MILITARY SPECIFICATION

TRANSMISSION GROUP DATA:

TRANSMITTER, DATA: T-1257/FSS-9(V)

AND

RECEIVER, DATA: R-1861/FSS-9(V)

This interim amendment is approved for use by U.S. Army Belvoir Research, Development, and Engineering Center with Military specification MIL-S-52877B, date 29 February 1980.

PAGE 1

2.1, lines 1-3, delete and substitute:

"2.1 Government documents.

2.1.1 Specifications and standards. Unless otherwise specified, the following specifications and standards of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation, form a part of this specification to the extent specified herein."

PAGE 2

2.1, under SPECIFICATIONS, MILITARY, delete:

"MIL-C-45662 - Calibration System Requirements.
* MIL-A-52878 - Alarm - Monitor Group."

* 2.1, under SPECIFICATIONS, MILITARY, add:

"MIL-M-52878 - Monitor Module, Status, ID-1921/FSS-9(V), Monitor Module, Alarm, ID-1922/FSS-9(V)."

2.1, under STANDARDS, MILITARY, delete:

"MIL-STD-1188 - Commercial Packaging of Supplies and Equipment."

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

2.1, under STANDARDS, MILITARY, after MIL-STD-810, add "1/".

2.1, under STANDARDS, MILITARY, add:

"MIL-STD-45662 - Calibration System Requirements."

2.1, add the following not at bottom of page.

"1/ The 'C' revision of MIL-STD-810 shall be used."

2.1, immediately above DRAWINGS, insert:

"2.1.2 Government drawings. The following Government drawings form a part of this specification to the extent specified herein."

2.1, immediately following parenthetical statement ending with "contracting officer.)" add:

"2.2 Other publications. The following document(s) form a part of this specification to the extent specified herein. The issues of the documents which are indicated as DoD adopted shall be the issue listed in the current DoDISS and the supplement thereto, if applicable.

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

D3951 - Standard Practice for Commercial Packaging.

(Application for copies should be addressed to the American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103.)"

PAGE 3

* 3.1.2, line 8, delete, "MIL-A-52878" and substitute, "MIL-M-52878."

PAGE 4

* 3.2 Line 1, delete "(preproduction model)".

* 3.3, delete in its entirety.

PAGE 7

* Table III. Output functional requirements., under definition of "Output level", delete "0 to -12 dBm in nominal 3 dBm steps." and substitute "-2 (+2.5, -2.0) dBm to -14 (+4.5, -4.0) dBm in four 3 (±.5) dBm steps."

* 3.6.1.5.6, lines 2 and 3, delete all after "shall be" and substitute "-4.0 dBm minimum, 0.5 dBm maximum under all operating conditions."

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:11Z
Check the source to verify that this is the current version before use.

3.6.2.5.3.1, delete and substitute:

"3.6.2.5.3.1 1270 Hz bandwidth. The receiver upper tone bandpass filter shall be centered at 1270 ±10 Hz. The 3 dB bandwidth shall be 70 ±10 Hz."

3.6.2.5.3.2, delete and substitute:

"3.6.2.5.3.2 1070 Hz bandwidth. The receiver lower tone bandpass filter shall be centered at 1070 ±10 Hz. The 3 dB bandwidth shall be 70 ±10 Hz."

* 3.6.2.5.4, line 2, delete and substitute "until the input signal level is less than -33 ±2 dBm (+2, -4 dBm during low temperature, high temperature, and humidity testing). Sensitivity of the 1070 Hz and 1270 Hz discriminator circuits shall be within 1 dB of each other".

3.6.2.5.5, delete and substitute:

* "3.6.2.5.5 Line fault sensitivity. The receiver line fault indicator LED shall illuminate when the input signal is +1.0 ±1.0 dBm (±3 dBm during low temperature, high temperature, and humidity testing) greater than the signal level at which base band dropout occurs."

After 3.11.1, add:

"3.12 Government-loaned property. When specified (see 6.2), the following property in the quantities specified (see 6.2) will be loaned by the Government (see 6.9) for testing of major components furnished separately.

Item No.	Description	Identification
1.	Receiver Data: R-1861/FSS-9(V)	TA13220E3500
2.	Transmitter Data: T-1257/FSS-9(V)	TA13220E3600

* 4.1.2, lines 2, 3, and 8, delete "preproduction model" and substitute "first article".

4.1.3, delete in its entirety.

* 4.2, delete and substitute:

"4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

a. First article inspection (see 4.3).
b. Quality conformance inspection (see 4.5).
c. Inspection of packaging (see 4.8)."

* 4.3, delete and substitute:

"4.3 First article inspection."

* 4.3.1, delete and substitute:

"4.3.1 First article examination. The first article shall be examined as specified in 4.6.1. Presence of one or more defects shall be cause for rejection."

* 4.3.2, delete and substitute:

"4.3.2 First article tests. The first article shall be subjected to the tests marked "X" in column 1 of table VII. Failure of any test shall be cause for rejection or for performing the disassembly inspection specified in 4.1.2."

* 4.4, delete in its entirety.

* 4.4.1, delete in its entirety.

PAGE 14

4.6.1, defect 101, delete in its entirety.

PAGE 15

4.6.2.1, line 3, delete "group shall" and substitute "group and major components when furnished separately shall".

4.6.2.1, line 5, after "24 hour period." add:

"Burn in of each data transmission group and major components furnished separately shall be accomplished in an operational configuration with not less than 25 dB attenuation in the transmission line. During each 24 hour period, the data receiver outputs shall be monitored for not less than a 12 hour period to insure the data transmitter and data receiver remain in synchronization with each other."

PAGE 16

* 4.6.2.2, under table VII, delete column for "preproduction." Change column heading "initial production" to "first article".

4.6.2.3, line 3, delete "MIL-C-45662" and substitute "MIL-STD-45662. Prior to testing data receivers furnished separately or as a part of data transmission groups, the A4 printed wiring board (PWB) shall be aligned using the alignment

Source: https://assist.dla.mil -- Downloaded: 2026t0-26T04:11Z
Check the source to verify that this is the currentversion before use.

procedure in the Appendix or equivalent procedure. The A4 PWB may be realigned after the 72-hour burn-in of the receiver but shall not be realigned during or between subsequent tests."

4.6.2.4, line 2, after "method" delete and substitute new sentence:

"Data transmitters or receivers furnished separately shall be connected with Government loaned units to form data transmission groups, and tested in accordance with the Appendix test method. Nonconformance to 3.6 shall constitute failure of this test."

PAGE 17

4.6.2.5, delete and substitute:

"4.6.2.5 Environmental. The data transmission group and major components (except code plugs) furnished separately shall be subjected to the following series of tests specified in MIL-STD-810C."

4.6.2.5.1, delete and substitute:

"4.6.2.5.1 Functional. Functional tests required during environmental tests shall be as specified in 4.6.2.4."

4.6.2.5.6, line 1, delete "Curve AX" and substitute "Curve AW".

PAGE 19

* 4.7, delete in its entirety.

* 4.7.1, delete in its entirety.

PAGE 20

4.8.1.3, delete defect 110 and substitute:

"110. Preservation method for data transmitters and data receivers not as specified for levels A and B."

Delete defect 111 and substitute:

"111. Unit containers for data transmitters and receivers not as specified for levels A and B."

5.1.3, line 2, delete "MIL-STD-1188" and substitute "ASTM D3951".

PAGE 21

5.2.3, line 3, delete "MIL-STD-1188" and substitute ASTM D3951".

5.3.2, lines 1 and 2, delete all after "in accordance with" and substitute:

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:11Z
Check the source to verify that this is the current version before use.

"ASTM D3951; in addition to the special marking specified in 5.3.3, weight and cube data shall be marked on the shipping container."

PAGE 22

* 6.2(b), delete in its entirety and substitute "Time frame required for submission of first article, and number required."

* 6.2(c), line 1, delete "preproduction model" and substitute "first article", line 3, delete "preproduction" and substitute "first article".

* 6.2(d), delete in its entirety.

6.2(e), line 1, delete "furnished a part" and substitute "furnished as a part".

After 6.2(h) add: "(i). When Government-loaned property is required (see 3.12). When applicable, the number of receivers or transmitters required (see 3.12)."

* 6.3, lines 1, 2, and 4, delete "preproduction" and substitute "first article".

PAGE 23

6.4.3, delete in its entirety.

6.5, delete in its entirety.

After 6.8, add: "6.9 Government-loaned property. The contracting officer should arrange to lend the receiver or transmitter specified in 3.12 when major components are procured separately."

Custodian:
Army - ME

Preparing activity:
Army - ME

Project 6350-A151

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

APPENDIX

PAGE 25

Under test apparatus, 2(b), delete and substitute:

"2(b) AC voltmeter - Hewlett Packard 400E or equivalent."

Under test apparatus, 2(c), delete and substitute:

"(c) Ammeter/voltmeter-Hewlett Packard 3435A or equivalent."

Under test apparatus, 2(d), delete "5332A" and substitute "5381A".

Under test appartus, after 2(i), add:

"(j) Oscilloscope, Tektronix Model 645 or equivalent."

PAGE 26

* Test preparation, 3(d) and 3(e), delete and substitute:

"(d) Connect data transmitter and data receiver to the test fixture and power supplies as shown in figure A-1. Connections shown as dashed lines shall not be made at this time.

(e) On test fixture, close S8 and S5, open S6 and S7, and set S1, S2, S3, and S4 to the off position."

* Test preparation, add:

"(f) Turn on power supplies and adjust each for a 20Vdc output."

* Test procedure, 4(c) (5): delete in its entirety.

PAGE 27

* Test procedure, 4(d) (2), line 2: change "between 0.0 and -3.0 dBm" to "between 0.5 and -4.0 dBm".

Test procedure, 4(g), delete and substitute:

"(g) Receiver Center Frequency, bandwidth, and channel sensitivity comparasion.

* (1) Close switch S8.
(2) Disconnect data transmitter connections to J7 and J8 of test fixture.
* (3) Connect signal generator through attenuator to J7 and J8 of test fixture. Connect AC voltmeter between J7 and J8.
(4) Tune the signal generator for an output of 1250 Hz ±5 Hz at a level of 0 dBm."

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

"(5) Set attenuator for a loss of 20 dB. AC voltmeter across J7 and J8 shall indicate -20 dB.

(6) Connect the AC voltmeter between TP-2 and TP-7 of the receiver A4 PWB.

(7) Increase the output frequency of the signal generator until the signal at TP-2 peaks. Frequency at which peak reading occurs shall be 1270 ±10 Hz. Peak reading at TP-2 shall be 7 ±2 dBm. Record this reading. Verify that the signal at TP-2 is not saturated by decreasing the input at J7-J8 by 3 dB, noting that the ac voltmeter reading decreases by 3 dB. If not, increase attenuation and repeat this step.

* (8) Adjust the signal generator frequency above 1270 Hz until the AC voltmeter indicates a reading 3 dB less than that recorded in step (6). Record this frequency F_H. Decrease the signal generator frequency below 1270 Hz until the ac voltmeter indicates a reading 3 dB less than that recorded in step (6). Record this frequency F_L. The 3 dB bandwidth of the 1270 Hz channel (F_H - F_L) shall be 70 ±10 Hz.

(9) Tune the signal generator for an output of 1050 ±5 Hz at a level of 0 dB, and set attenuator for 20 dB attenuation. Verify ac voltmeter reads -20 dBm at J7-J8.

(10) Connect the AC voltmeter between TP-1 and TP-7 of the A4 PWB.

(11) Increase the output frequency of the signal generator until the signal at TP-1 peaks. Frequency at which peak reading occurs shall be 1070 ±10 Hz. Peak reading at TP-1 shall be 7 ±2 dB. Record this reading. Verify the signal at TP-1 is not saturated, as in step (6).

(12) Adjust the signal generator above 1070 Hz until the AC voltmeter indicates a reading 3 dB less than that recorded in step (10). Record this frequency F_H. Decrease the signal generator frequency below 1070 until the ac voltmeter indicates a reading 3 dB less than that recorded in step (10). Record this frequency F_L. The 3 dB bandwidth of the 1070 Hz channel (F_H - F_L) shall be 70 ±10 Hz.

(13) Subtract the smaller of the two readings, obtained in steps (6) and (10) from the larger. The difference shall not exceed 1 dB.

(14) Remove signal generator and attenuator and reconnect data transmitter to J7 and J8 of test fixture."

PAGE 28

* Test procedure, 4(h), insert "(1) Set switches S1, S2, S3, and S4 to the Off position."

4(h) (5) change "LED shall turn off" to "LED 2 shall turn off."

Renumber existing 4(h) (1) thru 4(h) (7) as 4(h) (2) thru 4(h) (8).

* Test procedure, 4(i), delete and substitute:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

"(i) Data receiver low level line fault check and sensitivity test.

(1) Set switches S1, S2, S3, and S4 to the ON position.
(2) Disconnect transmission line from terminals J7 and J8.
(3) Insert the variable attenuator pad (600 ohms) into the transmission line between the data transmitter and terminals J7 and J8. Connect the ac voltmeter across TB2-8 and TB2-9 of the test fixture.
(4) Set the variable attenuator such that the input level to the receiver at TB2-8 and TB2-9 is -27 dBm.
(5) Resync system (press PB1 and wait 15 seconds).
(6) Reset line fault LED at data receiver, if lit.
(7) Allow system to operate for 30 seconds. System shall remain in synch and LED shall remain off.
(8) Connect oscilloscope to TP8 of receiver A-4 printed wiring board. Observe the baseband data, while also observing the data receiver line fault LED.
(9) Increase attenuation in 1 dB steps and record the ac voltmeter readings at the levels where the line fault LED illuminates and the baseband data drops out. Baseband data dropout shall occur at a reading on ac voltmeter of -33 ±2 dBm (±2, -4 dBm during high temperature, low temperature, and humidity tests). Line fault LED illumination shall occur at a reading ±1 dBm (±3 dBm during high temperature, low temperature, and humidity tests) greater than that at which baseband data dropout occured.
(10) Remove variable attenuator pad and oscilloscope and reconnect transmission line from data transmitter to terminals J7 and J8."

PAGE 29

* Test procedure 4(j): delete in its entirety.

PAGE 32

After Test Methods, add:

"ALIGNMENT PROCEDURE FOR THE DATA RECEIVER A4 PWB (DEMODULATOR)

1. PROCEDURE TO BE PERFORMED:

(a) Preamplifier alignment.
(b) 1270 Hz channel bandpass alignment.
(c) 1070 Hz channel bandpass alignment.
(d) Line fault sensitivity alignment.

2. TEST APPARATUS:

(a) Power supply - Power Design X-Mod-10, or equivalent.
(b) Signal generator - Wavetack Model 110, or equivalent.
(c) Voltmeter, AC - Hewlett-Packard 400E, or equivalent.
(d) Frequency counter - Hewlett-Packard 5381A, or equivalent.
(e) Oscilloscope - Tektronix Model 465, or equivalent.
(f) Attenuator - Hewlett-Packard 350D, or equivalent."

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:11Z
Check the source to verify that this is the currentversion before use.

"(g) Digital multimeter - Hewlett-Packard 3435A, or equivalent.
(h) Micellaneous cables and interconnects.
(i) Test fixture No. 1 - Demodulator Receiver. (See figures A-3 and A-4).
(j) Test fixture No. 2 - Demodulator Receiver. (See figures A-6 and A-7).

3. ALIGNMENT PREPARATION:

(a) Connect test equipment as shown in figure A-5 using the demodulator test fixture No. 1 of figures A-3 and A-4.
(b) Adjust power supply for 20 ±0.1 Vdc. Turn power supply off.
(c) Initially select values of 182K ohms for R11 and 182K ohms for R17 on the demodulator.
(d) Insert the demodulator into the test fixture and turn power supply on.
(e) Adjust signal generator to 1170 ±5 Hz and set the output to 0 dBm. With attenuator set to 0 dB, ac voltmeter should indicate 0 dB.
(f) Connect the multimeter between TP-6 and TP-7 (gnd) of the demodulator. Voltage shall be 19.4 ±0.1 Vdc.
(g) Connect the multimeter between TP-4 and TP-7 (gnd) of the demodulator. Voltage shall be 6.8 ±0.4 Vdc.
(h) Current as indicated on meter "M" of the test fixture shall be less than 7 mA.

4. ALIGNMENT PROCEDURE:

(a) Preamplifier alignment.

(1) Connect the AC voltmeter between TP-5 and TP-7 of the demodulator.
(2) Adjust the signal generator to 1270 ±5 Hz.
(3) Set the attenuator for -35 dB signal into the demodulator.
(4) A signal level of -23 ±2 dB shall be observed at TP-5. Record this level.
(5) Tune the signal generator to 1070 ±5 Hz. Insure signal level input to the demodulator is still at -35 dB. A signal level of -23 ±2 db shall be observed at TP-5. If the level observed differs by more than 0.5 dB of that recorded in step (4) adjust T1 until the level observed is within 0.5 dB. Repeat steps (2), (3), (4) and (5) until level observed in step 5 is within 0.5 dB of the level recorded in step (4) without T1 adjustment.

(b) 1270 Hz channel bandpass alignment.

(1) Adjust the signal generator to 1270 ±5 Hz and set the output to 0 dB.
(2) Connect the ac voltmeter between TP-2 and TP-7 of the demodulator.
(3) Connect the oscilloscope to TP-8 and its ground connection to J-5 of the test fixture.
(4) Set the attenuator for a loss of 20 dB.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

(5) Adjust R21 on the demodulator for a peak signal on the ac voltmeter (+7 ±2 dB). Record this reading.

Note: The oscilloscope will indicate a positive (+) voltage of 8.5 ±1 Vdc.

(6) Increase the signal generator frequency until the ac voltmeter at TP-2 drops -3 dBm from the reading in step (5). The frequency at this point will be called F_H. Record this frequency.
(7) Decrease the signal generator frequency until the ac voltmeter at TP-2 drops -3 dBm from the reading in step (5). The frequency at this point will be called F_L. Record this frequency.
(8) Subtract the two frequencies $f_H - F_L$. The difference is the bandwidth of the 1270 Hz channel and shall be 70 ±10 Hz.
(9) If the bandwidth in step (8) is out of tolerance reselect R17 and repeat steps (1) through (8).

(c) 1070 Hz channel bandpass alignment.

(1) Adjust the signal generator to 1070 ±5 Hz and set the output to 0 dB.
(2) Connect the ac voltmeter between TP-1 and TP-7.
(3) Retain the oscilloscope and attenuator as specified in paragraph b.
(4) Adjust R15 on the demodulator for a peak signal on the ac voltmeter (+8 ±1 dB). Record this reading.

NOTE: The oscilloscope will indicate a 0 voltage.

(5) Increase the signal generator frequency until the ac voltmeter drops -3 dB from the reading obtained in step (4). Record this frequency F_H.
(6) Decrease the signal generator frequency until the ac voltmeter drops -3 dB from the reading obtained in step (4). Record this frequency F_L.
(7) Subtract the two frequencies $F_H - F_L$. The difference is the bandwidth of the 1070 Hz channel and shall be 70 ±10 Hz.
(8) If the bandwidth in step (7) is out of tolerance reselect R11 and repeat steps (1) through (7).

(d) Line fault alignment.

(1) Replace signal generator in figure A-5 with demodulator test fixture No. 2 of figures A6 and A7. Apply 20 ±0.1 Vdc across J1 and J2 of the fixture.
(2) Set attenuator for -28 dBm signal into the demodulator.
(3) With oscilloscope connected to TP-8 on the demodulator observe a square wave with a period of 83.3 ±1 millisecond and an amplitude of 9 ±1 V peak to peak.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

(4) While observing oscilloscope increase attenuation in 1 dB steps until base band data (square wave) at TP-8 drops out. Base band dropout shall occur at -33 ±2 dB as indicated on the attenuator. Record this level.

(5) Connect the oscilloscope to TP-3 on the demodulator.

* (6) Set the attenuator to 25 dB (-25 dBm signal into the demodulator).

(7) Adjust R35 on the demodulator to its extreme clockwise position; LED-1 shall illuminate; oscilloscope output shall go high (18 ±1 Vdc).

* (8) Increase the attenuator until its setting is 1 dB less than the level recorded in step 4.

(9) While observing LED-1, adjust R35 counter clockwise slowly until the LED goes out. Oscilloscope will indicate a low (0 to 1 Vdc).

(10) To check for proper setting of R35 decrease attenuator by 1 dB. LED-1 shall illuminate and TP-3 shall go high. Increase attenuator by 1 dB and observe LED-1 shall go out and TP-3 shall go low.

NOTE: Demodulator is now properly aligned and ready for functional tests in data receiver."

PAGE 33

Figure A-1, delete and substitute new figure A-1.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:11Z
Check the source to verify that this is the currentversion before use.

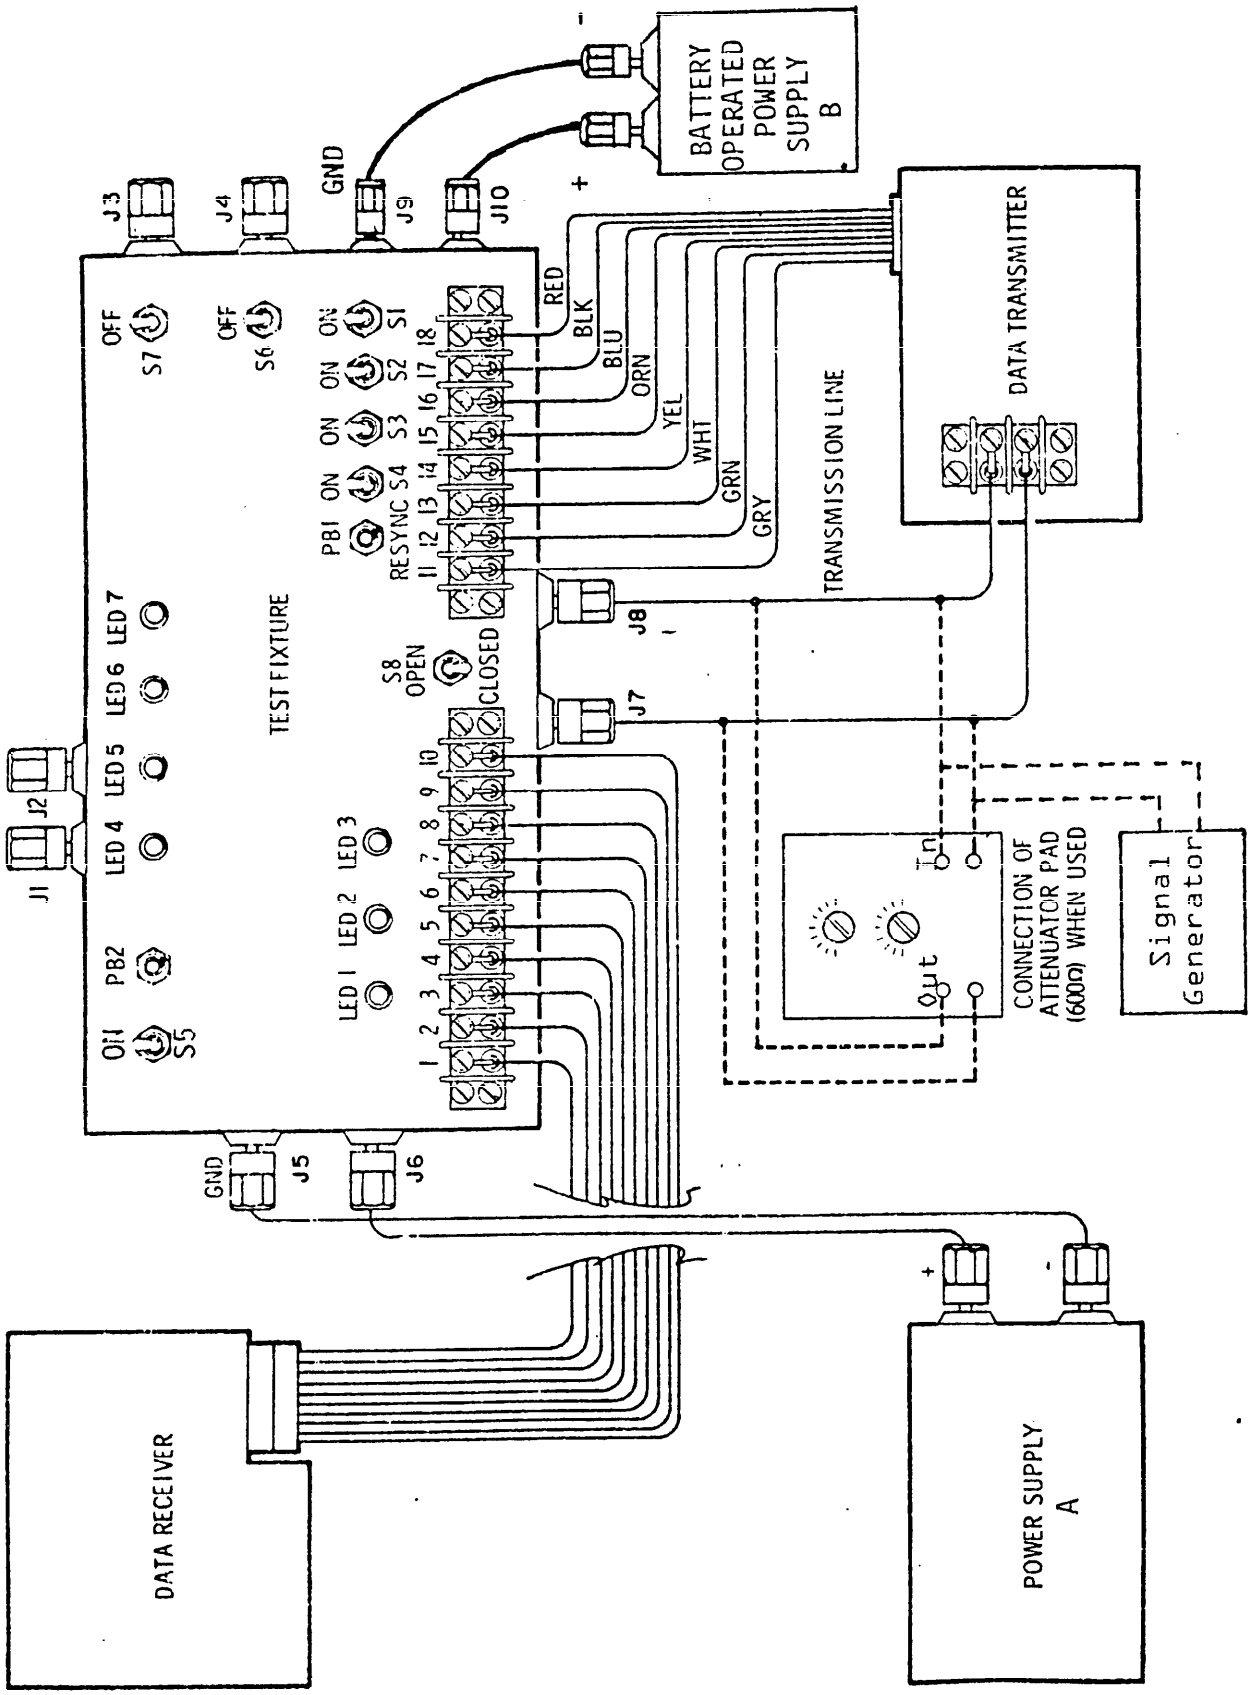


FIGURE A-1. Test fixture and test setup. X-3157C

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.


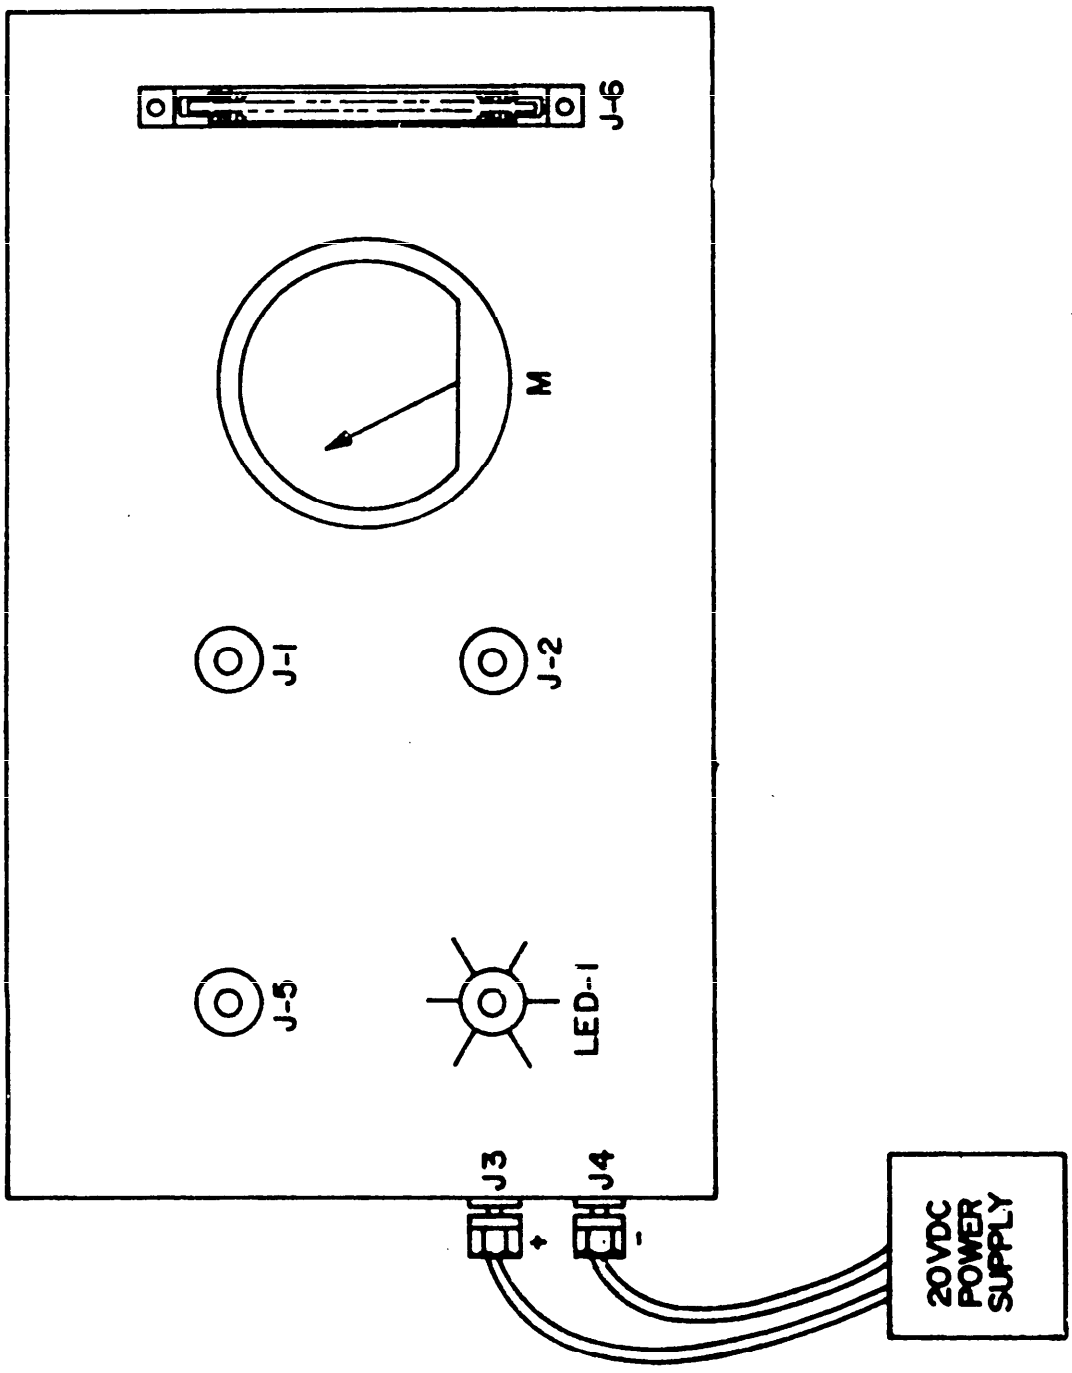


FIGURE A-3. Receiver demodulator test fixture no.1.

X-3760

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

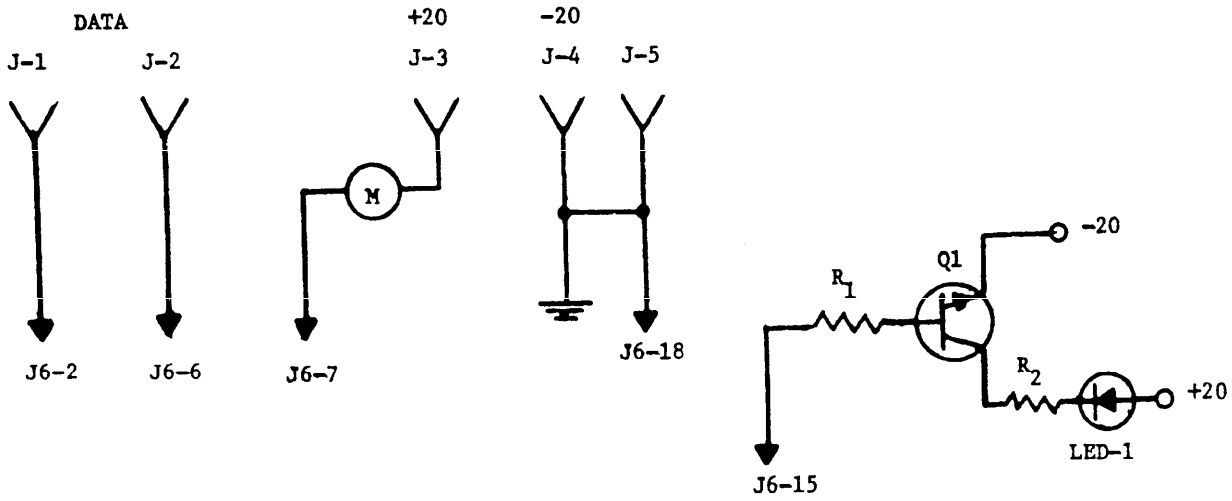

Parts List

Reference Designation	Description
J-6	Connector, TRW #252-18-30-160
J-1 thru J-5	Jack, Banana
Q1	Transistor, 2N2222
R_1	Resistor, 24K, 1/2 w, 5%, carbon
R_2	Resistor, 2.2K, 1/2 w, 5%, carbon
LED-1	Diode, LED, Dialight #558-0101-001
-	Cabinet for mounting above, any convenient size
M	Meter, DC milliamp, 0-20 MA F.S.

FIGURE A-4. Test fixture no. 1 parts list

X-3761

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.


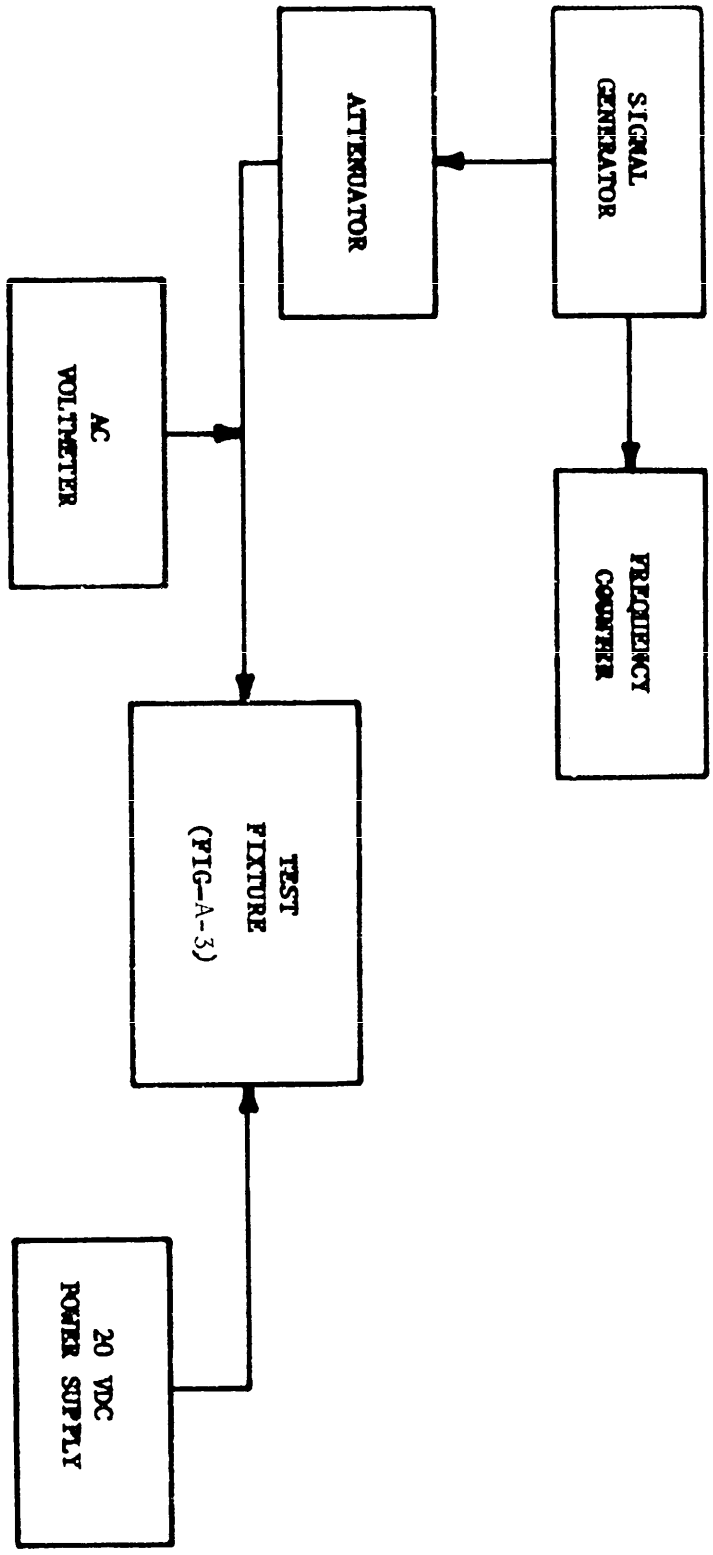


FIGURE A-5. Receiver demodulator test setup.

X-3762

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

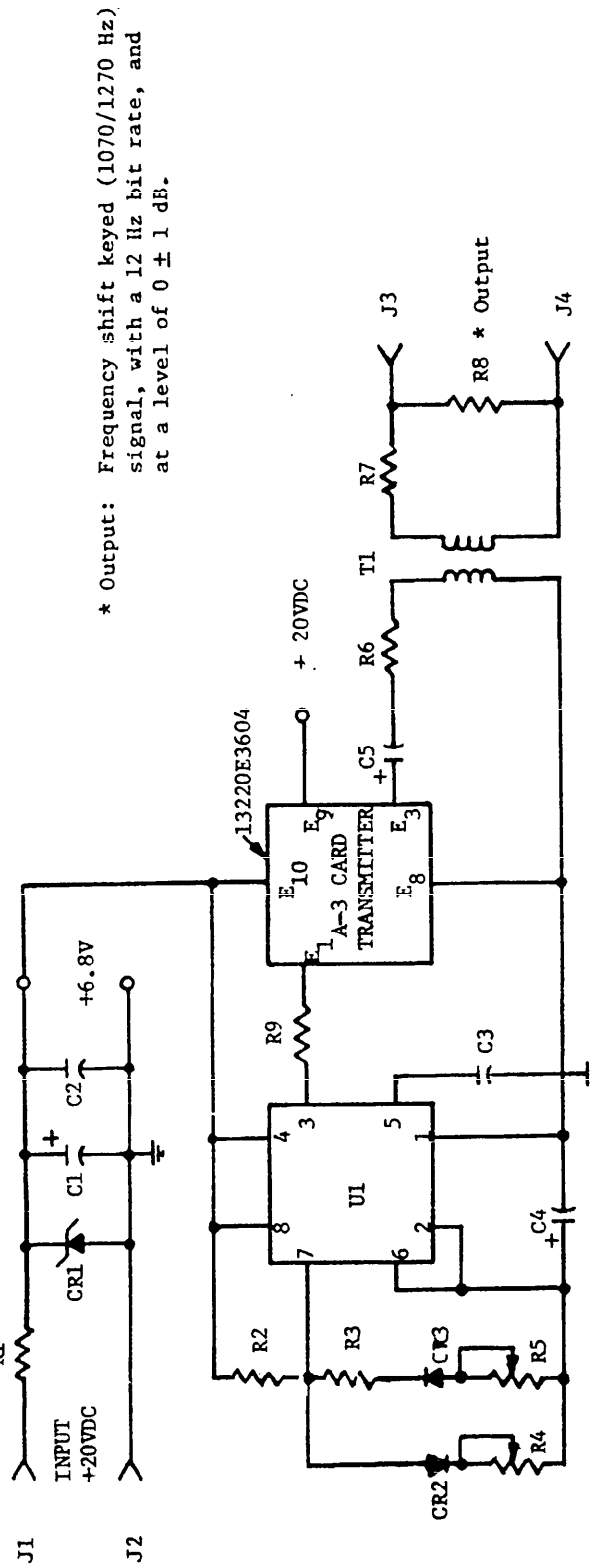

Note: 1. See Figure 3A for component values.
2. Adjust R4 for 41.66 ± 0.5 msec (positive portion only) at U1, pin 3.
3. Adjust R5 for 83.33 ± 1 msec (total period) at U1, pin 3.

FIGURE A-6. Receiver demodulator fixture no.2 schematic diagram.

X-3763

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.

Reference Designation	Description
C1	Capacitor, Electrolytic, 47 uf ± 10%, 35 Vdc
C2	Capacitor, Disc, Ceramic, .01 uf ± 5%, 50 Vdc
C3	Capacitor, Disc, Ceramic, .01 uf ± 5%, 50 Vdc
C4	Capacitor, Tantalum, 1.0 uf ± 5%, 35 Vdc
C5	Capacitor, Electrolytic, 1.0 uf ± 5%, 15 Vdc
CR1	Diode, IN754A
CR2	Diode, IN914
CR3	Diode, IN914
R1	Resistor, 500 ohm ± 5%, 1W
R2	Resistor, 27,000 ohm ± 5%, 1/4W
R3	Resistor, 27,000 ohm ± 5%, 1/4W
R4	Resistor, Variable, 50,000 ohm ± 5%, 1/4W
R5	Resistor, Variable, 50,000 ohm ± 5%, 1/4W
R6	Resistor, 510 ohm ± 5%, 1/4W
R7	Resistor, 270 ohm ± 5%, 1/4W
R8	Resistor, 290 ohm ± 5%, 1/4W
R9	Resistor, 47,000 ohm ± 5%, 1/4W
T1	Transformer, Triad, TY304P
U1	Integrated Circuit, NE 555
Trans	A3 Card - 13220E3604
J1 to J4	Jack, Banana
	Cabinet, suitable for mounting above components

FIGURE A-7. Test fixture no. 2 parts list.

X-3764

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:11Z
Check the source to verify that this is the current version before use.