MILITARY SPECIFICATION

FUZE, BOMB: MECHANICAL NOSE, THERMALLY PROTECTED, M904E4, ASSEMBLY

1. SCOPE

1.1 This specification covers the quality assurance provisions and special requirements not covered by the drawings for loading component metal parts and the loading, assembling and packing of one type of fuze designated as Fuze, Bomb: Mechanical Nose, Thermally Protected, M904E4.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposals form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-P-116 - Preservation, Method of
MIL-D-1000 - Drawings, Engineering and Associated Lists
MIL-A-2550 - Ammunition and Special Weapons, General Specification for
MIL-C-45662 - Calibration System Requirements
MIL-R-46204 - Relay, XM9, Loading, Assembling and Packing
MIL-D-46402 - Delay or Non-Delay Element, M9, Loading, Assembling and Packing
MIL-D-46207 - Detonator, Flash, M35, Loading, Assembling and Packing
MIL-F-50237 - Fuze, Bomb: M904E3, Less Delay Element, Loading, Assembling and Packing

MATERIAL

AS-2670 - Molding Compound, Rubber, Butadiene Acrylonitrile with Phenolic Resin and Boric Acid

FSC: 1325

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

STANDARDS

MILITARY

MIL-STD-100 - Engineering Drawing Practices
MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-109 - Quality Assurance Terms and Definitions
MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-650 - Explosive Sampling, Inspection and Testing
MIL-STD-1167 - Ammunition Data Cards
MIL-STD-1168 - Lot Numbering of Ammunition
MIL-STD-1235 - Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes
ASTM-A283-70 - Low and Intermediate Tensile Strength Carbon Steel Plate of Structural Quality
ASTM-D1692 - Flammability of Plastic Sheeting and Cellular Plastics
ASTM-D2044 - Moisture Content in Paper and Paperboard by Toluene Distillation

DRAWINGS

US ARMY MUNITIONS COMMAND

9272080 - Fuze, Bomb: Mechanical Nose, Thermally Protected, M904E4, Assembly
9239084 - Fuze, Bomb, M904E3, Loading Assembly Less Delay

NAVAL AIR SYSTEMS COMMAND

333 AS110 - Container, Shipping and Storage - Fuze, M904 Type, Thermally Protected, Assembly

PUBLICATIONS

AMCR 385-224 - AMC Safety Manual
MIL-HDBK-204 - Inspection Equipment Design
Code of Federal Regulations, Title 49 - Transportation, Parts 1-199

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

(Copies of specifications, standards, drawings and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer.)

3. REQUIREMENTS

3.1 Material. - Materials and parts shall be in accordance with applicable drawings and specifications.

3.2 Relay, XM9. - The XM9 relays used in loading these fuzes shall comply with Specification MIL-R-46204 and the requirements of this specification.

3.3 Detonator, M35. - The M35 flash detonator used in loading these fuzes shall comply with Specification MIL-D-46207 and the requirements of this specification.

3.3.1 Detonator Deterioration. - Detonators scheduled for use in loading these fuzes shall not be used if two (2) or more years have elapsed since the last Government acceptance test or if the detonator or packing/packaging exhibits evidence of having been subjected to adverse environmental conditions, however brief, until tested for possible deterioration, as specified in Specification MIL-D-46207, and the quality verified as acceptable (see 6.4).

3.4 Filler Discs. - The felt filler discs used in loading these fuzes shall not exceed the thickness requirement of the applicable drawing at the time and place of loading the fuzes.

3.5 Fuzes. - The fuze assemblies shall comply with all requirements specified on Drawings (dwg.) 9272080 and 9239084 and with all requirements specified in applicable specifications and the requirements of this specification.

3.6 Explosive Functioning. - The completely loaded fuze assembly (9272080), including Relay Assembly, XM9 (8838198), Detonator, M35 (8797789) assembled to Rotor Assembly (9240873), Lead Cup Assembly (9240957), Booster Cup Assembly (9240876) and Non-Delay Element, M9 (8838197), when held vertically with the booster end down and a nine (9) pound plus or minus 0.1 pound weight (1.0 inch diameter impact surface) dropped so that the 1.0 inch diameter flat end strikes the center of the vane from a height of 31 inches minus one (1) inch, shall not fail to cause initiation of the Non-Delay Element, M9; the Relay, XM9;

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

the Detonator, M35 in the Rotor Assembly; the Lead Cup Assembly and the Booster Cup Assembly high order, as evidenced by the booster assembly causing an indentation of 0.100 inch minimum in mild steel plate when measured with a probe 0.06 inch in diameter having a spherical radius of 0.03 inch minimum.

3.7 Workmanship. - All assemblies shall be fabricated and finished in a thorough, workmanlike manner and loading, assembling and packing shall be performed in accordance with best practices. Parts utilized shall be free of dirt, grease, corrosion products and other foreign material. The cleaning method, when used, shall not be injurious to any part or explosive, nor shall the parts or explosive be contaminated by the cleaning agent. Surface coatings shall not be damaged except for a few slight scratches not exposing base material. All required markings shall be neat and sharply defined. All adhesives used shall be properly mixed, used and cured before shipment or packaging. No components, subassemblies or assemblies shall be used in fabricating the final assemblies unless they are identifiable as to orgin, condition and acceptability. Incomplete or defective components, subassemblies and assemblies shall not be explosively loaded.

3.8 First Article Inspection. - This specification makes provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.9 Safety. - Compliance with the requirements of AMC Regulation 385-224 (Safety Manual) for handling, loading, assembling, inspection, testing, packing and packaging, shipment and storage of the product covered by this specification is mandatory.

3.10 Packing Supports. - The molded polystyrene foam packing supports shall not contain moisture in excess of 0.4 percent, shall not exhibit an electrical potential in excess of 2,000 volts when rubbed with a catskin, and shall be self extinguishing (flammability) in accordance with Standard ASTM-D1692.

3.11 Tetryl Booster Pellets. - Tetryl booster pellets used in loading these fuzes shall comply with Specification MIL-P-46464 and the requirements of this specification.

3.12 Non-Delay Element, M9. - The M9 non-delays used in loading these fuzes shall comply with Specification MIL-D-46402 and the requirements of this specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for Inspection. - Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements. Reference shall be made to Standard MIL-STD-109 in order to define terms used herein. The provisions of Specification MIL-A-2550 shall apply.

4.1.1 Submission of Product. - At the time each completed lot of items deliverable under the contract is submitted to the Government for acceptance, the contractor shall supply the following information accompanied by a certificate which attests that the information provided is correct and applicable to the product being submitted:

a. A statement that the lot complies with all of the quality assurance provisions specified in this specification.
b. Drawing and specification number and date, together with identification and date of changes thereto.
c. A statement that all material purchased by the contractor meets requirements, when such material is controlled by Government or commercial specifications referenced in any of the contractual documents, and that certificates of conformance are on file and available for review.
d. Number of items in the lot.
e. Date submitted.

The certificate shall be signed by a responsible agent of the certifying organization. The initial certificate submitted shall be substantiated by evidence of the agent's authority to bind his principal. Substantiation of the agent's authority will not be required with subsequent certificates unless, during the course of the contract, this authority is vested in another agent of the certifying organization.

4.2 First Article Inspection

4.2.1 Submission. - Prior to initiating regular production, the contractor shall submit a first article sample to a Govern-

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

ment approved facility as designated by the Contracting Officer (see 6.6) for evaluation in accordance with the provisions of 4.2.2. The first article sample shall consist of:

50 complete loaded fuzes
10 booster pellets
20 preformed lead cup pellets
20 loaded lead cup assemblies

The first article sample shall consist of material that has been produced by the contractor or furnished by a supplier and manufactured using the same production processes, procedures and equipment which will be used in fulfilling the contract. All materials, including packaging and packing, shall be obtained from the same sources of supply as will be used in regular production. The sample shall be accompanied by statements of findings for materials and tests performed by the contractor. The first article sample, or portion thereof as directed by the Contracting Officer, shall also be submitted whenever there is a lapse in production for a period in excess of 90 days or whenever a change occurs in manufacturing process, material used, drawing, specification or source of supply so as to significantly affect product uniformity as determined by the Government. Prior to submission, the contractor shall inspect the sample to the degree necessary to assure that it conforms to the requirements of the contract and submit a record of this inspection with the sample. A sample containing known defects shall not be submitted unless specifically authorized by the Contracting Officer.

4.2.2 Inspections to be Performed. - Assemblies and components will be examined and tested by the Government to determine conformance with 4.3.2 and 4.3.3.1 of this specification and any or all requirements of the applicable drawings.

4.2.3 Rejection. - If the first article sample or components fail to comply with any of the applicable requirements, the first article sample shall be rejected. The Government reserves the right to terminate its inspection upon observing any non-conformance of the sample to the specified requirements. In the event of rejection, the Government reserves the right to require the contractor to take corrective action and submit a new first article sample or portion thereof. Until a first article sample is accepted, the contractor is in no way authorized by the

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

Government to initiate regular production unless otherwise directed by the Contracting Officer.

4.3 Inspection Provisions

4.3.1 Lot Formation. - The term "inspection lot" as used throughout this specification is defined as an essentially homogeneous collection of units of product from which a representative sample is drawn and inspected to determine conformance with applicable requirements. The sample selected shall represent only that quantity of units from which the sample was drawn and shall not be construed to represent any prior or subsequent quantities presented for inspection. Homogeneity shall be considered to exist provided the inspection lot has been produced by one manufacturer, in one unchanged process, in accordance with the same drawing, same drawing revision, same specification and same specification revision and complies with the provisions for submission of product as specified in MIL-STD-105. Changes to the process, specification or drawing not affecting safety, performance, interchangeability or storage, as determined by the Government, shall not be deemed to alter the homogeneity of an inspection lot. All material submitted for inspection in accordance with this specification shall comply with the homogeneity criteria specified herein regardless of the type of sampling procedure which is being applied to determine conformance with requirements. Lot numbering, as required, shall be in accordance with MIL-STD-1168. Each inspection lot of loaded fuzes shall contain:

a. Metal parts assemblies from one manufacturer bearing the same lot interfix number.
b. Lead cups from one manufacturer bearing the same lot interfix number.
c. Booster discs from one manufacturer bearing the same lot interfix number.
d. Booster cups from one manufacturer bearing the same lot interfix number.
e. Rotor cover discs from one manufacturer bearing the same lot interfix number.
f. Rotor detent springs from one manufacturer bearing the same lot interfix number.
g. Rotor detents from one manufacturer bearing the same lot interfix number.
h. Rotor torque springs from one manufacturer bearing the same lot interfix number.
i. Rotor assemblies from one manufacturer bearing the same lot interfix number.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

j. Detonators from one manufacturer bearing the same lot interfix number.

k. Tetryl from one manufacturer bearing the same lot interfix number for the lead charge.

l. Tetryl from one manufacturer bearing the same lot interfix number for the booster pellets.

m. Relay assemblies from one manufacturer bearing the same lot interfix number.

n. Filler discs from one manufacturer bearing the same lot interfix number.

o. Thermal protection sleeves from one manufacturer.

p. Non-delay elements from one manufacturer bearing the same lot interfix number.

NOTE: It is neither required nor intended that the same manufacturer manufacture all of the components required to assemble and load a complete lot of fuzes. The requirement of lot homogeneity is satisfied by conforming to the above listed conditions while utilizing the product of any acceptable source.

4.3.2 Examination. - The examinations listed in the following subparagraphs shall be performed on inspection lots (see 4.3.1) of the components or assemblies designated in the applicable paragraph headings. Inspection for Critical Defects (and Major Defects, when so specified) shall be 100 percent. Sampling plans for Major and Minor Defects shall be in accordance with MIL-STD-105 except that continuous sampling plans in accordance with MIL-STD-1235 may be used if approved by the Government. Instead of applying the AQL's designated herein to the groups of Major and Minor Defects listed, the contractor may elect to apply AQL's to individual defects using an AQL of 0.40 percent for each Major Defect and an AQL of 0.65 percent for each Minor Defect. When this method is elected, it shall be applied to all of the Major and Minor Defects listed in the applicable subparagraphs of this section, except where 100 percent inspection is specified, and be documented as part of the contractor's inspection system. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.3.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

4.3.2.1 Assembly, Lead Cup (see dwg. 9240957 covering a detail of dwg. 9240876).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Cup punctured, ruptured or cut to the extent that explosive is exposed	Visual	01001
Major:	AQL 0.40 Percent		
101.	Height of charge	Gage	01002
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.7)	Visual	01003

4.3.2.2 Assembly, Booster Cup, after Assembly of Lead Cup, prior to Loading Booster Pellet (see dwg. 9240876 covering a detail of dwg. 9239084).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.40 Percent		
101.	Lead charge missing, flaking or disintegrating ..	Visual	02001
102.	Crimp of lead cup assembly incomplete	Visual	02002
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.7)	Visual	02003

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

4.3.2.3 Assembly, Booster Cup, prior to Assembly of Booster Disc (see dwg. 9240876 covering a detail of dwg. 9239084).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Assembly incomplete	Visual	03001
102.	Pellet chipped or cracked ..	Visual	03002
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.7)	Visual	03003

4.3.2.4 Assembly, Booster Cup (see dwg. 9240876 covering a detail of dwg. 9239084).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Booster disc damaged (punctured or torn)	Visual	04001
Major:	AQL 0.40 Percent		
101.	Crimp incomplete, inadequate or cracked	Visual	04002
102.	Evidence of poor workmanship (see 3.7)	Visual	04003
Minor:	None defined.		

4.3.2.5 Assembly, Rotor (see dwg. 9240873 covering a detail of dwg. 9239084).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Detonator punctured, ruptured or cut to the extent that explosive is exposed ..	Visual	05001

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

2.	Letter "A" missing, incomplete, damaged, incorrect color or incorrectly located (see 6.7)	Visual	05002
3.	Fluorescent red-orange paint background missing, incomplete, incorrect color or damaged	Visual	05003
Major:	AQL 0.040 Percent		
101.	Thickness, max.	Visual	05004
Major:	AQL 0.40 Percent		
102.	Detonator inverted, missing or incompletely crimped	Visual	05005
103.	Assembly or component damaged	Visual	05006
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.7)	Visual	05007

4.3.2.6 Sleeve (see dwg. 9272081 covering a detail of dwg. 9272080).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.50 Percent		
101.	True position of stop screw cut-out	Gage	06001
102.	Width of stop screw cut-out, max.	Gage	06002
103.	Diameter of index lock hole, min.	Gage	06003
104.	True position of index lock hole	Gage	06004
105.	Diameter of striker body viewing window hole, min. ..	Gage	06005
106.	True position of striker body viewing window hole ...	Gage	06006

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

107.	Diameter of stop screw hole, min.	Gage	06007
108.	True position of stop screw hole	Gage	06008
109.	Radius of arming wire cut-out, min.	Gage	06009
110.	True position of arming wire cut-out	Gage	06010
111.	Width of index lock cut-out, max.	Gage	06011
112.	True position of index lock cut-out	Gage	06012
113.	Large outside diameter	Gage	06013
114.	True position of large outside diameter	Gage	06014
115.	Inside diameter	Gage	06015
116.	Marking incorrect, incomplete or illegible	Visual	06016
Minor: AQL 0.65 Percent			
201.	Evidence of poor workmanship (see 3.7)	Visual	06017

4.3.2.7 Assembly, Fuze, Bomb, M904E4, prior to Application of Adhesive (see Sheet 2 of dwg. 9272080 covering a detail of dwg. 9272080).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major: AQL 0.40 Percent			
101.	Evidence of foreign material on fuze body	Visual	07001
Minor: None defined.			

4.3.2.8 Assembly, Fuze, Bomb, M904E4, after Application of Adhesive (see Sheet 2 of dwg. 9272080 covering a detail of dwg. 9272080).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

Major:	AQL 0.40 Percent		
101.	Inadequate amount of adhesive applied to fuze body ..	Visual	08001
Minor:	None defined.		

4.3.2.9 Assembly, Fuze, Bomb, M904E4, after Assembly of Sleeve (see dwg. 9272080).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 Percent		
101.	Window hole of sleeve not aligned with window of fuze	Visual	09001
102.	Index lock pin hole of sleeve not aligned with index lock pin of fuze	Visual	09002
103.	Space between fuze body chamfer and back end of sleeve not filled with adhesive	Visual	09003
104.	Adhesive on window, index lock pin, stop screw or threads	Visual	09004
105.	Sleeve loose	Manual	09005
Minor:	AQL 1.00 Percent		
201.	Marking incorrect, incomplete or illegible	Visual	09006
202.	Evidence of poor workmanship (see 3.7)	Visual	09007

4.3.2.10 Assembly, Fuze, Bomb, M904E4, Prior to Assembly of Rotor Assembly (see dwg. 9239084).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Relay punctured, torn or ruptured to the extent that explosive is visible	Visual	10001

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Major:	AQL 1.00 Percent		
101.	Relay missing, inverted, damaged or incompletely crimped (not complete 360 degrees)	Visual	10002
102.	Evidence of poor workmanship in rotor cavity (see 3.7) ..	Visual	10003
Minor:	None defined.		

4.3.2.11 Assembly, Fuze, Bomb, M904E4, Prior to Assembly of Booster Cup Assembly (see dwg. 9239084).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Rotor assembly missing	Visual	11001
2.	Rotor cover disc missing or damaged (punctured or torn)	Visual	11002
Major:	100 Percent Inspection Required		
101.	One or more components protrude above rotor cavity ...	Straight-Edge	11003
Major:	AQL 0.40 Percent		
102.	Rotor detent or rotor detent spring missing or incorrectly assembled (not torqued)	Visual	11004
103.	Rotor torque spring missing or incorrectly assembled	Visual	11005
Minor:	AQL 0.65 Percent		
201.	Evidence of poor workmanship (see 3.7)	Visual	11006

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

4.3.2.12 Assembly, Fuze, Bomb, M904E4, Loading (see dwg. 9239084).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Fuze partially or completely armed (red marker or letter "A", rotor assembly is visible through rotor cavity window) or window damaged in any manner which will prevent positive observation of the position of the rotor when the rotor is in the armed position	Visual	12001
2.	Seal wire missing, improperly assembled or damaged	Visual	12002
3.	White numeral in green background not visible through striker body assembly observation window at either the 6 or 18 second fuze functioning time setting	Visual	12003
4.	Safety tag missing or illegible	Visual	12004
Major:	AQL 1.00 Percent		
101.	White numerals on green background of striker assembly misleading or unidentifiable	Visual	12005
102.	Booster assembly loose (sealing compound missing or inadequate)	Manual	12006
103.	Fuze setting incorrect	Visual	12007
104.	Window missing or damaged (cracked or punctured)	Visual	12008
105.	Vane assembly damaged or bent	Visual	12009
106.	Warning tag torn or defaced.	Visual	12010
107.	Index locking pin missing or bent	Visual	12011

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

108.	Stop screw missing	Visual	12012
109.	Body thread damaged	Visual	12013
110.	Delay element lock pin loose or missing	Visual-Manual	12014
111.	Non-delay element missing or improperly assembled	Visual-Manual	12015
Minor:	AQL 1.50 Percent		
201.	Protective coating damaged (excluding slight scratches and loader's stamping)	Visual	12016
202.	Evidence of poor workmanship (see 3.7)	Visual	12017

4.3.2.13 Package, Intermediate, Prior to Assembly into Body (see dwg. 333AS111).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	Desiccant inadequate, missing, improperly positioned or insecure	Visual-Manual	13001
Minor:	None defined.		

4.3.2.14 Package, Intermediate (see dwg. 333AS111 covering a detail of dwg. 333AS110).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	No space for subsequent seals	Visual	14001
102.	Fuze missing	Visual-Balance	14002
Minor:	AQL 0.65 Percent		
201.	Marking missing, misleading or unidentifiable ..	Visual	14003

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

NOTE: Paragraph 4.3.2.14, Major 102. - Visual examination for presence of all required fuzes may be substantiated by establishing a nominal weight of known complete intermediate packs, and this weight plus or minus 10 percent of the weight of one fuze shall be the tolerance for this determination.

4.3.2.15 Container, Shipping and Storage (see dwg. 333AS110).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 Percent		
101.	FSN number missing or misleading	Visual	15001
102.	Hardware missing, broken or loose	Visual-Manual	15002
Minor:	AQL 1.50 Percent		
201.	Contents loose (when tilted)	Manual	15003
202.	Marking missing, misleading or unidentifiable	Visual	15004
203.	Car seal missing, unsealed or improperly positioned ...	Visual	15005

4.3.3 Testing

4.3.3.1 First Article Sample Testing

4.3.3.1.1 Specific Gravity of Booster Pellet (when applicable as specified in Note 4 - dwg. 8839361) (see Test Method 4.4.2) - Code No. 17001.

4.3.3.1.2 Specific Gravity of Lead Charge

4.3.3.1.2.1 Preformed Pellet (see dwg. 9240957 and Test Method 4.4.3.1) - Code No. 18001.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

4.3.3.1.2.2 Reconsolidated Pellet in Lead Cup (see dwg. 9240957 and Test Method 4.4.3.2) - Code No. 18002.

4.3.3.1.3 Explosive Functioning (see 3.6 and Test Method 4.4.6), Failure to Arm - Code No. 12018, Failure to Function - Code No. 12019 and Inadequate Indentation Code No. 12020.

4.3.3.2 Production Testing

4.3.3.2.1 Binder-Lubricant Content of Tetryl Lead Cup Charge (see dwg. 9240957) - Code No. 16001 - Major Defect.- A sample of 20 grams shall be taken from each batch of lead cup charge material. Determination shall be performed as specified in 4.4.1. The represented batch shall be rejected if the binder-lubricant content exceeds the specified requirement.

4.3.3.2.2 Specific Gravity of Booster Pellet (when applicable as specified in Note 4 - dwg. 8839361) - Major Defect - Code No. 17001. - A sample of 10 pellets shall be selected from each batch and tested as specified in 4.4.2. The represented batch shall be rejected if one or more pellets are classed defective.

4.3.3.2.3 Specific Gravity of Lead Charge. - For the following tests, the batch, as defined in 4.3.3.2.1, shall retain the identity assigned therein.

4.3.3.2.3.1 Preformed Pellet (see dwg. 9240957) - Major Defect - Code No. 18001. - A sample of 20 units shall be selected from each batch for this determination which shall be performed as specified in 4.4.3.1. If one or more samples fail to conform to the specified requirement, the batch shall be rejected.

4.3.3.2.3.2 Reconsolidated Pellet in Lead Cup (see dwg. 9240957) - Major Defect - Code No. 18002. - A sample of 20 loaded lead cups shall be selected from each batch for this determination which shall be performed as specified in 4.4.3.2. If one or more samples fail to conform to the specified requirement, the batch shall be rejected.

4.3.3.2.4 Thickness of Filler Disc (see dwg. 8839360 and 3.4) - Major Defect - Code No. 19001. - A sample of five (5) discs shall be selected from each container (the

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

smallest individual level of packaging) and the thickness measured as specified in 4.4.4. The container of discs shall be rejected and scrapped if the thickness exceeds the drawing requirement.

4.3.3.2.5 Rotor Cover Disc in Fuze Assembly (see dwg. 9239084), Disc missing - Critical Defect - Code No. 20001; and more than one (1) disc - Major Defect - Code No. 09002.- The examination shall be performed 100 percent unless equipment described in 4.4.5 or equivalent is utilized in a foolproof manner.

4.3.3.2.6 Material (see dwg. 9272081) - Critical Defect - Code No. 06018 and Curing Time (see dwg. 9272081) Critical Defect - Code No. 06019. - A certificate of conformance, including actual test results, for each batch of material used in the manufacture of each lot of sleeves shall accompany each lot of sleeves supplied to the prime contractor. Testing for conformance of material shall be performed in accordance with Material Specification AS2670. The lot of sleeves shall be rejected and shall not be used in the manufacture of the final fuze assembly if the certificate of conformance does not accompany each lot, or if the test results show that the material does not conform to the requirements of Specification AS2670. Additionally, each lot of sleeves shall be accompanied by a certificate which attests to the curing time and pressure used in the curing of each sleeve. The lot of sleeves shall be rejected and shall not be used in the manufacture of the final fuze assembly if the certificate shows that the curing time and pressure do not comply with the specified requirements.

4.3.3.2.7 Explosive Functioning (see 3.6), Failure to arm - Code No. 12018, Failure to function - Code No. 12019; and inadequate indentation - Code No. 12020 - Major Defect. - A sample of 35 fuze assemblies shall be selected from each lot for this test which shall be performed as specified in 4.4.6 using the applicable test equipment of 4.3.4. The lot shall be rejected if two or more assemblies are classed defective. If only one assembly is found defective, a second sample of 35 shall be selected from the lot and tested. The lot shall be rejected if one or more assemblies are classed defective in the second sample.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

4.3.3.2.8 Seal of Barrier Bag Containing Fuze and Support Intermediate Pack (see dwg. 333AS111) - Major Defect - Code No. 12004. - The test procedures for this test shall be as prescribed in Specification MIL-P-116. Sampling and rejection criteria shall be in accordance with Standard MIL-STD-105, Special Inspection Level S-4, in Table I and an AQL of 0.40 percent.

4.3.3.2.9 Packing Supports (see 3.10) - Major Defects - Moisture Content - Code No. 21001; Static Potential Charge - Code No. 21002 and Flammability - Code No. 21003. - A sample of 30 supports shall be selected from each shipment received by the loading plant. One (1) support shall be selected from the approximate center of each of 30 individual shipping cartons to make up the required sample. To prevent the loss of moisture from the support, all of the individual supports in the sample shall be sealed in individual polyethylene bags immediately after selection so as to preclude an exchange of occluded gases and the included air kept to a minimum. Ten (10) of the supports shall be subjected to the moisture content determination specified in 4.4.7. The shipment shall be rejected and further testing stopped if one or more supports exhibit excessive moisture content (excess moisture will have an effect on the succeeding tests; therefore, performing these tests will serve no useful purpose). If the moisture content is found to be acceptable, the remaining 20 supports shall be tested for static potential as specified in 4.4.8. Two (2) supports from these 20 shall be subjected to the flammability determination specified in 4.4.9. The shipment shall be rejected if two or more supports exhibit excessive static charge, or if one or both flammability samples burn beyond the gage mark described in the ASTM-D1692.

4.3.4 Inspection Equipment.-Inspection equipment required to perform the inspection prescribed in this specification is identified in the Examination (4.3.2) and Test Method (4.4) paragraphs herein. See 6.3 for details concerning responsibilities for inspection equipment design and approval.

4.3.4.1 Government Rights to Documentation. - Inspection equipment drawings and lists provided and revised in accordance with the requirements may be used by DOD activities for design, procurement, manufacture, testing, evaluation, production and receiving inspection, overhaul, shipping, storage, identification of stock, ordering and

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

storage of replacement parts, inspection of items at overhaul, general maintenance of equipment, construction, survey and whenever inspection equipment drawings are needed.

4.3.4.2 Calibration. - The contractor shall have available a set of master gages, standards and appropriate instruments for regularly scheduled calibrations of his acceptance inspection equipment. Records of such regularly scheduled calibrations shall be maintained by the contractor and made available for review by the Government. The calibration of gages, standards and instruments shall be in accordance with Specification MIL-C-45662.

4.4 Test Methods and Procedures. - The test method and procedure described in each of the following tests represents only one method and procedure which has been proven in use and is approved by the Government for Government acceptance purposes. Producers and manufacturers have the option of using substitute methods and procedures only after obtaining Government approval. Government approval will be based on an evaluation to determine that the substitute method and procedure will result in a quality evaluation equal to or better than that specified herein.

4.4.1 Determination of Binder-Lubricant Content of Booster Pellet or Lead Charge. - An adequately weighed, moisture-free portion of five (5) grams of sample shall be transferred to a tared, medium-porosity sintered glass filtering crucible. The sample shall be extracted with four (4) 10-milliliter (ml) portions of acetone; each portion shall remain in contact with the residue for approximately five (5) minutes before applying suction. Any lumps which may persist shall be broken up and the sides of the crucible shall be washed down with each 10 ml. portion of acetone to insure complete removal of the tetryl. The residue shall be aspirated until the odor of acetone is no longer detectable. The crucible and its contents shall be placed in an oven maintained at 105 degrees plus or minus 5 degrees Centigrade (°C) for 1/2 hour and cooled to room temperature in a desiccator and then weighed. The residue shall then be re-extracted with 10 ml. portions of acetone, repeating the suction, drying, cooling and weighing operations after each additional portion until two successive weighings do not differ from each other by more than 0.002 grams. Calculate the total percentage of binder-lubricant as follows:

$$\text{Total Percent of Binder-Lubricant} = \frac{100\ A}{B}$$

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

where:

A = Weight of residue in crucible.

B = Weight of specimen on a moisture-free basis.

NOTE: The sample, to be moisture-free, should be placed in an ambient temperature of 100 plus or minus 5°C for one hour and the weight recorded as B.

4.4.2 Specific Gravity of Booster Pellet. - This determination shall be performed as specified in Method 203.1 of Standard MIL-STD-650. The pellet shall be classed defective if the specific gravity fails to conform to the specified requirement.

4.4.3 Specific Gravity of Lead Charge

4.4.3.1 Preformed Pellets. - The specific gravity of the lead charge preformed pellet shall be determined using the following formula:

$$\text{Specific Gravity} = \frac{W}{12.8727\ D^2L}$$

where:

W = Weight of pellet in grams.
D = Diameter of pellet in inches squared.
L = Length of pellet in inches.

To assure the adequacy of the above formula, it shall be necessary that diameter (D) and length (L) of the pellet be measured to the nearest one thousandth of an inch on a Optical Comparator. In addition, pellets containing chips or broken edges shall not be used for this determination.

4.4.3.2 Reconsolidated Pellet in Lead Cup. - The specific gravity of the lead cup charge shall be determined as specified herein. All weights shall be measured to the nearest 0.001 gram, and all volumes calculated to the nearest 0.001 cubic centimeter. The resultant specific gravity calculation shall be rounded off to the nearest 0.01 by increasing the result if the thousandths place is greater than five, unchanged if the thousandths place is less than five, increased if the hundredths place is an even number and the

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

thousandths place is exactly five, and unchanged if the hundredths place is odd and the thousandths place is exactly five. This test shall be performed with water and ambient temperature at 70°F plus or minus 2°F.

The procedure for weighing articles while submerged in water shall be as follows:

a. Fill a glass beaker with distilled water to approximately one inch of the top.

b. Attach a wire loop from the hanger of either balance pan of an analytical balance (without dampers). The wire loop shall be formed so that it will hold and suspend the lead cup under approximately one inch of water in the beaker mentioned above, when the balance is balanced. A tare weight shall be attached to the other balance pan to balance the wire loop when the wire loop, without the lead cup, is submerged to the depth required to submerge the lead cup. For analytical balances that do not utilize pans or are of a special design, a comparable procedure shall be established. The height of the water shall be maintained uniform throughout the test.

c. Place the lead cup in the loop, open end up, and check to assure that all air bubbles have been removed from the exterior surfaces when loaded and interior surfaces when empty. Balance and record this weight to the nearest 0.001 gram.

To determine the specific gravity of the tetryl lead charge, proceed as follows:

a. Weigh the loaded lead cup in air; record this weight as A.

b. Weigh the loaded lead cup under water; record this weight as B.

c. Subtract B from A and multiply by 0.9977; record the result as the volume of loaded lead cup, Vl.

d. Remove the tetryl charge from the lead cup by soaking and washing with acetone. After all visible traces of tetryl have been removed, dry the lead cup, weigh in air and record this weight as C.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

e. Weigh the empty lead cup under water and record this weight as D.

f. Subtract D from C and multiply by 0.9977. Record the result as the volume of the empty lead cup, Ve.

g. Subtract Ve from Vl and record the result as the volume of tetryl, Tv.

h. Subtract C from A and record the result as the weight of tetryl, Tw.

i. Divide the weight of the tetryl (Tw) by the volume of the tetryl (Tv) and record the result as the specific gravity of the lead cup charge.

4.4.4 Thickness of Filler Disc. - The disc shall be placed on a steel anvil of sufficient size to provide support to the entire disc. A circular presser foot having an area of 1.0000 square inch, plus or minus 0.0025 square inch (1.129 inches in diameter) acting under a dead load of 10 ounces, plus or minus 0.05 ounce shall be applied gradually (without shock) to the center of the disc. The thickness shall be measured by a dial indicator or dial micrometer to the nearest 0.001 inch. The presser foot shall be of sufficient thickness to assure rigidity, and the edge shall be rounded off with a radius of 0.016 inch, plus or minus 0.001 inch. The surface of the anvil and presser foot shall be applied parallel to each other within 0.001 inch. The disc shall be classed defective if the thickness measurement fails to comply with the requirement.

4.4.5 Rotor Cover Disc in Fuze Assembly. - Equipment shall be used which will assure one disc being dispensed for each fuze in the production flow. (This equipment shall assure that two or more discs are not adhering to each other which could be accomplished by a push-through type of gage.) The production line shall be so designed that one fuze must advance from the assembly station before another disc is obtainable and the fuze prevented from advancing if no disc is obtained. A check shall be made of the area at regular intervals to verify that no discs are dropped, thereby causing all fuzes assembled since the last check to be suspect of disc missing. If a disc is found to have been dropped, all fuzes assembled since the last check shall be examined for presence of disc.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

4.4.6 Explosive Functioning. - For the performance of this test, the completely loaded fuze assembly shall include a loaded relay, loaded rotor assembly (M35 detonator), loaded booster assembly containing lead cup assembly and booster pellet and non-delay element. Prior to this test, the loaded fuze shall be set at the six (6) second time position and temperature conditioned at -65°F, plus or minus 5°F for not less than six (6) hours. To maintain temperature until tested, the fuze assembly shall be conditioned in a portable insulated container with the cover removed from the container during conditioning. (A low density plastic foam is suggested for container material.) Before removal from the chamber, the cover shall be placed on the container and shall not be removed until the fuze assembly is to be assembled into the test equipment. The test shall be performed with the least possible delay. (All testing operations shall be performed utilizing an approved barricade.) Testing shall be performed as follows:

a. The operator shall ascertain prior to performing test that the approved test equipment (see 4.3.4) is properly prepared for test, including adherence to all safety aspects (see 3.9). Prior to mounting the assembly in the test fixture, visually and manually check to assure that the fuze is properly locked in the six second arming time position; check both windows in the fuze body to assure that the fuze is not armed. (Set aside any fuze which is not positively identified as not being armed, and check to see that the M9 non-delay element is properly seated and locked in position.)

b. Mount the fuze assembly in the test fixture with the base end seated on a witness plate, four inches square by one inch thick, made from steel conforming to ASTM-A283-70 and remove the safety wire from the fuze.

c. Arm the fuze assembly remotely or by some other approved method by rotating the vane in a clockwise direction (as viewed from the nose end) until arming has been accomplished. The fuze will be considered armed when the black letter "A" on red background is indicated and viewed through the large indicator window (striker body) located at the side of the body, and when the black letter "A" on a red background is indicated and viewed through the small indicator (rotor) located in the radial cutout adjacent to the delay lock pin. However, if it is evident that the black letter "A" on its red background is not visible in either indicator window, the fuze shall be rejected (see Note 1 and 6.8).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

d. The specified weight to initiate the fuze assembly functioning shall be secured with a holding pin; and for added safety, a second holding pin shall be positioned under the first holding pin. The two holding pins shall have features which allow release of the weight only from outside the barricade area. The height of the specified drop shall be measured as the distance between the bottom of the weight and the flared end of the vane.

e. A safety lanyard will be attached to the fuze assembly to provide a means of removing the fuze from the path of the weight, should the weight hang up during test.

f. Upon satisfactory arming, the operator will further ascertain that the fuze and test equipment are properly prepared for the function phase of testing, including adherence to all safety aspects, and that all personnel are present and accounted for behind the barricade.

g. Operator will pull release pins (second holding pin first - see "d" above), allowing the weight to drop onto the fuze. High order detonation shall be evidenced by indentation of the mild steel plate to the required depth.

h. If the fuze fails to function, all personnel will wait behind the barricade for a period of 30 minutes minimum prior to returning to the test fixture.

i. If the fuze fails to function after being impacted, it shall be destroyed in place (in accordance with local safety regulations) by means of a demolition charge, taking extreme care when placing the charge not to disturb the fuze in any way.

NOTE 1: The fuze assembly, if it fails to arm, shall be removed to a separate barricade area under local safety regulations. The fuze shall be downloaded and a determination and record made as to the cause of arming failure (see 6.8). The fuze shall be classed defective if it fails to arm, if it fails to function explosively after arming, or if it fails to cause an indentation in the steel plate to the required depth when measured as specified in 3.6.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

4.4.7 Moisture Content of Packing Support

4.4.7.1 Preparation of Specimen. - The total weight of the specimen shall consist of approximately one hundred (100) grams. The specimen shall consist of pieces or sections that are removed sequentially from the sample to yield the maximum specimen height and size that the test flask can accomodate. The cutting of the support to obtain the specimen shall not be accomplished by use of heat, such as hot wires, heated knives, etc. A knife with a serrated edge has been found to be adequate for this purpose. The specimen shall be weighed to the nearest 0.1 gram.

4.4.7.2 Apparatus. - The test apparatus for performing the moisture determination shall be a typical distillation process as shown in Figure 1.

Test Flask. - A two (2) liter cylindrical reaction flask with cover and clamp to hold the cover. The cover shall contain one opening with a standard 24/40 tapered joint.

Heating Element. - Any heating element that will fit the test flask and apply heat as required.

Distillation Trap. - A Dean-Stark or Bidwell-Sterling type distillation trap with 0.1 milliliter divisions and 24/40 joints.

Reflux Condenser. - Water-jacketed, 400 millimeters minimum length with 24/40 joint.

Drying Tube. - A drying tube containing a moisture-indicating desiccant, equipped with a rubber stopper to fit the end of the reflux condenser.

4.4.7.3 Test Procedure. - In general, the precautions, calibration and techniques prescribed in ASTM D2044 shall be observed. Plate 1,200 milliliters of dry (suitable distilled) toluene into the test flask. Add the specimen to the flask and assemble the cover as soon as the specimen is in place. A maximum of five (5) minutes is allowed from the time when the support is removed from the polyethylene bag to the time when the cover is assembled to the test flask. If this time period is exceeded, discard the contents of

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

the test flask. The test shall not be completed, and a replacement support and specimen shall be selected and prepared, adhering to all of the requirements for selecting and preparing the original sample and specimen. The toluene solution containing water from the specimen shall be refluxed by the application of heat to the test flask until the water level in the distillation trap maintains a constant level for 15 minutes minimum. The system shall then be allowed to cool at ambient temperature, then 40 to 50 milliliters of toluene, in 10 milliliter increments, shall be poured down the condenser to rinse any water droplets from the surface. The distillation trap shall then be removed from the system, its contents stirred, to assure complete separation of the toluene and water. The volume of the water shall be observed and recorded as V, estimated to the nearest 0.05 milliliter. The total percentage of moisture content shall be calculated as follows:

$$\text{Percentage of Moisture Content} = \frac{100\ V}{W}$$

where:

V = Volume of water in milliliters.
W = Weight of the specimen in grams.

4.4.8 Static Potential Charge. - The support shall be removed from the polyethylene bag, placed on an ungrounded surface in an environment of not more than 55 percent relative humidity, and briskly rubbed with a catskin not less than 10 strokes. Each stroke shall be superimposed upon the preceeding stroke. The support shall not be touched in any manner during this induction period or during the measurement, which shall follow immediately within 20 seconds after the last stroke of the catskin (Central Scientific Company, Catalog No. 78640). The static potential shall be measured by holding the detecting head of a Keithley Static Meter No. 600A, with Detecting Head No. 2501 (or substantial equals) nor more than 3/8 inch from the approximate center of the support surface where the rubbing was accomplished.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

NOTE: Static potential charge measurements require stringent adherence to manufacturer's recommended procedures, including calibration and head standoff distances. Special attention should be given to preventing disturbance of the co-axial cable between the detector head and the electrometer during test when using the Keithly equipment.

4.4.9 Flammability. - One specimen shall be prepared as prescribed in ASTM D1692 from each of the supports in the sample and tested as specified therein. The specimen size, conditioning and testing shall be as prescribed in ASTM D1692.

5. PREPARATION FOR DELIVERY

5.1 Preservation and Packaging

5.1.1 Level A. - The loaded assemblies shall be packaged and preserved in accordance with dwg. 333AS111.

5.2 Packing

5.2.1 Level A. - The packaged assemblies shall be packed in accordance with dwg. 333AS110.

5.3 Marking. - Marking shall be in accordance with MIL-STD-129 and Code of Federal Regulations Title 49 - Transportation Parts 1-199.

6. NOTES

6.1 Ordering Data. - Procurement documents shall specify the following:

a. Title, number and date of this specification.
b. Data cards. - Data cards shall be prepared for each lot in accordance with the information specified in Standard MIL-STD-1167.

6.2 Inspection Code Numbers. - The five digit code numbers assigned to the inspections herein are to facilitate future data collection and analysis by the Government. All submitted designs shall contain a reference to the applicable five digit code number contained in Section 4 of this specification and the appropriate component or assembly drawing number and revision letter to which the specific design applies. They should also be cited as references on drawings of equipment designs submitted by the contractor (see 6.3.5).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

6.3 Inspection Equipment Designs. - Inspection equipment designs are of two types - Government Special Inspection Equipment (SIE) designs and contractor designs. SIE designs are designated by drawing numbers contained under the "Method of Inspection" headings in Section 4 of this specification. Design responsibility for all other inspection equipment is assigned to the contractor. The contractor need not furnish any design when a complete Government SIE design is provided. Unless otherwise specified, however, the contractor may submit alternate or modified contractor designs of SIE in accordance with 6.3.2 and 6.3.3 should he elect to do so.

6.3.1 SIE Designs. - SIE designs may consist of any of the following:

a. Detailed drawings which completely depict all information necessary for the fabrication and use of the item of inspection equipment.

b. A source control drawing or a specification control drawing as defined in MIL-STD-100.

c. An envelope drawing, as defined in MIL-STD-100 which establishes the criteria which a detail design shall meet. When envelope drawings are specified, the contractor shall prepare designs which comply with the criteria therein.

6.3.2 Contractor Designs. - Contractor designs are required for all inspection equipment for which SIE designs are not specified and may include commercial equipment which the contractor proposes to use. (Commercial equipment is defined as unmodified equipment which is cataloged and available for purchase by the general public.) Contractor designs shall include appropriate operating instructions, calibration procedures and maintenance procedures. Commercial equipment shall be fully described by catalog listings or other means which provide sufficient information to permit identification and evaluation by the Government, and may include illustrations and engineering data. Designs shall be prepared for any special fixture(s) required to be used with commercial equipment or with SIE designs if not otherwise covered thereby (see 6.3.1.c.). Designs shall be of the category and form (per MIL-D-1000) specified in the Contract Data Requirements Lists (DD Form 1423). The contractor is referred to MIL-HDBK-204, "Inspection Equipment Design" for guidance. The specification number and the applicable

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

five-digit defect code number (or other specific identifying information) from Section 4 of this specification shall be referenced on each contractor design, together with the component or assembly drawing number and revision letter to which the specific design applies.

6.3.3 Submission of Designs for Approval. - Contractor designs shall be approved by the Government prior to fabricating or procuring the equipment. Designs shall be submitted for approval to Picatinny Arsenal, ATTN: SARPA-QA-A-F, Dover, New Jersey 07801 in accordance with the stipulations, time frame and distribution specified in the Contract Data Requirements List (DD Form 1423) or in the contract. Partial submission of inspection equipment designs is permissible and encouraged. However, the completion date for design review will be based on the date of the final submission of designs. Picatinny Arsenal design review will normally be accomplished within one month after receipt.

6.4 Check Test for Detonator Deterioration. - The Contracting Officer shall arrange for the contractor to be reimbursed for the expense incurred in the performance of the check test. The test shall be conducted at Government expense without cost to the contractor who loaded the detonator, or to the contractor assembling the detonator into the rotor of the fuze, and shall not constitute a basis for rejection against either contractor except where deterioration has occurred as a direct result of carelessness in handling, storage, etc., permitted while the detonator lot was under jurisdiction of either contractor.

6.5 Submission of First Article Samples. - Instructions as to the location for the evaluation of first article sample shall be obtained from the Contracting Officer. Upon receipt of such request, the Contracting Officer shall advise Picatinny Arsenal and instructions will be issued accordingly. All inquiries shall be forwarded to: Commander, Picatinny Arsenal, ATTN: SARPA-QA-I-Q, Dover, New Jersey 07801.

6.6 Critical Defect Reporting. - Critical defect reporting shall be as prescribed by the Contracting Officer.

6.7 Examination of Rotor Assembly. - Any rotor assembly

subject to controversy as to the letter "A" incomplete, damaged or improperly located, including red paint incomplete or damaged, shall be assembled into the rotor cavity of an acceptable empty fuze body (dwg. 9239092), moved to the fully armed

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

position and viewed through the rotor viewing window. Any rotor assembly which does not show a legible black letter "A" on a complete red background within the viewing window area shall be classed defective.

6.8 Determination and Resolution of Failure to Arm or Function

a. Failure of the fuze to arm, as evidenced by viewing through the larger window in the body, and likewise, failure of the fuze to arm in the lower section, as evidenced by viewing through the small window giving the lack of appearance of a black letter "A" on a red background, may not be due to the loading operation (see 4.4.6). Also, failure of the M9 non-delay element to function or to propagate to the XM9 relay may not be the result of defectives incurred by the loading facility.

b. Since these areas are open to interpretation, the loader shall preserve original defectives until the completion of the test (and retest, if allowed); and should the defective be the cause of lot failure under the acceptable level as given elsewhere herein, the contractor, in the presence of the designated Government inspector, may disassemble, x-ray or otherwise review the defective fuze to determine the cause thereof. If the cause is resolved by the Government Inspector to be positively due to a metal parts being defective, the contractor will be allowed to substitute a randomly selected sample(s) in place thereof for the purpose of completing the test.

NOTE: Metal parts deficiencies, which reduce the performance of the fuze lot below the acceptable level specified for the loaded fuze, shall preclude shipment and delivery of the lot without prior specific approval of the procuring agency. In addition, fuzes placed in this category shall be stored in bond pending receipt of the formal release or other disposition instructions.

Custodian:
Army-

Preparing Activity:
Army-

Project Number: 1325-A-420

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.

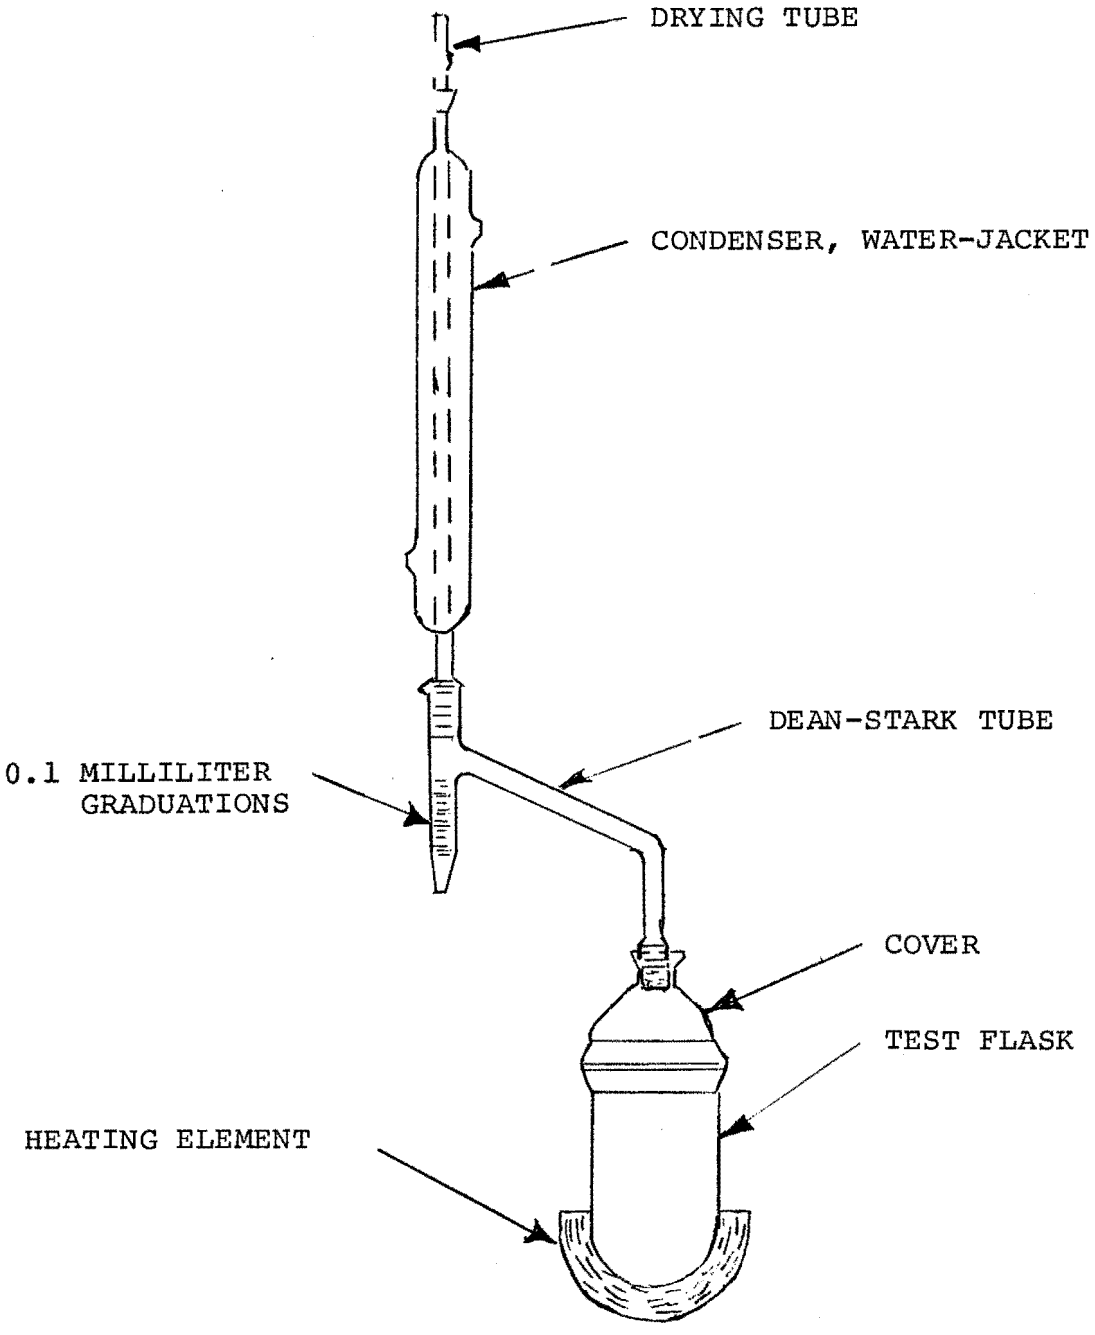


FIGURE I

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:04Z
Check the source to verify that this is the current version before use.