MIL-V-51281C(EA)
15 August 1983
SUPERSEDING
MIL-V-51281B(EA)
4 November 1976

MILITARY SPECIFICATION

VOICEMITTER-OUTLET VALVE ASSEMBLY, CHEMICAL-BIOLOGICAL MASK, C29R5

This specification is approved for use by US Army Armament, Munitions and Chemical Command, Department of the Army, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers a chemical-biological mask voicemitter-outlet valve assembly.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. Unless otherwise specified, the following specifications, standards, and handbooks of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-C-10758 - Chemical Agent, GB.
MIL-D-50030 - Decontaminating Agent, DS2.

: Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed: to: Commander, Armament Research and Development Center, US Army Armament, Munitions and Chemical Command, ATTN: DRSMC-TSC-S(A), Aberdeen Proving Ground, MD 21010 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 4240

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:05Z
Check the source to verify that this is the currentversion before use.

STANDARDS

FEDERAL

Fed. Std. No. 123 - Marking for Shipment (Civil Agencies).

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-282 - Filter Units Protective Clothing, Gas-Mask Components and Related Products: Performance Test Methods.

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein.

DRAWINGS AND TECHNICAL DATA PACKAGE LIST (TDPL)

US ARMY ARMAMENT, MUNITIONS AND CHEMICAL COMMAND

CHEMICAL RESEARCH AND DEVELOPMENT CENTER

TDPL 5-81-125	-	Voicemitter-Outlet Valve Assembly, Chemical-Biological Mask, C29R5.
E136-5-540-2	-	Tester, Air Flow Resistance, Q179, Assembly.
D136-13-342	-	Tester, Mechanical, Impact and Rigidity, Q26, Assembly.
E136-14-3-2	-	Test Device, Air Pressure, Q25, Assembly.
C136-19-2	-	Tester, Tension, Q41, Assembly.
D136-42-102-7	-	Penetrometer, Filter, Q127, Assembly.
B136-44-1-4	-	Resistance Indicator, Inlet and Outlet Valve, Q212, Assembly.
D136-45-202-3	-	Indicator, Outlet Valve Leakage, M4A1, Assembly.
D136-45-202-8	-	Indicator, Outlet Valve Leakage, M4A1, Assembly.
D5220-A51-3999	-	Target Gage.

(Copies of specifications, standards, handbooks, drawings, and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer.)

2.1.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 Preproduction. Prior to the start of regular production, a preproduction sample of voicemitter-outlet valve assemblies and components shall be produced, in accordance with this specification for examination and tests (see 4.3).

3.2 Materials and components.

3.2.1 Materials. All materials cited on drawings in TDPL 5-81-125 or on its subsidiary drawings shall conform to the specifications listed thereon, or to the specific characteristics set forth on the drawings.

3.2.1.1 Diaphragm material. Diaphragm material shall have a GB (MIL-C-10758) penetration resistance of no less than 120 minutes when tested as specified in 4.4.4.1 (see 4.1.2).

3.2.2 Components. All components of the voicemitter-outlet valve assembly shall conform to the specifications and drawings listed in TDPL 5-81-125 and its subsidiary drawings. The following component requirements and classifications of defects in 4.4.3.3(a), (b), (c) and (d) shall be checked on the components before they are assembled into a complete voicemitter.

3.2.2.1 Diaphragm tension. The diaphragm tension shall be such that the deflection caused by the addition of a 114-gram weight is between 0.025 and 0.037 inch when tested as specified in 4.4.4.2. The addition of a five gram weight shall not cause the diaphragm to seat or bottom on the baffle.


3.2.2.2 Frame and outlet valve seat. The cemented joint between the frame and the outlet valve seat shall not leak when subjected to static pressure of 3 pounds per square inch (psi) for a minimum 15 seconds when tested as specified in 4.4.4.3.

3.2.2.3 Outlet valve seat impact resistance. The outlet valve seat shall not break, nor shall the rubs of the hub be depressed so that the distance from any portion of the upper surface of the hub to the hub edge of the sealing rim surface (see figure 1) has been increased by more than 0.012 inch when tested as specified in 4.4.4.4.

3.2.2.4 Valve seat leakage. Leakage through the valve seat shall not exceed 15 milliliters of air per minute at a pressure differential of 25 millimeters of water when tested as specified in 4.4.4.5.

3.2.2.5 Resistance to DS2. The voicemitter speech diaphragm assembly (C5-81-13) shall not break, crack, craze or contain pinholes after immersion of the entire diaphragm assembly in DS2 (MIL-D-50030) for three minutes minimum when tested as specified in 4.4.4.14.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:05Z
Check the source to verify that this is the currentversion before use.

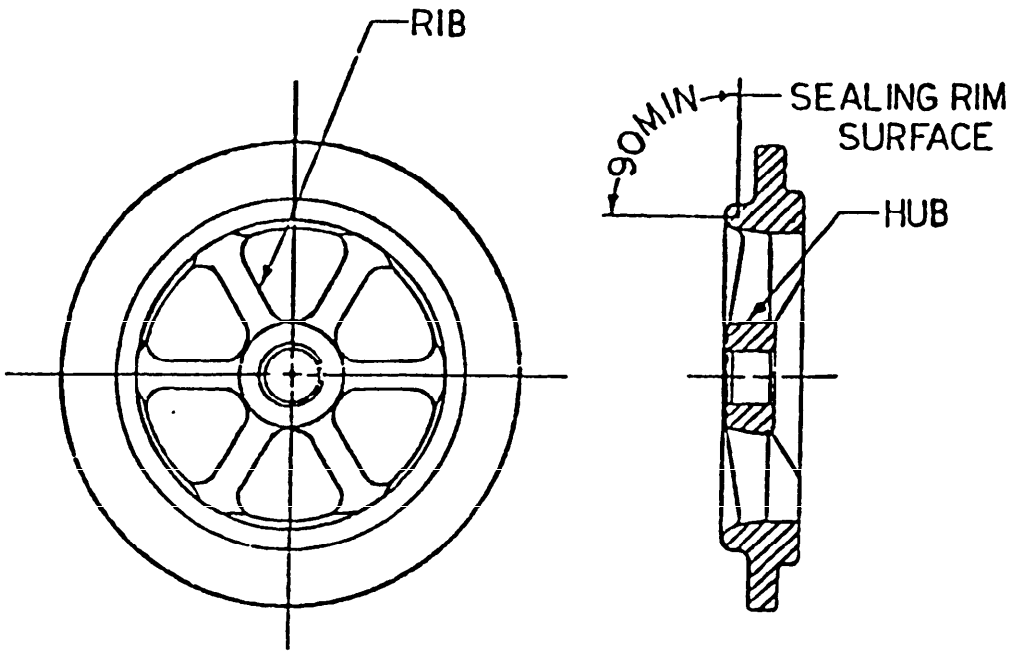

OUTLET VALVE SEAT
FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

3.2.2.6 Body to housing assembly. Primer and sealing compound shall be applied to the threads of the body prior to assembly to the voicemitter-outlet valve assembly. The body shall be assembled to the voicemitter-outlet valve housing, then torqued and tested as specified in 4.4.4.15.

3.3 Manufacture and assembly. The voicemitter-outlet valve assembly shall be manufactured and assembled to conform to Drawing E5-81-125.

3.4 Exhalation resistance to airflow. The assembled outlet valve shall have a resistance not exceeding a pressure differential of 30 millimeters of water at an airflow rate of 85 liters per minute when tested as specified in 4.4.4.6. When the resuscitation valve seat housing is not assembled at the voicemitter level during mask manufacture the assembled outlet valve shall have a resistance not exceeding 22 millimeters of water at an airflow rate of 85 liters per minute.

3.5 Outlet valve leakage. Leakage through the assembled outlet valve shall not exceed 15 milliliters of air per minute, at a pressure differential of one inch of water when tested as specified in 4.4.4.7.

3.6 Dioctylphthalate (DOP) smoke penetration.

3.6.1 Diaphragm assembly. DOP smoke penetration of the diaphragm assembly shall not exceed 0.001 percent when tested as specified in 4.4.4.8.

3.6.2 Voicemitter assembly. DOP smoke penetration of the voicemitter-outlet valve assembly with the opening in the valve seat sealed shall not exceed 0.001 percent when tested as specified in 4.4.4.9.

3.7 Drinking assembly.

3.7.1 Airflow. With the lever actuated in a counter clockwise direction, fully against the stop the airflow through the drinking tube shall be 2.0 liters of air per minute at a maximum pressure differential of 1.2 inches of water when tested as specified in 4.4.4.10.

3.7.2 Actuation of drinking tube. When the lever is fully actuated toward the stop in a counter-clockwise direction, the drinking arm shall move smoothly and the mouthpiece shall fall within the periphery of and pass through the target gage area so that the mouthpiece extends beyond the back surface of the gage when tested as specified in 4.4.4.11. The kink tube shall be open and not twisted and shall not move away from the metal housing or arm flange. Upon manual return of the lever to its neutral or rest position, the drinking arm and kink tube shal return to their original positions.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:05Z
Check the source to verify that this is the currentversion before use.

3.8 Actuation of the resuscitation tube. When the lever is fully actuated toward the stop in a clockwise direction, the resuscitation tube shall move smoothly without distortion of the support assembly and shall fall within the periphery of and pass through the target gage area so that the mouthpiece extends beyond the back surface of the gage when tested as specified in 4.4.4.12. Upon release of the lever the resuscitation tube shall return to its original position.

3.9 Diaphragm tension of the voicemitter-outlet valve. The tension of the diaphragm when assembled into the voicemitter-outlet valve assembly shall be such that the deflection caused by the addition of 114-gram weight is between 0.025 and 0.040 inch when tested as specified in 4.4.4.2. The addition of a five-gram weight shall not cause the diaphragm to seat or bottom on the baffle.

3.10 Lever attachment. The lever and its attachment to the shaft shall withstand a clockwise and a counterclockwise torque of 10.0 inch pounds without evidence of failure when tested as specified in 4.4.4.13.

3.11 Strength of shaft stop. The wire stop on the shaft or the formed stop on the shaft, which is applicable, when tested in a voicemitter shall withstand a clockwise and counterclockwise torque of 10.0 inch pounds without evidence of failure when tested as specified in 4.4.4.13.

3.12 Workmanship. The voicemitter-outlet valve assembly and its components shall be free from imperfections, dirt, grease, oil, foreign matter, and from damage such as dents, roughened valve seat, twisted kink tubing, cracks, sharp edges, burrs, tears, wrinkled mylar, folded valve disks, and torn valve disks that would impair its function. Epoxy sealer, holding the outlet valve seat to the frame, shall not be excessively applied so as to be evident within 1/4 inch of the outlet valve well face.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection.

4.1.1 Contractor's responsibility. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.2 Government's responsibility. The Government will be responsible for the performance of the test specified in 4.4.4.1. Samples shall be forwarded to the laboratory designated by the contracting officer (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

4.1.3 Objective evidence. The contractor shall provide objective evidence acceptable to the contracting officer that the requirements of 3.2 and section 5 for which specific inspection has not been provided in this specification have been satisfied.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

(a) Preproduction inspection (see 4.3).
(b) Quality conformance inspection (see 4.4).

4.3 Preproduction inspection.

4.3.1 Sample. A preproduction sample of 25 voicemitter-outlet valve assemblies and 200 voicemitter speech diaphragm assemblies, 50 each of outlet valve seats, frame and outlet valve seat assemblies, and flames shall be produced, using the same methods, materials, and equipment as will be used during regular production. The initial 15 linear feet of each roll of diaphragm material used for preproduction shall be submitted to the Government for GB testing (see 4.1.2).

4.3.2 Inspection procedure. The 25 voicemitter-outlet valve assemblies and the components shall be inspected for all requirements of the drawings and of this specification.

4.3.3 Tests. The voicemitter-outlet valve assemblies, 50 voicemitter speech diaphragm assemblies, components, and diaphragm material shall be tested in accordance with 4.4.4.

4.3.4 Acceptance/rejection criteria. The preproduction sample shall meet the examination and tests specified in 4.3.2 and 4.3.3 to be acceptable. The contractor shall obtain written approval from the contracting officer prior to proceeding with regular production.

4.4 Quality conformance inspection.

4.4.1 Lotting. A lot shall consist of voicemitter-outlet valve assemblies or components produced by one manufacturer from the same materials, at the same plant, and under essentially the same manufacturing conditions. No more than one lot of diaphragm material and the following rubber components (outlet valve disk, resuscitation valve disk, and kink tube) shall be represented in any one lot of finished voicemitter-outlet valve assemblies. Any changes in materials, equipment or procedure used in regular production from that used in the preproduction sample shall be approved by the contracting officer prior to its institution and may require a new preproduction sample. A lot of voicemitter-outlet valve assemblies contains diaphragm assemblies (Dwg C5-81-13) which have been parylene coated in several batches, (a batch is defined as diaphragm assemblies in one chamber and one days production from that chamber) provided each batch has been tested and accepted in accordance with 4.4.4.14 and 4.4.3.2.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

4.4.2 Sampling.

4.4.2.1 For examination and nondestructive tests. Sampling shall be conducted in accordance with MIL-STD-105.

4.4.2.2 For destructive tests. Sampling for testing of the outlet valve seat impact resistance, and the body to housing assembly test shall be conducted in accordance with MIL-STD-105, level S-4. A random sample of 50 voicemitter speech diaphragm assemblies shall be selected from the lot for resistance to DS2. After 50 samples from 9 consecutive batches in a lot are found failure-free for DS2; reduce the sample size to 8 and continue testing each batch using a sample size of 8 until a failure is found; then revert to a sample size of 50 until another 9 consecutive failure-free batches have been produced. A break in production will require reverting to 50 samples per batch until another 9 consecutive failure-free batches have been produced. In addition, the initial 15 linear feet of each roll of diaphragm material shall be submitted to the Government for GB testing.

4.4.3 Inspection procedure.

4.4.3.1 For examination and nondestructive tests. The sample voicemitter-outlet valve assemblies and components shall be examined and tested in accordance with the classification of defects and with MIL-STD-105. Each item in the lot shall be examined for critical defects.

4.4.3.2 For destructive tests. The sample for the outlet valve seat impact resistance shall be tested as specified in 4.4.4.4 and evaluated in accordance with MIL-STD-105 using an AQL of 0.65 percent defective. The sample of diaphragm material for GB penetration shall be tested as specified in 4.4.4.1. The sample for body housing assembly shall be tested as specified in 4.4.4.15. The sample for resistance to DS2 shall be tested as specified in 4.4.4.14. The acceptance number for GB penetration test, resistance to DS2, and body to housing assembly test is zero.

4.4.3.3 Classification of defects.

(a) Diaphragm assembly (Drawing C5-81-13).

Categories	Defects	Acceptance standards
Critical:		
1	DOP smoke penetration	4.4.4.8

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

Categories	Defects	Acceptance standards
Major:	AQL 1.0 percent defective	
101	Component missing or incorrectly assembled	
102	Outside diameter (2.364) incorrect	
103	Outside periphery thickness (0.130) incorrect	
104	Workmanship (see 3.12)	
	AQL 0.25 percent defective	
105	Diaphragm tension	4.4.4.2

(b) Seat, outlet valve (Drawing D5-81-167).

Categories	Defects	Acceptance standards
Critical:	None defined	
Major:	AQL 1.0 percent defective	
101	Workmanship (see 3.12) inadequate	
102	Diameter (1.130) incorrect	
103	Diameter (1.492) incorrect	
104	Diameter (0.176) incorrect	
105	Thickness (0.150) incorrect	
106	Thickness (0.160) incorrect	
107	Sealing rim surface not smooth	
108	Counter sink diameter (0.195) incorrect	
109	Concentricity incorrect	
	AQL 0.25 percent defective	
110	Valve seat leakage	4.4.4.5

(c) Frame and outlet valve seat assembly (Drawing D5-81-112).

Categories	Defects	Acceptance standards
Critical:		
1	Leakage	4.4.4.3

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

Major: AQL 1.0 percent defective

101	Component missing, incorret, or incorrectly assembled
102	Workmanship (see 3.12) inadequate
103	Plan view profile incorrect

Minor: AQL 2.5 percent defective

201	Dimple incorrect

(d) Frame (Drawing D5-81-111).

Categories	Defects
Critical:	None defined
Major:	AQL 1.0 percent defective
101	Diameter (1.496) incorrect
102	Well taper (1°) incorrect
103	Plan view profile incorrect
104	Diameter (0.255) incorrect
105	Concentricity incorrect
106	Workmanship (see 3.12) inadequate
107	Small hole locations incorrect
Minor:	AQL 2.5 percent defective
201	Diameter (1.225) incorrect
202	Depth (0.538) incorrect
203	Diameter (2.120) incorrect
204	Protective finish missing, incomplete, or incorrect

(e) Voicemitter-outlet valve assembly, C29R5 (Drawing E5-81-125).

Categories	Defects	Acceptance standards
Critical:		
1	Outlet valve leakage	4.4.4.7
2	DOP smoke penetration	4.4.4.9

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

Major:	AQL 1.0 percent defective	
101	Component missing or incorrectly assembled	
102	Workmanship (see 3.12) inadequate	
*103	Valve seat housing not properly oriented or firmly seated against frame	
*104	Resuscitation tube support not firmly seated	
105	Lever inoperative	
*106	Resuscitation valve disk distorted or folded	
107	Lever not securely attached to shaft	4.4.4.13
108	Shaft stop strength inadequate	4.4.4.13
	AQL 0.25 percent defective	
109	Diaphragm tension incorrect	4.4.4.2
110	Outlet valve resistance to airflow excessive	4.4.4.6
111	Drinking assembly airflow inadequate	4.4.4.10
112	Drinking tube operation incorrect	4.4.4.11
*113	Resuscitation tube operation incorrect	4.4.4.12
Minor:	AQL 2.5 percent defective	
201	Protective finish missing	
202	Mouthpiece orientation incorrect	
203	Spring ends not closed	

(f) Arm, drinking assembly (Drawing C5-81-157).

Categories	Defects
Critical:	None defined
Major:	AQL 1.0 percent defective
101	Tubing not securely attached to arm
102	Mouthpiece not parallel with tube

*May be performed at mask assembly station if resuscitation valve seat housing is assembled at that time.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:05Z
Check the source to verify that this is the currentversion before use.

4.4.4 Tests. Tests shall be conducted as follows:

4.4.4.1 GB penetration. The resistance of the diaphragm material to GB penetration shall be determined in accordance with method T208 of MIL-STD-282.

4.4.4.2 Diaphragm tension. The diaphragm tension shall be determined with the Q41 Tension Tester (C136-19-2).

4.4.4.3 Frame and outlet-valve seat-assembly leakage. The leakage of the frame and outlet-valve seat assembly shall be determined with the Q25 Air Pressure Test Device (E136-14-3-2).

4.4.4.4 Outlet valve seat impact resistance. The impact resistance of the outlet valve seat shall be determined with the Q26 Impact and Rigidity Mechanical Tester (D136-13-342), with a 1/4-pound weight dropped from a height of 24 inches.

4.4.4.5 Valve seat leakage. An outlet valve disk shall be assembled to the seat and tested with the M4A1 Outlet Valve Leakage Indicator (D136-45-202-8).

4.4.4.6 Exhalation resistance to airflow. The resistance to airflow of the outlet valve assembly of the voicemitter shall be determined with the Q212 Inlet and Outlet Valve Resistance Indicator Assembly (B136-44-4).

4.4.4.7 Outlet valve leakage. The leakage of the outlet valve shall be determined with the M4A1 Outlet Valve Leakage Indicator (D136-45-202-3).

4.4.4.8 Diaphragm assembly DOP smoke penetration. Mount the diaphragm assembly in the Q127 Penetrometer (D136-42-102-7) and test for smoke penetration.

4.4.4.9 Voicemitter assembly DOP smoke penetration. Actuate the lever until fully engaged against the stop at least three times in a counterclockwise direction. Return the lever to its neutral or rest position. Mount the voicemitter in the Q127 Penetrometer (D136-42-102-7) and test for smoke penetration.

4.4.4.10 Airflow. The airflow through the drinking tube shall be determined with the Q179 Airflow Resistance Tester (E136-5-540-2). Actuate the lever until fully engaged against the stop at least three times in a counterclockwise direction prior to performing test.

4.4.4.11 Actuation of the drinking tube. Position the voicemitter-outlet valve assembly in the Target Gage (D5220-A51-3999), making sure that the voicemitter plate is flat against the gage and not bowed. Actuate the lever three times, as specified. The mouthpiece must fall within the periphery of and pass through the gage.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

4.4.4.12 Actuation of the resuscitation tube. Position the voicemitter outlet valve assembly in Extended Position Drinking and Resuscitation Tubes Gage (D5220-A51-3999), making sure that the voicemitter plate is flat against the gage and not bowed. Actuate the lever three times as specified. The mouthpiece must fall within the periphery of and pass through the gage.

4.4.4.13 Lever attachment and strength of shaft stop. Position the voicemitter outlet valve assembly in a suitable holding fixture. Using a torque wrench, which has been modified to attach to the lever, actuate the lever to the stop until the specified torque is achieved in the clockwise direction and then repeat the test in the counterclockwise direction.

4.4.4.14 Resistance to DS2. (See 6.5). The resistance of the voicemitter diaphragm to DS2 shall be determined by totally immersing the entire diaphragm assembly in DS2 (MIL-D-50030) for at least 3 minutes. The diaphragm shall be agitated for at least 15 seconds upon immersion in the DS2 to remove air bubbles and insure all diaphragm surfaces are covered by DS2. After 3 minutes exposure the diaphragm assembly shall be removed from the DS2, thoroughly rinsed with distilled water, blown dry with filtered compressed air and the diaphragm examined for breaks, cracks, crazing or pinholes. (The rear baffle shall be cut away to facilitate this examination, however, care shall be exercised to assure that the diaphragm is not damaged).

4.4.4.15 Body to housing assembly. The body of the sample voicemitter-outlet valve assemblies shall be removed using a calibrated torque wrench. The torque required to remove the body shall be no less than 25 in-lbs. After removing the body, the body threads shall be examined under ultra-violet light for evidence of sealing compound.

5. PACKAGING

5.1 Unit packing, packing, and marking, interplant shipment (see 6.3). The voicemitter-outlet valves shall be unit packed and packed to provide adequate protection from physical damage from the supply source to the first receiving activity for immediate use or further processing. Shipping containers shal be in compliance with the rules and regulations applicable to the mode of transportation. Marking shall be in conformance with Fed. Std. No. 123.

5.2 Repair parts. When voicemitter-outlet valve assemblies are procured for storage and issue as repair parts, preservation, unit packing, packing and marking shall be as specified on the packaging data sheet which is identified by the National Stock Number.

6. NOTES

6.1 Intended use. The item covered by this specification is a combination voicemitter and outlet valve, with drinking and resuscitation capability, intended for use with the M17A1 field chemical-biological masks.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

6.2 Ordering data. Acquisition documents should specify the following:

(a) Title, number and date of this specification.
(b) Preproduction:

(1) Time allowed for contractor submission of samples for Government test and evaluation after award of contract.
(2) Name and address of test facility and shipping instructions when testing is performed by the Government.
(3) Time required for the Government to notify the contractor whether or not to proceed with production.

(c) Laboratory to which samples shall be sent for GB testing.

6.3 Interplant shipments. Packaging for interplant shipment is for supplies and materials that do not enter the military supply system. Typical interplant shipments are shipments from a vendor to a subcontractor or a prime contractor, or from a subcontractor to a prime contractor, or from a vendor or contractor to a military arsenal or plant.

6.4 Component specifications.

MIL-D-10132 - Discs, Valve.
MIL-R-51283 - Rubber Fabricated Products for M17A1/M17A2 Masks.

6.5 Handling of DS2. Once bulk storage containers of DS2 are opened, they must be resealed after extraction of DS2 for the testing and kept under a nitrogen gas atmosphere at all times. Daily use quantities, when removed from the bulk, need only be stored in stoppered ground glass containers. At no time, however, should the glass container be left open longer than to permit extraction of the quantity required for testing.

Custodian:

Army - EA

Preparing activity:

Army - EA

Project No. 4240-A786

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:05Z
Check the source to verify that this is the currentversion before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for submitting comments and suggestions for improvements. All users of military standardization documents are invited to p suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)* mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorizati to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

NO P
NEC
IF M
IN
UNITE

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12062 WASHINGTON, D.C.

POSTAGE WILL BE PAID BY DEPARTMENT OF THE ARMY

Commander
Armament Research and Development Center
US Army Armament, Munitions and Chemical Command
ATTN: DRSMC-TSC-S(A)
Aberdeen Proving Ground, MD 21010

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:05Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-V-51281C(EA)	VOICEMITTER-OUTLET VALVE ASSEMBLY, CHEMICAL-BIOLOGICAL MASK, C29R5

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*:

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation.

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 EDITION OF 1 OCT 76 IS OBSOLETE

Source: https://assist.dla.mil - Downloaded: 2026-02-26T04:05Z
Check the source to verify that this is the current version before use.