MIL-O-22776C
5 January 1978
SUPERSEDING
MIL-O-22776B
23 October 1973

MILITARY SPECIFICATION

OVERALLS, WET WEATHER

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE.-

1.1 Scope.- This specification covers the requirements for waterproof overalls, made of a double coated nylon twill cloth.

* 1.2 Classification.- The overalls shall be of one type, and shall be procured in the following sizes as specified (see 6.2):

XX Small	-	(26-28)
X Small	-	(30-32)
Small	-	(34-36)
Medium	-	(38-40)
Large	-	(42-44)
X Large	-	(46-48)

2. APPLICABLE DOCUMENTS

* 2.1 Issue of documents.- The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Navy Clothing and Textile Research Facility, 21 Strathmore Road, Natick, MA., 01760) by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8405

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

V-T-295	- Thread, Nylon
DDD-L-20	- Label; For Clothing, Equipage, and Tentage (General Use)

MILITARY

MIL-B-286	- Buttons, Tack; and Tack, Button
MIL-F-495	- Finish, Chemical, Black (For Copper Alloys)
MIL-W-530	- Webbing, Textile, Cotton, General Purpose, Natural or in Colors
MIL-B-17757	- Boxes, Shipping, Fiberboard (Modular Sizes)
MIL-C-19759	- Cloth, Coated, Twill, Nylon (low Count)
MIL-F-21840	- Fastener Tapes, Hook and Pile, Synthetic

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams, and Stitchings

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	- Marking for Shipment and Storage

(Copies of specifications, standards, drawings, and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

RULES AND REGULATIONS

U. S. POSTAL SERVICE MANUAL

(Copies of the manual may be obtained from the Superintendent of Documents, U. S. Government Printing Office, Washington, D. C. 20402.)

2.2 Other publications.- The following documents form a part of this specification to the extent specified herein. Unless a specific issue is identified, the issue in effect on date of invitation for bids or request for proposal shall apply.

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

Source: https://assist.dla.mil -- Downloaded: 202610-19T13:58Z
Check the source to verify that this is the current version before use.

(Application for copies should be addressed to the American Trucking Association, Attn: Traffic Department, 1616 P Street, N.W., Washington, D.C. 20036.)

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

3. REQUIREMENTS.-

3.1 Guide sample.- Samples, when furnished, are solely for guidance and information to the contractor (see 6.3). Variations from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article.- When specified (see 6.2), the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.2).

3.3 Materials.-

3.3.1 Basic material.- The basic material for the overalls shall be a chloroprene coated nylon twill conforming to type II of MIL-C-19759, except that the coating shall be unvulcanized and tested as specified in 4.3.1.

3.3.2 Buttons and tacks.- The buttons and tacks shall conform to the requirements specified in MIL-B-286. The buttons shall be of type I, 27 line, and the tacks shall be of type IX, 17 line by 0.406 inch (10.3mm) prong length.

* 3.3.3 Cement, chloroprene.- The cementing compound shall have a chloroprene base and the same curing characteristics as the coating compound specified in 3.3.1. The use of reclaimed rubber is prohibited (see 4.3.1). Cemented sample seams shall have a minimum adhesion of 5 pounds per inch width (22 N/2.5cm) when tested as specified in 4.3.1. The color of the cement shall approximate the shade of the green coating compound specified in 3.3.1 or shall be unpigmented.

* 3.3.4 Thread, nylon.- The nylon thread shall conform to type III, size B or E, of V-T-295, except that the colorfastness requirements shall not apply. The thread shall be dyed to match Olive Drab S-1, cable no. 66022, or shall approximate the green shade of the basic material.

3.3.5 Webbing, cotton.- The cotton webbing shall conform to type II a, class 3, of MIL-W-530. The webbing shall finish 1 1/4 inches (3.2cm) in width, and shall be dyed olive green 107 or approximate the green shade of the basic material.

3.3.6 Fastener tapes.- The fastener tapes shall conform to type II, class 3, of MIL-F-21840. The tapes shall be 1 inch (2.5cm) in width. The color shall be Green 3422 or shall approximate the green shade of the basic material.

Source: https://assist.dla.mil -- Downloaded: 202610-19T13:58Z
Check the source to verify that this is the current version before use.

3.3.7 Buckles, suspender.- The buckles shall be made of brass and shall be chemically finished black conforming to the requirements of MIL-F-495. The shape and dimensions of the suspender buckles shall be as shown in figure 3.

* 3.3.8 Combination label.- A combination identification, size, and instruction label, conforming to type IV, classes 12 and 13, of DDD-L-20, shall be printed on a suitable sized piece of unvulcanized basic material or may be marked directly on overalls. All markings shall be bright yellow in color. The inscription and size of characteristics shall be as follows:

	SIZE OF CHARACTERS	
	INCH	(MM)
OVERALLS, WET WEATHER	3/16	(4.8)
CONTRACT NO. DSA-100-00-0-0000 (EXAMPLE)	1/8	(3.2)
STOCK NO. 8405-00-000-0000 (EXAMPLE)	1/8	(3.2)
SIZE: MEDIUM (38-40) (EXAMPLE)	1/8	(3.2)
NAME OF CONTRACTOR	1/8	(3.2)
INSTRUCTIONS	3/16	(4.8)
This waterproof overall has been oversized to fit	3/32	(2.4)
over heavy clothing for use under cold/wet weather	3/32	(2.4)
conditions. If oversized when worn over light	3/32	(2.4)
clothing, use a smaller size	3/32	(2.4)
DO NOT DRY CLEAN	3/16	(4.8)

* 3.3.9 Dusting medium.- The dust used in fabricating both the basic material and overall, shall be of a suitable dusting medium that does not support mildew growth in the finished vulcanized garment (see 3.6.2 and 4.3.1).

3.4 Design.- The overalls shall be of a bib front, high back style, with cemented side seams; center front seam; center back seam; and leg inseams. The overalls shall have a double folded self-closing fly; suspender straps with an attached adjustable slide loop buckle, stitched to the back bib and secured to the bib front by buttons and tacks; a patch pocket with a flap located on the left front; a gusset type closure located on the right side and secured by a waist tab and ajustable patch assembly; and hemmed leg bottoms. Each leg bottom shall have a leg tab and adjustable patch assembly attached (see figures 1 and 2).

3.4.1 Figures.- Figures 1 thru 4 are furnished for information purposes only. When inconsistencies exist between the written specification and the figures, the specification shall govern.

3.5 Patterns.- Standard patterns will be furnished by the Government. The standard patterns shall not be altered in any way and are to be used for cutting the contractors working patterns. The working patterns shall be identical to the standard patterns.

Source: https://assist.dla.mil -- Downloaded: 202610-19T13:58Z
Check the source to verify that this is the current version before use.

3.5.1 Pattern parts The component parts shall be cut from the material specified, and in accordance with the following pattern parts:

Material	Pattern Parts	Cut Parts
Cloth coated, nylon twill	Back (left side)	1
	Front (left side)	1
	Back (right side)	1
	Front (right side)	1
	Back and Front facing (left side)	1
	Back facing (right side)	1
	Front facing (right side)	1
	Gusset (2 piece)	2
	or	
	Gusset (1 piece)	1
	Waist adjustment tab (2 piece)	2
	or	
	Waist adjustment tab (1 piece)	1
	Waist adjustment patch	1
	Pocket	1
	Pocket flap 1/	2
	Leg adjustment tab (2 piece)	4
	or	
	Leg adjustment tab (1 piece)	2
	Leg adjustment patch	2
	Fly extension (left side)	1
	Fly extension (right side)	1
	Gusset reinforcement patch	1
	Crotch reinforcement patch	1
	Adjustment tab reinforcement patch	3
	Hanger loop	1
Templates	Pocket V-strip marker 2/	
	Pocket finishing cementing marker	
	Pocket flap welt locator marker	

1/ This part may be cut in one piece.
2/ For duel application as marker and locator.

3.6 Construction:-

3.6.1 Sewn seams.- Stitch and seam types specified in Table I shall conform to FED-STD-751. Seam allowances shall be maintained with seams properly sewn so that no raw edges, runoffs, twists, pleats, or open seams will result. Thread breaks shall be secured by starting the repair stitch not less than 1/2 inch (12.7mm) in back of the break. Skipped stitches may be repaired using 301 stitch type. The minimum and maximum number of stitches per inch shall be as specified in table I.

Source: https://assist.dla.mil -- Downloaded: 202640-19T13:58Z
Check the source to verify that this is the current version before use.

* 3.6.2 Cemented seams and parts.- Prior to joining of precemented and dusted parts, the surfaces to be joined shall be washed with a suitable solvent. Care shall be exercised in performing this operation to avoid solvent staining of adjacent surfaces. Unless otherwise specified in table I, all LSA type cemented seams shall overlap 1/2 to 3/4 inch (12.7 to 19.0mm). The width of the cemented area (cement margin) for seams before joining shall be a maximum of 7/8 inch (22.2mm) per single ply of material. The width of the visible cement line allowed for seams after joining, shall be of a maximum of 3/8 inch (9.5mm) on the outside and 3/8 inch (9.5mm) on the underside. Whenever possible, cementing shall be performed by shingling or with the aid of templates to insure that the cement lines are even, uniform, and within specified tolerances. Cemented parts such as the pocket and reinforcement patches, shall show a maximum cement line of 3/8 inch (9.5mm) around all outer edges. All cemented seams and parts shall be rolled to remove any puckers, tunnels, or wrinkles and shall be dusted in accordance with 3.3.9. Cemented seam types specified in table I, are similar to the seam types specified in FED-STD-751 minus the stitchline.

*3.6.3 Dusting visible cement lines Before vulcanization, visible cement lines along edges of seams and parts shall be dusted with the minimum amount of dusting medium necessary to prevent adhesion of uncured coated fabric and cemented surfaces. Care shall be taken to insure only the cemented areas are dusted (see 3.3.9).

* 3.6.4 Vulcanization.- The overalls shall be vulcanized in accordance with the time and temperature requirements supplied by the coated fabric manufacturer (see 4.3.1.).

* 3.7 Manufacturing operation requirements.- The contractor shall manufacture the overalls in accordance with every applicable operation specified in table I. The contractor is not required to follow the exact sequence of operations listed.

3.7.1 Shade and size marking.- The component parts shall be marked, ticketed, or bundled to insure a uniform shade and size throughout the overall, except parts which may be cut from ends. Any method may be used except:

1. Metal fastening devices
2. Sew-on tickets
3. Adhesive type tickets whose adhesive causes discoloration or whose adhesive mass adheres to the material upon removal of the tickets

The use of a rubber stamp, ink pad numbering machine, or pencil is acceptable provided the numbers are legible and are not visible on the outside of the overall.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
1.	Cutting a. The overalls shall be cut in strict accordance with patterns furnished, which show size; shape; directional lines for cutting; and notches for proper assembly of all parts. The use of devices such as staples, pins, etc. to hold the working patterns on the basic material during cutting, is not permitted. b. All basic fabric component parts shall be cut from one piece of material except the inner ply of pocket flap when made from two pieces; front and back facings (left and right sides); gusset; and gusset and crotch reinforcement patches which may be cut from ends. c. The use of a drill hole is permitted only when the hole is located in an area where it will be covered in a later operation by the cement portion of a cemented component part. d. All other trimmings shall be cut in accordance with the pattern or in accordance with the Description of Operation when no pattern is furnished. e. The lightly coated (green) side of the basic material shall finish on the outside of the overalls.					
2.	Replacement of defective components.- During the spreading, cutting, and manufacturing process, components having material defects or damages that are classified as defects in 4.3.2.1, shall be removed from production and replaced with non-defective and properly matched components.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
3.	Shade and size marking.- All parts shall be marked, ticketed, or bundled in accordance with 3.7.1. When parts are cut from ends, the parts shall closely match the major component parts of the overalls.					
4.	Assemble leg adjustment tabs and patches (cementing or stitching).-					
	a. Cement method (see Figure 4) 1. Apply cement to the entire surface of the one or two piece tab on the black side. Place a piece of release paper large enough to cover an area of 1/2 to 3/4 inch (12.7 to 19.1mm) on the cemented surfaces from the straight end of tab, and join the two surfaces.		SSa or OSf			
	2. Apply cement to the entire surface of the adjustment tab reinforcement patch on the black side.					
	3. Apply cement to the 1/2 to 3/4 inch (12.7 to 19.1mm) area as specified in sequence (1) on each green side.					
	4. Insert straight end of leg adjustment tab thru slit of reinforcement patch. Activate cement on green sides of tab and on black side of reinforcement patch. Spread ends of tab in opposite directions, and join tab to patch.					
	or					
	b. Stitching method.- Stitch the one or two piece leg adjustment tab 1/16 to 1/8 inch (1.6 to 3.2mm) from all outer edges. Reinforcement patch is not required in this method.	301	SSa-1 and OSf-1	8-10	B or E	B or E

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
4.	Assemble leg adjustment tabs and patches (cementing or stitching) (cont'd)					
	c. Stitch a 7/8 to 1 1/8 inches (22.2 to 28.6mm) length of hook fastener tape to the leg adjustment tab as indicated by marks on pattern, 1/16 to 1/8 inch (1.6 to 3.2mm) from edge of tape on all sides. The tape shall finish on the underside of tab on finished overalls.	301	LSbj-1	8-10	B or E	B or E
	d. Stitch a 7 7/8 to 8 1/8 inches (20.0 to 22.6cm) length of pile fastener tape to the green side of leg adjustment patch as indicated by marks on pattern, 1/16 to 1/8 inch (1.6 to 3.2mm) from all outer edges of tape.	301	LSbj-1	8-10	B or E	B or E
	NOTE: The preassembled adjustment tabs and patches shall be attached as specified in operation 12.					
5.	Assemble waist adjustment tab and patches (Cementing or stitching.-					
	a. Cementing process (See Figure 4).-					
	1. Apply cement to the outer surface of the one or two piece tab on the black side. Place a piece of release paper large enough to cover an area of 1/2 to 3/4 inch (12.7 to 19.1mm) on the cemented surfaces from the straight end of tab, and join the two surfaces.		SSa or OSf			
	2. Apply cement to the entire surface of the adjustment tab reinforcement patch on the black side.					
	3. Apply cement to the 1/2 to 3/4 inch (12.7 to 19.1mm) area as specified in sequence (1) on each green side.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
5.	Assemble waist adjustment tab and patches (Cementing or stitching).- (Cont'd)					
	4. Insert straight end of waist adjustment tab thru slit of reinforcement patch. Activate cement on green sides of tab and on black side of reinforcement patch. Spread ends of tab in opposide directions, and join tab to patch.					
	or					
	b. Stitching method.-					
	-Stitch the one or two piece waist adjustment tab 1/16 to 1/8 inch (1.6 to 3.2mm) from all outer edges. Reinforcement patch is not required in this method.	301	SSa-1 and/or OSf-1	8-10	B or E	B or E
10	c. Stitch a 7/8 to 1-1/8 inches (22.2 to 28.6mm) length of hook fastener tape to the waist adjustment tabs as indicated by pattern marks, 1/16 to 1/8 inch (1.6 to 3.2mm) from edge of tape on all sides. The tape shall finish on the underside of tab on finished overalls.	301	LSbj-1	8-10	B or E	B or E
	d. Stitch a 4 3/8 to 4 5/8 inches (11.1 to 11.8cm) length of pile fastener tape to the green side of waist adjustment patch as indicated by pattern marks, 1/16 to 1/8 inch (1.6 to 3.2mm) from all outer edges of tape.	301	LSbj-1	8-10	B or E	B or E
	NOTE: The preassembled waist adjustment tab and patch shall be attached as specified in operation 10.					
6.	Join fronts to backs.-					
	a. Cement the left front to the left back, front overlapping back to form side seam.		LSa			

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
6.	Join fronts to backs.- (cont'd)					
	b. Cement the right front to the right back, front overlapping back to form side seam; leaving approximately 10 inches (25.4cm) of side seam from the top edge uncemented.		LSa			
7.	Assemble and attach pocket and flap.-					
	a. Cement solid the black side of the two piece pocket flap and join together. The superimposed pieces shall have all edges even, with no black coating visible from either edge.		SSa			
	As an alternate, the pocket flap may be cut in one piece and folded in half.		OSf			
	b. Turn under the top edge of pocket piece as indicated by pattern marks, and cement solid black side to black side to form a hem.		EFa			
	c. Fold the hem on pocket piece face to face to form a welt.					
	d. Position the pocket flap over the pocket welt and join (cement or stitch) at each side. When sides of assembly are stitched, the stitchline shall be 1/8 to 3/16 inch (3.2 to 4.8mm) from the side edges.	301	SSbd	8-10	B or E	B or E
	e. Tack each lower corner of flap welt assembly with a 1/4 to 3/8 inch (6.4 to 9.5mm) bartack, positioned 1/8 to 3/16 inch (3.2 to 4.8mm) from side and bottom edges. The bartack shall be parallel to the sides (ends) of flap.	Bartack		21-28 per bartack	B or E	B or E

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
7.	Assemble and attach pocket and flap.- (cont'd)					
	f. Using a template, cement a bias cut 15/16 to 1 1/16 inches (23.8 to 27.0mm) wide "V" strip of basic material (see 3.3.1) to the sides and bottom edges on inside of pocket piece. One half the width of "V" strip shall overlap the pocket piece edge, and shall be cemented black side to black side. The ends of the "V" strip shall extend 1/2 to 5/8 inch (12.7 to 15.9mm) beyond pocket piece onto pocket flap.					
	NOTE: As an alternate, the V-strip may be cemented to the left front before joining to the pocket.					
	g. Cement top of pocket flap to left front of overalls as indicated by marks on pattern.					
	h. Stitch top of pocket flap to left front of overalls with two rows of 1/4 inch (6.4mm) gauge stitching. The outer row of stitching shall be 1/16 to 1/8 inch (1.6 to 3.2mm) from top folded edge.	301	SSa-2	8-10	B or E	B or E
	i. The two rows of stitching shall be closed at each end with a 1/4 to 3/8 inch (6.4 to 9.5mm) bartack, or with a single row of stitching at each end. Rectangular box stitching may also be used.	Bartack or Backstitch		21-28 per bartack 8-10	B or E	B or E
	j. Cement pocket piece and "V" strip to left front of overalls.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
7.	Assemble and attach pocket and flap.- (cont'd)					
	k. Tack pocket flap to left front at each side of flap with a 1/4 to 3/8 inch (6.4 to 9.5mm) bartack, centered between the two previously stitched bartacks and 1/8 to 3/16 inch (3.2 to 4.8mm) from each side edge. Bartack shall be parallel to ends (width) of flap, and shall not catch the "V" strip in the stitching.	Bartack		21-28 per bartack	B or E	B or E
	1. Cut a piece of strapping approximately 1-1/2 by 11 inches (3.8 by 27.9cm) from the basic material specified in 3.3.1, and cement solid to the underside of the left front pocket piece black side to black side covering all visible pocket flap stitching including the bartacks.		LSbj			
8.	Fly assembly.-					
	a. Turn under one lengthwise edge of the left and right fly extension piece approximately 3/8 inch (9.5mm), and cement solid black side to black side.		EFa			
	b. Cement black side of right front over face side of right fly extension piece (unfolded edge), where indicated by pattern marks.		LSa			
	c. Cement left fly extension piece (unfolded edge) over left front face to face where indicated by pattern marks. The cemented area shall be 3/4 to 1 inch (19.1 to 25.4mm) in width.		SSa			
	d. Cement the fronts forming the front center seam, right front over left front.		LSa			

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 202610-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
8.	Fly assembly.- (cont'd)					
	e. Cement the right and left fly extension pieces at the top and bottom edges black side to black side, approximately 3/8 inch (9.5mm) in width.		SSa			
	f. Fold the fly extension pieces lengthwise as indicated by pattern marks, and cement face side to face side approximately 3/8 inch (9.5mm) in width.					
	g. Fold the fly extension pieces to the fronts lengthwise, and cement face side to face side approximately 3/8 inch (9.5mm) in width.					
	h. Tack each corner with a 1/4 to 3/8 inch (6.4 to 9.5mm) horizontal bartack, 1/8 to 3/16 inch (3.2 to 4.8mm) from the top and side edges.	Bartack		21-28 per bartack	B or E	B or E
	i. The finished fly shall measure 1-1/2 to 2 inches (3.8 to 5.1cm) in width.					
9.	Attach facings and suspender straps.-					
	a. Cement solid the right back over the left back, to form the center back seam.		LSa			
	b. Cement solid the back and front facing piece on the left inside of overall as indicated by pattern marks, black side to black side.		SSa			
	c. Cement solid the back facing and front facing pieces on the right inside of overall as indicated by pattern marks, black side to black side.		SSa			

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
9.	Attach facings and suspender straps.- (cont'd)					
	d. Fold top edge of front bib under as indicated by pattern marks, and cement solid black side to black side.		EFa			
	e. Attach two buttons (see 3.3.2) through the top folded edge of front bib where indicated by pattern marks.					
	f. Cut the suspender straps from the material specified in 3.3.5, 31 1/4 to 31 3/4 inches (79.4 to 80.7cm) in length. Bias cut one end of the straps (approximately 45^{0} angle), and gum the ends with cement to prevent raveling.					
	g. Slit each end of the back bib on the fold line, 1 3/4 to 1 5/8 inches (3.5 to 4.1cm) in length. Fold under the back bib as indicated by pattern marks, inserting the squared end of the suspender straps between the plies and perpindicular to the folded edge of the bib, passing through the slits 1 3/8 to 1 5/8 inches (3.5 to 4.1cm). Cement solid the assembly together.					
	h. Stitch each strap end with a 1 inch (2.5cm) square cross-box-stitch, with the stitching through the cloth plies (see figure 2).	301	Crossbox stitch	8-10	B or E	B or E
10.	Attach gusset and waist (side closure) tab assembly.-					
	a. When a two piece gusset is applicable, cement the gusset halves together as indicated by pattern marks.		LSa			

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 202610-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
10	Attach gusset and waist (side closure) tab assembly.- cont'd)					
	b. Cement the gusset to the overalls at right side seam top opening, with the edges of the overall over gusset as indicated by pattern marks.		LSa			
	c. Bartack bottom of gusset at "V" opening with a 1/4 to 3/8 inch (6.4 to 9.5mm) horizontal bartack, centered across the seam.	Bartack		17-28 per bartack	B or E	B or E
	d. Cement the outer surface of the gusset reinforcement patch on the black side, and join to the inside of overalls with the patch positioned horizontally across the tapered end of the gusset bottom as indicated by the pattern. The bartack shall be completely covered by the gusset reinforcement patch.		LSbj			
	e. Cement tab assembly (black side of reinforcement patch) to the top of right back where indicated by pattern marks.					
	or					
	f. Stitch the straight end of the tab to top of right back where indicated by pattern marks, with a 1 inch (2.5cm) square cross-box-stitch.	301	Cross-box-stitch	8-10	B or E	B or E
	g. Cement solid black side of adjustment patch assembly to right front, so that the waist tab overlaps 7/8 to 1 1/8 inches (22.3 to 38.6mm) when the gusset is closed in the normal position.					
	or					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
10.	Attach gusset and waist (side closure) tab assembly.- (cont'd)					
	h. Stitch the adjustment patch assembly to the right front 1/16 to 1/8 inch (1.6 to 3.2mm) from all outer edges, so that the waist tab overlaps 7/8 to 1 1/8 inches (22.3 to 38.6mm) when the gusset is closed in the normal position.	301	LSjb	8-10	B or E	B or E
11.	Attach hanger loop.-					
	a. Fold the hanger loop in thirds lengthwise, cementing solid each fold.					
	or					
	b. Fold the hanger loop in thirds lengthwise, and stitch each lengthwise fold 1/16 to 3/16 inch (1.6 to 4.8mm) from the edge.	301		8-10	B or E	B or E
	c. Position and center the hanger loop across the center back seam on inside of overalls and approximately 1 5/8 inches (4.1cm) below the top edge of back bib. Tack each end with two 1/4 to 3/8 inch (6.4 to 9.5mm) vertical bartacks, 1/8 and 3/8 inch (3.2 and 9.5mm) from the edges respectively.	Bartack		21-28 per bartack	B or E	B or E
	d. The hanger loop free opening shall finish not less than 3 inches (7.6cm) in length.					
12.	Complete legs and attach leg (side closure) tab assembly.-					
	a. Cement the left front to the left back, front overlapping back to form left leg inseam.		LSa			

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
12.	Complete legs and attach leg (side closure) tab assembly.- (cont'd)					
	b. Cement the right front to the right back, front overlapping back to form right leg inseam.		LSa			
	c. Cement solid the black side of the crotch reinforcement patch to the face side of the overalls at intersection of crotch seams.		LSbj			
	d. Turn under each leg bottom 1/2 to 3/4 inch (12.7 to 19.1mm), and cement solid black side to black side to form leg hems.		EFa			
	e. Cement tab assemblies (black side of reinforcement patch) to legs where indicated by pattern marks.		LSbj			
	or					
	f. Stitch the straight end of leg tabs to the leg where indicated by pattern marks, with a 1 inch (2.5cm) square cross-box-stitch.	301	Cross-box-stitch	8-10	B or E	B or E
	g. Cement solid black side of adjustment patch assemblies to each leg, so that each leg tab overlaps 7/8 to 1 1/8 inches (22.3 to 38.6mm) when closed.					
	or					
	h. Stitch the adjustment patch assembly to each leg 1/16 to 1/8 inch (1.6 to 3.2mm) from all outer edges, so that the leg tab overlaps 7/8 to 1 1/8 inches (22.3 to 38.6mm) when closed.	301	LSbj	8-10	B or E	B or E
	NOTE: The bottom edge of the adjustment patches shall finish parallel to the leg bottom.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table I - Construction of overalls (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
13.	Label.- Cement the combination identification - size - instruction label or print label inscription directly on inside of overalls, centered across the center back seam and approximately 6 1/2 inches (16.5cm) below the top edge.					
14.	Vulcanization.- The assembled overall shall be fully vulcanized using a heat curing or pressure vulcanizing process.					
15.	Suspender straps and buckles.- Thread bias cut ends of suspender straps through buckles. CAUTION: This operation shall not be performed prior to vulcanization.					
16.	Cleaning.- a. Trim all thread ends to less than 1/2 inch (12.7mm). b. Clean all removeable spots, stains, and shade size markings on outside of overalls, taking care not to damage coating in the process.					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

* 3.8 Measurements.- The finished overalls shall conform to the dimensions as specified in table II. All measurements and tolerances are expressed in inches and shall be taken with the overall laid smooth and flat. To convert from inches to centimeters, multiply by 2.54.

Table II - Finished measurements

Measurement	Size						Tolerance
	XX Small (26-28)	X Small (30-32)	Small (34-36)	Medium (38-40)	Large (42-44)	X-Large (46-48)	
Waist width (A)	16	18	20	22	24	26	± ½
Front Length (B)	49½	50	51½	53	53¼	54½	± 1
Side seam length (C)	41¼	42½	43 3/4	45	45¼	46½	± 1
Inseam length (D)	26½	27½	28½	29½	29½	30½	±½
Leg bottom width (E)	9¼	9½	9 3/4	10	10¼	10½	±¼

NOTE: A thru E refer to Figure 1.

A. Measurement shall be taken across bottom of bib, folded edge to folded edge.
B. Measurement shall be taken from top edge of bib to bottom edge of leg opening.
C. Measurement shall be taken along right side seam, from top edge to bottom edge of leg opening.
D. Measurement shall be taken along inseam, from top edge at crotch to bottom edge of leg opening.
E. Measurement shall be taken across bottom edge of leg opening, folded edge to folded edge.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

* 3.9 End item performance testing.- The vulcanized cemented seams shall conform to the requirements specified in table III when tested as specified in 4.4. The requirements specified do not refer to stitched or strapped seams.

Table III - Requirements for cemented seams in end item

Characteristic	Requirement	
	Average (min.)	Individual (min.)
Seam strength, lbs 1/	150	100
Seam adhesion, lbs/1 inch width 2/	5.0	4.0
Hydrostatic resistance, lbs/sq inch 3/		
Initial	100	50
After 1 dry cleaning	80	50
After 3 launderings	80	50

1/ Metric conversion: To convert pound force/inch to newton (N), multiply by 4.45.
2/ Metric conversion: To convert pound force/inch width to newton/2.5cm, multiply by 4.45.
3/ Metric conversion: To convert lbs/sq inch to pascal (Pa), multiply by 6894 (6.894×10^3).

3.10 Coating repairs on overalls.-

* 3.10.1 Black coated side (inside) Pinholes and uncoated areas of any type shall be repaired either before or after curing the assembled overalls with the black coating compound specified in 3.3.1. When overalls are repaired after curing, the repair compound shall be formulated to cure at room temperature. The size of the inside repair shall not exceed 3/4 inch (19mm) in length and width. The number of repairs allowed per overalls on the black coated side shall not exceed four. The repairable area shall be coated with a minimum of two coats of the repair compound. The first coat shall completely wet out the defective area and shall be thoroughly worked into the surface. The second coat shall be spread on smoothly and evenly over the first coating. After the compound is dry, the repaired area shall be lightly dusted with the dusting powder specified in 3.3.9. When fully cured, there shall be no lifting of the edges; cracking; flaking; or removal of the repair compound from the inside repaired area when subjected to a flexing action between the hands.

* 3.10.2 Green coated side (outside) Any area where the nylon base fabric is exposed, shall be touched-up (hidden) before or after curing with a suitably thinned solution of the green coating compound specified in 3.3.1. When overalls are repaired after vulcanization, the touch-up solution shall be formulated to cure at room temperature. Only the minimum amount of solution necessary to hide the uncoated area shall be applied. The number of repairs allowed per overalls on the green coated side, shall not exceed two. The color of the repaired areas shall be a good match to the surrounding coating.

3.11 Workmanship.- The finished overalls shall conform to the quality established by this specification. The occurrence of defects shall not exceed the applicable acceptable quality levels.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection.- Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to the prescribed requirements.

4.1.1 Certificate of compliance.- Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 First article inspection.- When required, the first article submitted in accordance with 3.2, shall be inspected as specified for compliance with design, construction, workmanship, and dimensional requirements.

4.3 Inspection.- Inspection shall be in accordance with MIL-STD-105, except where otherwise indicated herein.

* 4.3.1 Component and material inspection.- In accordance with 4.1 above, components and materials shall be inspected and tested in accordance with all the requirements of referenced specifications, drawings, and standards unless otherwise excluded, amended, modified, or qualified in this specification or applicable purchase document. A certificate of compliance shall be furnished for the material identification of the chloroprene cement (see 3.3.3), for the dusting medium characteristics specified in 3.3.9, and that the overalls have been vulcanized (see 3.6.4). In addition, components and materials listed in table IV shall be tested for the characteristics specified and in accordance with FED-STD-191 whenever applicable. All test reports shall contain the individual values utilized in expressing the final result. For the cloth, coated, nylon twill (vulcanized), the lot size shall be expressed in yards and the sample size shall be 3 continuous yards (2.7m) full width. The sample size shall be as follows:

Lot size (yards or meters)	Sample size
800 or less	2
801 up to and including 22,000	3
22,001 and over	5

The lot shall be unacceptable if one or more units fail to meet any requirement specified.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table IV - Component testing

Component	Characteristic	Requirement paragraph	Test Method
Cloth, coated, nylon twill (vulcanized)	Blocking	3.3.1	
	Breaking strength	3.3.1	
	Weight	3.3.1	1/
	Tear strength	3.3.1	
	Hydrostatic resistance	3.3.1	
	Flex stiffness	3.3.1	
	Adhesion of coating	3.3.1	
	Resistance to heat	3.3.1	
Cement, chloroprene	Seam adhesion	3.3.3	5960 2/

1/ Three yards (2.7m) of unvulcanized cloth shall be cured under conditions similar to those used on the end item, and shall be tested to meet the requirements specified in paragraph 3.3.3.4 of MIL-C-19759 for type II vulcanized cloth.

2/ Cemented seam specimens shall be prepared in accordance with 3.6.2, except that the seam shall overlap 1 1/4 inches (3.2cm). After vulcanization, a 1 inch (2.5cm) wide by 6 inch (15.2cm) long strip shall be marked and cut from the overlapped seam in the length direction.

4.3.2 Examination of the end item.- Examination of the end item shall be in accordance with 4.3.2.1 and 4.3.2.2. The applicable inspection levels and acceptable quality levels (AQL's) shall be as indicated in 4.3.2.3. The sample unit shall be one finished overall. The lot size shall be expressed in units of overalls.

4.3.2.1 Visual examination.-

Defect	Classification Major	Minor
I Material Defect(s) or Damage(s)		
A. Cloth, coated, nylon		
1. Any hole, cut, tear, or burn		X
2. Any pinhole, blister, lump, or imbedded foreign matter		X
3. Any weak or thin area		X
4. Permanent crease or wrinkle		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Defects	Classification Major	Minor
I Material Defect(s) or Damage(s) (cont'd)		
5. Any pick off or uncoated area	X	
6. Any tackiness	X	
7. Coating soft, i.e. not fully cured	X	
8. Any brittle area, i.e. coating cracks when bent	X	
9. Abraded or scuffed, resulting in a weak place or coating removal	X	
10. Any stitched mend or cemented cut patch	X	
11. Any objectionable odor other than that which is characteristic of the coating compound.		X
II Cleanness		
1. Any permanent spot, stain, streak, or assembly marking on any outside portion of the overalls which would be visible when worn		
- Up to 1/2 inch (12.7mm) inclusive in diameter or length		X
- 1/2 inch (12.7mm) or more in diameter or length	X	
2. Any size permanent spot, stain, streak, or assembly marking not visible on outside when overall is worn, e.g. on the pocket welt or the underside of the pocket flap		X
3. Two or more removable spots, stains, streaks, or assembly markings on outside of overalls		X
4. Six or more thread ends not trimmed to less than 1/2 inch (12.7mm)		X
5. Cement on any area other than where specified		X
6. Excessive dusting powder distributed over seams, patches, and/or strapping on outside only		X
7. Excessive dusting powder on any area other than seams, patches, and/or strapping on outside only		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Defects	Classification Major	Minor
III Components and Assembly (unless otherwise classified)		
1. Any component part omitted, misplaced, damaged, or otherwise defective	X	
2. Any required operation omitted	X	
3. Any required operation not as specified		X
4. Any component part not as specified, (type, size, color, etc.)	X	
IV Cutting		
- Any part not cut in accordance with directional lines indicated on patterns or not in accordance with specification requirements.	X	
V Shaded part(s)		
- Any outside part badly shaded, except those parts which may be cut from ends		X
VI Repaired area(s)		
1. Repair compound on coated fabric cracks, i. e. lifts off or flakes when coated fabric is flexed between the hands		X
2. Repair compound not smoothly or evenly applied		X
3. Repair compound does not cover defective area		X
4. Repaired area not dusted		X
5. Size of repair more than 3/4 inch (19.1mm) in length and width		X
6. Repaired areas number more than four (4) on black side or more than two (2) on green side		X
7. Color of repaired area on green side not good color match		X
VII Seams and Stitching		
A. General		
1. Any seam twisted, puckered, or pleated	X	
2. Any part of overall caught in an unrelated cementing or stitching operation		X

Source: https://assist.dla.mil -- Downloaded: 202610-19T13:58Z
Check the source to verify that this is the current version before use.

Defects	Classification Major	Minor
VII Seams and Stitching (cont'd)		
B. Cemented seams, patches, and strapping		
1. Poorly rolled forming:		
a. An open tunnel		
(1) Extending up to 1/2 the width of the seam, patch, or strapping		X
(2) Extending for more than 1/2 the width of seam, patch, or strapping	X	
b. A permanent pucker, wrinkle, fold, or closed tunnel		X
2. Seam overlapped less than 1/2 inch (12.7mm) or more than 3/4 inch (19.0mm)		X
3. Direction of seam lap other than specified		X
4. Any loose or unaffixed edge with a:		
a. Length:		
(1) Up to 1/4 inch (6.4mm) inclusive		X
(2) More than 1/4 inch (6.4mm)	X	
b. Depth:		
(1) Up to 1/8 inch (3.2mm) inclusive		X
(2) More than 1/8 inch (3.2mm)	X	
5. Dusting powder omitted or improperly applied causing adhesion between two surfaces	X	
6. Visible cement line more than 3/8 inch (9.5mm) in width for more than 1/2 the length of seam		X
7. Excessive cement resulting in adhesion of surfaces that were not required to be cemented	X	
C. Stitched seams		
1. Stitching margin not as specified		X
2. Ends not securely tacked		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Defects	Classification Major	Minor
VII Seams and Stitching (cont'd)		
3. Any open seam (see note)		
a. -1/4 to 1/2 inch inclusive (6.4 to 12.7mm)		X
b. -more than 1/2 inch (12.7mm)	X	
NOTE: One or more broken stitches or two or more continuous skipped or runoff stitches constitute an open seam.		
4. Loose tension resulting in a loosely secured seam		X
5. Tight tension (stitches break when normal strain is applied in the direction of the seam or stitching.)	X	
D. Stitches per inch (score only when condition exists on more than 1/2 the length of seam)		
1. One stitch less than the minimum or any number in excess of the maximum specified		X
2. Two or more stitches less than the minimum specified	X	
E. Seam and stitch types		
1. Not specified seam or stitch type	X	
2. Any line of stitching not beginning or not ending where specified		X
3. Any required line of stitching omitted	X	
F. Bartack(s)		
1. Missing or misplaced; not serving intended purpose	X	
2. Not size specified		X
3. Insecure or loose stitch tension		X
VIII Hems		
1. Puckered, twisted, or pleated		X
2. Irregular in width by 1/4 inch (6.4mm) or more		X
3. Width of hem on leg bottom less than 1/2 inch (12.7mm)	X	
4. Width of hem on leg bottom more than 3/4 inch (19.1mm)		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Defects	Classification Major	Minor
IX Hanger loop		
1. Omitted	X	
2. Misplaced or distorted:		
a. Not sewing intended purpose	X	
b. Serving intended purpose		X
3. Insecurely attached		X
4. Free opening of hanger loop less than 3 inches (7.6cm) in length		X
X Buttons		
1. One or both omitted, broken, or otherwise defective	X	
2. One or both misplaced, loose, not positioned or attached as specified		X
XI Leg tab(s) and adjustment patch(s) assemblies		
1. Leg tab or adjustment patch omitted or insecurely attached	X	
2. Leg tab or adjustment patch misplaced or distorted:		
a. Not serving intended purpose	X	
b. Serving intended purpose		X
3. Leg tab or adjustment patch with a loose or unaffixed edge:		
a. Up to 1/4 inch (6.4mm) inclusive in length or depth		X
b. 1/4 inch (6.4mm) or more in length or depth	X	
4. Leg tab overlaps adjustment patch less than 7/8 inch (22.3mm) or more than 1-1/8 inches (38.6mm) when finished		X
XII Suspender straps		
1. Omitted	X	
2. Straight end of one or both straps insecurely attached	X	
3. Free end of one or both straps not cut on a bias		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Defects	Classification Major	Minor
XII Suspender straps (cont'd)		
4. Free end of one or both straps not cement dipped, as evidence by raveling		X
5. Finished length of one or both straps less than 30 inches (76.2cm) in length, when measured from the top edge of back bib to top edge of free end.		X
XIII Facings		
1. The one piece back and front facing piece on left side or the back and front facing pieces on the right side omitted or insecurely attached	X	
2. Outside of overall puckered, twisted, or pleated by facing piece or pieces	X	
3. Any facing piece twisted or distorted:		
a. Not affecting appearance on the outside of overalls		X
b. Affecting appearance on the outside of overalls	X	
4. Any facing piece irregular in width by 1/4 inch (6.4mm) or more		X
5. Edge of any facing piece not even with the outer edge of overalls by more than 3/32 inch (2.4mm)		X
XIV Fly assembly		
1. Fly twisted or distorted	X	
2. Fly opens to left side of overalls		X
3. Finished fly less than 1-1/2 inches (3.8cm) or more than 2 inches (5.1cm) in width		X
XV Buckles		
1. One or both omitted, broken, or otherwise defective	X	
2. One or both not conforming to the size, configuration or finish as specified (see 3.3.7 and figure 3)	X	
XVI Waist tab and adjustment patch assembly		
1. Waist tab or adjustment patch omitted	X	
2. Waist tab or adjustment patch misplaced or distorted:		
a. Not serving intended purpose	X	
b. Serving intended purpose		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Defects	Classification Major	Minor
XVI Waist tab and adjustment patch (cont'd)		
3. Waist tab or adjustment patch with a loose or unaffixed edge:		
a. Up to 1/4 inch (6.4mm) inclusive in length or depth		X
b. 1/4 inch (6.4mm) or more in length or depth	X	
4. Waist tab overlaps adjustment patch less than 7/8 inch (22.3mm) or more than 1-1/8 inches (38.6mm) when finished		X
XVII Pocket and flap assembly		
1. Pocket piece or flap piece(s) as applicable set on crookedly or poorly shaped	X	
2. "V" strip omitted or misplaced	X	
3. Pocket welt or flap piece(s) as applicable, irregular in width by 1/4 inch (6.4mm) or more		X
4. Any component part of pocket assembly on outside of overalls, twisted; puckered; or pleated	X	
5. Edges of pocket flap pieces when applicable, not even with each other		X
XVIII Label		
1. Omitted, incorrect, or illegible	X	
2. Misplaced		X
3. Not cemented (when applicable)		X

* 4.3.2.2 Dimensional examination.- The overalls shall be examined for defects in dimensions in accordance with the following:

a. Any measurement deviating from nominal dimensions and tolerances as specified in table II, shall be scored as a size measurement defect.

b. Leg inseam lengths unequal in length by 1/2 inch (12.7mm) or more, shall be scored as a size measurement defect.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

4.3.2.3 Inspection levels and acceptable quality levels (AQL's).- The inspection levels and the acceptable quality levels, expressed in defects per 100 units for visual and dimensional examination, shall be as follows:

	Inspection level	AQL's Major	AQL's Total
For defects applicable to 4.3.2.1	II	2.5	15.0
For defects applicable to 4.3.2.2	S-3	-	4.0

* 4.3.3 Examination of packaging requirements.- An examination shall be made to determine that packaging, packing, and marking complies with the Section 5 requirements of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully prepared for delivery except that it need not be closed. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the end item inspection lot. The inspection level shall be S-2 and the AQL shall be 2.5 defects per 100 units.

Examine	Defect
Marking (exterior and interior)	Omitted, incorrect, illegible, of improper size location, sequence or method of application.
Materials	Any component missing, damaged, or not as specified.
Workmanship	Inadequate application of components, such as incomplete closure of container flaps, improper taping, loose strapping, inadequate stapling, bulging or distortion of container, open and noncontinuous heat sealed seams of polyethylene bag, or incorrectly fabricated bag.
Content	Number of overalls per shipping container is more or less than specified.

* 4.4 End item testing.- The methods of testing specified in FED-STD-191 whenever applicable and as listed in table V, shall be followed. Tests shall be conducted on cemented seams cut from three finished overalls randomly selected for each assembled shipping lot. Failure of any of the specimens tested to meet either the individual or average test requirements shall be cause for rejection of the lot. Test reports shall contain the individual test values.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

Table V - End item testing of cemented seams

Characteristic	Requirement paragraph	Test method	Number of tests per garment
Seam strength, initial	3.9	5100 1/	4
Seam adhesion, initial	3.9	5960 2/	3
Hydrostatic			
Initial	3.9	5512 3/	2
After 1 dry cleaning	3.9	5508 and 5512 3/	2
After 3 launderings	3.9	5556 and 5512 3/	2

1/ A 4X6 inch (10.2 X15.2cm) test specimen shall be cut from an outside side seam, a leg inseam, and a center back seam. The seam shall be centered equidistant from the clamps at right angles to the direction of the load application.

2/ The result shall be calculated to the nearest 0.1 pound per inch by dividing the actual width of the seam tested into the actual test result recorded in pounds.

3/ Water pressure shall be applied to the lightly (green) coated side, with the seam centered directly over the opening of clamp.

5. PACKAGING

5.1 Preservation-packaging.- Preservation-packaging shall be level A or Commercial as specified (see 6.2).

* 5.1.1 Level A.- Each pair of overalls, folded as specified below, shall be inserted into a clear polyethylene film bag of 0.0015 inch (0.038mm) thickness (+ 25 percent tolerance). The bag shall be formed with heat sealed seams that are straight, continuous and parallel to each other and the formed edges of the bag. The bag may be fabricated from polyethylene film tubing or sheeting. The final closure of the bag shall be heat sealed, with the heat seal made as close as possible to the open end. A 1/4 inch (6.4mm) diameter hole shall be made at one corner of the bag to allow excess air to escape. Alternatively, the final closure of the polyethylene bag may be accomplished by means of a tuck or reverse flap.

Method of Folding;

(1) Secure leg and waist adjustment assemblies.
(2) Lay overall flat, face-side up.
(3) Place shoulder straps inside the overalls.
(4) Fold the overall in half lengthwise, with the outer edges even and the fly inside the fold.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

5.1.1 Level A (cont'd)

(5) Fold seat portion of overall in, so that the width of the overall is approximately 11 inches (27.9cm).
(6) Fold top edge of overall down approximately 17 inches (43.2cm).
(7) Fold the leg portion up approximately 6 inches (15.2cm).
(8) Fold the bottom edge up to the top edge of overall, to finish approximately 11 by 15 inches (27.9 by 38.1cm).

5.1.2 Commercial packaging.- Overalls shall be preserved packaged to afford adequate protection against physical damage during shipment from the supply source to the first receiving activity. The contractor may use his standard practice when it meets this requirement.

5.2 Packing.- Packing shall be level A, B, or Commercial as specified (see 6.2).

* 5.2.1 Level A.- Thirty (30) overalls, of one size only and packaged as specified in 5.1, shall be packed in a solid fiberboard shipping container conforming to type SF, class weather-resistant, grade V2s, size 3A, of MIL-B-17757. The fiberboard for the box liner shall conform to type CF, class weather-resistant, variety DW, grade V15c, of MIL-B-17757. Level A packages shall be packed flat in two (2) tiers of fifteen (15) each, with each package reversed end to end and the length of the package parallel to the end panels of the container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Toward the end of the contract, or when there are less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

* 5.2.2 Level B.- Thirty (30) coveralls, of one size only and packaged as specified in 5.1, shall be packed in a corrugated fiberboard shipping container conforming to type CF, class domestic, grade 275, size 3A, of MIL-B-17757. The fiberboard for the box liner shall conform to type CF, class domestic, variety DW, grade 200, of MIL-B-17757. Level A packages shall be packed flat in two (2) tiers of fifteen (15) each, with each package reversed end to end and the length of the package parallel to the end panels of the container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Toward the end of the contract, or when there are less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.2.1 Weather-resistant fiberboard container.- When specified (see 6.2), the shipping container shall be a grade V3C, V3s, or V4s fiberboard box fabricated in accordance with MIL-B-17757 and closed in accordance with the appendix of the box specification.

Source: https://assist.dla.mil -- Downloaded: 20260-19T13:58Z
Check the source to verify that this is the current version before use.

* 5.2.3 Commercial packing Overalls, preserved-packaged as specified in 5.1, shall be packed in a manner to insure carrier acceptance and safe delivery at destination at the lowest transportation rate for such supplies. Containers shall be in accordance with the U. S. Postal Service Manual, Uniform Freight Classification Rules, or National Motor Freight Classification Rules, as applicable.

5.3 Marking.- In addition to any special marking required by contract or order, shipping containers shall be marked in accordance with MIL-STD-129.

* 5.3.1 Polyethylene bagged packaged.- Polyethylene bagged packages shall have the following information legibly printed or stamped in black directly on the bag across the center face or on a white paper label inserted within the bag so as to permit ready identification.

OVERALLS, WET WEATHER:
STOCK NO:
SIZE:
QUANTITY:

5.3.2 Labels, mixed sizes.- Each shipping container, packed with mixed sizes, shall have securely attached to the end and side directly under the printing or stenciling, a white paper label 5 by 4 inches (12.7 by 10.2cm) with the words "MIXED SIZES" plainly printed or stamped thereon and under these words shall be legibly printed or stamped the correct quantity and sizes container therein.

6. NOTES

6.1 Intended use.- The waterproof overalls are intended for use in conjunction with the wet weather parka, for protection of Military personnel working in wet or wet/cold conditions.

6.2 Ordering data.- Procurement documents should specify the following:

a. Title, number, and date of this specification
b. Sizes required (see 1.2)
c. First article requirements (see 3.2)
d. Selection of applicable levels of packaging and packing (see 5.1 and 5.2)
e. When weather-resistant grade fiberboard shipping containers are required for level B packing (see 5.2.2.1)

6.3 Samples.- For access to samples, address the procuring office issuing the invitation for bids.

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

* 6.4 Changes from previous issue.- The margins of this specification are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notation. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.


Custodians:
Navy - SA
Air Force - 99

User activities:
Navy - YD, MC, CG

Preparing Activity:
Navy - SA

Project No. 8405-0717


Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

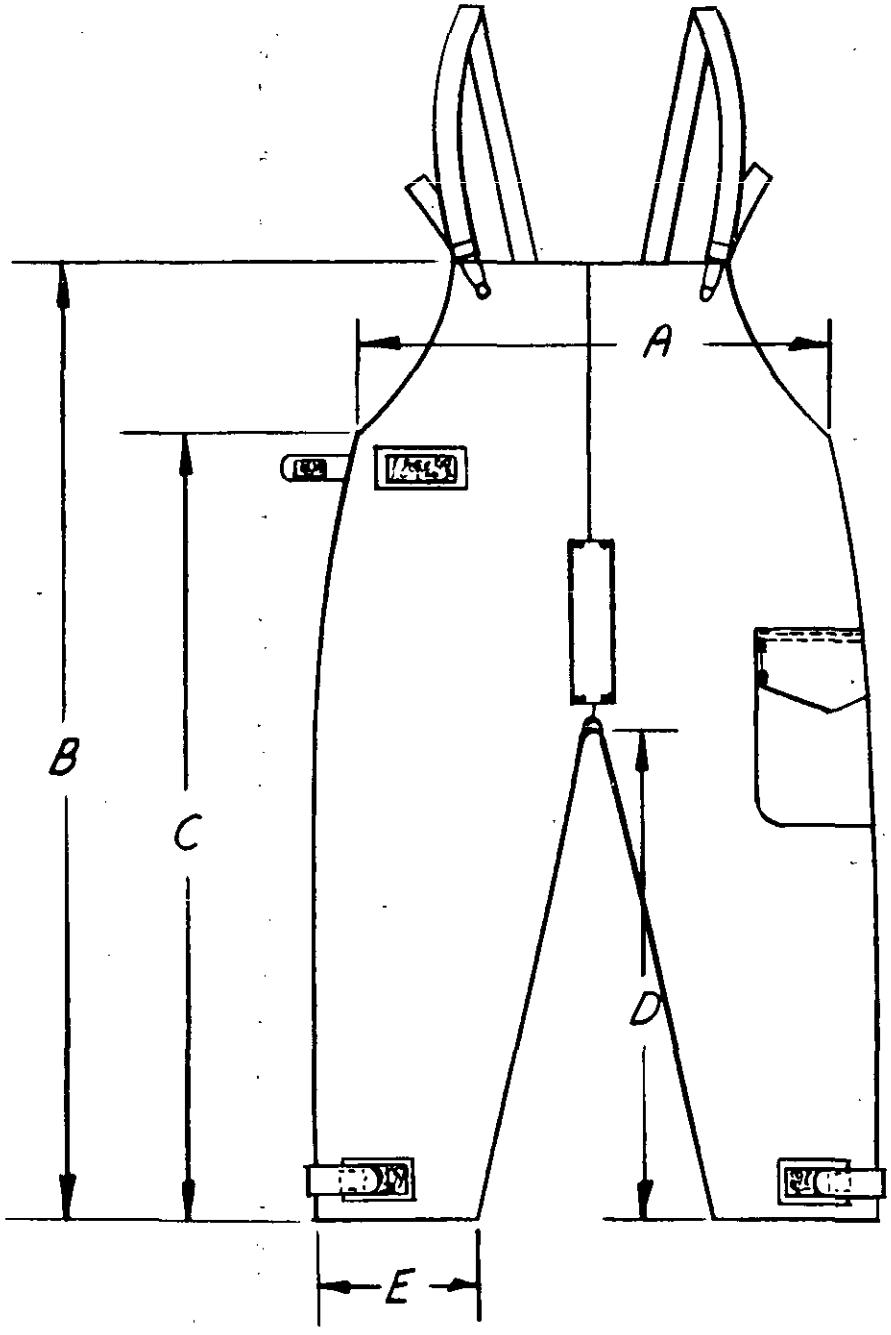

FRONT VIEW

FIGURE 1-OVERALLS, WET WEATHER


Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

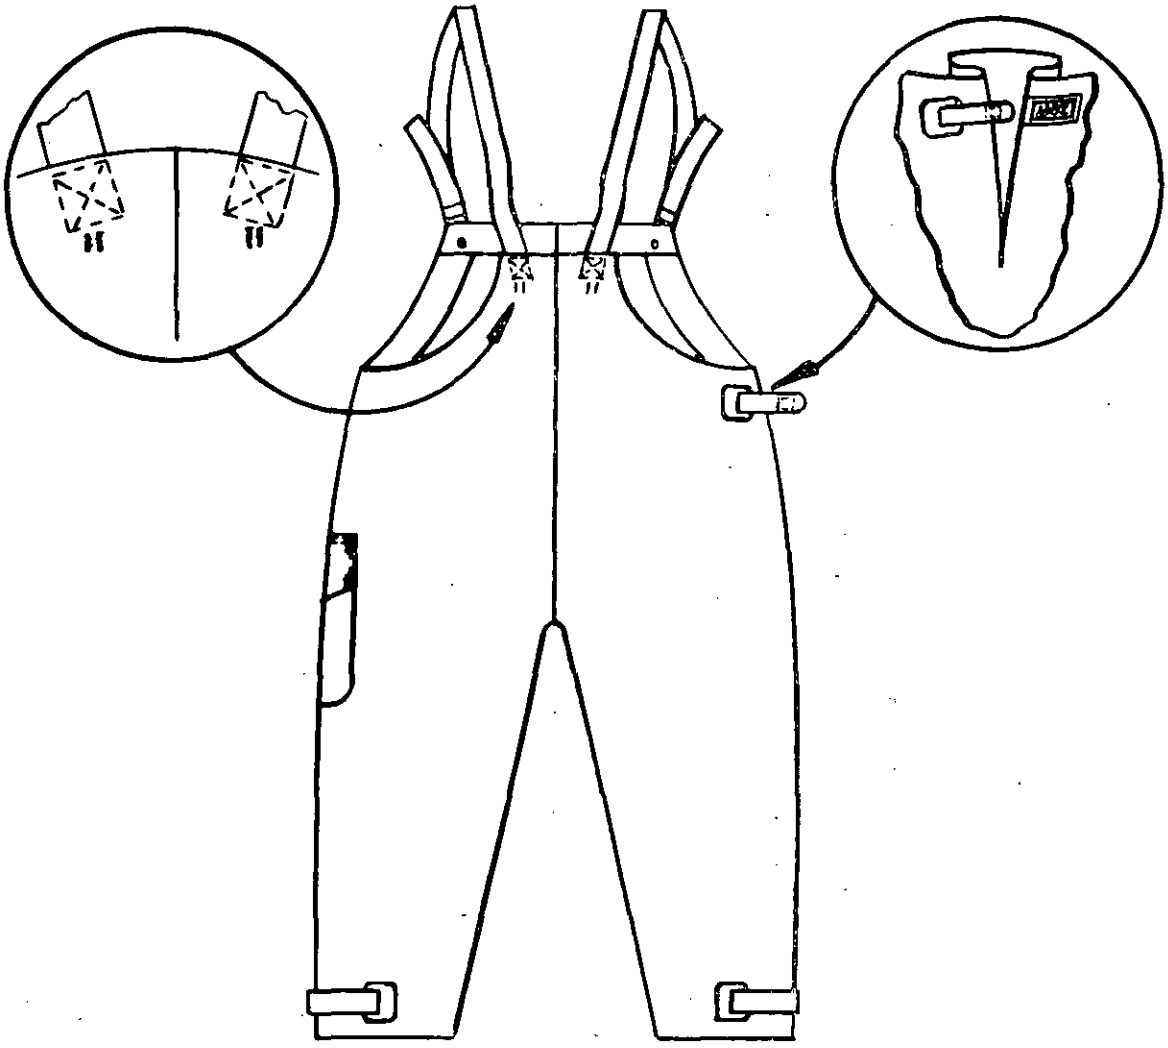

REAR VIEW

FIGURE 2-OVERALLS, WET WEATHER


Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

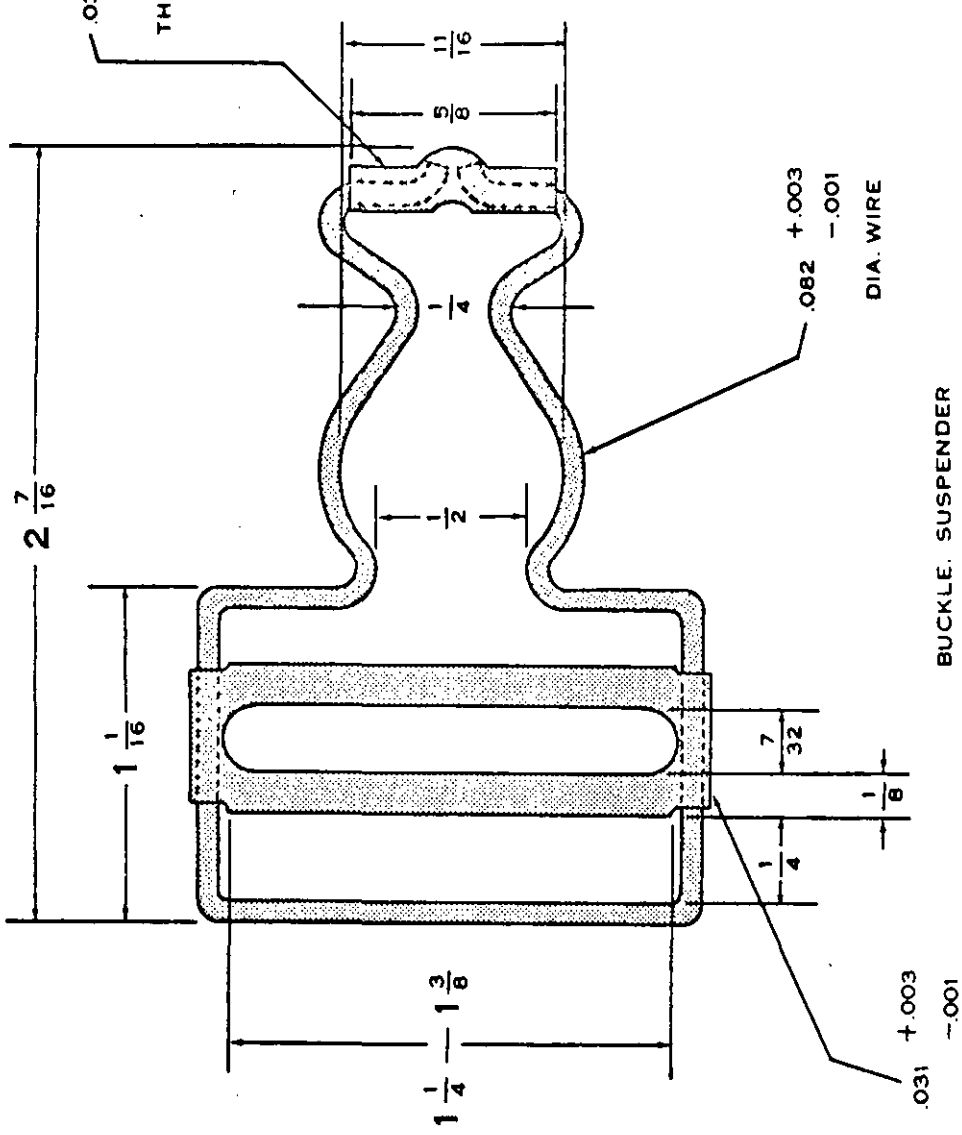


NOTE: TO CONVERT TO METRIC SYSTEM, MULTIPLY INCHES BY 25.4 TO FIND MILLIMETERS

FIGURE 3 - OVERALLS, WET WEATHER

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

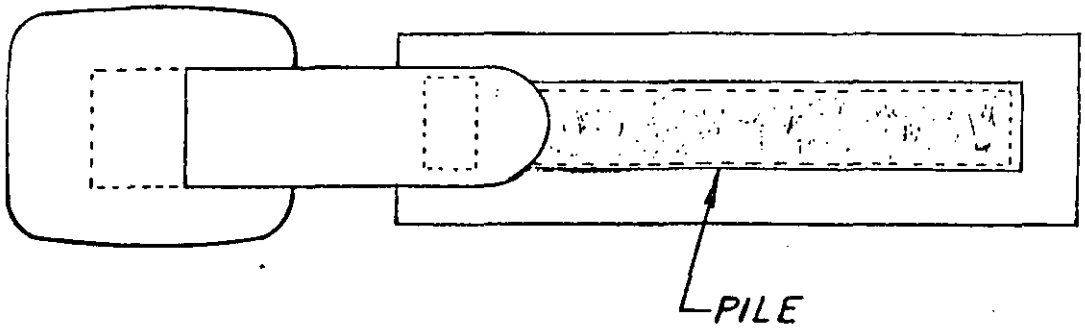

TOP VIEW

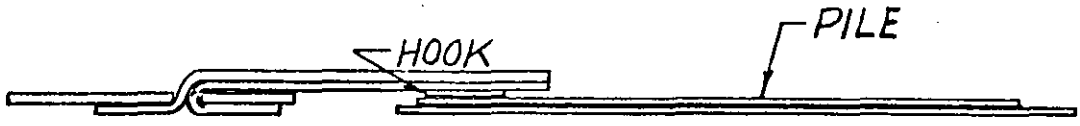

SIDE VIEW

LEG AND WAIST
ADJUSTMENT STRAP ASSEMBLY
FIGURE 4 - OVERALLS, WET WEATHER

☆U.S. GOVERNMENT PRINTING OFFICE: 1978 — 703-122/652

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.
NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-O-22776C OVERALLS, WET WEATHER

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1426 1 OCT 76 — *Replaces edition of 1 Jan 72 which may be used.* — *S/N 0102-LF-001-4260*

Source: https://assist.dla.mil -- Downloaded: 202610-19T13:58Z
Check the source to verify that this is the current version before use.

FOLD

Officer in Charge
Navy Clothing and Textile Research Facility
21 Strathmore Road, Natick, Mass. 01760

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

POSTAGE AND FEES PAID
DEPARTMENT OF THE NAVY
DoD-316



Officer in Charge
Navy Clothing and Textile Research Facility
21 Strathmore Road, Natick, Mass. 01760

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:58Z
Check the source to verify that this is the current version before use.