INCH-POUND

MIL-C-29380D
10 SEPTEMBER 1990
SUPERSEDING
MIL-C-29380C(MC)
29 December 1988

MILITARY SPECIFICATION

COAT, ALL-WEATHER, MEN'S

This specification is approved for use by U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirement for a man's all-weather coat.

1.2 Classification. The all-weather coats shall be one type in the following classes and sizes, as specified (see 6.2).

1.2.1 Class.

Class 1 - Marine Corps Pewter 2246
Class 2 - Marine Corps Blue 2324
Class 3 - Army Black 385

1.2.2 Sizes.

Extra Short(XS)	Short(S)	Regular(R)	Long(L)	Extra Long(XL)
	30	30		
32	32	32	32	
34	34	34	34	34
36	36	36	36	36
38	38	38	38	38
40	40	40	40	40
42	42	42	42	42
	44	44	44	44
	46	46	46	46
		48	48	48

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commanding General (PSE-C), Marine Corps Research Development and Acquisition Command, Washington, D. C. 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. The following specifications and standards form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation (see 6.2).

SPECIFICATION

FEDERAL

A-A-203	- Paper, Kraft, Untreated
A-A-50083	- Bag, Plastic Folded Garment
A-A-50198	- Thread, Gimp, Cotton, Buttonhole
A-A-50199	- Thread, Polyester, Cotton-Covered and Polyester-Covered
V-B-871	- Button, Sewing Hole, and Button, Staple, (Plastic)
V-F-106	- Fasteners, Slide, Interlocking
V-T-276	- Thread, Cotton
DDD-L-20	- Label: for Clothing, Equipage, and Tentage (General Use)
PPP-F-320	- Fiberboard: Corrugated and Solid, Sheet Stock (Container Grade), and Cut Shapes

MILITARY

MIL-B-371	- Braid, Textile, Tubular
MIL-B-1860	- Buckle, Slide, Plastic
MIL-T-3530	- Thread and Twine, Mildew Resistant or Water Repellant Treated
MIL-P-15011	- Pallet Material Handling, Wood Post Construction, 4-way Entry
MIL-B-17757	- Box, Shipping, Fiberboard (Modular Sizes)
MIL-C-21852	- Cloth, Taffeta, Nylon
MIL-C-29363	- Cloth, Poplin, Polyester and Cotton (Water Repellent)
MIL-L-35078	- Loads, Unit: Preparation of Semiperishable Substance Items; Clothing, Personal Equipment and Equipage; General Specification for
MIL-C-43525	- Cloth, Satin, Acetate or Rayon Face and Rayon or Cotton Back
MIL-C-44192	- Containers, Shipping and Storage, Coat (Hanger Pack)
MIL-C-44296	- Cloth, Fusibles

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams, and Stitching

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	- Marking for Shipment and Storage
MIL-STD-147	- Palletized Unit Load
MIL-STD-731	- Quality of Wood Members for Containers and Pallets
MIL-STD-1494	- Provisions for Evaluating Quality of Raincoat

(Unless otherwise indicated, copies of federal and military specifications and standards are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094.)

2.1.2 Other Government documents and publications. The following other Government documents and publications form a part of this specification to the extent specified herein. Unless otherwise specified, the issues are those cited in the solicitation.

Department of Defense Standard Color Card for Sewing Threads
Department of Defense (DOD) Standard Shades for Buttons 1966

Quartermaster Standard Shades of Slide Fastener Tapes

(Application for copies may be obtained from the Color Association of the United States, Inc., 343 Lexington Avenue, New York, New York 10016.)

2.2 Non-Government publications. The following document forms a part of this specification to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DoDISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DoDISS are the issues of the documents cited in the solicitation (see 6.2).

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

D3951 - Standard Practice for Commercial Packaging

(Application for copies should be addressed to the American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103-1187.)

(Non-Government standards and other publications are normally available from teh organizations that prepare or distribute the documents. These documents also may be available in or through libraries or other informational services.)

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Standard samples. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

3.2 First article. When specified in the contract or purchase order, a sample shall be subjected to first article inspection and approval (see 4.4 and 6.3).

3.3 Materials.

3.3.1 Basic fabric. The fabric shall be 65 percent polyester/35 percent cotton poplin cloth, with a durable water repellent finish conforming to MIL-C-29363.

3.3.2 Shell Lining. The material for the bias cut binding for the back edge of the facing, edges of liner, bottom edges of sleeve liner and for lining the sleeves shall be nylon taffeta, 1.9 ounce conforming to type IV of MIL-C-21852 in Marine Corps pewter shade to approximate the shade of the basic fabric for class 1 coats and black for classes 2 and 3 coats.

3.3.3 Coat Liner. The material for the liner shall be rayon or cotton back satin cloth conforming to type II of MIL-C-43525 except that the color shall be Marine Corps pewter shade to approximate the shade of the basic fabric for class 1 coats and black for classes 2 and 3 coats.

3.3.4 Material for hanger loop. The hanger loop shall be made of the basic fabric specified in 3.3.1 or shall be cotton or rayon braid that conforms to type IX, class 1, of MIL-B-371. Color shall match shade of basic fabric.

3.3.5 Interlining. The interlining for the front facing, front flap, topcollar, collar stand, pocket welts, shoulder straps, sleeve straps, sleeve turnup, and belt shall be a nonwoven fusible cloth of 85% polyester, 15% polyamide or 100% polyester 1.75 to 2.0 ounces per square yard, polyamide dot equal to or better than Pellon Style 8416, 8335 or Handler Style No. 71915. The color shall be charcoal for class 1 and charcoal or black for classes 2 and 3.

3.3.6 Fusible tape. The fusible tape for the seams (center back and side seams) shall conform to type IX, style A, class 1 or 2 of MIL-C-44296.

3.3.7 Slide fastener. The slide fastener for the liner shall conform to type IV, style 1, size L, short tab pull, aluminum chain of V-F-106. The length of the slide fastener shall conform to the below listing. The tape shall be cotton warp and nylon filling 7/16 to 3/4 inch wide. All the components of the slide fastener shall be aluminum and from the same supplier. As an alternate, a 100 percent texturized polyester tape conforming to V-F-106 may be used.

LENGTH OF SLIDE FASTENERS

Size of Coat	Length in Inches				
	Extra Short	Short	Regular	Long	Extra Long
30		77	77		
32	77	77	80	80	
34	77	77	80	80	84
36	77	77	80	84	84
38	77	80	80	84	84
40	77	80	80	84	87
42	80	80	84	84	87
44		80	84	87	87
46		84	84	87	87
48			84	87	87

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

3.3.7.1 Color and colorfastness. The slide fastener tape shall be shade AH, Cable No. 66533, sage green for the class 1 and black shade G, Cable No. 66507 for classes 2 and 3 coats. The tape shall show colorfastness to wet dry cleaning equal to or better than the standard sample (see 6.3). If a standard sample is not furnished, the slide fastener tape shall have good colorfastness to wet dry cleaning. (See Quartermaster Standard Shades of Slide Fastener Tapes.)

3.3.8 Buckles. The plastic buckle for the belt shall be a 2-1/4-inch general purpose buckle conforming to class 2 of MIL-B-1860. The color shall be green AF Cable No. 62017 for class 1, blue BV Cable No. 62002 for class 2 and black Cable No. CT62001 for class 3 coats. (See DOD Standard Shades for Buttons 1966).

3.3.9 Buttons. The buttons shall conform to type II, class D of V-B-871 in the following styles and sizes:

	Style	Sizes
Front, inside anchor	20 or 21	45
Sleeve, shoulder strap	20 or 21	30
Sleeve liner and belt	20 or 21	24
Stay	15	
Extra buttons (class 3 only)	20 or 21	30 and 45

The buttons shall have a glossy finish and shall be green shade AF Cable No. 62017 for class 1, blue BV Cable No. 62002 for class 2 and black Cable No. CT62001 for class 3 coats. (See DOD Standard Shades for Buttons 1966).

3.3.10 Thread.

3.3.10.1 Polyester/cotton covered. The thread shall be dyed shade taupe A, Cable No. 66030 for class 1, and shade blue AB, Cable No. 66044 for class 2 and shade black AA, Cable No. 66043 for class 3 coats and shall conform to MIL-T-43548. The thread shall be water repellant treated in accordance with type II, class 3 of MIL-T-3530.

Use	Number	Ply
Seaming, stitching, buttonholes, buttons and bartacks	50 or 70	2 or 3
Buttons sewing	30	2 or 3

3.3.10.2 Cotton. The cotton thread shall conform to V-T-276, type IC2, mercerized finish, Ticket No. A, 3 ply for all seaming, stitching and overedge stitching on the removable liner and for stitching the binding on the front and neck facing of the coat. The color of the thread shall be taupe A, cable No. 66030 for class 1 coats, blue shade AB Cable No. 66044 for class 2 coats and shade black AA, Cable No. 66043 for class 3. Polyester/cotton covered thread may be used as an alternate.

3.3.10.3 Colorfastness. The dyed thread shall show fastness to wet dry cleaning and light equal to or better than the standard sample when tested as specified in V-T-276 or A-A-50199. When no standard sample is available, the dyed thread shall show "good" fastness to wet dry cleaning and light when tested as specified in V-T-276 or A-A-50199.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

3.3.11 Gimp. The cotton gimp for reinforcing the buttonholes shall be dyed shade taupe A, Cable No. 66030 for Class 1, shade blue AB, Cable No. 66044 for Class 2 and shade black AA, Cable No. 66043 for class 3 coats and shall conform to type I or II, size 8 of A-A-50198.

3.3.11.1 Colorfastness. The dyed gimp shall show fastness to dry cleaning equal to or better than the standard sample, when tested as specified in A-A-50199. When no standard sample is available, the dyed gimp shall show "good" fastness to dry cleaning when tested as specified in A-A-50199.

3.3.12 Labels

3.3.12.1 Combination label. Each coat shall have a combination identification and instruction label conforming to type VI, Class 14 of DDD-L-20. The printing shall show fastness to dry cleaning and shall bear the following inscription:

NOMENCLATURE: Coat, Man's, All Weather
FIBER CONTENT: Polyester (65%), Cotton (35%)
CONTRACT NO: DLA-100-00-0-0000 (Example)
STOCK NO: 8405-00-000-0000 (Example)
NAME OF CONTRACTOR:

CLEANING INSTRUCTIONS
DRY CLEAN ONLY

3.3.12.2 Size label. Each coat and liner shall have a separate size label conforming to type VI, Class 2 of DDD-L-20 and shall bear the following inscription:

Size: 36R (Example)

The length (Extra Short, Short, Regular, Long and Extra-Long) may be abbreviated as follows: XS, S, R, L, or XL.

3.4 Design. The class 1 and 2 coat shall be the U.S. Marine Corps design shown on Figures 1 through 6, and the class 3 coat shall be U.S. Army design shown in Figures 2 through 7. The coats have a double breasted front model with belt and buckle, button throat closure, chest flap, shoulder straps, sleeve straps, two hanging pockets, center back vent with inner flap, half cape back and zip out liner and shall be water repellent finished. The class 3 coats shall have extra buttons sewn on the inside facing.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard patterns except that additional notches for use during construction are permitted on the working patterns. Also, minor modifications are permitted where necessary when using automatic equipment. These modifications shall not alter the dimensional serviceability or appearance requirements cited in this specifications. The standard patterns shall provide 1/4-inch allowance for seams at the edge of shoulder strap, collar, sleeve straps, belt, and facing to front; 3/8-inch allowance for sleeves, sleeve lining, setting sleeves, shoulder seams, collar stand to neck; 3/8-inch allowance for all seams in the liner, except as otherwise specified in Table 1. Standard

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:40Z
Check the source to verify that this is the current version before use.

patterns show size, seam allowances, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts.

3.5.1 Pattern parts. Coats shall be cut from the material specified herein in accordance with the pattern parts indicated below.

Item	Pattern Nomenclature	No. of cut parts
	Material: Basic fabric	
1.	Front	2
2.	Back	2
3.	Front facing	2
4.	Top sleeve	2
5.	Top sleeve (cap)	2
6.	Under sleeve	2
7.	Collar	2
8.	Collar stand	2
9.	Front lining (yoke)	1
10.	Back lining (yoke)	1
11.	Outside back (yoke)	2
12.	Hanging Pocket (back)	2
13.	Hanging Pocket (front)	1
14.	Belt	1
15.	Back vent facing	2
16.	Front flap (upper right) (gunpatch)	2
17.	Pocket Welt	2
18.	Sleeve Strap	4
19.	Shoulder Strap	1
20.	Neck facing	2
21.	Pocket facing (cord)	
	Material: Lining	
22.	Top sleeve	2
23.	Under sleeve	2
	Material: Interlining	
24.	Front facing	2
25.	Belt	1
26.	Shoulder strap	2
27.	Pocket welt	2
28.	Collar	1
29.	Collar stand	1
30.	Sleeve strap	2
31.	Neck facing	1
32.	Top sleeve reinforcement	2
33.	Under sleeve reinforcement	2
34.	Front flap (upper right)(gunpatch)	1
	Material: Liner	
35.	Front	2
36.	Back	1
37.	Top sleeve	2
38.	Under sleeve	2
	Marker	
39.	Lapel	
40.	Button and Buttonhole	
41.	Button and Belt fastener	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:40Z
Check the source to verify that this is the current version before use.

3.6 Construction. The coat shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I. The manufacturer will not be required to follow the exact sequence of operations as listed. The thread and the fabric shall not be lubricated by any means prior to or during the seaming.

3.6.1 Stitches, seams, and stitching. The stitch, seam, and stitching type specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. If two or more methods or seam or stitch types are given for the same part of an operation, any one of them may be used. Where stitch type 401 is used, the looper (under thread) shall be on the inside of the outer shell of the coat and on the side of the liner that will face the outer shell in the finished coat. Seams shall be sewn so that no raw edges, run offs, twists, pleats, puckers, or open seams will result. All seams shall start and finish evenly. Thread tension shall be maintained so that the stitching will not be tight or loose. Unless otherwise specified herein, raise stitching or edge stitching shall be 1/16 inch from the edge and 1/4-inch gage. The stitching for safety stitch construction shall be 3/8-inch gage. The guides and knives on the safety switch machine shall be set to trim only the ravelled ends of the fabric. Seams required to be worked out having a depth between the fold of 1/16 inch or more shall not be acceptable. The ends of all seams and stitchings not caught by other seams and stitching shall be backtacked not less than 1/2 inch. Thread breaks of stitch Type 301 shall be secured by stitching back of the break not less than 1/2 inch. Thread breaks or skipped stitches in stitch Type 401 shall be backstitched not less than 1 inch with the stitching superimposed and anchoring the ends of the break. When automatic equipment is authorized for use, minor modifications are permitted where necessary. These modifications shall not alter the dimensional, serviceability or appearance requirements cited in this specification.

3.6.2 Shade marking. The component parts of the coat cut from one piece of basic material and lining material shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

a. Corrosive metal fastening devices.
b. Adhesive type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets.

3.6.3 Fusing operations. The fusing operation for fusing the fusible interlining specified in 3.3.5 to the basic fabric of the outer shell specified in 3.3.1 should be performed on a fusing press. Specific settings (see 6.7) for the particular fusible style and press to be used should be obtained from the supplier of the fusible material so that the optimum results can be obtained.

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:40Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1.	Cutting. a. Cut the coat in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction indicated by the pattern. The pattern has markings for placement of pockets, buttonhole sizes, seam allowance and notches for proper assembly of all, parts. Unless otherwise specified, place the directional lines of the patterns in the warp direction of the material. c. Unless otherwise specified herein, cut all parts that are made of the basic fabric specified in 3.3.1 from the same piece of material. The under collar leaf, the underside of the shoulder straps, the hanging pocket, the front lining (yoke), the back lining (yoke), the under collarstand, the top sleeve cap, the hanger loop and the belt loop keeper and fastener may be cut from ends. The parts cut from ends shall approximate the shade of the outer shell. The front lining (yoke) and the back lining (yoke) shall match each other. d. Cut the stripping 2 inches wide for the hanger, belt loops, belt keeper and belt fastener in the direction of the warp. The finished width of the stripping shall be 1/2 ± 1/16 inch wide.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1.	Cutting. (cont'd) e. Cut the parts of the liner of the fabric specified in 3.3.3 in accordance with the directional lines on the pattern. When pairs of sleeve linings are cut from ends, the shade of the lining in each pair shall match. f. Cut all interlining parts in accordance with the patterns. g. Cut the binding for both the outer shell and the liner on the bias 1-1/8-inches wide. h. Cut sleeve lining in accordance with pattern. When cut from ends, the shade of each pair shall match. i. Drill holes for marking pockets and darts shall be permitted provided extreme care is taken in placement of drill holes and that no drill holes are visible on the outside of finished coats. Visible drill holes shall be scored as a major defect.					
2.	Replacement of damaged parts. a. Remove any parts containing material defects or workmanship damages that are classified as defects in MIL-STD-1494 from production during the spreading, cutting and manufacturing process and replace with nondefective and properly matched parts.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
2.	Replacement of damaged parts. (cont'd) b. Replace at time of cutting any parts of coat containing holes or serious weakening defects such as smashes, multiple floats, loose or weakening slubs, etc., expected to develop into holes, shade bars and dye streaks or unsightly slub, etc. affecting appearance. c. Replace any parts damaged during the manufacturing process by needle chews which may develop into a hole, scissor or knife cuts, tears, holes, mends or burns in the material affecting appearance.					
3.	Shade marking. a. Mark or ticket (see 3.6.2) all component parts to insure a uniform shade throughout the coat and the proper assembling of all parts. b. If shade marking is used, the marking shall not show through and be visible on the outside of the coat. c. The use of tickets with any metal fastening devices or sew-on shade tickets is prohibited.					
4.	Make shoulder straps. a. Position the shoulder strap interlining on the top ply of each shoulder strap and fuse (see 3.6.3).					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
4.	Make shoulder straps. (cont'd)					
	b. Join the top ply of each shoulder strap (with interlining) to the underply of the shoulder strap along the sides and across the neck end. Trim the corners and turn seam to the edges. Stitch each shoulder strap with double stitch seam 1/16 inch from the edge and 1/4-inch gage.	301 or 401 and 301	SSe-3 (a) SSe-3 (a) SSe-3 (b)	10-12 10-12 10-12	50 50 50	50 70 50
	c. Make a 7/8-inch eyelet-end square-bar type buttonhole in each shoulder strap, positioned midway with the inside edge of the eyelet 5/8 to 3/4 inch from the pointed end. The buttonhole shall not be off center by more than 1/8 inch.	Buttonhole		50-54 per buttonhole including tack	50	50
5.	Make sleeve strap.					
	a. Position the sleeve strap interlining on each ply of sleeve strap and fuse (see 3.6.3).					
	b. Fold strap in half lengthwise and stitch along side raw edge and point. Trim, turn and work out edges. Double stitch sides and point 1/16 inch from the seamed and folded edges and 1/4 inch gage.	301 or 401 and 301	SSe-3 (a) SSe-3 (a) SSe-3 (b)	10-12 10-12 10-12	50 50 50	50 70 50
	c. Overedge stitch raw edge of strap.	503 or 504	EFd-1 EFd-1	6-12 6-12	50 50	50 50
	d. Make a 7/8-inch eyelet-end square-bar type buttonhole in each strap positioned midway; the inside edge of the eyelet shall be 5/8 to 3/4 inch from the pointed end. The buttonhole shall not be off center by more than 1/8 inch.	Buttonhole		50-54 per buttonhole including tack	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6.	Make collar.					
	a. Fuse the collar interlining to the respective collar parts (see 3.6.3).					
	b. Stitch the undercollar to the topcollar around the side and the top edged with 1/4-inch seam.	301	SSe-3 (a)	10-12	50	50
		or 401	SSe-3 (a)	10-12	50	70
	c. Trim, turn and force out the edges of the collar. Double stitch the collar 1/16 inch from the turned edges and 1/4-inch gage.	301	SSe-3 (b)	10-12	50	50
7.	Make collarstand and attach collar.					
	a. Position collarstand interlining on both plies of collarstand and fuse (see 3.6.3).					
	b. Position the collar between the collarstand and the under collarstand, with the raw edges even and notches matching, and stitch along the top edge of the collarstand with 1/4-inch seam.	301	SSq-2 (a)	10-12	50	50
		or 401	SSq-2 (b)	10-12	50	70
	c. Turn down collarstand and stitch 1/16 inch from raised edge.	301	LSq-2 (b)	10-12	50	50
	d. Position the hangar loop on the center of the top collarstand. Turn the ends of the hangar loop under 3/8 inch and bartack. The bartack shall be 1/2 ± 1/16 inch long. Finished length of hangar loop shall be 2 3/4 inches.	Bar tack		28 per Bar tack	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	MDL	BOB/ LPR
7.	Make collarstand and attach collar. (cont'd)					
	e. Stitch the bottom edge of the top collarstand and the under collarstand together. The finished collar shall be 2-7/8 ± 1/8-inches wide at the center back.	301	SSa-1	10-12	50	50
8.	Make pocket welt.					
	Finished appearance. The welts shall be uniformly made and stitched.					
	a. Position welt interlining to the inside of each welt and fuse (see 3.6.3).					
	b. Fold welt in half lengthwise face-to-face and close each end of the welt with a 1/4-inch seam.	301	SSe-2 (a)	10-12	50	50
	c. Turn welt, completely working out seamed edges and corners.					
	d. Double edgestitch the welt uniformly 1/16-inch from the turned and folded edges and 1/4-inch gage.	301	SSe-3 (b) and OSf-1	10-12	50	50
	e. On the finished coat, the length of the welt shall be 8 ± 3/16-inches for all sizes.					
9.	Make hanging pocket.					
	Finished appearance. The pocket shall finish flat and smooth without twists, puckers, or raw edges. The stitching shall be uniform in width. The tongue notch shall not be exposed.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9.	Make hanging pocket. (cont'd)					
	a. The hanging pocket shall be made of two plies of basic material.					
	b. Cut the opening (when not cut in cutting room) in front part of pocket as indicated by mark on pattern. Tongue notch bottom end of opening.					
	c. Position the combination identification and instruction label at the outside center of left hanging pocket, approximately 1 inch above the bottom edge of pocket. The labels shall be positioned on that part of pocket against the body of the wearer. Stitch label to pocket 1/16 to 1/8-inch from each edge.	301	SSa-1 (each edge)	10-12	50	50
	d. Position the two plies of hanging pocket, face-to-face, with the raw edges even except the front. Join the two plies together 1/8-inch from the raw edges with the upper raw edge of the back opening turned back 3/16-inch and caught in the stitching.	301	SSe-2 (a)	10-12	50	50
	e. Trim seam and corners for better turning. Turn the pocket, working out the seamed edges and corners.					
	f. Edgestitch the entire pocket 3/16 to 1/4-inch from seamed edges. Continue to stitch the turned edge to the body of the pocket 1/16 to 1/8-inch from folded edge. The stitching shall extend the length of the opening.	301 and 301	SSe-2 (b) seamed edges) LSd-1 (back edge of opening)	10-12 10-12	50 50	50 50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9.	Make hanging pocket. (cont'd)					
	g. Close the front of the pocket with 1/4-inch seam from raw edge.	301	SSe-2 (a)	10-12	50	50
10.	Make front upper flap (gun-patch).					
	a. Position the front upper flap interlining on the underside of the top ply of the front upper flap and fuse (see 3.6.3).					
	b. Position the top ply of the front upper flap to the underply face-to-face with edges even. Seam the two plies together along the front and bottom edges with 1/4-inch seam. The line of stitching shall be from the step at the gorge (neck edge) to the arm-hole edge.	301	SSe-2 (a)	10-12	50	50
		or 401	SSe-2 (a)	10-12	50	70
	c. Turn the flap right side out, forcing the seam to the edge. Stitch the flap with double edge stitching 1/16 inch from the seamed edge and 1/4-inch gage.	301	SSe-3 (b)	10-12	50	50
11.	Set welt, facing, upper flap and hanging pocket to front.					
	Finished appearance. The welt, facing, upper flap and hanging pocket shall be set to the fronts smooth and flat, without twists, puckers, raw edges, or distortions. The gage of stitching shall be uniform. The tongue notches of the pocket opening in fronts shall not be exposed.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
11.	Set welt, facing, upper flap and hanging pocket to front. (cont'd)					
	a. The pocket opening may be cut prior to setting of pocket welt and hanging pocket to fronts (when not cut in cutting room).					
	b. Mark fronts for position of the pocket in accordance with marks in the pattern.					
	c. Position welt on outside of fronts with raw edges in line with the mark and with the folded edge of welt towards the front. Join welt to fronts with a 1/8 to 3/16-inch seam. Tongue notch pocket opening in fronts at top and bottom ends.	301	SSq-2 (a)	10-12	50	50
	d. Position hanging pocket on the outside of fronts with the raw edge even with the edge of pocket opening. Seam pocket to welt and front with a 1/4-inch seam.	301	SSe-2 (a)	10-12	50	50
	e. Fold facing in half lengthwise, with right side out. Position facing on outside of fronts at the back edge of pocket opening with raw edges even. Seam facing to pocket opening 1/4-inch from raw edges.	301	SSe-2 (a)	10-12	50	50
	f. Turn facing to inside of pocket opening and edgestitch 1/16 to 1/8-inch from seamed edge.	301	SSe-2 (b)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
11.	Set welt, facing, upper flap and hanging pocket to front. (cont'd)					
	g. Turn pocket and raw edge of welt through opening to inside. Smooth out the pocket and pocket welt and stitch the fronts 1/16-inch from raised edge through welt and front part of pocket.	301	SSq-2 (b)	10-12	50	50
	h. Stitch top and bottom ends of welt to the fronts through the hanging pocket from the raised seam at front edge of welt to the back edge of welt. Stitch diagonally to outer corner of top stitching of the welt and continue on the line of topstitching at each end of the welt to the stitching at the seam. Continue on the line of stitching of the raised seam to the outer row and backtack approximately 1/2-inch along the outer row. The outer row of stitching at top and bottom ends of welt shall be uniformly 1/16-inch from the ends.	301	LSa-2	10-12	50	50
	i. Place the front over the pocket smooth and flat and stitch the front to the pocket (full length of pocket) 1/8-inch from the front raw edge of the coat.	301	SSa-1	10-12	50	50
	j. Trim the excess pocket material even with the front edge of coat when necessary.					
	k. Position front upper flap to the upper right front with raw edges of flap even with gorge, shoulder and armhole edges. Stitch flap to front 1/8 to 1/4-inch from raw edge.	301	SSa-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12.	Assemble front facing.					
	a. Position the front facing interlining on the separate front facings, with raw edges even and notches matching, and fuse (see 3.6.3).					
	b. Position the neck facing interlining on the neck facing with lower edges even and fuse (see 3.6.3).					
	c. Join neck facing to front facing at shoulder with 3/8-inch seam.	301	SSe-2 (a)	10-12	50	50
	d. Press seam open smooth and flat with a heated pressing iron or pressing machine.					
	e. Overedge stitch the seam allowance at the shoulder.	503 or 504	EFd-1	6-12	50	50
	f. Mark a line 1 inch from the back edge of front facing, starting from the bottom edge of facing up to the notch. From that point, continue to mark 1-1/4-inches along the back edge of facing and neck facing for positioning of body lining.					
	g. Bind the back raw edge of the front and neck facing. The finished binding shall be 3/16 to 1/4-inch wide.	301 or 401	BSa-1	10-12	A	A
13.	Make body lining.					
	a. Join front and back yoke lining at the side with 3/8-inch seam.	301	SSe-2 (a)	10-12	50	50

Source: https://assist.dla.mil-Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13.	Make body lining. (cont'd)					
	b. Overedge stitch the side seam allowance together.	503 or 504	EFd-1	6-12	50	50
	- or -					
	c. Operations a and b may be performed in one operation.	515 or 516 or 519	SSa-2	8-10	70	70
	d. Join the front and back yoke lining at shoulder with 3/8-inch seam.	301	SSe-2 (a)	10-12	50	50
	e. Overedge stitch the shoulder seam allowance together.	503 or 504	EFd-1	6-12	50	50
	- or -					
	f. Operations d and e may be performed in one operation.	515 or 516 or 519	SSa-2	8-10	70	70
	g. Hem the bottom edge of front an back yoke lining with raw edge turned under and caught in the stitching 1/16-inch from the folded upper edge of the hem. The hem shall finish 1/2 ± 1/8-inch wide.	301	EFd-1	10-12	50	50
	h. Overedge stitch the body lining along the front and neck edge.	503 or 504	EFd-1 SSa-1	10-12	70	70

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13.	Make body lining. (cont'd)					
	i. Fold the back yoke lining in accordance with notches on the pattern, to form a 3/4-inch wide pleat at the center back. Tack lengthwise along the pleat in line with the notches for a distance of 1 to 1-1/2-inches from the top end.	301	SSa-1	10-12	50	50
	- or -					
	j. Form the pleat in accordance with notches by stitching across top of pleat at neckline. Press the pleat smooth and flat from top to bottom edges of the back yoke lining with heated pressing iron. The folded edge of the pleat on the outside of the back yoke shall be toward the left side.	301	SSa-1	10-12	50	50
14.	Seam facing assembly to body lining.					
	a. Lap the body lining on the inside of facing with the front edge of the lining in line with the mark, the shoulder seams matching, and the finished bottom edge of lining aligned with the notch in the facing. From that point, stitch the body lining to the facing 1/4-inch from the front edge of lining and neck facing.	301	LSa-1	10-12	50	50

Source: https://assist.dla.mil - Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
15.	Make sleeve lining.					
	a. Join the top and under-sleeve lining at the forearm and backarm, respectively, with 3/8-inch seam.	301	SSa-1 (a)	10-12	50	50
	b. Overedge stitch forearm and backarm seam allowance.	503 or 504	EFd-1	6-12	50	50
	- or -					
	c. Operations a and b may be performed in one operation.	515 or 516 or 519	SSa-2	8-10	70	70
16.	Join sleeve lining to body lining.					
	a. Position sleeve lining on the outside of body lining at armhole, with backarm seam of sleeve matching notch in the back, and with notch in top sleeve and fronts matching.					
	b. Join sleeve lining to front and back yoke lining with 3/8-inch seam, turning the edge of shoulder and side seam allowance toward the back.	301	SSa-1	10-12	50	50
	c. Overedge stitch the arm-hole seam allowance together.	503 or 504	EFd-1	6-12	50	50
	- or -					
	d. Operations b and c may be performed in one operation.	515 or 516 or 519	SSa-2	8-10	70	70

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
17.	Make back. Finished appearance. The center back seam of the coat shall be carefully joined without twists, puckers, pleats, or raw edges. The seam shall start and finish evenly. The gage of stitching shall be uniform in width. The left back part shall be over the right back part.					
	a. Place left back on right back, face-to-face, with the raw edge of left back positioned 7/16 (± 1/32) inch back from raw edge of right back. Fold right back seam allowance over staggered left back with fusible tape even with raw edge and stitch thru all plies 1/16 to 3/32-inch from raw edge of right back, simultaneously catching the fusing tape under the line of stitching. Line of stitching and fusing tape shall start approximately 1/4-inch below top of vent to neckline.	301	SSw-2 (a)	10-12	50	50
	b. Fold left back to finished position with the folded edge of back seam facing towards the right back. Topstitch 1/16-inch from folded edge and 1/4-inch gage.	301	SSw-2 (b)	10-12	50	50
	c. Press seam above vent and fuse tape.					
	d. Notch the vent together in diagonal line, from the top end of the vent to the end of joining seam.					
	e. Folding machine may be used.					

Source: https://assist.dla.mil - Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18.	Join back pleat facing to back vent.					
	Finished appearance. The back pleat facing shall be uniformly joined to the left and right back parts at the vent without twists, puckers, gathers, pleats, or raw edges.					
	a. Position the back pleat facing on the left and right back, respectively, with bottom and side edges even.					
	b. Join left and right side of facing, respectively, to right and left back, 1/8-inch from raw edge.	301	SSae-2 (a)	10-12	50	50
	c. Turn the facing back at the seam and edgestitch 1/4-inch from seam edges from bottom of back to top edge of vent.	301	SSae-2 (a)	10-12	50	50
	d. Form triangle. Turn under top edge of facing, forming a point, and seam to back along top edges, 1/16-inch, continuing down sides for a distance of 5/8 to 3/4-inch and continue directly across width of pleat with two rows of stitching 1/4-inch gage, closing pleat. Point of pleat facing shall be centered on center back seam (± 1/8-inch off center tolerance.	301	OSg-3	10-12	50	50
19.	Hem outside back yoke.					
	a. The outside back yoke shall be hemmed with a double row of stitching 1/16-inch from the folded edge using a 1/4-inch gage. The bottom raw edge of the yoke shall be turned under and caught in the stitching. The hem shall finish 3/8 inch in width.	301	EFb-2	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

10	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
19.	Hem outside back yoke. (cont'd)					
	b. Press the back yoke smooth and flat with a heated pressing iron or pressing machine.					
	c. Position the yoke on the outside of the back, with armhole, shoulder and neck edge even and notches matching, and join the yoke to the back 1/8 to 3/16-inch along the armholes, shoulder and neck edge.	301	SSa-1	10-12	50	50
20.	Join front and back at sides.					
	Finished appearance. The side seams of the coat shall be carefully joined without twists, puckers, pleats, or raw edges. The seams shall start and finish evenly. The gage of stitching shall be uniform in width. The back shall be over the fronts.					
	a. Place back on front, face-to-face with raw edge of back positioned 7/16 (± 1/32) inch back from raw edge of front. Fold front seam allowance over back with fusible tape even with raw edge and stitch through all plies 1/16 to 3/32-inch from raw edge of front, simultaneously catching the fusing tape under the line of stitching.	301	SSw-2 (a)	10-12	50	50
	b. Fold back to finished position with folded edge of side seam facing towards front of raincoat. Top stitch 1/16-inch from folded edge and 1/4-inch gage.	301	SSw-2 (b)	10-12	50	50

Source: https://assist.dla.mil - Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20.	Join front and back at sides. (cont'd) c. Press seam to fuse tape. - or - d. A folding machine may be used.					
21.	Make belt loops, belt keeper, fastener and hanger loop. Finished appearance. The finished strips shall be uniform in width, 1/2 ± 1/16-inch wide. a. Make the stripping from the basic material. b. Fold the raw edges to the center with raw edges abutted. Fold over on itself forming the 1/2 inch finished dimension and topstitch 1/16 inch from each outer edge. c. The finished length of the hanger loop shall be 2-3/4-inches. d. Cut the loops for the right side and for the front 4-inches long. e. Cut the loop for the left side 5-1/4-inches long. f. Cut the keeper 5-1/2-inches long. Fold in half end-to-end and join the ends together 1/4 to 3/8-inch from end. The finished keeper shall finish 2-1/2 ±1/8-inches.	301	EFp-2 (modified)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
21.	Make belt loops, belt keeper, fastener and hanger loop. (cont'd)					
	g. Cut the fastener 9-1/2-inches long. Fold one end of fastener 1-1/2-inches and stitch together 1/16 to 1/8-inch from each edge.	301	EFp-2	10-12	50	50
	h. Make a horizontal straight type buttonhole on the fastener, cut 5/8-inch long through the center of the turned under portion with the ends of the buttonhole securely tacked.	Button hole		42-48 not including tack	50	50
	- or -					
	i. A 5/8-inch eyelet-end-square-bar type buttonhole may be used with 50-54 stitches including the bartack.					
	NOTE: A Sonic Machine may be used to cut the strips to the proper length.					
22.	Make belt.					
	Finished appearance. The belt shall finish smooth and flat, without pleats, puckers, twists, or raw edges. The gage of stitching shall be uniform in width. The belt shall finish 2-1/8 ±1/8-inches wide. The belt fastener shall finish on the underside of the belt.					
	a. The belt shall be made of one ply of basic material interlined with fusible material.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22.	Make belt. (cont'd)					
	b. Position the belt interlining to the inside of belt and fuse (see 3.6.3).					
	c. Mark on the outside of the belt the location for sewing belt fastener and button in accordance with pattern marker.					
	d. Turn under the raw end of the fastener 3/8 to 1/2-inch and bartack the fastener to belt 1/8 to 3/16-inch from folded edge. The bartack shall be across the width of the fastener. The fastener, when buttoned, shall be smooth and flat without twist or bulging.	Bar-tack		28 stitches per bar-tack	50	
	e. Sew a 24-line button on the mark to properly engage the buttonhole for the belt fastener.	101 or 301		14-16 per button	30	
	f. Fold belt in half lengthwise with the belt fastener enclosed within the fold. Stitch the entire length of belt 1/4-inch from raw edge.	301	SSa-1	10-12	50	
	g. Close the pointed end with 1/4-inch seam along the slanted edge.	301	SSa-1	10-12	50	50
	h. Trim the pointed end of belt for proper turning. Turn the belt on the right side through the open end, working out the point and seam to the edge.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22.	Make belt. (cont'd)					
	i. Edge stitch both sides and pointed end of belt with a double row of stitching 1/16-inch from seamed and folded edges and 1/4-inch gage.	301	SSe-3 (b)	10-12	50	50
	j. Press belt smooth and flat with a heated pressing iron or pressing machine.					
	k. Position the belt keeper on the belt 6 ± 1/4-inches from the unfinished end. Tack or bartack the keeper to the belt, on each side of seam allowance of keeper, on the under side of belt. Stitch through all plies.	Bar-tack		28 per bar-tack	50	50
	Alternate Method: The bartack may be horizontally across the seam allowance and through all plies.					
	l. Fold unfinished end of belt over the buckle bar 2-3/4 ± 1/4-inches.					
	m. Turn under raw edge and double stitch to belt 1/16 and 1/4-inch gage.	301	EFb-2	12-16	50	50
	Alternate Method: The raw edge of belt may be overedge stitched and double stitched to belt 1/8 to 3/8-inch respectively from folded edge.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22.	Make belt. (cont'd) NOTE: A Sonic Machine may be used to cut the belts to the proper lengths.					
23.	Mark hem turnup. Mark the fronts and back including the center pleat, 1-1/4 inches from the bottom edge for the turnup.					
24.	Set belt loops to mark, shape lapels, and set hanger loop. Finished appearance. The belt loops shall be finished vertically straight and shall be positioned as follows: One loop on each front 1/4-inch above and in line with front pocket seam line. One loop on each side seam in horizontal line with the front loops. The belt loops shall measure 2 1/2 + 1/8-inches long from top to bottom folded edge. The underloop for the belt fastener shall have an opening of not less than 1-1/2-inches. NOTE: Raw edge on bottom of loops shall be stitched to the coat so that the stitching is not visible on the outside of loops. The top portion of the					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

.O	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24.	Set belt loops to mark, shape lapels, and set hanger loop. (cont'd)					
	loop shall be bartacked 1/16-inch from top folded edge. The raw ends of the loop shall not extend more than 1/4-inch.					
	a. Position the 5-1/4-inch long belt loop on the left side seam line, with one end approximately 1-3/4-inches from the bottom mark, and bartack the loop to the coat 1/8 to 3/16-inch from the end of the loop. Bartack the loop through the side seam at the bottom mark to form under loop for the belt fastener. Turn under the top end of the loop and bartack the loop through the side seam 1/16-inch from the top folded edge.	Bar-tack		28 per bar-tack	50	50
	b. Position one end of the 4-inch belt loops on each front and right side seam at the marks and bartack loop 3/16 to 1/4-inch from end. Turn under the top end of the loop and bartack 1/16-inch from top folded edge.	Bar-tack		28 per bar-tack	50	50
	c. Mark the lapels in accordance with lapel marker.					
	d. Position the hanger loop on the center of the top collarstand. Turn the ends of the hanger loop under 3/8-inch and bartack. The bartack shall be 1/2 ± 1/16-inch long. Finished length of hanger loop shall be 2-3/4-inches.	Bar-tack		28 per bar-tack	50	50

Source: https://assist.dla.mil - Downloaded: 20261O-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
25.	Seam shoulders.					
	Finished appearance. The shoulder seams of the coat shall be carefully joined without twists, puckers, pleats, or raw edges. The seams shall start and finish evenly. The gage of stitching shall be uniform in width. The back shall be over the fronts.					
	a. Join back and fronts together at the shoulder with 3/8 inch seams.	301	SSa-2	10-12	50	50
	b. Overedge stitch the shoulder seam allowance together.	301	LSbm-3 (a)	10-12	50	50
	c. Turn and top stitch the back to the fronts at the shoulder 5/16-inch from raised edge.	301	LSbm-3 (b)	10-12	50	50
26.	Set shoulder straps.					
	Finished appearance. The shoulder straps shall be uniform in size and setting. The straps shall lie smooth and flat without twists or fullness.					
	a. Position the shoulder straps, with the pointed end of the strap even with the edge of the gorge and with the notch centered on the shoulder seam.					
	b. Seam the shoulder straps to the coat 1/8 to 1/4-inch from the armhole edge. Trim the shoulder strap even with the armhole, where necessary.	301	SSa-1	10-12	50	50

Source: https://assist.dla.mil Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

O	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
27.	Join collar to coat and attach size label. Finished appearance. The collar shall be carefully joined to the coat without distortion of the collarstand or collar. a. Position the collar on the outside of coat with the neck edges of collar and coat even and the ends of collar in line with lapel notch. b. Join the collar, size label and upper flap to the neck of coat with a 3/16-inch seam. Position the top edge of size label at the center back on the top of collar.	301	SSa-1	10-12	50	50
28.	Join facing-lining assembly to coat. Finished appearance. The facing-lining assembly shall be uniformly stitched to the coat and shall finish smooth and flat without gathers, pleats or puckers. a. Position the facing-lining assembly on the outside of coat with right sides facing each other, with edges even and the notches at the front neck and collar matching. b. Join facing-lining assembly to the coat with a 1/4-inch seam. The stitching shall extend from the back bottom edge of facing, along front edges, on the lapel mark, and the neck, catching the collar, size label and upper flap in the stitching.	301	SSa-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28.	Join facing-lining assembly to coat. (cont'd)					
	c. Press seam open and flat with a heated pressing iron or pressing machine.					
	d. Trim corners of lapel and bottom corners of coat for proper turning. Notch seam allowance along the gorge and neck to allow for proper turning.					
29.	Hem and edgestitch coat.					
	Finished appearance. The edgestitching shall be of uniform width without twists, pleats, or puckers. The bottom hem shall be uniform in width without distortion and shall finish 3/4-inch to 7/8-inch wide.					
	a. Hem the bottom edge of coat with raw edge turned under 3/8-inch and stitch 1/16-inch from the upper folded edge. The stitching shall extend along the back edge of facing, from the upper folded edge of bottom turnup to 1/16-inch above the bottom edge of coat, with facing lapped on the bottom turnup. Continue to edgestitch 1/16-inch along the bottom and front edge up to the end of collar. From that point, continue to stitch the facing-lining assembly to folded edge of collar and collarstand 1/16-inch from raised edge. The underply of the collarstand (turnup) shall not be caught in the stitching.	301	SSe-2 (b) (top and front edge of lapels, front edges and bottom edge of coat) LSa-1 (back edge of facing) EFb-1 (upper folded edge of bottom turnup)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
29.	Hem and edgestitch coat. (cont'd)					
	b. Edgestitch the top and front edge of lapel and along the front edge of coat to the bottom edge of facing 1/16-inch from edge and 1/4-inch gage.	301	SSe-2 (b)	10-12	50	50
30.	Press fronts.					
	a. Press the coat fronts smooth and flat with a heated pressing iron or pressing machine.					
31.	Make sleeve (outer shell).					
	a. Position the sleeve reinforcement interlining at the bottom turnup of the top and upper sleeve, with notches matching, and fuse (see 3.6.3).					
	b. Join the top sleeve cap to top sleeve with 1/8-inch seam.	301	SSa-2	10-12	50	50
	c. Position top sleeve to the under sleeve face-to-face and join together at the back arm 3/8-inch from raw edges, catching the fusing tape in the stitching.	301	SSa-2	10-12	50	50
	d. Turn back the top sleeve and double stitch top sleeve to the under sleeve 1/16-inch from the raised edge and 1/4-inch gage.	301	LSbm-3 (b)	10-12	50	50
	e. Press seam and fuse tape.					

Source: https://assist.dla.mil Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31.	Make sleeve (outer shell). (cont'd)					
	f. Position the sleeve strap to the outside of the under sleeve with the lower edge of the strap aligned with the notch of the sleeve and edges even. Join top and under sleeve together at the underarm with 3/8-inch seam, catching the strap in the stitching.	301	SSa-1	10-12	50	50
	g. Overedge stitch each raw edge of the seam allowance. The end of the sleeve strap shall not be caught in the stitching of the under sleeve seam allowance.	503 or 504	EFd-1	6-12	50	50
	h. Press seam open and flat with a heated pressing iron or pressing machine.					
32.	Set sleeves.					
	Finished appearance. The sleeves shall be uniformly stitched without twists gathers, pleats, puckers or raw edges.					
	a. Position sleeve on outside of coat at the armhole, with notch in armhole edge of back matching backarm seam of sleeve, the notch in the top of sleeve head aligned with shoulder seam line and the notch at armhole edge of fronts and top sleeve matching.					
	b. Join sleeve to armhole with 3/8-inch seam, catching the end of shoulder straps and side seams in the stitching.	301	LSq-2 (a)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
32.	Set sleeves. (cont'd)					
	c. Overedge stitch the raw edge of the armhole and sleeve separately.	503 or 504	EFd-1	6-12	50	50
33.	Stitch lining to sleeves.					
	a. Stitch the sleeve lining to each sleeve at the wrist with two rows of stitching. The first row of stitching shall be 1/4 to 3/8-inch from the sleeve bottom. The second row of stitching shall be parallel to and 1-1/2-inches above the sleeve bottom.	301	SSa-2	10-12	50	50
	b. Overedge stitch the bottom raw edge of the sleeve and sleeve lining separately.	503 or 504	EFd-1	6-12	50	50
	c. Stitch the sleeve lining seam allowance to the outer shell at the underarm seam allowance 2-1/2 to 3 inches from the bottom of each sleeve for a distance of 6 to 6-1/2-inches.	301	SSa-1	10-12	50	50
	d. Position shoulder seam lining and coat even, and stitch along the upper armhole seam allowance of lining and coat together approximately 1-1/2-inches on each side of shoulder seam line.	301	SSa-1	10-12	50	50
	e. Stitch armhole seam allowance of lining and coat together at the base of armhole for a distance of 2-1/2 to 3 inches.	301	SSa-1	10-12	50	50
	f. Turn sleeve right side out.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34.	Set slide fastener on outer shell.					
	a. Position the slide fastener on the outer shell facings so that the ends of the slide fastener will be equidistant from the bottom edge of the outer shell and the separating pin of the slide fastener will be on the right facing. Position the slide fastener on the underside of the outer shell facings with the front edge of the chain 1/8 to 3/16-inch from the bound edge. Turn in the end of the slide fastener tape 1/2 to 3/4-inch. Stitch the length of the slide fastener tape 3/16 to 5/16-inch from the back edge of the chain.	301	SSa-1	10-12	50	50
	b. Press each front smooth and flat with a heated pressing iron or pressing machine.					
35.	Tack facing to hanging pocket.					
	Finished appearance. The facing shall be tacked to the pocket without fullness, gathers or puckers to distort the coat.					
	a. The facing shall be topstitched 1 1/2 inches in from the edge of the binding through both plies of the hanging pocket from the top to the bottom of the pocket.	301	SSe-3 (a)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36.	Attach lining to the coat.					
	Finished appearance. The lining shall be attached to the coat without twists, pulling or distortion to the coat.					
	a. The front yoke lining shall be bartacked through the hem of the lining and the top back corner of the pocket through all plies with a 1/2-inch tack.	Bar-tack or Blind tack		10-12 per tack	50	50
	b. The side yoke linings shall be bartacked through the lining and the sideseam of the coat. Avoid catching the belt loop in the bartack.	Bar-tack or Blind tack		28 per bar-tack 16-20 per tack	50 50	50 50
37.	Make buttonholes.					
	Finished appearance. The buttonholes shall be clean cut, well made and correctly positioned. The buttonhole shall be well worked over gimp to fit a 45-line button. The stitching shall be securely caught in the fabric with the purling on the outside of the left front and on the facing side of the lapels.					
	a. Mark the location for 3 buttonholes on the left front, one buttonhole on the right front, and the location for one buttonhole on each lapel, in accordance with buttonhole marker. The buttonhole for right front shall be top location of left buttonhole marker.					

Source: https://assist.dla.mil - Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
37.	Make buttonholes. (cont'd)					
	b. Make a horizontal eyelet-end square-bar type buttonhole, cut 1-1/4-inches long at each mark of the left and right front on each lapel. The inside edge of the eyelet-end of the buttonhole shall be 3/4-inch from front edge of coat and lapels, with the center of the top buttonhole to be 1-1/2 ±1/8-inches from top edge of lapels.	Button hole		50-54 per buttonhole (minimum not including bartack	50	50
	c. Securely bartack the ends of each buttonhole, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Bartack		21 per bartack	A	A
38.	Press coat.					
	Finished appearance. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired appearance in accordance with good manufacturing practices.					
	a. Press the fronts smooth and flat, straightening and shaping the front edges, the collar and the backs with a heated pressing iron or pressing machine.					
	NOTE: Caution is suggested in the pressure and temperature settings used in pressing to avoid creases and impressions on the finished garment.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39.	Sew buttons on outer shell.					
	a. Mark the position of the buttons, as indicated by the pattern marks, and sew the buttons to the coat as follows:					
	(1) Sew three 45-line buttons on the right and left fronts on the mark to correspond with the buttonholes, with the stitching of each button through the fronts, right interlining and facing. The stitching of both bottom buttons shall only catch the front and the top ply of front pockets. The buttons on the right side only shall be set on a stand with a 18-line stay button behind and then shank wrapped. The buttons on the left front of coat shall not be shanked but must have a stay button and shall be sewn with a tighter stitch to prevent a sagging appearance.	101 or 301		14-16 per button 14-16 per button	30 30	30
	(2) Sew one 45-line anchor button to the inside left front to properly engage buttonhole on right front. The button shall be shank wrapped.	101 or 301		14-16 per button	30	
	(3) Position and sew one 45-line button on the upper right front on the mark to correspond with the left lapel buttonhole to provide a smooth closure with the ends of the collar meeting at the neck. The collar ends at the neck shall not overlap or spread apart more than 1/2-inch.	101 or 301		14-16 per button	30	
	(4) Sew one 30-line button on each sleeve to correspond with the buttonhole in the sleeve strap.	101 or 301		14-16 per button	30	

Source: https://assist.dla.mil --Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39.	Sew buttons on outer shell. (cont'd)					
	(5) Sew one 30-line button to each shoulder to align with the eyelet-end of the button-hole in the shoulder straps. On the finished coat, the straps, when buttoned, shall lie smooth and flat without twisting or bulging.	101 or 301		14-16 per button	30	
	(6) For the class 3 coat, sew one 30-line and 45-line button on the inside right facing positioned 1 ± 1/4 inch from the inside edge of the facing and 8 ± 1/4 inches for short and regular lengths and 9 ± 1/4 inches for lengths long and extra long from the finished bottom of the coat. The stitching shall not be through the outer shell.	101 or 301		14-16 per button	30	30
	b. Sew a 24-line button on each sleeve lining, 1/2 ± 1/16-inch from the bottom turned edge of the lining without stitching through the outer shell. The buttons shall be positioned to correspond with the button loop at the end of the liner sleeve.	101 or 301		14-16 per button 14-16 per button	30 30	 30
40.	Make removable liner.					
	a. Join the fronts and backs together face-to-face at the shoulder 3/8-inch from raw edge.	301 or 401	SSa-1	8-10	A	A
	b. Overedge stitch the raw edge together. d -or-	503 or 504 or 602	SSa-1	8-10	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40.	Make removable liner. (cont'd)					
	As an alternate, operation 39a and b may be performed in one operation simultaneously stitching and overedge (chain-stitching).	515 or 516 or 519	SSa-2	8-10	A	A
	c. Join top and undersleeve at the back arm 3/8-inch from raw edge.	301 or 401	SSa-1	8-10	A	A
	d. Overedge stitch the raw edges together.	503 or 504	SSa-1	8-10	A	A
	- or -					
	As an alternate, operation 39c and d may be performed in one operation by simultaneously stitching and overedging.	515 or 516	SSa-2	8-10	A	A
41.	Set sleeve to liner.					
	a. Position sleeves on the outside of liner at the arm-holes with back arm seam of the sleeves matching notches in the back, and with notch in top sleeve and fronts matching.					
	b. Join sleeves to the liner 3/8-inch from raw edge.	301 or 401	SSa-1	8-10	A	A
	- or -					
	c. Overedge stitch the raw edge together.	503 or 504 or 602	SSa-1	8-10	A	A
	- or -					
	As an alternate, operation 40b and c may be performed in one operation by simultaneously stitching and overedging.	515 or 516	SSa-2	8-10	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
42.	Close sleeves and side seam of liner.					
	a. Close the side seams of the liner and the underarm seam of the sleeves 3/8-inch from raw edges.	301	SSa-1	8-10	A	A
	b. Overedge stitch the raw edge together.	503 or 504 or 602	SSa-1	8-10	A	A
	- or -					
	As an alternate, operation 41a and b may be performed in one operation by simultaneously stitching and overedging.	515 or 516	SSa-2	8-10	A	A
43.	Bind edges of liner and attach label.					
	a. Bind edges of liner as specified herein. The binding shall be uniformly stitched with no raw edges showing. The fabric shall be caught in the stitching. The finished binding shall be 3/16 to 1/4-inch wide.	301 or 401 or Bar-tack	BSc-1	10-12	A	A
			BSc-1	10-12	A	A
				28 stitches per	A	A
	(1) Bind the edge of the vent, the bottom, the fronts, and the neck, catching the top of the size label under the binding at center of neck area. The binding shall not begin or finish at the top of the vent. The ends of the binding shall be turned in and binding shall overlap not less than 1/2-inch. the end of the binding shall be turned on itself and securely stitched or bartacked. The bartack shall be 1/2 ±1/16-inch long.	301 or 401 or Bar-tack	BSc-1	10-12	A	A
				28 stitches per		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
43.	Bind edges of liner and attach label. (cont'd)					
	(2) Bind the bottom of each sleeve. The binding shall begin and finish at the underarm seam. The end of the binding of each sleeve shall be formed into a loop that will accommodate the 24-line button on the outer shell lining. The end of the binding shall be bartacked or securely stitched. The bartack shall be 5/8 ±1/16-inch long.	301 or 401 or Bartack	BSc-1	10-12 28 stitches per	A	A
	(3) Bind the edges of each pocket pass through. The binding shall not begin or finish at the top or the bottom of the pocket pass through. The ends of the binding shall be turned in and caught in the stitching. The ends of the binding shall overlap not less than 1/2-inch with the end of the binding turned over on itself and securely stitched or bartacked. The bartack shall be 1/2 ±1/16-inch long.	301 or 401 or Bartack	BSc-1	10-12 28 stitches per	50	50
44.	Sew size label to liner.					
	a. Stitch the two sides and bottom of the size label to the back of the liner.	301	LSbj-1	10-12	A	A
45.	Set slide fastener on liner.					
	a. Position the slide fastener on the underside of the liner, as indicated by the pattern marks, with the back edge of the chain immediately adjacent to the bound edge of the liner. Turn in the raw	301	LSa-1	10-12	A	A

Source: https://assist.dla.mil - Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
45.	Set slide fastener on liner. (cont'd) end of the slide fastener tape 1/2 to 3/4-inch. Stitch the length of the slide fastener tape with the stitching superimposed on the binding stitching. The slider shall be on the left side of the finished liner. When the fastener tape has a fused bottom, turn in of end is not required.					
46.	Clean coat and liner. a. Trim all thread ends. b. Remove all loose threads. c. Remove all spots and stains. d. Remove all shade tickets.					
47.	Attach liner to outer shell. a. Attach the liner to the outer shell by means of the slide fastener, checking the operation of the slide fastener to insure free and easy manipulation of the slider. When the slide fastener is closed, the outer shell and the liner shall not show any evidence of bulging or distortion. The liner shall match the outer shell in size.					
48.	Attach belt to coat. a. Match the belt to the coat. Place the belt through the loops. Thread the belt fastener through the underloop and button.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:40Z
Check the source to verify that this is the current version before use.

3.7 Dimensions. The finished measurements of the outer shell (coat) and the liner shall conform to the following:

Outer Shell (Coat)
Measurements in Inches

Size	Chest 1/	Back Length 2/	Sleeve Length 3/	Belt Length 4/
EXTRA SHORT				
32	39	40-1/2	16	40
34	41	40-3/4	16	42
36	43	41	16	44
38	45	41-1/4	16	46
40	47	41-1/2	16	48
42	49	41-3/4	16	50
SHORT				
30	37	42-1/4	17	38
32	39	42-1/2	17	40
34	41	42-3/4	17	42
36	43	43	17	44
38	45	43-1/4	17	46
40	47	43-1/2	17	48
42	49	43-3/4	17	50
44	51	44	17	52
46	53	44-1/4	17	54
REGULAR				
30	37	44-1/4	18	38
32	39	44-1/2	18	40
34	41	44-3/4	18	42
36	43	45	18	44
38	45	45-1/4	18	46
40	47	45-1/2	18	48
42	49	45-3/4	18	50
44	51	46	18	52
46	53	46-1/4	18	54
48	55	46-1/2	18	56
LONG				
32	39	46-1/2	19	40
34	41	46-3/4	19	42
36	43	47	19	44
38	45	47-1/4	19	46
40	47	47-1/2	19	48
42	49	47-3/4	19	50
44	51	48	19	52
46	53	48-1/4	19	54
48	55	48-1/2	19	56
EXTRA LONG				
34	41	49-1/4	20-1/2	42
36	43	49-1/2	20-1/2	44

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

Outer Shell (Coat)

Measurements in Inches

Size	Chest 1/	Back Length 2/	Sleeve Length 3/	Belt Length 4/
EXTRA LONG				
38	45	49-3/4	20-1/2	46
40	47	50	20-1/2	48
42	49	50-1/4	20-1/2	50
44	51	50-1/2	20-1/2	52
46	53	50-3/4	20-1/2	54
48	55	51	20-1/2	56
Tolerance ±	3/4	1/2	1/2	3/4

1/ Chest measurement taken with coat buttoned from folded edge to folded edge in line with pit of armhole and multiplied by two.

2/ Back length measurement taken along center back seam from lower edge of undercollar to bottom edge of coat.

3/ Sleeve length measurement taken along forearm seams from pit of armhole to bottom end of sleeve.

4/ Belt length measurement shall be taken along the center from end to end.

Liner

Measurements in Inches

Size	Chest 1/	Back Length 2/	Sleeve Length 3/
EXTRA SHORT			
32	33	33	14
34	35	33-1/4	14
36	37	33-1/2	14
38	39	33-3/4	14
40	41	34	14
42	43	34-1/4	14
SHORT			
30	31	34-3/4	15
32	33	35	15
34	35	35-1/4	15
36	37	35-1/2	15
38	39	35-3/4	15
40	41	36	15
42	43	36-1/4	15
44	45	36-1/2	15
46	47	36-3/4	15

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

Liner

Size	Measurements in Inches Chest 1/	Back Length 2/	Sleeve Length 3/
REGULAR			
30	31	36-3/4	16
32	33	37	16
34	35	37-1/4	16
36	37	37-1/2	16
38	39	37-3/4	16
40	41	38	16
42	43	38-1/4	16
44	45	38-1/2	16
46	47	38-3/4	16
48	49	39	16
LONG			
32	33	39-1/2	17
34	35	39-3/4	17
36	37	40	17
38	39	40-1/4	17
40	41	40-1/2	17
42	43	40-3/4	17
44	45	41	17
46	47	41-1/4	17
48	49	41-1/2	17
EXTRA LONG			
34	35	42-1/4	17-3/4
36	37	42-1/2	17-3/4
38	39	42-3/4	17-3/4
40	41	43	17-3/4
42	43	43-1/4	17-3/4
44	45	43-1/2	17-3/4
46	47	43-3/4	17-3/4
48	49	44	17-3/4
Tolerance ±	3/4	1/2	1/2

NOTE: The liner shall be placed flat on a table and measured as listed below:

1/ Chest measurement taken with liner folded in half (down center back) and measured from front bound edge to back folded edge in line with pit of armhole and multiplied by two.

2/ Back length taken along the center back neck edge to bottom of liner.

3/ Sleeve length measurement taken along the underarm seams from pit of armhole to bottom of sleeve.

3.8 Workmanship. The finished coat shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the applicable point of value or defect limit.

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:40Z
Check the source to verify that this is the currentversion before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements (examinations and testing) as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items must meet all requirements of section 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements, however this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.1.2 Responsibility for dimensional requirements. Unless otherwise specified in the contract or purchase order, the contractor is responsible for ensuring that all specified dimensions have been met. When dimensions cannot be examined on the end item, inspection shall be made at any point, or at all points in the manufacturing process necessary to ensure compliance with all dimensional requirements.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5).

4.3 Inspection conditions. Unless otherwise specified all inspections shall be in accordance with the test conditions specified MIL- STD-1494.

4.4 First article inspections. When a first article is required (see 3.2 and 6.2), it shall be examined for the defects specified in MIL-STD-1494.

4.5 Quality conformance inspection. Unless otherwise specified, sampling for inspection shall be performed in accordance with MIL-STD-105.

4.5.1 Component and material inspection. In accordance with 4.1, components and materials shall be inspected in accordance with all requirements of referenced specifications, drawings and standards unless otherwise excluded, amended, modified or qualified in this specification or applicable purchase document. The method of testing shall be as specified in FED-STD-191, wherever applicable. All test reports shall contain the individual values used in expressing the final result. The lot shall be unacceptable if one or more sample units fail to meet any of the test requirements specified. The lot size and sample size shall be in accordance with the following:

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

Lot Size (lot unit)	Sample Size (sample unit)
800 or less	2
801 to 22,000 inclusive	3
22,001 and over	5

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.2.1 Bond strength of fusible interlining. The strength of the bond of the fusible interlining to the outer shell shall be tested once each 4 hours as follows at each fusing press to determine that adequate fusing is being obtained. Prepare a test sample by fusing the fusible interlining specified in 3.3.5 to the basic fabric of the outer shell specified in 3.3.1 under the same fusing conditions as used in the manufacture of the coat. Determine the bond strength of the test sample with a commercial spring scale (see 6.8). If the bond strength of any test sample is less than required by MIL-C-44296, the fusing conditions shall be corrected and the bond strength test shall be repeated. Those units represented by this test shall be fused again and retested. If they fail, they shall be rejected.

4.5.3 End item visual examination. The end items shall be examined for visual defects in accordance with the provisions of MIL-STD-1494.

4.5.4 End item dimensional examination. The end items shall be examined for dimensional defects in accordance with the provisions of MIL-STD-1494 and as outlined in 3.7.

4.5.4.1 Sampling test. Samples of the end item shall be subjected to the sampling tests listed below. If one or more sample units fail to meet any test requirement listed below, the lot represented shall not be accepted. Sample size shall be in accordance with sampling plan in paragraph 4.5.1.

Sampling test	
Characteristics	Test methods
End Item Appearance	
Bubbling or delamination of fused area after five dry cleanings	Dry cleaning and visual 1/
Strike through of adhesive	Visual

1/ The complete coat shall be dry cleaned five times in a single unit, coin-operated cycle capable of providing a complete automatic dry to dry cycle, using perchloroethylene and then shall be visually examined for bubbling and delamination of the fused areas. After the coat has been subjected to five dry cleanings, the coat shall not show any evidence of bubbling or delamination of the fused areas. The coat shall not have any "strike through" of the adhesive after fusing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

4.5.5 Packaging examiantion. The fully packaged end items shall be examined in accordance with the provisions of MIL-STD-1494.

5. PACKAGING

5.1 Packaging. Packaging shall be level A, hanger pack or commercial as specified (see 6.2).

5.1.1 Level A. Each coat, with the front buttons buttoned and the belt through the belt loops, buckle and keeper will be folded to approximately 14-inches by 22-1/2-inches. Each folded coat shall be inserted in a close fitting flat style clear polyethylene bag conforming to A-A-50083. The bag shall be at least 1-inch longer than the folded coat. The unsealed opening of the bag shall be at the smaller dimension of the bag.

5.1.2 Commercial preservation. The coats shall be packaged in accordance with ASTM D 3951.

5.2 Packing. Packing shall be level A, B, hanger pack, or commercial as specified (see 6.2).

5.2.1 Level A. Ten coats of one size only, packaged as specified, shall be packed in a fiberboard shipping container that is assembled, closed, and reinforced in accordance with grade V2s, size 3A of MIL-B-17757. The fiberboard for the liner shall conform to type CF, class weather-resistant, variety DW, grade V15c of MIL-B-17757. Level A packages shall be packed flat with every other coat reversed top to bottom within the shipping container. The top and the bottom of the contents of the shipping container shall be completely covered with a sheet of 30-pound (minimum) basis weight paper conforming to A-A-203. Shipping contains shall be arranged in unit loads in accordance with MIL-L-35078 for the type and class of load specified (see 6.2). Strapping shall be limited to nonmetallic strapping for type II, class P loads.

5.2.2 Level B. Ten coats of one size only, packaged as specified, shall be packed in a shipping container that is assembled and closed to conform to class domestic, grade 275, size 3A of MIL-B-17757. The fiberboard for the liner shall conform to type CF, class domestic, variety DW, grade 275 of PPP- F-320. Level A packages shall be packed flat, with every other coat reversed top to bottom within the shipping container. The top and the bottom of the contents of the shipping container shall be completely covered with a sheet of 30-pound (minimum) basis weight paper conforming to A-A-203. Shipping containers shall be arranged in unit loads in accordance with MIL-L-35078 for the type and class of load specified (see 6.2). Strapping shall be limited to nonmetallic strapping for type II, class P loads.

5.2.2.1 Optional Shipping container. If specified by the procuring activity (see 6.2), a weather resistant shipping container shall be fabricated in accordance with grade V3c or V3s of MIL-B-17757 and closed in accordance with the appendix of the container specification. If specified by the procuring activity (see 6.2) the material for the shipping container shall conform to grade V4s of PPP-F-320.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

5.2.3 Hanger pack. When specified (see 6.2), 10 coats of one class and size shall be placed on a 16 inch hanger and packed in a type I container (hanger pack) in accordance with MIL-C-44192, except the inside depth of the box shall be 48 inches (+0, -2 inches). The loaded containers shall be palletized and marked in accordance with MIL-C-44192.

5.2.4 Commercial packing. Coats, packaged as specified in 5.1, shall be packed in accordance with ASTM D 3951.

5.3 Marking. In addition to any special marking required by the contract or purchase order, unit packs, shipping containers and palletized unit loads shall be marked in accordance with MIL-STD-129 or ASTM D 3951, as applicable.

5.3.1 Polyethylene bags. Each polyethylene package (see 5.1.1) shall have the nomenclature, stock number and size of the item packaged therein legibly printed or stamped in black directly across the center face of the bag or on a white paper label inserted within the bag so that it is readable through the polyethylene.

5.4 Palletization. When specified (see 6.2), coats packed as specified in 5.2.1 and 5.2.2 shall be palletized on a 4-way entry pallet in accordance with load type 1A of MIL-STD-147. Pallet type shall be type I (4-way entry), type IV or type V in accordance with MIL-STD-147. Pallets shall be fabricated from wood groups I, II, III, or IV of MIL-STD-731. Each prepared load shall be bonded with primary and secondary straps in accordance with bonding means C and D or film bonding means F or G. Pallet pattern shall be in accordance with the appendix of MIL-STD-147. Interlocking of loads shall be effected by reversing the pattern of each course. If the container is of a size which does not conform to any of the patterns specified in MIL-STD-147, the pallet pattern used shall be approved by the contracting officer.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coat covered by this specification is intended to be worn by male personnel of the U.S. Marine Corps and the U.S. Army.

6.2 Acquisition requirements. Acquisition documents should specify the following:

a. Title, number, and date of this specification
b. Size and class required (see 1.2)
c. Issue of DoDISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.1.1 and 2.2).
d. When a first article is required (see 3.2, 4.4. and 6.4)
e. Levels of packaging and packing (see 5.1 and 5.2).
f. Type and class of unit load required (see 5.2.1 and 5.2.2).
g. When weather-resistance grade fiberboard shipping containers are required for level B packing (see 5.2.2.1)
h. When palletization is required (see 5.4).

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:40Z
Check the source to verify that this is the current version before use.

6.3 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a preproduction sample. The contracting officer should specify the appropriate type of first article and the number of units to be furnished. The contracting officer should include specific instructions in all acquisition instruments regarding arrangements for selection, inspection, and approval of the first article.

6.4 Standard sample. The standard sample and color sample may be obtained from the procuring activity or as directed by the contracting officer.

6.5 Subject term (keyword) listing.

Cover
Male
Repellant
Weather

6.6 Figures. Figures 1 through 7 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

6.7 Fusing conditions. Specific machine setting should be obtained from the supplier of the particular fusible material for optimum results. The following fusing conditions include the recommendations of several suppliers of fusible material and are furnished for guidance only.

6.7.1 Fusible interlining. (See 3.3.5)

(a) Temperature between pressing surfaces of 280°F minimum and 310°F maximum, at the fuseline (not the temperature at the clock.

(b) Pressure between pressing surfaces of four pounds force per square inch (lb_f/in^2) minimum and five lb_f/in^2 maximum.

(c) Pressing time of 10 seconds minimum and 12 seconds maximum.

(d) Heat-dry.

6.8 Peel strength test. The procedure for the peel strength testing with a spring scale should be obtained from the supplier of the fusible material, and shall be accomplished 2 hours after fusing.

6.9 Changes from previous issues. Asterisks are not used in this revision to identify change with respect to the previous issue due to the extensiveness of the changes.

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:40Z
Check the source to verify that this is the current version before use.

Preparing Activity
Navy-MC
Project No. 8405-0134

Custodian
Army-GL

Review Activity
DLA-CT

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

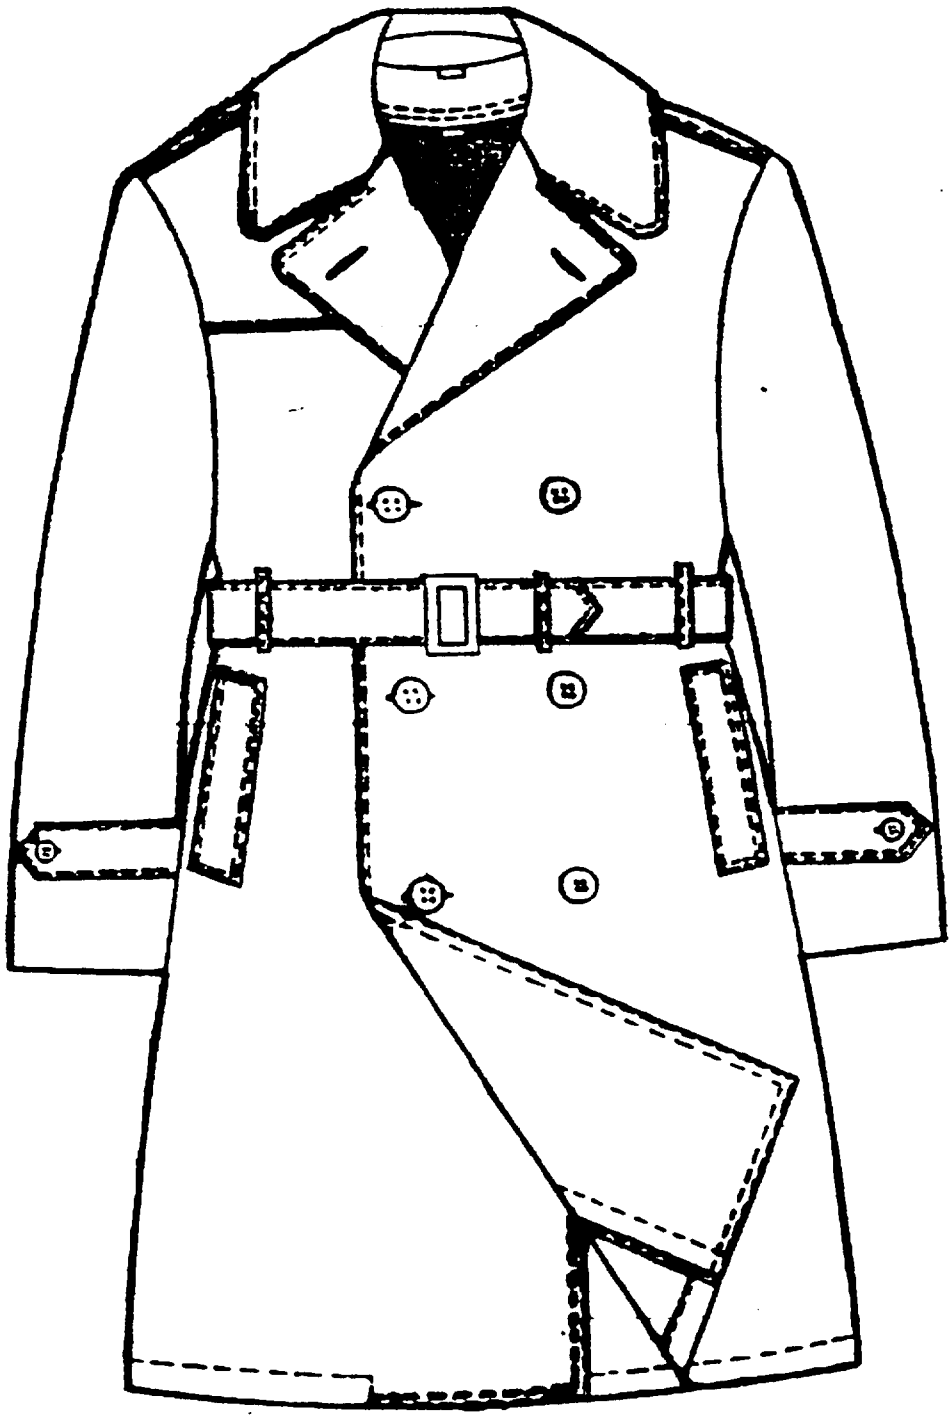


FIGURE 1: COAT, ALL-WEATHER, MEN'S, CLASSES 1 & 2

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:40Z
Check the source to verify that this is the current version before use.

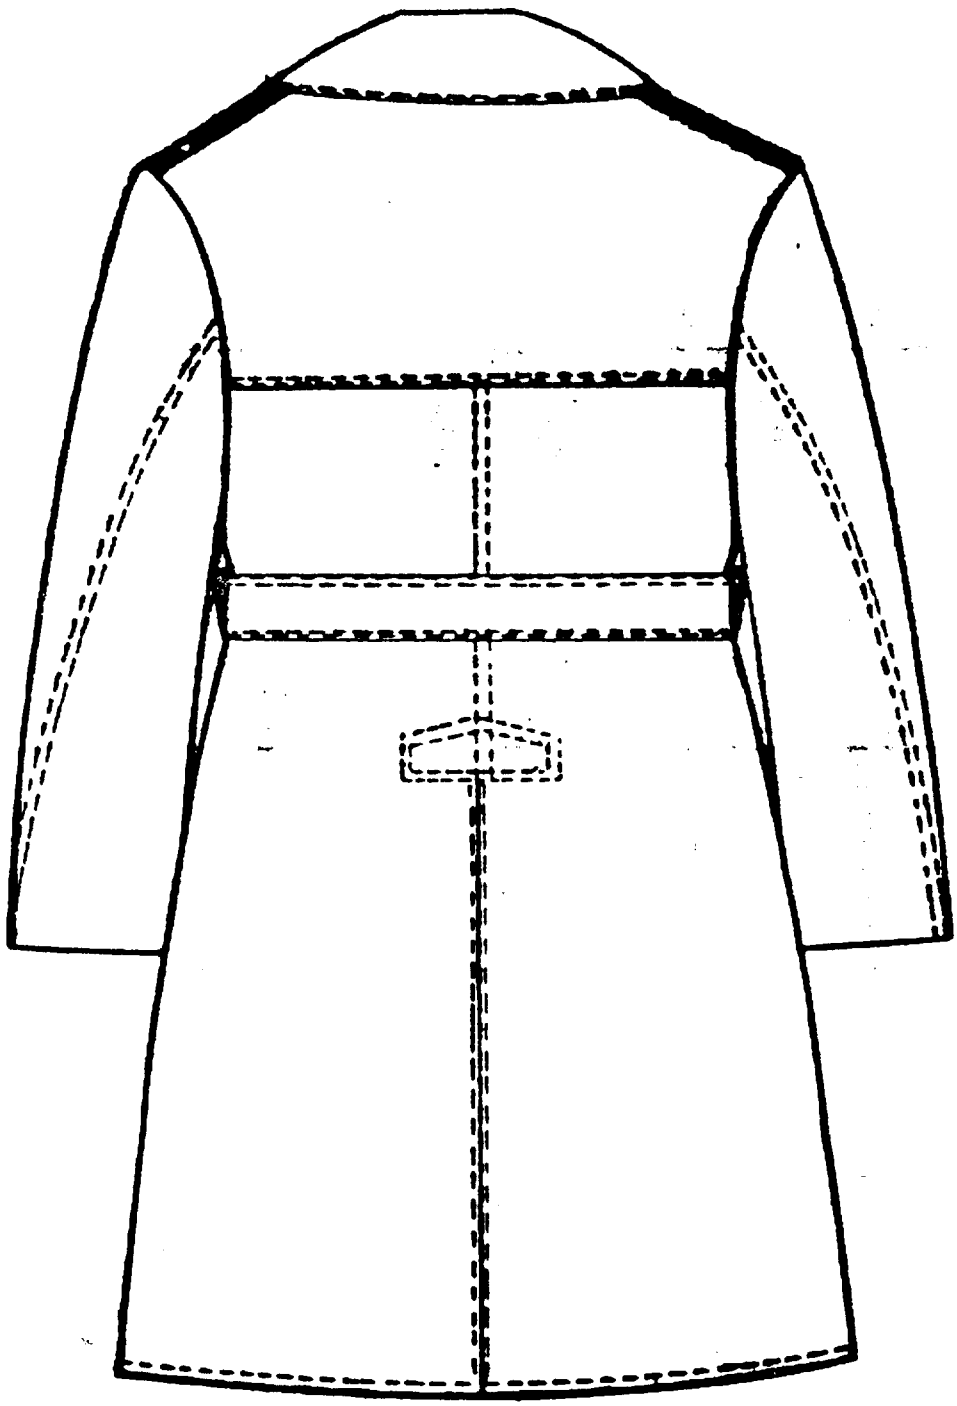


FIGURE 2: COAT, ALL-WEATHER, MEN'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

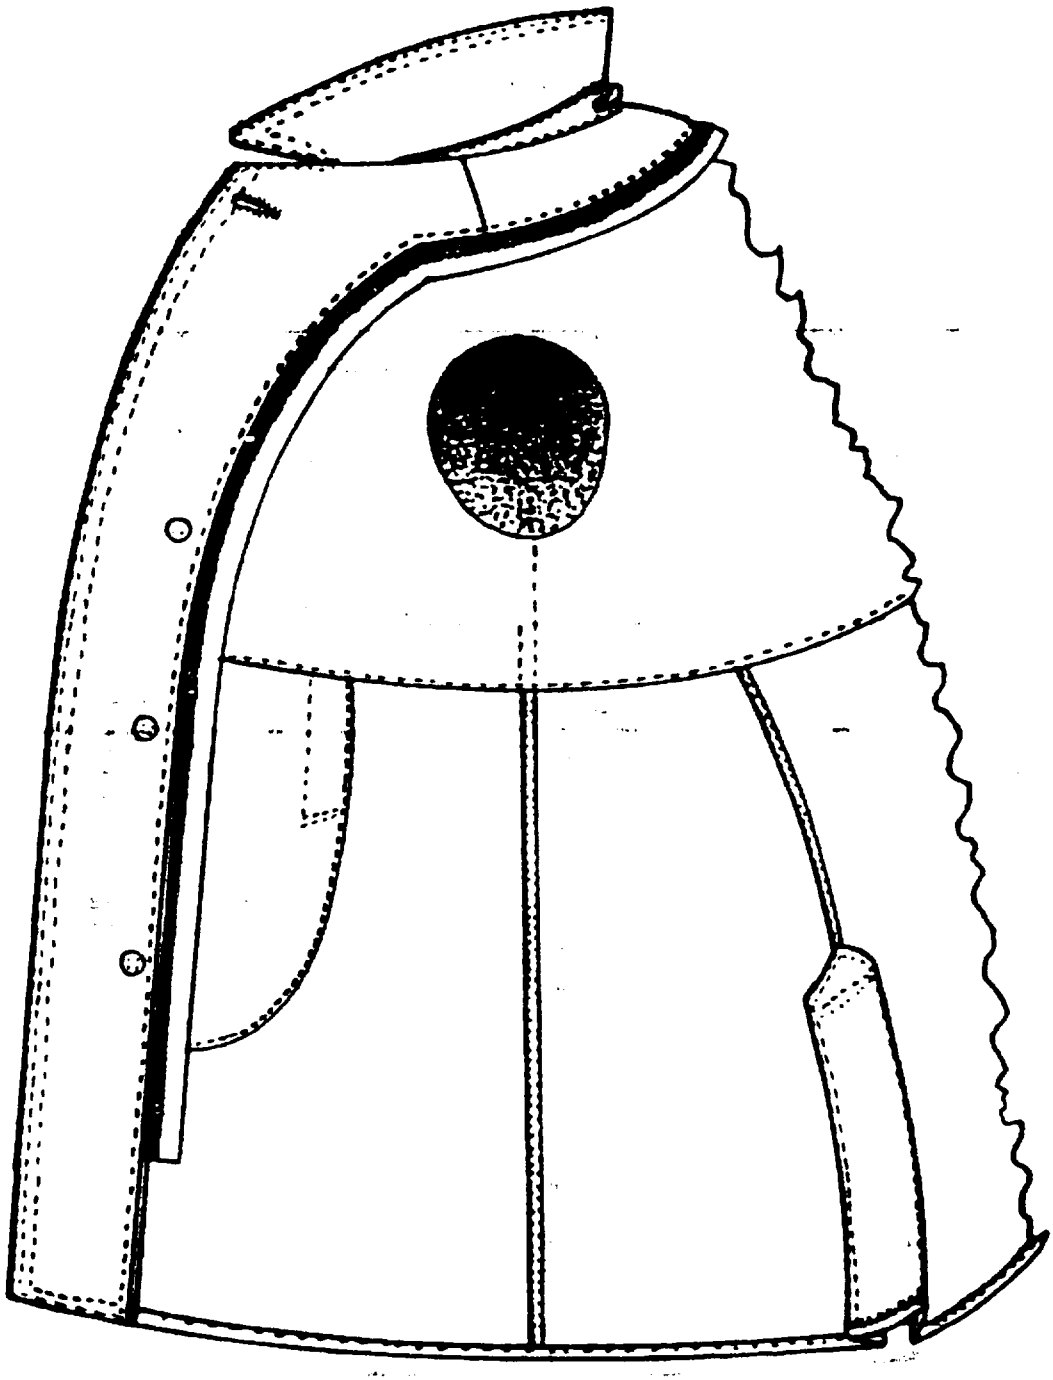


FIGURE 3: COAT. ALL-WEATHER. MEN'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

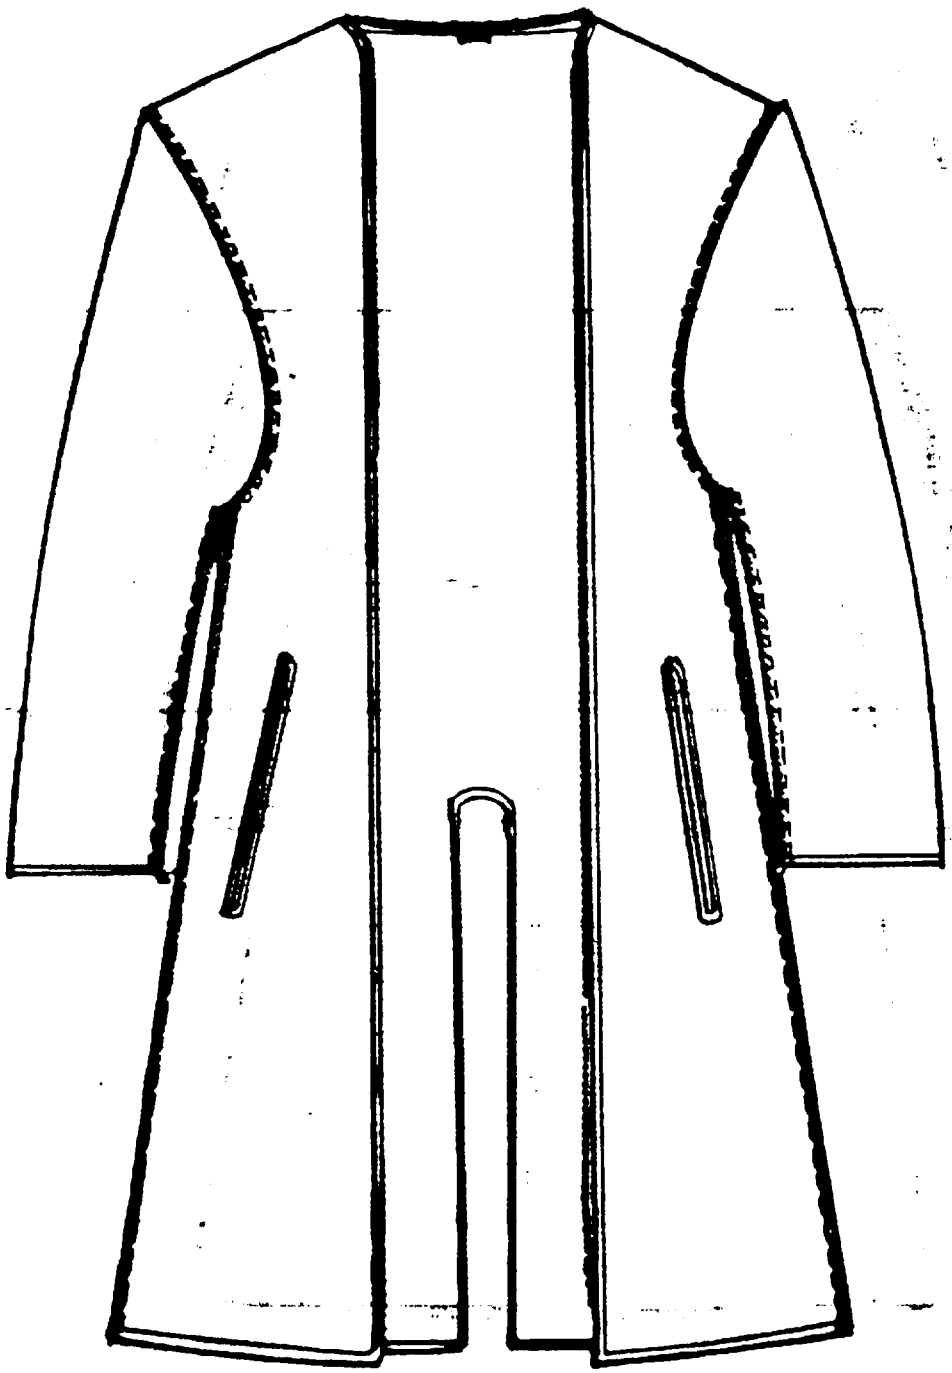


FIGURE 4: COAT, ALL-WEATHER, MEN'S

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:40Z
Check the source to verify that this is the current version before use.

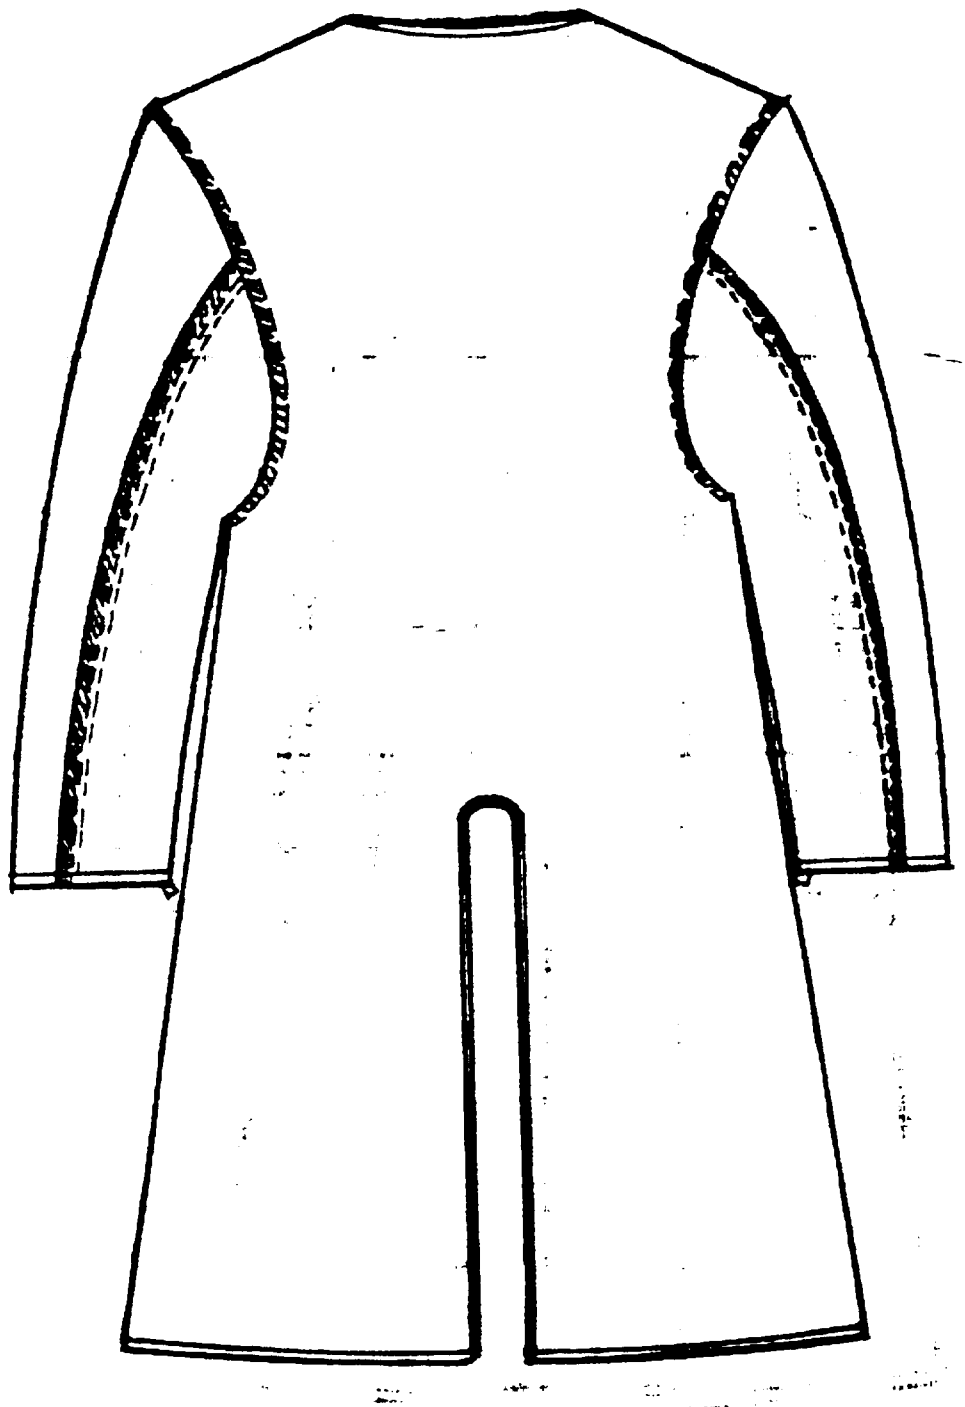


FIGURE 5: COAT, ALL-WEATHER, MEN'S

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:40Z
Check the source to verify that this is the current version before use.

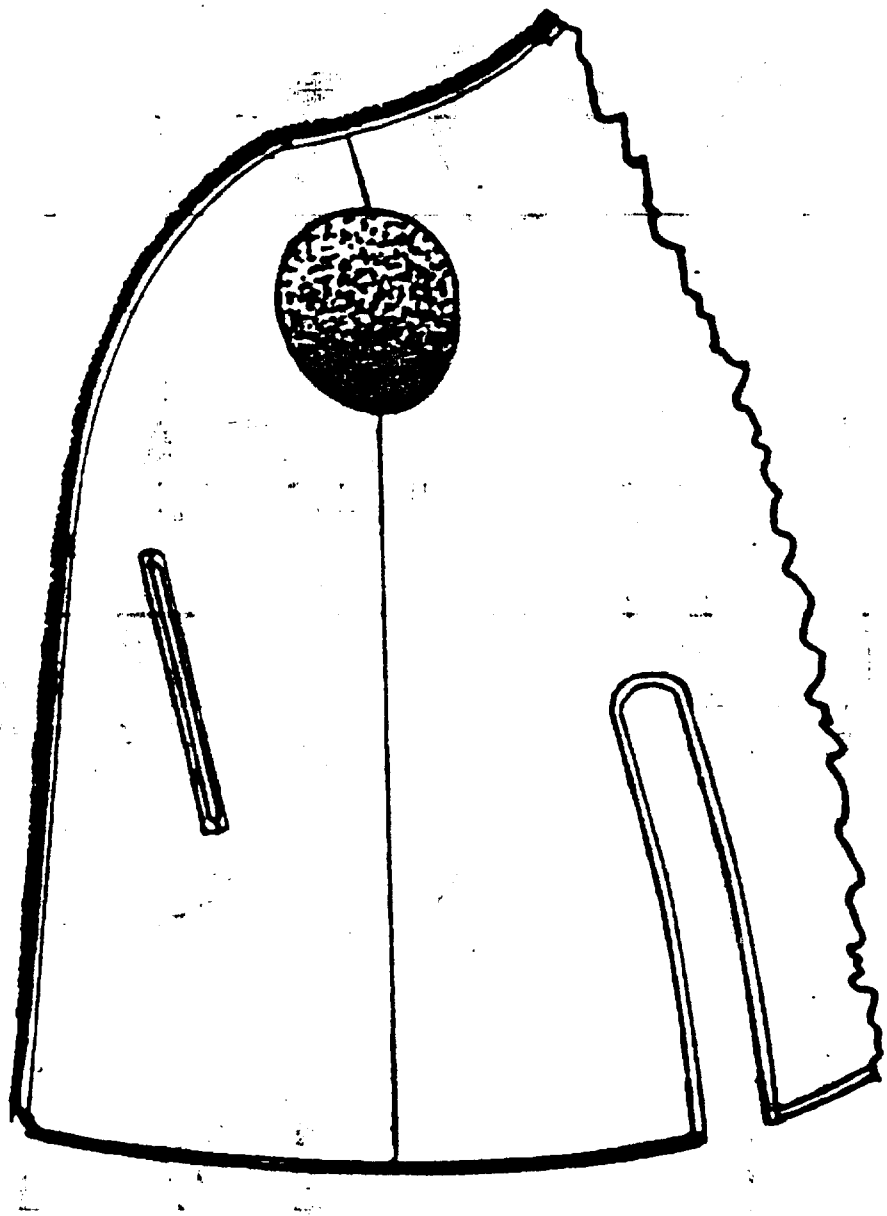


FIGURE 6: COAT, ALL-WEATHER, MEN'S

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:40Z
Check the source to verify that this is the current version before use.

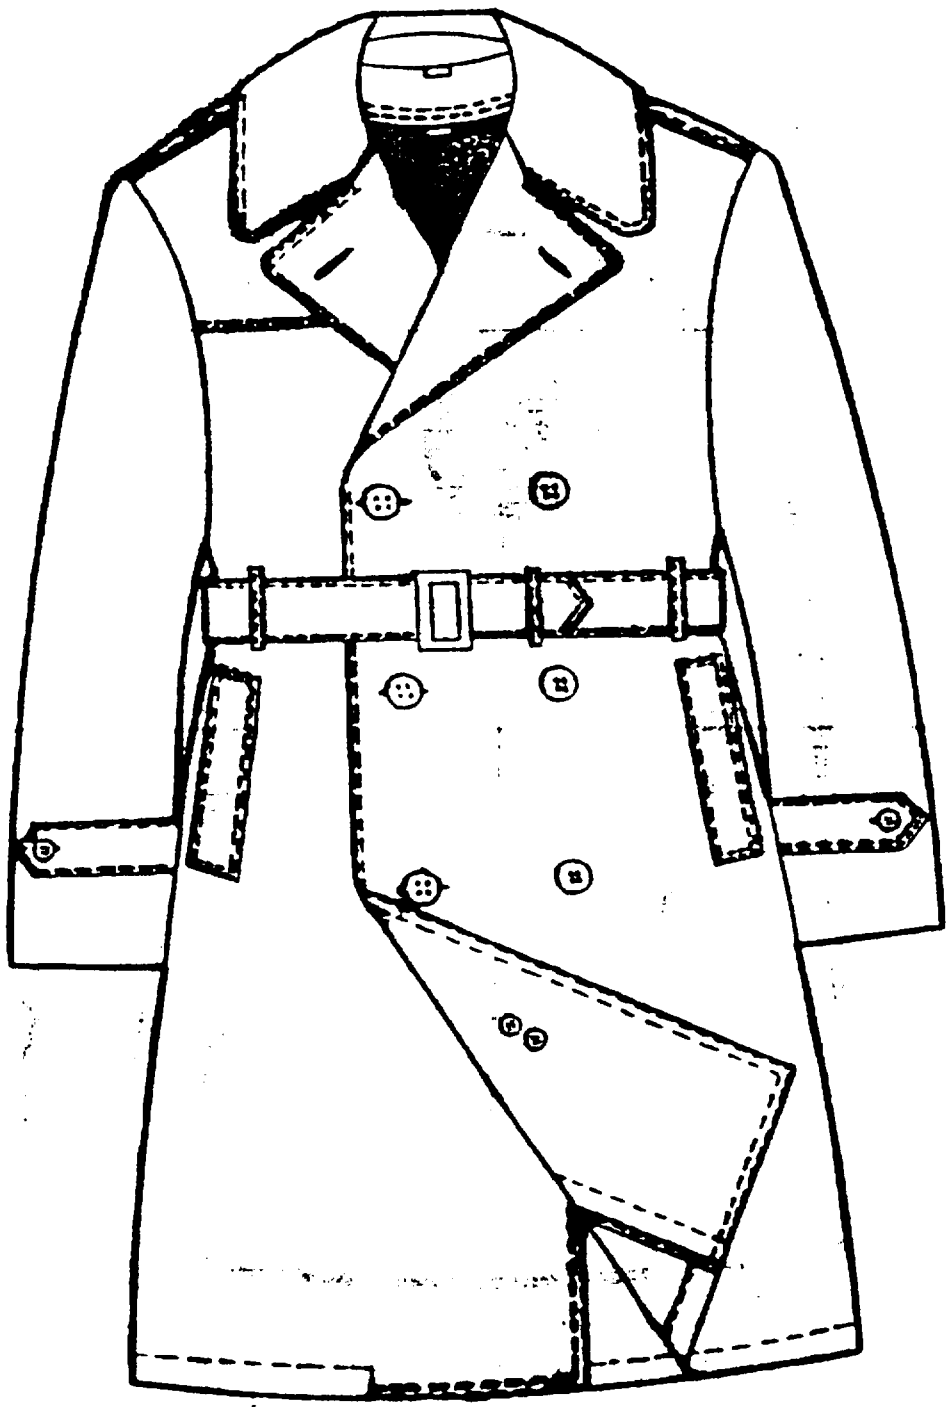


FIGURE 7: COAT, ALL-WEATHER, MEN'S, CLASS 3

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	1. DOCUMENT NUMBER	2. DOCUMENT DATE (YYMMDD)
	MIL-C-29380D	10 SEPTEMBER 1990

3. DOCUMENT TITLE

COAT, ALL-WEATHER, MEN'S

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME	b. TELEPHONE (Include Area Code) (1) Commercial	(2) AUTOVON
[illegible]manding General, Marine Corps Research, [illegible]velopment, and Acquisition Command (PSE-C)	(202) 696-1186/87/88	226-1186/87/88
c. ADDRESS (Include Zip Code) Washington, DC 20380-0001	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT: Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

Source: https://assist.dla.mil - Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:40Z
Check the source to verify that this is the current version before use.