INCH-POUND

MIL-C-29391A(MC)
6 DECEMBER 1990
SUPERSEDING
MIL-C-29391(MC)
17 NOVEMBER 1980

MILITARY SPECIFICATION

COAT, WOMEN'S: WOOL GABARDINE; DRESS BLUE CEREMONIAL

This specification is approved for use by the U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for a blue wool gabardine ceremonial dress coat.

1.2 Classification. The coats shall be of one type in the following sizes as specified (see 6.2).

Schedule of Sizes

Short	Regular	Long
6	6	-
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18
20	20	20
-	22	22

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commanding General (PSE-C), Marine Corps Research, Development, and Acquisition Command, Washington, DC 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC-NA FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

V-B-871	- Button, Sewing Hole, and Button, Staple, (Plastic)
V-T-276	- Thread, Cotton
V-T-280	- Thread, Gimp, Cotton, Buttonhole
V-T-295	- Thread, Nylon
V-T-301	- Thread, Silk
UU-P-268	- Paper, Kraft, Wrapping
DDD-L-20	- Label: For Clothing, Equipage, and Tentage (General Use)
DDD-T-86	- Tape, Textile; Cotton, General Purpose (Unbleached, Bleached or Dyed)

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-371	- Braid, Textile, Tubular
MIL-F-495	- Finish, Chemical, Black, For Copper Alloys
MIL-B-3461	- Button, Insignia, Metal, Uniform and Cap
MIL-C-10176	- Cloth, Gabardine: Wool, Polyester/Wool, Polyester and Wool
MIL-P-15064	- Pads, Shoulder and Sleeve-head
MIL-C-16375	- Cloth, Wigan, Cotton
MIL-B-17757	- Boxes, Shipping, Fiberboard, (Modular Sizes)
MIL-C-43718	- Cloth, Polyester; Polyester and Cotton; Polyester and Rayon, for Pockets
MIL-C-82114	- Coat Front: for Coats, Musicians

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

MIL-C-29405 - Cloth, Broadcloth, Wool, and Wool/Nylon

STANDARDS

FEDERAL

FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitches, Seams, and Stitching

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129 - Marking for Shipment and Storage

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Bldg 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094)

2.1.2 Other Government documents, drawings, and publications. The following other Government publication forms are a part of this specification to the extent specified herein. Unless otherwise specified, the issue is that cited in the solicitation.

LAWS AND REGULATIONS

U.S. Postal Service Manual

(Copies of the Manual may be obtained from the Superintendent of Documents, U.S. Government Printing Office, Washington, DC 20402.)

2.2 Non-Government publications. The following document(s) form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DODISS cited in the solicitation.

UNIFORM CLASSIFICATION COMMITTEE

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, IL 60606.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC.

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association Inc., ATTN: Tariff Order Section, 1616 P Street, N. W. Washington, DC 20036.)

Department of Defense (DOD) Standard Shades for Buttons, 1966

Department of Defense (DOD) Standard Color Card of Official Standardized Shades for Sewing Threads, 1968

(Copies may be obtained from the Color Association of the United States, Inc., 343 Lexington Avenue, New York, NY 10016.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Standard samples. Standard samples are furnished solely for guidance and information to the contractor (see 6.4). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), a sample shall be subjected to first article inspection (see 6.4), in accordance with 4.4.

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, polyester/wool gabardine, dark blue shade 2312 (see 6.3), 10.6 ounce, conforming to type II, class 12 of MIL-C-10176.

3.3.2 Lining. The material for lining the coat, pocket flaps, collar, and vent, and for making the collar eyelet covers shall be cloth, rayon, twill, black shade 2604 (see 6.3), 3.7 ounce, conforming to class 1 of MIL-C-368.

3.3.3 Polyester and cotton. The material for making the stay pieces for the front pocket flaps, stays for armhole and shoulder seams, binding for the lower edge of collar interlining, and reinforcement pieces for collar eyelets shall be polyester

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

and cotton conforming to type I of MIL-C-43718, except the requirements for nonfibrous material and seam efficiency shall not apply. The color shall be black.

3.3.4 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram, double texture, laminated, starch finish, natural color, conforming to the following when tested as specified in section 4, table IV:

3.3.4.1 Buckram material. The buckram shall be made of cotton of suitable staple length and grade to meet the requirements of this specification. It shall be thoroughly cleaned, well carded, drawn, and evenly spun.

3.3.4.2 Weave. The weave of the single plies of the cloth shall be four harness, 2 up and 2 down herringbone twill, 20 ends right and 20 ends left.

3.3.4.3 Yarns per inch. The two plies of the cloth shall each have a minimum thread count per inch of 50 in the warp and 20 in the filling.

3.3.4.4 Laminated cloth. The two plies of the cloth shall be thoroughly adhered together with a synthetic resin-type laminating material which shall not cause an objectional odor in the finished cloth. The laminated cloth shall show no evidence of delamination after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests specified in section 4, table IV.

3.3.4.4.1 Finish. The laminated cloth shall have a starch finish. The original stiffness of the finished cloth, and the stiffness of the cloth after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests, shall conform to the following when tested as specified in section 4, table IV:

Stiffness, inch-pound	Minimum	Maximum
original	0.60	0.95
after accelerated aging	0.70	0.95
after wet (dry) cleaning	0.50	0.85
after perspiration	0.50	0.85

3.3.4.4.2 Weight. The weight of the finished laminated cloth shall be 21 to 23 ounces per square yard (see section 4, table IV).

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:46Z
Check the source to verify that this is the currentversion before use.

3.3.4.4.3 Breaking strength. The breaking strength of the finished laminated cloth shall be 100 pounds minimum in the warp direction and 80 pounds minimum in the filling direction when tested as specified in section 4, table IV. After being subjected to the accelerated aging test (see section 4, table IV), the breaking strength of the cloth shall be not less than the original breaking strength when tested as specified in section 4, table IV.

3.3.5 Padding for collar. The material for padding the collar shall be a suitable cotton felt, white, weighing 4.25 to 4.75 ounces per square yard when tested as specified in section 4, table IV.

3.3.6 Coat fronts. The coat fronts shall conform to class 2 of MIL-C-82114.

3.3.7 Sleevehead and shoulder pads. The sleevehead pads shall conform to type IV of MIL-P-15064 and the shoulder pads shall conform to type I, class 2 of MIL-P-15064.

3.3.8 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength 50 pounds, black color conforming to type IX, class 1 of MIL-B-371.

3.3.9 Bias binding. The binding for the raw edge of seam allowance shall be bias cut from the lining material specified in 3.3.2. The binding for the raw edge of seam allowances shall be 3/4 inch wide and shall have sized edges.

3.3.10 Piping. The material for piping the shoulder straps, the upper and lower edges of the collar, the upper, lower and back edges or ornamental sleeve pieces, and the bottom and left front edges of the coat shall be cloth, broadcloth, wool, scarlet shade 2501 (see 6.3), 14 ounce, conforming to type I, of MIL-C-29405.

3.3.11 Tape. The tape shall be cotton, conforming to type III, class 1 of DDD-T-86. The tape for the armholes, backvent, and waist seam shall be 1/4 inch wide and the tape for the right front edge shall be 3/8 inch wide.

3.3.12 Wigan. The material for reinforcing the bottom edge of the sleeves shall be cloth, cotton, wigan, 2.5 ounces, natural color, conforming to type I of MIL-C-16375.

3.3.13 Thread.

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

3.3.13.1 Silk thread. The silk thread shall conform to V-T-301. The thread for machine sewing shall conform to type I, size A, for all bartacks and all outside seaming and stitching; size F and size B for buttonholes, bobbin or looper and needle threads, respectively, and size 0 for machine felling. The thread for hand sewing shall be type III, class 3, size C, 2-ply of V-T-301. As an alternate to the silk thread, nylon thread conforming to V-T-295, type I, class A/3 in lieu of silk type I ticket O/3 and type IC, class A, size C/2 in lieu of silk type III, class 3 ticket C/2 may be used.

3.3.13.2 Cotton thread. The cotton thread shall conform to V-T-276, type IC2, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching, overedge stitching, and for buttonholes; type IB3, glazed finish, ticket No. 24, 4-ply for sewing on buttons and machine tacking armholes. The thread for basting shall be a good commercial grade.

3.3.13.3 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.3.13.4 Color and colorfastness. All thread shall be black AA, Cable No. 66043, (See DOD Standard Color Card of Official Standardized Shades for Sewing Threads, 1968) except cotton thread for basting and for machine tacking armholes, which may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning and, in addition, the silk thread shall show good fastness to light.

3.3.14 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or type II of V-T-280. The color of the gimp shall be black AA, Cable No. 66043 showing good fastness to wet (dry) cleaning.

3.3.15 Buttons.

3.3.15.1 Insignia buttons. The insignia buttons shall be metal, goldplated, Marine Corps design, 27-line, conforming to type I, style 3, class A, subclass 1 of MIL-B-3461.

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

3.3.15.1.1 Ring toggles. Ring toggles for securing buttons to ornamental sleeve pieces and shoulders shall conform to MIL-B-3461.

3.3.15.1.2 Reinforcements. The reinforcement discs for buttons secured to shoulders and ornamental sleeve pieces with ring toggles shall be punched from the cloth, cotton, buckram specified in 3.3.4.

3.3.15.2 Sewing hole buttons. The sewing hole buttons shall be melamine formaldehyde composition, glossy finish, conforming to type II, class D, style 20 or 21, 34-line and style 4, 22-line of V-B-871. The color shall be black BT Cable No. 62001. (See DOD Standard Shades for Buttons, 1966.)

3.3.16 Hooks and eye. The hook and eye for closing the collar shall be brass, black japanned finish, or black chemical finish in accordance with MIL-F-495, followed by clear lacquer coating and shall conform to the requirements shown in figure 1 and the following.

3.3.16.1 Closure finish. All surfaces and edges of the hook and eye shall be clean, smooth, and free from burrs, tool marks, sharp edges, and roughness. The hook and eye shall be thoroughly and completely lacquered with the best available quality of black japanned lacquer. The dry lacquer film shall be continuous, level, adherent, free from lint, dust, or other foreign inclusions that may affect appearance or serviceability, and shall withstand the test for tackiness specified in section 4, table IV. All apertures of the finished lacquered hook and eye shall be completely open, and free of any lacquer film or black chemical finish.

3.3.17 Labels. Each coat shall have an identification label, a size label and an instruction label as follows. The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.17.1 Identification label. The identification label shall conform to type I, class 1, of DDD-L-20 and shall measure

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

not less than 2-1/2 inches wide by 1-1/2 inches long. The content and format shall be as follows:

NAME _____
SERVICE NO. _____
COLLAR SIZE _____
NOMENCLATURE (ITEM DESCRIPTION) _____
_____
CONTRACT NUMBER _____ DATE _____
NAME OF CONTRACTOR _____
WOOL PRODUCTS ACT INFORMATION
_____

Size of characters for "Name of contractor" shall be minimum 8 point (approximately 3/32 inch).

3.3.17.2 Size label. The size label shall be type I, class 2, of DDD-L-20 and shall measure not less than 1-1/2 inches wide by 1 inch long. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L for short, regular and long, and the stock number as shown by the following example:

14R
Stock Number

The stock number may be omitted from the size label. When omitted, it shall be incorporated in the identification label.

3.3.17.3 Instruction label. The instruction label shall conform to type I, class 3, of DDD-L-20 and shall measure not less than 2-1/4 inches wide by 4 inches long. The content and format shall be as shown in figure 2. The letters for the caption shall be not less than 5/32 inch in height and all other letters and figures shall be not less than 1/8 inch in height.

3.4 Design. The coat shall be the U.S. Marine Corps design shown in figures 3 through 5. It shall be a seven-button, two-piece upper front, single breasted, half-lined coat having a skirt type front with waist seam and waist darts, upper and lower pocket flaps to button, a four-piece back with lined center vent, ornamental sleeve patches at bottom of sleeve, stitched down shoulder straps with insignia button, and a stand-up collar with single hook and eye for front closure. The top and bottom edge of the collar; right front and bottom edge of coat; edges of

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

shoulder straps; and top, bottom, and back edges of ornamental sleeve patches shall be piped with scarlet broadcloth.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working pattern shall be identical to the standard patterns. The standard patterns provide 3/16-inch allowance for seams at left front edge of coat and for pocket flaps; 3/4-inch allowance for side seams; 1/8-inch allowance for right front, bottom edge of coat, ornamental sleeve patches and shoulder straps; 5/8-inch allowance for center back seam; and 3/8-inch allowance for all other seams, except as otherwise specified in table I. Patterns provide for finished width of collars to be 1-3/4 inches for short coats and 2 inches for regular and long coats. Standard patterns show size, seam allowances, and directional lines for cutting. They are marked or notched for proper placement and assembly of the component parts.

3.5.1 Pattern parts. Coats shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

Item	Pattern Nomenclature	No. of cut parts
	Material: Cloth, Polyester/Wool, Gabardine	
1.	Center, front, upper	2
2.	Front, lower	2
3.	Facing, right	1
4.	Facing, left	1
5.	Side front	2
6.	Center back	2
7.	Side back	2
8.	Top sleeves	2
9.	Under sleeves	2
10.	Ornamental sleeve piece	2
11.	Pocket flaps, upper	2
12.	Pocket flaps, lower	2
13.	Shoulder straps	2
14.	Collar (outer ply)	1

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Item	Pattern Nomenclature	No. of cut parts
	Material: Cloth, Rayon Lining	
15.	Front	2
16.	Yoke	1
17.	Top sleeve	2
18.	Undersleeve	2
19.	Pocket flaps, upper	2
20.	Pocket flaps, lower	2
21.	Collar lining	1
22.	Collar eyelet covers	2
23.	Back vent	1
	Material: Polyester and Cotton	
24.	Pocket flap stays, upper	2
25.	Pocket flap stays, lower	2
	Material: Cloth, Cotton, Buckram	
26.	Collar interlining	1
	Material: Cloth, Cotton Wigan	
27.	Reinforcement (bottom edge of sleeve)	2
	Shapers	
28.	Finished pocket flap shaper, upper	
29.	Finished pocket flap shaper, lower	
30.	Right vent shaper	
	Markers	
31.	Sleeve turnup and sleeve ornamentation marker	

3.6 Construction. The coats shall be constructed in accordance with the operations and the stitch, seam and stitching types specified in table I. The contractor is not required to follow the exact sequence of the operations as listed in table I, but all operations specified shall be used to manufacture the coats.

3.6.1 Stitches, seams and stitchings. The stitch, seam, and stitching types specified in table I shall conform to FED-STD-751. The number of stitches per inch as specified in table I

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.1 Tacking and backstitching. Ends of seams and stitching produced with 301 type stitch, when not caught in other seams or stitching, shall be securely backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of the coat cut from one piece of basic and lining materials, including pairs of sleeve lining, when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

a. Corrosive metal fastening devices.
b. Adhesive-type tickets which show discoloration and the adhesive mass adheres to the material upon removal of the tickets.
c. Sew-on shade tickets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
1.	Cutting.					
	a. Cut coats in strict accordance with patterns furnished by the Government. Cut basic material face to face i.e., the face of one ply of material shall be even and against the face of the next ply below.					
	b. Cut all materials in the direction indicated by directional lines on the patterns. NOTE: Straight of cloth refers to the warp direction.					
	c. Cut all polyester/wool gabardine parts of the coat from one piece of basic material, except the following parts may be cut from ends: belt loops and front facing. Parts cut from ends shall harmonize with the shade of the coat. Belt loops and binding for upper edge of collar interlining shall be cut inch wide.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
1.	Cutting. (cont'd.)					
	d. Cut linings for front, yoke, vent, and collar from one piece of rayon lining material. All other rayon lining may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the linings shall match each other.					
	e. Cut the bias binding for the raw edges of the seam allowances 3/4 inch wide from lining material (see 3.3.9).					
	f. Cut polyester and cotton stays for armhole and shoulder seam on the bias 3/4 inch wide and 4 ± 1/4 inches long for front shoulder and armhole edge. Cut polyester and cotton stays for upper and lower pocket flaps on the straight in accordance with patterns furnished. Cut the polyester and					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
1.	Cutting. (cont'd.)					
	cotton binding for lower edge of collar interlining on the straight 1 inch wide. Cut the reinforcement pieces for collar eyelet not less than 2 inches long and 1-3/4 inches wide.					
	g. Cut the cotton buckram for interlining the collar in accordance with the pattern furnished. Punch the reinforcement discs for buttons secured to shoulders and ornamental sleeve pieces from cotton buckram cloth. The reinforcement discs shall be 7/8 inch diameter with a 1/8 inch diameter hole at the center.					
	h. Cut the cotton felt for padding the collar 1-1/4 inches wide and sufficiently long to fold over the ends of the interlining for each size collar.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
1.	Cutting. (cont'd.)					
	i. Cut the scarlet wool cloth for piping the bottom and right front edge of coat, edges of shoulder straps, collar, and ornamental sleeve pieces on the straight of cloth. The piping shall be cut 5/8 inch wide for shoulder straps, collar and ornamental sleeve pieces, and 1-1/8 inches wide for bottom and right front edges of coat.					
	j. Cut the wigan for the bottom edge of sleeves on the bias in accordance with the patterns.					
	k. Dress the right vent in accordance with the patterns furnished.					
2.	Replacement of damaged parts.					
	a. Replace, at time of cutting, all parts containing damages					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
2.	Replacement of damaged parts. (cont'd.)					
	such as holes or serious weakening defects such as smashes, multiple floats and slubs likely to develop into a hole, and shade bars.					
	b. Replace all parts damaged during the manufacturing process by needle chews which may be expected to develop into a hole, scissors or knife cuts, tears, holes, mends, and burns.					
3.	Shade marking.					
	a. Mark or ticket all component parts (see 3.6.2) cut from one piece of basic material to insure uniform shade and size throughout the coat. All lining parts shall be marked, bundled, or ticketed to insure uniform shade and size throughout the garment.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
3.	Shade marking. (cont'd.)					
	b. The use of tickets with metal fastening devices or sew-on tickets is prohibited on the rayon lining.					
4.	Make belt loops.					
	Finished appearance. The belt loops shall be finish 1/2 inch wide and shall finish smooth and flat without pleats, gathers, puckers, or other distortion. The stitching shall be uniformly 1/8 inch from the finished edges.					
	a. The belt loops shall be made from a 1-inch-wide strip of basic material.					
	b. Fold the sides of the strip lengthwise towards the center, abutting the raw edges, and join the raw edges together with a covering stitch.	406	EFh-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
4.	Make belt loops. (cont'd.) c. Cut the loop for the left and right sides of the coat 3-1/2 inches long.					
5.	Make upper and lower pocket flaps. Finished appearance. The pocket flaps shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges. They shall be uniform in shape and size in accordance with the finished pocket flap shaper. The lining shall not be visible on the outside of the flaps. The buttonholes shall be cut-first type, clear cut, well made, well worked over gimp to fit a 27-line insignia button, and the stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
5.	Make upper and lower pocket flaps. (cont'd.)					
	flaps, and the purling of the buttonholes shall be on the outside of the flaps.					
	a. The pocket flaps shall be made of one ply of basic material lined with rayon lining.					
	b. Seam the lining to the basic material 3/16 inch from the side and bottom edges, evenly trimming the edges for proper turning.	301	SSe-2 (a)	10-14	A (silk)	A (silk)
	c. Turn the flaps, working the edges, corners and the point out completely. Edge-stitch the flaps uniformly 1/8 inch from seamed edges working the lining back 1/16 inch from the finished edges of the flaps.	301	SSe-2 (b)	10-14	A -or- A (silk)	A -or- A (silk)
	d. Press the flaps smooth and flat with a heated					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
5.	Make upper and lower pocket flaps. (cont'd.)					
	pressing iron or pressing machine.					
	e. Mark and trim top edge of flaps with the finished shaper so that in the finished coats, the length of the flaps at center point and sides shall conform to measurements shown in table III.					
	f. Join the raw edge of the lining and flaps together with overedge stitching.	504 or 505	EFd-1 EFd-1	8-10 8-10	A A	A A
	g. Mark a vertical eyelet end square bar type buttonhole, in the center of each breast pocket flap. Cut 3/4 inch long, through the center of each pocket flap with the eyelet 5/8 ± 1/8 inch above the center point.	But-ton-hole		38 per button-hole (not includ-ing tack)	B (silk)	F (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
5.	Make upper and lower pocket flaps. (cont'd.)					
	h. Make a vertical eyelet end square bar type buttonhole in the center of each lower pocket flap. Cut 3/4 inch long, through the center of each pocket flap with the inside edge of the eyelet 5/8 ± 1/8 inch above the center point/.	But-ton-hole		38 per button-hole (not includ-ing tack)	B (silk)	F (silk)
	i. Securely bartack the ends of the buttonholes, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Bar-tack		21 per bartack (mini-mum)	A (silk)	A (silk)
6.	Make shoulder straps.					
	Finished appearance. The piping shall be uniformly stitched to the shoulder straps without twists, gathers, puckers or pleats and shall be evenly and uniformly worked out to the edges. The straps shall finish smooth and flat					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
6.	Make shoulder straps. (contd.)					
	and shall be uniform in appearance.					
	a. The shoulder straps shall be made of one ply of basic material piped with scarlet wool broadcloth.					
	b. Seam a 5/8-inch-wide strip of scarlet piping to the shoulder straps, along front and back edges and around collar end, 1/8 inch from edges.	301	SSe-2 (b)	10-14	A -or- A (silk)	A -or- A (silk)
	-or-					
	c. Fold the scarlet piping, slightly offsetting the raw edges and seam to edge as above.	301	SSav-2 (a)	10-14	A -or- A (silk)	A -or- A (silk)
	d. Turn back the straps and scarlet piping uniformly, working the folded edge of the piping 1/8 inch beyond the ends of the straps. Topstitch the straps uniformly 3/16 inch	301	BSm-2 (b)	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
6. Make shoulder straps. (contd.)					
from the folded edges of piping. Clip the excess scarlet material at the collar end so that the strap will lie flat.					
e. Press the strap smooth and flat with a heated pressing iron or pressing machine.					
7. Make collar eyelet covers.					
Finished appearance. The collar eyelet covers shall finish 1-3/4 ± 1/8 inches wide.					
a. Turn under the side edges of the cover and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1 (each side edge)	10-14	A	A
b. Fold each cover in half across the width and seam 1/16 inch from the folded side edges. Continue stitching across the folded end.	301	SSc-1 (each side edge) OSf-1 (folded end)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
8.	Assemble collar interlining. (See figure 6). Finished appearance. The collar interlining shall be bound at the top edge with 1 inch wide strip of basic material and at the lower edge with 1 inch wide strip of polyester and cotton. The binding shall be uniformly stitched 1/4 inch from the folded edges. The binding shall not be tight or full causing puckers, gathers, or pleats. The interlining and edges of the binding shall be securely caught in the stitching. The interlining shall finish with the eyelet reinforcement pieces positioned on the inside and the felt padding positioned on the outside of the interlining. The collar eyelet covers shall be positioned so that in the finished collar, the covers					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
8.	Assemble collar interlining. (See figure 6). (cont'd.)					
	shall be centered over the eyelets.					
	a. Position the eyelet reinforcement at each end of the collar interlining. Bind each edge of the interlining, catching the reinforcements in the seams.	301	BSa-1	10-14	A	A
	b. Center the strip of felt padding on the outside of the collar interlining with the ends of the padding sufficiently long to fold over each end of the interlining. Seam the padding to the interlining from end to end, 1/8 inch from top and bottom edges, of the padding.	301	SSau-2	10-14	A	A
	c. Lap the raw edge of the collar eyelet covers 1/2 to 5/8 inch on the top inside edge of	301	LSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
8. Assemble collar interlining. (See figure 6). (cont'd.)					
the collar interlining. Seam the covers to the interlining 1/4 inch from the raw edge of the covers.					
9. Pipe outer ply of collar.					
Finished appearance. The piping shall extend the full length along both edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers or pleats.					
a. Seam a 5/8-inch wide strip of scarlet piping to the outer ply 1/8 inch from upper and lower edges.	301	SSe-2	10-14	A -or- A (silk)	A -or- A (silk)
b. Turn back the piping and outer ply at upper and lower edges, uniformly working the folded edge of the piping 1/8 inch beyond the edge of the outer ply. Topstitch the	301	BSm-2 (b)	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
9.	Pipe outer ply of collar. (cont'd)					
	outer ply uniformly 3/16 inch from the folded edges of the piping.					
	-or-					
	c. Turn back edge of collar and stitch through outer ply 1/16 inch from edge, leaving the folded edge of the slightly offset scarlet piping extending 1/8 inch beyond edge of outer ply.	301	BSm-3	10-14	A -or- A (silk)	A -or- A (silk)
10.	Assemble collar.					
	Finished appearance. The collar shall be assembled without twists, gathers, puckers, or pleats. In the finished collar, the ends of lining shall extend approximately 1/2 inch beyond the left end of the collar and approximately 2-1/2 inches beyond the right end of collar for the extension tab. Eyelet covers					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
10.	Assemble collar. (cont'd.) shall not be caught in the eyelet operation. a. Position the outer ply of the collar on the outside of the interlining assembly with the basic material on the top edge of the interlining extending uniformly 1/8 inch beyond the scarlet piping on the top edge of the outer ply. Polyester and cotton binding at the bottom edge of the interlining shall not be exposed beyond the scarlet piping on the bottom edge of the collar. b. Seam the outer ply and interlining assembly together with a row of stitches as close as possible to, but not on top of, the topstitching at the top and bottom edges of the outer ply.	301	SSa-1	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
10.	Assemble collar. (cont'd.)					
	c. Lap the top edge of the collar assembly over the top raw edge of collar lining approximately 1/2 inch, with the lining face up. Seam the collar to the lining with a row of stitches as close as possible to, but not on top of, the rows of stitches at the upper edge of the collar. The stitching shall extend from center to center of the collar eyelet covers.	301	LSa-1	10-14	A (silk)	A (silk)
	d. Smoothly fold the ends of the collar padding and outer ply to the inside over the ends of the inter-lining assembly and press smooth and flat with a heated pressing iron or pressing machine.					
	e. Turn collar lining at the seam to the inside of the collar and press smooth and					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
10.	Assemble collar. (cont'd.)					
	flat with a heated pressing iron or pressing machine.					
11.	Make collar extension tab.					
	Finished appearance. The collar extension tab shall extend 3/4 to 1 inch beyond the folded edge of the right end of the collar.					
	a. Turn the top and bottom edges and the end of the collar lining at the right end of the collar to the inside of the lining and baste the turned portion along the top, front and bottom edges to the body of the lining, forming the collar extension tab.	Hand				

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
11. Make collar extension tab. (cont'd.)					
b. Stitch the collar extension tab 1/16 inch from the top, front, and bottom edges and continue the stitching at the back of tab to top row, forming a 1-3/8 to 1-1/2 inch wide box stitch.	301	SSc-1	10-14 (top and bottom edges OSf-1 front edge) SSa-1 (back edge)	A (silk)	A (silk)
12. Fell ends of outer ply to collar.					
Finished appearance. The upper and lower edges at each end of the outer ply shall not be visible on the outside of the finished collar.					
a. Tack the ends of the outer ply to the reinforcement pieces and to the collar eyelet covers with overcast stitching.	Hand		2-3	C (silk)	
b. Make one eyelet through all plies of the collar and lining midway ± 1/16 inch between inner edges of scarlet	Eyelet		20 per eyelet	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
12.	Fell ends of outer ply to collar. (cont'd.)					
	piping and 1-1/2 ± 1/8 inches from each finished end of collar. The eyelet shall be well worked and shall finish with a 1/8 inch diameter opening.					
13.	Make ornamental sleeve pieces.					
	Finished appearance. The piping shall be uniformly stitched to the ornamental sleeve pieces without twists, gathers, puckers or pleats. The ornamental pieces shall finish smooth and flat and shall be uniform in appearance.					
	a. The ornamental sleeve pieces shall be one ply of basic material piped with scarlet.					
	b. Seam a 5/8-inch wide strip of scarlet piping to the ornamental sleeve pieces 1/8	301	SSe-2 (a)	10-14	A -or- A (silk)	A -or- A (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
13.	Make ornamental sleeve pieces. (cont'd.)					
	inch from the top, the scalloped side, and the bottom edges.					
	-or-					
	c. Fold the scarlet piping, slightly off-setting the raw edge and seam to edges as above.	301	SSav-2 (a)	10-14	A -or- A (silk)	A -or- A (silk)
	d. Turn back the sleeve pieces and the scarlet piping at the seamed edges, uniformly working the folded edge of the piping 1/8 inch beyond the edges of the sleeve pieces. Notch excess scarlet material at the top and lower points of ornamental pieces in order to reduce bulkiness. Topstitch the sleeve pieces uniformly 3/16 inch from the folded edge of the piping.	301	BSm-2	10-14	A (silk)	A (silk)
	e. Press ornamental pieces smooth and flat					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
13.	Make ornamental sleeve pieces. (cont'd.)					
	with a heated pressing iron or pressing machine.					
	f. Mark the sleeve pieces for location of insignia buttons as indicated by marks on the pattern. Assemble sleeve pieces in pairs.					
	g. Punch a hole through ornamental sleeve piece at each mark for attaching insignia buttons.					
	h. Inset the shank of the 27-line insignia buttons through the punched holes of each sleeve piece and reinforcement disc and secure each button to sleeve piece with a metal ring toggle.					
14.	Seam wool sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
14.	Seam wool sleeves at forearm. (cont'd.)					
	without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Position the top and under sleeves with notches matching and join at the forearm with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	b. Spread open the seam and press flat with a heated pressing iron.					
	c. Mark sleeve end for turnup and mark the top sleeve for positioning the ornamental sleeve piece with pattern marker.					
15.	Baste wigan reinforcement to wool sleeve.					
	a. Position the sleeve on the wigan with marks and notches matching as indicated by the pattern.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
15.	Baste wigan reinforcement to wool sleeve. (cont'd.)					
	b. Tack the left and right sleeves to the reinforcement pieces along the forearm seam allowance and along the sides of backarm seam allowance. When necessary, trim ends of reinforcement piece even with the back edges of backarm allowance.	101 or 301	SSa-1	4-6 10-14	A	A
	c. Baste sleeve and reinforcement piece together at the mark for the bottom turnup.	101	SSA-1	4-6	A	A
16.	Join ornamental sleeve piece to sleeve.					
	Finished appearance. The ornamental sleeve piece shall be uniformly stitched to the sleeve without twists, gathers, puckers, or pleats. It shall finish smooth and flat without raw edges.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
16.	Join ornamental sleeve piece to sleeve. (cont'd.)					
	The folded front edge of the ornamental piece shall not be top stitched. The position of the ornamental sleeve piece shall be as shown on figure 3.					
	a. Mark the ornamental sleeve piece on the inside 1/4 inch from raw edge. Position the sleeve piece on the sleeve with marks matching and with bottom edge of sleeve piece even with the mark for bottom turnup of the sleeve.					
	b. Seam the ornamental piece to the sleeve at the mark.	301	LSbj-1	10-14	A (silk)	A (silk)
	c. Turn back the ornamental piece at the seam and stitch as close as possible to, but not on top of, the top stitching at the top, the scalloped back, and the bottom edge.	301	LSbj-1	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
17.	Seam wool sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve at the backarm with a 3/8-inch seam, catching the ends of the wigan reinforcement piece in the stitching.	301	SSa-1	10-14	A	A
	b. Spread open the seam and press smooth and flat with a heated pressing iron.					
18.	Tack sleeve turnup to reinforcement.					
	a. Turn up the bottom edge of the sleeves at the mark and tack the raw edge to wigan reinforcement piece with blindstitching. The basic material shall not be caught in the blindstitching.	301	EFc-1 (b)	4-6	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
19. Seam sleeve linings. Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched, and shall finish smooth and flat without twists, gathers, puckers, or pleats. The seams shall start and finish evenly.					
a. Position the top and under sleeve linings in accordance with the notches on pattern and join at the forearm and backarm, respectively, with 3/8-inch seam.	301	SSa-1	10-14	A	A
20. Assemble wool sleeve and sleeve lining. Finished appearance. The sleeve linings shall be seamed to the sleeve without twists, gathers, puckers or pleats.					
a. Position the sleeve lining on the sleeve with					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
20.	Assemble wool sleeve and sleeve lining. (cont'd.)					
	the upper edge of the lining extending 3/4 to 1 inch beyond the armhole edge of the sleeve.					
	b. Seam the sleeve lining to the sleeve backarm and forearm seam allowance, respectively, commencing at the top edge of wigan reinforcement piece and extending to approximately 6 inches from armhole edge at the backarm and approximately 4-1/2 inches from armhole edge at the forearm.	301	SSa-1	6-8	A	A
	c. Pull sleeve through sleeve lining.					
21.	Fell turnup of sleeve lining.					
	Finished appearance. The sleeve linings shall not be short, tight, or twisted at bottom of sleeves.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
21. Fell turnup of sleeve lining. (cont'd).					
The sleeves shall be properly pressed.					
a. Turn under the bottom edge of sleeve lining to finish approximately 1-1/2 inches above the finished end of the sleeve and baste to turnup of sleeve.	Hand or 101				
b. Fell the folded edge of the sleeve lining to the turnup of the sleeve with blindstitching. NOTE: The bottom of sleeve lining may be felled without basting.	301 or Hand	EFc-1	6-8 8-10	0 C (silk)	0
c. Turn sleeves and assemble in pairs.					
22. Assemble front lining.					
Finished appearance. The dart and seams shall finish without gathers, puckers, or pleats.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
22.	Assemble front lining. (cont'd.)					
	a. Fold the upper front lining and stitch the waist darts in accordance with marks as indicated on pattern, tapering the upper end to a flat point, and securely tacking the points.	301	OSf-1	10-14	A	A
	b. Fold the lower front lining and stitch the waist darts in accordance with marks as indicated on pattern, tapering the lower end to a flat point, and securely tacking the points.	301	OSf-1	10-14	A	A
	c. Position the upper and lower front lining with edges even and join at the waist with 3/8 inch seam, catching the waist darts in the stitching.	301	SSa-1	10-14	A	A
	d. Press the waist darts smooth and flat toward the back, and press the waist seam toward the top with a heated					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
22. Assemble front lining. (cont'd.)					
pressing iron or pressing machine.					
23. Hem yoke.					
Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The hem shall be 3/8 ± 1/8 inch wide.					
a. Hem the bottom edge of the yoke lining, with the raw edge turned under and caught in the stitching 1/16 inch from the folded upper edge of the hem.	301	EFb-1	10-14	A	A
24. Make center pleat in yoke lining.					
Finished appearance. The pleat shall finish smooth and flat without puckers or pleats. The folded edge of the pleat on the outside of the yoke shall be toward the left side.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
24.	Make center pleat in yoke lining. (cont'd.)					
	a. Fold yoke lining in accordance with the notches on the pattern to form a 3/4 inch wide pleat at the center back.					
	b. Press the pleat smooth and flat from the top to the bottom edges of the yoke lining with a heated pressing iron.					
25.	Sew on identification and instruction labels.					
	Finished appearance. The identification and instruction labels shall be positioned so that in the finished coat, each label shall be midway between front and back edges of the facing with the bottom edge of the identification label approximately 4 inches from the bottom edge of the coat					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
25.	Sew on identification and instruction labels. (cont'd.)					
	and with bottom edge of instruction label overlapping the margin of the identification label and caught in the same row of stitching.					
	a. Sew the identification and instruction label, to the outside of the right facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge of each label except overlap)	10-14	A	A
26.	Seam poly/wool facing to front lining.					
	Finished appearance. The lining shall be carefully seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
26.	Seam poly/wool facing to front lining. (cont'd.)					
	a. Position the lining on the poly/wool facing with the top edge even, waist seam line of the lining and the notch on the facing matching. Seam front edge of lining to the back edge of facing 3/8 inch from the raw edge. The stitching shall extend from the top edge to the bottom notches of facing and lining.	301 or 401	SSa-1	10-14	A	A
	b. Press the facing-lining seam smooth and flat with a heated pressing iron, turning raw edges of facing-lining seam toward the side.					
27.	Bind backs. Finished appearance. The binding shall be uniformly stitched. It shall not be tight or full causing puckers, gathers, or pleats. The					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
27. Bind backs. (cont'd.)					
basic material shall be securely caught in the stitching.					
a. The raw edges of the center and side backs shall be bound with the 3/4 inch wide bias cut binding with the outside raw edge only of the binding turned under and caught in the stitching 1/16 inch from the inner folded edge.					
b. Bind the raw back edge of left and right center backs, respectively, from the top edge of backs to top end of vent. When binding the right center back, continue to bind the raw edge of right vent from top to bottom edge.	301	BSb-1	10-14	A	A
c. Bind the raw side edge of left and right center backs, respectively, from top to bottom edge.	301	BSb-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
27. Bind backs. (cont'd.)					
d. Bind the raw side edges of left and right side backs from top to bottom edge.	301	BSb-1	10-14	A	A
28. Seam lining to left vent.					
Finished appearance. The vent lining shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, or pleats.					
a. Fold vent lining in half lengthwise face to face and stitch along the top, from the notches to the folded edge, with a 5/16 to 3/8 inch seam. Turn vent lining to the right side, forcing out corner and seam.	301	SSa-1	10-14	A	A
b. Position the raw edge of lining on the outside of left vent, with notches on the lining in line with the top end	301	SSe-2 (a)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
28.	Seam lining to left vent. (cont'd.)					
	of vent; then seam together 3/8 inch from back edge. The lining shall extend from the notches to the bottom finished edge of coat.					
	c. Turn the lining to the inside with the seam 1/16 to 1/8 inch back of folded edge. Stitch the entire length of vent 1/8 inch from the folded edge.	301	SSe-2 (b)	10-14	A	A
29.	Join backs.					
	Finished appearance. The side and center backs shall be joined without gathers, puckers or pleats. The folded edge of the right vent shall be in vertical line with the center back seam. In the finished coat, the right center back shall overlap the left center back not less than 3 inches when measured at					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
29.	Join backs. (cont'd.)					
	bottom edge of coat and the right vent shall be 2 ± 1/8 inches wide measured at the bottom piped edge.					
	a. Stitch the 1/4 inch wide stay tape to the inside of right center back along the vent, with the edge of the tape positioned approximately 1/8 inch in front of the fold notch of the vent.	301	SSaa-1	10-14	A	A
	b. Position the center backs with edges even and join with a 5/8 inch seam from the top edge of the backs to approximately 3/4 inch below top end of the vent, and from that point continue to stitch diagonally across the top end of the left and right vents to the bound edge of the backs.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026l0-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
29.	Join backs. (cont'd.)					
	c. Turn the right vent to the inside of the right center back in accordance with the notches and edge stitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam line.	301	OSf-1	10-14	A (silk)	A (silk)
	d. Join the left and right side backs to the respective center backs with a 3/8 inch seam.	301	SSa-1	10-14	A	A
30.	Press back seams and vent lining.					
	a. The side and center back seams and vent lining shall be pressed with a heated pressing iron or pressing machine.					
	b. Notch the top end of the left vent diagonally from the juncture point of the vent and the center seam allowance of the left center					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
30.	Press back seams and vent lining. (cont'd.)					
	back to the lower end of the stitching for the center back seam.					
	c. Spread open the side and center back seams, respectively, and press flat.					
31.	Baste and stitch vent lining.					
	Finished appearance. The folded edge of the lining shall extend beyond the center seam allowance of the left backpart.					
	a. Baste vent lining to coat.	101 or Hand				
	b. Stitch the upper part of vent lining to the center back on each side of the seam allowance 1/8 inch from seamed edge of lining. Turn coat on the outside.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026l0-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
31. Baste and stitch vent lining. (cont'd.)					
c. Stitch and backstitch across the top end of vent, through the vent lining, from the back center seam to the edge of the vent.	301	SSa-1	10-14	A (silk)	A (silk)
32. Seam reinforcement stay to armhole and shoulder.					
Finished appearance. The polyester and cotton reinforcement stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers, or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
a. Seam the 3/4 inch wide polyester and cotton stays to the underside of the	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
32.	Seam reinforcement stay to armhole and shoulder. (cont'd.)					
	fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges.					
33.	Assemble fronts.					
	Finished appearance. The waist darts shall be properly tapered and shall finish without gathers, puckers or pleats. The upper and lower fronts and side body panel shall be joined without gathers, puckers, or pleats.					
	a. The fronts shall consist of an upper center front, side front body panels, and a lower front (skirt).					

Source: https://assist.dla.mil -- Downloaded: 20261-20T22:46Z
Check the source to verify that this is the current version before use.

edges and the leg bottoms shall be over-edged stitched. The inside of the waistband shall have a

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
33.	Assemble fronts. (cont'd.)					
	b. Fold the upper side fronts, matching the cut edges of the waist darts respectively. Stitch the entire length of the waist darts 3/8 inch from the cut edges at the bottom, tapering the upper ends to a flat point and securely tacking the points.	301	SSa-1	10-14	A	A
	c. Position the upper center fronts and side front panels with edges even and join with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	d. Spread open the waist darts and the center front seams and press flat with a heated pressing iron.					
	e. Position the upper and lower fronts (skirts) with edges even and join at the waist with a 3/8 inch seam and with the 1/4 inch wide	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
33.	Assemble fronts. (cont'd.) stay tape positioned on the upper fronts 1/4 inch from the lower edge and caught in the stitching. f. The tape shall be sewn with normal tension, not loose or tight, and shall extend from the center of the side body panel to not more than 2 inches from the front edge of the fronts. g. Spread open the waist seam and press flat with a heated pressing iron. h. Press and shape the fronts from the waist to the top edge on a suitable type heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest without distortion to the fronts or armhole of the coat.					

Source: https://assist.dla.mil -- Downloaded: 20261-20T22:46Z
Check the source to verify that this is the current version before use.

size designation the third is the height and the fourth one is the contract number

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
34.	Set pocket flaps. Finished appearance. The pocket flaps shall be set without twists, gathers, puckers, pleats, or raw edges. The pocket flaps on the left and right side, respectively, shall be in horizontal alignment with each other. The front edge of the upper pocket flaps shall be in a vertical straight line when buttoned. The point of the upper pocket flap shall be in line with center front and side front seam line. On the finished coat, the top edge of the pocket flaps shall be midway between the second and third buttonhole. The top edge of the bottom pocket flap shall be parallel with the waist seam and the front edge of the flap shall be in line with the front edge of upper pocket flap.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
34.	Set pocket flaps. (cont'd.) Pocket flaps shall conform to the measurements shown in table III. a. Mark the fronts in accordance with the marks on pattern for position of upper and lower pocket flaps. b. Position the pocket flaps on the outside of the fronts in accordance with the marks for the upper and lower pocket flaps, respectively. Position the polyester and cotton stay pieces for the flaps on the underside of the fronts. c. Seam the pocket flaps to the fronts through the polyester and cotton stay uniformly 1/8 inch from the serged edge of the flap.	301	LSq-2 (a)	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
34. Set pocket flaps. (cont'd.)					
d. Turn down the flaps and top stitch the flaps 1/8 inch from the raised edge.	301	LSq-2 (b)	10-14	A (silk)	A (silk)
35. Set belt loops.					
Finished appearance. The belt loops shall finish vertically straight and shall be positioned with the top front edge of the loops placed approximately 3/4 inch in front of the side seam line. The belt loops shall measure 2-1/2 ± 1/8 inches long from top to the bottom folded edges.					
a. Position one end of the 3-1/2 inch long belt loops on the right and left front and bartack the loops to the front at the top edge of the lower pocket flap. Turn under the top end of the loop and bartack the loop to the front 1/8 to 3/16	Bar-tack		28 per bartack (minimum)	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
35.	Set belt loops. (cont'd.)					
	inch from the folded edge, catching the turned under portion of the loop in the stitching.					
36.	Join back and fronts at sides.					
	Finished appearance. The back and fronts shall be carefully joined at the sides without twists, gathers, puckers or pleats.					
	a. Position the back and fronts with edges even and join at the sides with a 3/4 inch seam.	301	SSa-1	10-14	A	A
	b. Spread the side seams open and press flat with a heated pressing iron.					
37.	Tape armholes.					
	a. Sew 1/4 inch wide stay tape around the armhole from a point 1 to 1-1/2 inches above notch on the	301 or 401	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
37.	Tape armholes. (cont'd.)					
	fronts to 3/4 to 1 inch from shoulder edge on the back.					
	b. From the front notch to approximately 1-1/2 to 2 inches back of the underarm seam, the tape shall be stitched with slight tension and from this point up to 1-1/2 to 2 inches above the notch on the back, the tape shall be held taut while stitching and gathering 1/4 to 3/8 inch fullness.	301 or 401	SSaa-1	10-14	A	A
38.	Press shoulder blades and armholes.					
	a. Press the shoulder blades and armhole tapes smooth and flat with a heated pressing iron or suitable type pressing machine.					
39.	Shape fronts and trim bottom.					
	Finished appearance. In the finished coat, the					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
39.	Shape fronts and trim bottom. (cont'd.)					
	right front shall overlap the left front 4 ± 1/4 inches at the bottom edge.					
	a. Mark and shape the right front edge of the coat. Mark and trim 1/4 inch at the upper right front, from the collar notch to the front edge. Dress the right front on a line running from the top notch to the waist seam and 1 inch from the upper front edge to 1-1/8 inches at the waist seam. Continue on a straight line from the waist seam to the notch at bottom as indicated on the pattern. NOTE: The right front shall be dressed during the shaping operation in the sewing room.					
	b. Mark and shape the lower edge of coat. Trim 1/4 inch from bottom					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
39.	Shape fronts and trim bottom. (cont'd.)					
	of left front only, beginning at front edge and tapering to zero approximately 1 inch beyond the notch so that in the finished coat, the left front shall not extend below the bottom edge of the right front.					
40.	Stitch piping to coat.					
	Finished appearance. The piping shall be uniformly stitched to the bottom edge of coat and the front and top edge of right front without twists, gathers, puckers, or pleats. The piping shall extend from the bottom left front edge to the collar notch at top edge of right front.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
40.	Stitch piping to coat. (cont'd.)					
	a. Position the 1-1/8 inch wide strip of scarlet piping on the outside of the coat with one edge even with the bottom and front edge of right front. Stitch the piping to the coat 1/8 inch from the bottom edge and continue to stitch the piping to the front and top edges of the right front, leaving approximately 3/8 inch extension of piping at the end of each side of back vent for turning under.	301	SSa-1	10-14	A -or- A (silk)	A -or- A (silk)
	b. Turn the piping to the inside, working out the corners, and top stitch uniformly 3/16 inch from folded edge of the piping, catching the turned under portion of piping at each end of the back vent. The piping shall finish 1/8 inch beyond the edges	301	SSe-2 (b)	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
40.	Stitch piping to coat. (cont'd.)					
	of coat. Notch out the excess piping at lower corner of right front to eliminate bulkiness.					
	c. Notch the top edge of the piping approximately 2 inches in front of the side seam line.					
	d. Turn under the raw edge of piping along the bottom edge of coat 3/8 inch starting from the notch. Stitch the piping 1/16 to 3/32 inch from the turned edge, catching the vent lining in the stitching. Continue the stitching of the unturned edge of piping to the bottom edge of coat.	301	EFb-1	10-14	A (silk)	A (silk)
	-or-					
	e. Fold over 1/4 inch of the edge of the 1-1/8 inch piping and seam to coat as above.	301	SSav-2 (a)	10-14	A	A -or- A (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
40.	Stitch piping to coat. (cont'd.)					
	f. Press piping at the front and top edges of the right front smooth and flat with a heated pressing iron.					
41.	Interline fronts.					
	a. Properly position the left and right fronts on the respective coat front interlining and baste along the top edge of the upper pocket flap on the outside.	301	Hopper			
	b. Tack the top edge of the upper pocket flap stay and the front end of the upper and lower pocket flap stays to the coat front interlining. The front end of the stays shall be tacked as close to the side edges of the pocket flap as possible.	301	Hopper			
	c. Baste the coat front interlining and fronts together, starting	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
41.	Interline fronts. (cont'd.)					
	approximately 1-1/2 inches above the top edge of the upper pocket flap and baste along the center of the upper pocket flap, along the top edge of the lower pocket flap, and then diagonally across the front corner of the lower pocket flap, and from that point continue to baste down to the bottom of the coat.					
	d. Baste across the shoulder, allowing room for setting the shoulder pad and working the fullness toward the armhole. Baste along front of armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of the coat front interlining. Baste along the top edge, from the center basting stitches, from the shoulder to	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
41.	Interline fronts. (cont'd.)					
	approximately 1-1/2 inches from front edge. Continue to baste along the front edge to the bottom edge of fronts.					
	e. Trim the coat front interlining 1/4 inch back from the front and top front edge. The bottom of the interlining may be trimmed diagonally. Trim the inner edge of scarlet piping on the right front sufficiently so that in the finished coat, the piping will not be visible in the front buttonholes.					
	f. Place the inner edge of scarlet piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	301 or Hand	Hopper			

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
41. Interline fronts. (cont'd.)					
g. Fell upper, front and lower inner edges of piping to the coat front interlining.	301 or Hand	EFc-1 (b)	4-6 4-6	A C (silk)	A
h. Press the left and right fronts, respectively, on a suitable type heated pressing machine with the chest to conform to the shape of the body.					
i. Remove basting stitches from piping.					
42. Baste facing-lining assembly to left front.					
a. Position the left facing-lining assembly on the outside of the left front. Baste along the front and continue basting along the bottom edge. The facing shall be held slightly taut across the bottom edge of the front while basting.	301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
43.	Join left facing and front with tape.					
	a. Join the left facing to the left front 3/16 inch from the top and front edge of the coat, with the 3/8 inch wide stay tape positioned on the interlining side of fronts and caught in the stitching. The tape shall be sewn with slight tension and shall extend from the upper collar notch to 1 inch above the bottom edge of the coat.	301	SSa-1	10-14	A	A
	b. Fell the inner edge of the 3/8 inch wide tape to the coat front interlining from top to bottom ends.	103	SSm-1	4-6	A	
44.	Join facing to right front.					
	Finished appearance. The facing shall be uniformly joined to the right front without twists, gathers, puckers, or pleats.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
44.	Join facing to right front. (cont'd.)					
	a. Position the right front to the front facing (face to face) with the waist line seam of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch back from the front raw edge of facing. Mark along the top, front and bottom edge of facing.					
	b. Lap the front edge of the right front on the outside of the facing at the marks and join the front to the facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to bottom edge of the coat front only. Trim excess facing material where necessary.	301	LSa-1	10-14	A (silk)	A (silk)
	-or-					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
44.	Join facing to right front. (cont'd.)					
	c. Position right facing and lining assembly on the outside of right front and baste along front.	301 or Hand	Hopper			
	d. Join right front to facing, seaming through all plies forming a 1/8-inch piping on right front edge. The line of stitching shall be adjacent to the seam line of the scarlet piping.	301	SSav-2 (b)	10-14	A (silk)	A (silk)
	e. Remove basting on right front, open up facing and front and stitch right front 3/16 inch from edge of scarlet piping.	301	SSaw-2 (b)	10-14	A (silk)	A (silk)
	f. Press the front edge smooth and flat with a heated pressing iron or pressing machine, removing the fullness.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
44.	Join facing to right front. (cont'd.)					
	g. Remove basting from left facing; notch at collar terminal and trim upper front corner of facings.					
	h. Spread open the seam joining facing to left front from collar notch to the bottom edge of coat and press smooth and flat with a heated pressing iron.					
45.	Baste fronts.					
	a. Turn the facing-lining assemblies to the inside of fronts, completely working out the corners.					
	b. Baste along the front edge of right side, working the facing back from the folded edge of the piping.	101 or Hand				
	c. Baste along the front edges on left side, working the seam to the edge of the coat.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
45.	Baste fronts. (cont'd.)					
	The basting shall extend from collar notch to bottom edge of coat.					
46.	Baste facings (second time).					
	a. Baste the facings to the fronts approximately 1-1/2 inches from the top, front and bottom edge of coat, holding the lower corner of coat in such a manner as to cause the lower front edge of the fronts to roll inwards towards the back edge of the facing while basting.	Hand or 301	Hopper			
	b. Notch at collar terminal. Turn under and baste the top edge of the right facing to the front from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	301 or Hand	Hopper			

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
46.	Baste facings (second time). (cont'd.)					
	c. Baste facings to fronts starting approximately 3 inches down from the shoulder edge of facing and as close as possible to the facing-lining seam, placing the fullness over the chest; continue to baste the facing along the inner folded edge of the binding from the bottom end of the facing-lining seam to mark at lower edge of facing, properly distributing the fullness in the facing. Turn up the bottom edge of facing at the mark and baste along the folded edge.	301 or Hand	Hopper			
47.	Tack facings at back edge to interlining.					
	a. Tack the right and left facing-lining seam allowances to the respective coat front interlining from bottom edge	103	SSm-1	4-6	A	

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
47.	Tack facings at back edge to interlining. (cont'd.)					
	of interlining to not more than 3 inches below the shoulder edge.					
48.	Baste yoke lining to back.					
	a. Properly position and baste the one-piece rayon yoke lining to the inside of the back along the center pleat and along the arm-holes, shoulder, and bottom edge of the yoke.	301 or Hand	Hopper			
49.	Baste and fell front linings.					
	a. When necessary, trim the back end of lower pocket flap stays away from side seams.					
	b. Fold the front lining in accordance with the notches, forming the chest pleat, and baste lengthwise along the entire center of pleat.	301 or Hand				

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
49.	Baste and fell front linings. (cont'd.)					
	Continue to baste from the lower end of the pleat toward the lower edge of armhole, along side seam and across bottom edge of lining. The folded edge of the pleat on the outside of the lining shall be towards the armhole.					
	c. Turn under the back and bottom edge of the front lining and baste to coat, lapping the folded edge over the side, seam, bottom, and yoke lining while basting, allowing room for felling.	Hand or 301	Hopper			
	d. Fell the turned under portion of lining at bottom scarlet piping and side seam allowance of the fronts and to the yoke lining with blind-stitching 1/4 to 3/8 inch from the folded edge. Stitching shall	301	EFc-1 (b)		0 (silk)	0 (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
49. Baste and fell front linings. (cont'd.)					
extend from bottom edge of front lining to the lower edge of armhole.					
50. Trim lining and interlining.					
a. Trim the excess coat front interlining and front lining at the armhole.					
b. Trim the yoke lining even with the back at the neck.					
51. Edge stitch left front.					
Finished appearance. The edge stitching on the left front shall be uniform and the same gage as on the pocket flaps.					
a. Edge stitch the left front uniformly 1/8 inch from the top and front edges. The stitching shall extend from collar notch to bottom edge of coat.	301	SSe-2 (shows finished seams)	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
52.	Baste shoulder pads.					
	a. Insert shoulder pads between interlining and chest padding of coat front interlining in line with armhole edge and securely tack the pad to the interlining and chest padding only.	301 or Hand				
53.	Press front edges.					
	a. Press the left and right front edges individually smooth and flat with a heated pressing iron or pressing machine.					
54.	Make buttonholes.					
	Finished appearance. The buttonholes shall be cut-first type, clean cut, well made and well worked over gimp to fit a 27-line insignia button and the 30-line sewing hole button. The stitching of the buttonholes shall be securely caught					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
54.	Make buttonholes. (cont'd.) in the basic material. The gimp shall be pulled through to the underside of the front. The purling of the buttonholes shall be on the outside. The inside edge of the eyelet end of the buttonholes shall be 5/8 inch from front edge of piping. a. Mark the right front in accordance with the marks on the pattern for the locations of seven buttonholes. The mark for the bottom buttonhole shall be on the waist seam, the mark for the top buttonhole shall be 7/8 inch below the top piped edge of the front, and the marks for the remaining five buttonholes shall be evenly spaced.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
54. Make buttonholes. (cont'd)					
b. Make one horizontal eyelet-end, square-bar type buttonhole, 3/4 to 7/8 inches long, at each of the marks.	But-ton-hole		50 per button (mini-mum not includ-ing bar-tack)	B (silk)	F (silk)
c. Care should be exercised when making the button-hole at the waist, so that the seam does not come open beyond the ends of the buttonhole.					
d. Securely bartack the ends of each button-hole, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Bar-tack		21 per bartack	A (silk)	A (silk)
55. Seam shoulders.					
Finished appear-ance. The shoul-der seam shall finish without a distorted appear-ance.					
a. Join the front to the back at the shoulders with a 3/8 inch seam, working in the	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
55.	Seam shoulders. (cont'd) proper fullness on the backs in accordance with good manufacturing practice. b. Spread open the shoulder seam and press flat, holding the shoulders short and exercising much care in the pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
56.	Set shoulder straps. Finished appearance. The shoulder straps shall be uniformly stitched to the coat without twists, puckers, pleats, or other distortions. On the finished coat, the straps, including the					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
56.	Set shoulder straps. (cont'd.) piping, shall be 2-3/8 ± 1/8 inches wider at the armhole seam and shall taper to 1-3/4 ± 1/8 inches at the center of the insignia button; the rounded end of the strap shall be 1/4 to 3/8 inch from the lower edge of the collar. a. Position the shoulder straps with the back edge of the strap 3/8 to 1/2 inch to the back of the shoulder seam at the armhole and with the rounded end, on the finished coat, to be 1/4 to 3/8 inch from the lower edge of collar. b. Seam the shoulder straps to the coat at the front and back edges and around the collar end as close as possible to, but not on top of, the stitching for the piping. Trim the shoulder	301	SSa-1	10-14	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
56.	Set shoulder straps. (cont'd.) strap even with the armhole, where necessary.					
57.	Attach shoulder strap buttons. Finished appearance. The center of the insignia buttons in the finished coat shall be 3/4 inch to 7/8 inch from the rounded end of the shoulder strap. a. Mark each shoulder strap for the location of one 27-line insignia button. b. Punch a hole at the mark through the shoulder strap and fronts only. Insert the shank of insignia button through the hole and reinforcement disc and secure button to coat on inside with a ring toggle. -or-					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No. Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
57. Attach shoulder strap buttons. (cont'd.)					
c. Make one eyelet at the mark on each shoulder strap. The eyelets shall be well worked, and shall finish with a 1/8 inch diameter opening.	Eyelet		20 per eyelet (minimum)	A (silk)	A (silk)
58. Baste shoulder.					
a. Position the front lining and coat front interlining at the neck, shoulder and armhole edges at the front. Baste all plies together on the outside along the front edges of armhole and continue along the shoulder seam, catching the shoulder pad in the basting. Turn coat on the inside.					
59. Baste lining at shoulder.					
Finished appearance. In the finished coat, the yoke lining shall be lapped on the					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
59.	Baste lining at shoulder. (cont'd.)					
	facing-lining assembly.					
	a. Turn under edges of back yoke lining at shoulders and baste upper part of each shoulder over the front shoulder lining with end of chest pleat caught in basting.	Hand or 301	Hopper			
	-or-					
	b. In lieu of basting the lining at the shoulder as required in 58.a., 59.a., and hand felling as required in 65.d., trim the shoulder edge of the front lining, the coat front interlining, and yoke lining to approximately 3/8 inch from shoulder at the armhole edge and tapering to 1/8 inch at the neck, and join the yoke lining to the facing-lining assembly at the shoulder with a 3/8-inch seam,	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
59.	Baste lining at shoulder. (cont'd.)					
	securing the top end of the chest pleat in the seam, and working in the proper fullness on the back. In the finished coat, the yoke lining shall be lapped on the facing lining assembly.					
60.	Seam neckline with size label and hanger.					
	Finished appearance. The neckline shall finish smooth and flat without twists, pleats, or puckers. The size label shall be positioned between the ends of the coat hanger so that in the finished coat, the hanger opening shall be 2 ± 1/8 inches long when measured along the lower edge of collar lining.					
	a. Join facings and the yoke lining to the coat at the neckline	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
60.	Seam neckline with size label and hanger. (cont'd.)					
	from collar notch to collar notch with a 1/4 inch seam and with the upper edge of the size label and the ends of the coat hanger properly positioned and caught in the stitching at the inside center back.					
61.	Set collar.					
	Finished appearance. The collar shall be carefully joined to the coat without twists, puckers, pleats, raw edges, or distortion.					
	a. Mark neckline on the outside 1/2 inch from top edge for proper positioning of collar.					
	b. Position the collar with the lower edge lapped on the outside top edge of coat at the mark.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
61.	Set collar. (cont'd.)					
	c. Seam the collar, from end to end, to the coat as close as possible to, but not on top of, the stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining.	301	LSa-1	10-14	A (silk)	A (silk)
62.	Set sleeves.					
	Finished appearance. The armhole sleeve seam shall finish smooth and flat without twists, gathers, puckers or pleats.					
	a. Position sleeves on outside of coat at the armholes with back notch of sleeve matching the side-back seam line, and with notch in top sleeve and fronts matching.					
	b. Join the sleeves to the coat with a 3/8 inch seam, distributing the fullness in accordance	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
62.	Set sleeves. (cont'd.)					
	with good manufacturing practice and catching the ends of the shoulder straps in the stitching.					
	c. Notch armhole seam allowance on back and front adjacent to each side of the shoulder strap.					
	d. Press fullness of sleeve flat all around armhole, with the seam facing toward the sleeve, with a heated pressing iron on a suitable shaped pressing buck, shrinking fullness and holding armhole short. Care shall be exercised in pressing armhole seam in order not to stretch armhole.					
63.	Baste armhole.					
	a. Baste around the entire armhole on the inside, holding the yoke lining, shoulder pad, and front	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
63.	Baste armhole. (cont'd)					
	lining in place and distributing fullness evenly. Turn the coat on the outside.					
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of the sleeves to the front notch of coat.	Hand or 301	Hopper			
64.	Stitch sleeve head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					
	a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
64.	Stitch sleeve head pads and linings at armhole. (cont'd.)					
	armhole sleeve seam and with one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the armhole and the stay for the upper pockets, the front and yoke linings, and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, trimming away the excess material.	301	SSa-1	4-6	24/4	24/4
65.	Fell sleeve linings.					
	a. Position the sleeve lining at the armhole with back forearm seams of sleeves and lining matched.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
65.	Fell sleeve linings. (cont'd.) Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and yoke lining at the armhole. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of lining and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge from approximately 1-1/2 inches to the front of the forearm sleeve lining seam and extend the stitching to the side seam of body lining.					
	-or-					
	b. Stitch the sleeve lining by machine to the armhole on the inside from the forearm to backarm seam across the undersleeve.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
65.	Fell sleeve linings. (cont'd.)					
	c. Fell the lower corners of the front linings to the facings and the front seam allowance, respectively.	Hand		8-10	C (silk)	
	d. Fell the yoke lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of the yoke lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (silk)	
66.	Tack facings.					
	a. Securely tack the folded top edge of right facing to the scarlet piping at top edge of coat from collar notch to front edge.	Hand		8-10	C (silk)	
	b. Fell the lower back and bottom edges of facings to the scarlet piping at bottom edge of coat, starting at the top edge of piping and continuing	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
66.	Tack facings. (cont'd.)					
	along the back and bottom edges of facing to front edge of coat.					
	-or-					
	c. Stitch the bottom folded edge of facing to coat through all plies. The left facing may be caught in the edge stitching specified in operation 61.a., continuing to the back edge of facing. The right facing may be caught by super-imposing a row of stitching on the piping and raise stitching from back edge of facing and up front edge for 1/2 inch.	301	SSc-1	10-14	A	A
67.	Sew hook and eye to collar.					
	Finished appear-ance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
67.	Sew hook and eye to collar. (cont'd.)					
	the front of collar without misalignment or gap.					
	a. Position and securely sew the hook to the left end and the eye to the right end of the collar.	Hand		10 per hook and eye (minimum)	C (silk) (double thread)	
68.	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (silk)	
	b. Turn under the end and top edge of the lining at the left end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge to the end of the stitching, joining the lining to the collar.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
68.	Finish collar. (cont'd.)					
	c. Turn under and fell the lower folded edge of the collar lining to the coat from end to end, catching the turned under portion of the lining at the left end in the felling.	Hand		8-10	C (silk)	
	-or-					
	d. If the lower folded edge of collar lining is stitched by machine in lieu of hand felling, the lining shall be basted prior to stitching.	301	EF1-1	10-14	A	A
	e. Fell the collar extension tab to the right end of the collar and continue along the folded top edge to the end of the stitching, joining the lining to the collar.	Hand		8-10	C (silk)	
	f. Turn the collar eyelet covers to the inside of the collar and fell the cover to the collar lining	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
68.	Finish collar. (cont'd.)					
	along the front edge. Continue the felling along the bottom edge for a distance of approximately 1/2 inch from the front edge.					
69.	Clean coat.					
	a. Pull all basting thread, trim and remove all loose ends of thread, and remove all spots, stains and tickets without injury to the material.					
70.	Press coat.					
	Finished appearance. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

the 3.3.4.2 Outer-crown interlining. The material for interlining

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
70.	Press coat. (cont'd.)					
	a. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even.					
	b. Press the entire collar smooth and flat.					
	c. Press the upper fronts on a body machine, shrinking in and properly shaping the chest.					
	d. Press the lower fronts smooth and flat.					
	e. Press the sides, working the fullness towards the back.					
	f. Press the back smooth and flat, removing all fullness and lapping the right vent on the left vent.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

two free ends 1-3/4 inches in length as

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
70.	Press coat. (cont'd.) g. Press the sleeves smooth and flat, without injury to the buttons on ornamental sleeve pieces, creasing at the backarm and forearm. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 1 to 1-1/2 inches above the bottom edge of the breast pocket flap. The backarm crease shall be in line with the forearm crease. h. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine. i. Press the armholes solid from the inside, creasing the armholes at the front, back and armpit. The armpit and the back of the armhole shall be held					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Bob/ Lpr
70.	Press coat. (cont'd.)					
	short while pressing.					
	j. Block the armholes on a pressing buck, shrinking in the top sleeves.					
	k. Press lower edge of coat smooth, flat, and even.					
	l. Remove all wrinkles and impressions from under pocket flaps. Remove all impressions of the side and center back seam allowances from the coat. Press linings throughout, removing all wrinkles and creases. Press the front and yoke lining pleats smooth and flat.					
71.	Mark for buttons.					
	a. Mark the left front for the location of six 27-line insignia buttons and one 30-line sewing hole button to					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
71.	Mark for buttons. (cont'd.) properly engage with the button-holes in the right front. The mark for top button shall be in line with right front end of collar and remaining buttons shall be in verti-cal alignment with top mark. b. Mark left and right front for the location of 27-line insignia buttons to proper-ly engage with the buttonhole in the upper and lower flaps.					
72.	Sew on buttons. Finished appear-ance. The buttons shall be securely sewn to the coat and shall properly engage buttonholes in right front and upper and lower pocket flaps. The insignia buttons on the front and pocket flaps shall finish with the head of the eagle in an upright position. When					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

TABLE I. Manufacturing requirements.

No.	Operation	Stch Type	Seam/ Stch Type	Stch per Inch	Thread Ndl	Thread Bob/ Lpr
72.	Sew on buttons. (cont'd.)					
	the coat is buttoned, the center line of the buttons shall be midway between the front edge of the pocket flaps.					
	a. Sew one 27-line insignia button at each of the marks on the left front. The buttons shall be sewn through all plies of material.	101 or 301 or Hand		21 per button 21 per button 4-6 per button (double thread)	24/4 24/4	24/4
	b. Sew one 30-line sewing hole button at the waist mark on the left front through all plies, necking the button for shank wrapping.	101 or 301 or Hand		21 per button 21 per button 6-8 per button (double thread)	24/4 24/4 24/4	24/4
	c. Shank wrap the 30-line sewing hole button.	Hand or Machine		4 wraps (double thread) 16 stitches per shank	24/4 24/4	24/4
	d. Sew a 27-line insignia button at the mark made through the buttonhole eyelet, of lower and upper pocket flaps.	101 or 301 or Hand		21 per button 21 per button 4-6 per button (double thread)	24/4 24/4	24/4 24/4

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to measurements shown in tables II and III.

Table II - Coat measurements.

Short

Size	Breast 1/	Back Length 2/	Sleeve Length 3/	Collar Length 4/
6	33-1/2	26	16-1/4	13-1/2
8	34-1/2	26-1/4	16-1/4	13-3/4
10	35-1/2	26-1/2	16-1/4	14
12	37	26-3/4	16-1/4	14-1/4
14	38-1/2	27	16-1/4	14-3/4
16	40	27-1/4	16-1/4	15-1/4
18	42	27-1/2	16-1/4	15-3/4
20	44	27-3/4	16-1/4	16-1/4

Regular

Size	Breast 1/	Back Length 2/	Sleeve Length 3/	Collar Length 4/
6	33-1/2	27	17-1/4	13-1/2
8	34-1/2	27-1/4	17-1/4	13-3/4
10	35-1/2	27-1/2	17-1/4	14
12	37	27-3/4	17-1/4	14-1/4
14	38-1/2	28	17-1/4	14-3/4
16	40	28-1/4	17-1/4	15-1/4
18	42	28-1/2	17-1/4	15-3/4
20	44	28-3/4	17-1/4	16-1/4
22	46	29	17-1/4	16-3/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE II. Coat measurements - Continued.

Long				
Size	Breast 1/	Back Length 2/	Sleeve Length 3/	Collar Length 4/
8	34-1/2	28-3/4	18-1/2	13-3/4
10	35-1/2	29	18-1/2	14
12	37	29-1/4	18-1/2	14-1/4
14	38-1/2	29-1/2	18-1/2	14-3/4
16	40	29-3/4	18-1/2	15-1/4
18	42	30	18-1/2	15-3/4
20	44	30-1/4	18-1/2	16-1/4
22	46	30-1/2	18-1/2	16-3/4
Tolerance	± 1/2	± 1/2	± 1/2	± 1/4

1/ Breast measurement shall be taken with coat buttoned from folded edge to folded edge, in line with pit of armhole, and multiply by 2.

2/ Back length measurement shall be taken along center back seam from lower edge of collar to piped edge of coat.

3/ Sleeve length measurement shall be taken along forearm seam from pit of armhole to bottom edge of sleeve.

4/ Collar sizes represent length of collar in inches measured from end to end along the center.

TABLE III. Pocket flap measurements. 1/

Upper Pocket Flaps		
Size (Short, Regular, Long)	6-12	14-22
Length of flap at center point	2-1/2	2-1/2
Width of flap at top edge	4	4-1/2
Lower Pocket Flaps		
Size (Short, Regular, Long)	6-12	14-22
Length of flap at center point	3-1/2	3-1/2
Width of flap at top edge	6	6-1/2

1/ Tolerance on all measurements: ± 1/8 inch

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements, however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.1.2 Certificate of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.4)
b. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in MIL-STD-105.

4.4 First article inspections. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.5.3.2 through 4.5.3.5. The presence of any defect or

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

failure to pass any test shall be cause for rejection of the first article. The number of units to be inspected shall be specified by the contracting officer (see 6.2).

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing specified in FED-STD-191 shall be used, wherever applicable. Testing shall be performed on components listed in table IV for characteristics noted.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE IV. Test Methods.

Components	Characteristics	Rqmt. para.	Test Method	No. Determination per sample unit	Results reported as:
Cloth, Cotton, Buckram (collar interlining)	Material identification	3.3.4.1	1200	1	Pass or fail
	Weave (single ply)	3.3.4.2	Visual	1	Pass or fail
	Texture- threads per inch (single ply) -warp -filling	3.3.4.3	5050		Avg. of the 3 det in each direction to the nearest whole number.
	Resistance to: -Wet (dry) cleaning (laminated cloth)	3.3.4.4	5622	1	Satisfactory or unsatisfactory to standard. If no standard; good, fair or poor.
	-Accelerated aging (laminated cloth)	3.3.4.4	5622	1	Pass or fail
	-Perspiration	3.3.4.4	5682		Satisfactory or unsatisfactory to standard. If no standard: good, fair or poor

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE IV. Test Methods - Continued.

Components	Characteristics	Rqmt. para.	Test Method	No. Determination per sample unit	Results reported as:
	Stiffness - in. lb.				
	-original 1/	3.3.4.4.1	5202	10	
	-after wet (dry) cleaning 2/	3.3.4.4.1	5622	10	Nearest 0.001 lb.
	-after accelerated aging 3/	3.3.4.4.1	5850	10	
	-after perspiration 4/	3.3.4.4.1	5680	10	
	Weight - oz. per sq. yd.	3.3.4.4.2	5041	5	Avg. of the 5 det to nearest 0.1 oz.
	Breaking strengths lbs. (laminated cloth)	3.3.4.4.3	5100		Avg. of the 5 det in each direction to the nearest 1.0 lbs.
	-warp direction			5	
	-filling direction			5	
Padding, felt (for collar)	Material identification	3.3.5	1200	1	Pass or fail
	Weight - oz/per sq. yd.	3.3.5	5041	5	Avg. of all det to nearest 0.1 oz.
	Color	3.3.5	Visual	1	Pass or fail

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

TABLE IV. Test Methods - Continued.

Components	Characteristics	Rqmt. para.	Test Method	No. Determination per sample unit	Results reported as:
Hook and eye	Material identification 5/	3.3.16	Std Comm'l	1	Pass or fail
	Design	Fig. 1	Visual	1	Pass or fail
	Measurements	Fig. 1	Std Comm'l	1	Pass or fail
	Finish	3.3.16.1	Std Comm'l	1	Pass or fail
	Finish (tackiness) 6/	3.3.16.1		1	Pass or fail

1/ Method 5202, using a moment-weight of 1 pound.
2/ Method 5622, except the material shall be subjected to three 20-minute test cycles.
3/ Method 5850, except the aging process shall be limited to 5 hours at a temperature of 100 °C.
4/ Method 5680, except the material shall be immersed in the specified solution for 20 minutes and then air-dried.
5/ Accept a certificate of compliance for this requirement.
6/ Test for tackiness. At room temperature (60 ° to 80 °F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

4.5.1.1 Sampling. When specified in the contract or purchase order, sampling shall be in accordance with MIL-STD-105. The unit for expressing lot size and sample unit for testing each component shall be in accordance with the applicable subsidiary specification and as follows:

Components	Lot size expressed as	Sample Unit for testing
Padding for collar	Yards	1/4 yd. full width
Cloth, Cotton, Buckram (for collar)	Yards	2 yds. full width
Buttons, (Each type and size)	Gross	20 each
Ring, toggle	Gross	5 complete sets
Hook and eye	100 each	2 ea, hook and eye

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.3 Examination of the end item. Prior to the formation of a lot and as a final step in the contractor's production control plan, each coat shall be buttoned on a model form and examined for those defects listed in 4.5.3.2, 4.5.3.3, 4.5.3.4, and 4.5.3.5. The sample unit shall be one coat. The inspection level shall be II (see 6.5).

4.5.3.1 Classification of defects. All defects shall be classified as indicated below except those numbered 1 through 26 in the classification column which shall be classified as:

Major defect - When seriously affecting appearance or serviceability.
Minor A defect - When affecting appearance or service-ability, but not seriously.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

4.5.3.2 General defects. General defects shall be classified as follows:

Examine	Defect	Classification Major	Minor A	Minor B
Bartacks	One or more missing, loose or misplaced (except bartacks on buttonholes).		201	
Buttonholes (construc-tion)	a. One or more omitted, added, or wrong type.	101		
	b. Not corresponding to size of button (front and flaps): - too small, not permitting button to enter buttonhole. - too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).	102	202	
	c. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	103		
	d. Bartack missing or loose on: - one front buttonhole. - two or more front buttonholes. - one or more flap buttonholes.	104	203 204	
	e. Bartack misplaced, not serving intended purpose on one or more buttonholes: - front buttonholes. - flap buttonholes.	105	205	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	f. One or more broken stitches in:			
	- one front buttonhole.		206	
	- two or more front buttonholes.	106		
	- one flap buttonhole.			301
	- two or more buttonholes.		207	
	g. More than 2 skipped stitches in:			
	- one buttonhole.			302
	- two or more buttonholes.		208	
	h. Ragged edges, affecting appearance.			303
	i. Any uncut buttonhole.		209	
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		210	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified:			
	- one or two stitches.			304
	- three or more stitches.		211	
	l. One or more buttonholes finished with purling on the underside.	107		
Buttons	a. One or more missing, loose, defective, or improper size or type.		212	
	b. One or more buttons sewn with the head of the eagle in other than upright position (front and pockets).			305
	c. Bottom button on front not shank wrapped.		213	

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
Note:	Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; unsound soldering; scratches or dents; blemishes or imbedded foreign matter; loose or bent shanks; or are poorly plated or badly shaded.			
Ring toggles and reinforcement discs	Shoulder and ornamental sleeve piece buttons:			
	a. One ring toggle omitted.			306
	b. Two ring toggles omitted.		214	
	c. Three or more ring toggles omitted.	108		
	d. One or more reinforcement discs omitted.		215	
Cleanness	a. Any spot or stain clearly noticeable: - on outside. - on inside.	109		 307
	b. Thread ends not trimmed throughout garment, or one or more bastings not removed, or two or more shade tickets not removed.			308
	c. Any residue of synthetic thread when used not brushed off or removed.			309
Components and assembly	a. Any component part or required operation omitted (not herein classified).	1		
	b. Any defective component or defect of assembly (not herein classified).	2		

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
Cutting	a. Any component part of basic wool material not cut in accordance with directional lines on patterns; or in accordance with specification requirements.	110		
	b. Wool broadcloth for piping cut on bias.		216	
	c. Any lining part not cut in accordance with directional lines on patterns; or in accordance with specification requirements.		217	
Eyelets	a. One or more omitted or added.	111		
	b. Wrong type.		218	
	c. Eyelet not securely caught on fabric, causing stitching to pull away from fabric.	112		
	d. Diameter of inside opening less than 1/8 inch or more than 1/4 inch.		219	
	e. One or both eyelets uncut.		220	
	f. One or more broken stitches in: - one eyelet. - two eyelets.		 221	310
	g. More than two skipped stitches in one or both eyelets.		222	
	h. Purling not on outside of collar.			311
Hook and eye	a. Hook or eye omitted.	113		
	b. Not specified type or size.		223	

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	c. Hook or eye not securely tacked to ends of collar.		224	
	d. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hook and eye are fastened.	114		
Material defects and damages	a. Any weakening defect, such as smash, multiple float, and loose slub.	3		
	b. Any hole.	4		
	c. Shade bar, unsightly slub, etc., affecting appearance: - on outside. - on inside.	5	 225	
	d. Scissors or knife cut, tear, mend, or burn.	6		
	e. Needle chews that may develop into a hole.	7		
Note:	Material defects and workmanship damages are to be classified as indicated above only when the condition weakens the fabric or when it is conspicuously located. Nonweakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows: Material defect — No defect Workmanship damages — Minor B defect			
Pressing	a. Burned or scorched.	8		
	b. Pressing omitted entire garment.		226	
	c. Armhole stretched.	9		

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	d. Poorly pressed (unless otherwise indicated).			312
	e. Basting or pressing impressions not removed.			313
	f. Gloss not removed.			314
	g. Armholes not blocked or poorly blocked.		227	
	h. Edges bulky, i.e., not pressed solid.		228	
	i. Inside of armhole not creased as required.		229	
	j. Armhole seam not pressed open across top as required.		230	
	k. Wrinkles or pressing impressions not removed under pocket flap, side, or center back seam allowance.			315
	l. Linings not pressed smooth.			316
Seams and stitching	a. Accuracy of seaming:			
	1. Any seam twisted, gathered, puckered, or pleated.		231	
	2. Part of garment caught in any unrelated operation or stitching.	10		
	3. Unsightly hand felling or blindstitching exposed on outside of coat, affecting appearance.		232	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.			317

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	5. Wrong color of thread or two shades of thread used on outside of coat, affecting appearance.	11		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular, i.e., unevenly gaged, or various stitchings not uniform, affecting appearance.		233	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			318
	c. Open seams:			
	1. On outside:			
	- up to 1/4 inch inclusive.			319
	- more than 1/4 inch but not more than 1/2 inch.		234	
	- more than 1/2 inch.	115		
	2. On inside:			
	- more than 1/2 inch (except machine felling).		235	
	- up to 1/2 inch inclusive (except machine felling).			320
	- up to 1 inch inclusive (machine felling).			321
	- more than 1 inch (machine felling).		236	
Note:	One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.			
	d. Raw edges:			
	1. On outside:			322
	- up to 1/8 inch inclusive.			
	- more than 1/8 inch but not more tha 1/4 inch.		237	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	- more than 1/4 inch.	116		
	2. On inside:			
	- more than 1/8 inch but not more than 1/4 inch.			323
	- more than 1/4 inch.		238	
Note:	Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.			
	e. Run-offs (see classification of open seams).			
	f. Stitch tension:			
	1. Loose tension resulting in loose seam.	117		
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		239	
	3. Tight tension (stitches break when normal strain is applied).	118		
Note:	Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting pull in lengthwise direction of seam.			
	g. Stitches per inch (including labels) less than minimum specified:			
	- one or two stitches.			324
	- three stitches.		240	
	- four or more stitches.	119		
	- one or more stitches on labels.			325
Note:	To be scored only if condition exists on major portion of seam.			
	h. Wrong stitch or seam type.		241	

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	i. Stitching skipped or broken (on edge or raised stitching when seam is seamed, turned and stitched):			
	-1/4 inch or more but not more than 1/2 inch.			326
	- more than 1/2 inch.		242	
Shaded parts	a. On outside:			
	1. Any shaded part (except belt loops).	12		
	2. Belt loop badly shaded.			327
	b. On inside:			
	1. Any lining part badly shaded (except sleeve lining).		243	
	2. Any lining part badly shaded or pairs not matching each other.			328
4.5.3.3 Detailed defects (coat buttoned on form). Detailed defects (with coat buttoned on form) shall be classified as follows:				
Collar (construction and setting)	a. Interlining omitted.	120		
	b. Interlining tight or twisted, causing puckers on collar, affecting appearance.		244	
	c. Tight at joining to front or back, causing puckers or pleats at neck of coat, affecting appearance.	13		
	d. Piping irregular, affecting appearance.		245	
	e. Collar ends overlapping when fastened.		246	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	f. Collar ends spread open more than 1/4 inch when fastened.	121		
	g. Binding strip at top edge of interlining other than specified basic material.	122		
	h. Center of eyelets from finished ends of collar: - less than 1-3/8 inches or more than 1-5/8 inches.		247	
	i. One or both eyelets off-center with top and bottom edges of collar by more than 1/4 inch.		248	
	j. Collar off-center by more than 1/4 inch.	123		
	k. Finished width of collar (short sizes): - less than 1-5/8 inches or more than 1-7/8 inches.		249	
	l. Finished width of collar (all other sizes): - less than 1-7/8 inches or more than 2-1/8 inches.		250	
	m. Collar irregular in width by 1/4 inch or more.		251	
	n. Front finished ends of collar uneven in width by 3/16 inch or more.	124		
	o. Binding not exposed or not extending uniformly 1/8 inch beyond piping at top edge of collar.		252	

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	p. End of collar distorted, twisted, or crooked, caused by hand felling or hand stitching exposed on outside of either collar end.		253	
	q. Hand tacking at lower corner of collar to coat insecure or omitted.		254	
Alignment of front buttons and buttonholes	Not aligned, causing a noticeable bulge or twist on fronts when buttoned, affecting appearance.	14		
Length of buttoned fronts	a. Right front at corner shorter than left front at bottom by: - more than 1/8 inch but not more than 1/4 inch.		255	
	- more than 1/4 inch.	125		
	b. Right front at corner longer than left front by: - more than 1/4 inch but not more than 3/8 inch.			329
	- more than 3/8 inch.		256	
	c. Left front at corner exposed beyond bottom edge of right front by more than 1/8 inch.		257	
Alignment of front waist seams	Out of horizontal alignment by more than 1/4 inch.		258	
Pocket flap alignment position and construction	a. Flaps (all flaps): 1. Lining tight or twisted, causing fullness or twist on flaps, affecting appearance.	15		
	2. Overedge stitching on upper edge of flap omitted on: - one flap.			330

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	- two or more flaps.		259	
	3. Lining exposed on edge of flap, affecting appearance.		260	
	4. Poorly shaped, not in conformity with flap shaper.	16		
	5. Stitching joining flaps to fronts not caught through lining staypiece.		261	
	6. Corners of flaps not securely backstitched.		262	
	b. Flap buttonholes (position):			
	1. Position of buttonholes from pointed edge of flap (measured to inside edge of eyelet): - less than 1/2 inch or more than 3/4 inch.		263	
	2. Out of alignment with point at center of flap by more than 1/8 inch.		264	
	c. Upper pocket flaps (position):			
	1. Out of horizontal alignment by: - 1/4 inch or more but not more than 3/8 inch.		265	
	2. Top edge of flap not positioned midway between second and third buttonholes.		266	
	d. Upper pocket flap measurements:			

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	1. Length and width of pocket flaps different from dimensions and tolerances included in table III:			
	- by more than tolerance but not more than twice the tolerance.			331
	- by more than twice the tolerance.		267	
	e. Lower pocket flaps (position):			
	1. Out of horizontal alignment by:			
	- 1/4 inch or more but not more than 1/2 inch.		268	
	- more than 1/2 inch.	126		
	2. Front edge of flaps not parallel with front edge of coat by 1/4 inch or more when coat is buttoned.		269	
	3. Top edge of flap not parallel with the waist seam by 1/4 inch or more.		270	
	f. Lower pocket flap measurements:			
	1. Length and width of pocket flaps different from dimensions and tolerances included in table III:			
	- by more than tolerance but not more than twice the tolerance.			332
	- by more than twice the tolerance.		271	
Shoulder (construc-tion)	Improperly joined or set, causing shoulders or back to twist.	17		

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
Shoulder pads	a. Not completely caught in armhole tacking.		272	
	b. Misplaced, not serving intended purpose, i.e., too far back or too far forward.		273	
	c. One or both pads omitted.	127		
Shoulder straps	a. Misplaced, i.e., one strap further forward or back from position of other strap, affecting appearance.		274	
	b. Strap stitched to coat too full or twisted, or stitched to coat too tight, causing fullness or twist on front or back of coat.		275	
	c. Poorly shaped.			333
	d. Shoulder seam exposed beyond back edge of shoulder strap (except rounded end).		276	
	e. Width of shoulder strap at armhole seam (including piping):			
	- less than 2-1/4 inches but not less than 2-1/8 inches.			334
	- more than 2-1/2 inches but not more than 2-5/8 inches.			335
	- less than 2-1/8 inches or more than 2-5/8 inches.		277	
	f. Width of shoulder strap across center of insignia button (including piping):			
	- less than 1-1/2 inches but not less than 1-3/8 inches.			336
	- more than 2 inches but not more than 2-1/8 inches.			337

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	- less than 1-3/8 inches or more than 2-1/8 inches.		278	
	g. Rounded end of shoulder strap positioned less than 1/4 inch or more than 3/8 inch from collar edge.			338
	h. Piping irregular in width, affecting appearance.		279	
	i. Buttons not uniformly set from collar edge by more than 1/4 inch.		280	
	j. Center of buttons less than 3/4 inch or more than 7/8 inch from rounded end of strap (including piping).			339
Armholes (construc-tion)	a. Badly stretched.	18		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	19		
	c. Crooked seam.			340
	d. Tape stitching exposed and visible on outside surface.			341
	e. Sleeve head pads not completely tacked to armholes, or misplaced not serving intended purpose.		281	
	f. One or both sleeve head pads omitted.		282	
	g. Armhole not tacked completely or insecurely tacked.		283	
Sleeves	a. Setting and hang:			

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	1. Sleeve fullness misplaced, affecting appearance.		284	
	2. Sleeve too far front, i.e., front edge of sleeve more than 2-1/2 inches forward from center point of lower pocket flap.	128		
	3. Sleeve too far back, i.e., front edge of sleeve more than 2-1/2 inches back from center point of lower pocket flap.	129		
	4. Hang of sleeves in opposite directions, i.e., one sleeve too far forward and one sleeve too far back, tolerance of 1 inch but not exceeding 1-1/2 inches from center point of lower pocket flap for position of each sleeve.		285	
	5. Sleeves tight in armhole, i.e., roll effect not present at front or back of sleeve.	20		
	b. Sleeve lining:			
	1. Twisted, tight, or short causing bulge, twist or puckering on outside of sleeves.	21		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			342
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of sleeves.			343

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	c. Construction of sleeves:			
	1. Wigan twisted, tight, or pleated, causing ridges or puckering on outside of bottom of sleeves, affecting appearance.		286	
	2. Tacking on bottom turnup to wigan omitted or insecure.		287	
	3. Sleeve bottom edge uneven by more than 1/4 inch.			344
	4. Tacking on 1 or both sleeve lining seams to sleeve seams omitted or insecure.			345
	5. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/2 inches up from bottom edge of sleeve.			346
	d. Ornamental sleeve pieces:			
	1. Piping irregular, affecting appearance.		288	
	2. Ornamental piece stitched to sleeve too full or twisted, affecting appearance.		289	
	3. Length of ornamental piece (including piping): - less than 5-1/8 inches but not less than 5 inches or more than 5-3/8 inches but not more than 5-1/2 inches.			347
	- less than 5 inches or more than 5-1/2 inches.		290	
	4. Width at top, center, and bottom points (including piping):			

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	- less than 2-1/8 inches but not less than 2 inches or more than 2-3/8 inches but not more than 2-1/2 inches.			348
	- less than 2 inches or more than 2 1/2 inches.		291	
	5. Poorly shaped, affecting appearance.		292	
	6. Set on crookedly, affecting appearance.		293	
	7. Misplaced, i.e., one piece further forward or back from position of other piece, affecting appearance.		294	
	8. Bottom edge not horizontal with bottom edge of sleeve by more than 1/8 inch or edge extends beyond bottom edge of sleeve.		295	
	9. Ornamental piece stitched to sleeve with pointed ends toward forearm seam of sleeve.	130		
	e. Position of buttons on ornamental pieces (measurements made from center of button):			
	1. From top and bottom edges (including piped edge):			
	- less than 3/4 inch but not less than 1/2 inch.			349
	- more than 1 inch but not more than 1-1/4 inches.			350
	- less than 1/2 inch or more than 1-1/4 inches.		296	
	2. Top or bottom button from scalloped edge including piped edge:			
	- less than 5/8 inch but not less than 3/8 inch.			351

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	- less than 7/8 inch but not more than 1-1/8 inches.			352
	- less than 3/8 inch or more than 1-1/8 inches.		297	
	3. Center button from pointed edge (including piped edge):			
	- less than 1-1/8 inches but not less than 1 inch or more than 1-3/8 inches but not more than 1-1/2 inches.			353
	- less than 1-1/2 inches.		298	
	4. Center button not in line with pointed edge by:			
	- more than 1/4 inch.		299	
Body (outside)	a. Fitting of body and yoke linings: Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	22		
	b. Fitting of front interlining:			
	1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	23		
	2. Too full, causing coat front to have a wavy appearance.	24		
Waist seam	a. Seam not pressed open.		201a	
	b. Seam stretched, affecting appearance.		202a	
	c. Tape set on tight, causing puckering on waist seam, affecting appearance.		203a	

Source: https://assist.dla.mil -- Downloaded: 2026l0-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
Waist dart and side panel	a. Waist dart not pressed open.		204a	
	b. Side panel seam not pressed open.		205a	
Front and bottom edges	a. Front edges stretched, affecting appearance.		206a	
	b. Tape or piping set on tight, causing puckering on front, affecting appearance.		207a	
	c. Front or bottom piping irregular, affecting appearance.		208a	
	d. Bottom edge stretched, puckered, or uneven, affecting appearance.			354
	e. Bottom corner of right front poorly shaped, affecting appearance.		209a	
	f. Right front rolling outward below bottom button.	25		
	g. Front edge irregular, affecting appearance.		210a	
	h. Right forepart overlapping left forepart at bottom edge of coat: - less than 4 inches or more than 4-1/2 inches.			355
	i. Piping tight on front or bottom edge, causing puckering outside of coat, affecting appearance.		211a	
Front facings	Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.	26		

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
Back side panel seam	a. Not pressed open.		212a	
	b. Curved panel seam on back of coat, stretched or distorted, affecting appearance.		213a	
Vent opening	a. Right vent edge stretched, causing vents to spread open, affecting appearance.		214a	
	b. Row of stitching across top of vent opening omitted or insecure or not caught through vent lining.		215a	
	c. Right vent 1/4 inch or more shorter than left vent.		216a	
	d. Right vent 1/4 inch or more longer than left vent.			356
	e. Tape on right edge set on tight, causing puckering on vent edge, affecting appearance.		217a	
	f. Right vent edge crooked, affecting appearance.		218a	
	g. Right vent backpart overlapping left vent backpart at bottom edge: - less than 3-1/4 inches or more than 3-3/4 inches.			357
	h. Width of right vent measured at bottom piped edge: - less than 1-7/8 inches or more than 2-1/8 inches wide.			358
	i. Row of stitching across top of vent opening less than 1-5/8 inches or more than 2 inches long.			359

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	j. Piping exposed and visible on right vent edge.			360
	k. Row of stitching across top of vent opening misplaced, not serving intended		219a	
4.5.3.4 Detailed defects inside of coat (with coat spread on table). Detailed defects of inside of coat (with coat spread on table) shall be classified as follows:				
Front Buttonholes	a. Position from front edge (including piped edge): - less than 1/2 inch or more than 3/4 inch.	131		
	b. More than 1/4 inch from equal spacing.		220a	
	c. Bottom buttonhole above or below waist seam.		221a	
	d. Top buttonhole less than 3/4 inch or more than 1 inch from top edge of piping.		222a	
	e. Unevenly spaced from front edge by more than 3/16 inch.		223a	
Front buttons (Positioned and secure sewing)	a. Out of vertical alignment by 1/4 inch or more.		224a	
	b. Center of buttons more than 3/8 inch off-center midway between front edge of upper pockets when buttoned.		225a	
	c. Button stitching caught through interlining (canvas front) but not facing: - on 1 button.			361
	- on 2 or more buttons.		226a	

Source: https://assist.dla.mil -- Downloaded: 2026l0-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
	d. Button stitching not caught through interlining (canvas front) on 1 or more buttons.	132		
Belt loops	a. Loops less than 3/8 inch or more than 5/8 inch wide.			362
	b. Length of belt loop from top to bottom folded edge: - less than 2-3/8 inches or more than 2-5/8 inches.			363
	c. The back edge of loop placed less than 1/2 inch or more than 1 inch in front of side seam.		227a	
	d. Bottom folded end of loop more than 1/4 inch above top edge of lower flap.			364
	e. Bottom end of loop bartacked through double fold exposing bartack.			365
	f. Omitted: - 2 loops. - 1 loop.	133	 228a	
	g. Loops not aligned by: - more than 1/4 inch but not more than 1/2 inch. - more than 1/2 inch.		 229a	366
	h. Top folded end of loop bartacked to forepart less than 1/8 inch or more than 1/4 inch from folded end.			367
	i. Loops set on an angle, affecting appearance.			368
Labels	a. Any required label missing, incorrect, or illegible. Size label not securely caught in stitching.		230a	

Source: https://assist.dla.mil -- Downloaded: 20261010-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	b. Woven instruction or identification label not stitched on 4 sides or not positioned as specified to the outside of right facing.			369
Hanger	a. Hanger omitted or ends not securely stitched.		231a	
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along collar seam.			370
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.			371
Front facings	a. Fullness or pleats on facings between buttons, buttonholes or between front edge and buttons or buttonholes.			372
	b. Tacking on back edge to 1 or both interlinings: - omitted. - insecure or incomplete for a distance of more than 5 inches below shoulder seams, or more than 4 inches above bottom edge of lining.		232a	373
	c. Tacking at back edge of 1 or both facings from bottom edge across scarlet piping omitted or insecure.			374
Back yoke lining	a. Excessive fullness or pleats.			375
	b. Twisted, not affecting smoothness on outside surface of back.			376

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	c. Hem twisted, or width less than 1/4 inch or more than 1/2 inch wide.			377
	d. Bottom raw edge of yoke not turned under in stitching forming hem.			378
	e. Pleat in center of yoke lining omitted.		233a	
	f. Folded edge of center pleat facing the right side of coat.			379
	g. Felling at lower edge of yoke lining to side seam outlet omitted or insecurely felled on one or both sides.			380
Front body linings	a. Excessive puckering or pleated.			381
	b. Twisted, not affecting smoothness on outside of coat.			382
	c. One or both chest pleats on shoulder omitted.		234a	
	d. Folded edge of 1 or both chest pleats facing front edge of coat.			383
	e. Back stitch at lower armhole edge from approximately 1-1/2 inches to front or forearm sleeve lining seam to side seam of body lining omitted.			384
	f. Hem twisted, or width less than 1/4 inch or more than 1/2 inch wide.			385

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:46Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	Minor A	Minor B
	g. Bottom raw edge of body lining not turned under in stitching forming hem.			386
Waist seam	Tape on 1 or both waist seams omitted.		235a	
Collar lining and eyelet covers	a. Collar lining tab right end of collar omitted or extending beyond collar end for a distance of less than 3/4 inch.		236a	
	b. Stitching on end, side edges, or across width of collar tab omitted.		237a	
	c. Ends of collar lining not securely tacked.		238a	
	d. 1 or both eyelet covers omitted.		239a	
	e. 1 or both eyelet covers not covering eyelet.		240a	
	f. Width of collar eyelet covers less than 1-5/8 inches or more than 1-7/8 inches.			387
	g. Felling on front edge and along lower corner of 1 or both eyelet covers omitted.		241a	
	h. Felling along lower corner of 1 or both eyelet covers extending for a distance of more than 3/4 inch.			388
	i. Hand felling of lining across the full width at the left or right end of collar omitted.		242a	

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	Minor A	Minor B
Left vent lining	a. Top edge not completely covering edges of center back seam outlets		243a	
	b. Folded edge of lining not extending beyond center seam allowance of right backpart.			389
	c. Tight, short, or twisted, causing fullness or twist outside of coat.		244a	
Binding on seam outlets	a. Not securely caught on fabric, causing binding to pull away from fabric easily.		245a	
	b. Binding tight, causing edge of seams to curl and not lie flat.			390

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

4.5.3.5 Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect. The inspection level shall be S-3 (see 6.5).

4.5.4 Examination of packaging. An examination shall be made to determine compliance with packaging, packing and marking requirements of section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully packaged, selected just prior to closing operation. Defects of closure listed below will be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the inspection lot. The inspection level shall be S-2 (see 6.5).

Examine	Defect
Marking (exterior and interior)	Omitted; incorrect; illegible, of improper size, location, sequence or method of application.
Materials	Any component missing. Any component damaged, affecting serviceability.
Workmanship	Inadequate application of components, such as incomplete closure of case liners, container flaps, loose strapping, inadequate stapling. Bulging or distortion of containers.
Content	Number of coats per shipping container is more or less than required.

5. PACKAGING

5.1 Packaging. Packaging shall be level A.

5.1.1 Level A. Each coat shall be laid on a flat surface, with the front of coat facing up. A bending or non-bending paper-board shoulder form conforming to figure 8 shall be inserted into the coat so as to fit snuggly into the collar and shoulders. The buttonhole front shall overlap the button front. The sleeves shall be positioned full length so that sleeve ends rest over the lower pockets. The coat shall then be folded in half by bringing the collar portion down even with the bottom edge so that the folded coat measures no more that 23 by 15 inches.

5.2 Packing. Packing shall be level A, B or commercial as specified (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

5.2.1 Level A. Fifteen (15) coats, of one size only, shall be packed with the collar of every other coat in a reverse position, in a fiberboard shipping container conforming to class-weather resistant, type SF, grade V2s, size 3A of MIL-B-17757. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis-weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled, closed, and reinforced as specified in the appendix to the box specification.

5.2.2 Level B.

5.2.2.1 Method 1. Fifteen (15) coats, of one size only, shall be packed with collar of every other coat in a reversed position, in a fiberboard shipping container conforming to class-domestic, type CF, variety SW, size 3A of MIL-B-17757. The fiberboard used in fabricating the box shall be grade 275 and for lining grade 200. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis-weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled and closed as specified in the appendix to the box specification.

5.2.2.2 Method 2. When specified (see 6.2), three level B shipping containers (45 coats of one size only) shall be overpacked in a fiber-board shipping container conforming to class-weather resistant class, type SF, size 4, of MIL-B-17757, reinforced as specified in the appendix to the box specification.

5.2.3 Commercial. Coats shall be packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight and National Motor Freight Classification Rules and U.S. Postal Service Manual or regulations of other carriers applicable to the mode of transportation.

5.3 Marking. In addition to any special marking required by the contract, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coat covered by this specification is intended to be worn by female personnel of the U.S. Marine Corps Ceremonial Unit.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

6.2 Acquisition requirements. Acquisition documents should specify the following:

a. Title, number, and date of this specification.
b. Size required (see 1.2).
c. When first article is not required (see 3.2).
d. Selection of applicable levels of preservation, packaging and packing (see 5.1).
e. When level A, method 2, preservation and packaging is required (see 5.1.1.2).
f. Acceptance criteria (see 6.5)

6.3 Standard samples and shade samples. For information regarding the availability of standard samples and standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

6.4 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a preproduction sample. The Contracting Officer should also include specific instructions in acquisition documents regarding arrangements for selection, inspection, and approval of the first article.

6.5 Acceptance criteria. The acceptance criteria below are recommended for use. The acceptance criteria as specified in the contract or purchase order shall be binding. Unless otherwise specified, the following acceptance criteria are in accordance with MIL-STD-105.

6.5.1 For end item visual examination. An acceptance quality level (AQL), expressed in terms of defects per hundred units, of 1.5 for major defects, 10.0 for major and minor A combined and 40.0 for major, minor A and B combined is recommended.

6.5.2 For end item dimensional examination. An AQL, expressed in terms of defects per hundred units, of 10.0 is recommended.

6.5.3 For packaging examination. An AQL, expressed in terms of defects per hundred units, of 4.0 is recommended.

6.6 Figures. Figures are furnished for information purposes only. To the extent of any inconsistencies between the written specification and the figure, the written specification shall control.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

6.7 Subject (Key word) listing.

Dress
Enlisted
Stand-up collar

6.9 Marginal notations. Asterisks are not used in this revision to identify changes with respect to the previous issue, due to extensive changes.

Preparing activity:
Navy - MC
Project No. 8410-N751

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the currentversion before use.

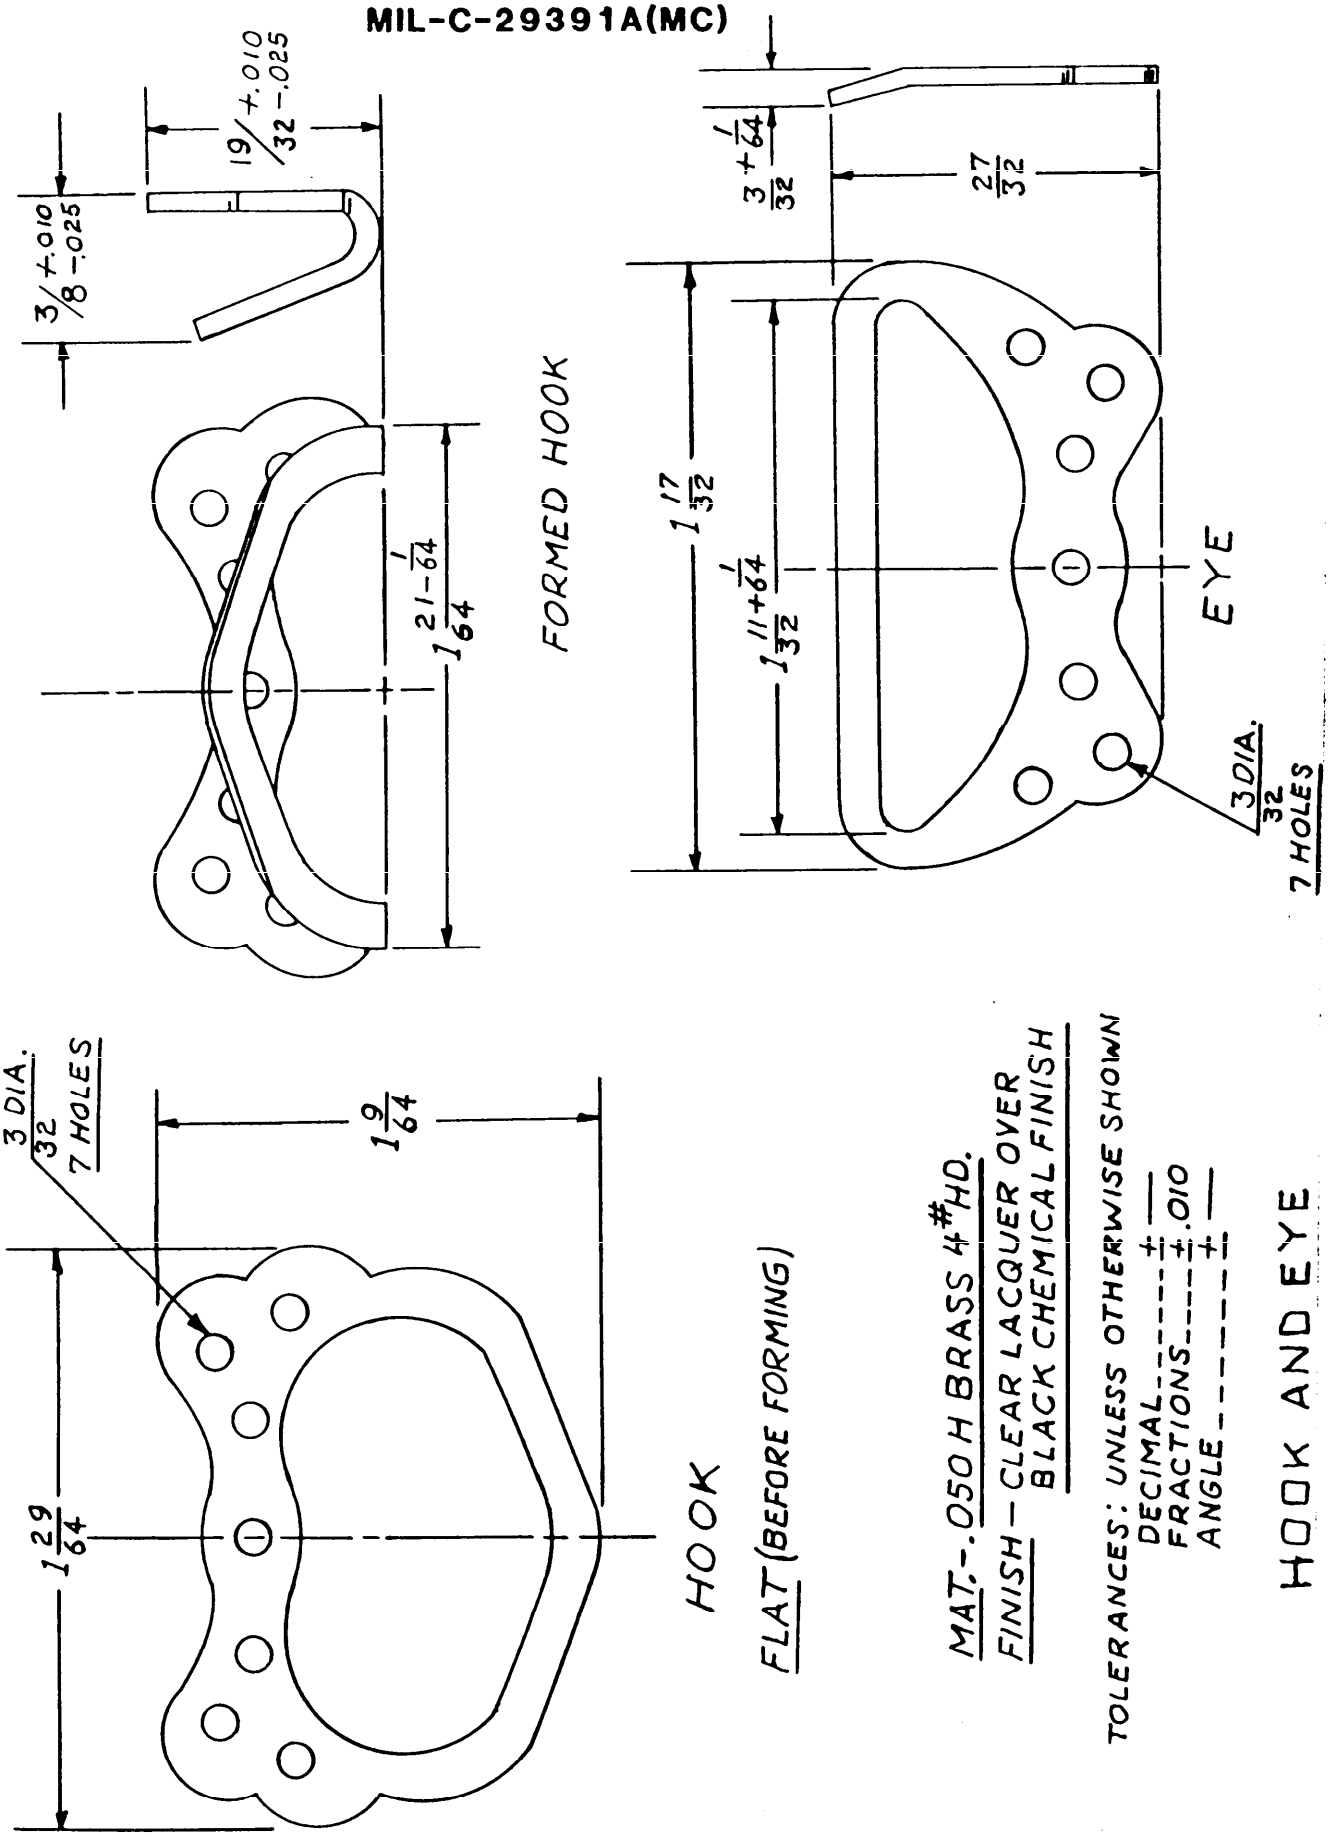


FIG 1: COAT, WOMAN'S WOOL GABARDINE DRESS BLUE CEREMONIAL

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:46Z
Check the source to verify that this is the current version before use.

TO KEEP YOUR COAT LOOKING SMART INSIST ON IT BEING PROPERLY PRESSED.

PRESSING INSTRUCTIONS

1. AVOID PRESSING DRY OR WITH TOO HOT AN IRON.

2. REMOVE ALL GLOSS FROM EDGES AND SEAMS BY PRESSING WITH DAMP CLOTH.

3. CREASE ONLY LOWER THREE-FOURTHS OF SLEEVES.

WOVEN INSTRUCTION LABEL

FIG 2: COAT'WOMAN'S WOOL GABARDINE DRESSBLUE CEREMONIAL

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

Colorfastness The dyed thread shall show fastness to light

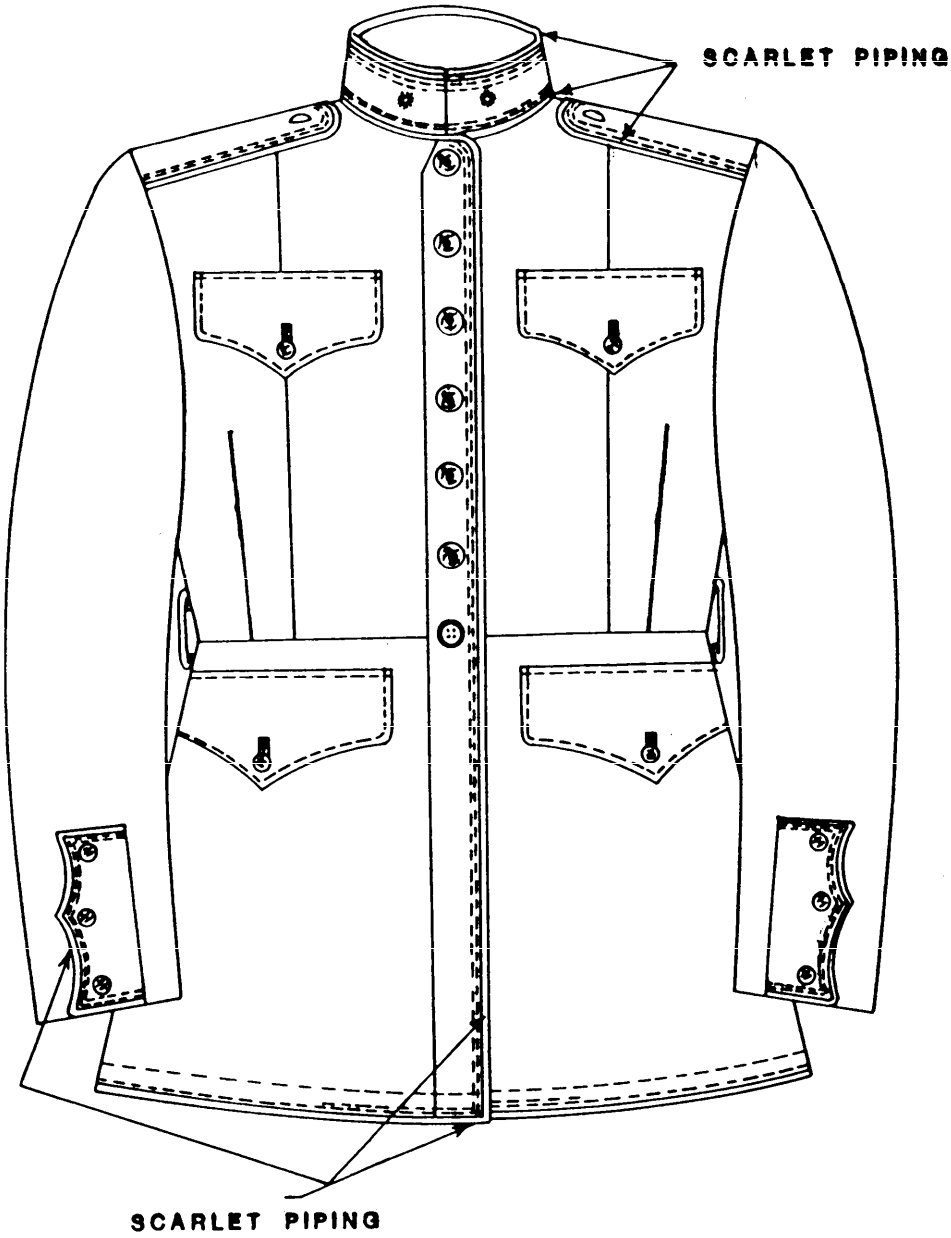


FIG 3: COAT, WOMAN'S WOOL GABARDINE DRESS BLUE CEREMONIAL

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.

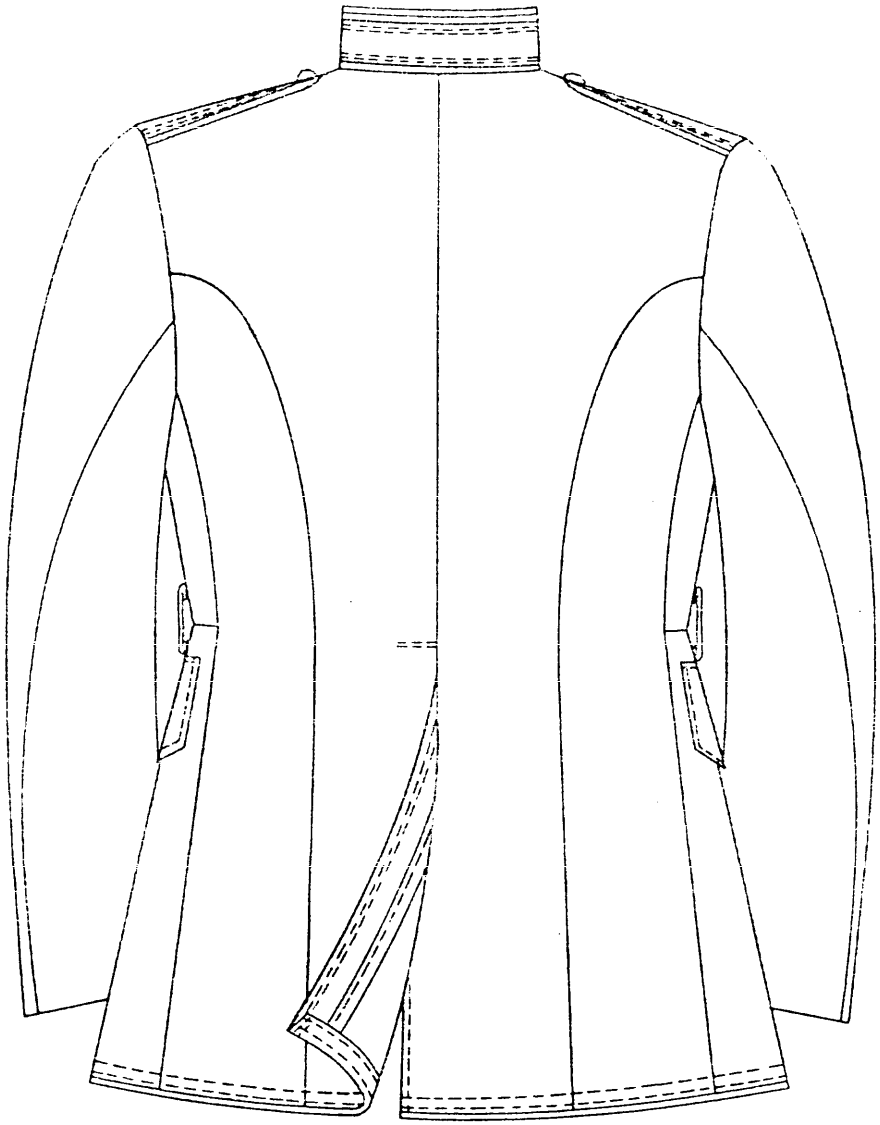


FIG 4: COAT, WOMAN'S WOOL GABARDINE DRESS BLUE CEREMONIAL

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.


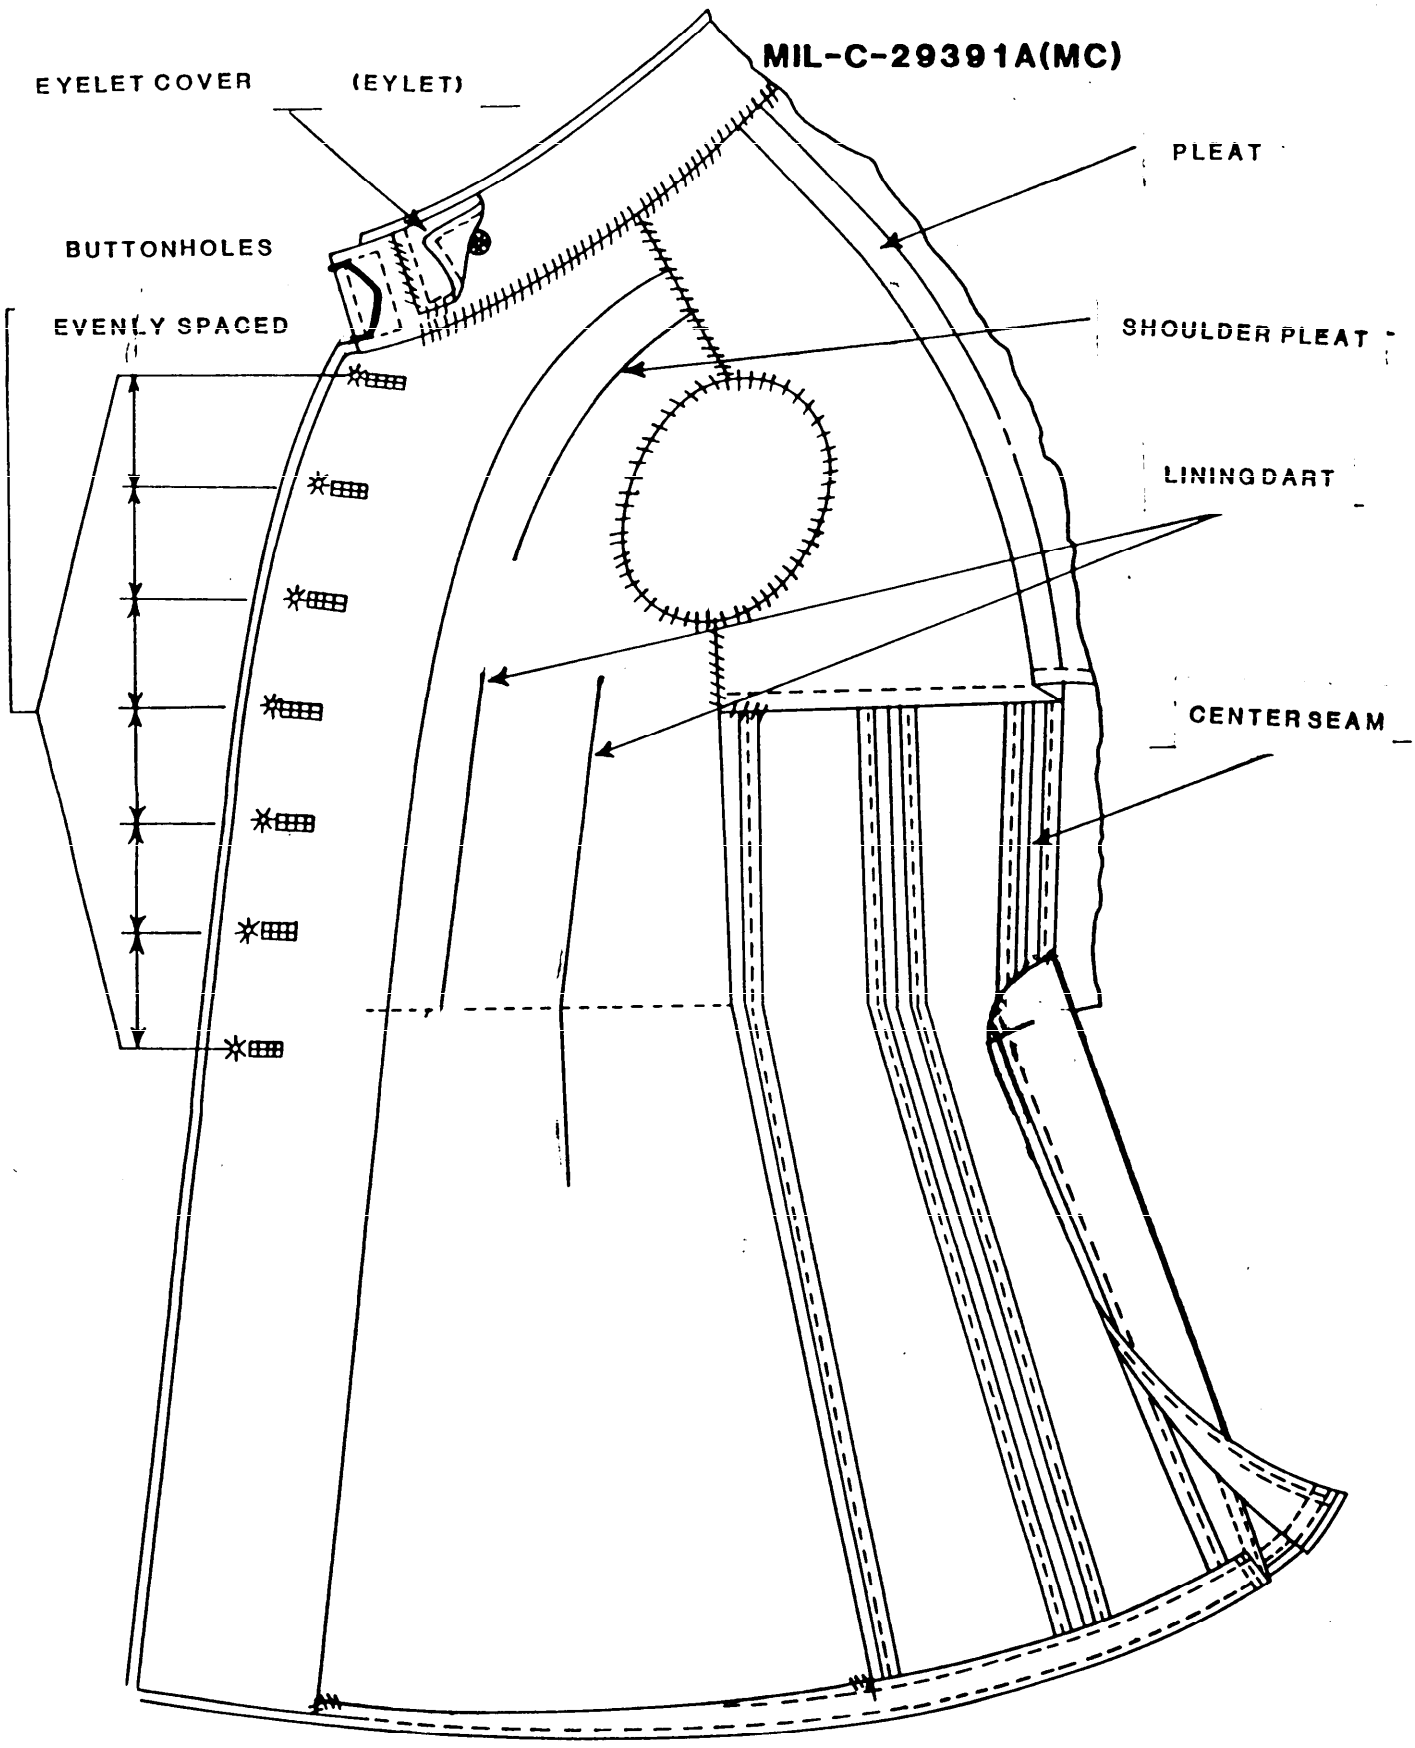


FIG: 5: COAT WOMANS WOOL GABARDINE DRESS BLUE CEREMONIAL

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:46Z
Check the source to verify that this is the current version before use.

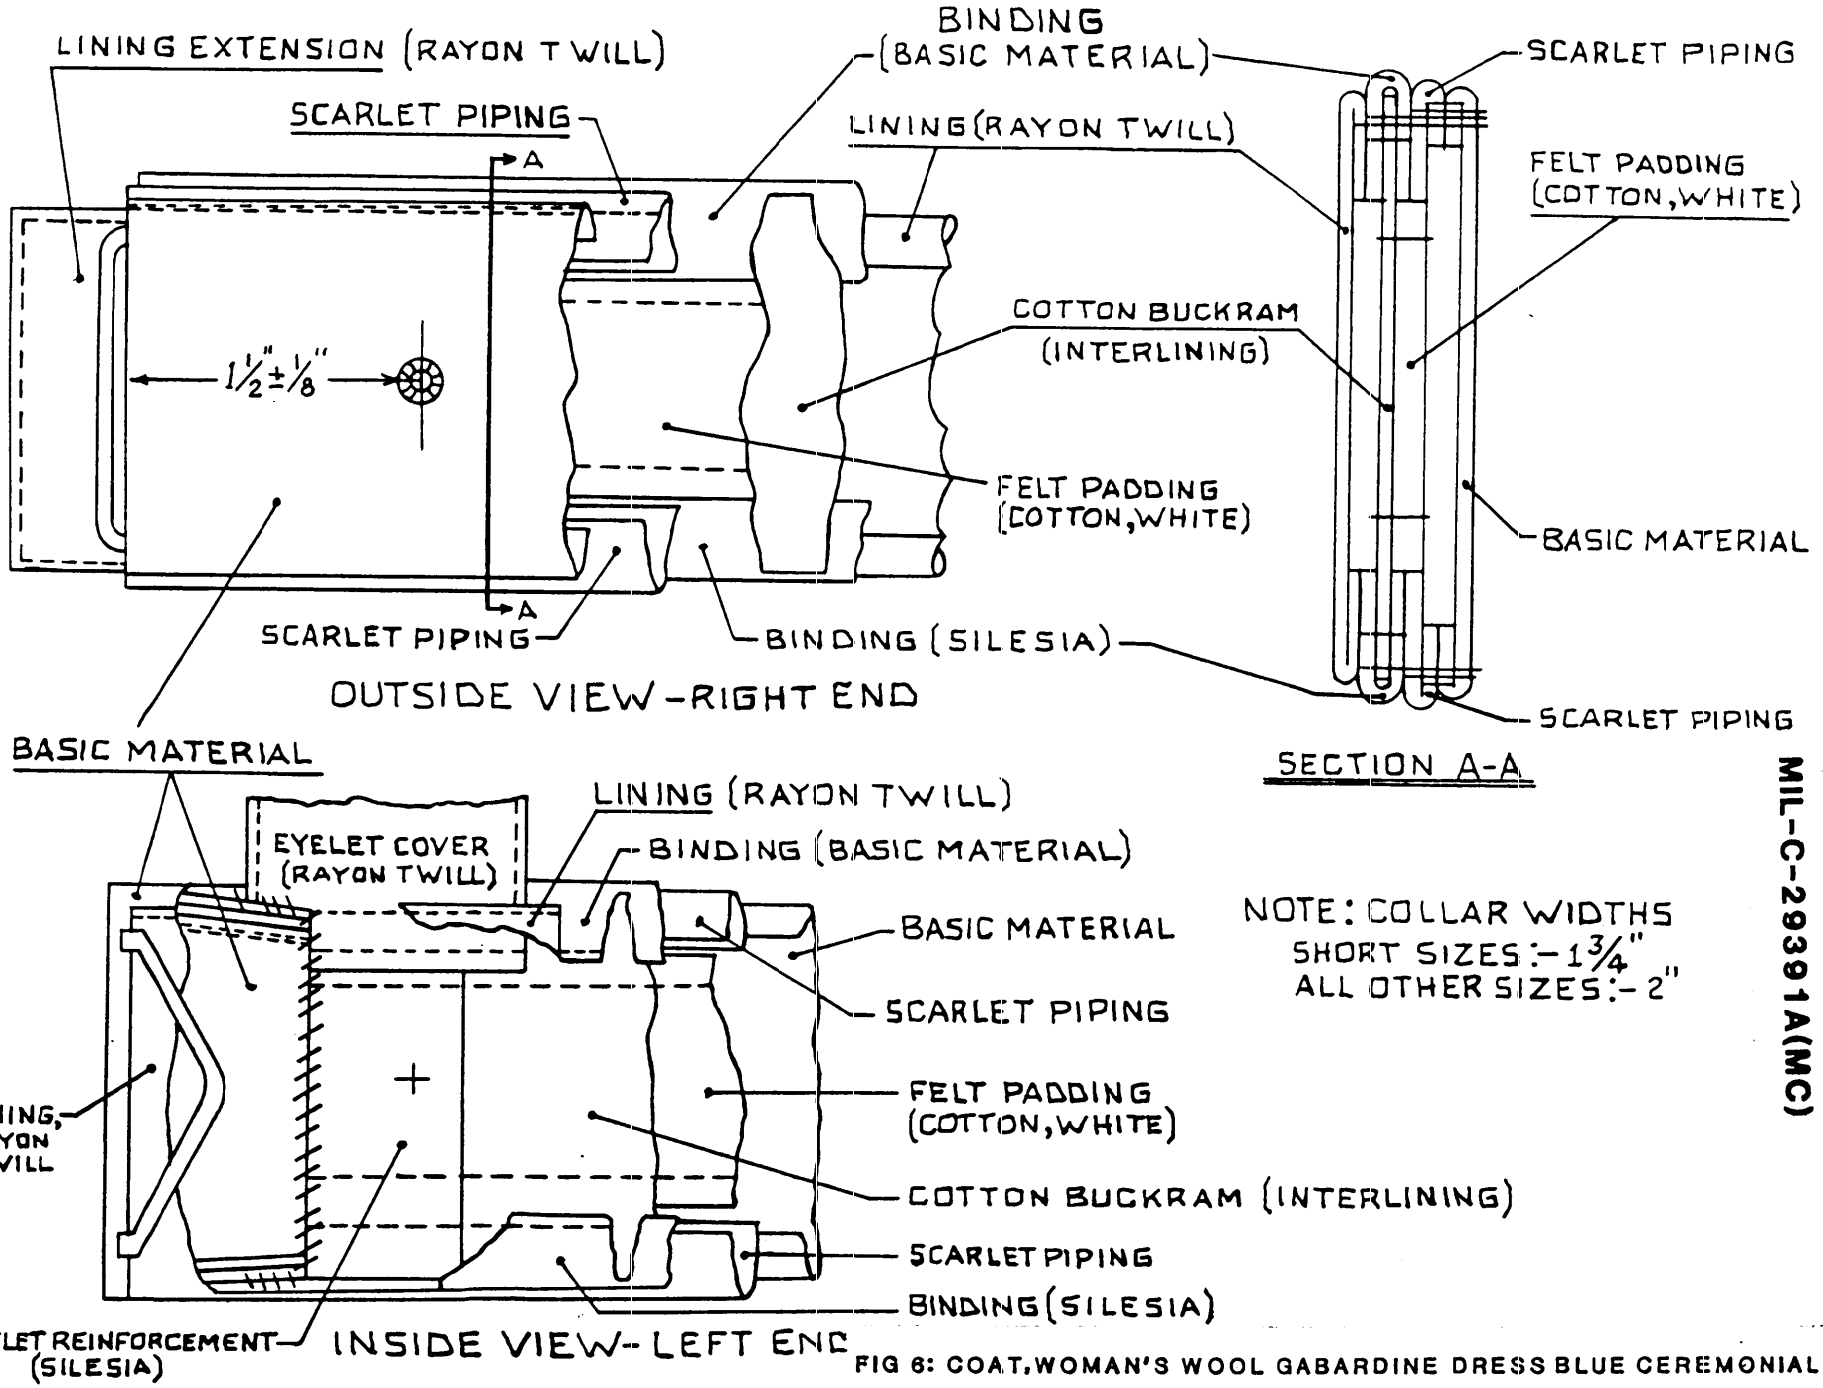

NOTE: COLLAR WIDTHS
SHORT SIZES :- 1 3/4"
ALL OTHER SIZES :- 2"

FIG 6: COAT, WOMAN'S WOOL GABARDINE DRESS BLUE CEREMONIAL

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	1. DOCUMENT NUMBER	2. DOCUMENT DATE (YYMMDD)
	MIL-C-29391A(MC)	6 DECEMBER 1990

3. DOCUMENT TITLE

COAT, WOMEN'S: WOOL GABARDINE; DRESS BLUE CEREMONIAL

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a. NAME	b. TELEPHONE (Include Area Code)	
Commanding General, Marine Corps Research, Development, and Acquisition Command (PSE-C)	(1) Commercial (202) 696-1186/87/88	(2) AUTOVON 226-1186/87/88
c. ADDRESS (Include Zip Code) Washington, DC 20380-0001	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT: Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

DD Form 1426, OCT 89 *Previous editions are obsolete.* 198/290

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:46Z
Check the source to verify that this is the current version before use.