MILITARY SPECIFICATION

COAT, WOMEN'S: FULL DRESS SCARLET, U. S. MARINE BAND, MUSICIAN

This specification is approved for use by U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for women musicians' scarlet wool full dress coats.

1.2 Classification. The coats shall be of one type in the following sizes, as specified (see 6.2).

Schedule of Sizes

Short	Regular	Long
6	6	
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18
20	20	20
	22	22

1.3 Individual orders. When the coat is custom tailored to an individual order, this specification shall govern, except that the detail requirements of Section 3, Table I, may be modified to the extent necessary for good custom tailoring practices.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of the specification to the extent specified herein.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commandant of the Marine Corps (LMA-1), Headquarters, U. S. Marine Corps, Washington, D. C. 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8410

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the currentversion before use.

SPECIFICATIONS

FEDERAL

V-T-276	- Thread, Cotton
V-T-280	- Thread, Gimp, Cotton, Buttonhole
V-T-301	- Thread, Silk
DDD-L-20	- Label; For Clothing, Equipage, and Tentage (General Use)
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached, or Dyed)

MILITARY

MIL-C-326	- Cloth, Silesia, Cotton
MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill Rayon
MIL-B-3461	- Buttons, Insignia, Metal, Uniform and Cap
MIL-P-15064	- Pad, Shoulder and Sleeve-Head
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/wool
MIL-C-41820	- Cloth, Gabardine, Polyester and Rayon
MIL-C-43718	- Cloth, Twill, Polyester, Polyester and Cotton, Polyester and Rayon
MIL-C-82114	- Coat Front for Coats, Musicians
MIL-C-82252	- Cloth, Broadcloth, Wool, and Wool Synthetic (moth-proofed)

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams and Stitchings

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	- Marking for Shipment and Storage

(Copies of specifications and standards required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

LAWS AND REGULATIONS

U. S. Postal Service Manual

(Copies of the manual may be obtained from the Superintendent of Documents, U. S. Government Printing Office, Washington, D. C. 20402.)

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association, Inc., Tariff Order Section, 1616 P. Street, N.W., Washington, D. C. 20026.)

3. REQUIREMENTS

3.1 Standard sample. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variations from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), before production is commenced, the first article, consisting of the number of coats specified by the procuring activity (see 6.2), shall be submitted, or made available to the contracting officer or his authorized representative for inspection. The approval of the first article authorizes the commencement of production, but does not relieve the contractor of responsibility for compliance with all provisions of this specification. The first article shall be manufactured by the contractor in the same facilities to be used for the manufacture of the production items.

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, wool, tropical, scarlet shade 2502 (see 6.3), 10.5 ounce conforming to type I, class 1 of MIL-C-21115.

3.3.2 Collar and sleeve cuff material. The material for the collar and cuffs shall be cloth, polyester/wool blend, black shade 2607 (see 6.3), conforming to type III, class 1 of MIL-C- 21115.

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

3.3.3 Lining. The material for lining the coats and collar and for making the collar eyelet covers,front facing, eyelet cover, coat hanger and straps to secure the lining to the bottom edge of coat shall be cloth, rayon twill, scarlet shade 2506 (see 6.3), conforming to class 1 of MIL-C-368.

3.3.3.1 Bias binding. The binding for underarm shield shall be bias cut out of the lining material specified in 3.3.3. The binding shall be cut 5/8 to 7/8 inches wide and shall have sized edges.

3.3.4 Collar tab. The material for the collar tab shall be cloth, wool broadcloth, blue shade 2307 (see 6.3), conforming to type I, class 2, of MIL-C-82252.

3.3.5 Piping. The material for piping shall be cloth, gabardine, polyester and rayon, white shade 3042 (see 6.3), conforming to type I of MIL-C-41820, cut 5/8 to 3/4 inch wide for piping the lower collar edge and ornamental sleeve cuff and 1 inch wide for piping the front and bottom edges of coat and seams joining the center back to the skirt of the coat.

3.3.5.1 Vinyl piping. The white vinyl cord for piping the upper edge of the collar shall be tubular, with 7/16-inch-wide welt and serrated edges as manufactured by the Thielex Plastics company, or an equal.

3.3.6 Silesia or polyester and cotton. The stays for armhole and shoulder seams, the binding for the neck edge of the coat front, interlining front, interlining stay and the collar interlining shall be cut from cloth, cotton, silesia, 4.5 ounce conforming to type I of MIL-C-326 or polyester and cotton conforming to MIL-C-43718. The silesia or polyester and cotton shall be black shade 2607. The requirements for nonfibrous material and seam efficiency shall not apply.

3.3.7 Front interlining. The interlining for the upper and lower fronts shall be fusible cloth in accordance with good commercial practice.

3.3.8 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram, double texture, laminated, starch finish, natural color, conforming to the following when tested as specified in Section 4, Table III.

3.3.8.1 Cotton buckram. The buckram shall be made of cotton of suitable staple length and grade to meet the requirements of this specification, thoroughly cleaned, well carded, drawn and evenly spun.

3.3.8.2 Weave. The weave of the single plies of the cloth shall be four harness; 2 up and 2 down herringbone twill, 20 ends right and 20 ends left.

3.3.8.3 Texture. The two plies of the cloth shall each have a minimum thread count per inch of 50 in the warp and 20 in the filling.

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the currentversion before use.

3.3.8.4 Laminated cloth. The two plies of the cloth shall be thoroughly adhered together with a synthetic resin type laminating material which shall not cause any objectionable odor in the finished cloth. The laminated cloth shall show no evidence of delamination after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests as specified in Section 4, Table III.

3.3.8.4.1 Finish. The laminated cloth shall have a starch finish. The original stiffness of the finished cloth, and the stiffness of the cloth after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests shall conform to the following when tested as specified in Section 4, Table III.

Stiffness, inch-pound:	Minimum	Maximum
-original	0.60	0.95
-after accelerated aging	0.70	0.95
-after wet (dry) cleaning	0.50	0.85
-after perspiration	0.50	0.85

3.3.8.4.2 Weight. The weight of the finished laminated cloth shall be 21 to 23 ounces per square yard (see Section 4, Table III).

3.3.8.4.3 Breaking strength. The breaking strength of the finished laminated cloth shall be 100 pounds minimum in the warp direction and 80 pounds minimum in the filling direction, when tested as specified in Section 4, Table III. After being subjected to the accelerated aging test, the breaking strength of the cloth shall be not less than the original breaking strength when tested as specified in Section 4, Table III.

3.3.9 Reinforcement discs. The reinforcement discs for buttons secured to the back skirt seam, with ring toggle, shall be punched from the cloth, cotton, buckram specified in 3.3.8. The reinforcement discs shall be 7/8 inch in diameter with a 1/8-inch-diameter hole at the center.

3.3.10 Coat fronts. The coat fronts shall conform to class 3 of MIL-C-82114.

3.3.11 Shoulder pads. The shoulder pads shall conform to the requirements of type III, class 2, of MIL-P-15064.

3.3.12 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.13 Stay tape. The stay tape for the armholes and waist seam shall be cotton, 1/4 inch wide, conforming to type III, class 1, of DDD-T-86, except the requirement for nonfibrous material shall not apply.

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

3.3.14 Thread.

3.3.14.1 Silk thread. The silk thread shall conform to V-T-301 as follows, except the requirements for extractable matter shall not apply:

Use	Type	Class	Ticket No.	Ply
Bartacks and all outside seaming and stitching.	I		A	
Machine felling.			O	
Making buttonholes in coat	I		B and F	3
Hand felling; and hand sewing	III	3	C	2

3.3.14.2 Cotton, thread. The cotton thread shall conform to V-T-276 as follows:

Use	Type	Ticket No.	Ply
All inside seaming and stitching.	IC2	A	3
Serging and overedge stitching.	IA3	70	2
Machine tacking armholes and sewing on buttons.	IB3	24	4

The thread for basting shall be good commercial grade cotton.

3.3.14.3 Color and colorfastness. All thread shall be scarlet shade W, cable No. 66040, except: the silk thread for stitching collar, cuffs and braid, which shall be black; the cotton thread for basting and machine tacking armhole, which may be white; and the cotton thread for overedge stitching the piping at the bottom edge of coat shall be white. The colored threads shall show the following colorfastness when tested as specified in the applicable thread specification:

Thread	Color	Wet (dry) Cleaning	Light
Cotton	Scarlet	Good	--
Silk	Scarlet	Fair	Fair
Silk	Black	Good	Good

3.3.15 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of V-T-280. The color of the gimp shall be scarlet shade W, cable No. 66040 and shall show good fastness to wet (dry) cleaning.

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

3.3.16 Ornamental braid. The ornamental braid for the front of the coats shall be mohair, black, tubular, 3/8 ± 1/16 inch wide conforming to the following:

Weave	Plain
Weight per gross yards, ounce (minimum)	35
Picks per inch (minimum)	9
Total carriers (minimum)	16
Ends per carriers (minimum)	6
Breaking strength, pounds (minimum)	105
Shrinkage:	
-length, percent (maximum)	2.0
-width, inches	Not less than the original width
Colorfastness to:	
-wet (dry) cleaning	Good
-light	Good

3.3.17 Buttons.

3.3.17.1 Insignia buttons. The insignia buttons shall be metal, gold plated, 27-line and 40-line conforming to type I, style 3, class A, subclass 2, of MIL-B-3461.

3.3.17.2 Ring toggles. Ring toggles for securing buttons to fronts, back and sleeves shall conform to MIL-B-3461.

3.3.18 Hooks and eyes. The hooks and eyes for closing the collar shall be brass, black enameled finish, size No. 16, commercial type. All surfaces and edges of the hooks and eyes shall be clean, smooth, free from burrs, tool marks, sharp edges, and roughness. The hook and eye shall be thoroughly and completely lacquered with the best available quality of black japanned lacquer. The dry lacquer film shall be continuous, level, adherent, free from lint, dust, or other foreign inclusions that may affect appearance or serviceability, and shall withstand the test for tackiness specified in 4.6.1.2.

3.3.19 Labels. Each coat shall have a combination personal clothing identification label and a size label as follows: The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

3.3.19.1 Combination personal-clothing identification label. The combination personal-clothing identification label shall conform to type I, classes 1 and 10 (combined), of DDD-L-20 except all printing and the space between the lines of printing shall be minimum 10 point (approximately 1/8 inch). The content and format shall be as follows:

Name _____
Service No. _____
Collar Size _____
Nomenclature (item description)
_____
Contract No. _____ Date _____
Name of Contractor _____
Wool Products Act Information
_____

3.3.19.2 Size label. The size label shall conform to type I, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letter S, R, or L, for Short, Regular and Long, as shown by the following example:

$$\frac{14R}{\text{Stock Number}}$$

The stock number may be omitted from the size label, but when omitted, it shall be incorporated in the identification label.

3.4 Design. The coat shall be the U. S. Marine Corps design shown on Figures 1 through 4, a semiformfitting, single-breasted fully-lined coat with 12 gold plated insignia buttons on the left front and 6 on the right front, having upper fronts with black braid, skirt type lower body parts with waist darts, a waist seam, a three-piece back with 2 gold plated insignia buttons at the waist, ornamental sleeve cuffs with gold plated insignia buttons, a standup collar with hooks and eyes for front closure and worked eyelts, and cloth loops on each shoulder for attaching epaulets. The side and bottom edges of the collar, the front and bottom edges of coat, the seam joining the skirt to the center back, and the top edge of the ornamental sleeve cuff shall be piped with white cloth. The top edge of the collar shall be piped with white vinyl cord.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard pattern. The standard pattern shall provide 3/4-inch allowance for side seams and for seam joining the skirt to the center back and 3/8-inch allowance for all other seams except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the currenversion before use.

3.5.1 List of pattern parts. The coats shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

Item	Pattern nomenclature Material basic: cloth, wool tropical	No. of cut parts
1.	Center, front, upper	2
2.	Skirt (lower)	2
3.	Side (front)	2
4.	Side back	2
5.	Center back	1
6.	Top sleeve	2
7.	Under sleeve	2
8.	Front facing, right	1
9.	Front facing, left	1
10.	Underarm shield	2
	Material: Cloth, wool-polyester	
11.	Collar, outerply	1
12.	Sleeve cuff	2
13.	Sleeve cuff eyelet facing (top ply)	2
14.	Sleeve cuff eyelet facing (under ply)	2
	Material: Cloth, wool broadcloth	
15.	Collar, tab	1
	Material: Cloth, rayon lining	
16.	Front, upper	2
17.	Skirt, (lower)	2
18.	Side back	2
19.	Center back	2
20.	Top sleeve	2
21.	Under sleeve	2
22.	Collar lining	1
23.	Collar eyelet cover	2
24.	Front eyelet cover	1
	Material: Cloth, cotton, buckram	
25.	Collar interlining	1
	Material: Silesia or polyester and cotton	
26.	Collar interlining	1
	Material: Interlining (fusible)	
27.	Center front	2
	Marker	
28.	Side front	2
29.	Skirt, lower	2
30.	Cuff and eyelet marker	

3.6 Construction.

3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

3.6.1.1 Stitches, seams, and stitchings. The stitch, seam, and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching and serging shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.2 Thread breaks and ends of seams. The end of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitchings shall be back-tacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of each coat cut from one piece of the wool and lining material, including pairs of sleeve linings and underarm shields when not cut from ends, shall be shade marked to insure uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.
(b) Sew-on shade tickets.
(c) Adhesive-type tickets which show discoloration and the use of an adhesive mass which adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LPR
1.	Cutting. a. Cut coats in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction of the warp as indicated by the directional lines on the pattern. c. Cut all scarlet wool parts of the coat from one piece of the basic material. d. Cut the strapping for the shoulder loops from basic material in the direction of the warp 2-3/4 inches long and of sufficient width so that the finished loops will be 5/8 ± 1/8 inch wide. e. Cut the body and collar linings, collar eyelet covers and left front facing eyelet cover from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the sleeve lining shall match. Cut the strips for the coat hanger and for the lining securing straps 1-1/8 inches wide. Cut front eyelet cover in accordance with the pattern. f. Cut the wool material for the sleeve cuffs, outer ply of collar and cuff eyelet facings from one piece of the material specified in 3.3.2. g. Cut the collar tab from the material specified in 3.3.4.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
1.	Cutting. (cont'd)					
	h. Cut silesia or polyester and cotton stays for armhole and shoulder seams on the bias 3/4 inch wide and 4 ± 1/4 inches long. Cut silesia or polyester and cotton for collar interlining in accordance with the patterns furnished. Cut the silesia or polyester and cotton for binding the neck edge of the coat front interlining on the bias, 3/4 inch wide and approximately 5 inches long.					
	i. Cut the cotton buckram for interlining the collar on the straight in accordance with the pattern furnished.					
	j. Cut the piping material (see 3.3.5) for piping the front and bottom edges of coats, lower edge and end of collar, top edge of ornamental sleeve cuffs and the seam joining the skirt to the center back on the straight. The piping shall be cut 5/8 to 3/4 inch wide for collar, and ornamental sleeve cuffs, and 1 inch wide for bottom and front edges of coat and the seam joining the skirt to the center back.					
	k. Punch the reinforcement discs for buttons secured to the skirt back seam from cloth, cotton, buckram. The reinforcement discs shall have a 1/8-inch diameter hole at the center.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
2.	Replacement of damaged parts.					
	a. Replace at time of cutting any part of coat containing holes, seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, develop into holes, shade bars and dye streaks or unsightly slubs, etc., affecting appearance.					
	b. Replace any part damaged during the manufacturing process by needle chews which may develop into holes, scissor or knife cuts, tears, holes, mends or burns in the material, affecting appearance.					
3.	Shade marking.					
	a. Mark or ticket all component parts (see 3.6. 2) cut from one piece of the basic material. Mark or ticket all component parts cut from one piece of rayon lining material and the pairs of sleeve linings when cut from ends.					
	b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					
4.	Make shoulder loops.					
	Finished appearance. The finished loops shall be uniform in width and shall finish 5/8 ± 1/8 inches wide.					
	a. Fold the strap for the loops in half lengthwise and seam together 1/4 inch from raw edges.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
4.	Make shoulder loops. (cont'd)					
	b. Press the seam open, smooth and flat with a heated pressing iron.					
	c. Turn strap rightside out, with seam line placed in center on the underside and press smooth and flat with a heated pressing iron.					
5.	Make coat hanger and lining securing straps.					
	Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8-inch-wide strip of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	10-14	A	A
	b. Cut the coat hanger 3-3/4 ± 1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ± 1/4 inches long.					
6.	Make collar eyelet covers.					
	Finished appearance. The collar eyelet covers shall finish 1-3/4 ± 1/8 inches wide.					
	a. Turn under the side edges of the collar eyelet covers and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1 (each side edge)	10-14	A	A
	b. Fold each cover in half across the width and seam 1/16 inch from the folded side edges.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
7.	Make front eyelet cover.					
	a. Fold front eyelet cover in half lengthwise and stitch across the bottom edge with a 1/4-inch seam.	301	SSa-1	10-14	A	A
	b. Turn the cover right side out. Press and crease the folded edge smooth and flat with a heated pressing iron.					
8.	Make underarm shields.					
	Finished appearance. The underarm shields shall finish smooth and flat, without puckers, pleats, gathers or other distortions.					
	a. Bind the rounded edge of shield with bias binding, turning under the outside edge of the binding only and catching 1/16 inch from the folded edge.	301	BSb-1	10-14	A	A
	b. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
9.	Make cuffs and eyelet opening.					
	Finished appearance. The cuffs shall be uniform in appearance, shall finish smooth and flat, without twists, gathers, pleats, puckers or other distortions. The cuffs shall finish 5 inches high at the point on top sleeve and 3 inches high at the backarm, including piping. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the sleeve cuff.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
9.	Make cuffs and eyelet opening. (cont'd)					
	a. The cuffs shall be made of one ply of material specified in 3.3.2., piped with material specified in 3.3.5.					
	b. Position one ply of the cuff eyelet facing on the outside of sleeve cuff, face to face with back edges even and notches matching. Join the two plies together from notch to notch with 3/8 inch seam.	301	LSq-2 (a)	10-14	A	A
	c. Extend the depth of the notches to the seam line. Turn back the facing and top stitch the facing to the cuff 1/16 to 1/8 inch from the raised edge.	301	LSq-3 (b)	10-14	A	A
	d. Mark location for 3 eyelets on each cuff for removeable buttons.					
	e. Make 1/8-inch eyelet on each of the marks through both plies.	Eyelet		22 per eyelet	A	A
	f. Position the cuff on the facing with back edges even and notches matching, with the right side faced up. Stitch the ends of the opening through the facing 1/4 inch from back raw edges.	301	SSa-1 (each end)	10-14	A	A
	g. Position the strip of piping material on the outside of sleeve cuff and stitch together 1/8 inch from the upper curved and pointed edge of cuff.	301	BSm-1 (a)	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
9.	Make cuffs and eyelet opening. (cont'd)					
	h. Turn back the cuff and piping, working the folded edge of the piping 1/8 inch beyond edge of cuff. Top stitch the cuff to the piping 3/16 inch from folded edge of piping.					
	i. Press the cuffs smooth and flat with a heated pressing iron or pressing machine.					
10.	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of under sleeve and with the notches in the lower forearm edge of top and under sleeve matching. Seam top and under sleeve together 3/8 inch from forearm edge of top sleeve, forming a tapered outlet on the under sleeve.	301	SSbd-1 to SSa-1	10-14	A	A
	b. Spread open the seam and press flat with a heated pressing iron.					
11.	Join cuffs to sleeve.					
	Finished appearance. The cuff shall be uniformly stitched to the sleeve without twists, gathers, puckers or raw edges. In the					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
11.	Join cuffs to sleeves. (cont'd)					
	finished coat (after pressing), the point of the cuff shall be centered between the lower forearm edge and the backarm seam of sleeve.					
	a. Mark the sleeves in accordance with the sleeve cuff marker for positioning of the cuffs, with notch on the cuff marker matching the forearm seam line and bottom edge of marker in line with the bottom raw edge of sleeve.					
	b. Position the piped edge of cuff at the mark and stitch cuff to sleeve along the piped edge. The line of stitching shall be adjacent to the stitching of the cuff piped edge.	301	LSa-1	10-14	A (silk)	A
	c. Lift the cuff up and stitch the bottom edge of sleeves to the eyelet facing 1/4 to 3/8 inch from the bottom raw edge.	301	SSa-1	10-14	A	A
	d. Trim excess facing even with the bottom edge of sleeve.					
12.	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without distortions and shall start and finish evenly.					
	a. Join the top and under sleeves together at the backarm with a 3/8-inch seam, catching the ends of the cuff in the seam leaving an opening on the cuff between notches.	301	SSa-1	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
12.	Seam sleeves at backarm. (cont'd)					
	b. Spread open the sleeve and cuff seams and press smooth and flat with a heated pressing iron.					
13.	Baste and tack cuff to sleeve.					
	a. Turn the bottom of the cuff to the inside against the bottom edge of sleeve in accordance with notches, and baste along the turned edge of the cuff.	301 or Hand				
	b. Tack the raw edge of cuff to the body of sleeves with blind-stitching. The blindstitching shall not be exposed on, or caught to, the outside of the cuff.	301	EFe-1 (b)	4-6	A	A
	c. On the finished coat, the height of the cuff, when measured from folded bottom edge of cuff, shall be 3 ± 1/8 inches at the forearm and backarm seams, and 5 ± 1/8 inches at the point.					
14.	Seam sleeve lining at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without puckers, twists, gathers or pleats and shall start and finish evenly.					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the notches in lower forearm edge of top and under sleeve linings matching. Seam the top and under sleeve lining together 3/8 inch from the forearm edge of topsleeve lining, forming a tapered outlet on the under sleeve lining.	301	SSbd-1 or SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
15.	Seam sleeve lining at backarm.					
	Finished appearance. The backarm shall finish smooth and flat, without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve linings at the backarm with a 3/8-inch seam.	301	SSa-1	10-14	A	A
16.	Assemble sleeve and sleeve lining.					
	Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers or pleats.					
	a. Position the sleeve lining on the sleeve with upper edge of the lining extending approximately 1 inch beyond the armhole edge of the sleeve.					
	b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the sleeve, commencing at the top edge of the cuff and extending to approximately 6 inches from the armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand		4-6 1-2	A	A
	c. Turn sleeve lining over the sleeve.					
17.	Fell sleeve lining turnup/press sleeves.					
	Finished appearance. The sleeve lining shall not be short, tight or twisted at bottom of sleeves.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THR	
					NDL	LPr
17.	Fell sleeve lining turnup/press sleeves. (cont'd)					
	a. Turn under the bottom edge of the sleeve lining to finish 1 to 1-1/4 inches above the finished end of sleeve, and baste to turnup of cuff, or the sleeve lining may be felled to bottom sleeve without basting.	101 or Hand				
	b. Fell the folded edge of sleeve lining to the turnup of the cuff with blindstitching.	Hand or 301	EFc-1 (b)	8-10 6-8	C (silk) 0 (silk)	0
	c. Turn sleeves rightside out and assemble in pairs. Insert a sleeve pad in the sleeve to avoid creasing the front and back edges and press smooth and flat with a heated pressing machine.					
18.	Assemble collar interlining.					
	a. The collar interlining assembly shall consist of one ply of buckram and one ply of cotton silesia or polyester and cotton.					
	b. Position the silesia or polyester and cotton and buckram interlinings for the collar with all edges even and seam together 1/8 to 3/16 inch from the edges.	301	SSa-1 (each edge)	10-14	A	A
19.	Pipe outer ply of collar.					
	Finished appearance. The piping shall extend at the lower and side edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
19.	Pipe outer ply of collar. (cont'd)					
	a. The outer ply of the collar shall be made of one ply of material specified in 3.3.2, piped with material specified in 3.3.5.					
	b. Seam a 5/8-to 3/4-inch-wide strip of piping to outer ply 1/8 inch from sides and lower edge.	301	SSaa-1	10-14	A (silk)	A
	c. Turn back the piping and outer ply, uniformly working the folded edge of the piping beyond the edges. Topstitch the outer ply uniformly 3/16 inch from the folded edge of piping.	301	SSa-1	10-14	A (silk)	A
20.	Assemble collar.					
	Finished appearance. The collar shall be assembled without twists, gathers, puckers or pleats.					
	a. Position the interlining assembly on the inside of the outer ply under the unattached edge of piping. Tack all the raw edges of piping to the silesia or polyester and cotton interlining, making the outer ply form a smooth and snug fit.	Hand		2-3	C (silk)	
	b. Fold the upper raw edge of the outer collar over the interlining and tack to the silesia.	Hand		2-3	C (silk)	
	c. Press the collar smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
20.	Assemble collar. (cont'd)					
	d. Position the collar on the vinyl cord, with the upper edge of the collar abutted against the cord edge. Stitch collar to the vinyl cord 1/16 inch from edge of collar. Trim the ends of the cord even with the ends of the collar.	301	LSa-1	10-14	A (silk)	A
	e. Position an eyelet cover on the underside at each end of the collar, with one edge of the cover 3/4 to 7/8 inch from the front end, and the bottom raw edge of the eyelet cover 1/2 to 5/8 inch from the upper cord edge. Stitch collar to cover along the cord edge adjacent to the stitching line of the collar.	301	LSa-1	10-14	A (silk)	A
	f. Lap the upper cord edge of collar over the top raw edge of collar lining approximately 1/2 inch with lining face up. Stitch collar to the lining and eyelet cover along the cord edge adjacent to the stitching line of the collar. The stitching shall extend from center to center of eyelet covers. The collar lining shall extend not less than 1/2 inch from each end of collar.	301	SSa-1	10-14	A (silk)	A
	g. Turn collar lining and eyelet cover at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LPR
20.	Assemble collar. (cont'd)					
	h. Make one eyelet through all plies except the eyelet cover, at each end of the collar midway between the top and bottom edges and 1-1/2 + 1/8 inches from finished ends. The eyelets shall be well worked with the purling on the outisde of the collar and shall finish with a 1/8-inch-diameter opening.	Eye-let		22 per eyelet	A (silk)	A
21.	Assemble body lining.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					
	a. The body lining shall consist of an upper front, a side back panel, a center back panel, and a skirt.					
	b. Fold the upper front lining lengthwise with notches matching, and stitch front darts in accordance with marks as indicated on the patterns. The line of stitching for the waist darts shall be 3/8 inch from the folded edge of the dart at the waist tapering to a flat point at the top end, and securely backtacked.	301	OSf-1	10-14	A	A
	c. Position the side back panel and fronts with edges even and with notches matching. Seam together at the side seam with 3/4 inch seam.	301	SSa-1	10-14	A	A
	d. Position center back to the respective side backs with edges even and notches matching. Join together with a 3/8-inch seam.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
21.	Assemble body lining. (cont'd)					
	e. Overedge stitch together the side seam, and side back seam. The overedge stitching shall be securely caught in the fabric.	503 or 504	EFd-1	6-10	70/2	70/2
22.	Join upper body lining assembly to skirt.					
	a. Fold the skirt lining in accordance with notches on the pattern to form a 3/4-inch pleat at the waist line. Stitch across the pleat 1/8 to 3/16 inch from raw edge.	301	SSa-1	10-14	A	A
	b. Position the upper assembly to the skirt (face to face), with all edges even and join together at the waist with a 3/8-inch seam. The seam allowance for the waist darts, side and side back seams shall face toward the back.	301	SSa-1	10-14	A	A
	c. Overedge stitch the entire waist seam allowance with all joining seams caught in the stitching.	503 or 504	EFd-1	6-10	70/2	70/2
	d. Press all seams and darts smooth and flat. The waist seam shall be pressed toward the bottom and the remaining seams and darts towards the back.					
23.	Join front eyelet cover to left front facing.					
	a. Position front eyelet cover on the outside of the left front facing with the front and upper raw edges of cover and facing even. Stitch cover to facing 1/4 inch from raw edges.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the currentversion before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
24.	Seam wool facing to lining assembly.					
	Finished appearance. The lining shall be carefully aligned and seamed to the facing so that in the finished coat, the lining shall lie smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.					
	a. Position the lining on the wool facing with the top edges even and notches matching.					
	b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from the top edge of the facing to approximately 1-1/4 inches from the bottom edge of facing.	301	SSa-1	10-14	A	A
25.	Serge or overedgestitch facing-lining assembly.					
	Finished appearance. The overedge stitching shall be securely caught in the fabric.					
	a. Overedge stitch together the facing-lining seam allowance. The overedge stitching shall be securely caught in the fabric.	503 or 504	EFd-1	6-10	70/2	70/2
26.	Sew on identification label.					
	Finished appearance. The identification label shall be positioned so that in the finished coat, the label shall be midway between front and back edge of the left facing, with the bottom edge of					

Source: https://assist.dla.mil -- Downloaded: 20261-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LPR
26.	Sew on identification label. (cont'd)					
	label approximately 4 inches from the bottom finished edge of coat.					
	a. Sew the identification label to the outside of the left facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge)	10-14	A	A
27.	Make outer assembly.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					
	a. The assembly shall consist of upper front, side front, side back, center back and lower skirt.					
	b. Position the upper front, side front, and skirt interlining on the inside of their respective front, side front and skirt and fuse (see 3.3.7).					
	c. Fold the side fronts lengthwise with notches matching. Stitch the entire length of the dart 3/8 inch from the lower end and tapering to a point at the upper end.	301	OSf-1	10-14	A	A
	d. Position the upper front and side front panel with edges even, and join together with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	e. Position the side back and side front with edges even and notches matching. Seam together at the side with 3/4-inch seam.	301	SSa-1	10-14	A	A
	f. Spread open the front and side seams and press smooth and flat with a heated pressing iron.					
	g. Press the waist dart flat on the dart seam without turning the dart either to the right or left.					
	h. Overedgestitch the raw edge of each seam allowance.	503 or 504	EFd-1	6-12	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LPR
27.	Make outer assembly. (cont'd)					
	i. Fold the skirt dart in accordance with notches on patterns and stitch the length of the dart. The dart shall taper from 3/4 inch at the top to zero at the lower end. Dart shall finish approximately 5-1/4 to 5-1/2 inches long.	301	OSf-1	10-14	A	A
	j. Press skirt dart flat on dart seam without turning dart either to the right or left.					
	k. Position the upper assemblies and the skirt face to face with fronts and edges even, and with the back edge of the skirt extended 3/8 inch beyond the back edge of the side back panel as indicated by the notch on the skirt. Join together at the waist with a 3/8-inch seam and with the 1/4-inch-wide stay tape positioned on the upper assembly, 1/4 inch from the upper edge and caught in the stitching.	301	SSa-1	10-14	A	A
	l. The tape shall be sewn with the normal tension, not loose or tight, and shall extend from the side back seam to not more than 3-1/2 inches from the front edge of the fronts. Spread open the waist seam and press flat with a heated pressing iron.					
	m. Overedge stitch the raw edge of each seam allowance, the back edge of the skirt, the back edge of the side back panel and both sides of the center back.	503 or 504	EFd-1	6-12	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
28.	Pipe skirt.					
	Finished appearance. The finished piping shall be of uniform width, without twists, puckers, pleats or distortion. Piping shall extend along the back edge of skirt.					
	a. Fold 1-inch piping in half lengthwise. Seam piping 1/8 inch from folded edge.	301 or 401	OSf-1	10-14	A	A
	b. Serge or overedge stitch the raw edges of the piping together.	503 or	EFd-1	6-10	70/2	70/2
		504		6-10	70/2	70/2
	c. Mark along back edge of skirt for the positioning of the piping. The mark line shall be 7/8 inch from the back edge and shall extend from the top to bottom of the skirt.					
	d. Position the folded edge of piping on the mark line, and stitch piping to skirt 3/16 to 1/4 from the folded edge of piping. Piping shall finish with a minimum 1/2 inch excess at the top end to give a neat finish. In the finished coat, the folded edge of piping shall extend 1/8 inch beyond the seam.	301	OSf-1	10-14	A	A
29.	Join center back to side back and skirt.					
	Finished appearance. The backpart seams shall start and finish evenly and shall be smooth without gathers, pleats or puckers.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
29.	Join center back to side back and skirt. (cont'd)					
	a. Position and join the left and right assemblies to the center backpart with a 3/8-inch seam down to the waistseam and with a 3/4-inch seam from the waistseam to the bottom of coat.	301	SSa-1 (above waist-seam) LSaj-1 (below waist-seam)	10-14	A	A
	b. Spread open the side backseam from armholes to the waistseam, and press smooth and flat. Press skirt back seams from waistseam to bottom of coat smooth and flat with edge of each seam toward the center back. Pressing shall be done with a heated pressing iron or pressing machine.					
30.	Seam reinforcement stay to shoulder and armhole.					
	Finished appearance. The reinforcement stays shall be sewn to the armhole and shoulder edge of the front without gathers, puckers or pleats. The top end of the armhole stay and lower end of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide stays to the underside of the front along the shoulder edges and upper front edge of the armhole respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from neck and armholes respectively. The strip for the upper edge of armholes shall be positioned approxi-	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LPR
30.	Seam reinforcement stay to shoulder and armhole. (cont'd)					
	mately 1/2 inch from the shoulder.					
31.	Mark and dress right front.					
	a. Mark and dress the right front edge of coat, from the top notch to the waist seam. The mark line shall be 1 inch from the upper front edge to 1-1/8 inches at the waist seam. Continue on the straight line, from the waist seam to the notch at the bottom of the skirt.					
	NOTE: The dressing and shaping of the right front shall be performed in the sewing room.					
32.	Tape armholes.					
	a. Sew the cotton tape to the armhole starting with one end approximately 1 inch above the notch in the fronts and continuing along the lower and back edge of the armhole to approximately 1/2 inch from shoulder edge.	301	SSaa-1	10-14	A	A
	b. The tape shall be stitched with slight tension along the lower front edges of the armholes and shall be held taut while stitching along the back edge.					
33.	Press shoulder blades and armhole tapes.					
	a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or suitable type pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LPR
34.	Stitch piping to coat.					
	Finished appearance. The piping shall be uniformly stitched to the coat without twists, puckers or pleats. The piping shall extend from the collar notch at top edge of the right front to the collar notch at top edge of the left front.					
	a. Position the 1-1/4-inch-wide strip of piping material on the outside of left and right front, with one edge even with top, front and bottom edges of coat. Stitch piping to coat 1/8 inch from edge. The piping shall extend from the collar notch at the top, along the left and right front and the bottom edge of the coat.	301	SSa-1	10-14	A	A
	b. Turn the piping to the inside working out the folded edge of piping 1/8 inch beyond edges of coat. Topstitch coat to the piping 3/16 inch from the folded edge of piping, catching the turned under portion of the piping in the stitching.	301	SSe-2 (b)	10-14	A (silk)	A
	c. Notch out the excess piping material at the top and bottom front corners to eliminate bulkness. Trim the inner edge of piping on the right front only from the upper front down to approximately 1 to 1-1/2 inches below waist seam, so that the piping will not interfere with front buttonholes.					
	d. Overedge stitch the raw edge of the piping at the bottom edge of coat.	503 or 504	EFd-1	6-12	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
35.	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste the front to the interlining from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom edge of the front.	301 or Hand	Hopper			
	b. Baste along the shoulder, allowing room for setting the shoulder pad, working the fullness toward the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the backedge of interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulders to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of fronts.	301 or Hand	Hopper			
36.	Trim coat front interlining.					
	a. Trim the top edge of coat interlining even with the top edge of fronts from the point of shoulder to the collar notch.					
	b. Notch the top edge of the interlining in line with the collar notch.					
	c. Remove stitches joining front edge of silesia or polyester and cotton to coat front interlining, approximately 1/2 inch back from front and top edge of fronts.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
36.	Trim coat front interlining. (cont'd)					
	d. Turn the coat inside out and trim the interlining only approximately 1/4 inch back from the front and top edge of fronts.					
	e. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					
37.	Bind front edge and gorge of interlining.					
	Fold silesia or polyester and cotton back and over the top and front raw edge of the interlining. Stitch along the top and front edge with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the turned-under portion in the stitching.	301	EFa-3	8-10	A	A
38.	Bind top neck of interlining.					
	Finished appearance. The silesia or polyester and cotton binding shall be uniformly stitched along the gorge of the coat front interlining from the collar notch to the shoulder point.					
	a. Lap the 3/4-inch-wide strip of binding on the outside of the coat front interlining from the collar notch to shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	8-10	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
38.	Bind top neck edge of interlining. (cont'd)					
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301	SSa-1	10-14	A	A
39.	Fell piping to coat front interlining.					
	a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	101				
	b. Fell the upper front and lower edge of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A C (silk)	A
	c. Pull and remove basting stitches from piping.					
	d. Press the left and right fronts, respectively, on a suitable type heated pressing machine, with the chest to conform to the shape of the body.					
40.	Mark fronts for positioning the braid and buttonholes (see Figure 5).					
	a. Mark the location of six buttonholes on the outside of the right front, as shown on Figure 5. The top buttonhole (line A) shall be positioned 1 inch below the upper piped edge and 5/8 inch from the front piped edge. The lower buttonhole (line B) shall be on the					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD	
					NDL	LPR
40.	Mark fronts for positioning the braid and buttonholes (see Figure 5). (cont'd)					
	waist seam line and 5/8 inch from front piped edge. The remaining four buttonhole marks shall be evenly spaced.					
	b. Extend each buttonhole line towards the back and armhole edge. (Line B shall be 1 inch shorter than line A). The length of the top and bottom line is determined by the position of the harp on the second line from the top which shall be approximately 1-7/8 from the armhole edge to the center of the harp. The second line from the top shall be measured from the front edge of the buttonhole line to the center of the harp. Transfer this measurement to the bottom line less 1 inch. Draw a straight line from the bottom line mark through center of the harp up to the top line, establishing line A-C and B-D as shown on Figure 5.					
	c. Bisect the top line A-C and bottom line B-D and connect the bisecting points with a straight line E-F.					
	d. Position right front of coat on left front, face to face with the collar notches even and the right front edge 1 inch back of the left front edge at collar notch and waist seam and armhole edge even.					
	e. Trace the six lines on the left front to coincide with the lines on the right front; the lines on the left front shall extend approximately 2 to 2-1/4 inches from the front piped edge.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LPR
40.	Mark fronts for positioning the braid and buttonholes (see Figure 5). (cont'd) The vertical lines on the left front shall be identical to lines C-D-E-F on the right front. f. Draw a circle 7/8 ± 0-1/32 inch in diameter on each side of the six horizontal lines, centered to bisect line E-F and with the edge of each circle touching the horizontal line forming a figure 8 design as shown on Figure 5. g. Position the center of the harp pattern at the line C-D, with the upper edge of the pattern positioned at the bottom side of each horizontal line. Mark the harp in accordance with the pattern marker. The bottom edge of the harp must be not less than 1/2 inch from the line beneath.					
41.	Baste braid (see Figure 6). a. Baste braid by hand along each side of the horizontal line and around the circle figure 8 design and around the harp. The braid shall begin and end at the harp with both ends of the braid secured and tacked under the horizontal braid. On the right front the braid shall be basted around the buttonhole line with the outer edge of the braid 1/4 to 3/8 inch from the piped front edge.	Hand		6-8	C (silk black)	

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LPR
41.	Baste braid (see Figure 6). (cont'd)					
	b. Begin with cut end of braid even with straight line at top of harp. Baste the braid along its forward edge down the center of harp to the forward edge of harp center. Continue up the backarm along the back edge of harp to the straight line at top using the same edge of the braid.	Hand		2-6	C (silk) Black	
	c. Baste the bottom edge of braid along the straight line to the circle, follow circle back to straight line and continue to end of straight line.	Hand		2-6	C (silk) Black	
	d. Repeat steps 40.a, b, c, d, e and f on each marking on fronts.					
42.	Tack braid.					
	a. Securely tack all unattached edges of braid to provide a smooth, secure and flat surface of stitching.	Hand		2-6	C (silk) Black	
	b. Tack inside edges of braid circles to coat, forming an inner hole approximately 1/4 inch in diameter.	Hand		2-6	C (silk) Black	
	c. Tack loops at button edge of coat together to the coat to finish secure and flat.	Hand		2-6	C (silk) Black	
43.	Stitch braid (see Figure 6).					
	Finished appearance. All stitching shall be done 1/16 inch from all edges whenever possible. All stitching shall be uniform. All stitching shall be performed with one continuous thread whenever possible. Stitching across braid strands shall be done only as prescribed or when abso-					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
43.	Stitch braid (see Figure 6). (cont'd)					
	lutely necessary. All edges of the braid shall be securely attached to the coat at all points. The braid and the stitching shall present a smooth, neat, uniform appearance. The braid on the right front only shall be unstitched for approximately 3 inches from front end of the buttonhole loop braid.					
	a. Stitch braid through fronts and interlining on both sides of the braid 1/16 inch from edge. The line of stitching shall start and finish at the harp as shown on Figure 6.	301	SSav-2	10-14	A (silk)	A
	b. Braid may be stitched without basting, provided the requirements previously mentioned are maintained.	301	SSav-2	10-14	A (silk)	A
	c. Hand stitch the inner edges of horizontal braid together on both fronts from harp ends to end of buttonhole opening on right front and from harp ends to front end of braid on left front.	Hand		8-10	C (silk)	
44.	Join facing to fronts.					
	a. Position the left and right fronts to the respective front facing (face to face), with the waistline notch of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark the facing along the top, front and bottom edges of coat.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LP
44.	Join facing to fronts. (cont'd)					
	b. Lap the front edge of the right and left fronts, respectively on the outside of the facing at the marks and join the fronts to facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to bottom edge of coat front edge only.	301	LSa-1	10-14	A	A
	c. Trim excess facing material where necessary.					
45.	Baste front edges.					
	a. Turn the facing-lining assemblies to the inside of fronts, completely working out the corners.					
	b. Baste along the front edge of left and right fronts, working the facing back from the folded edge of piping.	101 or Hand				
46.	Baste facing (second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 301	Hopper			
	b. Turn under and baste the top edge of the facing even with the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
46.	Baste facing (second time). (cont'd)					
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of facings to approximately 1-1/4 inches from the lower edge of facing.	Hand or 301	Hopper			
	d. Turn under the bottom edge of facing at the mark and baste along the folded edge.	Hand or 301	Hopper			
47.	Tack facing to interlining.					
	a. Tack the right and left facing-lining seam allowance to the respective coat front interlining from approximately 2-1/2 inches from bottom edge of coat to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6		
48.	Baste front linings to coat.					
	a. Fold the front lining in accordance with the notches forming the chest pleat, and baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
	b. Baste the front lining to the coat, starting at the lower end of the chest pleat, continuing along lower edge of armhole approximately 2 inches from the edge and ending at the side seam. Match	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
48.	Baste front linings to coat. (cont'd)					
	side seams of coat and lining and continue basting as close as possible to the side seam and then across the bottom towards the front approximately 4 inches from piped bottom edge of coat.					
49.	Join lining at center back.					
	Finished appearance. The lining shall be carefully joined at center back without gathers, puckers or pleats. The seam shall start and finish evenly. The folded edge of the center pleat, on the outside of the lining, shall be towards the right side. The center back seam of the lining shall be between the fold.					
	a. Position the back parts of lining and join together at the center with a 3/8-inch seam from top to bottom.	301	SSa-1	10-14	A	A
	b. Overedge stitch entire back seam allowance together.	503 or 504	EFd-1	6-12	A	A
50.	Baste back lining to coat.					
	a. Fold the back lining, forming approximately a 1-inch-wide pleat at the center back. Baste the back lining to the coat along the center pleat from the top end to approximately 4 inches from the bottom finished edge of coat.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
50.	Baste back lining to coat. (cont'd)					
	b. Baste back lining to coat starting at side seam and continuing approximately 3 inches from the armhole and shoulder edges.	Hand or 301	Hopper			
51.	Hem bottom edge of lining.					
	Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The hem shall be 3/4 ± 1/8 inch wide. The lining securing straps shall be positioned on the back in line with back seam of coat.					
	a. Hem the bottom edge of body lining with the raw edge turned under and with one end of the securing straps positioned and caught in the stitching 1/16 inch from the upper folded edge of hem.	301	EFb-1	10-14	A	A
52.	Tack the lining securing straps to bottom of coat.					
	Finished appearance. The lining securing straps when tacked to the bottom edge of coat shall not cause twists or other distortions to either the coat or the lining. The end of the securing straps shall finish between the piping at bottom edge of coat and the skirt seam allowance. In the finished coat, the lining shall not be visible below the bottom edge of coat.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
52.	Tack the lining securing straps to bottom of coat. (cont'd)					
	a. Position and securely tack the free end of the securing straps to the piping at the bottom edge of coat through the skirt seam allowance.	301	SSa-1	10-14	A	A
	b. Position the bottom edge of the lining so that in the finished coat, the lining shall not be visible below the bottom of coat. Fold the lining securing straps across the width and stitch approximately 1/4 inch from the folded end in order to hold the lining in position.	301	OSf-1	10-14	A	A
53.	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the back lining even with the neck.					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck.					
54.	Make buttonholes.					
	Finished appearance. The buttonholes shall be clean cut, well made, well worked over gimp to fit 40-line insignia buttons. The gimp and thread shall be pulled through to the outside of the front. The purling of the buttonholes shall be on the facing side.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
54.	Make buttonholes. (cont'd)					
	The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of coat. The buttonholes shall be cut first type.					
	a. Remove the basting on the unstitched portion of the braid.					
	b. Make a horizontal eyelet-end square bar type buttonhole cut 1-1/8 inches long at each of the marks.	But-ton-hole		60 stitches per but-tonhole	B (silk)	F
	c. Securely bartack the end of each buttonhole catching the ends of the gimp and thread in the bar-tack. Trim the ends of the gimp and thread.	Bar-tack		21 per bartack	A (silk)	A
	d. Rebaste the unstitched portion of the braid around the buttonholes and complete that portion of the stitching through all plies (see Figure 6).					
55.	Make eyelets in fronts.					
	Finished appearance. The eyelets shall be worked with the purling on the outside of the coat, and shall finish with a 1/8-inch diameter opening. All stitches shall be securely caught in the fabric.					
	a. Mark the left front for the location of six eyelets for removable insignia buttons to align with the buttonhole on the right front. The mark for the top eyelet shall be in line with the left end of collar and the remaining eyelets shall be in vertical					

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
55.	Make eyelets in fronts. (cont'd)					
	alignment with the top mark.					
	b. Mark location for eyelets on the right and left front for removable buttons. The mark for the eyelet shall be between the braid strands at the top end of each harp.					
	c. Make an eyelet at each of the marks through all plies. The eyelet cover on the right front shall not be caught in the stitching.	Eye-let		22 per eyelet	A	A
56.	Press front of coat.					
	Finished appearance. Fronts shall finish smooth and flat without distortion, with all edges uniformly worked out.					
	a. Press the front of coat and braid smooth and flat with a suitable pressing machine, removing the fullness.					
57.	Baste shoulder pad to coat.					
	a. Insert shoulder pads between interlining and chest padding of coat fronts. Securely tack the pad to the interlining and chest padding only.	Hand or 301	Hopper			
58.	Seam shoulders.					
	Finished appearance. The shoulder seam shall finish without a distorted appearance.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCHS/ IN	THREAD NDL	THREAD LPR
58.	Seam shoulders. (cont'd)					
	a. Join the back to the fronts at the shoulders with a 3/8-inch seam, working in the fullness on the back in accordance with good manufacturing practice.	301	SSa-1	10-14	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulders short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
59.	Set shoulder loops.					
	Finished appearance. The shoulder loops shall be securely stitched without causing distortion to the shoulder and shall be positioned as follows: One loop on each shoulder 5/8 to 3/4 inch from the raw edge of armhhole. One loop on each shoulder 4 to 4-1/4 inches from the raw edge of armhole, and the front end of each loop shall be 5/8 to 3/4 inch in front of the shoulder seam line. The loop shall finish 1 + 1/8 inch long from folded edge to folded edge.					
	a. Position one end of each loop on the front 1/2 to 5/8 inch from the shoulder seam line. Stitch loop to the coat only 1/8 inch from the raw end of the loop.	301	SSa-1	10-14	A	A
	b. Fold loop back, turn under the back end of the loop and stitch the loop to the coat only 1/8 inch from the turned edge, catching the turned under portion in the stitching.	301	EFb-1	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
60.	Baste shoulder.					
	a. Position the front lining and coat front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn the coat on the inside.	Hand or 301	Hopper			
61.	Baste back lining and facing-lining assembly at shoulders.					
	a. Turn under and lap the shoulder edge of the back lining on the facing-lining assembly. Baste lining along the folded edge of the back lining with the top end of the chest pleat caught in the basting.	Hand				
62.	Seam neckline with size label and coat hanger.					
	Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label shall be positioned between the ends of the coat hanger and the ends of the coat hanger shall be positioned so that in the finished coat, the hanger opening shall be 2 ± 1/8 inches long when measured along the lower edge of collar lining.					
	a. Join facings and back lining to coat at the neckline from collar notch to collar notch, with a 1/4-inch seam and with the upper edge of the size label and the ends of the hanger positioned and caught in the stitching at the inside center back.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
62.	Seam neckline with size label and coat hanger. (cont'd)					
	b. Press the neckline of the coat smooth and flat with a heated pressing iron or pressing machine.					
63.	Set collar with lining.					
	Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar.					
	a. Mark the neckline on the outside 3/8 inch from collar notch up to the shoulder seam and gradually to within 1-1/4 to 1-3/8 inches at the center back for position of collar.					
	b. Position the collar with the lower edge lapped on the outside top edges of the coat at the mark.					
	c. Seam the collar from end to end, to the coat, as close as possible to, but not on top of, the stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining.	301	LSa-1	10-14	A (silk)	A
64.	Set sleeves.					
	Finished appearance. The armhole-sleeve seam shall finish without twists, gathers, puckers or pleats.					
	a. Position sleeves on outside of coat at the armholes, with the back notch matching the side back seam, and with notch in top sleeve and front matching.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
64.	Set sleeves. (cont'd)					
	b. Join the sleeve to the coat with a 3/8-inch seam, distributing the fullness in accordance with good manufcturing practice.	301	SSa-1	10-14	A	A
	c. Press the entire armhole smooth and flat with a heated pressing iron to remove fullness, exercising care not to stretch the armhole.					
65.	Baste armhole.					
	a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing fullness evenly. Turn coat on the outside.	Hand or 301	Hopper			
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of sleeves to the front notch of coat.	Hand or 301	Hopper			
66.	Set underarm shields to coat.					
	a. Position the underarm shield on the lining side of coat with the raw edges even with lower edge of armhole.					
	b. Baste the underarm shields to the coat along the vertical center and top, side and bottom edges.	Hand or 301	Hopper			
67.	Stitch sleeve head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
67.	Stitch sleeve head pads and linings at armhole. (cont'd)					
	a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam, and with the one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole-sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.	301	SSa-1	4-6	24/4	24/4
	c. The underarm shield may be basted to the armhole prior to stitching.					
68.	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (silk)	
69.	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve and sleeve lining matching.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
69.	Fell sleeve lining at armhole. (cont'd)					
	b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge from backarm seam of sleeve to the front edge of the shield.	Hand		8-10	C (silk)	
	- or -					
	c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operations 68a. above.	301	SSa-1	10-14	A	A
	- or -					
	d. Machine stitch the lower edge of the sleeve lining, at the armhole on the inside from forearm seam to backarm seam and stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling. NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.	Mach-ine		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD LPR
70.	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of the coat, starting at the bottom edge of the lining and continuing along the back and bottom edges of facing to the front edge of coat.	Hand		8-10	C (silk)	
	b. Fell the folded edge of the facings to the piping along the top edge from collar to notch to front edge of coat.	Hand		8-10	C (silk)	
	c. Fell the eyelet cover to the right front facing along the bottom edge of cover.	Hand		8-10	C (silk)	
	d. Tack the eyelet cover to the right front facing along the folded edge of lining. Place one tack midway between the second and third eyelet from the top, and one tack midway between the fourth and fifth eyelet from the top.	Hand		4-6 per tack	C (silk)	
71.	Sew hooks and eyes to collar (see figure 7).					
	Finished appearance. The hooks shall be positioned on the collar so that in the finished coat the top and bottom hooks shall be approximately 1/4 inch from top and bottom edges respectively of collar, and the remaining hook shall be midway between top and bottom hooks. The eyes shall be positioned to engage the hooks, effecting a flat, smooth closure at front of collar without misalignment or gapping.					
	a. Position and securely sew 3 hooks to the right end and 3 eyes to the left end of the collar.	Hand		16 per hook	C (silk) (double thread)	
72.	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (silk)	
	b. Turn under the end and top edge of the lining at the right and left end of the collar and position the folded edge of the lining under the hook. Fell the	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
72.	Finish collar. (cont'd)					
	folded end of the collar lining to the end of the collar and continue felling along the top folded edge of the end to the stitching joining the lining to the collar.					
	c. Turn under and fell the lower edge of the collar lining to the coat from end to end, catching the turned-under portion of the lining at the right and left end in the felling.	Hand		8-10	C (silk)	
	d. The lower edge of the collar lining may be basted to coat prior to felling.	Hand		8-10	C (silk)	
	e. Position the collar tab on the inside of collar at the left and with the collar tab extending approximately 3/4 inch beyond the front end of collar. Fell top, back and bottom raw edge of tab to collar lining, and stitch and back stitch the front end of tab approximately 1/4 to 3/8 inch from the eye.					
73.	Clean coat.					
	a. Pull all basting thread, trim and remove any loose ends of thread, and remove any spots, stains and tickets without injury to the material.					
	b. Buttonholes at front closure shall be examined for exposure of coat front interlining cloth. The exposed interlining shall be colored with a reddish indelible ink.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the currentversion before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
74.	Press coat. a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. c. Press the entire collar smooth and flat. d. Press the upper front on a body machine, shrinking and properly shaping the chest. e. Press the lower fronts smooth and flat. f. Press the sides, working the fullness towards the back. g. Press the back smooth and flat, removing all fullness. h. Block the shoulders to remove fullness and press shoulders smooth on a shoulder shaping machine. i. Press the armholes solid from the inside, creasing the armholes at the front, back and armpit. The armpit and the back of the armhole shall be held short while pressing.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
74.	Press coat.					
	j. Block the armholes on a pressing block, shrinking the top sleeves.					
	k. Insert a sleeve pad in the sleeves in order to prevent creasing and press sleeves smooth and flat.					
	l. Press lower edge of coat smooth, flat and even. Remove all impressions on the side and center back seam allowances. Press linings throughout, removing all wrinkles and creases. Press the front and back lining pleats smooth and flat. Remove all gloss marks.					
75.	Attach buttons.					
	a. Insert the shank of a 40-line insignia button through each eyelet on the right and left fronts and at the back. Secure each button with a ring toggle.					
	b. Insert the shank of a 27-line insignia button through each eyelet on the sleeve cuffs and secure each button with a ring toggle.					

Source: https://assist.dla.mil -- Downloaded: 20261-20T22:50Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II - Coat measurements 1/

Size	Bust 2/	Back length 3/	Sleeve length 4/	Collar length
	inches	inches	inches	inches
Short				
6	33-1/2	25	16-1/4	13
8	34-1/2	25-1/4	16-1/4	13-1/2
10	35-1/2	25-1/2	16-1/4	14
12	37	25-3/4	16-1/4	14-1/2
14	38-1/2	26	16-1/4	15
16	40	26-1/4	16-1/4	15-1/2
18	42	26-1/2	16-1/4	16
20	44	26-3/4	16-1/4	16-1/2
Regular				
	inches	inches	inches	inches
6	33-1/2	26	17-1/4	13
8	34-1/2	26-1/4	17-1/4	13-1/2
10	35-1/2	26-1/2	17-1/4	14
12	37	26-3/4	17-1/4	14-1/2
14	38-1/2	27	17-1/4	15
16	40	27-1/4	17-1/4	15-1/2
18	42	27-1/2	17-1/4	16
20	44	27-3/4	17-1/4	16-1/2
22	46	28	17-1/4	17
Long				
	inches	inches	inches	inches
8	34-1/2	27-1/2	18-1/2	13-1/2
10	35-1/2	27-3/4	18-1/2	14
12	37	28	18-1/2	14-1/2
14	38-1/2	28-1/4	18-1/2	15
16	40	28-1/2	18-1/2	15-1/2
18	42	28-3/4	18-1/2	16
20	44	29	18-1/2	16-1/2
22	46	29-1/4	18-1/2	17

1/ Tolerance on all measurements ± 3/8 inch.

2/ Bust measurement taken with coat buttoned, from folded edge to folded edge in line with pit of armhole: multiply by 2.

3/ Back length measurement taken along center back seam from lower edge of collar to bottom edge of coat.

4/ Sleeve length measurement taken along forearm seam from pit of armhole to bottom edge of sleeve.

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurence of defects shall not exceed the levels set by the applicable acceptable quality levels (AQL's).

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Certificate of compliance. Where certificate of compliance is submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4)
2. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. All inspections shall be in accordance with the provisions set forth in MIL-STD-105, except where otherwise indicated herein.

4.4 First article inspections. When first article is required, inspection shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table III for characteristics noted.

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. para.	Test method	No. Det. per S/U	Results reported as:
Cloth, Cotton, Buckram, (collar interlining)	Material identification 1/	3.3.8 1	1200	1	Pass or Fail
	Weave (single ply)	3.3.8 2	Visual	1	Pass or Fail
	Texture-threads per inch (single ply) -warp -filling	3.3.8 3	5050		
	Resistance to: -wet (dry) cleaning (laminated cloth)	3.3.8 4	5622 2/		
	-accelerated aging (laminated cloth)	3.3.8 4	5850 3/		
	perspiration	3.3.8 4	5680 4/		
	Stiffness, inch-lb. -original	3.3.8 4.1	5202 5/		
	-after wet (dry) cleaning	3.3.8 4.1	5622 2/ 5202		
	-after accelerated aging	3.3.8 4.1	5850 3/ 5202	10	
	-after perspiration	3.3.8 4.1	5680 4/ 5202	10	
	Weight oz. per sq. yd.	3.3.8 4.2	5041		
	Breaking strength (min) (lbs) (laminated cloth) -warp direction -filling direction	3.3.8 4.3	5100		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. para.	Test method	No. Det. per S/U	Results reported as:
Ornamental Braid	Weave	3.3.1 6	Visual	1	Pass or Fail
	Wt., oz.	3.3.1 6	5041		
	gross yards	3.3.1 6	4.3.2	1	To nearest 0.1 oz.
	Texture (picks & ends)	3.3.1 6	Visual	5	Avg. of 5 det. to nearest whole no.
	No. of Carriers	3.3.1 6	Visual	1	To nearest no.
	Shrinkage 6/	3.3.1 6	5558		
	Breaking strength 7/	3.3.1 6	5100		
	Colorfastness to:				
	-wet (dry) cleaning	3.3.16	5622		
	-light	3.3.16	5660		
Hook and Eye	Material identification 1/	3.3.18	Std Comm'l	1	Pass or Fail
	Finish	3.3.18	4.3.1.2	1	Pass or Fail

1/ Accept on certificate of compliance.
2/ Except that the colorfastness shall be evaluated after three wet cleaning cycles.
3/ Except that the aging exposure shall be limited to 5 hours at a temperature of 100 °C.
4/ Except that the material shall be immersed in the specified solutions for 20 minutes and air-dried.
5/ Except that a moment weight of 1 pound shall be used.
6/ Except that the width of the test specimen shall be the full width of the braid.
7/ Breaking strength shall be determined on the full width of the braid and the jaw dimensions shall be greater than the width of the braid.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

4.5.3 Sampling test. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following:

Hook and eye	100 each	2 each, hook and eye
Strap eye	100 each	2 each
Strap loop	100 each	2 each
Ornamental braid	yards	5 yards

4.5.4 Examination of end item. The end item shall be examined for defects listed in 4.5.4.1 through 4.5.4.3. The sample unit shall be one coat. All defects shall be classified as indicated below, except those with an asterisk (*) in classification column, which shall be classified as follows:

Major defect - When seriously affecting appearance or serviceability.

Minor A defect - When affecting appearance or serviceability but not seriously.

4.5.4.1 General defects. General defects shall be classified as follows:

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Buttonholes (construction)	a. One or more omitted or added.	X		
	b. Wrong type or uncut.		X	
	c. Not corresponding to size of button (front):			
	-too small, not permitting button to enter buttonhole.	X		
	-too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		X	
	d. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	X		
	e. Bartack missing or loose on:			
	-one buttonhole.		X	
	-two or more buttonholes.	X		
	f. Bartack misplaced, not serving intended purpose on:			
	-one buttonhole.			X
	-two or more buttonholes.		X	
	g. One or more broken stitches in:			
	-one buttonhole.		X	
	-two or more buttonholes.	X		
	h. More than 2 skipped stitches in:			
	-one buttonhole.			X
	-two or more buttonholes.		X	
	i. Ragged edges, affecting appearance or exposed interlining not colored with reddish indelible ink.			X

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Buttonholes (construction)	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		X	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified: -one or two stitches. -three or more stitches.		 X	 X
	l. One or more buttonholes finished with purling on the outside of fronts.	X		
Buttons or ring toggles	a. Missing, loose, broken or defective: -1 button or ring toggle. -2 or more buttons or 2 or more ring toggles.	 X	 X 	
	b. Not specified type, size, color or finish.		X	
NOTE: Buttons shall be considered defective if they have sharp, rough or cracked edges; scratches; blemishes or imbedded foreign matter on face side of button, loose shanks; or badly shaded.				
Cleanness	a. One or more removable spots or stains clearly noticeable, outside of coat.		X	
	b. One or more removable spots or stains clearly noticeable, inside of coat.			X
	c. One or more spots or stains of an obvious permanent nature.	*		
	d. Thread ends not trimmed, loose thread ends, 2 or more shade markings, or basting not removed throughout garment (to be scored when the condition exists on major portion of coat).		X	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Components and Assembly	a. Any defective component or of assembly (not herein classified).	X		
	b. Any component part or required operation omitted (not herein classified).	X		
Cutting	a. Any component part of basic wool material not cut in accordance with directional lines on patterns, or in accordance with specification requirements.	X		
	b. Cloth gabardine (white) for piping cut on the bias.		X	
	c. Any lining part not cut in accordance with directional lines on patterns.		X	
Eyelets (construction)	a. One or more omitted or added.	X		
	b. Wrong type.		X	
	c. Eyelet not securely caught on fabric, causing stitching to pull away from fabric.	X		
	d. Diameter of inside opening less than 1/8 inch or more than 1/4 inch.			X
	e. One or more eyelets uncut.		X	
	f. One or more broken stitches in: -one eyelet. -two or more eyelets.		 X	 X
	g. More than two skipped stitches in one or more eyelets.		X	
Hooks and eyes	a. One hook or eye omitted.		X	
	b. Two or more hooks or eyes omitted.	X		

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor A	Minor B
	c. Not specified type or size.		X	
	d. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hooks and eyes are fastened.		X	
	e. Hook or eye not securely tacked to ends of collar.		X	
	f. Hooks or eyes misplaced, i.e, hooks positioned on left end and eyes positioned on right end of collar.		X	
Material defects and damages	a. Any weakening defect such as smash, multiple float, loose slub, etc., that may develop into a hole.	X		
	b. Any hole (including drill holes).	X		
	c. Shade bar, unsightly slubs, etc: -on outside. -on inside.	X		X
	d. Needle chews which may develop into a hole.	X		
	e. Scissors or knife cuts, tear, mend or burn.	X		

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definity weakens the fabric or when it is so conspicously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows:

Material defect.	No defect
Workmanship damages.	Minor B defect

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Ornamental braid	a. Not specified, type, size or color.	X		
	b. One or more omitted.	X		
Pressing	a. Burned or scorched.		X	
	b. Pressing omitted (entire garment).		X	
	c. Poorly pressed (unless otherwise classified).		X	
	d. Armhole stretched, affecting appearance.		X	
	e. Basting or pressing impressions not removed on major portion of coat.			X
	f. Gloss not removed throughout coat, affecting appearance.			X
	g. Armholes not blocked or blocked poorly.		X	
	h. Inside of armholes not pressed solid.		X	
	i. Edges bulky, i.e., not pressed solid, affecting appearance.			X
	j. Linings not pressed smooth.			X
Seams and Stitching	a. Accuracy of seaming: 1. Any seam twisted, puckered or pleated, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	2. Part of garment caught in any unrelated operation or stitching.	X		
	3. Unsightly hand felling or blindstitching exposed on outside of coat, affecting appearance.		X	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.			X
	5. Wrong color of thread used on outside of coat, affecting appearance.	X		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular, i.e., unevenly gaged, or various stitchings not uniform, affecting appearance.		X	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			X
	c. Open seams:			
	1. On outside: -up to 1/4 inch inclusive -more than 1/4 inch but not more than 1/2 inch. -more than 1/2 inch.	 X	 X 	X
	2. On inside: -more than 1/2 inch (except machine felling). -up to 1/2 inch inclusive (except machine felling). -up to 1 inch inclusive (machine felling). -more than 1 inch (machine felling).	 	X X	 X X

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
NOTE: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.				
	d. Raw edges:			
	1. On outside:			
	-up to 1/8 inch inclusive.			X
	-more than 1/8 inch but not more than 1/4 inch.		X	
	-more than 1/4 inch.	X		
	2. On inside:			
	-more than 1/8 inch but not more than 1/4 inch.			X
	-more than 1/4 inch.		X	
NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.				
	e. Run-offs (see classification of open seams).			
	f. Stitch tension:			
	1. Loose tension resulting in loose seam.	X		
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		X	
	3. Tight tension (stitches break when normal strain is applied).	X		
NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting pull in lengthwise direction of seam.				
	g. Stitches per inch (excluding labels).			
	1. Less than minimum specified:			
	-one or two stitches.			X
	-three stitches.		X	
	-four or more stitches.	X		
NOTE: To be scored only if condition exists on major portion of seam.				

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	h. Stitch and seam type: 1. Wrong stitch or seam type.		X	
	i. Stitching skipped or broken (on edge, or raised stitching when seam is seamed, turned and stitched): -1/4 inch or more but not more than 1/2 inch.			X
	-more than 1/2 inch.		X	
Shaded parts	a. On outside 1. Any shaded part (except ornamental braid).			
	2. Any ornamental braid shaded, affecting appearance.		X	
	b. On inside: 1. Any lining part badly shaded (except sleeve lining).		X	
	2. Any sleeve lining part badly shaded or pairs not matching each other.			X

4.5.4.2 Detailed defects (coat buttoned on form or spread out on a table). Detailed defects with coat buttoned on form or spread out on a table shall be classified as follows:

Examine	Defect	Classification		
		Major	Minor	
			A	B
Collar (construction & setting)	a. Interlining omitted (buckram or silesia).	X		
	b. Interlining (buckram or silesia) tight or twisted, causing puckers on collar, affecting appearance.		X	
	c. Tight at joining to front or back, causing puckers or pleats at neck of coat, affecting appearance.		X	
	d. Piping irregular, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	e. Collar ends overlapping when fastened.		X	
	f. Collar ends spread open more than 3/8 inch when fastened.		X	
	g. Center of eyelets from finished ends of collar: -less than 1-3/8 inches but not less than 1-1/4 inches.			X
	-more than 1-5/8 inches but not more than 1/3-4 inches.			X
	-less than 1-1/4 inches or more than 1-3/4 inches.		X	
	h. One or both eyelets off-center with top and bottom edges of collar by more than 1/4 inch.			X
	i. Front finished ends of collar uneven in width by 3/16 inch or more.		X	
Alignment of front buttons and buttonholes	a. Not aligned, causing a noticeable bulge or twist on fronts when buttoned, affecting appearance.		X	
	b. Horizontal alignment of buttons on left front:			
	1. One or more rows out of alignment by more than 1/4 inch but not more than 1 inch.		X	
	2. One or more rows out of alignment by more than 1 inch.	X		
Ornamental braid (position, construction and setting).	a. One or more rows out of horizontal alignment by more than 1/4 inch.		X	
	b. One or more rows of braid not formed with either a figure 8 or a harp.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor A	Minor B
	c. Diameter of figure 8 circle less than 27/32 inch or more than 7/8 inch.			X
	d. Back edge of second harp from top less than 3/8 inch from finished armhole seam.		X	
	e. One or more inner circles forming figure 8 less than 1/8 inch in diameter.		X	
	f. One or more rows of braid not stitched through interlining.			X
	g. Stitching of braid not started or ending at bottom of harp where the front and back cross.			X
	h. Stitching of braid not uniform, affecting appearance.		X	
	i. Ends of stitching not securely tacked on one or more braids.		X	
	j. One or more braids not lying smooth, i.e., puckered, twisted, pleated or having excessive fullness, affecting appearance.			
	k. Braid not pressed smooth and flat.			X
	l. One or more harps not formed in accordance with Figure 6.		X	
	m. Braid loop around one or more buttonholes not properly positioned, restricting use of buttonhole for buttoning.		X	
	n. Inner edges of horizontal braid not adjacent to one another, i.e., spaced more than 1/16 inch apart on one or more braids.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	o. Front edge of one or more braids on right front positioned less than 1/4 inch from piping joining seam.			X
	p. Front edge of braid out of vertical alignment with left front edge of coat by 1/8 inch or more.		X	
	q. One or more horizontal braids not hand felled together at inner edges for full length of straight portion except at openings for buttonholes.		X	
Length of buttoned fronts	a. Right front at corner shorter than left front at bottom by: -more than 1/8 inch but not more than 1/4 inch. -more than 1/4 inch.	 X	X	
	b. Right front at corner longer than left front by: -more than 1/4 inch but not more than 3/8 inch. -more than 3/8 inch.	 X		X
	c. Left front at corner exposed beyond bottom edge of right front by more than 1/8 inch.		X	
Shoulder (construction)	a. Improperly joined or set, causing shoulder or back to twist.		X	
Shoulder pads	a. Not completely caught in armhole tacking.		X	
	b. Misplaced, not serving intended purpose, i.e., too far back or too far forward.		X	
	c. One or both pads omitted.		X	
Armholes (construction)	a. Badly stretched, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor A	Minor B
	b. Taped too tight, causing puckering.		X	
	c. Crooked seam, affecting appearance.		X	
	d. Tape stitching exposed and visible on outside surface.			X
	e. Sleeve head pads not completely tacked to armholes or misplaced, not serving intended purpose.		X	
	f. One or both sleeve head pads omitted.		X	
Sleeves	a. Setting and hang: 1. Sleeve fullness misplaced, affecting appearance.		X	
	2. Backarm seam of sleeve not matching side back seam by: -more than 1/4 inch but not more than 1/2 inch. -more than 1/2 inch.	 X	X	
	3. Hang of sleeves on the same coat in opposite direction by more than 2 inches.			X
	4. Sleeve tight in armhole, i.e., roll effect not present.			X
	b. Sleeve lining: 1. Twisted, tight, or short causing bulge, twist, or puckering on outside of sleeves.	 X		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			X

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of sleeve.			X
	c. Construction of sleeves:			
	1. Tacking on bottom turnup to body of sleeve omitted or insecure.		X	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			X
	3. Tacking on 1 or both sleeve lining seams to sleeve seams omitted, or insecure.			X
	4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from bottom edge of sleeve.			X
	d. Sleeve cuffs:			
	1. Piping irregular, affecting appearance.		X	
	2. Top edge on top sleeve part poorly shaped, affecting appearance.		X	
	3. Height of pointed end on both sleeves varying in length by more than 1/4 inch.		X	
	4. Sleeve puckered at joining of cuff, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	5. Cuff puckered or twisted at joining to sleeve, affecting appearance.		X	
	6. Ends of cuff staggered at backarm seam: -1/8 inch or more but not more than 1/4 inch. -more than 1/4 inch.		 X	 X
	7. Height of cuff at point on top sleeve including piping: -less than 4-3/4 inches but not less than 4-1/2 or more than 5-1/4 inches but not more than 5-1/2 inches. -less than 4-1/2 inches or more than 5-1/2 inches		 X	 X
	8. Height of cuff at backarm or front creased edges including piping. -less than 2-3/4 inches but not less than 2-1/2 inches or more than 3-1/4 inches but not more than 3-1/2 inches. -less than 2-1/2 inches or more than 3-1/2 inches.		 X	 X
	9. Point of cuff not centered between the folded forearm edge and the folded backarm edge of sleeves by more than 1/4 inch.		X	
Position of eyelets on sleeve cuffs	a. Horizontal alignment of eyelet on one sleeve cuff not uniform with other sleeve cuff by more than 1/4 inch.			X
	b. Eyelet on one or both sleeve cuffs out of vertical alignment by more than 1/8 inch.			X

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Body (outside)	a. Fitting of body linings: 1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	X		
	b. Fitting of front interlining: 1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	X		
	2. Too full, causing coat front to have a wavy appearance.	X		
Waist seam	a. Seam not pressed open.		X	
	b. Seam stretched, affecting appearance.		X	
	c. Tape set on tight, causing puckering on waist seam, affecting appearance.		X	
Lower skirt dart	a. One or both darts cut and sewn type in lieu of folded seam type.			X
	b. End on one or both darts not properly tapered, causing puckering at end of dart, affecting appearance.		X	
	c. Length of one or both darts less than 5 inches or more than 5-1/2 inches long.			X
	d. One or both folded darts not pressed flat as specified.			X
Upper front, side body and side back panel seams	a. One or more joining seams not spread open and pressed flat.		X	

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	b. Curved side back panel seam stretched or distorted, affecting appearance.		X	
Center back and skirt	a. Joined seams below waist seam not pressed flat and towards the center of back.		X	
	b. Piping at back edge of skirt set on tight, causing puckering on back, affecting appearance.		X	
	c. Folded edge of piping extending less than 1/8 inch beyond the seam on back.		X	
	d. Buttons on each back seam at the skirt seam: -out of horizontal alignment by 1/4 inch or more. -one or both reinforcement disc omitted.		X	X
Front and bottom edges	a. Front edges stretched, affecting appearance.		X	
	b. Piping set on tight, causing puckering on front, affecting appearance.		X	
	c. Front or bottom piping irregular, affecting appearance.		X	
	d. Bottom edge stretched, puckered or uneven, affecting appearance.			X
	e. Bottom corner of right front poorly shaped, affecting appearance.		X	
	f. Right front rolling outward below bottom button.		X	
	g. Front edge irregular, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	h. Piping tight on bottom edge, causing puckering on outside of coat, affecting appearance.		X	
	i. Right front not dressed as specified.		X	
Front facings	a. Short, tight, or twisted causing fullness or twists on fronts, affecting appearance.		X	
Front buttonholes (position)	a. Position from front edge including piped edge: -less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch. -less than 1/2 inch or more than 7/8 inch.		X	X
	b. More than 1/4 inch from equal spacing.		X	
	c. Bottom buttonhole above or below waist seam.		X	
	d. Unevenly spaced from front edge by more than 3/16 inch.		X	
	e. Top buttonhole less than 7/8 inch or more than 1-1/8 inches from top edge of piping (collar notch).		X	
Front buttons (position)	a. Out of vertical alignment by 1/4 inch or more.		X	
	b. Center of one or more buttons positioned from right front edge: -less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch. -less than 1/2 inch or more than 7/8 inch.		X	X

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Labels	a. Any required label missing, incorrect, illegible or size label not securely caught in stitching.	X		
	b. Identification label not stitched on 4 sides.		X	
	c. Bottom edge of identification label less than 3 inches or more than 5 inches from bottom finished edge of coat.			X
	d. Identification label not stitched to outside of right facing.			X
Hanger	a. Hanger omitted or ends not securely stitched.	X		
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along the lower edge of collar lining.		X	
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.		X	
	d. Finished width less than 1/4 inch or more than 3/8 inch wide.			X
Front facings	a. Fullness or pleats on facings between eyelets, buttonholes, or between front edge and eyelets or buttonholes.			X

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor A	Minor B
	b. Tacking on back edge to 1 or both interlinings: -omitted. -insecure or incomplete for a distance of more than 4-1/2 inches below shoulder seams, or more than 4 inches above bottom edge of coat.		X	X
	c. Felling at bottom edge of front facing or back edge of facing omitted or insecure on one or both facings.		X	
	d. Felling along folded edge of one or both facings at collar notch omitted or insecure.		X	
Body linings	a. Excessive puckering or pleated.			X
	b. Twisted, not affecting smoothness on outside of coat.			X
	c. One or both chest pleats on shoulders omitted.		X	
	d. Folded edge of 1 or both chest pleats facing front edge of coat.			X
	e. Pleat omitted at center of back lining.		X	
	f. Pleat less than 1/2 inch in depth at center of back lining.			X
	g. Bottom hem less than 5/8 inch or more than 7/8 inch wide.			X
	h. Lining too long, i.e., exposed beyond bottom edge of coat.		X	
Lining securing straps	a. One or both omitted or insecure.		X	
	b. Less than 1/4 inch or more than 3/8 inch wide.			X

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	c. One or both positioned more than 1 inch from back seams.			X
	d. End of one or both straps not fastened between the piping at bottom edge of coat and skirt seam allowance.			X
	e. One or both not folded and stitched across width.			X
	f. One or both not properly attached to lining hem of coat, causing twist or distortion to either the lining or coat.		X	
	g. One or both exposed beyond bottom edge of coat.		X	
Serge or overedge stitching	a. Basic material: -omitted on one or more raw edges for cut darts and seams where specified.		X	
	b. Piping the skirt: -omitted on raw edges of one or both folded pipings.		X	
	c. Lining joined seams: -omitted on one or more seams where specified.		X	
Waist seams	a. Tape on one or both seams omitted.		X	
Underarm shields	a. One or both omitted.		X	
	b. Tacking on one or both shields along side or bottom edge to body lining omitted or insecure.			X

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	c. Top edge not caught in armhole tacking or stitching when tacked by hand.			X
	d. Puckered, pleated, or twisted.			X
	e. One or both shields misplaced, not serving intended purpose.			X
Inside of armhole	a. Backstitching at armpit of armhole from backarm seam of sleeve to front edge of shield omitted.			X
Collar extension tab	a. Omitted.		X	
	b. Extending less than 1/2 inch or more than 1 inch beyond end of collar.			X
	c. Felling omitted or insecure at top, back, front or bottom edges.		X	
	d. Box stitching omitted.		X	
Collar lining and eyelet covers	a. Ends of collar lining not securely tacked.		X	
	b. One or both eyelet covers omitted.		X	
	c. One or both eyelet covers not covering eyelet.		X	
	d. Width of collar eyelet cover less than 1-5/8 inches or more than 1-7/8 inchea.			X
	e. Felling on front edge and along lower corner of 1 or both eyelet covers omitted.		X	
	f. Felling along lower corner of one or both eyelet covers extending for a distance of more than 3/4 inch.			X

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	g. Top or bottom hook positioned less than 1/4 inch from top or bottom edges respectively of collar.			X
	h. Remaining hook not positioned midway between top and bottom hook.			X

4.5.4.3 Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5.4.4 Inspection levels and AQL's. Inspection levels and AQL's expressed in defects per 100 units (DHU) shall be as follows:

4.5.4.1 through 4.5.4.2

Inspection Level III of MIL-STD-105

AQL's	Major	1.5 DHU
	Major and Minor A (combined)	10.0 DHU
	Total Major, Minor A and Minor B (combined)	40.0 DHU

4.5.4.3

Inspection Level S-3 of MIL-STD-105

One class	4.0 DHU

4.5.5 Examination of packaging. An examination shall be made to determine compliance with packaging, packing and marking requirements of Section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the inspection lot. The inspection lot shall be S-2 and the AQL shall be 2.5 DHU.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

Examine	Defect
Marking (exterior and interior)	Omitted, incorrect, illegible, of improper size, location, sequence, or method of application.
Materials	Any component missing or damaged.
Workmanship	Inadequate application of components, such as incomplete closure of case liners, container flaps, loose strapping, inadequate stapling. Bulging or distortion of containers.
Content	Number of coats per container is more or less than required.

4.6 Tests.

4.6.1 Lacquer tests.

4.6.1.1 Liver of sulfur. The samples to be tested shall be immersed in a 2 percent by weight chemically pure liver of sulfur (potassium sulphide) water solution, at a temperature of 100°F, for not less than 3 minutes. The samples shall then be removed and rinsed in warm, then cold, then hot water, after which they shall be wiped gently in an absorbent cellulose material or whirled to remove residual moisture, and allowed to air dry at room temperature for a period of 1 hour. There shall be no change in the appearance of the lacquered surfaces except for a slight overall yellowing and not more than 3 dark spots, each not exceeding 1/32 inch largest dimension.

4.6.1.2 Tackiness. At room temperature (60° to 80°F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

4.6.2 Weight of braid per gross yards. Weigh 6 yards of braid in a relaxed condition on a balance or scale accurate to ± 0.25 percent. Convert to ounces and multiply by 24 to obtain the weight of 144 yards.

5. PACKAGING

5.1 Preservation and packaging. Unless otherwise specified (see 6.2), the coats shall be packaged in accordance with good commerical practice and packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight Classification Rules, National Motor Freight Classification, U.S. Postal Service Manual or regulations of other carriers applicable to the mode of transportation.

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:50Z
Check the source to verify that this is the current version before use.

5.2 Markings. In addition to any special marking required by the contract or order, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES

6.1 Intended use. The coats described herein are intended for wear by enlisted female personnel of the U. S. Marine Corps Band.

6.2 Ordering data. Purchasers should exercise any desired options offered herein, and procurement documents should specify the following:

6.2.1 Procurement requirements.

(a) Title, number and date of this specification.
(b) Sizes required (see 1.2).
(c) Whether first article is required (see 3.2).
(d) Number of coats in first article (see 3.2).
(e) When coats shall not be packaged and packed in accordance with commerical practice (see 5.1).

6.2.2 Contract data requirements. Data conforming to Data Item Descriptions DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902, DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on a DD Form 1423 included in the contract.

6.3 Samples and shade samples. For information regarding availability of sample coats and standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).

6.5 Figures. Figures 1 through 7 show general design of the coats with assembly details and measurements. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

Preparing Activity:

Navy - MC

Project No. 8410-N492

Source: https://assist.dla.mil -- Downloaded: 2026l0-20T22:50Z
Check the source to verify that this is the currentversion before use.

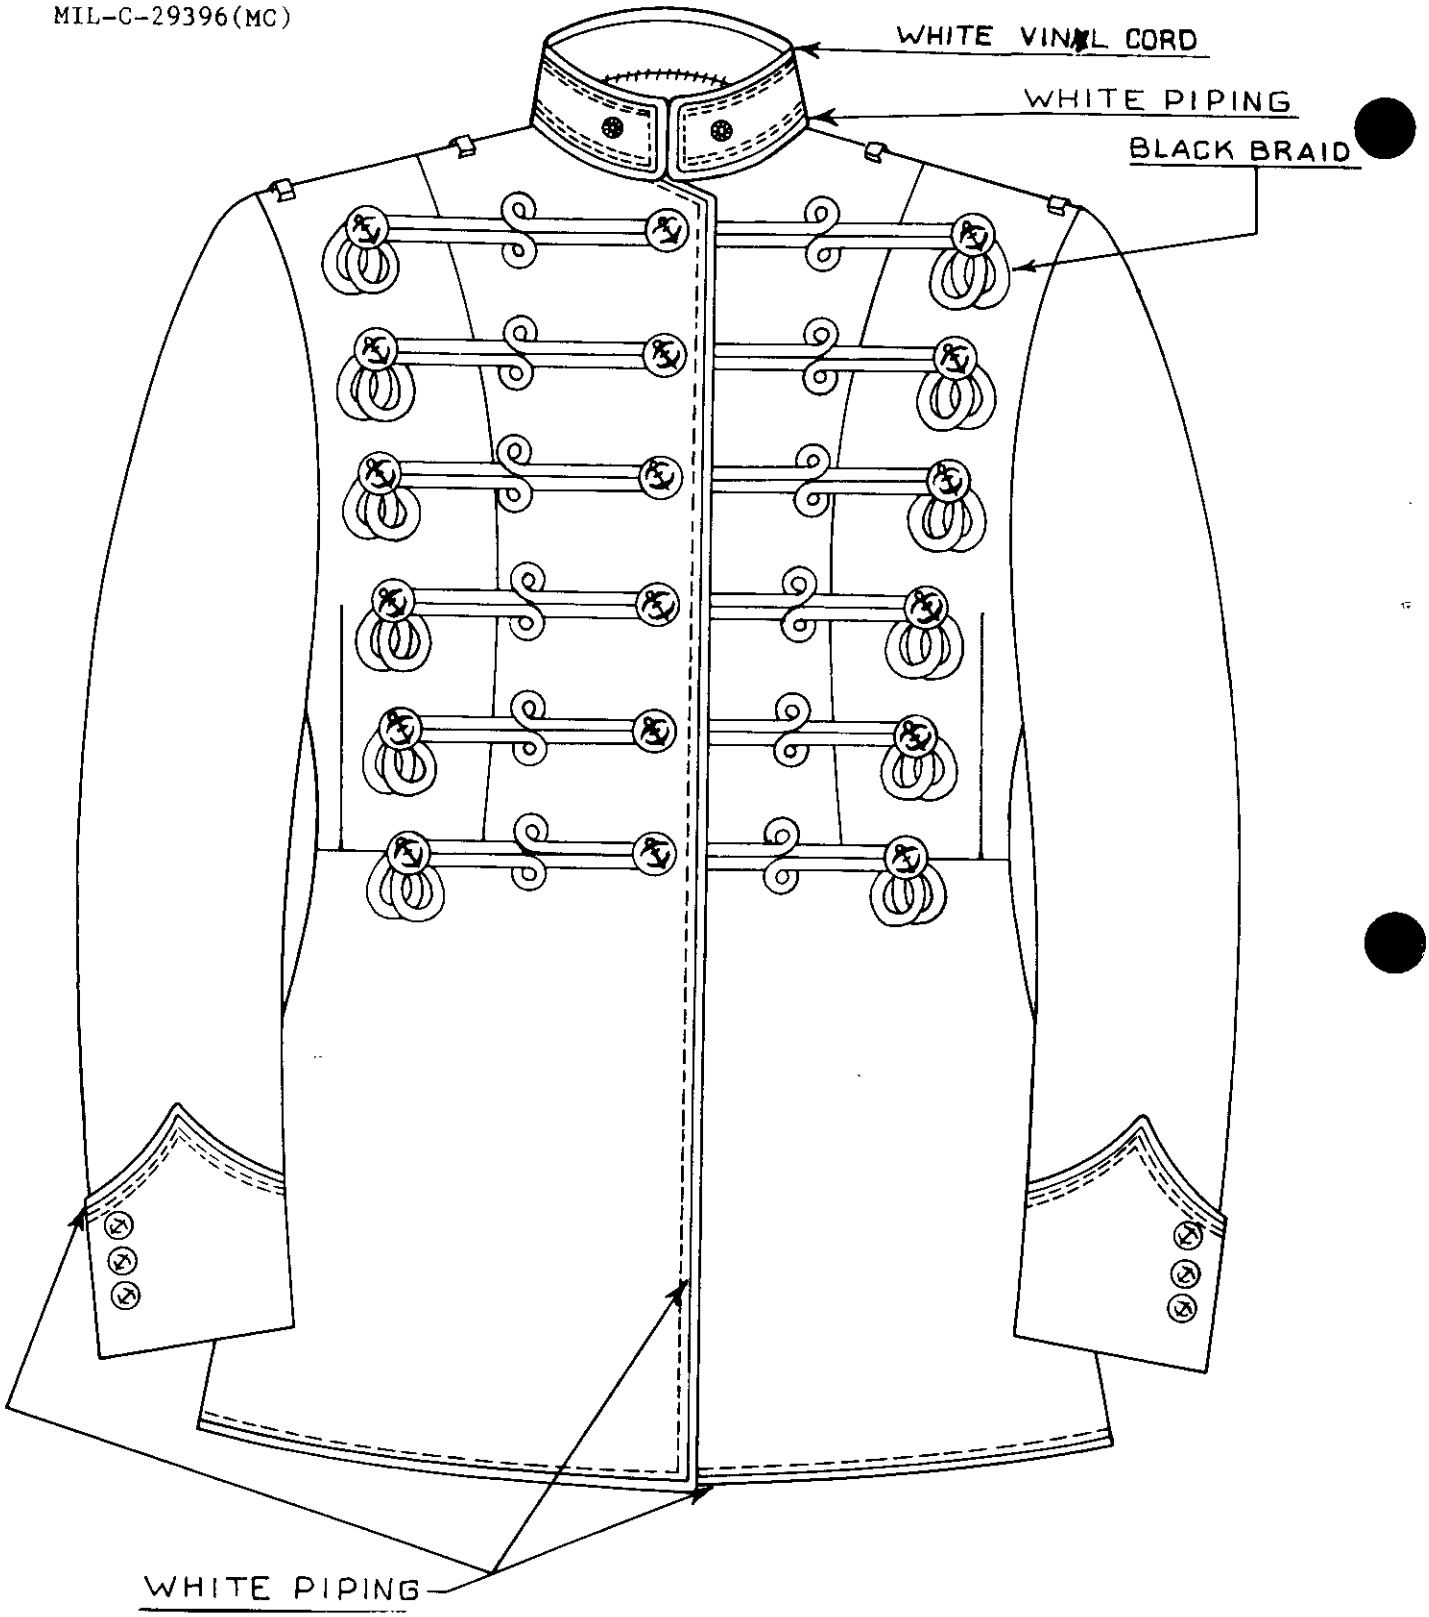


FIG: 1 COAT,WOMAN'S,FULL DRESS:SCARLET

U.S.MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

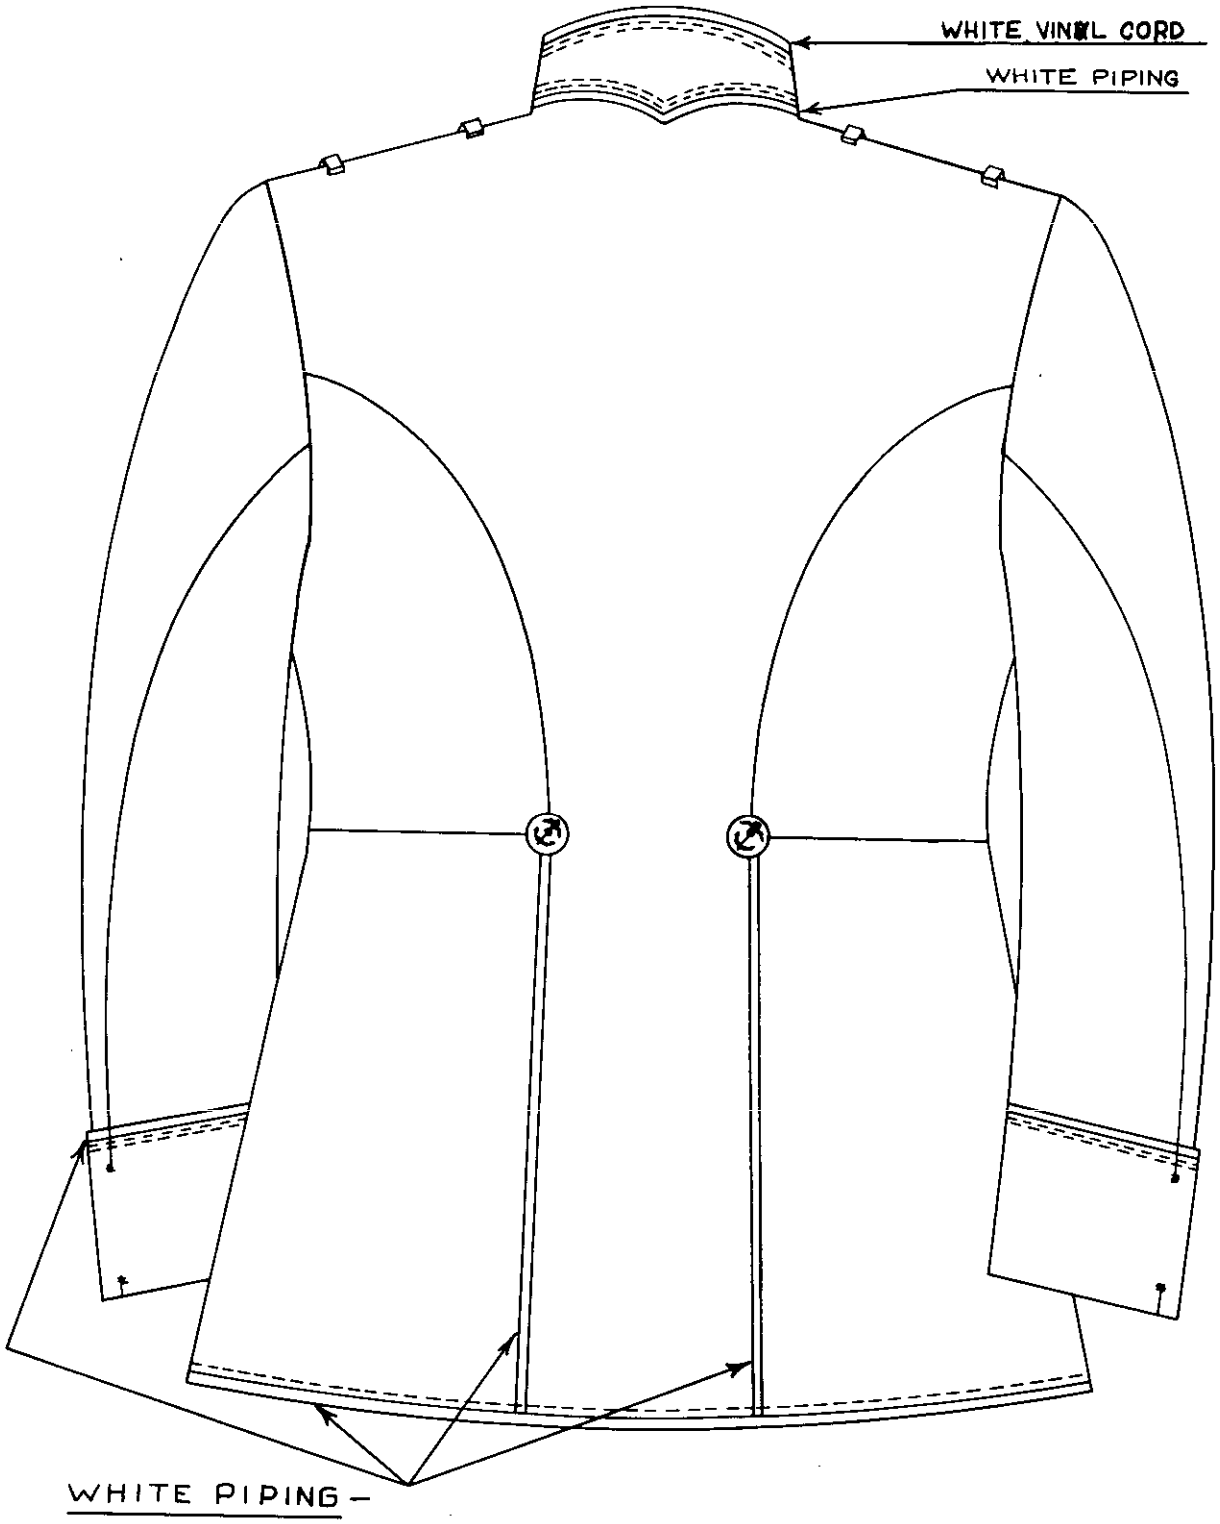


FIG.2 COAT, WOMAN'S, FULLDRESS, SCARLET

U.S. MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.


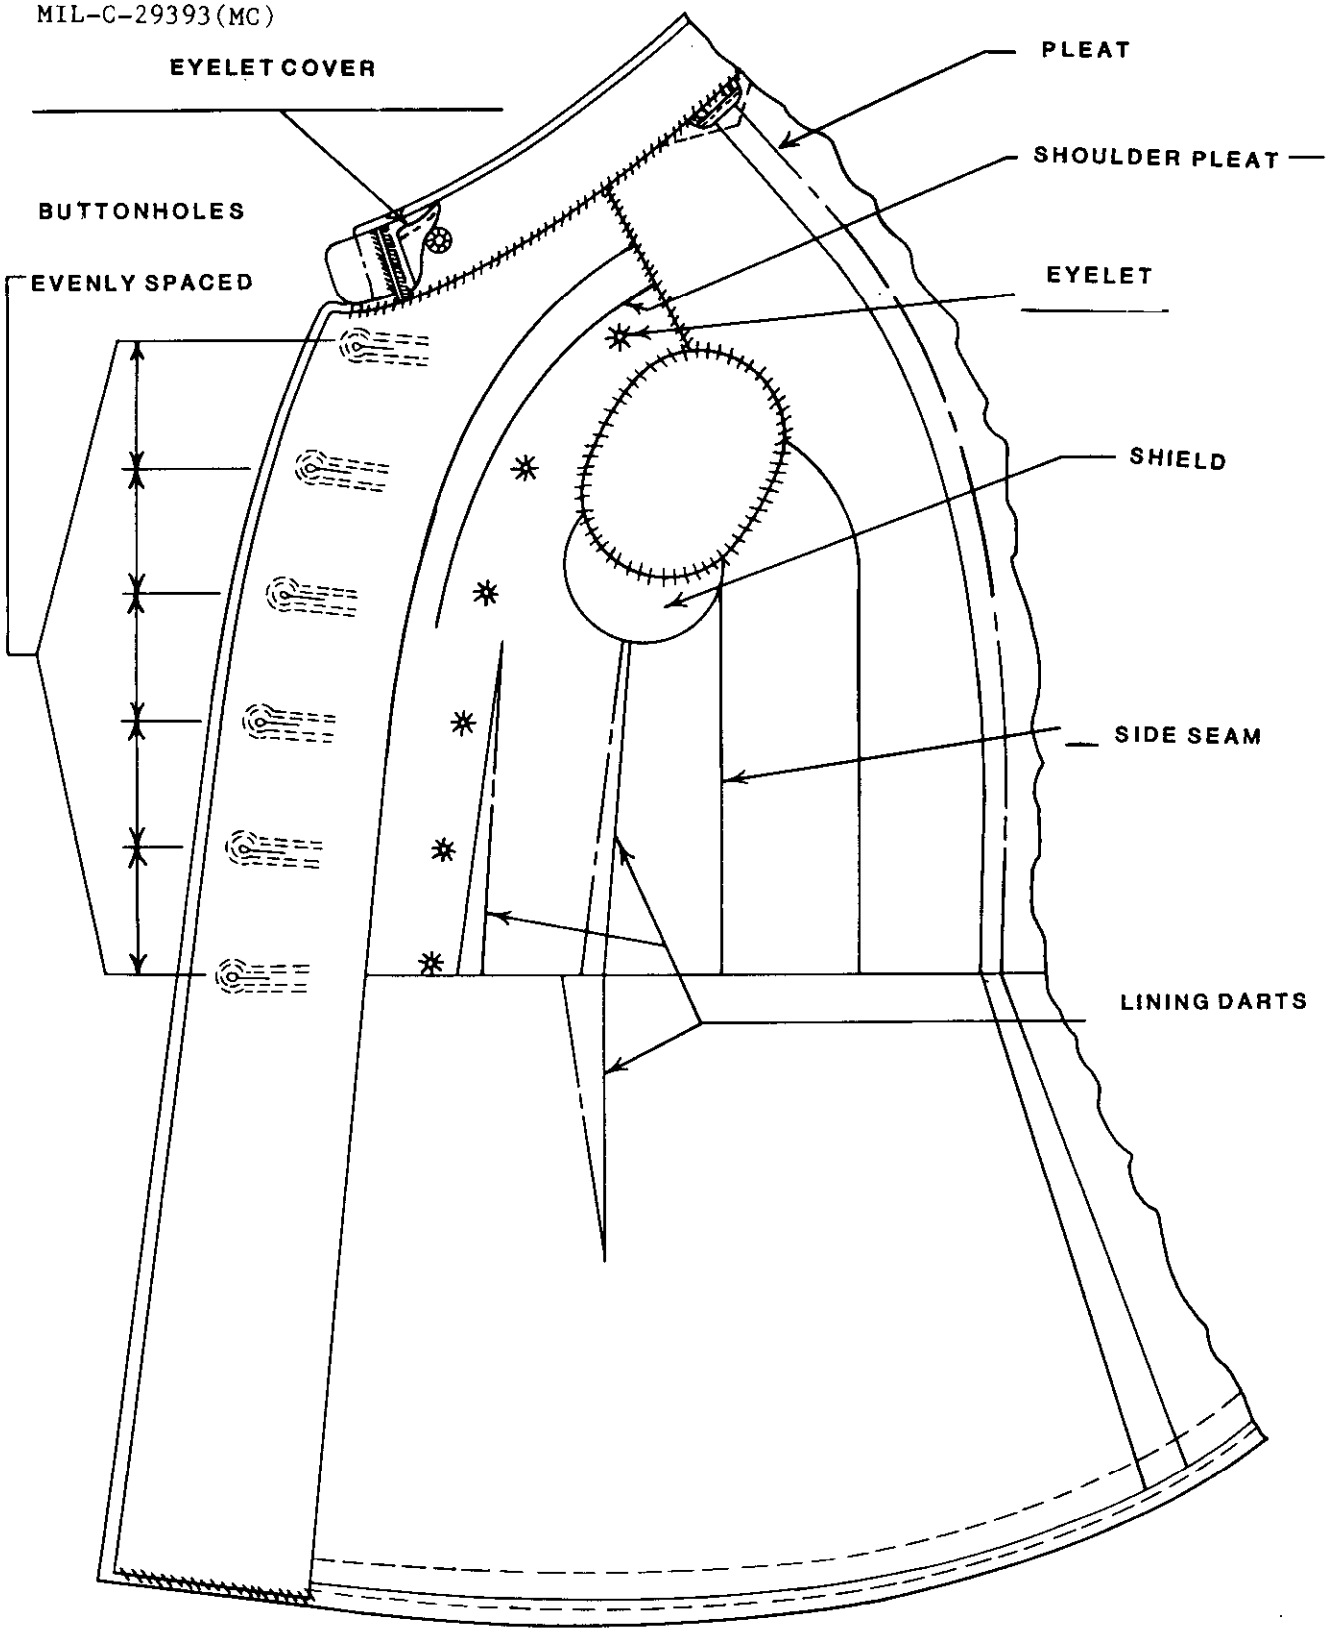


FIG.3:COAT,WOMAN'S,FULL DRESS,SCARLET

U.S.MARINE CORPS BAND


Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

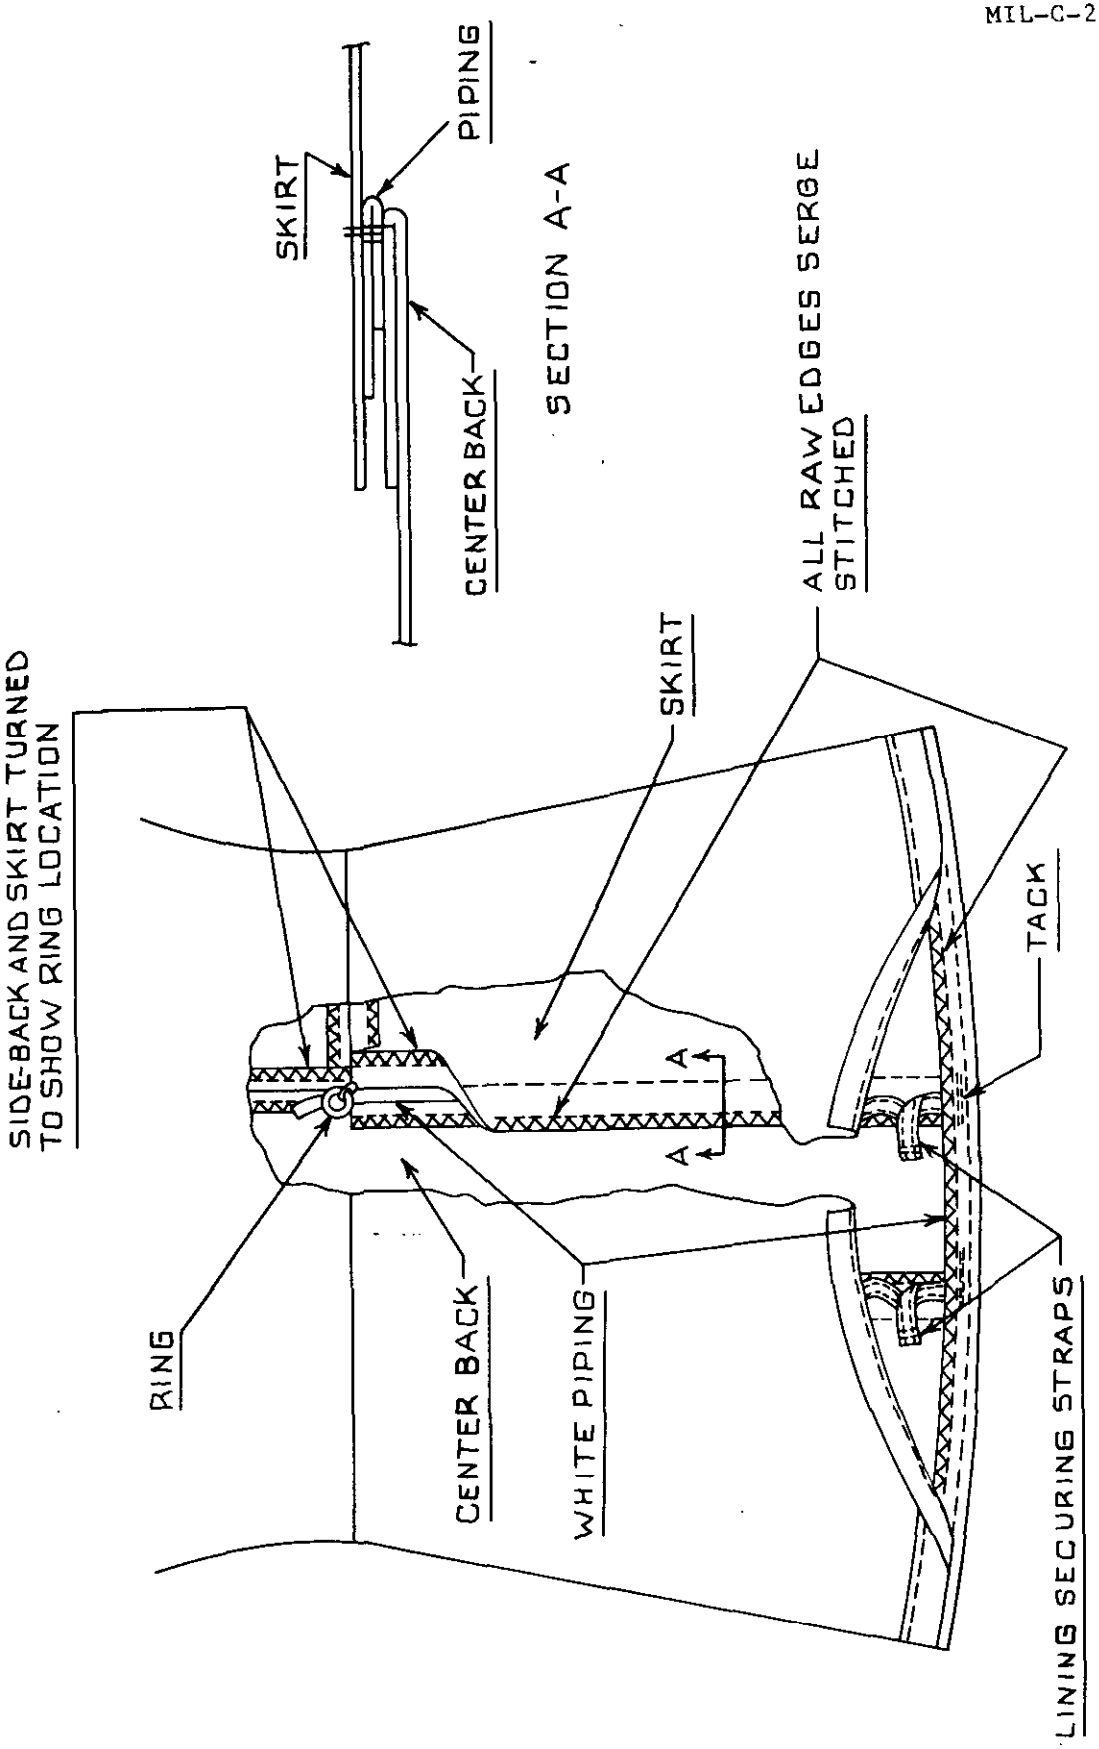

BACK INSIDE — CUT THROUGH VIEW

FIG:4 COAT,WOMAN'S,FULL DRESS,SCARLET U.S.MARINE CORPS BAND


Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

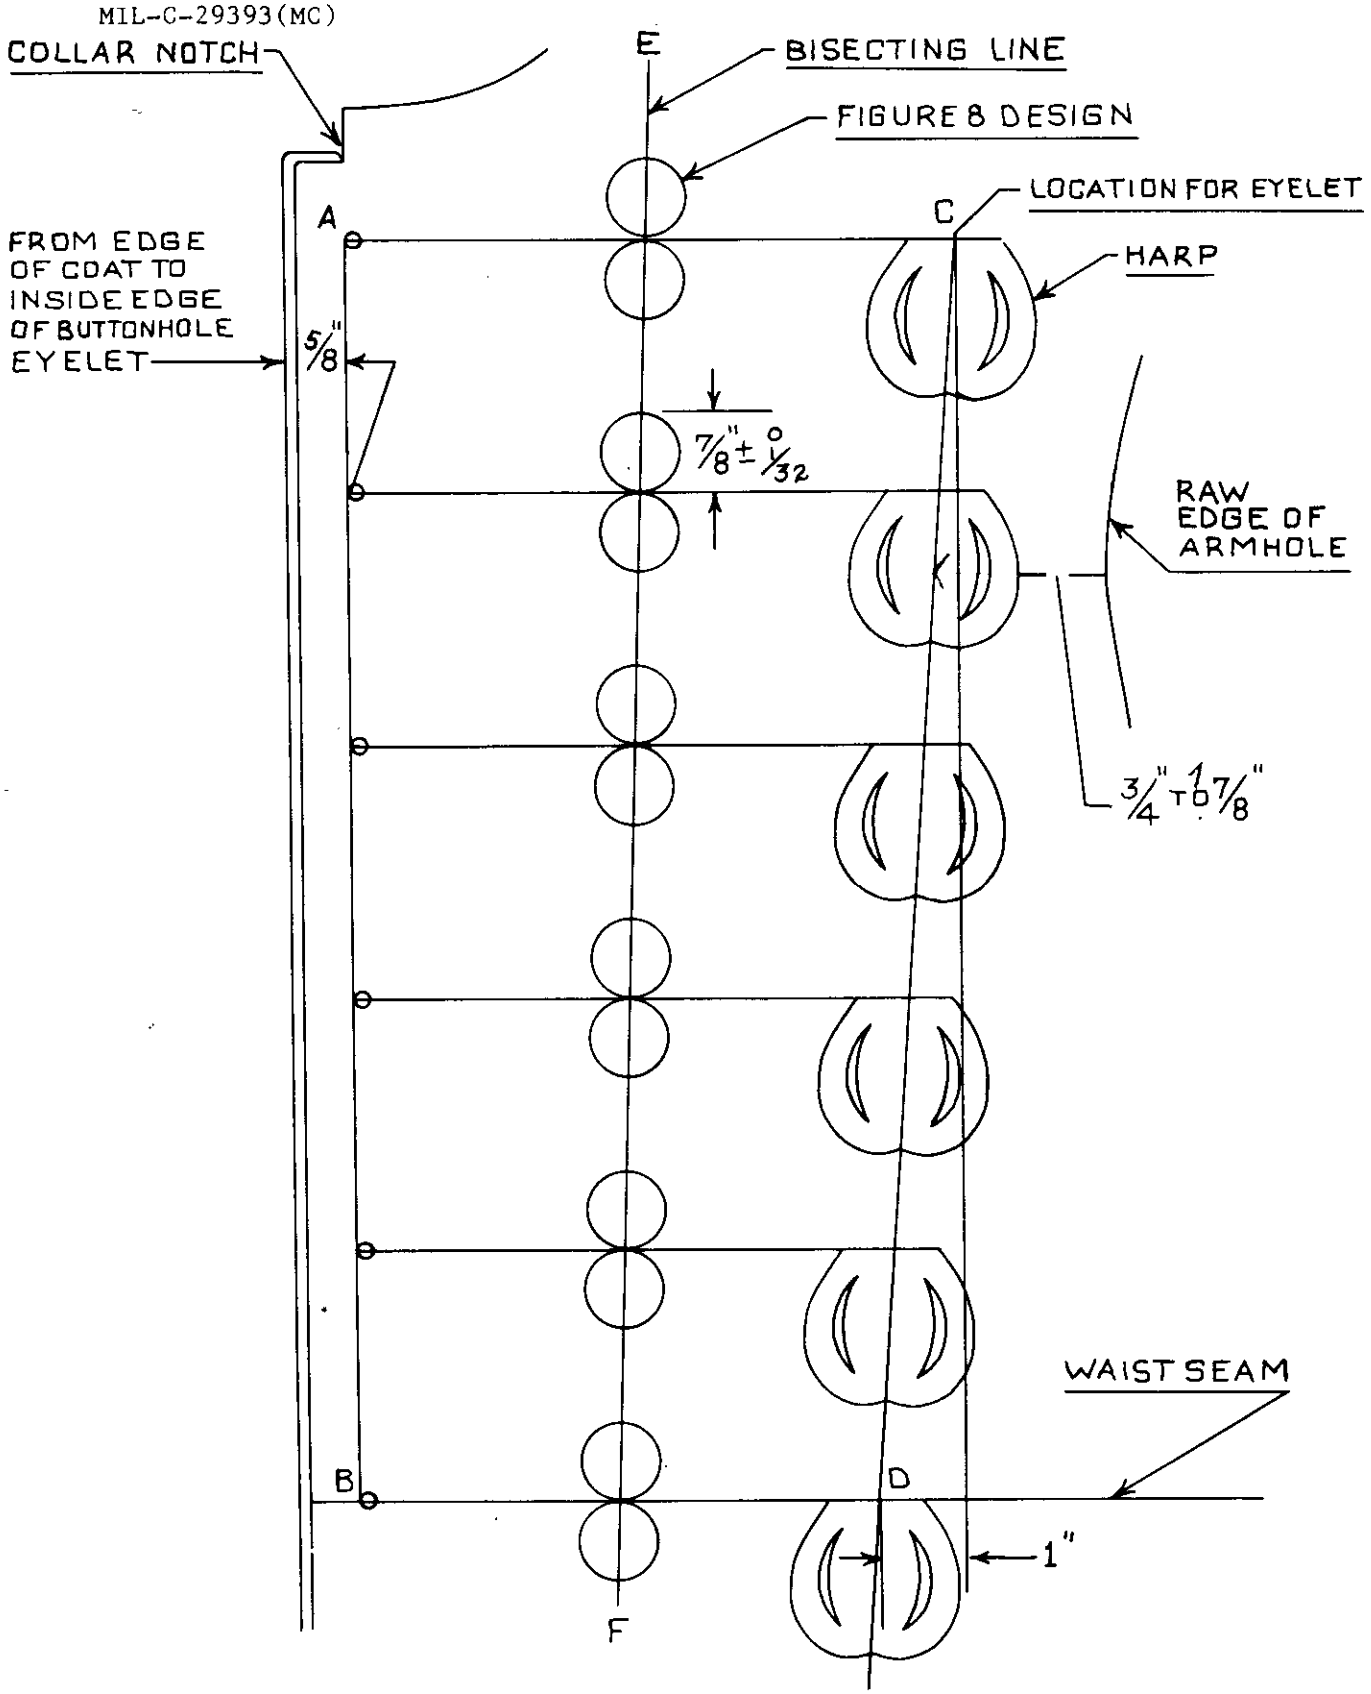

BRAID PLACEMENT DIAGRAM — LEFT FRONT


FIG.5: COAT, WOMAN'S, FULL DRESS SCARLET

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

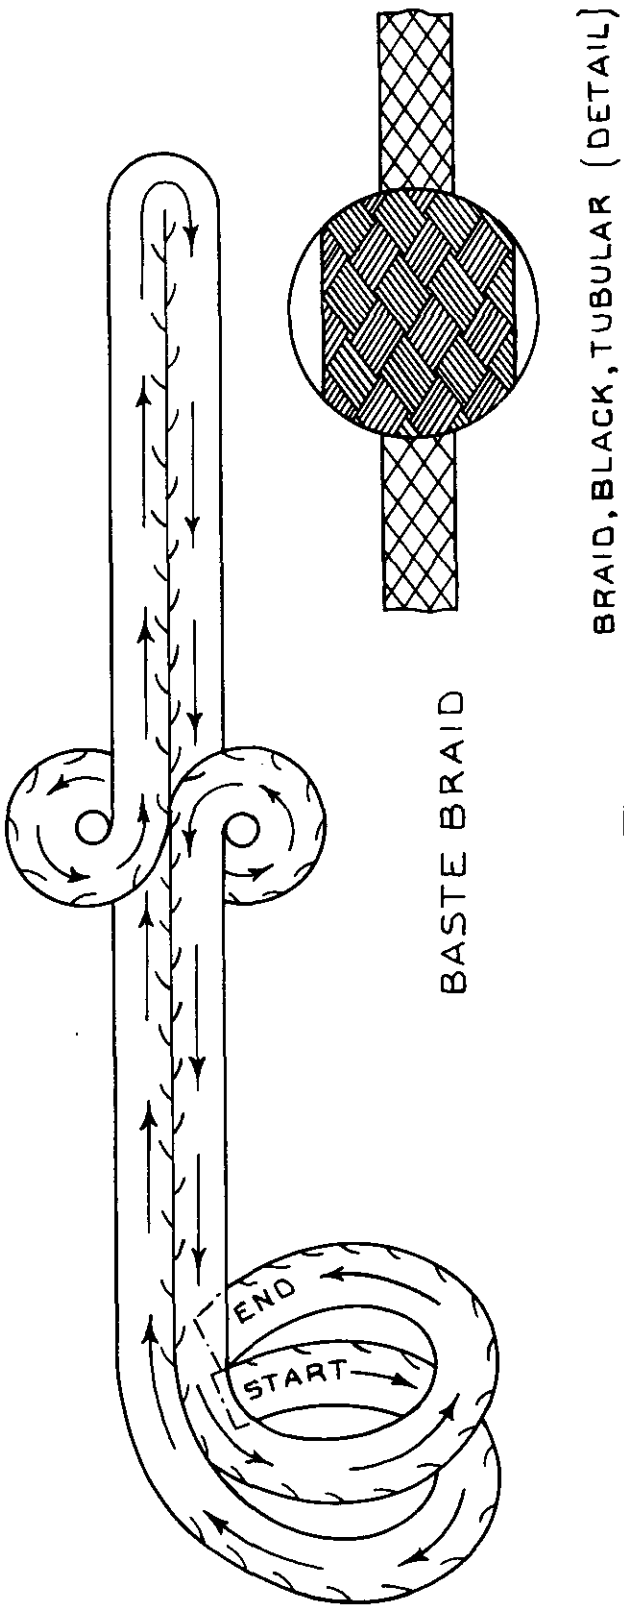

BASTE BRAID

BRAID, BLACK, TUBULAR (DETAIL)

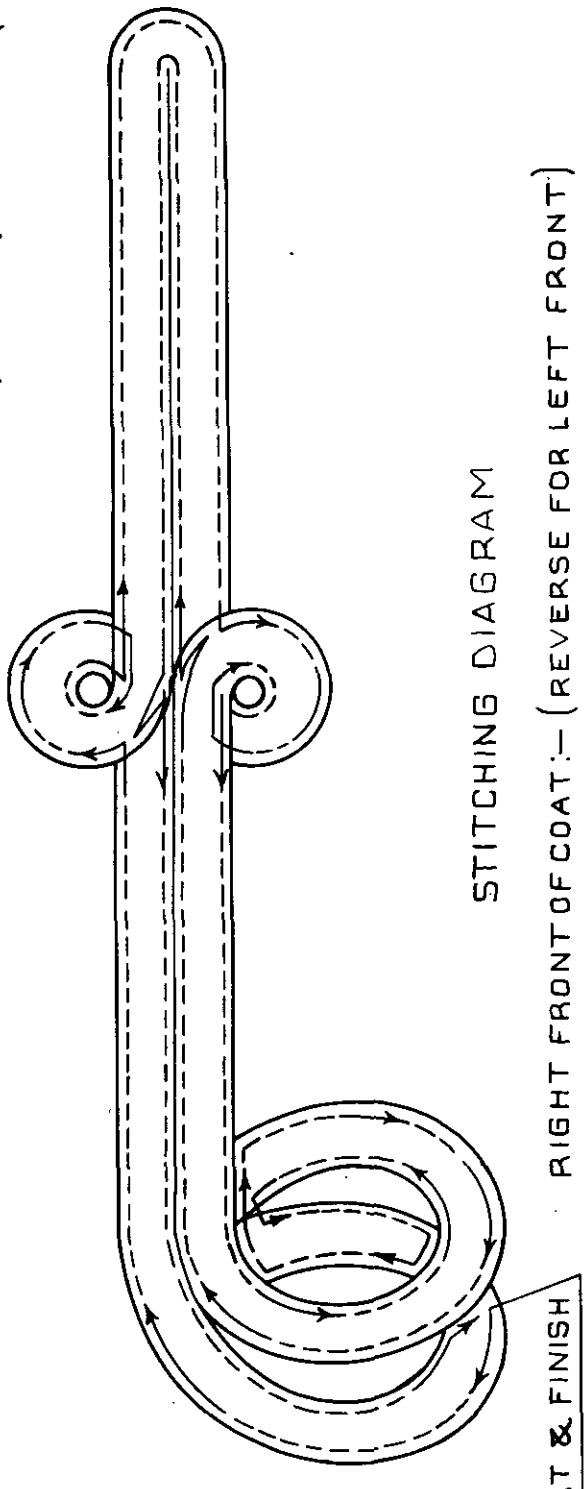


STITCHING DIAGRAM

RIGHT FRONT OF COAT:- (REVERSE FOR LEFT FRONT)

START & FINISH


FIG.6: COAT, WOMAN'S, FULL DRESS, SCARLET U.S. MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:50Z
Check the source to verify that this is the current version before use.

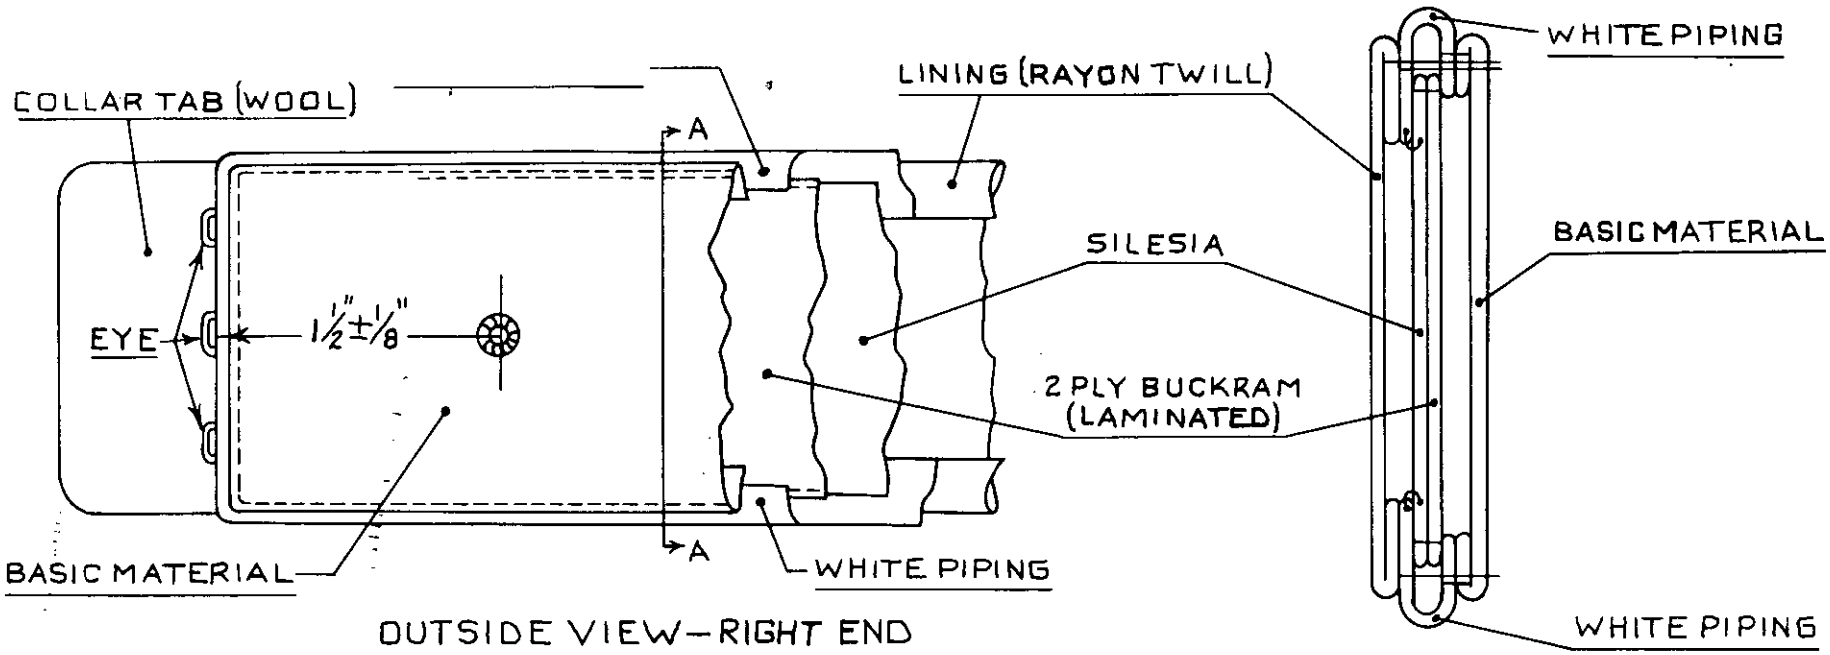

OUTSIDE VIEW—RIGHT END

SECTION A-A

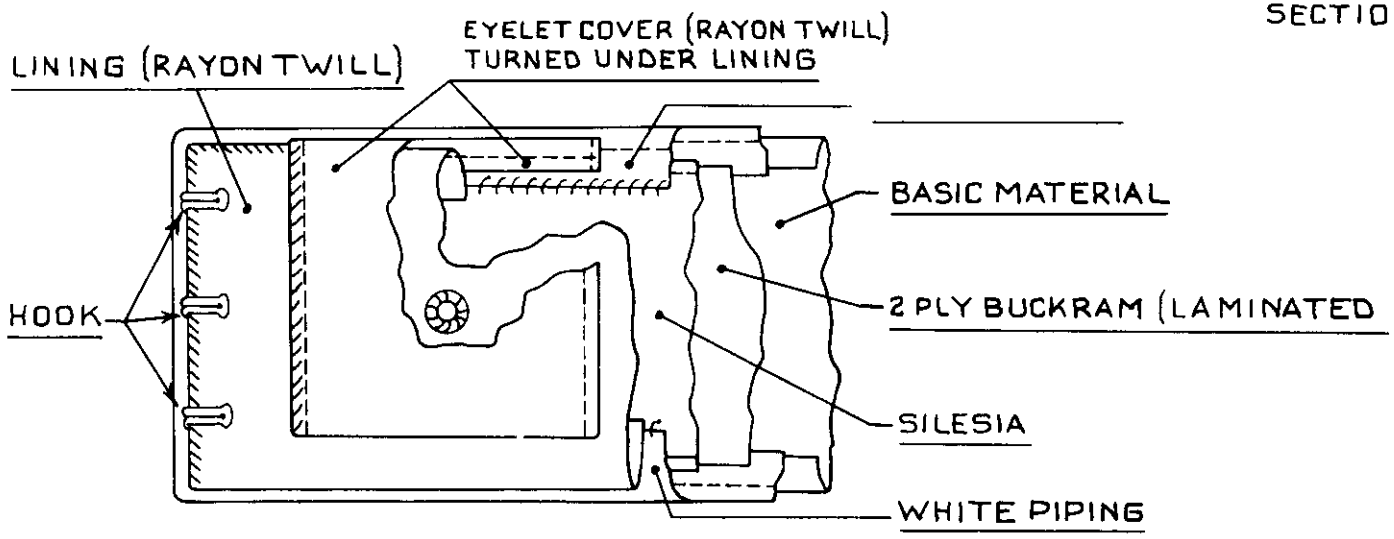

INSIDE VIEW—LEFT END

FIG.7: COAT, WOMAN'S, FULL DRESS, SCARLET U.S. MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:50Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

MIL-C-29393(MC) COAT, WOMEN'S: FULL DRESS SCARLET,U.S. MARINE BAND,MUSICIAN

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

S/N 0102-LF-014-1802

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE NAVY
Headquarters, U.S. Marine Corps
Washington, D.C 20380
OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

POSTAGE AND FEES PAID
DEPARTMENT OF THE NAVY
DOD-317



Commandant of the Marine Corps
Headquarters, U.S. Marine Corps
(Code LMA-1)
Washington, D.C. 20380

FOLD

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:50Z
Check the source to verify that this is the current version before use.