INCH-POUND

MIL-C-29393A(MC)
9 June 1995

SUPERSEDING
MIL-C-29393(MC)
26 November 1980

MILITARY SPECIFICATION

COAT, WOMEN'S: FULL DRESS, SCARLET, U. S. MARINE BAND, MUSICIAN

This specification is approved for use by the U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirements for women's musicians' scarlet wool full dress coats.

1.2 Classification. The coats shall be of one type in the following sizes, as specified (see 6.2).

Schedule of Sizes

Short	Regular	Long
2	2	-
4	4	4
6	6	6
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
-	18	18

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

1.3 Individual orders. When the coat is custom tailored to an individual order, this specification shall govern, except that the detail requirements of section 3, table I, may be modified to the extent necessary for good custom tailoring practices.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation (see 6.2).

SPECIFICATIONS

FEDERAL

A-A-50186	- Cloth, Buckram, Woven and Non-woven
A-A-50196	- Thread, Silk
A-A-50198	- Thread, Gimp, Cotton Buttonhole
A-A-50199	- Thread, Polyester Core, Cotton or Polyester Covered
A-A-52071	- Tape, Textile, Cotton, General Purpose
A-A-52094	- Thread, Cotton
A-A-52106	- Cloth, Twill or Plain Weave, Polyester and Polyester Blend
DDD-L-20	- Label; For Clothing, Equipage and Tentage, (General Use)

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill Rayon
MIL-F-495	- Finish, Chemical,Black, for Copper Alloys
MIL-B-3461	- Buttons, Insignia, Metal, Uniform and Cap
MIL-P-15064	- Pad, Shoulder and Sleeve-Head
MIL-E-20652	- Eyelets, Metallic and Eyelet Washers (General Specification for)
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/Wool
MIL-C-41820	- Cloth, Gabardine, Polyester and Rayon
MIL-C-44296	- Cloth, Fusible
MIL-C-82114	- Coat Front for Coats, Musicians

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the currenversion before use.

STANDARDS

FEDERAL

FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitches, Seams and Stitchings

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129 - Marking for Shipment and Storage

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19120-5094.)

2.2 Non-Government publications. The following document(s) form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation (see 6.2).

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense Standard Shades for Sewing Threads.

(Applications for copies should be addressed to the Color Association of the United States, 409 W. 44th St., New York, NY 10016-0927.)

AMERICAN SOCIETY FOR TESTING AND MATERIALS

ASTM D 3951 - Standard Practice for Commercial Packaging

(Application for copies should be addressed to American Society for Testing and Material, 1916 Race Street, Philadelphia, PA 19103.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 Guide sample. Guide samples are furnished solely for guidance and information to the contractor (see 6.3). Variations from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.3 and 6.4.)

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, wool, tropical, scarlet shade 2502 (see 6.3), 10.5 ounce conforming to type I, class 1 of MIL-C-21115.

3.3.2 Collar and sleeve cuff material. The material for the collar and cuffs shall be cloth, polyester/wool blend, black shade 2607 (see 6.3), conforming to type III, class 1 of MIL-C-21115.

3.3.3 Lining. The material for lining the coats and collar, and for making the collar eyelet covers, front facing, eyelet cover, coat hanger and straps to secure the lining to the bottom edge of coat, shall be cloth, rayon twill, scarlet shade 2506 (see 6.3), conforming to class 1 of MIL-C-368.

3.3.3.1 Bias binding. The binding for underarm shields shall be bias cut out of the lining material specified in 3.3.3. The binding shall be cut 5/8 to 7/8 inches wide and shall have sized edges.

3.3.4 Piping. The material for piping shall be cloth, gabardine, polyester and rayon, white shade 3042 (see 6.3), conforming to type I of MIL-C-41820, cut 5/8 to 3/4 inch wide for piping the lower collar edge and ornamental sleeve cuff and 1 inch wide for piping the front and bottom edges of coat and seams joining the center back to the skirt of the coat.

3.3.4.1 Vinyl piping. The white vinyl cord for piping the upper edge of the collar shall be tubular, with a 7/16 inch wide welt and serrated edges as manufactured by the Thielex Plastics Company, Pearl Binding Company or an equal.

3.3.5 Stays, bindings and interlining. The stays for armhole and shoulder seams, the binding for the neck edge of the coat front, front interlining, interlining stay, and the collar interlining shall be cut from twill or plain weave polyester or polyester blend conforming to A-A-52106.

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

3.3.6 Front interlining. The fusible interlining for the upper and lower fronts shall be a twill weave conforming to type V of MIL-C-44296, in a black or charcoal shade.

3.3.7 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram, double texture, laminated, starch finish, natural color, conforming to type IV of A-A-50186. The weight of the laminated cloth shall be 21 to 23 ounces per square yard.

3.3.7.1 Plastic. The plastic strip used in the collar interlining shall be clear plastic pattern stock 0.20 inches thick. It shall be cut using the cotton buckram pattern.

3.3.8 Reinforcement discs. The reinforcement discs for buttons secured to the back skirt seam, with ring toggle, shall be punched from the cloth, cotton, buckram specified in 3.3.7. The reinforcement discs shall be 7/8 inch in diameter with a 1/8 inch diameter hole at the center.

3.3.9 Coat fronts. The coat fronts shall conform to class 3 of MIL-C-82114.

3.3.10 Shoulder pads. The shoulder pads shall conform to the requirements of type III, class 2, of MIL-P-15064.

3.3.11 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.12 Stay tape. The stay tape for the armholes and waist seam shall be cotton, 1/4 inch wide, conforming to type II, class 1, of A-A-52071, except the requirement for non-fibrous material shall not apply.

3.3.13 Thread.

3.3.13.1 Silk thread. The silk thread shall conform to A-A-50196. The thread for machine sewing shall conform to type I, size A for all outside seaming and stitching; size B and Size F for buttonhole, needle and looper threads, respectively; size O for machine felling. The thread for hand sewing shall be type III, size C, 2-ply.

3.3.13.2 Cotton, thread. The cotton thread shall conform to A-A-52094, type III mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching and overedge stitching and type II glazed finish, ticket No. 24 4-ply for machine tacking armholes. The thread for basting shall be good commercial grade.

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

As an alternate to the cotton thread, a polyester, cotton covered thread conforming to A-A-50199, ticket No. 50, 2 or 3-ply may be used for seaming and ticket No. 70, 2-ply may be used for overedging.

3.3.13.3 Color and colorfastness. All thread shall be scarlet shade W, cable No. 66040, except: the silk thread for stitching collar, cuffs and braid, which shall be black; the cotton thread for basting and machine tacking armhole, which may be white; and the cotton thread for overedge stitching the piping at the bottom edge of coat which shall be white. The colored threads shall show the following colorfastness when tested as specified in the applicable thread specification:

Thread	Color	Wet (dry) Cleaning	Light
Cotton	Scarlet	Good	-
Silk	Scarlet	Fair	Fair
Silk	Black	Good	Good

3.3.14 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be scarlet shade W, cable No. 66040 and shall show good fastness to wet (dry) cleaning.

3.3.15 Ornamental braid. The ornamental braid for the front of the coats shall be mohair, black, tubular, and 3/8 ± 1/16 inches wide, conforming to the following:

Weave	Plain
Weight per gross yards, ounce (minimum)	35
Picks per inch (minimum)	9
Total carriers (minimum)	16
Ends per carriers (minimum)	6
Breaking strength, pounds (minimum)	105
Shrinkage:	
- length, percent (maximum)	2.0
- width, inches	Not less than the original width

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

Weave	Plain
Colorfastness to:	
- wet (dry) cleaning	Good
- light	Good

3.3.16 Buttons.

3.3.16.1 Insignia buttons. The insignia buttons shall be metal, gold plated, 27-line and 40-line conforming to type I, style 3, class A, subclass 1, of MIL-B-3461.

3.3.16.2 Ring toggles. Ring toggles for securing buttons to fronts, back, and sleeves shall conform to MIL-B-3461.

3.3.17 Collar closure hook and eye. The hook and eye for closing the collar shall be brass, black japanned finish or black chemical finish in accordance with MIL-F-495, followed by a clear lacquer coating and conform to the requirements of figure 8. .

3.3.18 Collar eyelets. The eyelets for the collar shall be brass, rolled flange type, with the barrel scored 6 to 8 scores. The eyelets shall conform to MIL-E-20652, sheet 1A-BE108 and be enameled a black shade.

3.3.19 Labels. Each coat shall have a combination instruction/identification label and a size label as detailed in 3.3.19.1 and 3.3.19.2. The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.19.1 Combination instruction/identification label. The combination instruction/identification label shall conform to type VI, classes 1 and 3 (combined), of DDD-L-20 except all printing and the space between the lines of printing shall be minimum 10 point (approximately 1/8 inch). The content and format shall be as follows:

Nomenclature (item description)
_____
Contract No. _____ Date _____
Name of Contractor _____
Wool Products Act Information
_____
DRY CLEAN ONLY

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

3.3.19.2 Size label. The size label shall conform to type VI, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letter S, R, or L, for Short, Regular and Long, as shown by the following example:

14R

3.4 Design. The coat shall be the U. S. Marine Corps design shown on figures 1 through 4, a semi-formfitting, single-breasted, fully-lined coat with 12 gold plated insignia buttons on the left front and 6 gold plated insignia buttons on the right front. It shall have upper fronts with black braid, skirt type lower body parts with waist darts, a waist seam, a three-piece back with 2 gold plated insignia buttons at the waist, ornamental sleeve cuffs with gold plated insignia buttons, a stand up collar with hook and eye for front closure and metal collar eyelets, and cloth loops on each shoulder for attaching epaulets. The side and bottom edges of the collar, the front and bottom edges of coat, the seam joining the skirt to the center back, and the top edge of the ornamental sleeve cuff shall be piped with white cloth. The top edge of the collar shall be piped with white vinyl cord.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard pattern. The standard pattern shall provide 3/4 inch allowance for side seams and for seam joining the skirt to the center back and 3/8 inch allowance for all other seams except as otherwise specified in table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

3.5.1 List of pattern parts. The coats shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

Item	Pattern nomenclature	No. of cut parts
	Material basic: Cloth, wool, tropical	
1.	Center, front, upper	2
2.	Skirt (lower) Front	2
3.	Skirt (lower) Back	2
4.	Side (front)	2
5.	Side back	2
6.	Center back	1
7.	Top sleeve	2

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature	No. of cut parts
	Material basic: Cloth, wool, tropical	
8.	Under sleeve	2
9.	Front facing, right	1
10.	Front facing, left	1
11.	Underarm shield	2
	Material: Cloth, wool/polyester	
12.	Collar, outer ply	1
13.	Sleeve cuff	2
14.	Sleeve cuff eyelet facing (top ply)	2
15.	Sleeve cuff eyelet facing (under ply)	2
	Material: Cloth, rayon lining	
16.	Front, upper	2
17.	Skirt, (lower) Front	2
18.	Skirt, (lower) Back	2
19.	Side back	2
20.	Center back	2
21.	Top sleeve	2
22.	Under sleeve	2
23.	Collar lining	1
24.	Collar eyelet cover	2
25.	Front eyelet cover	1
	Material: Cloth, cotton, buckram	
26.	Collar interlining	1
	Material: Cloth, twill or plain weave polyester or polyester blend	
27.	Collar interlining	1
	Material: Interlining (fusible)	
28.	Center front	2
	Marker	
29.	Side front	2
30.	Skirt, lower	2
31.	Cuff and eyelet marker	-

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

3.6 Construction.

3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in table I. The contractor is not required to follow the exact sequence of the operations as listed in table I, but all operations specified shall be used to manufacture the coats.

3.6.1.1 Stitches, seams, and stitchings. The stitch, seam, and stitching types specified in table I shall conform to FED-STD-751. The number of stitches per inch as specified in table I indicates the minimum and maximum number permitted. All overedge stitching and serging shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.2 Thread breaks and ends of seams. The end of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of each coat cut from one piece of the wool and lining material, including pairs of sleeve linings and underarm shields when not cut from ends, shall be shade marked to insure uniform shade and size throughout the garment. Any method of shade marking may be used except:

a. Corrosive metal fastening devices.
b. Sew-on shade tickets.
c. Adhesive-type tickets which show discoloration and the use of an adhesive mass which adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. Cut coats in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction of the warp as indicated by the directional lines on the pattern. c. Cut all scarlet wool parts of the coat from one piece of the basic material. d. Cut the strapping for the shoulder loops from basic material in the direction of the warp, 2-3/4 inches long, and of sufficient width, so that the finished loops will be 5/8 ± 1/8 inch wide. e. Cut the body and collar linings, collar eyelet covers, and left front facing eyelet cover from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the sleeve lining shall match. Cut the strips for the coat hanger and for the lining securing straps 1-1/8 inches wide. Cut front eyelet cover in accordance with the pattern.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) f. Cut the wool material for the sleeve cuffs, outer ply of collar, and cuff eyelet facings from one piece of the material specified in 3.3.2. g. Cut polyester stays for armhole and shoulder seams on the bias, 3/4 inch wide and 4 ± 1/4 inches long. Cut polyester for collar interlining in accordance with the patterns furnished. Cut the polyester for binding the neck edge of the coat front interlining on the bias, 3/4 inch wide and approximately 5 inches long. h. Cut the cotton buckram for interlining the collar on the straight in accordance with the pattern furnished. i. Cut the piping material (see 3.3.4) for piping the front and bottom edges of the coats, lower edge and end of collar, top edge of ornamental sleeve cuffs, and the seam joining the skirt to the center back on the straight. The piping shall be cut 5/8 to 3/4 inch wide for collar, and ornamental sleeve cuffs; 1 inch wide for the					

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) bottom and front edges of coat, and the seam joining the skirt to the center back. j. Punch the reinforcement discs for buttons secured to the skirt back seam from cloth, cotton, buckram. The reinforcement discs shall have a 1/8 inch diameter hole at the center.					
2	Replacement of damaged parts. a. Replace at time of cutting any part of coat containing holes; seriously weakening defects such as smashes, multiple floats, loose or weakening slubs; shade bars and dye streaks; or unsightly slubs, etc., affecting appearance. b. Replace any part damaged during the manufacturing process by needle chews, which may develop into holes; scissor or knife cuts; tears; holes; mends; or burns in the material, affecting appearance.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
3	Shade marking. a. Mark or ticket all component parts (see 3.6.2) cut from one piece of the basic material. Mark or ticket all component parts cut from one piece of rayon lining material and the pairs of sleeve linings when cut from ends. b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					
4	Make shoulder loops. Finished appearance. The finished loops shall be uniform in width and shall finish 5/8 ± 1/8 inches wide. a. Fold the strap for the loops in half lengthwise and seam together 1/4 inch from raw edges. b. Press the seam open, smooth, and flat with a heated pressing iron. c. Turn the strap right side out, with seam line placed in center on the underside, and press smooth and flat with a heated pressing iron.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
5	Make coat hanger and lining securing straps. Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8 inch wide strip of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	10-14	A	A
	b. Cut the coat hanger 3-3/4 ± 1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ± 1/4 inches long.					
6	Make collar eyelet covers. Finished appearance. The collar eyelet covers shall finish 1-3/4 ± 1/8 inches wide.					
	a. Turn under the side edges of the collar eyelet covers and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1 (each side edge)	10-14	A	A
	b. Fold each cover in half across the width and seam 1/16 inch from the folded side edges.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Make front eyelet cover.					
	a. Fold front eyelet cover in half lengthwise and stitch across the bottom edge with a 1/4 inch seam.	301	SSa-1	10-14	A	A
	b. Turn the cover right side out. Press and crease the folded edge smooth and flat with a heated pressing iron.					
8	Make underarm shields.					
	Finished appearance. The underarm shields shall finish smooth and flat without puckers, pleats, gathers, or other distortions.					
	a. Bind the rounded edge of shield with bias binding, turning under the outside edge of the binding only, and catching 1/16 inch from the folded edge.	301	BSb-1	10-14	A	A
	b. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
9	Make cuffs and eyelet opening.					
	Finished appearance. The cuffs shall be uniform in appearance, shall finish smooth and flat, without twists, gathers, pleats, puckers, or other distortions. The cuffs					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Make cuffs and eyelet opening. (cont'd) shall finish 5 inches high at the point on top sleeve and 3 inches high at the backarm, including piping. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the sleeve cuff. a. The cuffs shall be made of one ply of the material specified in 3.3.2., piped with the material specified in 3.3.4.					
	b. Position one ply of the cuff eyelet facing on the outside of sleeve cuff, face to face, with back edges even and notches matching. Join the two plies together from notch to notch with 3/8 inch seam.	301	LSq-2 (a)	10-14	A	A
	c. Extend the depth of the notches to the seam line. Turn back the facing and top stitch the facing to the cuff 1/16 to 1/8 inch from the raised edge. d. Mark location for 3 eyelets on each cuff for removable buttons.	301	LSq-3 (b)	10-14	A	A
	e. Make a 1/8 inch eyelet on each of the marks through both plies.	Eyelet		22 per eyelet	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Make cuffs and eyelet openings. (cont'd)					
	f. Position the cuff on the facing with back edges even, notches matching, and with the right side faced up. Stitch the ends of the opening through the facing 1/4 inch from back raw edges.	301	SSa-1 (each end)	10-14	A	A
	g. Position the strip of piping material on the outside of sleeve cuff and stitch together 1/8 inch from the upper curved and pointed edge of cuff.	301	BSm-1 (a)	10-14	A (Silk)	A
	h. Turn back the cuff and piping, working the folded edge of the piping 1/8 inch beyond edge of cuff. Top stitch the cuff to the piping 3/16 inch from folded edge of piping.	301	SSa-1	10-14	A (Silk)	A
	i. Press the cuffs smooth and flat with a heated pressing iron or pressing machine.					
10	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge	301	SSbd-1 to SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Seam sleeves at forearm. (cont'd) of the under sleeve and with the notches in the lower forearm edge of top and under sleeve matching. Seam top and under sleeve together 3/8 inch from forearm edge of top sleeve, forming a tapered outlet on the under sleeve. b. Spread open the seam and press flat with a heated pressing iron.					
11	Join cuffs to sleeves. Finished appearance. The cuff shall be uniformly stitched to the sleeve without twists, gathers, puckers or raw edges. In the finished coat (after pressing), the point of the cuff shall be centered between the lower forearm edge and the backarm seam of sleeve. a. Mark the sleeves in accordance with the sleeve cuff marker for positioning of the cuffs, with notch on the cuff marker, matching the forearm seam line and bottom edge of marker in line with the bottom raw edge of sleeve.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
11	Join cuffs to sleeves. (cont'd)					
	b. Position the piped edge of cuff at the mark and stitch cuff to sleeve along the piped edge. The line of stitching shall be adjacent to the stitching of the cuff piped edge.	301	LSa-1	10-14	A (Silk)	A
	c. Lift the cuff up and stitch the bottom edge of sleeves to the eyelet facing 1/4 to 3/8 inch from the bottom raw edge.	301	SSa-1	10-14	A	A
	d. Trim excess facing even with the bottom edge of sleeve.					
12	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without distortions, and shall start and finish evenly.					
	a. Join the top and under sleeves together at the backarm with a 3/8 inch seam, catching the ends of the cuff in the seam, leaving an opening on the cuff between notches.	301	SSa-1	10-14	A (Silk)	A
	b. Spread open the sleeve and cuff seams and press smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 20260410-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Baste and tack cuff to sleeve. (cont'd)					
	a. Turn the bottom of the cuff to the inside against the bottom edge of sleeve in accordance with notches, and baste along the turned edge of the cuff.	301 or Hand				
	b. Tack the raw edge of cuff to the body of sleeves with blindstitching. The blindstitching shall not be exposed on, or caught to, the outside of the cuff.	301	EFe-1 (b)	4-6	A	A
	c. On the finished coat, the height of the cuff, when measured from folded bottom edge of cuff, shall be 3 ± 1/8 inches at the forearm and backarm seams, and 5 ± 1/8 inches at the point.					
14	Seam sleeve lining at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without puckers, twists, gathers, or pleats and shall start and finish evenly.					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the	301	SSbd-1 or SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
14	Seam sleeve lining at forearm. (cont'd) notches in lower forearm edge of top and under sleeve linings matching. Seam the top and under sleeve lining together, 3/8 inch from the forearm edge of topsleeve lining, forming a tapered outlet on the under sleeve lining.					
15	Seam sleeve lining at backarm. Finished appearance. The backarm shall finish smooth and flat, without twists, gathers, puckers, or pleats and shall start and finish evenly. a. Join the top and under sleeve linings at the backarm with a 3/8 inch seam.	301	SSa-1	10-14	A	A
16	Assemble sleeve and sleeve lining. Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers, or pleats. a. Position the sleeve lining on the sleeve with upper edge of the lining extending approximately 1 inch beyond the armhole edge of the sleeve.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
16	Assemble sleeve and sleeve lining. (cont'd)					
	b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the sleeve, commencing at the top edge of the cuff and extending to approximately 6 inches from the armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand		4-6 1-2	A	A
	c. Turn sleeve lining over the sleeve.					
17	Fell sleeve lining turnup/press sleeves.					
	Finished appearance. The sleeve lining shall not be short, tight, or twisted at bottom of sleeves.					
	a. Turn under the bottom edge of the sleeve lining to finish 1 to 1-1/4 inches above the finished end of sleeve, and baste to turnup of cuff; or the sleeve lining may be felled to bottom sleeve without basting.	101 or Hand				
	b. Fell the folded edge of sleeve lining to the turnup of the cuff with blindstitching.	Hand or 301	EFc-1 (b)	8-10 6-8	C (Silk) C (Silk)	O
	c. Turn sleeves right side out and assemble in					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
17	Fell sleeve lining turnup/press sleeves. (cont'd) pairs. Insert a sleeve pad in the sleeve to avoid creasing the front and back edges and press smooth and flat with a heated pressing machine.					
18	Assemble collar interlining. a. The collar interlining assembly shall consist of one ply of buckram and one ply of polyester twill or plain weave cloth.					
	b. Position the polyester twill cloth and buckram interlinings for the collar with all edges even, and seam together 1/8 to 3/16 inch from the edges.	301	SSa-1 (each edge)	10-14	A	A
19	Pipe outer ply of collar. Finished appearance. The piping shall extend at the lower and side edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers, or pleats. a. The outer ply of the collar shall be made of one ply of material specified in 3.3.2, piped with material specified in 3.3.4.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
19	Pipe outer ply of collar. (cont'd)					
	b. Seam a 5/8 to 3/4 inch wide strip of piping to outer ply 1/8 inch from sides and lower edge.	301	SSaa-1	10-14	A (Silk)	A
	c. Turn back the piping and outer ply, uniformly working the folded edge of the piping beyond the edges. Topstitch the outer ply uniformly 3/16 inch from the folded edge of piping.	301	SSa-1	10-14	A (Silk)	A
20	Assemble collar and make collar extension tab.					
	Finished appearance. The collar shall be assembled without twists, gathers, puckers, or pleats.					
	a. Position the interlining assembly on the inside of the outer ply under the unattached edge of piping. Tack all the raw edges of piping to the polyester twill interlining, making the outer ply form a smooth and snug fit.	Hand		2-3	C (Silk)	
	b. Fold the upper raw edge of the outer collar over the interlining and tack to the polyester twill cloth.	Hand		2-3	C (Silk)	
	c. Press the collar smooth and flat with a heated pressing iron or					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Assemble collar and make collar extension tab. (cont'd)					
	pressing machine.					
	d. Position the collar on the vinyl cord, with the upper edge of the collar abutted against the cord edge. Stitch collar to the vinyl cord 1/16 inch from edge of collar. Trim the ends of the cord even with the ends of the collar.	301	LSa-1	10-14	A (Silk)	A
	e. Position an eyelet cover on the underside at each end of the collar, with one edge of the cover 3/4 to 7/8 inch from the front end, and the bottom raw edge of the eyelet cover 1/2 to 5/8 inch from the upper cord edge. Stitch collar to cover along the cord edge adjacent to the stitching line of the collar.	301	LSa-1	10-14	A (Silk)	A
	f. Lap the upper cord edge of collar over the top raw edge of collar lining approximately 1/2 inch with lining face up. Stitch collar to the lining and eyelet cover along the cord edge adjacent to the stitching line of the collar. The stitching shall extend from center to center of the eyelet covers. The collar lining shall extend	301	SSa-1	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Assemble collar and make collar extension tab. (cont'd) approximately 1/2 inch beyond the right end of the collar and approximately 2-1/2 inches beyond the left end of the collar for the lining extension tab. g. Turn collar lining and eyelet cover at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine. h. Attach metal eyelets through all plies of the collar at each end midway between the upper and lower edges and 1-1/2 inches from the finished ends. The eyelet covers will not be caught in the eyelets.					
	i. Turn back the left end of the collar lining 1-1/2 inches, face to face, and stitch along the top and bottom edges from the fold to the back raw edge of lining, forming the collar lining extension tab. Turn end of collar lining to face side of lining, forcing out the corners. Stitch collar lining extension tab 1/16 inch from top, front and bottom edges and continue the stitching at the back of	301	SSc-1 (top and bottom edges) OSf-1 (front edge) SSa-1 (back edge)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Assemble collar and make collar extension tab. (cont'd) tab to top row forming approximately a 1 x 1-3/8 inch box stitch.					
21	Assemble body lining. Finished appearance. All darts and joining seams shall finish smooth and flat without gathers, pleats, or puckers. The seams shall start and finish evenly. a. The body lining shall consist of an upper front, a side back panel, a center back panel, and a front and back lower skirt.					
	b. Fold the upper front lining lengthwise with notches matching, and stitch front darts in accordance with marks as indicated on the patterns. The line of stitching for the waist darts shall be 3/8 inch from the folded edge of the dart at the waist tapering to a flat point at the top end, and securely backtacked.	301	OSf-1	10-14	A	A
	c. Position the side back panel and fronts with edges even and with notches matching. Seam together at the side seam with 3/4 inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
21	Assemble body lining. (cont'd)					
	d. Position center back to the respective side backs with edges even and notches matching. Join together with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	e. Overedge stitch separately the side seam and side back seam. The overedge stitching shall be securely caught in the fabric.	503 or 504	EFd-1	6-10	70/2	70/2
22	Join upper body lining assembly to skirt.					
	a. Position the lower front and lower back skirt panels together at side seams and join with a 3/4 inch seam. This seam to be pressed open and overedge stitched separately.					
	b. Position the upper assembly to the skirt (face to face), with all edges even and join together at the waist with a 3/8 inch seam. The seam allowance for the waist darts, side and side back seams shall face toward the back.	301	SSa-1	10-14	A	A
	c. Overedge stitch the entire waist seam allowance separately with all the joining seams caught in the stitching.	503 or 504	EFd-1	6-10	70/2	70/2

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22	Join upper body lining assembly to skirt. (cont'd) d. Press all seams and darts smooth and flat. The waist seam shall be pressed toward the bottom and the remaining seams and darts towards the back.					
23	Join front eyelet cover to left front facing. a. Position front eyelet cover on the outside of the left front facing with the front and upper raw edges of cover and facing even. Stitch cover to facing 1/4 inch from raw edges.	301	SSa-1	10-14	A	A
24	Seam wool facing to lining assembly. Finished appearance. The lining shall be carefully aligned and seamed to the facing so that in the finished coat, the lining shall lie smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion. a. Position the lining on the wool facing with the top edges even and notches matching.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the currenversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24	Seam wool facing to lining assembly. (cont'd)					
	b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from the top edge of the facing to approximately 1-1/4 inches from the bottom edge of facing.	301	SSa-1	10-14	A	A
25	Serge or overedge stitch facing-lining assembly.					
	Finished appearance. The overedge stitching shall be securely caught in the fabric.					
	a. Overedge stitch together the facing-lining seam allowance. The overedge stitching shall be securely caught in the fabric.	503 or 504	EFd-1	6-10	70/2	70/2
26	Sew on identification label.					
	Finished appearance. The identification/instruction label shall be positioned so that in the finished coat, the label shall be midway between front and back edge of the left facing, with the bottom edge of label approximately 4 inches from the bottom finished edge of coat.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
26	Sew on identification label. (cont'd)					
	a. Sew the identification/instruction label to the outside of the left facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge)	10-14	A	A
27	Make outer assembly.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					
	a. The assembly shall consist of upper front, side front, side back, center back and front and back lower skirt.					
	b. Position the upper front, side front, and skirt interlining on the inside of their respective front, side front and skirt, and fuse (see 3.3.6).					
	c. Fold the side fronts lengthwise with notches matching. Stitch the entire length of the dart 3/8 inch from the lower end and tapering to a point at the upper end.	301	OSf-1	10-14	A	A
	d. Position the upper front and side front panel with edges even, and join	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
27	Make outer assembly. (cont'd) together with a 3/8 inch seam.					
	e. Position the side back and side front panel with edges even and notches matching. Seam together at the side with 3/4 inch seam.	301	SSa-1	10-14	A	A
	f. Spread open the front and side seams and press smooth and flat with a heated pressing iron.					
	g. Press the waist dart flat on the dart seam without turning the dart either to the right or left.					
	h. Overedge stitch the raw edge of each seam allowance.	503 or 504	EFd-1	6-12	A	A
	i. Join the lower front and lower back skirt parts at the sides with a 3/4 inch seam.					
	j. Press the seam open and overedge stitch the raw edges of the seam separately.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the currenversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
27	Make outer assembly. (cont'd)					
	k. Position the upper assemblies and the skirt face to face with fronts and edges even, and with the back edge of the skirt extended 3/8 inch beyond the back edge of the side back panel as indicated by the notch on the skirt. Join together at the waist with a 3/8 inch seam and with the 1/4 inch wide stay tape positioned on the upper assembly, 1/4 inch from the upper edge and caught in the stitching.	301	SSa-1	10-14	A	A
	l. The tape shall be sewn with the normal tension, not loose or tight, and shall extend from the side back seam to not more than 3-1/2 inches from the front edge of the fronts. Spread open the waist seam and press flat with a heated pressing iron.					
	m. Overedge stitch the raw edge of each seam allowance, the back edge of the skirt, the back edge of the side back panel, and both sides of the center back.	503 or 504	EFd-1	6-12	A	A
28	Pipe skirt.					
	Finished appearance. The finished piping shall be of uniform width, without					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28	Pipe skirt. (cont'd)					
	twists, puckers, pleats, or distortion. Piping shall extend along the back edge of the skirt.					
	a. Fold 1 inch piping in half lengthwise. Seam piping 1/8 inch from the folded edge.	301 or 401	OSf-1	10-14	A	A
	b. Serge or overedge stitch the raw edges of the piping together.	503 or 504	EFd-1	6-10 6-10	70/2 70/2	70/2 0/2
	c. Mark along back edge of skirt for the positioning of the piping. The mark line shall be 7/8 inch from the back edge and shall extend from the top to bottom of the skirt.					
	d. Position the folded edge of piping on the mark line, and stitch piping to skirt 3/16 to 1/4 from the folded edge of piping. Piping shall finish with a minimum 1/2 inch excess at the top end to give a neat finish. In the finished coat, the folded edge of piping shall extend 1/8 inch beyond the seam.	301	OSf-1	10-14	A	A
29	Join center back to side back and skirt.					
	Finished appearance. The backpart seams shall start and finish evenly and shall be smooth without					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
29	Join center back to side back and skirt. (cont'd) gathers, puckers, or pleats. a. Position and join the left and right assemblies to the center backpart with a 3/8 inch seam down to the waistseam and with a 3/4 inch seam from the waistseam to the bottom of coat. b. Spread open the side back seam from armholes to the waistseam, and press smooth and flat. Press skirt back seams from waistseam to bottom of coat smooth and flat with edge of each seam toward the center back. Pressing shall be done with a heated pressing iron or pressing machine.	301	SSa-1 (above waist-seam) LSaj-1 (below waist-seam)	10-14	A	A
30	Seam reinforcement stay to shoulder and armhole. Finished appearance. The reinforcement stays shall be sewn to the armhole and shoulder edge of the front without gathers, puckers, or pleats. The top end of the armhole stay and lower end of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
30	Seam reinforcement stay to shoulder and armhole. (cont'd) a. Seam the 3/4 inch wide stays to the underside of the front along the shoulder edges and upper front edge of the armhole respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from neck and armholes respectively. The strip for the upper edge of armholes shall be positioned approximately 1/2 inch from the shoulder.	301	SSaa-1	10-14	A	A
31	Mark and dress right front. a. Mark and dress the right front edge of coat, from the top notch to the waist seam. The mark line shall be 1 inch from the upper front edge to 1-1/8 inches at the waist seam. Continue on the straight line, from the waist seam to the notch at the bottom of the skirt. NOTE: The dressing and shaping of the right front shall be performed in the sewing room.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
32	Tape armholes.					
	a. Sew the cotton tape to the armhole starting with one end approximately 1 inch above the notch in the fronts and continuing along the lower and back edge of the armhole to approximately 1/2 inch from shoulder edge.	301	SSaa-1	10-14	A	A
	b. The tape shall be stitched with slight tension along the lower front edges of the armholes and shall be held taut while stitching along the back edge.					
33	Press shoulder blades and armhole tapes.					
	a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or suitable type pressing machine.					
34	Stitch piping to coat.					
	Finished appearance. The piping shall be uniformly stitched to the coat without twists, puckers, or pleats. The piping shall extend from the collar notch at top edge of the right front to the collar notch at top edge of the left front.					
	a. Position the 1-1/4 inch wide strip of piping	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34	Stitch piping to coat. (cont'd) material on the outside of left and right front, with one edge even with top, front and bottom edges of coat. Stitch piping to coat 1/8 inch from edge. The piping shall extend from the collar notch at the top, along the left and right front and the bottom edge of the coat.					
	b. Turn the piping to the inside working out the folded edge of piping 1/8 inch beyond edges of coat. Topstitch coat to the piping 3/16 inch from the folded edge of piping, catching the turned under portion of the piping in the stitching.	301	SSe-2 (b)	10-14	A (Silk)	A
	c. Notch out the excess piping material at the top and bottom front corners to eliminate bulkiness. Trim the inner edge of piping on the right front only from the upper front down to approximately 1 to 1-1/2 inches below the waistseam, so that the piping will not interfere with front buttonholes.					
	d. Overedge stitch the raw edge of the piping at the bottom edge of coat.	503 or 504	EFd-1	6-12	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste the front to the interlining from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches up from the bottom edge of the front.	301 or Hand	Hopper			
	b. Baste along the shoulder, allowing room for setting the shoulder pad, working the fullness toward the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulders to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of fronts.	301 or Hand	Hopper			
36	Trim coat front interlining.					
	a. Trim the top edge of coat interlining even with the top edge of fronts from the point of shoulder					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36	Trim coat front interlining. (cont'd) to the collar notch. b. Notch the top edge of the interlining in line with the collar notch. c. Remove stitches joining front edge of polyester and cotton to coat front interlining, approximately 1/2 inch back from front and top edge of fronts. d. Turn the coat inside out and trim the interlining only approximately 1/4 inch back from the front and top edge of fronts. e. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					
37	Bind front edge and gorge of interlining. a. Fold polyester and cotton back and over the top and front raw edge of the interlining. Stitch along the top and front edge with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front	301	EFa-3	8-10	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
37	Bind front edge and gorge of interlining. (cont'd) edge and catching the turned-under portion in the stitching.					
38	Bind top neck of interlining. Finished appearance. The polyester and cotton binding shall be uniformly stitched along the gorge of the coat front interlining from the collar notch to the shoulder point.					
	a. Lap the 3/4 inch wide strip of binding on the outside of the coat front interlining from the collar notch to shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	8-10	A	A
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39	Fell piping to coat front interlining.					
	a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	101				
	b. Fell the upper front and lower edge of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A (Silk) A	C
	c. Pull and remove basting stitches from piping.					
	d. Press the left and right fronts, respectively, on a suitable type heated pressing machine, with the chest to conform to the shape of the body.					
40	Mark fronts for positioning the braid and buttonholes (see Figure 5).					
	a. Mark the location of six buttonholes on the outside of the right front, as shown on Figure 5. The top buttonhole (line A) shall be positioned 1 inch below the upper piped edge and 5/8 inch from the front piped edge. The lower buttonhole (line B) shall be on the waist seam line					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40	Mark fronts for positioning the braid and buttonholes (see Figure 5). (cont'd) and 5/8 inch from front piped edge. The remaining four buttonhole marks shall be evenly spaced. b. Extend each buttonhole line towards the back and armhole edge. (Line B shall be 1 inch shorter than line A). The length of the top and bottom line is determined by the position of the harp on the second line from the top which shall be approximately 1-7/8 inches from the armhole edge to the center of the harp. The second line from the top shall be measured from the front edge of the buttonhole line to the center of the harp. Transfer this measurement to the bottom line less 1 inch. Draw a straight line from the bottom line mark through center of the harp up to the top line, establishing line A-C and B-D as shown on Figure 5. c. Bisect the top line A-C and bottom line B-D and connect the bisecting points with a straight line E-F. d. Position right front of coat on left front,					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40	Mark fronts for positioning the braid and buttonholes (see Figure 5). (cont'd) collar notches even, the right front edge 1 inch back of the left front edge at collar notch, and waist seam and armhole edge even. e. Trace the six lines on the left front to coincide with the lines on the right front; the lines on the left front shall extend approximately 2 to 2-1/4 inches from the front piped edge. The vertical lines on the left front shall be identical to lines C-D-E-F on the right front. f. Draw a circle 7/8 ± 1/32 inch in diameter on each side of the six horizontal lines, centered to bisect line E-F and with the edge of each circle touching the horizontal line forming a figure 8 design as shown on Figure 5. g. Position the center of the harp pattern at the line C-D, with the upper edge of the pattern positioned at the bottom side of each horizontal line. Mark the harp in accordance with the pattern marker. The					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40	Mark fronts for positioning the braid and buttonholes (see Figure 5). (cont'd) bottom edge of the harp must be not less than 1/2 inch from the line beneath.					
41	Baste braid (see Figure 6).					
	a. Baste braid by hand along each side of the horizontal line and around the circle figure 8 design and around the harp. The braid shall begin and end at the harp with both ends of the braid secured and tacked under the horizontal braid. On the right front the braid shall be basted around the buttonhole line with the outer edge of the braid 1/4 to 3/8 inch from the piped front edge.	Hand		6-8	C (Silk) Black	
	b. Begin with cut end of braid even with straight line at top of harp. Baste the braid along its forward edge down the center of harp to the forward edge of harp center. Continue up the backarm along the back edge of harp to the straight line at top using the same edge of the braid.	Hand		2-6	C (Silk) Black	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Baste braid (see Figure 6). (cont'd)					
	c. Baste the bottom edge of braid along the straight line to the circle, follow circle back to straight line and continue to end of straight line.	Hand		2-6	C (Silk) Black	
	d. Repeat steps 40.a, b, c, d, e and f on each, marking on fronts.					
42	Tack braid.					
	a. Securely tack all unattached edges of braid to provide a smooth, secure and flat surface of stitching.	Hand		2-6	C (Silk) Black	
	b. Tack inside edges of braid circles to coat, forming an inner hole approximately 1/4 inch in diameter.	Hand		2-6	C (Silk) Black	
	c. Tack loops at button edge of coat together to the coat to finish secure and flat.	Hand		2-6	C (Silk) Black	
43	Stitch braid (see Figure 6).					
	Finished appearance. All stitching shall be done 1/16 inch from all edges whenever possible. All stitching shall be uniform. All stitching shall be performed with one continuous thread					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
43	Stitch braid (see Figure 6). (cont'd)					
	whenever possible. Stitching across braid strands shall be done only as prescribed or when absolutely necessary. All edges of the braid shall be securely attached to the coat at all points. The braid and the stitching shall present a smooth, neat, uniform appearance. The braid on the right front only shall be unstitched for approximately 3 inches from front end of the buttonhole loop braid.					
	a. Stitch braid through fronts and interlining on both sides of the braid 1/16 inch from edge. The line of stitching shall start and finish at the harp as shown on Figure 6.	301	SSav-2	10-14	A (Silk)	A
	b. Braid may be stitched without basting, provided the requirements previously mentioned are maintained.	301	SSav-2	10-14	A (Silk)	A
	c. Hand stitch the inner edges of horizontal braid together on both fronts from harp ends to end of buttonhole opening on right front and from harp ends to front end of braid on left front.	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
44	Join facing to fronts.					
	a. Position the left and right fronts to the respective front facing (face to face), with the waistline notch of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark the facing along the top, front and bottom edges of coat.					
	b. Lap the front edge of the right and left fronts, respectively on the outside of the facing at the marks and join the fronts to facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to bottom edge of coat front edge only.	301	LSa-1	10-14	A	A
	c. Trim excess facing material where necessary.					
45	Baste front edges.					
	a. Turn the facing-lining assemblies to the inside of fronts, completely working out the corners.					
	b. Baste along the front edge of left and right fronts, working the facing back from the folded edge of piping.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
46	Baste facing (second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 301	Hopper			
	b. Turn under and baste the top edge of the facing even with the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	Hand or 301	Hopper			
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of facings to approximately 1-1/4 inches from the lower edge of facing.	Hand or 301	Hopper			
	d. Turn under the bottom edge of facing at the mark and baste along the folded edge.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
47	Tack facing to interlining.					
	a. Tack the right and left facing-lining seam allowance to the respective coat front interlining from approximately 2-1/2 inches from bottom edge of coat to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6		
48	Baste front linings to coat.					
	a. Fold the front lining in accordance with the notches forming the chest pleat, and baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
	b. Baste the front lining to the coat, starting at the lower end of the chest pleat, continuing along lower edge of armhole approximately 2 inches from the edge and ending at the side seam. Match side seams of coat and lining and continue basting as close as possible to the side seam and then across the bottom towards the front approximately 4 inches from piped bottom edge of coat.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
49	Join lining at center back. Finished appearance. The lining shall be carefully joined at center back without gathers, puckers or pleats. The seam shall start and finish evenly. The folded edge of the center pleat, on the outside of the lining, shall be towards the right side. The center back seam of the lining shall be between the fold.					
	a. Position the back parts of lining and join together at the center with a 3/8 inch seam from top to bottom.	301	SSa-1	10-14	A	A
	b. Overedge stitch entire back seam allowance together.	503 or 504	EFd-1	6-12	A	A
50	Baste back lining to coat.					
	a. Fold the back lining, forming approximately a 1 inch wide pleat at the center back. Baste the back lining to the coat along the center pleat from the top end to approximately 4 inches from the bottom finished edge of coat.	Hand or 301	Hopper			
	b. Baste back lining to coat starting at side seam and continuing approximately 3 inches from the armhole and	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
50	Baste back lining to coat. (cont'd) shoulder edges.					
51	Hem bottom edge of lining. Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, or pleats. The hem shall be 3/4 ± 1/8 inch wide. The lining securing straps shall be positioned on the back in line with back seam of coat.					
	a. Hem the bottom edge of body lining with the raw edge turned under and with one end of the securing straps positioned and caught in the stitching 1/16 inch from the upper folded edge of hem.	301	EFb-1	10-14	A	A
52	Tack the lining securing straps to bottom of coat. Finished appearance. The lining securing straps when tacked to the bottom edge of coat shall not cause twists or other distortions to either the coat or the lining. The end of the securing straps shall finish between the piping at bottom edge of coat and the skirt seam allowance. In the finished coat, the lining shall not be visible below					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
52	Tack the lining securing straps to bottom of coat. (cont'd)					
	the bottom edge of coat.					
	a. Position and securely tack the free end of the securing straps to the piping at the bottom edge of coat through the skirt seam allowance.	301	SSa-1	10-14	A	A
	b. Position the bottom edge of the lining so that in the finished coat, the lining shall not be visible below the bottom of coat. Fold the lining securing straps across the width and stitch approximately 1/4 inch from the folded end in order to hold the lining in position.	301	OSf-1	10-14	A	A
53	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the back lining even with the neck.					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
54	Make buttonholes. Finished appearance. The buttonholes shall be clean cut, well made, well worked over gimp to fit 40-line insignia buttons. The gimp and thread shall be pulled through to the outside of the front. The purling of the buttonholes shall be on the facing side. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of coat. The buttonholes shall be cut first type. a. Remove the basting on the unstitched portion of the braid.					
	b. Make a horizontal eyelet-end square bar type buttonhole cut 1-1/4 inches long at each of the marks.	Buttonhole		60 per button-hole	B (Silk)	F
	c. Securely bartack the end of each buttonhole, catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bartack		21 per bartack	A (Silk)	A
	d. Rebaste the unstitched portion of the braid around the buttonholes and complete that portion of the stitching through all plies (see Figure 6).					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
55	Make eyelets in fronts. Finished appearance. The eyelets shall be worked with the purling on the outside of the coat, and shall finish with a 1/8 inch diameter opening. All stitches shall be securely caught in the fabric. a. Mark the left front for the location of six eyelets for removable insignia buttons to align with the buttonhole on the right front. The mark for the top eyelet shall be in line with the left end of collar and the remaining eyelets shall be in vertical alignment with the top mark. b. Mark location for eyelets on the right and left front for removable buttons. The mark for the eyelet shall be between the braid strands at the top end of each harp. c. Make an eyelet at each of the marks through all plies. The eyelet cover on the right front shall not be caught in the stitching.	Eyelet		22 per eyelet	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
56	Make button openings in back. Cut a 1/4 inch vertical opening at the intersection of the side and waist seams on the back. The ends of the openings shall be hand or machined tacked.					
57	Press front of coat. Finished appearance. Fronts shall finish smooth and flat without distortion, with all edges uniformly worked out. a. Press the front of coat and braid smooth and flat with a suitable pressing machine, removing the fullness.					
58	Baste shoulder pad to coat. a. Insert shoulder pads between interlining and chest padding of coat fronts. Securely tack the pad to the interlining and chest padding only.	Hand or 301	Hopper			
59	Seam shoulders. Finished appearance. The shoulder seam shall finish without a distorted appearance. a. Join the back to the fronts at the shoulders with a 3/8-inch seam,	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
59	Seam shoulders. (cont'd) working in the fullness on the back in accordance with good manufacturing practice. b. Spread open the shoulder seam and press flat, holding the shoulders short, and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
60	Set shoulder loops. Finished appearance. The shoulder loops shall be securely stitched without causing distortion to the shoulder and shall be positioned as follows: one loop on each shoulder 5/8 to 3/4 inch from the raw edge of armhole; one loop on each shoulder 4 to 4-1/4 inches from the raw edge of armhole; and the front end of each loop shall be 5/8 to 3/4 inch in front of the shoulder seam line. The loop shall finish 1 ± 1/8 inch long from folded edge to folded edge.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
60	Set shoulder loops. (cont'd)					
	a. Position one end of each loop on the front 1/2 to 5/8 inch from the shoulder seam line. Stitch loop to the coat only 1/8 inch from the raw end of the loop.	301	SSa-1	10-14	A	A
	b. Fold loop back, turn under the back end of the loop and stitch the loop to the coat only 1/8 inch from the turned edge, catching the turned under portion in the stitching.	301	EFb-1	10-14	A (Silk)	A
61	Baste shoulder.					
	a. Position the front lining and coat front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn the coat on the inside.	Hand or 301	Hopper			
62	Baste back lining and facing-lining assembly at shoulders.					
	a. Turn under and lap the shoulder edge of the back lining on the facing-lining assembly. Baste lining along the folded	Hand				

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
62	Baste back lining and facing-lining assembly at shoulders. (cont'd) edge of the back lining with the top end of the chest pleat caught in the basting.					
63	Seam neckline with size label and coat hanger. Finished appearance. The neckline shall finish smooth and flat, without twists, pleats, or puckers. The size label shall be positioned between the ends of the coat hanger and the ends of the coat hanger shall be positioned so that in the finished coat, the hanger opening shall be 2 ± 1/8 inches long when measured along the lower edge of collar lining.					
	a. Join facings and back lining to coat at the neckline from collar notch to collar notch, with a 1/4 inch seam and with the upper edge of the size label and the ends of the hanger positioned and caught in the stitching at the inside center back.	301	SSa-1	10-14	A	A
	b. Press the neckline of the coat smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
64	Set collar with lining. Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar. a. Mark the neckline on the outside 3/8 inch from collar notch up to the shoulder seam and gradually to within 1-1/4 to 1-3/8 inches at the center back for position of collar. b. Position the collar with the lower edge lapped on the outside top edges of the coat at the mark. c. Seam the collar from end to end, to the coat, as close as possible to, but not on top of, the stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining.	301	LSa-1	10-14	A (Silk)	A
65	Set sleeves. Finished appearance. The armhole-sleeve seam shall finish without twists, gathers, pleats or puckers. a. Position sleeves on outside of coat at the armholes, with the back notch matching the side back seam, and with notch in top sleeve and front					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
65	Set sleeves. (cont'd)					
	matching.					
	b. Join the sleeve to the coat with a 3/8 inch seam, distributing the fullness in accordance with good manufacturing practice.	301	SSa-1	10-14	A	A
	c. Press the entire armhole smooth and flat with a heated pressing iron to remove fullness, exercising care not to stretch the armhole.					
66	Baste armhole.					
	a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing fullness evenly. Turn coat on the outside.	Hand or 301	Hopper			
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of sleeves to the front notch of coat.	Hand or 301	Hopper			
67	Set underarm shields to coat.					
	a. Position the underarm shield on the lining side of coat with the raw edges even with lower edge of armhole.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
67	Set underarm shields to coat. (cont'd)					
	b. Baste the underarm shields to the coat along the vertical center and top, side, and bottom edges.	Hand or 301	Hopper			
68	Stitch sleeve head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					
	a. Position the sleeve head pad on the sleeve with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam, and the one end of the pad matching the notch in the front.					
	b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole-sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.	301	SSa-1	4-6	24/4	24/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
68	Stitch sleeve head pads and linings at armhole. (cont'd) c. The underarm shield may be basted to the armhole prior to stitching.					
69	Fell back lining and facing-lining assembly at shoulders. a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (Silk)	
70	Fell sleeve lining at armhole. a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve and sleeve lining matching.					
	b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
70	Fell sleeve lining at armhole. (cont'd) the fullness in accordance with good commercial practice. Backstitch the lower armhole edge from backarm seam of sleeve to the front edge of the shield. - or - c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam, and hand fell the remaining portion as specified in operations 68a. above. - or - d. Machine stitch the lower edge of the sleeve lining, at the armhole on the inside from forearm seam to backarm seam, and stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling. NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.	301 Machine	SSa-1	10-14 8-10	A C (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
71	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of the coat, starting at the bottom edge of the lining and continuing along of the lining and continuing along the back and bottom edges of facing to the front edge of coat.	Hand		8-10	C (Silk)	
	b. Fell the folded edge of the facings to the piping along the top edge from collar to notch to front edge of coat.	Hand		8-10	C (Silk)	
	c. Fell the eyelet cover to the right front facing along the bottom edge of cover.	Hand		8-10	C (Silk)	
	d. Tack the eyelet cover to the right front facing along the folded edge of lining. Place one tack midway between the second and third eyelet from the top, and one tack midway between the fourth and fifth eyelet from the top.	Hand		4-6 per tack	C (Silk)	
72	Sew hook and eye to collar (see Figure 8).					
	Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at the front of the collar without misalignment.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
72	Sew hook and eye to collar (see Figure 8). (cont'd)					
	a. Position and securely sew the hook to the right end and the eye to the left end of the collar. The hook and eye shall be positioned with their front edges even with the respective front ends of the collar and securely sewn to the collar at the top and bottom edge of the hook and eye. The stitching on each side shall not be more than 3/8 inch from the front end of the collar, through the individual holes at the rear of the hook and eye.	Hand		16 per hook and eye	C (Silk) (double thread)	
73	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (Silk)	
	b. Turn under the end and top edge of the lining at the right and left end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge of the end to the stitching joining the lining to the collar.	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
73	Finish collar. (cont'd)					
	c. Turn under and fell the lower edge of the collar lining to the coat from end to end, catching the turned-under portion of the lining at the right and left end in the felling.	Hand		8-10	C (Silk)	
	d. Fell the collar extension tab from the underside, the the collar, across the left front end of the collar, leaving an opening of 1/4 to 3/8 inches between the stitching line and the inside back edge of the eye to properly engage hook. Continue felling along the folded top edge to the end of the stitching, joining the lining to the collar.	Hand		8-10	C (Silk)	
	e. Turn the collar eyelet covers to the inside of the collar and fell the cover to the collar lining along the front edge. Continue the felling along the bottom edge for a distance of approximately 1/2 inch from the front edge.	Hand		8-10	C (Silk)	
74	Clean coat.					
	a. Pull all basting thread; trim and remove any loose ends of thread; and remove any spots, stains and tickets without					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
74	Clean coat. (cont'd) injury to the material. b. Buttonholes at front closure shall be examined for exposure of coat front interlining cloth. The exposed interlining shall be colored with a reddish indelible ink.					
75	Press coat. a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. c. Press the entire collar smooth and flat. d. Press the upper front on a body machine, shrinking and properly shaping the chest. e. Press the lower fronts smooth and flat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
75	Press coat. (cont'd) f. Press the sides, working the fullness towards the back. g. Press the back smooth and flat, removing all fullness. h. Block the shoulders to remove fullness and press shoulders smooth on a shoulder shaping machine. i. Press the armholes solid from the inside, creasing the armholes at the front, back, and armpit. The armpit and the back of the armhole shall be held short while pressing. j. Block the armholes on a pressing block, shrinking the top sleeves. k. Insert a sleeve pad in the sleeves in order to prevent creasing, and press sleeves smooth and flat. l. Press lower edge of coat smooth, flat, and even. Remove all impressions on the side and center back seam allowances. Press linings throughout, removing all wrinkles and creases. Press the front and back lining pleats smooth and flat. Remove all gloss					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
75	Press coat. (cont'd) marks.					
76	Attach buttons. a. Insert the shank of a 40-line insignia button through each eyelet on the right and left fronts and at the back. Secure each button with a ring toggle. b. Insert the shank of a 27-line insignia button through each eyelet on the sleeve cuffs and secure each button with a ring toggle.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in table II.

Table II. Coat measurements. 1/

Size	Bust 2/	Back length 3/	Sleeve length 4/	Collar length
		Short		
	inches	inches	inches	inches
2	33-1/2	25	16-1/4	13
4	34-1/2	25-1/4	16-1/4	13-1/2
6	35-1/2	25-1/2	16-1/4	14
8	37	25-3/4	16-1/4	14-1/2
10	38-1/2	26	16-1/4	15
12	40	26-1/4	16-1/4	15-1/2
14	42	26-1/2	16-1/4	16
16	44	26-3/4	16-1/4	16-1/2
		Regular		
	inches	inches	inches	inches
2	33-1/2	26	17-1/4	13
4	34-1/2	26-1/4	17-1/4	13-1/2
6	35-1/2	26-1/2	17-1/4	14
8	37	26-3/4	17-1/4	14-1/2
10	38-1/2	27	17-1/4	15
13	40	27-1/4	17-1/4	15-1/2
14	42	27-1/2	17-1/4	16
16	44	27-3/4	17-1/4	16-1/2
18	46	28	17-1/4	17
		Long		
	inches	inches	inches	inches
4	34-1/2	27-1/2	18-1/2	13-1/2
6	35-1/2	27-3/4	18-1/2	14
8	37	28	18-1/2	14-1/2
10	38-1/2	28-1/4	18-1/2	15
12	40	28-1/2	18-1/2	15-1/2
14	42	28-3/4	18-1/2	16
16	44	29	18-1/2	16-1/2
18	46	29-1/4	18-1/2	17

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

1/ Tolerance on all measurements ± 3/8 inch.

2/ Bast measurement taken with coat buttoned, from folded edge to folded edge in line with pit of armhole; multiply by 2.

3/ Back length measurement taken along center back seam edge of collar to bottom edge of coat.

4/ Sleeve length measurement taken along forearm seam from pit of armhole to bottom edge of sleeve.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements; however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.1.2 Inspection system program plan. When specified in the contract or order, an inspection system program plan shall be prepared (see 6.3).

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.3.1)
2. Quality conformance inspection (see 4.4)

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

4.3 Inspection. Inspection shall be in accordance with MIL-STD-105, except where otherwise indicated herein.

4.3.1 First article inspection. When specified in the contract or purchase order, a first article inspection procedure shall be prepared, inspection performed on a completely fabricated coat for conformance to all provisions of this specification and a first article inspection report shall be prepared (see 6.4).

4.4 Quality conformance inspection.

4.4.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in table III for characteristics noted. When specified in the contract or purchase order a failed item analysis report shall be prepared.

4.4.2 In-process inspection. An inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies. When specified in the contract or purchase order a production/acceptance inspection procedure and production inspection reports shall be prepared.

4.4.3 Sampling test. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following:

Hook and eye	100 each	2 each, hook and eye
Ornamental braid	yards	5 yards

4.4.4 Examination of end item. The end item shall be examined for defects listed in 4.4.4.1 through 4.4.4.3. The sample unit shall be one coat. All defects shall be classified as indicated below, except those numbered 1 through 99 in classification column, which shall be classified as follows:

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

Table III. Test methods

Components	Characteristics	Rqmt. para.	Test method	No. Det. per S/U	Results reported as:
Ornamental Braid	Weave	3.3.15	Visual	1	Pass or Fail
	Weight, oz. gross yards	3.3.15	5041 4.4.1	1	To nearest 0.1 ounce.
	Texture (picks & ends)	3.3.15	Visual	5	Avg. of 5 det.to nearest whole number.
	No. of Carriers	3.3.15	Visual	1	To nearest no.
	Shrinkage 6/	3.3.15	5558		
	Breaking strength 7/	3.3.15	5100		
	Colorfastness to:				
	- wet (dry) cleaning	3.3.15	5622		
	- light	3.3.15	5660		
Hook and Eye	Material identification 1/	3.3.17	Std Comm'l	1	Pass or Fail
	Finish	3.3.17	4.4.1	1	Pass or Fail

1/ Accept on certificate of compliance.

2/ Except that the width of the test specimen shall be the full width of the braid.

3/ Breaking strength shall be determined on the full width of the braid and the jaw dimensions shall be greater than the width of the braid.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

Major defect - When seriously affecting appearance or serviceability.
Minor A defect - When not seriously affecting appearance or serviceability.

4.4.4.1 General defects. General defects shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes (constructed)	a. One or more omitted or added.	101		
	b. Wrong type or uncut.		201	
	c. Not corresponding to size of button (front):			
	- too small, not permitting button to enter buttonhole.	102		
	- too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		202	
	d. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	103		
	e. Bartack missing or loose on:			
	- one buttonhole.		203	
	- two or more buttonholes.	104		
	f. Bartack misplaced, not serving intended purpose on:			
	- one buttonhole.			301
	- two or more buttonholes.		204	
	g. One or more broken stitches in:			
	- one buttonhole.		205	
	- two or more buttonholes.	105		
	h. More than 2 skipped stitches in:			
	- one buttonhole.			302
	- two or more buttonholes.		206	
	i. Ragged edges, affecting appearance, or exposed interlining not colored with reddish indelible ink.			303
	j. Gimp omitted in one or more buttonholes, or ends of gimp not pulled through to underside.		207	

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes (constructed) (cont'd)	k. Stitches per buttonhole (not including bartack) less than the minimum specified:			
	- one or two stitches.			304
	- three or more stitches.		208	
	l. One or more buttonholes finished with purling on the outside of fronts.	106		
Buttons or ring toggles	a. Missing, loose, broken, or defective:			
	- 1 button or ring toggle.		209	
	- 2 or more buttons, or 2 or more ring toggles.	107		
	b. Not specified type, size, color, or finish.		210	
Note:	Buttons shall be considered defective if they have sharp, rough, or cracked edges; scratches; blemishes; imbedded foreign matter on face side of button; loose shanks; or badly shade.			
Cleanness	a. One or more removable spots or stains clearly noticeable, outside of coat.		211	
	b. One or more removable spots or stains clearly noticeable, inside of coat.			305
	c. One or more spots or stains of an obvious permanent nature.	1		
	d. Thread ends not trimmed, loose thread ends, 2 or more shade markings, or basting not removed throughout garment (to be scored when the condition exists on major portion of coat).		212	
Components and assembly	a. Any defective component or assembly (not herein classified).	108		
	b. Any component part or required operation omitted (not herein classified).	109		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Cutting	a. Any component part of basic wool material not cut in accordance with directional lines on patterns, or in accordance with specification requirements.	110		
	b. Cloth gabardine (white) for piping cut on the bias.		213	
	c. Any lining part not cut in accordance with directional lines on patterns.		214	
Eyelets (construction)	a. One or more omitted or added.	111		
	b. Wrong type.		215	
	c. Eyelet not securely caught on fabric, causing stitching to pull away from fabric.	112		
	d. Diameter of inside opening less than 1/8 inch or more than 1/4 inch.			306
	e. One or more eyelets uncut.		216	
	f. One or more broken stitches in:			
	- one eyelet.			307
	- two or more eyelets.		217	
	g. More than two skipped stitches in one or more eyelets.		218	
Hook and eye	a. One hook or eye omitted.		219	
	b. Not specified type or size.		220	
	c. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hooks and eyes are fastened.		221	
	d. Hook or eye not securely tacked to ends of collar.		222	
	e. Hooks or eyes misplaced, i.e., hooks positioned on left end and eyes positioned on right end of collar.		223	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Material defects and damages	a. Any weakening defect such as smash, multiple float, loose slub, etc., that may develop into a hole.	113		
	b. Any hole (including drill holes).	114		
	c. Shade bar, unsightly slubs, etc.:			
	- on outside.	115		
	- on inside.			308
	d. Needle chews which may develop into a hole.	116		
	e. Scissors or knife cuts, tear, mend, or burn.	117		

Note: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicious and have negligible effect on serviceability are to be classified as follows:

Material defect. - No defect
Workmanship damages. - Minor B defect

Ornamental braid	a. Not specified, type, size or color.	118		
	b. One or more omitted.	119		
Pressing	a. Burned or scorched.		224	
	b. Pressing omitted (entire garment).		225	
	c. Poorly pressed (unless otherwise classified).		226	
	d. Armhole stretched, affecting appearance.		227	
	e. Basting or pressing impressions not removed on major portion of coat.			309
	f. Gloss not removed throughout coat, affecting appearance.			310
	g. Armholes not blocked or blocked poorly.		228	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Pressing (cont'd)	h. Inside of armholes not pressed solid.		229	
	i. Edges bulky, i.e., not pressed solid, affecting appearance.			311
	j. Linings not pressed smooth.			312
Seams and stitching	a. Accuracy of seaming:			
	1. Any seam twisted, puckered or pleated, affecting appearance.		230	
	2. Part of garment caught in any unrelated operation or stitching.	120		
	3. Unsightly hand felling or blindstitching exposed on outside of coat, affecting appearance.		231	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.			313
	5. Wrong color of thread used on outside of coat, affecting appearance.	121		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular, i.e., unevenly gaged, or various stitchings not uniform, affecting appearance.		232	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			314
	c. Open seams:			
	1. On outside:			
	- up to 1/4 inch inclusive.			315
	- more than 1/4 inch but not more than 1/2 inch.		233	
	- more than 1/2 inch.	122		
	2. On inside:			
	- more than 1/2 inch (except machine felling).		234	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	- up to 1/2 inch inclusive (except machine felling).			316
	- up to 1 inch inclusive (machine felling).			317
	- more than 1 inch (machine felling).		235	

Note: One or more broken stitches; or two or more continuous, skipped, or runoff stitches constitute an open seam.

d. Raw edges:			
1. On outside:			
- up to 1/8 inch inclusive.			318
- more than 1/8 inch but not more than 1/4 inch.		236	
- more than 1/4 inch.	123		
2. On inside:			
- more than 1/8 inch but not more than 1/4 inch.			319
- more than 1/4 inch.		237	

Note: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.

e. Runoffs (see classification of open seams).			
f. Stitch tension:			
1. Loose tension resulting in loose seam.	124		
2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		238	
3. Tight tension (stitches break when normal strain is applied).	125		

Note: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting pull in lengthwise direction of seam.

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	g. Stitches per inch (excluding labels): 1. Less than minimum specified: - one or two stitches.			320
	- three stitches.		239	
	- four or more stitches.	126		
	Note: To be scored only if condition exists on major portion of seam.			
	h. Stitch and seam type: 1. Wrong stitch or seam type.		240	
	i. Stitching skipped or broken (on edge or raised stitching, when seam is seamed, turned and stitched): - 1/4 inch or more but not more than 1/2 inch.			321
	- more than 1/2 inch.		241	
Shaded parts	a. On outside: 1. Any shaded part (except ornamental braid).	2		
	2. Any ornamental braid shaded, affecting appearance.		242	
	b. On inside: 1. Any lining part badly shaded (except sleeve lining).		243	
	2. Any sleeve lining part badly shaded or pairs not matching each other.			322

4.4.4.2 Detailed defects. Detailed defects with coat buttoned on a form or spread out on a table shall be classified as follows:

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar (construction and setting)	a. Interlining omitted (buckram).	127		
	b. Interlining (buckram) tight or twisted, causing puckers on collar, affecting appearance.		244	
	c. Tight at joining to front or back, causing puckers or pleats at neck of coat, affecting appearance.		245	
	d. Piping irregular, affecting appearance.		246	
	e. Collar ends overlapping when fastened.		247	
	f. Collar ends spread open more than 3/8 inch when fastened.		248	
	g. Center of eyelets from finished ends of collar:			
	- less than 1-3/8 inches but not less than 1-1/4 inches.			323
	- more than 1-5/8 inches but not more than 1-3/4 inches.			324
	- less than 1-1/4 inches or more than 1-3/4 inches.		249	
	h. One or both eyelets off-center with top and bottom edges of collar by more than 1/4 inch.			325
	i. Front finished ends of collar uneven in width by 3/16 inch or more.		250	
Alignment of front buttons and buttonholes	a. Not aligned, causing a noticeable bulge or twist on fronts when buttoned, affecting appearance.		251	
	b. Horizontal alignment of buttons on left front:			
	1. One or more rows out of alignment by more than 1/4 inch but not more than 1 inch.		252	
	2. One or more rows out of alignment by more than 1 inch.	128		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Ornamental braid (position, construction and setting)	a. One or more rows out of horizontal alignment by more than 1/4 inch.		253	
	b. One or more rows of braid not formed with either a figure 8 or a harp.	129		
	c. Diameter of figure 8 circles less than 27/32 inch or more than 7/8 inch.			326
	d. Back edge of second harp from top less than 3/8 inch from finished armhole seam.		254	
	e. One or more inner circles forming figure 8 less than 1/8 inch in diameter.		255	
	f. One or more rows of braid not stitched through interlining.			327
	g. Stitching of braid not started or ending at bottom of harp where the front and back cross.			328
	h. Stitching of braid not uniform, affecting appearance.		256	
	i. Ends of stitching not securely tacked on one or more braids.		257	
	j. One or more braids not lying smooth, i.e., puckered, twisted, pleated, or having excessive fullness, affecting appearance.		258	
	k. Braid not pressed smooth and flat.			329
	l. One or more harps not formed in accordance with figure 6.		259	
	m. Braid loop around one or more buttonholes not properly positioned, restricting use of buttonhole for buttoning.		260	
	n. Inner edges of horizontal braid not adjacent to one another, i.e., spaced more than 1/16 inch apart on one or more braids.		261	

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Armholes (construction) (cont'd)	d. Tape stitching exposed and visible on outside surface.			332
	e. Sleeve head pads not completely tacked to armholes; or misplaced, not serving intended purpose.		273	
	f. One or both sleeve head pads omitted.		274	
Sleeves	a. Setting and hang:			
	1. Sleeve fullness misplaced, affecting appearance.		275	
	2. Backarm seam of sleeve not matching side back seam by: - more than 1/4 inch but not more than 1/2 inch.		276	
	- more than 1/2 inch.	132		
	3. Hang of sleeves on the same coat in opposite direction by more than 2 inches.			333
	4. Sleeve tight in armhole, i.e., roll effect not present.			334
	b. Sleeve lining:			
	1. Twisted, tight, or short, causing bulge, twist, or puckering on outside of sleeves.	133		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			335
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of sleeve.			336
	c. Construction of sleeves:			
	1. Tacking on bottom turnup to body of sleeve omitted or insecure.		277	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			337
	3. Tacking on 1 or both sleeve lining seams to sleeve seams omitted, or insecure.			338

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Ornamental braid (position construction and setting) (cont'd)	o. Front edge of one or more braids on right front positioned less than 1/4 inch from piping joining seam.			330
	p. Front edge of braid out of vertical alignment with left front edge of coat by 1/8 inch or more.		262	
	q. One or more horizontal braids not hand felled together at inner edges for full length of straight portion except at openings for buttonholes.		263	
Length of buttoned fronts	a. Right front at corner shorter than left front at bottom by: - more than 1/8 inch but not more than 1/4 inch.		264	
	- more than 1/4 inch.	130		
	b. Right front at corner longer than left front by: - more than 1/4 inch but not more than 3/8 inch.			331
	- more than 3/8 inch.	131		
	c. Left front at corner exposed beyond bottom edge of right front by more than 1/8 inch.		265	
Shoulder (construction)	a. Improperly joined or set, causing shoulder or back to twist.		266	
Shoulder pads	a. Not completely caught in armhole tacking.		267	
	b. Misplaced, not serving intended purpose; i.e., too far back or too far forward.		268	
	c. One or both pads omitted.		269	
Armholes (construction)	a. Badly stretched, affecting appearance.		270	
	b. Taped too tight, causing puckering.		271	
	c. Crooked seam, affecting appearance.		272	

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from bottom edge of sleeve.			339
	d. Sleeve cuffs:			
	1. Piping irregular, affecting appearance.		278	
	2. Top edge on top sleeve part poorly shaped, affecting appearance.		279	
	3. Height of pointed end on both sleeves varying in length by more than 1/4 inch.		280	
	4. Sleeve puckered at joining of cuff, affecting appearance.		281	
	5. Cuff puckered or twisted at joining to sleeve, affecting appearance.		282	
	6. Ends of cuff staggered at backarm seam:			
	- 1/8 inch or more but not more than 1/4 inch.			340
	- more than 1/4 inch.		283	
	7. Height of cuff at point on top sleeve including piping:			
	- less than 4-3/4 inches but not less than 4-1/2; or more than 5-1/4 inches but not more than 5-1/2 inches.			341
	- less than 4-1/2 inches or more than 5-1/2 inches.		284	
	8. Height of cuff at backarm or front creased edges including piping:			
	- less than 2-3/4 inches but not less than 2-1/2 inches or more than 3-1/4 inches but not more than 3-1/2 inches.			342
	- less than 2-1/2 inches or more than 3-1/2 inches.		285	

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	9. Point of cuff not centered between the folded forearm edge and the folded backarm edge of sleeves by more than 1/4 inch.		286	
Position of eyelets on sleeve cuffs	a. Horizontal alignment of eyelet on one sleeve cuff not uniform with other sleeve cuff by more than 1/4 inch.			343
	b. Eyelet on one or both sleeve cuffs out of vertical alignment by more than 1/8 inch.			344
Body (outside)	a. Fitting of body linings: 1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	134		
	b. Fitting of front interlining: 1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	135		
	2. Too full, causing coat front to have a wavy appearance.	136		
Waist seam	a. Seam not pressed open.		287	
	b. Seam stretched, affecting appearance.		288	
	c. Tape set on tight, causing puckering on waist seam, affecting appearance.		289	
Lower skirt dart	a. One or both darts cut and sewn type in lieu of folded seam type.			345
	b. End on one or both darts not properly tapered, causing puckering at end of dart, affecting appearance.		290	
	c. Length of one or both darts less than 5 inches or more than 5-1/2 inches long.			346

Source: https://assist.dla.mil -- Downloaded: 202640-20T22:49Z
Check the source to verify that this is the currentversion before use.

Examine	Defects	Classification Major	Minor A	Minor B
Lower skirt dart (cont'd)	d. One or both folded darts not pressed flat as specified.			347
Upper front, side body, and side back panel seams	a. One or more joining seams not spread open and pressed flat.		291	
	b. Curved side back panel seam stretched or distorted, affecting appearance.		292	
Center back and skirt	a. Joined seams below waist seam not pressed flat and towards the center of back.		293	
	b. Piping at back edge of skirt set on tight, causing puckering on back, affecting appearance.		294	
	c. Folded edge of piping extending less than 1/8 inch beyond the seam on back.		295	
	d. Buttons on each back seam at the skirt seam: - out of horizontal alignment by 1/4 inch or more.		296	
	- one or both reinforcement discs omitted.			348
Front and bottom edges	a. Front edges stretched, affecting appearance.		297	
	b. Piping set on tight, causing puckering on front, affecting appearance.		298	
	c. Front or bottom piping irregular, affecting appearance.		299	
	d. Bottom edge stretched, puckered, or uneven, affecting appearance.			349
	e. Bottom corner of right front poorly shaped, affecting appearance.		201a	
	f. Right front rolling outward below bottom button.		202a	
	g. Front edge irregular, affecting appearance.		203a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Front and bottom edges (cont'd)	h. Piping tight on bottom edge, causing puckering on outside of coat, affecting appearance.		204a	
	i. Right front not dressed as specified.		205a	
Front facings	a. Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.		206a	
Front buttonholes (position)	a. Position from front edge including piped edge: - less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch.			350
	- less than 1/2 inch or more than 7/8 inch.		207a	
	b. More than 1/4 inch from equal spacing.		208a	
	c. Bottom buttonhole above or below waist seam.		209a	
	d. Unevenly spaced from front edge by more than 3/16 inch.		210a	
	e. Top buttonhole less than 7/8 inch or more than 1-1/8 inches from top edge of piping (collar notch).		211a	
Front buttons (position)	a. Out of vertical alignment by 1/4 inch or more.		212a	
	b. Center of one or more buttons positioned from right front edge: - less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch.			351
	- less than 1/2 inch or more than 7/8 inch.		213a	
Labels	a. Any required label missing, incorrect, illegible or size label not securely caught in stitching.	137		

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Labels (cont'd)	b. Identification label not stitched on 4 sides.		214a	
	c. Bottom edge of identification label less than 3 inches or more than 5 inches from bottom finished edge of coat.			352
	d. Identification label not stitched to outside of right facing.			353
Hanger	a. Hanger omitted or ends not securely stitched.	138		
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along the lower edge of collar lining.		215a	
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.		216a	
	d. Finished width less than 1/4 inch or more than 3/8 inch wide.			354
Front facings	a. Fullness or pleats on facings between eyelets, buttonholes, or between front edge and eyelets or buttonholes.			355
	b. Tacking on back edge to 1 or both interlinings: - omitted.		217a	
	- insecure or incomplete for a distance of more than 4-1/2 inches below shoulder seams, or more than 4 inches above bottom edge of coat.			356
	c. Felling at bottom edge of front facing or back edge of facing omitted or insecure on one or both facings.		218a	
	d. Felling along folded edge of one or both facings at collar notch omitted or insecure.		219a	
Body linings	a. Excessive puckering or pleated.			357

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Body linings (cont'd)	b. Twisted, not affecting smoothness on outside of coat.			358
	c. One or both chest pleats on shoulders omitted.		220a	
	d. Folded edge of 1 or both chest pleats facing front edge of coat.			359
	e. Pleat omitted at center of back lining.		221a	
	f. Pleat less than 1/2 inch in depth at center of back lining.			360
	g. Bottom hem less than 5/8 inch or more than 7/8 inch wide.			361
	h. Lining too long, i.e., exposed beyond bottom edge of coat.		222a	
Lining securing straps	a. One or both omitted or insecure.		223a	
	b. Less than 1/4 inch or more than 3/8 inch wide.			362
	c. One or both positioned more than 1 inch from back seams.			363
	d. End of one or both straps not fastened between the piping at bottom edge of coat and skirt seam allowance.			364
	e. One or both not folded and stitched across width.			365
	f. One or both not properly attached to lining hem of coat, causing twist or distortion to either the lining or coat.		224a	
	g. One or both exposed beyond bottom edge of coat.		225a	
Serge or overedge stitching	a. Basic material: - omitted on one or more raw edges for cut darts and seams where specified.		226a	
	b. Piping the skirt: - omitted on raw edges of one or both folded pipings.		227a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Serge or overedge stitching (cont'd)	c. Lining joined seams: - omitted on one or more seams where specified.		228a	
Waist seams	a. Tape on one or both seams omitted.		229a	
Underarm shields	a. One or both omitted.		230a	
	b. Tacking on one or both shields along side or bottom edge of body lining omitted or insecure.			366
	c. Top edge not caught in armhole tacking or stitching when tacked by hand.			367
	d. Puckered, pleated, or twisted.			368
	e. One or both shields misplaced, not serving intended purpose.			369
Inside of armhole	a. Backstitching at armpit of armhole from backarm seam of sleeve to front edge of shield omitted.			370
Collar lining extension tab	a. Omitted.		231a	
	b. Extending less than 1/2 inch or more than 1 inch beyond end of collar.			371
	c. Felling omitted; or insecure at top, back, front, or bottom edges.		232a	
	d. Box stitching omitted.		233a	
Collar lining and eyelet covers	a. Ends of collar lining not securely tacked.		234a	
	b. One or both eyelet covers omitted.		235a	
	c. One or both eyelet covers not covering eyelet.		236a	
	d. Width of collar eyelet cover less than 1-5/8 inches or more than 1-7/8 inches.			372
	e. Felling on front edge and along lower corner of 1 or both eyelet covers omitted.		237a	

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:49Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar lining and eyelet covers (cont'd)	f. Felling along lower corner of one or both eyelet covers extending for a distance of more than 3/4 inch.			373
	g. Top or bottom hook positioned less than 1/4 inch from top or bottom edges respectively of collar.			374
	h. Remaining hook not positioned midway between top and bottom hook.			375

4.4.4.3 Finished measurements. Any measurement deviating from the nominal dimensions and tolerances specified in table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.4.5 Examination of preparation for delivery. An examination shall be made to determine compliance with packaging, packing and marking requirements of section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery.

Examine	Defect
Marking (exterior interior)	Omitted; incorrect; illegible; or of and improper size, location, sequence, or method of application.
Materials	Any component missing or damaged.
Workmanship	Inadequate application of components, such as incomplete closure of case liners, container flaps, loose strapping, or inadequate stapling. Bulging or distortion of containers.
Content	Number of coats per container is more or less than required.

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the currentversion before use.

4.5 Tests.

4.5.1 Lacquer tests.

4.5.1.1 Liver of sulfur. The samples to be tested shall be immersed in a 2 percent by weight chemically pure liver of sulfur (potassium sulphide) water solution, at a temperature of 100° F, for not less than 3 minutes. The samples shall then be removed and rinsed in warm, then cold, then hot water, after which they shall be wiped gently in an absorbent cellulose material or whirled to remove residual moisture, and allowed to air dry at room temperature for a period of 1 hour. There shall be no change in the appearance of the lacquered surfaces except for a slight overall yellowing and not more than 3 dark spots, each not exceeding 1/32 inch largest dimension.

4.5.1.2 Tackiness. At room temperature (60° F to 80° F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

4.5.2 Weight of braid per gross yards. Weigh 6 yards of braid in a relaxed condition on a balance or scale accurate to ± 0.25 percent. Convert to ounces and multiply by 24 to obtain the weight of 144 yards.

5. PACKAGING

5.1 Preservation. Unless otherwise specified (see 6.2), the coats shall be preserved in accordance with ASTM D 3951.

5.2 Packing. Coats preserved in accordance with 5.1 shall be packed in accordance with ASTM D-3951.

5.3 Markings. In addition to any special marking required by the contract or order, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coats described herein are intended for wear by enlisted female personnel of the U.S. Marine Corps Band.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

6.2. Acquisition requirements. Acquisition documents must specify the following:

a. Title, number, and date of this specification.
b. Issue of DODISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.1).
c. Sizes required (see 1.2).
d. Whether first article is required (see 3.2).
e. Number of coats in first article (see 3.2).

6.3 Samples and shade samples. For information regarding availability of sample coats and standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).

6.5 Figures. Figures 1 through 7 show general design of the coats with assembly details and measurements. In the event of a conflict between these figures and the text of this specification, the text of this specification shall govern.

6.6 Changes from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

6.7 Subject term (key word) listing.

Band
Female
Garment
Outerwear

Preparing Activity:
Navy - MC
Project No. 8410-N872

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

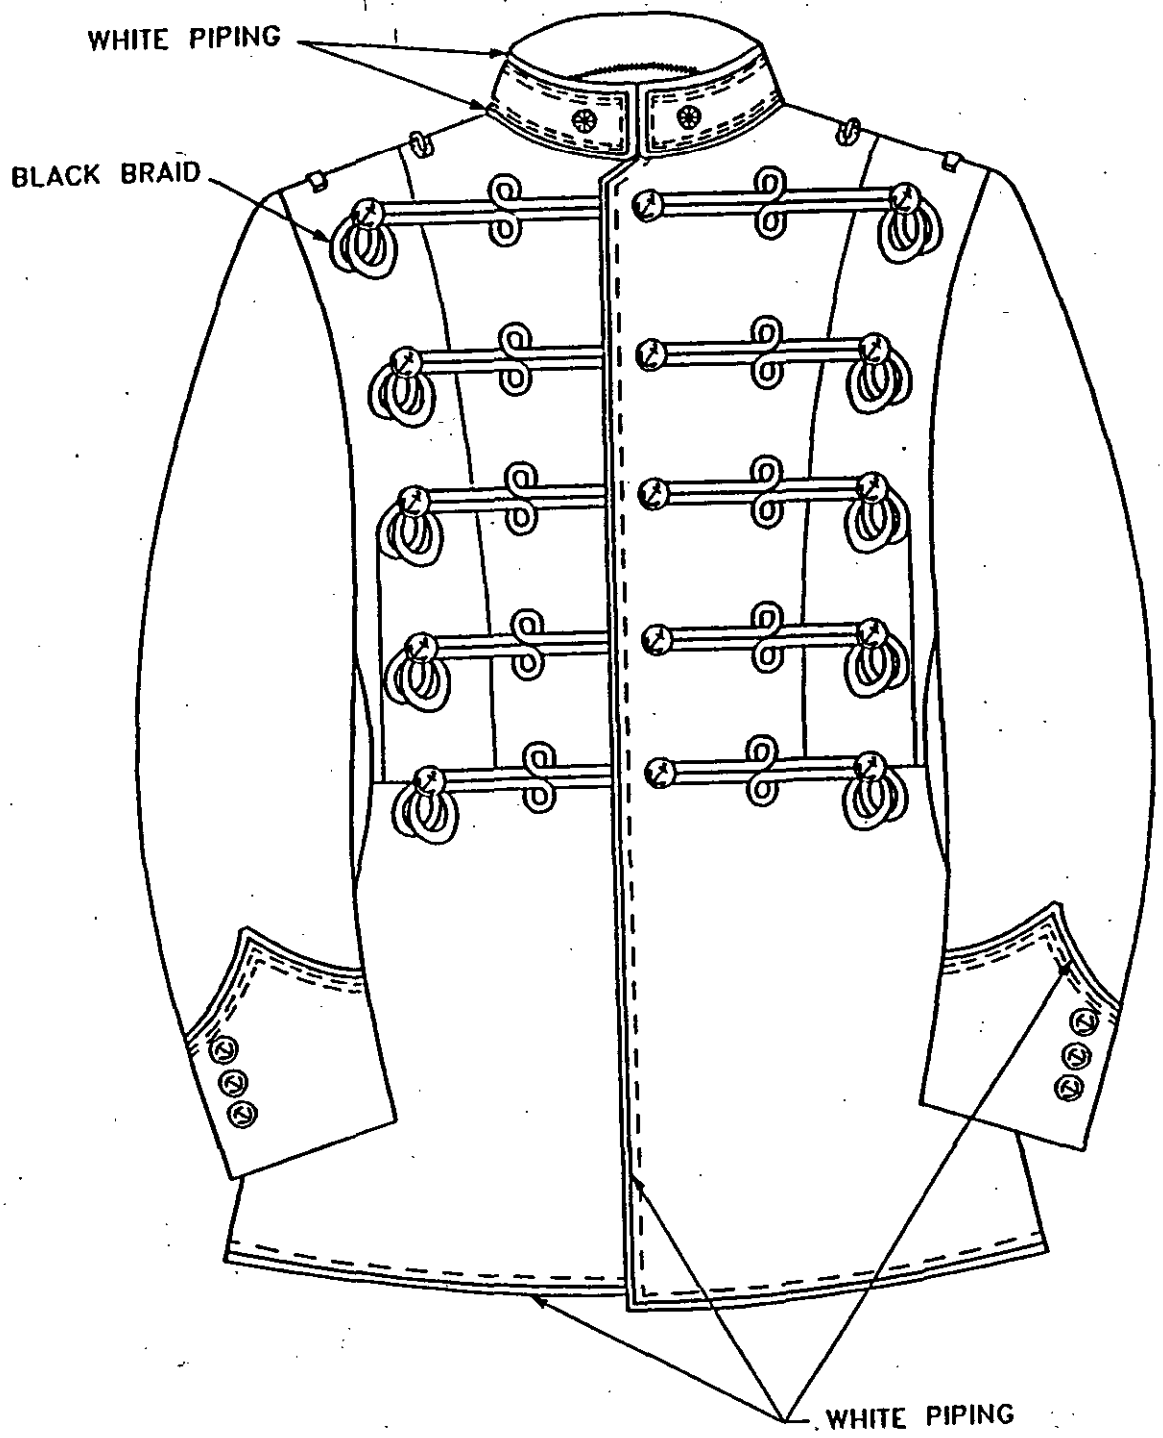


FIGURE 1. COAT, WOMAN'S: FULL DRESS, SCARLET; U.S. MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

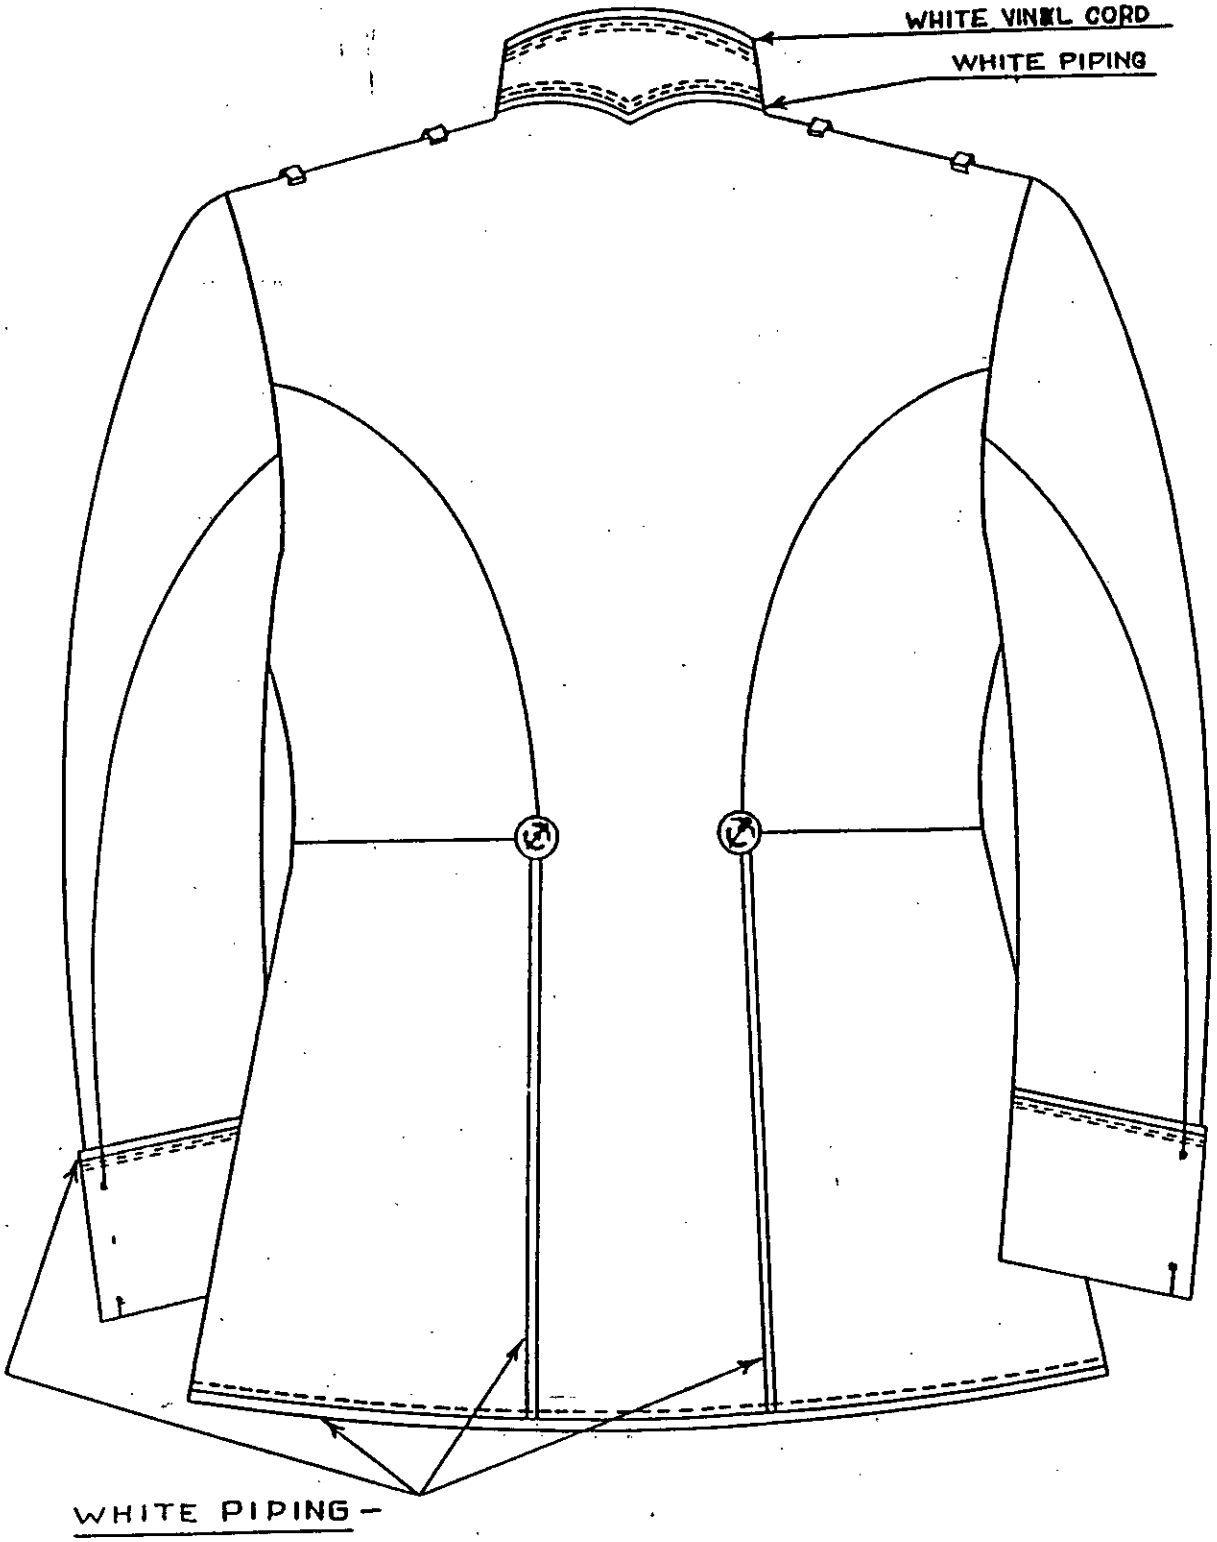


FIG.2 COAT, WOMAN'S, FULLDRESS, SCARLET

U.S. MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.


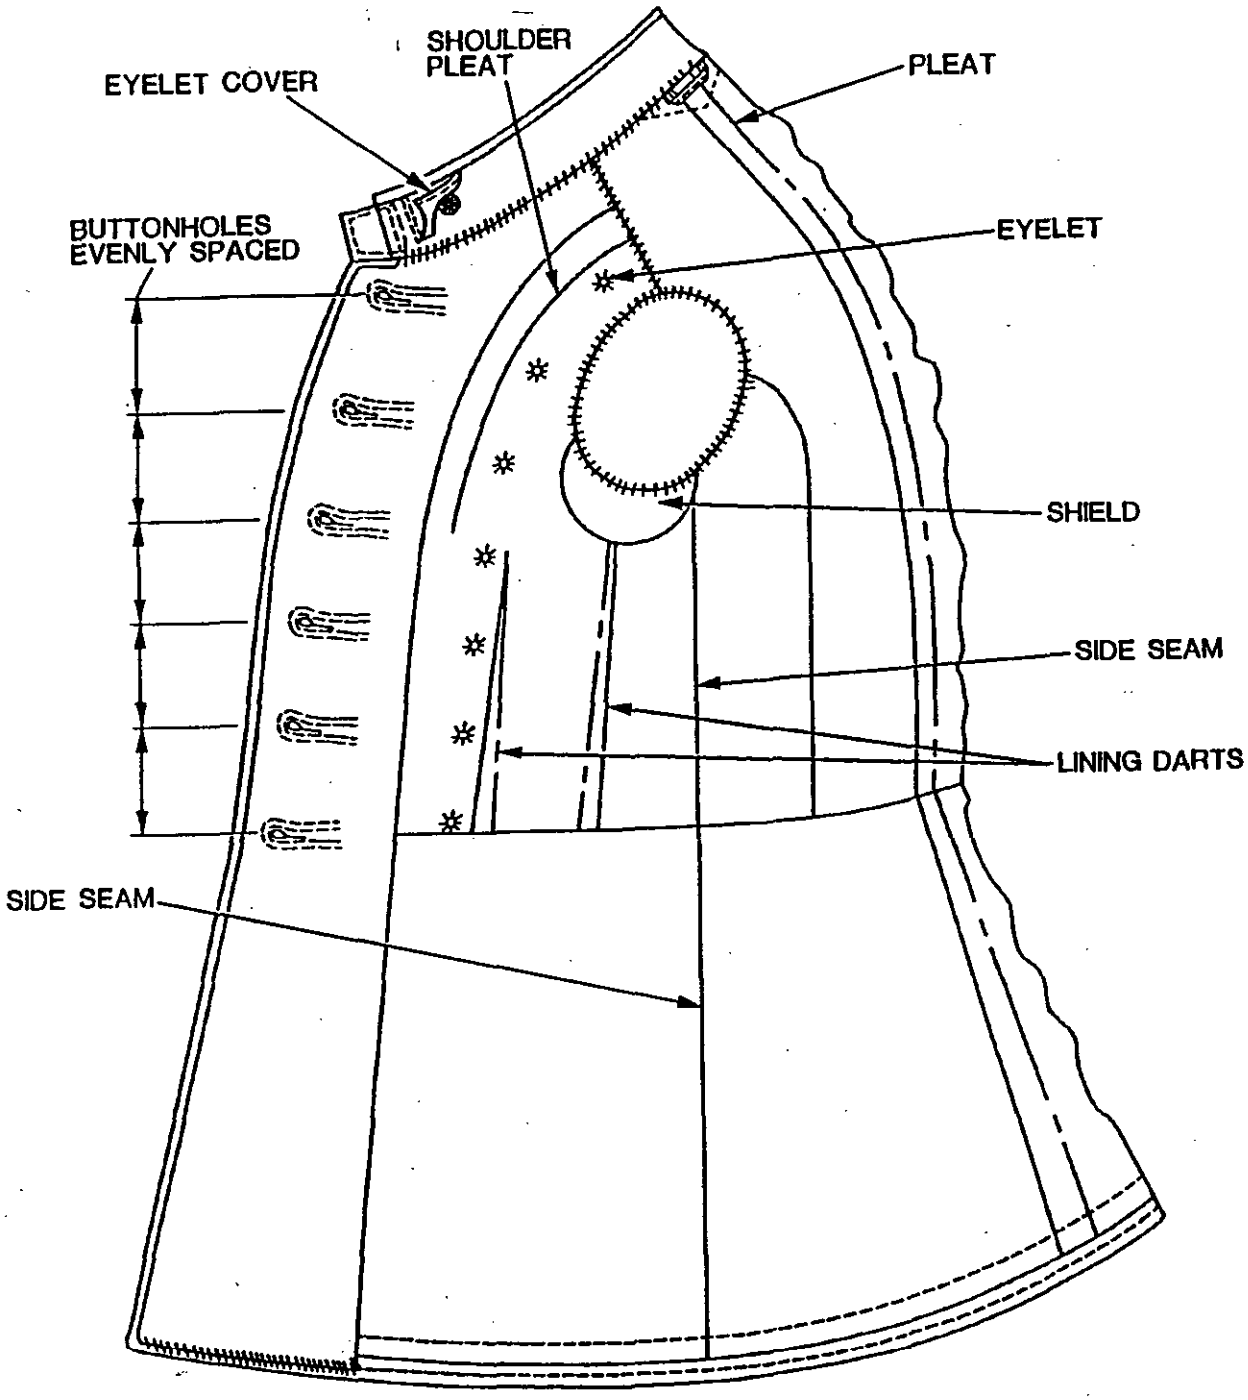


FIGURE 3. COAT, WOMAN'S: FULL DRESS, SCARLET, U. S. MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 2026l0-20T22:49Z
Check the source to verify that this is the currentversion before use.

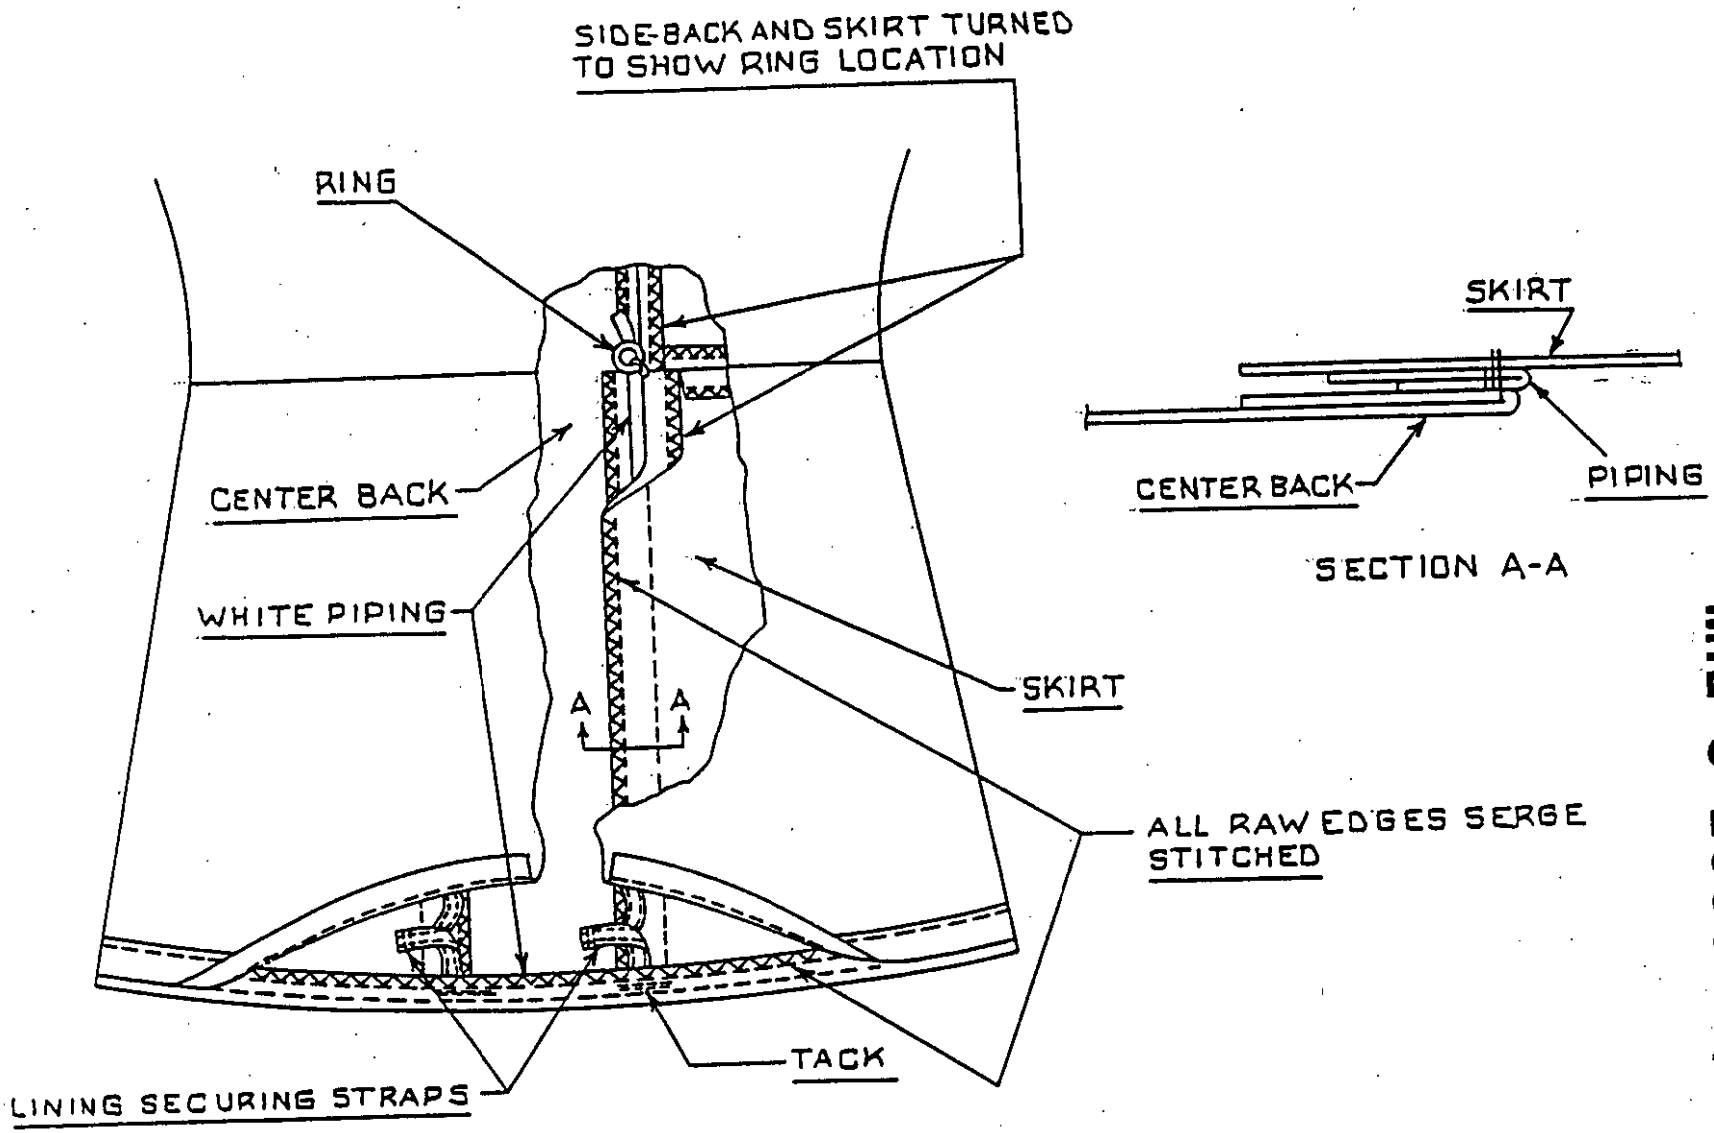

BACK INSIDE — CUT THROUGH VIEW

FIG:4 COAT,WOMAN'S,FULL DRESS,SCARLET U.S.MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.


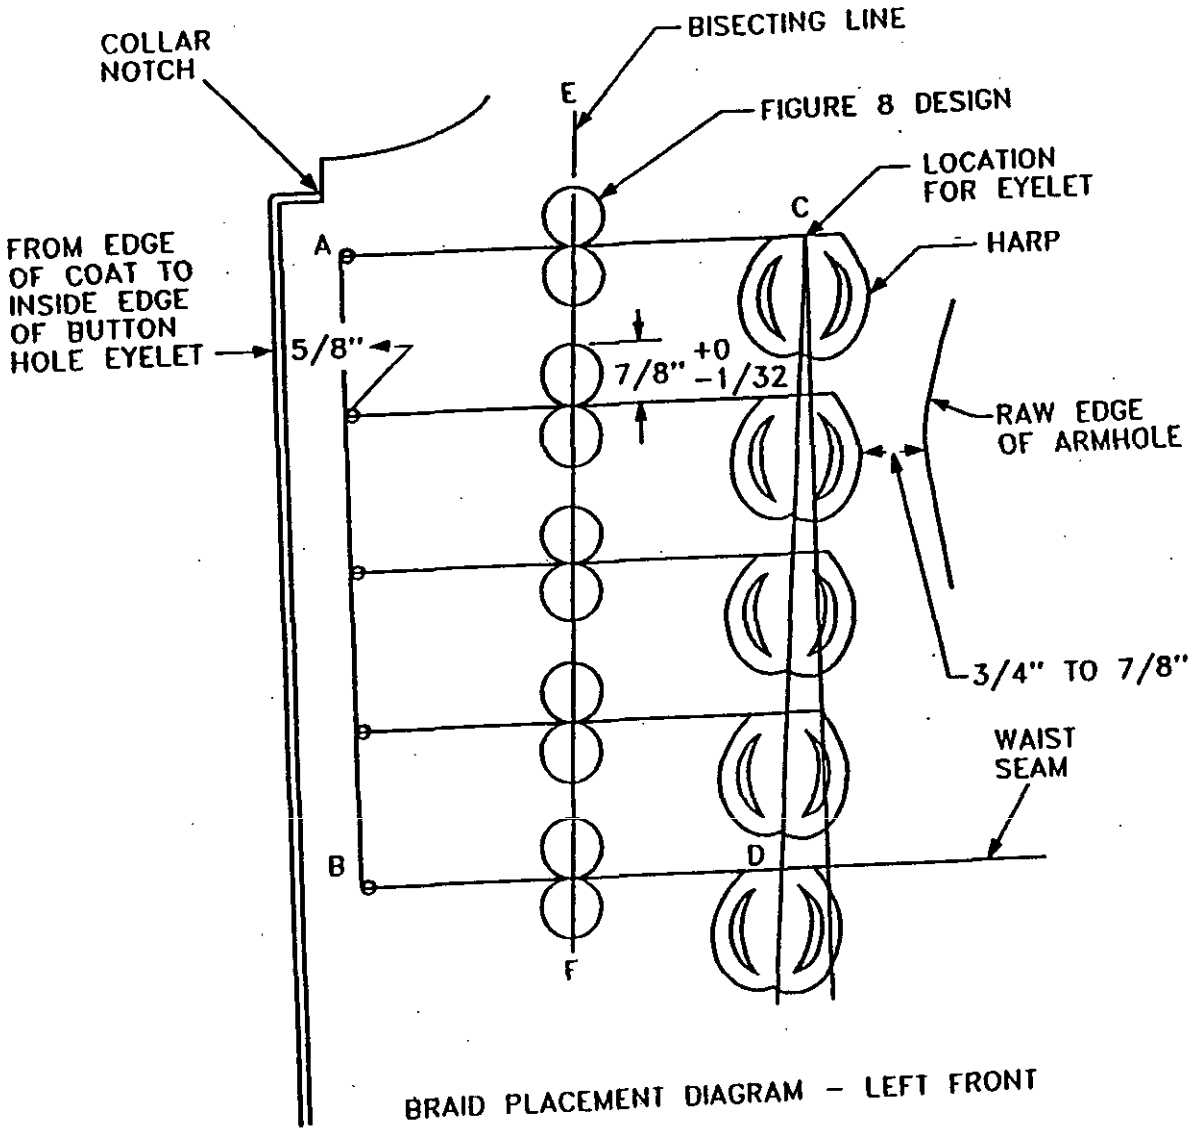



FIGURE 5: COAT, WOMAN'S, FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:49Z
Check the source to verify that this is the current version before use.

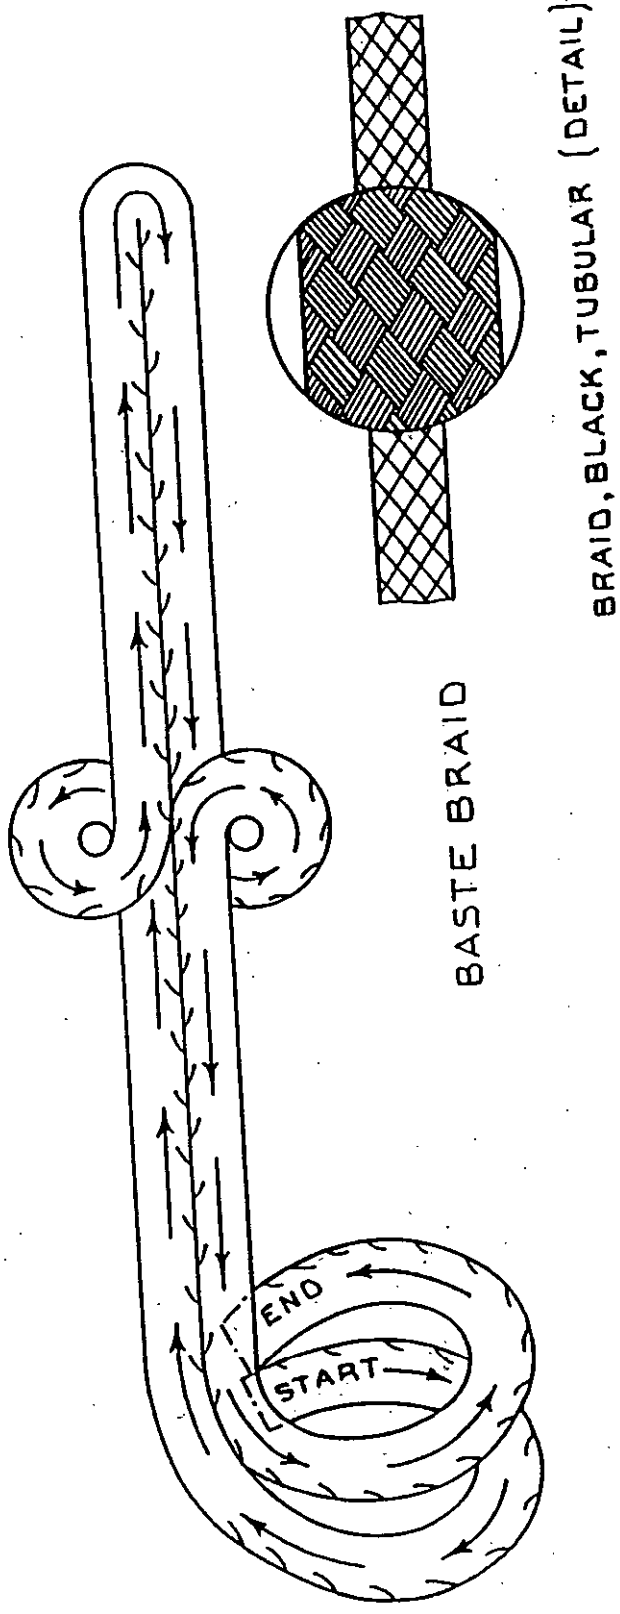

BASTE BRAID

BRAID, BLACK, TUBULAR (DETAIL)

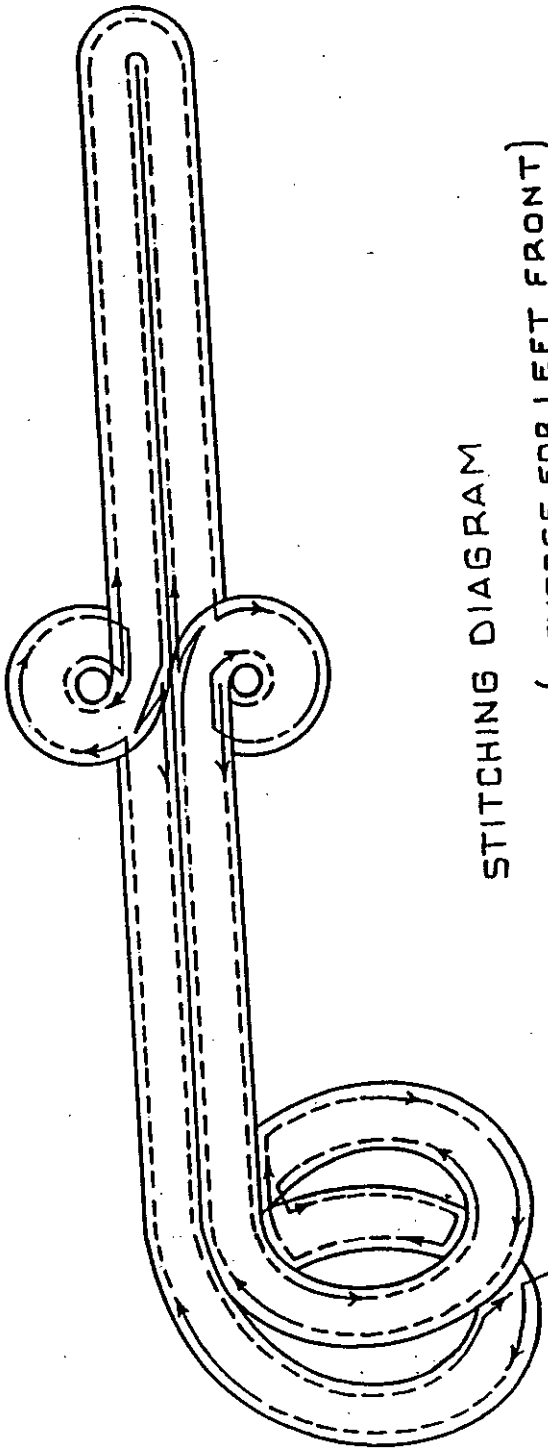

STITCHING DIAGRAM

RIGHT FRONT OF COAT:— (REVERSE FOR LEFT FRONT)

START & FINISH

FIG. 6: COAT, WOMAN'S, FULL DRESS, SCARLET U.S. MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

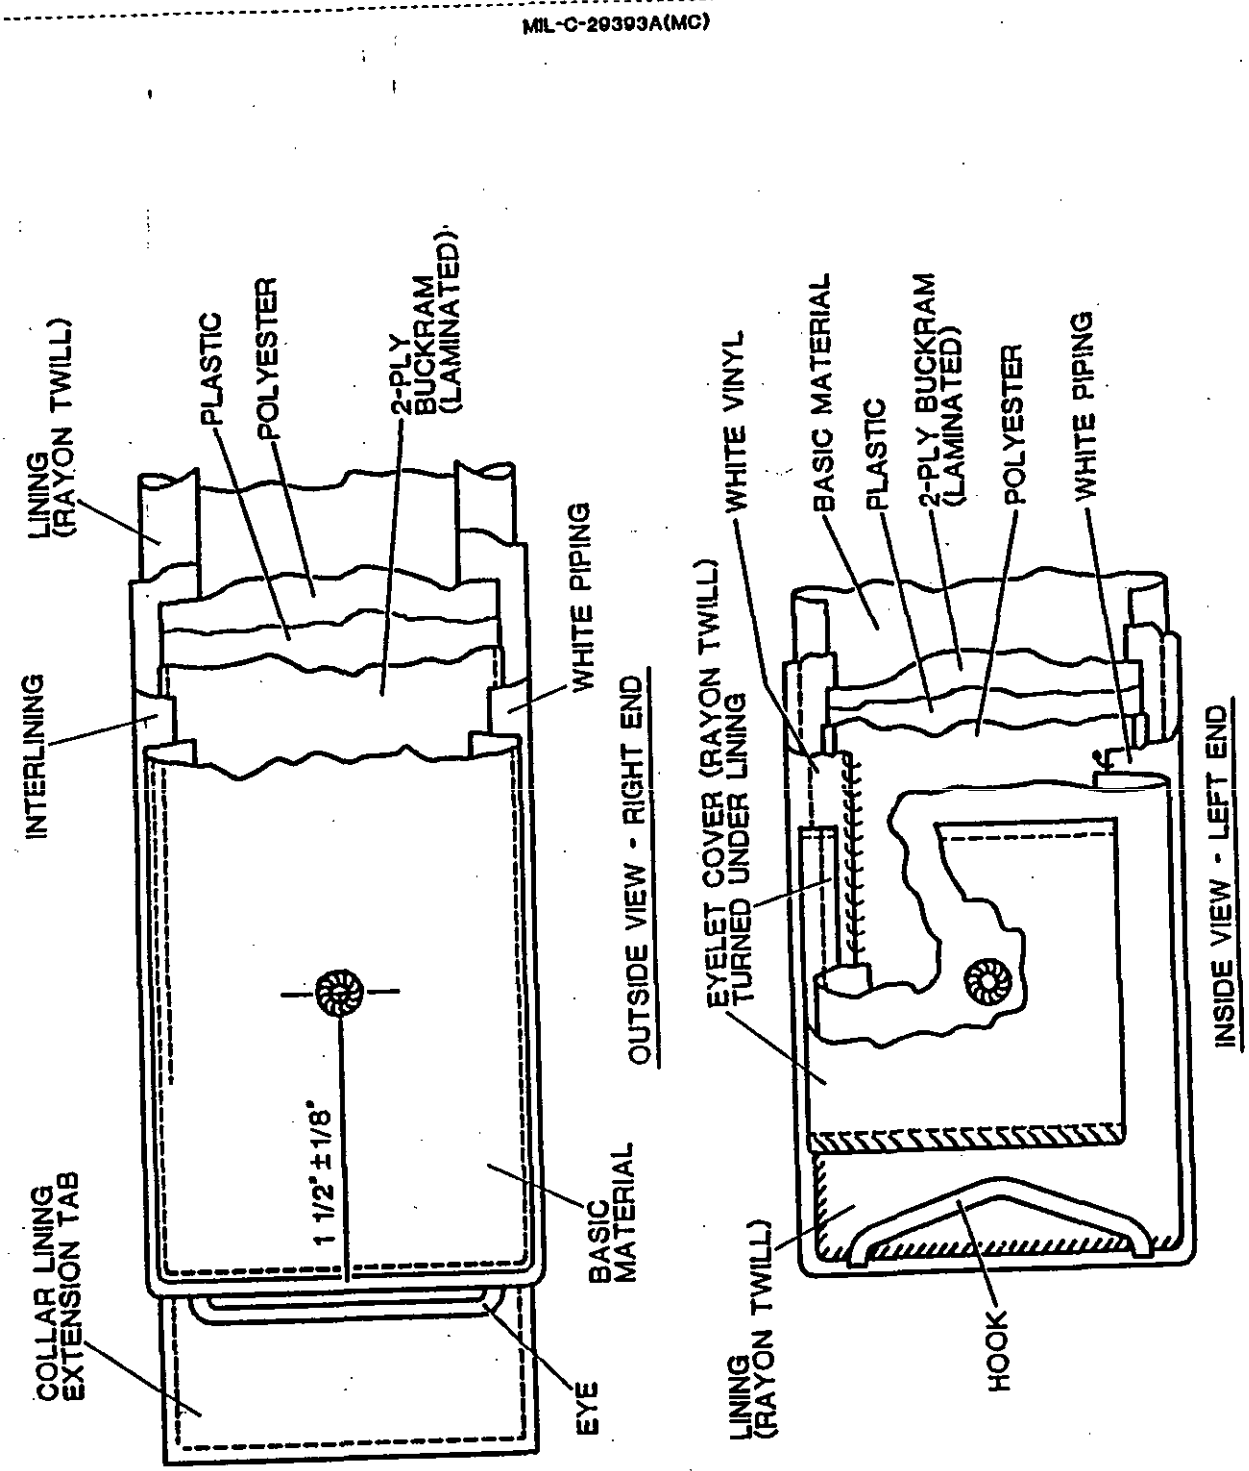


FIGURE 7: COAT, WOMAN'S, FULL DRESS, SCARLET, U. S. MARINE CORPS BAND

Source: https://assist.dla.mil -- Downloaded: 20261020T22:49Z
Check the source to verify that this is the current version before use.

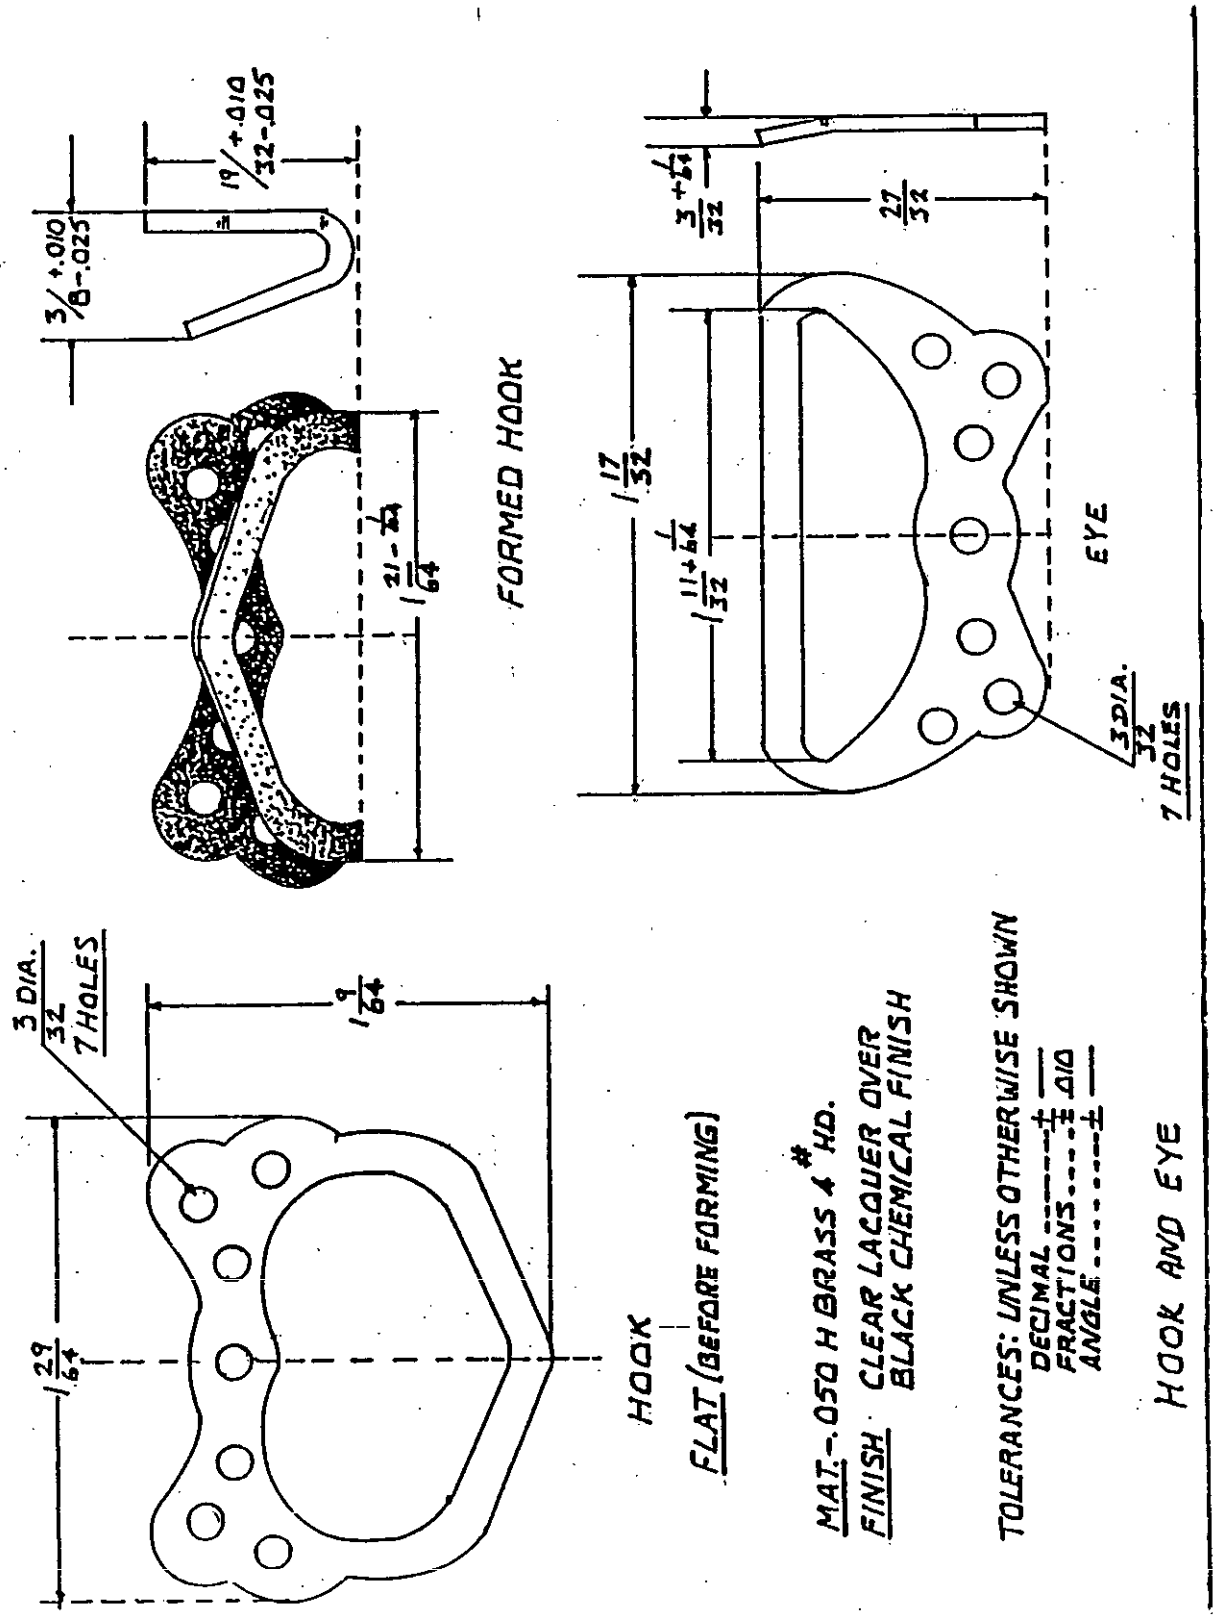


Fig 8' Coat, Women's, Full Dress, Scarlet, US Marine Band, Musician

Source: https://assist.dla.mil -- Downloaded: 202610-20T22:49Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	1. DOCUMENT NUMBER	2. DOCUMENT DATE (YYMMDD)
	MIL-C-29393A(MC)	9 June 1995

3. DOCUMENT TITLE
COAT, WOMEN'S: FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a. NAME	b. TELEPHONE (Include Area Code) (1) Commercial	(2) AUTOVON
COMMANDER	(703) 784-4584	278-4584
c. ADDRESS (Include Zip Code) PROGRAM SUPPORT DIRECTORATE (PSE-C/S) MARCORSYSCOM, 2033 BARNETT AVE SUITE 315 QUANTICO VA 22134-5010	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT: Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

Source: https://assist.dla.mil - Downloaded: 2026/10 20T22:49Z
Check the source to verify that this is the current version before use.