INCH-POUND

MIL-DTL-29396B(MC)
8 October 1997
SUPERSEDING
MIL-J-29396A(MC)
23 June 1995

DETAIL SPECIFICATION

JACKET, WOMAN'S - SPECIAL FULL DRESS SCARLET, U.S. MARINE BAND, MUSICIAN

This specification is approved for use by U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1. Scope. This specification covers requirements for women musicians' scarlet wool special dress jackets.

1.2. Classification. The jacket will be of one type in the following sizes as specified (see 6.2):

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-D), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Schedule of sizes

Short	Regular	Long
2	2	
4	4	4
6	6	6
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
	18	18

2. APPLICABLE DOCUMENTS

2.1. General. The documents listed in this section are specified in sections 3 and 4 of this specification. This section does not include documents cited in other sections of this specification or recommended for additional information or as examples. While every effort has been made to ensure the completeness of this list, document users are cautioned that they must meet all specified requirements documents cited in sections 3 and 4 of this specification, whether or not they are listed.

2.2. Government documents.

2.2.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation (see 6.2).

SPECIFICATIONS

FEDERAL

A-A-50186 - Cloth, Cotton, Buckram
A-A-50196 - Thread, Silk
A-A-50198 - Thread, Gimp, Cotton, Buttonhole
A-A-50199 - Thread, Polyester Core, Cotton or Polyester Covered
A-A-52071 - Tape, Textile, Cotton, General Purpose (Unbleached, Bleached, or Dyed)
A-A-52094 - Thread, Cotton

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

A-A-52106 - Cloth, Twill or Plain Weave, Polyester and Polyester Blend
DDD-L-20 - Label: For Clothing, Equipage and Tentage (General Use)

DEPARTMENT OF DEFENSE
MIL-C-368 - Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-DTL-3461 - Button, Insignia, Metal, Uniform and Cap
MIL-P-15064 - Pads, Shoulder and Sleeve-Head
MIL-C-21115 - Cloth, Tropical: Wool, Polyester and Rayon
MIL-C-41820 - Cloth, Gabardine, Polyester and Rayon
MIL-C-44296 - Cloth, Fusibles
MIL-DTL-82114 - Coat Front - For Coats, Musician

STANDARDS

FEDERAL
FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitches, Seams and Stitchings

(Unless otherwise indicated, copies of the above specifications, standards, handbooks are available from the Standardization Document Order Desk, 700 Robbins Avenue, Building 4D, Philadelphia, PA 19111-5094.)

2.3. Non-Government publications. The following document(s) form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DoDISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DoDISS are the issues of the documents cited in the solicitation (see 6.2).

ANSI/ASQC Z1.4 - Sampling Procedures and Tables for Inspection by Attributes

(Applications for copies should be addressed to The American National Standards Institute, 11 West 42nd Street, New York, NY 10036.)

Department of Defense (DoD) Standard Color Card of Official Standardized Shades for Sewing Threads 1968

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

(Application for copies should be addressed to the Color Association of the United States, Inc., 409 W. 44th Street, New York, NY 10016-0927.)

2.4. Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1. Standard sample. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2. First article. When specified (see 6.2), a sample shall be subjected to first article inspection in accordance with 4.3.

3.3. Materials.

3.3.1 Basic material. The basic material shall be cloth, wool, tropical, scarlet, shade 2502 (see 6.3), 10.5 ounce conforming to type I, class 1 of MIL-C-21115.

3.3.2 Collar, cuff and shoulder strap material. The material for the collar, shoulder strap and cuffs shall be cloth, polyester/wool blend, black, shade 2607 (see 6.3), conforming to type III, class 1 of MIL-C-21115.

3.3.3 Lining. The material for lining the body and collar, and for making the front facing eyelet cover and jacket hanger shall be cloth, rayon twill, scarlet, shade 2506 (see 6.3), conforming to class 1 of MIL-C-368.

3.3.3.1. Bias binding. The binding of the underarm shield shall be bias cut out of the lining material specified in 3.3.3. The binding shall be cut 5/8 to 7/8 inches wide and shall have sized edges.

3.3.4 Piping. The material for piping shall be cloth, gabardine, polyester and rayon, white, shade 3042 (see 6.3), conforming to type I of MIL-C-41820, cut 5/8 to 3/4 inch wide for

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

piping the lower collar edge and ornamental sleeve cuff and 1 inch wide for piping the front and bottom edges of jacket.

3.3.4.1. Vinyl piping. The white vinyl cord for piping the upper edge of the collar shall be tubular, with 7/16 inch wide welt and serrated edge.

3.3.5 Cloth, twill or plain weave, polyester or polyester blend. The stays for armhole and shoulder seams, the collar interlining and the binding for the neck edge of the front interlining shall be cut from cloth, twill or plain weave, polyester or polyester blend, conforming to class 1 of A-A-52106. The cloth shall be black, shade 2607. The requirements for nonfibrous material and seam efficiency shall not apply.

3.3.6 Front interlining. The interlining for the fronts and side front shall be fusible cloth conforming to type V, class 2 of MIL-C-44296.

3.3.7 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram, double texture, natural color, conforming to type I of A-A-50186.

3.3.7.1. Plastic. The plastic strip used in the collar interlining shall be clear plastic pattern stock 0.20 inch thick. It shall be cut using the cotton buckram pattern.

3.3.8 Jacket fronts. The jacket fronts shall conform to class 3 of MIL-DTL-82114.

3.3.9 Shoulder pads. The shoulder pads shall conform to the requirements of type I, class 2 of MIL-P-15064.

3.3.10 Sleeve-head pads. The sleeve-head pads shall conform to type IV of MIL-P-15064.

3.3.11 Stay tape. The stay tape for the armholes and waist seam shall be cotton, 1/4 inch wide, conforming to type II, class 1 of A-A-52071, except the requirement for nonfibrous material shall not apply.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

3.3.12 Thread.

3.3.12.1.Silk thread. The silk thread shall conform to A-A-50196 as follows, except the requirements for extractable matter shall not apply:

Use	Type	Ticket No.	Ply
Bartacks and all outside seaming and stitching.	I	A	3
Machine felling.	I	O	3
Making buttonholes in jacket.	I	B and F	3
Hand felling; and hand sewing.	III	C	2

3.3.12.2.Cotton thread. The cotton thread shall conform to A-A-52094 as follows:

Use	Type	Ticket No.	Ply
All inside seaming and stitching.	III	A	3
Serging and overedge stitching.	I	70	2
Machine tacking armholes and sewing on buttons.	I	40	3

The thread for basting shall be good commercial grade cotton. As an alternate to the cotton thread, a polyester core, cotton or polyester covered thread conforming to A-A-50199, ticket No. 50, 2-ply or ticket No. 70, 2-ply may be used.

3.3.12.3.Color and colorfastness. All thread shall be scarlet, shade W, cable No. 66040 (see DoD Standard Color Card of Official Standardized Shades for Sewing Threads 1968), except: the silk thread for stitching collar, cuffs and braid, which shall be black; the cotton thread for basting and machine tacking armhole, which may be white; and the cotton thread for overedge stitching the piping at the bottom edge of jacket shall be white. The colored threads shall show the following colorfastness when tested as specified in the applicable thread specification:

Thread	Color	Wet (dry) cleaning	Light
Cotton	Scarlet	Good	--
Silk	Scarlet	Fair	Fair
Silk	Black	Good	Good

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

3.3.13 Gimp. The buttonhole gimp shall be cotton, ticket No. 8, soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be scarlet, shade W, cable No. 66040 and shall show good fastness to wet (dry) cleaning.

3.3.14 Buttons.

3.3.14.1. Insignia buttons. The insignia buttons shall be metal, gold plated, 27-line for shoulder straps, sleeves and 40-line for front closure conforming to type I, style 3, class A, subclass 1 of MIL-DTL-3461.

3.3.14.2. Ring toggles. Ring toggles for securing buttons to fronts and sleeves shall conform to MIL-DTL-3461.

3.3.15 Collar closure hook and eye. The hook and eye for closing the collar shall be brass, black, japanned finished or black chemical finish, followed by a clear lacquer coating and conform to the requirements of Figure 4.

3.3.16 Labels. Each jacket shall have a combination instruction/ identification label and a size label as follows. The jacket is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.16.1. Combination identification/instruction label. The combination identification/instruction label instruction shall conform to type VI, classes 1 and 10 (combined), of DDD-L-20 except all printing and the space between the lines of printing shall be minimum 10 point (approximately 1/8 inch). The content and format shall be as follows:

Collar size:
Nomenclature: (item description)
Contract number:
Name of contractor:
Wool Products Act information:

3.3.16.2. Size label. The size label shall conform to type VI, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letter S, R, or L, for Short, Regular and Long, as shown by the following example:

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

3.4. Design. The jacket shall be U.S. Marine Corps design shown on Figures 1 and 2, a formfitting, fully-lined jacket with two-piece front, four-piece back, sleeve cuffs, shoulder straps with buttons, a standup collar with hooks and eyes for front closure and seven gold insignia buttons on the right front. The ends and bottom edge of collar, front and bottom edges of jacket, the top edge of sleeve cuffs and edges of shoulder straps shall be piped with material. The top edge of the collar shall be piped with white vinyl cord.

3.5. Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard pattern. The standard pattern shall provide 3/4 inch allowance for side seams, 5/8 inch allowance for center back seam and 3/8 inch allowance for all other seams except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

3.5.1 List of pattern parts. The jackets shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

ITEM	PATTERN NOMENCLATURE	NO. OF CUT PARTS
	Material basic: Cloth, wool tropical	
1	Center front	2
2	Side front	2
3	Side back	2
4	Center back	2
5	Top sleeve	2
6	Under sleeve	2
7	Front facing, right	1
8	Front facing, left	1
9	Underarm shield	2
	Material: Cloth, polyester/wool black	
10	Collar outerply	1
11	Sleeve cuff	2
12	Sleeve cuff eyelet facing (top ply)	2
13	Sleeve cuff eyelet facing (under ply)	2
14	Shoulder straps	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

ITEM	PATTERN NOMENCLATURE	NO. OF CUT PARTS
	Material: Cloth, rayon twill	
15	Front	2
16	Side back	2
17	Center back	2
18	Top sleeve	2
19	Under sleeve	2
20	Collar lining	1
21	Front facing eyelet cover	1
22	Shoulder eyelet cover	2
	Material: Cloth, cotton buckram	
23	Collar interlining	1
	Material: Cloth, twill or plain weave, polyester or polyester blend	
24	Collar interlining	1
	Material: Cloth interlining (fusible)	
25	Center front	2
26	Side front	2
	Marker	
27	Sleeve cuff and eyelet marker	
	Shaper	
28	Bottom shaper	

3.6. Construction.

3.6.1 Manufacturing requirements. The jackets shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the jackets.

3.6.1.1. Stitches, seams and stitchings. The stitch, seam, and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching and serging shall be done on serging machines with knife attachment properly set to trim the raveled edge without cutting the material.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

3.6.1.2. Thread breaks and ends of seams. The ends of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitchings shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of each jacket cut from one piece of the wool and lining material, including pairs of sleeve linings and underarm shields when not cut from ends, shall be shade marked to ensure uniform shade and size throughout the garment. Any method of shade marking may be used except:

a. Corrosive metal fastening devices.
b. Sew-on shade tickets.
c. Adhesive type tickets which show discoloration or leave traces of paper or adhesive mass to the material upon removal of the tickets.

3.6.3 Fusing operations. The fusing operations for fusing the fusible interlining specified in 3.3.6 to the basic material of the outer shell specified in 3.3.1 shall be performed on a fusing press. Specific settings (see 6.5) for the particular fusible style and press to be used should be obtained from the supplier of the fusible material so that the optimum results can be obtained.

TABLE I. Manufacturing requirements.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
1	Cutting. a. Cut jackets in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction of the warp as indicated by the directional lines on the pattern. c. Cut all scarlet wool parts of the coat from one piece of the basic material.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
1	Cutting. (cont'd) d. Cut the body and collar linings, shoulder eyelet covers and left front facing eyelet cover from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the sleeve lining shall match. Cut the strips for the jacket hanger 1-1/8 inches wide. Cut front eyelet cover in accordance with the pattern. e. Cut the sleeve cuffs, outer ply of collar, shoulder straps and cuff eyelet facings from one piece of the material specified in 3.3.2. f. Cut twill or plain weave, polyester or polyester blend or polyester and cotton stays for armhole and shoulder seams on the bias 3/4 inch wide and 4 ± 1/4 inches long. Cut twill or plain weave, polyester or polyester blend or polyester and cotton for collar interlining in accordance with the patterns furnished. Cut the twill or plain weave, polyester or polyester blend or polyester and cotton for binding the neck edge of the jacket from interlining on the bias, 3/4 inch wide and approximately 5 inches long. g. Cut the cotton buckram for interlining the collar on the straight in accordance with the pattern furnished. h. Cut the piping material (see 3.3.4) for piping the front and bottom edges of jackets, lower edge and end of collar and top edge of ornamental sleeve cuffs. The piping shall be cut 5/8 to 3/4 inch wide for collar and ornamental sleeve cuffs, and 1 inch wide for bottom and front edges of jacket.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
2	Replacement of damaged parts.					
	a. Replace at time of cutting any part of jacket containing holes, seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc., affecting appearance.					
	b. Replace any part damaged during the manufacturing process by needle chews which may develop into holes, scissor or knife cuts, tears, holes, mends or burns in the material, affecting appearance.					
3	Shade marking.					
	a. Mark or ticket all component parts (see 3.6.2) cut from one piece of the basic material. Mark or ticket all component parts cut from one piece of rayon lining material and the pairs of sleeve linings when cut from ends.					
	b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					
4	Make jacket hanger.					
	Finished appearance. The jacket hanger shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8 inch wide strip of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	10-14	A	A
	b. Cut the jacket hanger 3-3/4 ± 1/4 inches long.					
5	Make shoulder strap eyelet cover.					
	Finished appearance. The shoulder strap eyelet cover shall finish 1-3/4 ± 1/8 inches wide.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	a. Turn under the side edges of the eyelet covers and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1 (each side edge)	10-14	A	A
5	Make shoulder strap eyelet cover. (cont'd)					
	b. Fold each cover in half across the width and stitch 1/16 inch from the folded side edges.	301	SSa-1	10-14	A	A
6	Make underarm shields.					
	Finished appearance. The underarm shields shall finish smooth and flat without puckers, pleats, gathers or other distortions.					
	a. Bind the rounded edge of shield with bias binding, turning under the outside edge of the binding only and catching the turned under portion in the stitching 1/16 inch from the folded edge.	301	BSb-1	10-14	A	A
	b. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
7	Make cuffs and eyelet opening.					
	Finished appearance. The cuffs shall be uniform in appearance, shall finish smooth and flat, without twists, gathers, pleats, puckers or other distortions. The cuffs shall finish 5 inches high at the point on top sleeve and 3 inches high at the backarm, including piping. The piping shall extend uniformly 1/8 inch beyond the seamed edges of the sleeve cuff.					
	a. The cuffs shall be made of one ply of material specified in 3.3.2 piped with material specified in 3.3.4.					
	b. Position one ply of the cuff eyelet facing on the outside of sleeve cuff, face to face, with back edges even and notches matching. Join the two plies together from notch to notch with 3/8 inch seam.	301	LSq-2 (a)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	c. Extend the depth of the notches to the seam line. Turn back the facing and topstitch the facing to the cuff 1/16 to 1/8 inch from the raised edge.	301	LSq-3 (b)	10-14	A	A
	d. Mark location for three eyelets on each cuff for removable buttons.					
7	Make cuffs and eyelet opening. (cont'd)					
	e. Make 1/8 inch eyelet on each of the marks through both plies.	Eyelet		22 per eyelet	A	A
	f. Position the cuffs on the facing with back edges even and notches matching, with the right side faced up. Stitch the ends of the opening through the facing 1/4 inch from back raw edges.	301	SSa-1 (each end)	10-14	A	A
	g. Position the strip of piping material on the outside of sleeve cuff and stitch together 1/8 inch from the upper curved and pointed edge of cuff.	301	BSm-1 (a)	10-14	A	A
	h. Turn back the cuff and piping, working the folded edge of the piping 1/8 inch beyond edge of cuff. Topstitch the cuff to the piping 3/16 inch from folded edge of piping.	301	SSa-1	10-14	A	A
	i. Press the cuffs smooth and flat with a heated pressing iron or pressing machine.					
8	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of under sleeve and with the notches in the lower forearm edge of top and under sleeve matching. Seam top and under sleeve together 3/8 inch from forearm edge of top sleeve, forming a tapered outlet on the under sleeve.	301	SSbd-1 to SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	b. Spread open the seam and press flat with a heated pressing iron.					
9	Join cuffs to sleeve.					
	Finished appearance. The cuff shall be uniformly stitched to the sleeve without twists, gathers, puckers or raw edges. In the finished jacket (after pressing), the point of the cuff shall be centered between the lower forearm edge and the backarm edge of sleeve.					
	a. Mark the sleeves in accordance with the sleeve cuff marker for positioning of the cuffs, with notch on the cuff marker matching the forearm seam line and bottom edge of marker in line with the bottom raw edge of sleeve.					
	b. Position the piped edge of cuff at the mark and stitch cuff to sleeve along the piped edge. The line of stitching shall be adjacent to the stitching of the cuff piped edge.	301	LSa-1	10-14	A (silk)	A
	c. Lift the cuff up and stitch the bottom edge of sleeves to the eyelet facing 1/4 to 3/8 inch from the bottom raw edge.	301	SSa-1	10-14	A	A
	d. Trim excess facing even with the bottom edge of sleeve.					
10	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without distortions and shall start and finish evenly.					
	a. Join the top and under sleeves together at the backarm with a 3/8 inch seam, catching the ends of the cuff in the seam and leaving an opening on the cuff between notches.	301	SSa-1	10-14	A (silk)	A
	b. Spread open the sleeve and cuff seams and press smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
11	Baste and tack cuff to sleeve.					
	a. Turn the bottom of the cuff to the inside against the bottom edge of sleeve in accordance with notches, and bast along the turned edge of the cuff.	301 or Hand				
	b. Tack the raw edge of cuff to the body of sleeves with blind stitching. The blind stitching shall not be exposed on, or caught to, the outside of the cuff.	301	EFe-1	4-6	A	A
	c. On the finished jacket, the height of the cuff, when measured from folded bottom edge of cuff, shall be 3 ± 1/8 inches at the forearm and backarm seams, and 5 ± 1/8 inches at the point.					
12	Seam sleeve lining at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without puckers, twists, gathers or pleats and shall start and finish evenly.					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the notches in lower forearm edge of top and under sleeve linings matching. Seam the top and under sleeve lining together 3/8 inch from the forearm edge of top sleeve lining, forming a tapered outlet on the under sleeve lining.	301	SSbd-1 or SSa-1	12-16	A	A
13	Seam sleeve lining at backarm.					
	Finished appearance. The backarm shall finish smooth and flat, without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve linings at the backarm with a 3/8 inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
14	Assemble sleeve and sleeve lining. Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers or pleats.					
14	Assemble sleeve and sleeve lining. (cont'd) a. Position the sleeve lining on the sleeve with upper edge of the lining extending approximately 1 inch beyond the armhole edge of the sleeve.					
	b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the sleeve, commencing at the top edge of the cuff and extending to approximately 6 inches from the armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand		4-6 1-2	A	A
	c. Turn sleeve lining over the sleeve.					
15	Fell sleeve lining turnup/press sleeves. Finished appearance. The sleeve lining shall not be short, tight or twisted at bottom of sleeves.					
	a. Turn under the bottom edge of the sleeve lining to finish 1 to 1-1/4 inches above the finished end of sleeve, and baste to turnup of cuffs, or the sleeve lining may be felled to bottom sleeve without basting.	101 or Hand				
	b. Fell the folded edge of sleeve lining to the turnup of the cuff with blind stitching.	Hand or 301	EFc-1 (b)	8-10 6-8	C (silk) 0 (silk)	 0 (silk)
	c. Turn sleeves right side out and assemble in pairs. Insert a sleeve pad in the sleeve to avoid creasing the front and back edges and press smooth and flat with a heated pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
16	Assemble collar interlining. a. The collar interlining assembly shall consist of one ply of buckram and one ply of twill or plain weave, polyester or polyester blend or polyester and cotton.					
16	Assemble collar interlining. (cont'd) b. Position the twill or plain weave, polyester or polyester blend or polyester and cotton and buckram interlinings for the collar with all edges even and seam together 1/8 to 3/16 inch from the edges.	301	SSa-1 (each edge)	10-14	A	A
17	Pipe outer ply of collar. Finished appearance. The piping shall extend at the lower and side edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers or pleats. a. The outer ply of the collar shall be made of one ply of material specified in 3.3.1, piped with material specified in 3.3.4.					
	b. Seam a 5/8 to 3/4 inch wide strip of piping to outer ply 1/8 inch from sides and lower edge.	301	SSaa-1	10-14	A (silk)	A
	c. Turn back the piping and outer ply, uniformly working the folded edge of the piping beyond the edges. Topstitch the outer ply uniformly 3/16 inch from the folded edge of piping.	301	SSa-1	10-14	A (silk)	A
18	Assemble collar. Finished appearance. The collar shall be assembled without twists, gathers, puckers, or pleats.					
	a. Position the interlining assembly on the inside of the outer ply under the unattached edge of piping. Tack all the raw edges of piping to the twill or plain weave, polyester or polyester blend or polyester and cotton interlining, making the outer ply form a smooth and snug fit.	Hand		2-3	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	b. Fold the upper raw edge of the outer collar over the interlining and tack to the twill or plain weave, polyester or polyester blend.	Hand		2-3	C (silk)	
	c. Press the collar smooth and flat with a heated pressing iron or pressing machine.					
18	Assemble collar. (cont'd)					
	d. Position the collar on the vinyl cord, with the upper edge of the collar abutted against the cord edge. Stitch collar to the vinyl cord 1/16 inch from edge of collar. Trim the ends of the cord even with the ends of the collar.	301	LSa-1	10-14	A (silk)	A
	e. Lap the upper cord edge of collar over the top raw edge of collar lining approximately 1/2 inch with lining face up. Stitch collar to the lining along the cord edge adjacent to the stitching line of the collar. The collar lining shall extend not less than 2-1/2 inches beyond the left end of the collar and 1/2 inch beyond the right end of the collar for the extension tab.	301	SSa-1	10-14	A (silk)	A
	f. Turn collar lining at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine.					
19	Make collar extension tab.					
	Finished appearance. The collar extension tab shall extend 3/4 to 1 inch beyond the folded edge of the right end of the collar.					
	a. Turn the top and bottom edges and the end of the collar lining at the right end of the collar to the inside of the lining and baste the turned portion along the top, front and bottom edges to the body of the lining, forming the collar extension tab.	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	b. Stitch the collar extension tab 1/16 inch from the top, front and bottom edges and continue the stitching at the back of tab to top row, forming a 1-3/8 to 1-1/2 inch wide box stitch.	301	SSc-1 (top & bottom edges) OSf-1 (front edge) SSa-1 (back edge)	10-14	A (silk)	A
20	Assemble body lining.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					
	a. The body lining shall consist of a front, a side back panel, and center back panel.					
	b. Fold the front lining lengthwise with notches matching, and stitch front darts in accordance with marks as indicated on the patterns. The line of stitching for the darts shall be 3/8 inch from the folded edge of the dart at the bottom tapering to a flat point at the top end, and securely backtacked.	301	OSf-1	10-14	A	A
	c. Position the center back lining with back edges even and notches matching. Seam together from the upper notches for a distance of approximately 2 inches, and from that point seam horizontally to 3/8 inch from the back edge, and continue seaming to the bottom end of lining.	301	SSa-1	10-14	A	A
	d. Position the center back to the respective side backs with edges even and notches matching. Join together with 3/8 inch seam.	301	SSa-1	10-14	A	A
	e. Position side back and side front face to face with edges even and join together at the side with 3/4 inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	f. Press the darts and side seams of lining smooth and flat with a heated pressing iron toward the back, and press the left and right side back lining seam toward center back.					
	g. Press the pleat at center back smooth and flat from top to bottom edge. The folded edge of pleat on the outside of lining shall be toward the right side as worn.					
21	Make front eyelet cover.					
	a. Fold front eyelet cover in half lengthwise and stitch across the bottom edge with a 1/4 inch seam.					
	b. Turn cover right side out, press and crease the folded edge smooth and flat with a heated pressing iron.					
22	Attach front eyelet cover to facing.					
	a. Position the eyelet cover on the outside of the right front facing, with the top, bottom and front raw edges even. Stitch the cover to the facing 3/16 to 1/4 inch from raw edges.	301	SSa-1	10-14	A	A
23	Seam wool facing to lining assembly.					
	Finished appearance. The lining shall be carefully aligned and seamed to the facing so that in the finished jacket, the lining shall lie smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.					
	a. Position the lining on the wool facing with the top edges even and notches matching.					
	b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from the top edge of the facing to approximately 1 inch from the bottom edge of facing.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
24	Sew on identification label.					
	Finished appearance. The identification label shall be positioned so that in the finished jacket, the label shall be midway between front and back edge of the left facing, with the bottom edge of label approximately 4 inches from the bottom finished edge of jacket.					
	a. Sew the identification label to the outside of the left facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge)	10-14	A	A
25	Make shoulder straps.					
	Finished appearance. The piping shall be uniformly stitched to the shoulder straps without twists, gathers, puckers or pleats and shall be evenly and uniformly worked out to the edges. The straps shall finish smooth and flat and shall be uniform in appearance.					
	a. The shoulder straps shall be made of one ply of basic material piped with white gabardine, polyester and rayon cloth.					
	b. Seam a 5/8 inch wide strip of white piping to the shoulder straps, along front and back edges and around collar end, 1/8 inch from edges.	301	SSe-2 (a)	10-14	A or A (silk)	A or A
	-or-					
	c. Fold the white piping, slightly offsetting the raw edges and seam to edge as above.	301	SSav-2 (a)	10-14	A or A (silk)	A or A
	d. Turn back the straps and white piping, uniformly working the folded edge of the piping 1/8 inch beyond the ends of the straps. Topstitch the straps uniformly 3/16 inch from the folded edges of piping. Clip the excess white material at the collar end so that the strap will lie flat.	301	BSm-2 (b)	10-14	A (silk)	A
	e. Press the strap smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
26	Assemble fronts. Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly. a. The assembly shall consist of front, side front, side back and center back.					
26	Assemble fronts. (cont'd) b. Position the front and side front interlining on the inside of their respective front and side front and fuse (see 3.6.3).					
	c. Fold the side fronts lengthwise with notches matching. Stitch the entire length of the dart 3/8 inch from the lower end and tapering to a point at the upper end.	301	OSf-1	10-14	A	A
	d. Position the front and side front panel with edges even, and join together with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	e. Spread open seams and press smooth and flat with a heated pressing iron. f. Press the waist darts flat on the dart seam without turning the dart to the right or left.					
27	Join backs. Finished appearance. The side and center backs shall be joined without gathers, puckers or pleats.					
	a. Position the center backs with edges even, and join together with a 5/8 inch seam, from the top to the bottom edge.	301	SSa-1	10-14	A	A
	b. Join the left and right side backs to the respective center backs with 3/8 inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
28	Join back and front at sides.					
	a. Position the side back and side fronts face to face with edges even, and join together at the side with 3/4 inch seam.	301	SSa-1	10-14	A	A
	b. Spread open side and back seams and press smooth and flat with a heated pressing iron.					
	c. Mark and shape the bottom of front and back in accordance with the pattern shaper.					
29	Seam reinforcement stay to shoulder, armhole, gorge and neck.					
	Finished appearance. The reinforcement stays shall be sewn to the armhole and shoulder edge of the front without gathers, puckers or pleats. The top end of the armhole stay and lower end of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4 inch wide stays to the underside of the front along the shoulder edges and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from neck and armholes respectively. The strip for the upper edge of armholes shall be positioned approximately 1/2 inch from the shoulder. The strip for the gorge shall be positioned approximately 1/2 inch from shoulder seams across center back. The strip for the neck shall be positioned 1/2 inch from shoulder seams to 1/2 inch from front collar notches.	301	SSaa-1	10-14	A	A
30	Mark and dress left front.					
	a. Mark and dress the left front edge of jacket, from the top notch to the bottom notch. The mark line shall be 1 inch from the upper front edge to the bottom front edge.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	NOTE: The dressing and shaping of the left front shall be performed in the sewing room.					
31	Tape armholes.					
	a. Sew the cotton tape to the armhole starting with one end approximately 1 inch above the notch in the fronts and continuing along the lower and back edge of the armhole to approximately 1 inch from shoulder edge.	301	SSaa-1	10-14	A	A
31	Tape armholes. (cont'd)					
	b. The tape shall be stitched with slight tension along the lower front edges of the armholes and shall be held taut while stitching along the back edge.					
32	Press shoulder blades and armhole tapes.					
	a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or suitable type pressing machine.					
33	Stitch piping to jacket.					
	Finished appearance. The piping shall be uniformly stitched to the jacket without twists, puckers or pleats. The piping shall extend from the collar notch at top edge of the right front to the collar notch at top edge of the left front.					
	a. Position the 1-1/4 inch wide strip of piping material on the outside of left and right front, with one edge even with top, front and bottom edges of jacket. Stitch piping to jacket 1/8 inch from edge. The piping shall extend from the collar notch at the top, along the left and right front and the bottom edge of the jacket.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	b. Turn the piping to the inside, working out the folded edge of piping 1/8 inch beyond edges of jacket. Topstitch jacket to the piping 3/16 inch from the folded edge of piping, catching the turned under portion of the piping in the stitching.	301	SSe-2 (b)	10-14	A	A
	c. Notch out the excess piping material at the top and bottom front corners to eliminate bulkiness. Trim the inner edge of piping on the left front only from the upper front down to approximately 1 to 1-1/2 inches from bottom edge of front, so that the piping will not interfere with front buttonholes.					
34	Interline fronts.					
	a. Position the left and right fronts on the respective jacket front interlining and baste the front to the interlining from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom edge of the front.	301 or Hand	Hopper			
	b. Baste along the shoulder, allowing room for setting the shoulder pad and working the fullness toward the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulders to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of fronts.	301 or Hand	Hopper			
35	Trim jacket front interlining.					
	a. Trim the top edge of jacket interlining even with the top edge of fronts from the point of shoulder to the collar notch.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	b. Notch the top edge of the interlining in line with the collar notch.					
	c. Remove stitches joining front edge of twill or plain weave, polyester or polyester blend or polyester and cotton to jacket front interlining, approximately 1/2 inch back from front and top edge of fronts.					
	d. Turn the jacket inside out and trim the interlining only, approximately 1/4 inch back from the front and top edge of fronts.					
35	Trim jacket front interlining. (cont'd)					
	e. Trim the shoulder edge of the jacket front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					
36	Bind front edge and gorge of interlining.					
	Fold twill or plain weave, polyester or polyester blend or polyester and cotton back over the top and front raw edge of the interlining. Stitch along the top and front edge with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the turned-under portion in the stitching.	301	EFa-3	8-10	A	A
37	Bind top neck edge of interlining.					
	Finished appearance. The twill or plain weave, polyester or polyester blend or polyester and cotton binding shall be uniformly stitched along the gorge of the jacket front interlining from the collar notch to the shoulder point.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	a. Lap the 3/4 inch wide strip of binding on the outside of the jacket front interlining from the collar notch to shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	8-10	A	A
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301	SSa-1	10-14	A	A
38	Fell piping to jacket front interlining.					
	a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	101				
38	Fell piping to jacket front interlining. (cont'd)					
	b. Fell the front and lower edge of the piping to the jacket front interlining.	301 or Hand	EFc-1	4-6	A C (silk)	A C
	c. Tack the raw edge of the bottom piping to each seam allowance of jacket.	301 or Hand	SSa-1	4-6	C (silk)	C
	d. Pull and remove basting stitches from piping.					
	e. Press the left and right fronts, respectively, on a suitable type heated pressing machine with the chest to conform to the shape of the body.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
39	Join facing to fronts.					
	a. Position the left and right fronts to the respective front facing (face to face), with the notch of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark the facing along the top, front and bottom edges of jacket.					
	b. Lap the front edge of the right and left fronts, respectively, on the outside of the facing at the marks and join the fronts to facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to bottom edge of jacket front edge only and the eyelet cover shall be caught in the stitching.	301	LSa-1	10-14	A	A
	c. Trim excess facing material where necessary.					
40	Baste front edges.					
	a. Turn the facing-lining assemblies to the inside of fronts, completely working out the edges.					
	b. Baste along the front edge of left and right fronts, working the facing and eyelet cover back from the folded edge of piping.	101 or Hand				
41	Baste facing (second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the jacket, holding the lower corner of the jacket in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 301	Hopper			
	b. Turn under and baste the top edge of the facing even with the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of facings to approximately 1-1/4 inches from the lower edge of facing.	Hand or 301	Hopper			
	d. Turn under the bottom edge of facing at the mark and baste along the folded edge.	Hand or 301	Hopper			
42	Tack facing to interlining.					
	a. Tack the right and left facing-lining seam allowance to the respective jacket front interlining from approximately 2 inches from bottom edge of jacket to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6		
43	Baste linings to jacket.					
	a. Fold the front lining in accordance with the notches forming the chest pleat, and baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
43	Baste linings to jacket. (cont'd)					
	b. Baste the front lining to the jacket, starting at the lower end of the chest pleat, continuing along lower edge of armhole approximately 2 inches from the edge and ending at the side seam. Match side seams of jacket and lining and continue basting as close as possible to the side seam and then across the bottom towards the front approximately 4 inches from piped bottom edge of jacket.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
44	Baste back lining to jacket.					
	a. Fold the back lining, forming approximately a 1 inch wide pleat at the center back. Baste the back lining to the jacket along the center pleat from the top approximately 3 inches from the bottom finished edge of jacket.	Hand or 301	Hopper			
	b. Baste back lining to jacket starting at side seam and continuing approximately 3 inches from the armhole and shoulder edges, allowing room for shoulder pad.	Hand or 301	Hopper			
	c. Turn under the bottom edges of front and back lining, and baste along the bottom edge of jacket, with the folded edge of lining positioned approximately 1/2 inch from the bottom piped edge of jacket.	Hand or 301	Hopper			
45	Fell lining to bottom piping.					
	a. Fell the turned under portion of lining along the bottom piping of the jacket with blind stitching 1/4 to 3/8 inch from the bottom folded edge of lining. Only the under ply of the folded edge of lining shall be caught in the stitching.	301 or Hand	EFc-1 (b)	6-8	0 (silk) C (silk)	0
46	Trim lining and interlining.					
	a. Trim the excess jacket front interlining and front lining at the armhole.					
	b. Trim the back lining even with the neck.					
46	Trim lining and interlining. (cont'd)					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
47	Press fronts. Press each front smooth and flat on a suitable type heated pressing machine to conform to the shape of the body and eliminate excess fullness in the breast.					
48	Make buttonholes. Finished appearance. The buttonholes shall be clean cut, well made, well worked over gimp to fit 40-line insignia buttons. The gimp and thread shall be pulled through to the outside of the front. The purling of the buttonholes shall be on the outside of the front. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of jacket. The buttonholes shall be cut first type. a. Mark the left front for the location of seven buttonholes. The mark for the top and bottom buttonholes shall be in accordance with marks on the patterns. The marks for the remaining five buttonholes shall be evenly spaced.					
	b. Make a horizontal eyelet end, square-bar type buttonhole cut 1-1/4 inch long at each of the marks.	Button-hole		60 stitches per button-hole		
	c. Securely bartack the end of each buttonhole, catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bartack		21 per bartack	A (silk)	A
49	Baste shoulder pad to jacket. a. Insert shoulder pads between interlining and chest padding of jacket fronts. Securely tack the pad to the interlining and chest padding only.	Hand or 301	Hopper			
50	Seam shoulders. Finished appearance. The shoulder seam shall finish without a distorted appearance.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	a. Join the back to the front at the shoulders with a 3/8 inch seam, working in the fullness on the back in accordance with good manufacturing practice.	301	SSa-1	10-14	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulders short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
51	Set shoulder straps.					
	Finished appearance. The shoulder straps shall be uniformly stitched to the jacket without twists, puckers, pleats or other distortion. On the finished jacket, the shoulder strap shall measure 2-3/8 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches at the center of the insignia buttons.					
	a. Position the shoulder straps with the rounded end of the strap 7/8 inch from the gorge edge (neck) and with the notch at the back raw edge of shoulder strap aligned with the shoulder seam line at the armhole.					
51	Set shoulder straps. (cont'd)					
	b. Stitch shoulder strap to the jacket at the front and back edges and around the collar end as close as possible to, but not on top of, the stitching for the piping. Trim the shoulder strap even with the armhole, where necessary.	301	SSa-1	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
52	Baste shoulder.					
	a. Position the front lining and jacket front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn the jacket on the inside.	Hand or 301	Hopper			
53	Baste back lining and facing-lining assembly at shoulders.					
	a. Turn under and lap the shoulder edge of the back lining on the facing-lining assembly. Baste lining along the folded edge of the back lining with the top end of the chest pleat and eyelet cover caught in the basting.	Hand				
54	Seam neckline with size label and jacket hanger.					
	Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label shall be positioned between the ends of the jacket hanger and the ends of the jacket hanger shall be positioned so that in the finished jacket, the hanger opening shall be 2 ± 1/8 inches long when measured along the lower edge of collar lining.					
	a. Join facings and back lining to jacket at the neckline from collar notch to collar notch, with a 1/4 inch seam and with the upper edge of the size label and the ends of the hanger positioned and caught in the stitching at the inside center back.	301	SSa-1	10-14	A	A
54	Seam neckline with size label and jacket hanger. (cont'd)					
	b. Press the neckline of the jacket smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
55	Set collar.					
	Finished appearance. The collar shall be carefully joined to the jacket without distortion of the collar.					
	a. Mark the neckline on the outside 3/8 to 1/2 inch from collar notch up to the shoulder seam and gradually to within 1 to 1-1/4 inches at the center back for position of collar.					
	b. Position the collar with the lower edge lapped on the outside top edges of the jacket at the mark.					
	c. Stitch the collar from end to end, to the jacket, as close as possible to, but not on top of, the stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining.	301	LSa-1	10-14	A (silk)	A
56	Set sleeves.					
	Finished appearance. The armhole-sleeve seam shall finish without twists, gathers, puckers or pleats.					
	a. Position sleeves on outside of jacket at the armholes, with the back notch matching the side back seam, and with notch in top sleeve and front matching.					
	b. Join the sleeve to the jacket with a 3/8 inch seam, distributing the fullness in accordance with good manufacturing practice.	301	SSa-1	10-14	A	A
	c. Press the entire armhole smooth and flat with a heated pressing iron to remove fullness, exercising care not to stretch the armhole.					
57	Baste armhole.					
	a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing fullness evenly. Turn jacket on the outside.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of sleeves to the front notch of jacket.	Hand or 301	Hopper			
58	Set underarm shields to jacket.					
	a. Position the underarm shield on the lining side of jacket with the raw edges even with lower edge of armhole.					
	b. Baste the underarm shields to the jacket along the vertical center and top, side and bottom edges.	Hand or 301	Hopper			
59	Stitch sleeve-head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve-head pads and linings at the armhole.					
	a. Position the sleeve-head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam, and with one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve-head pad to the sleeve from end to end, through the armhole-sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.	301	SSa-1	4-6	24/4	24/4
	c. The underarm shield may be basted to the armhole prior to stitching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
60	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat and the eyelet cover in the felling. Fell the eyelet cover along the facing-lining seam line from the bottom edge up to the shoulder line.					
61	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve and sleeve lining matching.					
	b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the jacket around the entire armhole, placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge from backarm seam of sleeve to the front edge of the shield.	Hand		8-10	C (silk)	
	c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operation 60.a.	301	SSa-1	10-14	A	A
	-or-					
	d. Machine stitch the lower edge of the sleeve lining, at the armhole on the inside from forearm seam to backarm seam and stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling.	Machine		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
61	Fell sleeve lining at armhole. (cont'd)					
	NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.					
62	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of the jacket, starting at the bottom edge of the lining and continuing along the back and bottom edges of facing to the front edge of jacket, catching the eyelet cover in the felling.	Hand		8-10	C (silk)	
	b. Fell the folded edge of the facings to the piping along the top edge from collar to notch to front edge of jacket.	Hand		8-10	C (silk)	
	c. Fell the eyelet cover to the left front facing along the bottom edge of cover.	Hand		8-10	C (silk)	
	d. Tack the eyelet cover to the left front facing along the folded edge of lining. Place one tack midway between the second and third eyelet from the top, and one tack midway between the fourth and fifth eyelet from the top.	Hand		4-6 per tack	C (silk)	
63	Sew hook and eye to collar.					
	Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at the front of collar without misalignment.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	a. Position and securely sew the hook to the left end and the eye to the right end of the collar. The hook and eye shall be positioned with their front edges even with the respective front ends of the collar and securely sewn to the collar at the top and bottom of the forward edge of the hook and eye. The stitching on each side shall not be more than 3/8 inch from the front end of collar through the individual holes at the rear of the hook and eye.	Hand		16 per hook 16 per eye	C (silk)	
64	Finish collar.					
	a. Securely tack the lower corners of the collar to the jacket.	Hand		8-10	C (silk)	
	b. Turn under the end and top edge of the lining at the right and left end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge of the end to the stitching joining the lining to the collar.	Hand		8-10	C (silk)	
	c. Turn under and fell the lower edge of the collar lining to the jacket from end to end, catching the turned-under portion of the lining at the right and left end in the felling.	Hand		8-10	C (silk)	
	d. The lower edge of the collar lining may be basted to jacket prior to felling.	Hand		8-10	C (silk)	
	e. Turn back collar lining extension tab and hand fell directly behind eyes.					
65	Mark and make eyelets on right front and shoulders.					
	Finished appearance. The eyelets shall be worked with the purling on the outside of the jacket, and shall finish with 1/8 inch diameter openings. All stitches shall be securely caught in the fabric.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	a. Mark the right front for the location of the seven eyelets for removable insignia buttons to align with the buttonholes on the left front. The mark for the top eyelet shall be in line with the right end of collar and the remaining eyelets shall be in vertical alignment with the top mark.					
	b. Mark location of eyelet on shoulder strap 5/8 inch from the rounded piped edge and center at shoulder strap.					
65	Mark and make eyelets on right front and shoulders. (cont'd)					
	c. Make an eyelet on the right front at each mark through the facing. The eyelet cover on the inside of the right front shall not be caught in the stitching.	Eyelet		22 per eyelet	A (silk)	A
	d. Make one eyelet at the mark on each shoulder strap through all plies except the eyelet cover.	Eyelet		22 per eyelet	A (silk)	A
66	Clean jacket.					
	a. Pull all basting thread, trim and remove any loose ends of thread, and remove any spots, stains and tickets without injury to the material.					
	b. Buttonholes at front closure shall be examined for exposure of jacket front interlining cloth. The exposed interlining shall be colored with a reddish indelible ink.					
67	Press jacket.					
	a. The jacket shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices.					
	b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	c. Press the entire collar smooth and flat. d. Press the front on a body machine, shrinking and properly shaping the chest. e. Press the sides, working the fullness towards the back. f. Press the back smooth and flat, removing all fullness.					
67	Press jacket. (cont'd) g. Block the shoulders to remove fullness, and press shoulders smooth on a shoulder shaping machine. h. Press the armholes solid from the inside, creasing the armholes at the front, back and armpit. The armpit and the back of the armhole shall be held short while pressing. i. Block the armholes on a pressing block, shrinking the top sleeves. j. Insert a sleeve pad in the sleeves in order to prevent creasing and press sleeves smooth and flat. k. Press lower edge of jacket smooth, flat and even. Remove all impressions on the side and center back seam allowances. Press linings throughout, removing all wrinkles and creases. Press the front and back lining pleats smooth and flat. Remove all gloss marks.					
68	Attach buttons. a. Insert the shank of a 40-line insignia button through each eyelet on the right front and secure each button with a ring toggle. b. Insert the shank of a 27-line insignia button through each eyelet on the sleeve cuffs and secure each button with a ring toggle.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	c. Insert the shank of 27-line insignia button through each eyelet on the shoulder and secure each button with a ring toggle.					

3.7. Finished measurements. The finished jacket shall conform to the measurements shown in Table II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Table II. Finished measurements. 1/

Size	Breast 2/ (inches)	Back length 3/ (inches)	Sleeve length 4/ (inches)	Collar length 5/ (inches)
		Short		
2	33-1/2	16-1/2	16-1/4	13
4	34-1/2	16-3/4	16-1/4	13-1/2
6	35-1/2	17	16-1/4	14
8	37	17-1/4	16-1/4	14-1/2
10	38-1/2	17-1/2	16-1/4	15
12	40	17-3/4	16-1/4	15-1/2
14	42	18	16-1/4	16
16	44	18-1/4	16-1/4	16-1/2
		Regular		
2	33-1/2	17-1/2	17-1/4	13
4	34-1/2	17-3/4	17-1/4	13-1/2
6	35-1/2	18	17-1/4	14
8	37	18-1/4	17-1/4	14-1/2
10	38-1/2	18-1/2	17-1/4	15
12	40	18-3/4	17-1/4	15-1/2
14	42	19	17-1/4	16
16	44	19-1/4	17-1/4	16-1/2
18	46	19-1/2	17-1/4	17
		Long		
4	34-1/2	19	18-1/2	13-1/2
6	35-1/2	19-1/4	18-1/2	14
8	37	19-1/2	18-1/2	14-1/2
10	38-1/2	19-3/4	18-1/2	15
12	40	20	18-1/2	15-1/2
14	42	20-1/4	18-1/2	16
16	44	20-1/2	18-1/2	16-1/2
18	46	20-3/4	18-1/2	17

1/ Tolerance on all measurements ± 3/8 inch.

2/ Bust measurement taken with jacket buttoned, from folded edge to folded edge in line with pit of armhole; multiply by 2.

3/ Back length measurement taken along center back seam from lower edge of collar to bottom edge of jacket.

4/ Sleeve length measurement taken along forearm seam from pit of armhole to bottom edge of sleeve.

5/ Collar sizes represent length of collar in inches measured from end to end along the center.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

3.8. Workmanship. The finished jacket shall conform to the quality and grade of product established by this specification.

3.9. Recycled, recovered, or environmentally preferable materials. Recycled, recovered, or environmentally preferable materials should be used to the maximum extent possible provided that the material meets or exceeds the operational and maintenance requirements, and promotes economically advantageous life cycle costs.

4. VERIFICATION

4.1. Classification of inspection. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.3).
b. Conformance inspection (see 4.4).

4.2. Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the provisions set forth in ANSI/ASQC Z1.4.

4.3. First article inspection. When first article is required, inspection shall be made of a completely fabricated jacket for all provisions of this specification.

4.4. Conformance inspection.

4.4.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extend applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table III for characteristics noted.

4.4.1.1. Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following. The lot shall be unacceptable if one or more sample units fail to meet any test requirements specified.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Lot size	Sample size
800 or less	2
801 to 22,000 inclusive	3
22,001 and over	5

The unit for expressing lot sizes and sample unit for testing each component shall be in accordance with applicable subsidiary specifications as follows:

Component	Expressed as	Sample unit for testing
Hook and eye	100 each	two each, hook and eye

TABLE III. Test methods.

Components	Characteristics	Reqmt. para.	Test method	No. det. per S/Unit	Results reported as
Hook and eye	Liver of sulphur	3.3.15	4.5.1.1	1	Pass or fail
	Tackiness	3.3.15	4.5.1.2	1	Pass or fail

4.4.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.4.2.1. Bond strength of fusible interlining. The strength of the bond of the fusible interlining to the outer shell shall be tested once each four hours as follows. At each fusing press to determine that adequate fusing is being obtained. Prepare a test sample by fusing the fusible interlining specified in 3.3.6 to the basic fabric of the outer shell specified in 3.3.1 under the same fusing conditions to be used in the manufacture of the jacket. Determine the bond strength of the test sample with a commercial spring scale (see 6.6). If the bond strength of any test sample is less than 22 ounces per inch of width, the fusing conditions shall be corrected and the bond strength test shall be repeated. Those units represented by this test shall be fused again and retested. If they fail, they shall be rejected.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

4.4.3 Examination of end item. The end item shall be examined for defects listed in 4.4.3.2 through 4.4.3.3. The sample unit shall be one jacket.

4.4.3.1. Classification of defects. All defects shall be classified as indicated below, except that numbered 1 in the major classification column which shall be classified as follows:

Major defect – When seriously affecting appearance or serviceability.
Minor A defect – When not seriously affecting appearance or serviceability.

4.4.3.2. General defects. General defects shall be classified as follows:

4.4.3.3.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Buttonholes (construction)	a. One or more omitted or added.	101		
	b. Wrong type or uncut.		201	
	c. Not corresponding to size of button (front):			
	– too small, not permitting button to enter buttonhole.	102		
	– too large, 3/8 inch or longer than the diameter of button (measured at inside of purling).		202	
	d. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	103		
	e. Bartack missing or loose on:			
	– one buttonhole.		203	
	– two or more buttonholes.	104		
	f. Bartack misplaced, not serving intended purpose on:			
	– one buttonhole.			301
	– two or more buttonholes.		204	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Buttonholes (construction) (cont'd)	g. One or more broken stitches in:			
	- one buttonhole.		205	
	- two or more buttonholes.	105		
	h. More than two skipped stitches in:			
	- one buttonhole.			302
	- two or more buttonholes.		206	
	i. Ragged edges, affecting appearance, or exposed interlining not colored with reddish indelible ink.			303
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		207	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified:			
	- one or two stitches.			304
	- three or more stitches.		208	
	l. One or more buttonholes finished with purling on the outside of fronts.	106		
Buttons or ring toggles	a. Missing, loose, broken or defective:			
	- one button or ring toggle.		209	
	- two or more buttons or two or more ring toggles.	107		
	b. Not specified type, size, color or finish.		210	

NOTE: Buttons shall be considered defective if they have sharp, rough or cracked edges; scratches, blemishes or imbedded foreign matter on face side of button, loose shanks; or badly shaded.

Cleanness	a. One or more removable spots or stains clearly noticeable, outside of jacket.		211	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Cleanness (cont'd)	b. One or more removable spots or stains clearly noticeable, inside of jacket.			305
	c. One or more spots or stains of an obvious permanent nature.	1		
	d. Thread ends not trimmed, loose thread ends, two or more shade markings, or basting not removed throughout garment (to be scored when the condition exists on major portion of jacket).		212	
Components and assembly	a. Any defective component or assembly (not herein classified).	108		
	b. Any component part or required operation omitted (not herein classified).	109		
Cutting	a. Any component part of basic wool material not cut in accordance with directional lines on patterns, or in accordance with specification requirements.	110		
	b. Cloth gabardine (white) for piping cut on the bias.		213	
	c. Any lining part not cut in accordance with directional lines on patterns.		214	
Eyelets (construction)	a. One or more omitted or added.	111		
	b. Wrong type.		215	
	c. Eyelet not securely caught on fabric, causing stitching to pull away from fabric.	112		
	d. Diameter of inside opening less than 1/8 inch or more than 1/4 inch.			306

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Eyelets (construction) (cont'd)	e. One or more eyelets uncut.		216	
	f. One or more broken stitches in:			
	- one eyelet.			307
	- two or more eyelets.		217	
	g. More than two skipped stitches in one or more eyelets.		218	
Hook and eye	a. One hook or eye omitted.	113		
	b. Not proper color or finish.		219	
	c. Not specified type or size.		220	
	d. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hooks and eyes are fastened.		221	
	e. Hook or eye not securely tacked to ends of collar.		222	
	f. Hook or eye misplaced, i.e., hook positioned on right end and eye positioned on left end of collar.		223	
Material defects and damages	a. Any weakening defect such as smash, multiple float, loose slub, etc., that may develop into a hole.	114		
	b. Any hole (including drill holes).	115		
	c. Shade bar, unsightly slubs, etc.:			
	- on outside.		224	
	- on inside.			308
	d. Needle chews which may develop into a hole.	116		
	e. Scissors or knife cuts, tear, mend or burn.	117		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows:

Material defect - No defect
Workmanship damages - Minor B defect

Pressing	a. Burned or scorched.		225	
	b. Pressing omitted (entire garment).		226	
	c. Poorly pressed (unless otherwise classified).		227	
	d. Armhole stretched, affecting appearance.		228	
	e. Basting or pressing impressions not removed on major portion of jacket.			309
	f. Gloss not removed throughout jacket, affecting appearance.			310
	g. Armholes not blocked, or blocked poorly.		229	
	h. Inside of armholes not pressed solid.		230	
	i. Edges bulky, i.e., not pressed solid, affecting appearance.			311
	j. Linings not pressed smooth.			312
Seams and stitching	a. Accuracy of seaming:			
	1. Any seam twisted, puckered or pleated, affecting appearance.		231	
	2. Part of garment caught in any unrelated operation or stitching.	118		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Seams and stitching (cont'd)	3. Unsightly hand felling or blind stitching exposed on outside of jacket, affecting appearance.		232	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.			313
	5. Wrong color of thread used on outside of jacket, affecting appearance.	119		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular, i.e., unevenly gaged, or various stitchings not uniform, affecting appearance.		233	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			314
	c. Open seams:			
	1. On outside:			
	- up to 1/4 inch inclusive.			315
	- more than 1/4 inch but not more than 1/2 inch.		234	
	- more than 1/2 inch.	120		
	2. On inside:			
	- more than 1/2 inch (except machine felling).		235	
	- up to 1/2 inch inclusive (except machine felling).			316
	- up to 1 inch inclusive (machine felling).			317
	- more than 1 inch (machine felling).		236	

NOTE: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Seams and stitching (cont'd)	d. Raw edges:			
	1. On outside:			
	- up to 1/8 inch inclusive.			318
	- more than 1/8 inch but not more than 1/4 inch.		237	
	- more than 1/4 inch.	121		
	2. On inside:			
	- more than 1/8 inch but not more than 1/4 inch.			319
	- more than 1/4 inch.		238	

NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.

e. Run-offs (see classification of open seams).			
f. Stitch tension:			
1. Loose tension resulting in loose seam.	122		
2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		239	
3. Tight tension (stitches break when normal strain is applied).	123		

NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting pull in lengthwise direction of seam.

g. Stitches per inch (excluding labels).			
1. Less than minimum specified:			
- one or two stitches.			320
- three stitches.		240	
- four or more stitches.	124		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
NOTE: To be scored only if condition exists on major portion of seam.				
Seams and stitching (cont'd)	h. Stitch and seam type:			
	1. Wrong stitch or seam type.		241	
	i. Stitching skipped or broken (on edge, or raised stitching when seam is seamed, turned and stitched):			
	- 1/4 inch or more but not more than 1/2 inch.			321
	- more than 1/2 inch.		242	
Shaded parts	a. On outside:			
	1. Any shaded part.		243	
	b. On inside:			
	1. Any lining part badly shaded (except sleeve lining).		244	
	2. Any sleeve lining part badly shaded or pairs not matching each other.			322

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

4.4.3.4. Detailed defects (jacket buttoned on form or spread out on a table). Detailed defects with jacket buttoned on form or spread out on a table shall be classified as follows:

Examine	Defects	Classification		
		Major	Minor A	Minor B
Collar (construction & setting)	a. Interlining omitted (buckram or twill or plain weave, polyester or polyester blend).	125		
	b. Interlining (buckram or twill or plain weave, polyester or polyester blend) tight or twisted, causing puckers on collar, affecting appearance.		245	
	c. Tight at joining to front or back, causing puckers or pleats at neck of jacket, affecting appearance.		246	
	d. Piping irregular, affecting appearance.		247	
	e. Collar ends overlapping when fastened.		248	
	f. Collar ends spread open more than 3/8 inch when fastened.		249	
	g. Front finished ends of collar uneven in width by 3/16 inch or more.		250	
Alignment of front buttons and buttonholes	a. Not aligned, causing a noticeable bulge or twist on fronts when buttoned, affect appearance.		251	
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by: - more than 1/8 inch but not more than 1/4 inch.		252	
	- more than 1/4 inch.	126		

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Length of buttoned fronts (cont'd)	b. Left front at corner longer than right front by: - more than 1/4 inch but not more than 3/8 inch.			323
	- more than 3/8 inch.	128		
	c. Right front at corner exposed beyond bottom edge of left front by more than 1/8 inch.		253	
Shoulder (construction)	a. Improperly joined or set, causing shoulder or back to twist.		254	
Shoulder pads	a. Not completely caught in armhole tacking.		255	
	b. Misplaced, not serving intended purpose, i.e., too far back or too far forward.		256	
	c. One or both pads omitted.		257	
Armholes (construction)	a. Badly stretched, affecting appearance.		258	
	b. Tape too tight, causing puckering.		259	
	c. Crooked seam, affecting appearance.		260	
	d. Tape stitching exposed and visible on outside surface.			324
	e. Sleeve-head pads not completely tacked to armholes or misplace, not service intended purpose.		261	
	f. One or both sleeve-head pads omitted.		262	
Sleeves	a. Setting and hang:			
	1. Sleeve fullness misplaced, affecting appearance.		263	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Sleeves (cont'd)	2. Hang of sleeves on the same jacket in opposite direction by more than 2 inches.			325
	3. Sleeve tight in armhole, i.e., roll effect not present.			326
	b. Sleeve lining:			
	1. Twisted, tight, or short, causing bulge, twist, or puckering on outside of sleeves.	128		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			327
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of sleeve.			328
	c. Construction of sleeves:			
	1. Tacking on bottom turnup to body of sleeve omitted or insecure.		264	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			329
	3. Tacking on one or both sleeve lining seams to sleeve seams omitted, or insecure.			330
	4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from bottom edge of sleeve.			331
	d. Sleeve cuffs:			
	1. Piping irregular, affecting appearance.		265	
	2. Top edge on top sleeve part poorly shaped, affecting appearance.		266	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Sleeves (cont'd)	3. Height of pointed end on both sleeves varying in length by more than 1/4 inch.		267	
	4. Sleeve puckered at joining of cuff, affecting appearance.		268	
	5. Cuff puckered or twisted at joining to sleeve, affecting appearance.		269	
	6. Ends of cuff staggered at backarm seam:			
	- 1/8 inch or more but not more than 1/4 inch.			332
	- more than 1/4 inch.		270	
	7. Height of cuff at point on top sleeve including piping:			
	- less than 4-3/4 inches but not less than 4-1/2 or more than 5-1/4 inches but not more than 5-1/2 inches.			333
	- less than 4-1/2 inches or more than 5-1/2 inches.		271	
	8. Height of cuff at backarm or front creased edges including piping:			
	- less than 2-3/4 inches but not less than 2-1/2 inches or more than 3-1/4 inches but not more than 3-1/2 inches.			334
	- less than 2-1/2 inches or more than 3-1/2 inches.		272	
	9. Point of cuff not centered between the lower forearm folded edge and the folded backarm edge of sleeves by more than 1/4 inch.			335
Position of eyelets on sleeve cuffs	a. Horizontal alignment of eyelet on one sleeve cuff not uniform with other sleeve cuff by more than 1/4 inch.			336

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Position of eyelets on sleeve cuffs (cont'd)	b. Eyelets on one or both sleeve cuffs out of vertical alignment by more than 1/8 inch.			337
Body (outside)	a. Fitting of body linings:			
	1. Tight, short, or twisted, causing fullness or twist on outside of jacket, affecting appearance.	129		
	b. Fitting of front interlining:			
	1. Tight, short, or twisted, causing fullness or twist on outside of jacket, affecting appearance.	130		
	2. Too full, causing jacket front to have a wavy appearance.	131		
Front, side front, side back and center back seams	a. One or more joining seams not spread open and pressed flat.		273	
	b. Curved side back panel seam stretched or distorted, affecting appearance.		274	
	c. Curved center back seam stretched or distorted.		275	
Front and bottom edges	a. Front edges stretched, affecting appearance.		276	
	b. Piping set on tight, causing puckering on front, affecting appearance.		277	
	c. Front or bottom piping irregular, affecting appearance.		278	
	d. Bottom edge stretched, puckered or uneven, affecting appearance.			338
	e. Bottom corner of left front poorly shaped, affecting appearance.		279	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Front and bottom edges (cont'd)	f. Left front rolling outward below bottom button.		280	
	g. Front edge irregular, affecting appearance.		281	
	h. Piping tight on bottom edge, causing puckering on outside of jacket, affecting appearance.		282	
	i. Left front not dressed as specified.		283	
Front facings	a. Short, tight, or twisted causing fullness or twists on fronts, affecting appearance.		284	
Front buttonholes (position)	a. Position from front edge including piped edge: - less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch.			339
	- less than 1/2 inch or more than 7/8 inch.		285	
	b. More than 1/4 inch from equal spacing.		286	
	c. Unevenly spaced from front edge by more than 3/16 inch.		287	
	d. Top buttonhole less than 7/8 inch or more than 1-1/8 inches from top edge of piping (collar notch).		288	
Front eyelets (position)	a. Out of vertical alignment by 1/4 inch or more.		289	
	b. Center of one or more eyelets positioned from right front edge: - less than 2 inches but not less than 1-3/4 inches or more than 2-1/4 inches but not more than 2-1/2 inches.			340
	- less than 1-3/4 inches or more than 2-3/8 inches.		290	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Labels	a. Any required label missing, incorrect, illegible or size label not securely caught in stitching.	132		
	b. Identification label not stitched on four sides.		291	
	c. Bottom edge of identification label less than 3 inches or more than 5 inches from bottom finished edge of jacket.			341
	d. Identification label not stitched to outside of right facing.			342
Hanger	a. Hanger omitted or ends not securely stitched.	133		
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along the lower edge of collar lining.		292	
	c. Hanger not stitched to neck of jacket prior to seaming collar to neck of jacket.		293	
	d. Finished width less than 1/4 inch or more than 3/8 inch wide.			343
Front facings	a. Fullness or pleats on facings between eyelets, buttonholes, or between front edge and eyelets or buttonholes.			344
	b. Tacking on back edge to one or both interlinings: - omitted. - insecure or incomplete for a distance of more than 4-1/2 inches below shoulder seams, or more than 4 inches above bottom edge of jacket.		294	345

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Front facings (cont'd)	c. Felling at bottom edge of front facing or back edge of facing omitted or insecure on one or both facings.		295	
	d. Felling along folded edge of one or both facings at collar notch omitted or insecure.		296	
Body linings	a. Excessive puckering or pleated.			346
	b. Twisted, not affecting smoothness on outside of jacket.			347
	c. One or both chest pleats on shoulders omitted.		297	
	d. Folded edge of one or both chest pleats facing front edge of coat.			348
	e. Pleat omitted at center of back lining.		298	
	f. Pleat less than 1/2 inch in depth at center of back lining.			349
	g. Lining too long, i.e., exposed beyond bottom edge of jacket.		299	
Underarm shields	a. One or both omitted.		201a	
	b. Tacking on one or both shields along side or bottom edge to body lining omitted or insecure.			350
	c. Top edge not caught in armhole tacking or stitching when tacked by hand.			351
	d. Puckered, pleated, or twisted.			352
	e. One or both shields misplaced, not serving intended purpose.			353

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Inside of armhole	a. Backstitching at armpit of armhole from backarm seam of sleeve to front edge of shield omitted.			354
Collar extension tab	a. Omitted.		202a	
	b. Extending less than 1/2 inch or more than 1 inch beyond end of collar.			355
	c. Felling omitted or insecure at top, back, front or bottom edge.		203a	
	d. Box stitching omitted.		204a	
Collar lining	a. Ends of collar lining not securely tacked.		205a	

4.4.3.5. Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5. Tests.

4.5.1 Lacquer tests.

4.5.1.1. Liver of sulfur. The samples to be tested shall be immersed in a two percent by weight chemically pure liver of sulfur (potassium sulphide) water solution, at a temperature of 100°F, for not less than three minutes. The samples shall then be removed and rinsed in warm, then cold, then hot water, after which they shall be wiped gently in an absorbent cellulose material or whirled to remove residual moisture, and allowed to air dry at room temperature for a period of one hour. There shall be no change in the appearance of the lacquered surfaces except for a slight overall yellowing and not more than three dark spots, each not exceeding 1/32 inch largest dimension.

4.5.1.2. Tackiness. At room temperature (60° to 80°F) press a piece of tissue paper against the lacquered surface for 30

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

5. PACKAGING

5.1. Packaging. For acquisition purposes, the packaging requirements shall be as specified in the contract or order (see 6.2). When actual packaging of material is to be performed by Department of Defense (DoD) personnel, these personnel need to contact the responsible packaging activity to ascertain requisite packaging requirements. Packaging requirements are maintained by the Inventory Control Point's packaging activity within the Military Department of Defense Agency, or within the Military Department's Systems Command. Packaging data retrieval is available from the managing Military Department's or Defense Agency's automated packaging files, CD-ROM products, or by contacting the responsible packaging activity.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1. Intended use. The coats described herein are intended for wear by enlisted female personnel of the U.S. Marine Corps Band.

6.2. Acquisition requirements. Acquisition documents must specify the following:

a. Title, number, and date of the specification.
b. Issue of DoDISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.2).
c. Packaging requirements (see 5.1).
d. Sizes required (see 1.2).
e. Whether first article is required (see 3.2).
f. Number of jackets in first article (see 3.2).

6.3. Standard sample. For information regarding availability of standard sample jackets and standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

6.4. Figures. Figures 1 through 4 show general design of the jackets with assembly details and measurements. In the event of conflict between these figures and the text of this specification, the text of this specification will govern.

6.5. Fusing conditions. Specific machine setting should be obtained from the supplier of the particular fusible material for optimum results. The following fusing conditions include the recommendations of several suppliers of fusible material and are furnished for guidance only.

a. Temperature between pressing surface of 300°F minimum and 320°F maximum, at the fuseline (not the temperature at the clock).
b. Pressure between pressing surfaces of 6 pounds force per square inch ($1b_f/in^2$) minimum and 7 $1b_f/in^2$ maximum.
c. Pressing time of 12 seconds minimum and 14 seconds maximum.
d. Heat-dry.

6.6. Peel strength test. The procedure for the peel strength testing with a spring scale should be obtained from the supplier of the fusible material, and be accomplished two hours after fusing.

6.7. Vinyl piping. The vinyl piping manufactured by the Thielex Plastics Company has been found to meet the requirements in 3.3.4.1.

6.8. Subject term (keyword) listing.

Interlining, fusible
Piping
Shoulder
Sleeve

6.9. Changes from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extent of the changes.

Preparing Activity:
Navy - MC
Project No. 8410-N342

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

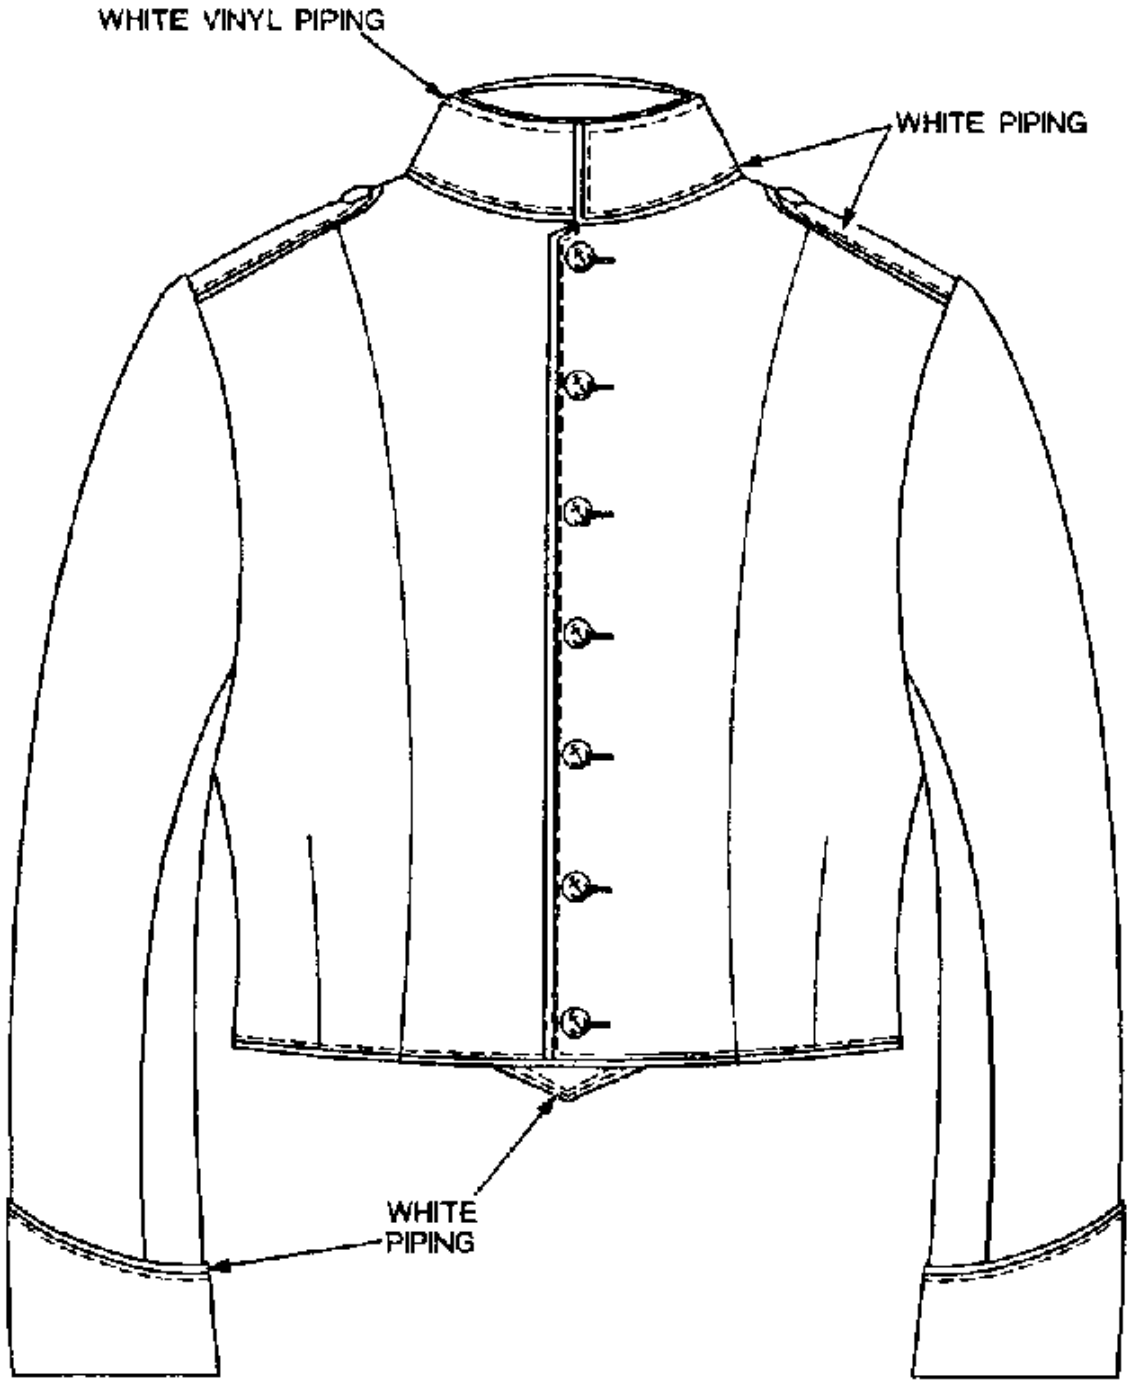


Figure 1. Jacket, Woman's - Special Full Dress Scarlet, U.S. Marine Band, Musician

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

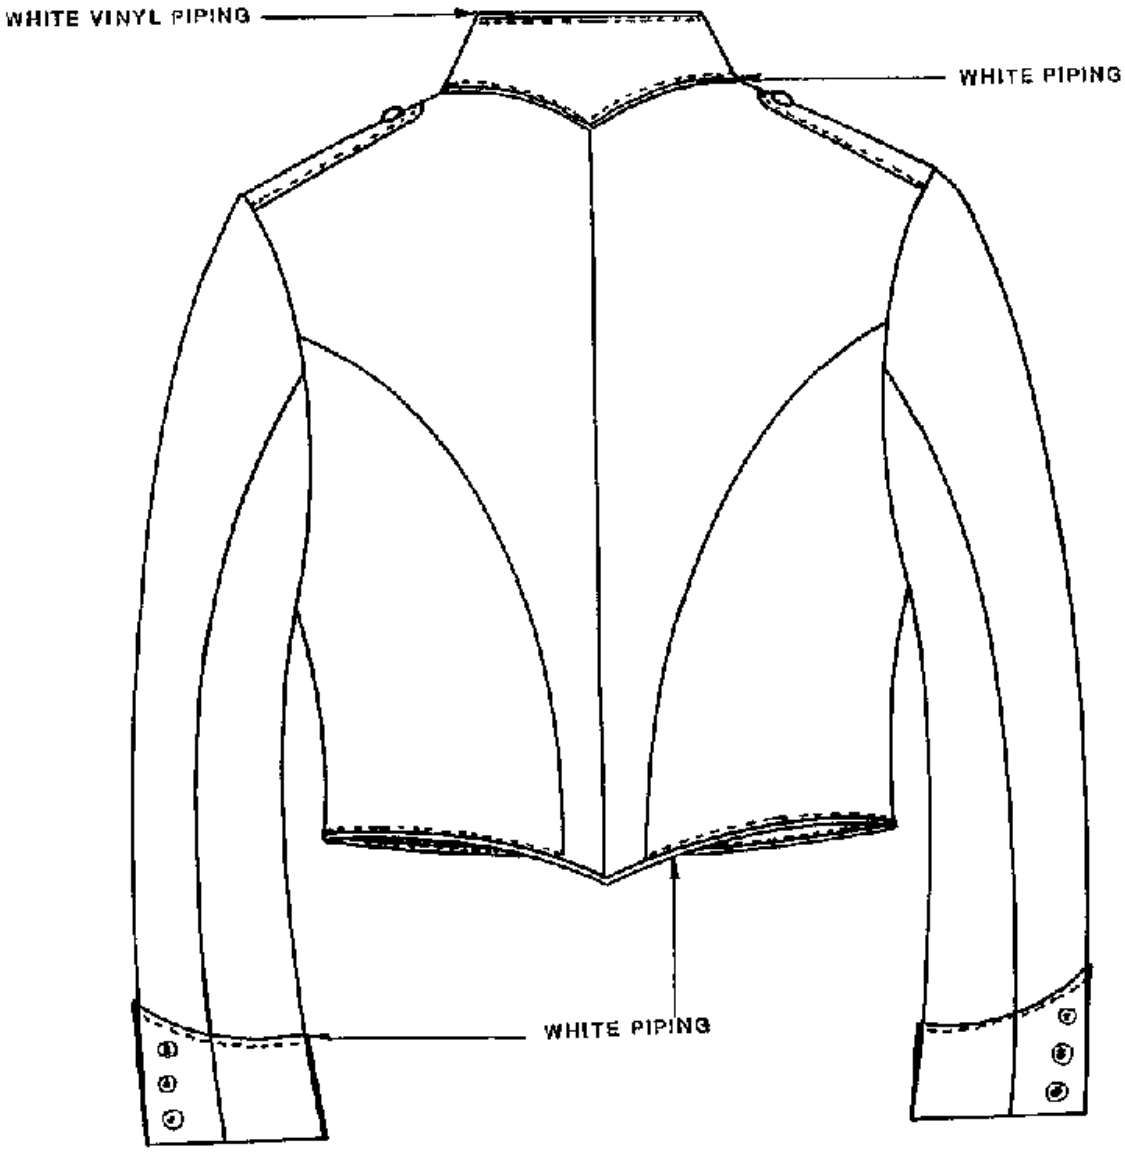


Figure 2. Jacket, Woman's - Special Full Dress Scarlet, U.S. Marine Band, Musician

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

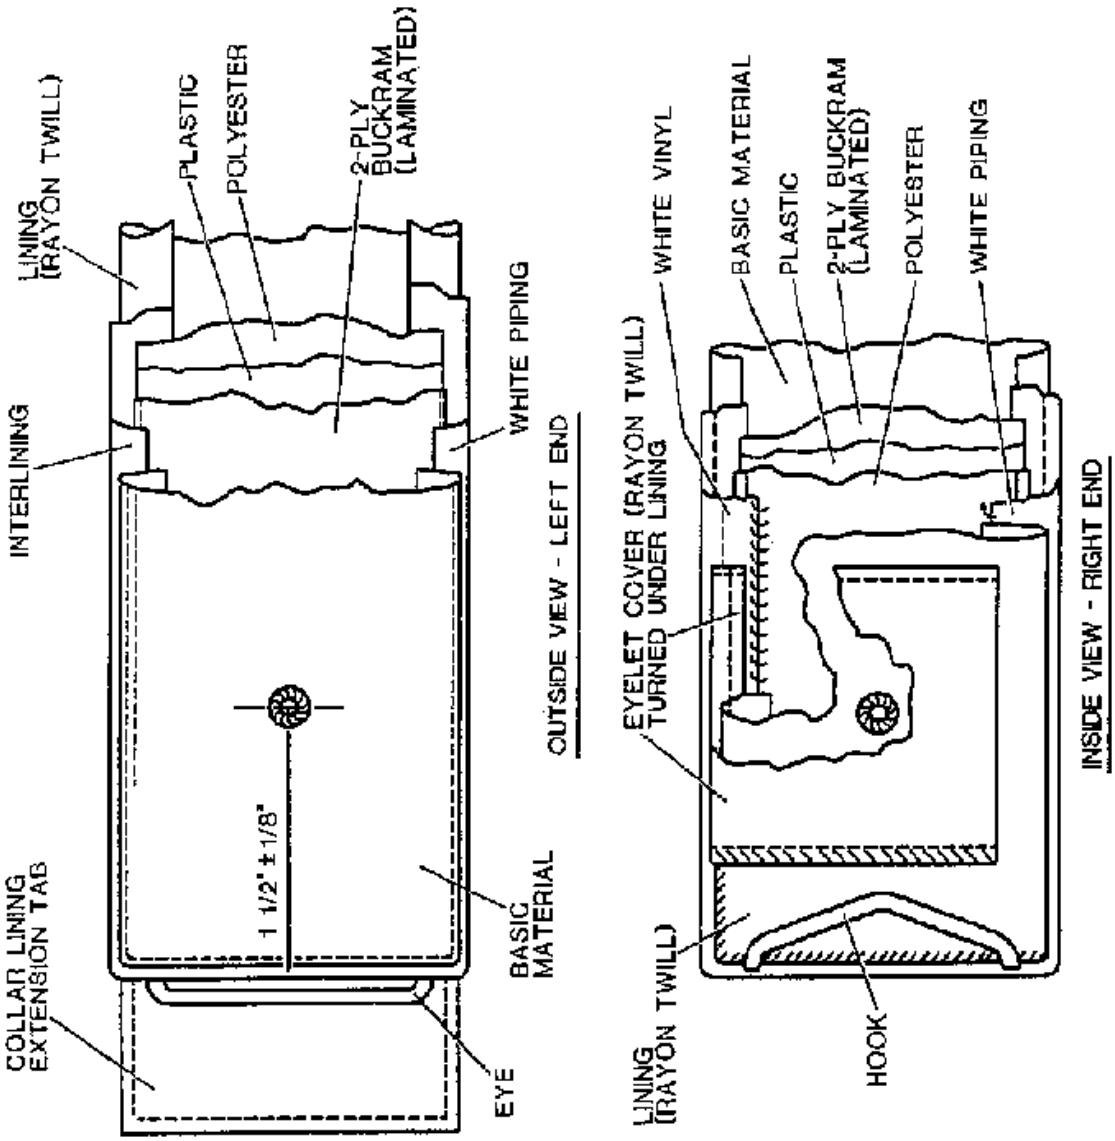


Figure 3. Jacket, Woman's – Special Full Dress Scarlet, U.S. Marine Band, Musician

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

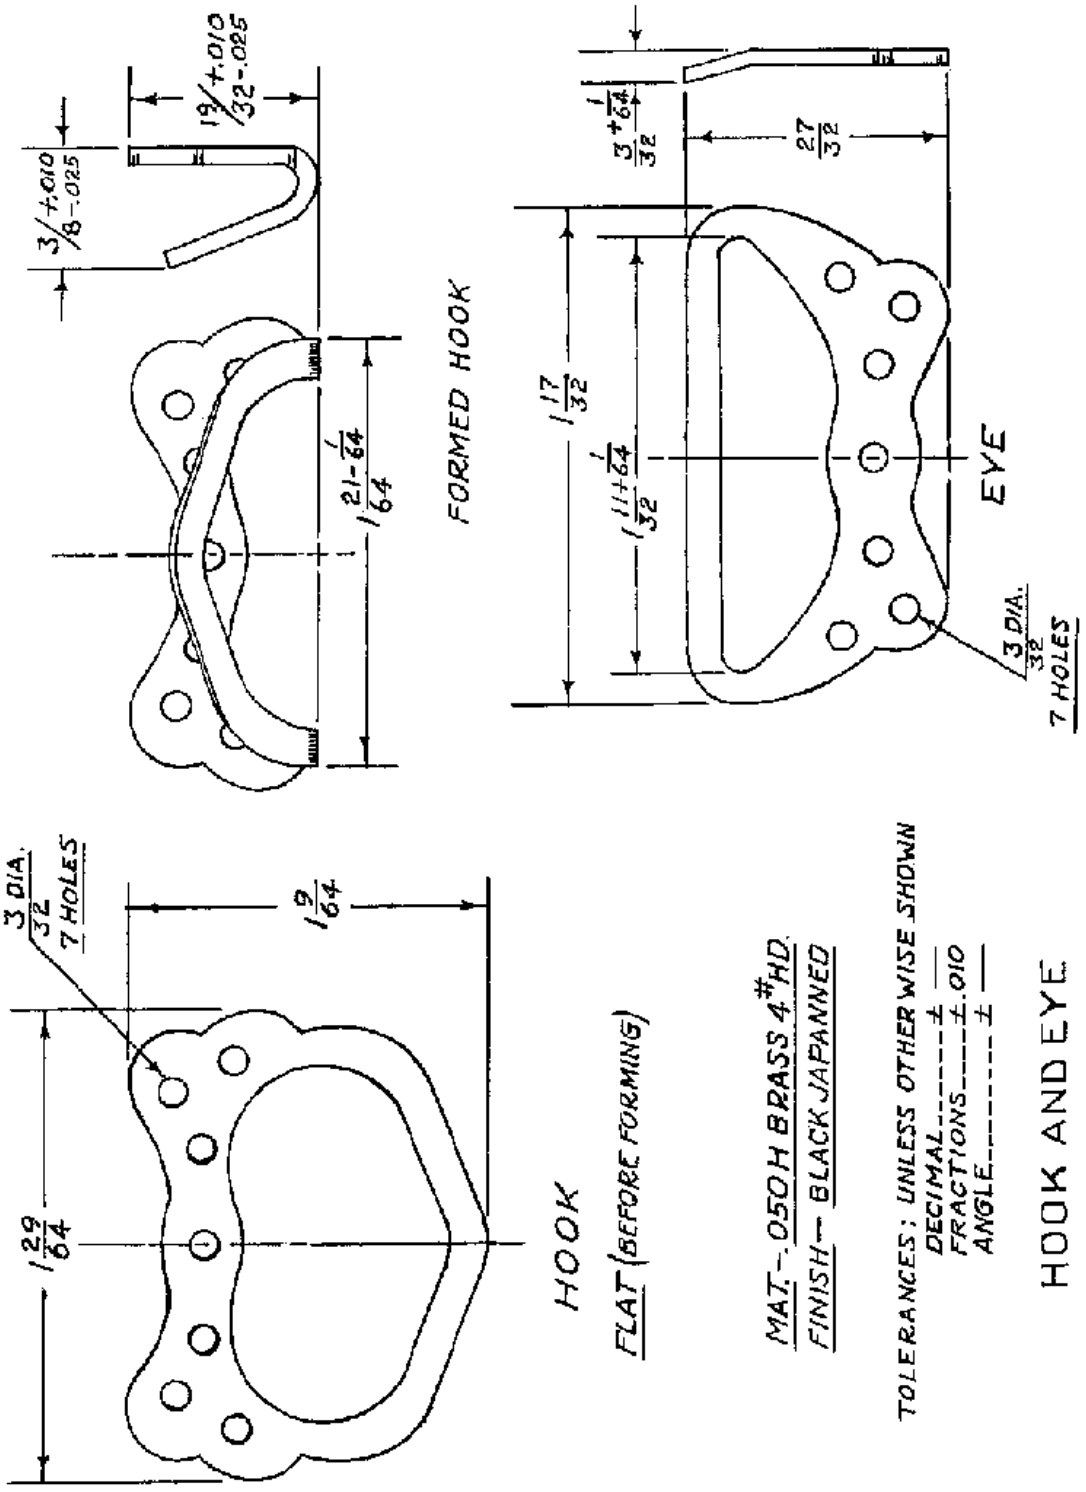


Figure 4. Jacket, Woman's – Special Full Dress Scarlet, U.S. Marine Band, Musician

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.

2. The submitter of this form must complete blocks 4, 5, 6, and 7.

3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	**1. DOCUMENT NUMBER** MIL-DTL-29396B	**2. DOCUMENT DATE (YYMMDD)** 08-OCTOBER-1997

3. DOCUMENT TITLE JACKET, WOMAN'S - SPECIAL FULL DRESS SCARLET, U.S. MARINE BAND, MUSICIAN

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME *(Last, First, Middle Initial)*	b. ORGANIZATION	
c. ADDRESS *(Include Zip Code)*	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON *(if applicable)*	**7. DATE SUBMITTED** (YYMMDD)

8. PREPARING ACTIVITY

a. NAME COMMANDER (PSE-D) MARINE CORPS SYSTEMS COMMAND	b. TELEPHONE *Include Area Code)* (1) Commercial (2) AUTOVON
c. ADDRESS *(Include Zip Code)* QUANTICO, VA 22134-5010	**IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT:** DEFENSE QUALITY AND STANDARDIZATION OFFICE 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22401-3466 Telephone (703) 756-2340 AUTOVON 289-2340

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:51Z
Check the source to verify that this is the current version before use.