INCH-POUND

MIL-J-29397A(MC)
23 June 1995
MIL-J-29397(MC)
2 October 1981

# MILITARY SPECIFICATION

## JACKET, WOMAN'S: FULL DRESS, SCARLET, U. S. MARINE BAND, MUSICIAN'S

This specification is approved for use by the U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

## 1. SCOPE

1.1 Scope. This specification covers requirements for women musicians' scarlet wool full dress jackets.

1.2 Classification. The jackets shall be of one type in the following sizes, as specified (see 6.2).

Schedule of Sizes

| Short | Regular | Long |
|---|---|---|
| 2 | 2 | |
| 4 | 4 | 4 |
| 6 | 6 | 6 |
| 8 | 8 | 8 |
| 10 | 10 | 10 |
| 12 | 12 | 12 |
| 14 | 14 | 14 |
| 16 | 16 | 16 |
| | 18 | 18 |

1.3 Individual orders. When the jacket is custom tailored to an individual order, this specification shall govern, except that the detailed requirements of Section 3, Table I, may be modified to the extent necessary for good custom tailoring practices.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8410
DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 52 | Make buttonholes. (cont'd)<br><br>gimp and thread in the bartack. Trim the ends of the gimp and thread.<br><br>d. Rebaste the unstitched portion of the braid around the buttonholes and complete that portion of the stitching through all plies (see Figure 4). | | | | | |
| 53 | Make eyelets in fronts.<br><br>Finished appearance. The eyelets shall be worked with the purling on the outside of the jacket, and shall finish with a 1/8 inch diameter opening. All stitches shall be securely caught in the fabric.<br><br>a. Mark the left front for the location of five eyelets for removable insignia buttons to align with the buttonhole on the right front. The mark for the top eyelet shall be in line with the left end of collar and the remaining eyelets shall be in vertical alignment with the top mark.<br><br>b. Mark location for eyelets on the right and left front for removable buttons. The mark for the eyelet shall be between the braid strands at the | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 53 | Make eyelets in fronts. (cont'd) | | | | | |
| | top end of each harp. | | | | | |
| | c. Make an eyelet at each of the marks through all plies. The eyelet cover on the right front shall not be caught in the stitching. | Eyelet | | 22 per eyelet | A | A |
| 54 | Press front of jacket. | | | | | |
| | Finished appearance. Fronts shall finish smooth and flat without distortion, with all edges uniformly worked flat. | | | | | |
| | a. Press the front of jacket and braid smooth and flat with a suitable pressing machine, removing the fullness. | | | | | |
| 55 | Baste shoulder pad to jacket. | | | | | |
| | a. Insert shoulder pads between interlining and chest padding of jacket fronts. Securely tack the pad to the interlining and chest padding only. | Hand or 301 | Hopper | | | |
| 56 | Set shoulder loops (see Figure 5). | | | | | |
| | Finished appearance. The shoulder loops shall be securely stitched without causing distortion to the shoulder. The loops shall finish 3/4 inch wide and 1 | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 56 | Set shoulder loops (see Figure 5). (cont'd)<br><br>inch long. | | | | | |
| | a. Position the raw edge of one loop on the front of the jacket at the shoulder edge, 1-1/4 inches from the raw edge of neck gorge and stitch loop to jacket 1/8 inch from raw edges. The outside edge of the second loop shall be positioned 3-3/4 inches from the outside edge of the first loop and at the shoulder edge. Stitch loop to jacket 1/8 inch from the raw edges. | 301 | SSa-1 | 10-14 | A | A |
| 57 | Seam shoulders.<br><br>Finished appearance. The shoulder seam shall finish without a distorted appearance. | | | | | |
| | a. Join the back to the front at the shoulders with a 3/8 inch seam, working in the fullness on the back in accordance with good manufacturing practice. | 301 | SSa-1 | 10-14 | A | A |
| | b. Spread open the shoulder seam and press flat, holding the shoulders short and exercising much care in pressing in order not to effect a distorted appearance in the finished | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 57 | Seam shoulders. (cont'd)<br><br>seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block. | | | | | |
| 58 | Set shoulder loops to jacket back.<br><br>a. The front end of loop shall be stitched 5/8 inch in front of the shoulder seam and aligned with each other. | 301 | EFb-1 | 10-14 | A (Silk) | A |
| | b. Fold loop back, turn under the back end of the loop and stitch the loop to the jacket only 1/16 inch from the turned edge catching the turned-under portion in the stitching. | 301 | EFb-1 | 10-14 | A (Silk) | A |
| 59 | Baste shoulder.<br><br>a. Position the front lining and jacket front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn the jacket on the inside. | Hand or 301 | Hopper | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 60 | Baste back lining and facing-lining assembly at the shoulders. | | | | | |
| | a. Turn under and lap the shoulder edge of the back lining on the facing-lining assembly. Baste lining along the folded edge of the back lining with the top end of the chest pleat caught in the basting. | Hand | SSm-1 | 4-6 | | |
| 61 | Seam neckline with size label and jacket hanger. | | | | | |
| | Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label shall be positioned between the ends of the jacket hanger and the ends of the jacket hanger shall be positioned so that in the finished jacket, the hanger opening shall be 2 ± 1/8 inches long when measured along the lower edge of collar lining. | | | | | |
| | a. Join facings and back lining to jacket at the neckline from collar notch to collar notch, with a 1/4 inch seam and with the upper edge of the size label and the ends of the hanger positioned and caught in the stitching at the inside center back. | 301 | SSa-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 61 | Seam neckline with size label and jacket hanger. (cont'd)<br><br>b. Press the neckline of the jacket smooth and flat with a heated pressing iron or pressing machine. | | | | | |
| 62 | Set collar.<br><br>Finished appearance. The collar shall be carefully joined to the jacket without distortion of the collar.<br><br>a. Mark the neckline on the outside 3/8 to 1/2 inch from collar notch up to the shoulder seam and gradually to within 1 to 1/4 inches at the center back for position of collar.<br><br>b. Position the collar with the lower edge lapped on the outside top edges of the jacket at the mark.<br><br>c. Stitch the collar from end to end, to the jacket, as close as possible to, but not on top of, the stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining. | 301 | LSa-1 | 10-14 | A (Silk) | A |
| 63 | Set sleeves.<br><br>Finished appearance. The armhole sleeve seam shall | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026l0-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 63 | Set sleeves. (cont'd) | | | | | |
| | finish without twists, gathers, puckers or pleats. | | | | | |
| | a. Position sleeves on outside of jacket at the armholes, with the back notch matching the side back seam, and with notch in top sleeve and front matching. | | | | | |
| | b. Join the sleeve to the jacket with a 3/8 inch seam, distributing the fullness in accordance with good manufacturing practice. | 301 | SSa-1 | 10-14 | A | A |
| | c. Press the entire armhole smooth and flat with a heated pressing iron to remove fullness, exercising care not to stretch the armhole. | | | | | |
| 64 | Baste armhole. | | | | | |
| | a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing fullness evenly. Turn jacket on the outside. | Hand or 301 | Hopper | | | |
| | b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the | Hand or 301 | Hopper | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 64 | Baste armhole. (cont'd)<br><br>backarm seam of sleeves to the front notch of jacket. | | | | | |
| 65 | Set underarm shields to jacket.<br><br>a. Position the underarm shield on the lining side of the jacket with the raw edges even with lower edge of armhole. | | | | | |
| | b. Baste the underarm shields to the jacket along the vertical center and top, side and bottom edges. | Hand or 301 | Hopper | | | |
| 66 | Stitch sleeve head pads and linings at armhole.<br><br>Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.<br><br>a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam, and with one end of the pad matching the notch in the fronts. | | | | | |
| | b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole-sleeve seam allowance, 1/8 inch from | 301 | SSa-1 | 4-6 | 24/4 | 24/4 |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 66 | Stitch sleeve head pads and linings at armhole. (cont'd)<br><br>the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.<br><br>c. The underarm shield may be basted to the armhole prior to stitching. | | | | | |
| 67 | Fell back lining and facing-lining assembly at the shoulders.<br><br>a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling. | Hand | | 8-10 | C (Silk) | |
| 68 | Fell sleeve lining at armholes.<br><br>a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve and sleeve lining matching. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 68 | Fell sleeve lining at armholes. (cont'd) | | | | | |
| | b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the jacket around the entire armhole, placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge from backarm seam of sleeve to the front edge of the shield. | Hand | | 8-10 | C (Silk) | |
| | -or- | | | | | |
| | c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operations 67 a. above. | 301 | SSa-1 | 10-14 | A | A |
| | -or- | | | | | |
| | d. Machine stitch the lower edge of the sleeve lining, at the armhole on the inside from forearm seam to backarm seam and stitch the remaining portion of the sleeve | Machine | | 8-10 | C (Silk) | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 68 | Fell sleeve lining at armholes. (cont'd) | | | | | |
| | lining at the armhole with machine simulated hand felling. | | | | | |
| | NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling. | | | | | |
| 69 | Fell facings. | | | | | |
| | a. Fell the facing to the piping at the bottom edge of the jacket, starting at the bottom edge of the lining and continuing along the back and bottom edges of facing to the front edge of jacket, catching the eyelet cover in the felling. | Hand | | 8-10 | C (Silk) | |
| | b. Fell the folded edge of the facings to the piping along the top edge from collar notch to front edge of jacket. | Hand | | 8-10 | C (Silk) | |
| | c. Fell the eyelet cover to the right front facing along the bottom edge of cover. | Hand | | 8-10 | C (Silk) | |
| | d. Tack the eyelet cover to the right front facing along the folded edge of lining. Place one tack midway between the second and third eyelet from the top, and one tack midway between the fourth and | Hand | | 4-6 per tack | C (Silk) | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 69 | Fell facings. (cont'd)<br><br>fifth eyelet from the top. | | | | | |
| 70 | Sew hook and eye to collar.<br><br>Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at the front of the collar without misalignment. | | | | | |
| | a. Position and securely sew the hook to the left end and the eye to the right end of the collar. The hook and eye shall be positioned with their front edges even with the respective front ends of the collar and securely sewn to the collar at the top and bottom edge of the hook and eye. The stitching on each side shall not be more than 3/8 inch from the front end of the collar, through the individual holes at the rear of the hook and eye. | Hand | | 16 per hook 16 per eye | C (Silk) | |
| 71 | Finish collar. | | | | | |
| | a. Securely tack the lower corners of the collar to the jacket. | Hand | | 8-10 | C (Silk) | |
| | b. Turn under the end and top edge of the lining at the right and left end of the collar and position | Hand | | 8-10 | C (Silk) | |



Source: https://assist.dla.mil -- Downloaded: 202610-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 71 | Finish collar. (cont'd) | | | | | |
| | the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge of the end to the stitching joining the lining to the collar. | | | | | |
| | c. Turn under and fell the lower edge of the collar lining to the jacket from end to end, catching the turned-under portion of the lining at the right and left end in the felling. | Hand | | 8-10 | C (Silk) | |
| | d. The lower edge of the collar lining may be basted to jacket prior to felling. | Hand | | 8-10 | C (Silk) | |
| | e. Turn back collar lining extension tab and hand fell directly behind eyes. | Hand | | 8-10 | C (Silk) | |
| 72 | Clean jacket. | | | | | |
| | a. Pull all basting thread, trim and remove any loose ends of thread, and remove any spots, stains and tickets without injury to the material. | | | | | |
| | b. Buttonholes at front closure shall be examined for exposure of jacket front interlining cloth. The exposed interlining | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 72 | Clean jacket. (cont'd)<br><br>shall be colored with a reddish indelible ink. | | | | | |
| 73 | Press jacket.<br><br>a. The jacket shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices.<br><br>b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even.<br><br>c. Press the entire collar smooth and flat.<br><br>d. Press the front on a body machine, shrinking and properly shaping the chest.<br><br>e. Press the sides, working the fullness towards the back.<br><br>f. Press the back smooth and flat, removing all fullness. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 73 | Press jacket. (cont'd)<br><br>g. Block the shoulders to remove fullness, and press shoulders smooth on a shoulder shaping machine.<br><br>h. Press the armholes solid from the inside, creasing the armholes at the front, back and armpit. The armpit and the back of the armhole shall be held short while pressing.<br><br>i. Block the armholes on a pressing block, shrinking the top sleeves.<br><br>j. Insert a sleeve pad in the sleeves in order to prevent creasing and press sleeves smooth and flat.<br><br>k. Press lower edge of jacket smooth, flat and even. Remove all impressions on the side and center back seam allowances. Press linings throughout, removing all wrinkles and creases. Press the front and back lining pleats smooth and flat. Remove all gloss marks. | | | | | |
| 74 | Attach buttons.<br><br>a. Insert the shank of a 40-line insignia button through each eyelet on the left front. Secure each button with a ring toggle. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 74 | Attach buttons. (cont'd)<br><br>b. Insert the shank of a 27-line insignia button through each eyelet on the sleeve cuffs and secure each button with a ring toggle. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished jacket shall conform to the measurements shown in Table II.

Table II - Jacket measurements 1/

SHORT

| Size | Bust 2/ | Back length 3/ | Sleeve length 4/ | Collar length |
|---|---|---|---|---|
| | inches | inches | inches | inches |
| 2 | 33 1/2 | 16 1/2 | 16 1/4 | 13 |
| 4 | 34 1/2 | 16 3/4 | 16 1/4 | 13 1/2 |
| 6 | 35 1/2 | 17 | 16 1/4 | 14 |
| 8 | 37 | 17 1/4 | 16 1/4 | 14 1/2 |
| 10 | 38 1/2 | 17 1/2 | 16 1/4 | 15 |
| 12 | 40 | 17 3/4 | 16 1/4 | 15 1/2 |
| 14 | 42 | 18 | 16 1/4 | 16 |
| 16 | 44 | 18 1/4 | 16 1/4 | 16 1/2 |

REGULAR

| | | | | |
|---|---|---|---|---|
| | inches | inches | inches | inches |
| 2 | 33 1/2 | 17 1/2 | 17 1/4 | 13 |
| 4 | 34 1/2 | 17 3/4 | 17 1/4 | 13 1/2 |
| 6 | 35 1/2 | 18 | 17 1/4 | 14 |
| 8 | 37 | 18 1/4 | 17 1/4 | 14 1/2 |
| 10 | 38 1/2 | 18 1/2 | 17 1/4 | 15 |
| 12 | 40 | 18 3/4 | 17 1/4 | 15 1/2 |
| 14 | 42 | 19 | 17 1/4 | 16 |
| 16 | 44 | 19 1/4 | 17 1/4 | 16 1/2 |
| 18 | 46 | 19 1/2 | 17 1/4 | 17 |

LONG

| | | | | |
|---|---|---|---|---|
| | inches | inches | inches | inches |
| 4 | 34 1/2 | 19 | 18 1/2 | 13 1/2 |
| 6 | 35 1/2 | 19 1/4 | 18 1/2 | 14 |
| 8 | 37 | 19 1/2 | 18 1/2 | 14 1/2 |
| 10 | 38 1/2 | 19 3/4 | 18 1/2 | 15 |
| 12 | 40 | 20 | 18 1/2 | 15 1/2 |
| 14 | 42 | 20 1/4 | 18 1/2 | 16 |
| 16 | 44 | 20 1/2 | 18 1/2 | 16 1/2 |
| 18 | 46 | 20 3/4 | 18 1/2 | 17 |



Source: https://assist.dla.mil -- Downloaded: 20260410-20T22:53Z
Check the source to verify that this is the current version before use.

1/ Tolerance on all measurements ± 3/8 inch.

2/ Bust measurement taken with jacket buttoned, from folded edge to folded edge in line with pit of armhole: multiply by 2.

3/ Back length measurement taken along center back seam from lower edge of collar to bottom edge of jacket.

4/ Sleeve length measurement taken along forearm seam from pit of armhole to bottom edge of sleeve.

3.8 Workmanship. The finished jacket shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspections set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements; however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.3.1).
2. Quality conformance inspection (see 4.4).

4.3 Inspection. Inspection shall be in accordance with MIL-STD-105, except where otherwise indicated herein.



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

4.4 First article inspection. When specified in the contract or purchase order, a first article inspection procedure shall be prepared, inspection performed on a completely fabricated coat for conformance to all provisions of this specification and a first article inspection report shall be prepared (see 6.4).

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in table III for characteristics noted.

4.5.2 In process inspection. An inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies. When specified in the contract or purchase order, a production/acceptance inspection procedure and production inspection reports shall be prepared.

4.5.3 Sampling test. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following:

| Component for testing | Lot sizes expressed as: | Sample unit |
|---|---|---|
| Hook and eye | 100 each | 2 each hook and eye |
| Ornamental braid | yards | 5 yards |

Table III - Test Methods

| Components | Characteristics | Para | Method | No | Det. | Report as |
|---|---|---|---|---|---|---|
| Hook and eye | Liver of sulfur | 3.3.15 | 4.6.1.1 | 1 | | Pass or fail |
| | Tackiness | 3.3.15 | 4.6.1.2 | 1 | | Pass or fail |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

4.5.4 Bond strength of fusible interlining. The strength of the bond of the fusible interlining to the outer shell shall be tested once each 4 hours as follows at each fusing press to determine that adequate fusing is being obtained. Prepare a test sample by fusing the interlining specified in 3.3.6 to the basic fabric of the outer shell specified in 3.3.1 under the same fusing conditions to be used in the manufacture of the jacket. Determine the bonding strength of the test sample with a commercial spring scale (see 6.7). If the bond strength of any test sample is less than 22 ounces per inch of width, the fusing conditions shall, be corrected and the bond strength test shall be repeated. Those units represented by this test shall be fused again and retested. If they fail, they shall be rejected.



Source: https://assist.dla.mil -- Downloaded: 202610-20T22:53Z
Check the source to verify that this is the currentversion before use.

Table III - Test Methods

| Components | Characteristics | Rqmt. Para. | Test Method | No. Det. Per S/Unit | Results reported as: |
|---|---|---|---|---|---|
| Ornamental Braid | Weave | 3.3.15 | Visual | 1 | Pass or fail |
| | Weight, ounces gross yards | 3.3.15<br>3.3.15 | 5041<br>4.3.2 | 1 | To nearest 0.1 oz. |
| | Texture (picks and ends) | 3.3.15 | Visual | 5 | Average of 5 det. to nearest whole number |
| | No. of Carriers | 3.3.15 | Visual | 1 | To nearest number |
| | Shrinkage 2/ | 3.3.15 | 5558 | | |
| | Breaking strength 3/ | 3.3.15 | 5100 | | |
| | Colorfastness to:<br>- (wet) dry cleaning<br>- light | <br>3.3.15<br>3.3.15 | <br>5622<br>5660 | | |
| Hook and Eye | Material identification 1/ | 3.3.17 | Std Comm'l | 1 | Pass or fail |
| | Finish | 3.3.17 | 4.3.1.2 | 1 | Pass or fail |

1/ Certificate of compliance.

2/ Except that the width of the test specimen shall be the full width of the braid.

3/ Breaking strength shall be determined on the full width of the braid and the jaw dimensions shall be greater than the width of the braid.



Source: https://assist.dla.mil -- Downloaded: 202640-20T22:53Z
Check the source to verify that this is the current version before use.

4.5.5 Examination of end item. The end item shall be examined for defects listed in 4.5.5.1 through 4.5.5.2. The sample unit shall be one jacket. All defects shall be classified as indicated below, except those numbered 1-99 in the classification column, which shall be classified as follows:

Major defect - When seriously affecting appearance or serviceability

Major A Defect - When affecting appearance or serviceability, but not seriously

4.5.5.1 General defects. General defects shall be classified as follows:

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Buttonholes (construction) | a. One or more omitted or added. | 101 | | |
| | b. Wrong type or uncut. | | 201 | |
| | c. Not corresponding to size of button(front): | | | |
| | - too small, not permitting button to enter buttonhole. | 102 | | |
| | - too large, 3/8 inch or longer than the diameter of button (measured at inside of purling. | | 202 | |
| | d. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric. | 103 | | |
| | e. Bartack missing or loose on: | | | |
| | - one buttonhole. | | 203 | |
| | - two or more buttonholes. | 104 | | |
| | f. Bartack misplaced, not serving intended purpose on: | | | |
| | - one buttonhole. | | | 301 |
| | - two or more buttonholes. | | 204 | |
| | g. One or more broken stitches in: | | | |
| | - one buttonhole. | | 205 | |
| | - two or more buttonholes. | 05 | | |
| | h. More than 2 skipped stitches in: | | | |
| | - one buttonhole. | | | 302 |
| | - two or more buttonholes. | | 206 | |



Source: https://assist.dla.mil -- Downloaded: 2026l0-20T22:53Z
Check the source to verify that this is the currentversion before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Buttonholes (construction) (cont'd) | i. Ragged edges, affecting appearance or exposed interlining not colored with reddish indelible ink. | | | 303 |
| | j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside. | | 207 | |
| | k. Stitches per buttonhole (not including bartack) less than the minimum specified: | | | |
| | - one or two stitches. | | | 304 |
| | - three or more stitches. | | 208 | |
| | l. One or more buttonholes finished with purling on the outside of fronts. | 106 | | |
| Buttons or ring toggles | a. Missing, loose, broken or defective: | | | |
| | - 1 button or ring toggle. | | 209 | |
| | - 2 or more buttons/toggles. | 107 | | |
| | b. Not specified type, size color or finish. | | 210 | |

NOTE: Buttons shall be considered defective if they have sharp, rough or cracked edges; scratched, blemishes or imbedded foreign matter on face side of button, loose shanks or badly shaded.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Cleanness | a. One or more removable spots or stains clearly noticeable on outside of jacket. | | 211 | |
| | b. One or more removable spots or stains clearly noticeable on inside of jacket. | | | 305 |
| | c. One or more spots or stains of an obvious permanent nature. | 1 | | |
| | d. Thread ends not trimmed, loose thread ends, 2 or more shade markings, or basting not removed throughout garment (to be scored when the condition | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Cleanness (cont'd) | exists on major portion of jacket). | | 212 | |
| Components and assembly | a. Any defective component or assembly (not herein classified). | 108 | | |
| | b. Any component part or required operation omitted (not herein classified). | 109 | | |
| Cutting | a. Any component part of basic wool material not cut in accordance with directional lines on patterns, or in accordance with specification requirements. | 110 | | |
| | b. Cloth, gabardine (white) for piping cut on the bias. | | 213 | |
| | c. Any lining part not cut in accordance with directional lines on patterns. | | 214 | |
| Eyelets (construction) | a. One or more omitted or added. | 111 | | |
| | b. Wrong type. | 112 | | |
| | c. Eyelet not securely caught on fabric, causing stitching to pull away from fabric. | 113 | | |
| | d. Diameter of inside opening less than 1/8 inch or more than 1/4 inch. | | | 306 |
| | e. One or more eyelets uncut. | | 215 | |
| | f. One or more broken stitches in: | | | |
| | - one eyelet. | | | 307 |
| | - two or more eyelets. | | 216 | |
| | g. More than two skipped stitches in one or more eyelets. | | 217 | |
| Hook and eye | a. Not specified type or size. | | 218 | |
| | b. Hook or eye not securely tacked to the ends of the collar. | | | 308 |
| | c. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Hook and eye (cont'd) | buttoned and hook and eye is fastened. | | 219 | |
| Material defects and damages | a. Any weakening defect such as a smash, multiple float, loose slub, etc., that may develop into a hole. | 114 | | |
| | b. Any hole (including drill holes). | | 220 | |
| | c. Shade bar, Unsightly slubs etc: | | | |
| | - on outside. | 115 | | |
| | - on inside. | | 221 | |
| | d. Needle chews which may develop into a hole. | 116 | | |
| | e. Scissors or knife cut, tear, mend or burn. | 117 | | |

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have negligable effect on serviceability are to be classified as follows:

| | |
|---|---|
| Material defect | No defect |
| Workmanship damages | Minor B defects |

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Ornamental braid | a. Not specified, type, size or color. | 118 | | |
| | b. One or more omitted. | 119 | | |
| Pressing | a. Burned or scorched. | | 222 | |
| | b. Pressing omitted (entire garment). | | 223 | |
| | c. Poorly pressed (unless otherwise classified). | | 224 | |
| | d. Armhole stretched. | | 225 | |
| | e. Basting or pressing impressions not removed on major portion of jacket. | | | 309 |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Pressing (cont'd) | f. Gloss not removed throughout jacket, affecting appearance. | | | 310 |
| | g. Armholes not blocked, or blocked poorly. | | 226 | |
| | h. Inside of armholes not pressed solidly. | | 227 | |
| | i. Edges bulky,i.e., not pressed solid, affecting appearance. | | | 311 |
| | j. Lining not pressed smooth. | | | 312 |
| Seams and stitching | a. Accuracy of seaming: | | | |
| | 1. Any seam twisted,puckered or pleated, affecting appearance. | | 228 | |
| | 2. Part of garment caught in any unrelated operation or stitching. | 120 | | |
| | 3. Unsightly hand felling or blindstitching exposed on outside affecting appearance. | | 229 | |
| | 4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required. | | | 313 |
| | 5. Wrong color of thread used on outside of jacket, affecting appearance. | 121 | | |
| | b. Gage of stitching (edge or raised stitching): | | | |
| | 1. Irregular, i.e., unevenly gaged or various stitching not uniform affecting appearance. | | 230 | |
| | 2. Beyond range of width specified or varies more than 1/16 inch when no range is specified. | | | 314 |
| | c. Open seams | | | |
| | 1. On outside: | | | |
| | - up to 1/4 inch inclusive. | | | 315 |
| | - more than 1/4 inch but not more than 1/2 inch. | | 231 | |
| | - more than 1/2 inch. | 122 | | |
| | 2. On inside: | | | |
| | - more than 1/2 inch except machine felling. | | 232 | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Seams and stitchings (cont'd) | - up to 1/2 inch inclusive (except machine felling). | | | 316 |
| | - up to 1 inch inclusive (machine felling). | | | 317 |
| | - more than 1 inch (machine felling). | | 233 | |

NOTE: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Seams and stitchings (cont'd) | d. Raw edges: | | | |
| | 1. On outside: | | | |
| | - up to 1/8 inch inclusive. | | | 318 |
| | - more than 1/8 inch but not more than 1/4 inch. | | 234 | |
| | - more than 1/4 inch. | 123 | | |
| | 2. On inside: | | | |
| | - more than 1/8 inch. | | | 318 |
| | - but not more than 1/4 inch. | | 235 | |

NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Seams and stitchings (cont'd) | e. Run-offs (see classification of open seams. | | | |
| | f. Stitch tension: | | | |
| | 1. Loose tension resulting in loose seam. | 124 | | |
| | 2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread. | | 236 | |
| | 3. Tight tension (stitches break when normal strain is applied). | 125 | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test the seam by exerting pull in a lengthwise direction.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Seams and stitchings (cont'd) | g. Stitches per inch (excluding labels). | | | |
| | 1. Less than minimum specified: | | | |
| | - one or two stitches. | | | 319 |
| | - three stitches. | | 237 | |
| | - four or more stitches. | 126 | | |

NOTE: To be scored only if condition exists on a major portion of a seam.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Seams and stitchings (cont'd) | h. Stitch and seam type: | | | |
| | 1. Wrong stitch or seam type. | | 238 | |
| | i. Stitching skipped or broken (on edge, or raised stitching when seam is seamed, turned and stitched): | | | |
| | - 1/4 inch or more but not more than 1/2 inch. | | | 320 |
| | - more than 1/2 inch. | | 239 | |
| Shaded parts | a. On outside: | | | |
| | 1. Any shaded part (except ornamental braid). | | 240 | |
| | 2. Any ornamental braid shaded, affecting appearance. | | 241 | |
| | b. On inside | | | |
| | 1. Any lining part badly shaded (except sleeve lining). | | 242 | |
| | 2. Any sleeve lining part badly shaded or pairs not matching each other. | | | 321 |

4.5.5.2 Detailed defects. Detailed defects are when a jacket is buttoned on a form or spread out on a table. The defects shall be classified as follows:



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

ject - Sleeves unequal in length by more than 1/4 [illegible] deviations specified in 3.7 shall be scored as a de

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Collar (construction and setting) | a. Interlining omitted (buckram, or twill polyester, or fusible). | 127 | | |
| | b. Interlining tight or twisted causing puckers on collar affecting appearance. | | 243 | |
| | c. Tight at joining of front and back causing puckers or pleats at jacket neck, affecting appearance. | | 244 | |
| | d. Piping irregular, affecting appearance. | | 245 | |
| | e. Collar ends overlapping when fastened. | | 246 | |
| | f. Collar ends spread open more than 3/8 inch when fastened. | | 247 | |
| | g. Center of eyelets from finished ends of collar: | | | |
| | - less than 1-3/8 inches but not less than 1-1/4 inches. | | | 322 |
| | - more than 1-5/8 inches but not more than 1-3/4 inches. | | | 323 |
| | - less than 1-1/4 inches or more than 1-3/4 inches. | | 248 | |
| | h. One or both eyelets off-center with top and bottom edges of collar by more than 1/4 inch. | | | 324 |
| | i. Front finished ends of collar uneven in width by 3/16 inch or more. | | 249 | |
| Alignment of front buttons and buttonholes | a. Not aligned, causing a noticeable bulge or twist on fronts when buttoned affecting appearance. | | 250 | |
| | b. Horizontal alignment of buttons on left front: | | | |
| | 1. One or more rows out of alignment by more than 1/4 inch but not more than 3/8 inch. | | 251 | |
| | 2. One or more rows out of alignment by more than 3/8 inch. | 128 | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Ornamental braid (position, construction and setting) | a. One or more rows out of horizontal alignment by more than 1/4 inch. | | 252 | |
| | b. One or more rows of braid not formed with either a figure 8 or a harp. | 129 | | |
| | c. Diameter of figure 8 circle less than 27/32 inch or more than 7/8 inch. | | | 325 |
| | d. Back edge of second harp from top less than 3/8 inch from finished armhole seam. | | 253 | |
| | e. One or more inner circles forming figure 8 less than 1/8 inch in diameter. | | 258 | |
| | f. One or more rows of braid not stitched through interlining. | | | 326 |
| | g. Stitching of braid not started or ending at bottom of harp where the front and back cross. | | | 327 |
| | h. Stitching of braid not uniform affecting appearance. | | 259 | |
| | i. Ends of stitching not securely tacked on one or more braids. | | 260 | |
| | j. One or more braids not lying smooth, i.e., puckered, twisted, pleated or having excessive fullness, affecting appearance. | | 261 | |
| | k. Braid not pressed smooth and flat. | | | 328 |
| | l. One or more harps not formed in accordance with Figure 4. | | 262 | |
| | m. Braid loop around one or more buttonholes not properly positioned, restricting use of buttonhole for buttoning. | | 263 | |
| | n. Inner edges of horizontal braid not adjacent to one another, i.e., spaced more than 1/16 inch apart on one or more braids. | | 264 | |
| | o. Front edge of one or more braids on right front positioned less than 1/4 inch | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| | from piping joining seam. | | | 329 |
| Ornamental braid (position, construction and setting) (cont'd) | p. Front edge of braid out of vertical alignment with left front edge of jacket by 1/8 inch or more. | | 265 | |
| | q. One or more horizontal braids not hand felled together at inner edges for full length of straight portion except at openings for buttonholes. | | 266 | |
| Length of buttoned fronts | a. Right front at corner shorter than left front at bottom by: - more than 1/8 inch but less than 1/4 inch. | | 267 | |
| | - more than 1/4 inch. | 130 | | |
| | b. Right front at corner longer than left front by: - more than 1/4 inch but less than 3/8 inch. | | | 330 |
| | - more than 3/8 inch. | 131 | | |
| | c. Left front at corner exposed beyond bottom edge of right front by more than 1/8 inch. | | 268 | |
| Shoulder (construction) | a. Improperly joined or set, causing shoulder or back to twist. | | 269 | |
| Shoulder pads | a. Not completely caught in armhole tacking. | | 270 | |
| | b. Misplaced, not serving intended purpose, i.e., too far back or forward. | | 271 | |
| | c. One or both pads omitted. | | 272 | |
| Armholes (construction) | a. Badly stretched, affecting appearance. | | 273 | |
| | b. Tape too tight, causing puckering. | | 274 | |
| | c. Crooked seam, affecting appearance. | | 275 | |
| | d. Tape stitching exposed and visible on outside surface. | | | 331 |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Armholes (construction) (cont'd) | e. Sleeve head pads not completely tacked to armholes or misplaced, not serving intended purpose. | | 276 | |
| | f. One or both sleeve head pads omitted. | | 277 | |
| Sleeves | a. Setting and hang: 1. Sleeve fullness misplaced affecting appearance. | | 278 | |
| | 2. Hang of sleeves on the same jacket in opposite direction by more than 2 inches. | | 279 | |
| | 3. Sleeve tight in armhole, i.e., roll effect not present. | | | 332 |
| | b. Sleeve lining: 1. Twisted, tight, or short causing bulge, twist, or puckering on outside of sleeves. | 132 | | |
| | 2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch. | | | 333 |
| | 3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of sleeve. | | | 334 |
| | c. Construction of sleeves: 1. Tacking on bottom turn-up to bode of sleeve omitted or insecure. | | 280 | |
| | 2. Sleeve bottom edge uneven by more than 1/4 inch. | | | 335 |
| | 3. Tacking on one or both sleeve lining seams to sleeve seams omitted, or insecure. | | | 336 |
| | 4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from bottom of sleeve. | | | 337 |
| | d. Sleeve cuffs: 1. Piping irregular, affecting appearance. | | 281 | |
| | 2. Top edge on top sleeve part | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Sleeves (cont'd) | poorly shaped affecting appearance. | | 282 | |
| | 3. Height of pointed end on both sleeves varying in length by more than 1/4 inch. | | 283 | |
| | 4. Sleeve puckered at joining of cuff, affecting appearance. | | 284 | |
| | 5. Cuff puckered or twisted at joining to sleeve, affecting appearance. | | 285 | |
| | 6. Ends of cuffs staggered at backarm seam: | | | |
| | - 1/8 inch or more but not more than 1/4 in. | | | 338 |
| | - more than 1/4 inch. | | 286 | |
| | 7. Height of cuff at point on top sleeve including piping: | | | |
| | - less than 4-3/4 but not less than 4-1/2 inches or more than 5-1/4 but not more than 5 1/2 inches. | | | 339 |
| | - Less than 4 1/2 or more than 5-1/2 in. | | 287 | |
| | 8. Height of cuff at backarm or front creased edges including piping: | | | |
| | - less than 2-3/4 but not less than 2-1/2 inches or more than 3-1/4 but not more than 3-1/2 inches. | | 288 | |
| | - less than 2-1/2 inches or more than 3-1/2 inches. | | 289 | |
| | 9. Point of cuff not centered between the lower forearm folded edge and the folded backarm edge of sleeve by more than 1/4 inch. | | | 340 |
| Position of eyelets on sleeve cuffs | a. Horizontal alignment of eyelet on one sleeve cuff not uniform with other sleeve cuff by more than 1/4 inch. | | | 341 |
| | b. Eyelets on one or both sleeve cuffs out of vertical alignment by more than 1/8 inch. | | | 342 |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Body (outside) | a. Fitting of body lining: 1. Tight, short, or twisted causing fullness or twist on outside of jacket affecting appearance. | 133 | | |
| | b. Fitting of front interlining: 1. Tight, short, or twisted, causing fullness or twist on outside of jacket affecting appearance. | 134 | | |
| | 2. Too full, causing jacket front to have a wavy appearance. | 135 | | |
| Front side, front side back and center back seams | a. One or more joining seams not spread open and pressed flat. | | 290 | |
| | b. Curved side back panel seam stretched or distorted affecting appearance. | | 291 | |
| | c. Curved center back seam stretched or distorted. | | 292 | |
| Front and bottom edges | a. Front edges stretched affecting appearance. | | 293 | |
| | b. Piping set on tight, causing puckering on front affecting appearance. | | 294 | |
| | c. Front at bottom piping irregular, affecting appearance. | | 295 | |
| | d. Bottom edge stretched, puckered or uneven, affecting appearance. | | | 343 |
| | e. Bottom corner of right front poorly shaped affecting appearance. | | 296 | |
| | f. Right front rolling outward below bottom button. | | 297 | |
| | g. Front edge irregular, affecting appearance. | | 298 | |
| | h. Piping tight on bottom edge, causing puckering on outside of jacket, affecting appearance. | | 299 | |
| | i. Right front not dressed as specified. | | 201a | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Front facing | a. Short, tight or twisted causing fullness or twists on front, affecting appearance. | | 202a | |
| Front buttonholes (position) | a. Position from front edge including piped edge:<br>- less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch. | | | 344 |
| | - less than 1/2 inch or more than 7/8 inch. | | 203a | |
| | b. More than 1/4 inch from equal spacing. | | 204a | |
| | c. Unevenly spaced from front edge by more than 3/16 inch. | | 205a | |
| | d. Top buttonhole less than 7/8 inch or more than 1-1/8 inch from top edge of piping (collar notch). | | 206a | |
| Front eyelets (position) | a. Out of vertical alignment by 1/4 inch or more. | | 207a | |
| | b. Center of one or more eyelets positioned from left front edge:<br>- less than 2 inches but not less than 1-3/4 inches or more than 2-1/4 inches but not more than 2-1/2 inches. | | | 345 |
| | - less than 1-3/4 inches or more than 2-3/8 inches. | | 208a | |
| Labels | a. Any required label missing, incorrect, illegible or size label not caught in stitching. | 136 | | |
| | b. Identification/instruction label not stitched on 4 sides. | | 209a | |
| | c. Bottom edge of identification/instruction label less than 3 inches or more than 5 inches from bottom edge of jacket. | | | 346 |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Lables (cont'd) | d. Label(s) misplaced. | | | 347 |
| | e. Identification/instruction label not stitched to outside of right facing. | | | 348 |
| Hanger | a. Hanger omitted or ends not securely tacked. | 137 | | |
| | b. Less than 1-7/8 inches or more than 2-1/8 inch opening. | | 210a | |
| | c. Finished width less than 1/4 inch or more than 3/8 inch. | | | 349 |
| | d. Hanger not stitched to neck of jacket prior to seeming collar to neck of jacket. | | | 350 |
| Front facing | a. Fullness or pleats on facings between eyelets, buttonholes, or between front edge and eyelets or buttonholes. | | | 351 |
| | b. Tacking on back edge of one or both interlinings: - omitted. | | 211a | |
| | - insecure or incomplete for a distance of more than 4-1/2 inches below shoulder seams, or more than 4 inches above bottom edge of jacket. | | | 352 |
| | c. Felling at bottom edge of front facing or back edge of facing omitted or insecure on one or both facings. | | 212a | |
| | d. Felling along folded edge of one or both facings at collar notch omitted or insecure. | | 213a | |
| Body lining | a. Excessive puckering or pleated. | | | 353 |
| | b. Twisted, not affecting smoothness on outside of jacket. | | | 354 |
| | c. One or both chest pleats on on shoulders omitted. | | 214a | |
| | d. Folded edge of one or both chest pleats facing front edge of jacket. | | | 355 |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Body lining (cont'd) | e. Pleat omitted at center of back lining. | | 215a | |
| | f. Pleat less than 1/2 inch in depth at center back lining. | | | 356 |
| | g. Lining too long, i.e., exposed beyond bottom edge of jacket. | | 216a | |
| Underarm shields | a. One or both omitted. | | 217a | |
| | b. Tacking on one or both shields along side or bottom edge to body lining omitted or insecure. | | | 357 |
| | c. Top edge not caught in armhole stitching or tacks when hand tacked. | | | 358 |
| | d. Puckered, pleated or twisted. | | | 359 |
| | e. One or both shields misplaced, not serving intended purpose. | | | 360 |
| Inside of armhole | a. Backstitching at armpit of armhole from backarm seam of sleeve to front edge of sleeve omitted. | | | 361 |
| Collar extension tab | a. Omitted. | | 218a | |
| | b. Extends less than 1/2 inch or more than 1 inch beyond end of collar. | | | 362 |
| | c. Felling omitted or insecure at top, back, front or bottom edges. | | 219a | |
| | d. Box stitching omitted. | | 220a | |
| Collar lining and eyelet covers | a. Ends of collar lining not securely tacked. | | 221a | |
| | b. One or both eyelet covers omitted. | | 222a | |
| | c. One or both eyelet covers not covering eyelet. | | 223a | |
| | d. Width of collar eyelet less than 1-5/8 inches or more than 1-7/8 inches. | | | 363 |
| | e. Felling on front edge and along lower corner of one or both eyelet covers omitted. | | 224a | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

| Examine | Defects | Classification Major | Minor A | Minor B |
|---|---|---|---|---|
| Collar lining and eyelet covers (cont'd) | f. Felling along lower corner of one or both eyelet covers extending for a distance of more than 3/4 inch. | | | 364 |
| Hook and eye | a. Top or bottom hook positioned less than 1/4 inch from top or bottom edges respectively of collar. | | | 365 |
| | b. Top or bottom hook positioned more than 1/2 inch from top and bottom edges respectively of collar. | | | 366 |



Source: https://assist.dla.mil -- Downloaded: 202610-20T22:53Z
Check the source to verify that this is the current version before use.

4.5.5.3 Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5.5.4 Examination of preparation for delivery. An examination shall be made to determine compliance with packaging, packing and marking requirements of section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery.

| Examine | Defect |
|---|---|
| Marking (exterior interior) | Omitted; incorrect; illegible; or of and improper size, location, sequence, or method of application. |
| Materials | Any component missing or damaged. |
| Workmanship | Inadequate application of components, such as incomplete closure of case liners, container flaps, loose strapping, or inadequate stapling. Bulging or distortion of containers. |
| Content | Number of coats per container is more or less than required. |

4.6 Tests.

4.6.1 Lacquer tests.

4.6.1.1 Liver of sulfur. The samples to be tested shall be immersed in a 2 percent by weight chemically pure liver of sulfur (potassium sulphide) water solution, at a temperature of 100° F, for not less than 3 minutes. The samples shall then be removed and rinsed in warm, then cold, then hot water, after which they shall be wiped gently in an absorbent cellulose material or whirled to remove residual moisture, and allowed to air dry at room temperature for a period of 1 hour. There shall be no change in the appearance of the lacquered surfaces except for a slight overall yellowing and not more than 3 dark spots, each not exceeding 1/32 inch largest dimension.



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

4.6.1.2 Tackiness. At room temperature (60° F to 80° F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

4.6.2 Weight of braid per gross yards. Weigh 6 yards of braid in a relaxed condition on a balance or scale accurate to ± 0.25 percent. Convert to ounces and multiply by 24 to obtain the weight of 144 yards.

5. PACKAGING

5.1 Preservation. Unless otherwise specified (see 6.2), the jackets shall be preserved in accordance with ASTM D 3951.

5.2 Packing. Jackets preserved in accordance with 5.1 shall be packed in accordance with ASTM D-3951.

5.3 Markings. In addition to any special marking required by the contract or order, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The jackets described herein are intended for wear by enlisted female personnel of the U.S. Marine Corps Band.

6.2. Acquisition requirements. Acquisition documents must specify the following:

a. Title, number, and date of this specification.
b. Issue of DODISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.1).
c. Sizes required (see 1.2).
d. Whether first article is required (see 3.2).
e. Number of jackets in first article (see 3.2).

6.3 Samples and shade samples. For information regarding availability of sample jackets and standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).



Source: https://assist.dla.mil -- Downloaded: 202640-20T22:53Z
Check the source to verify that this is the current version before use.

6.5 Figures. Figures 1 through 6 show general design of the jackets with assembly details and measurements. In the event of a conflict between these figures and the text of this specification, the text of this specification shall govern.

6.6 Fusing conditions. The specific machine setting should be obtained from the supplier of the particular fusible material for optimum results. The following fusing conditions include the recommendations of several suppliers of fusible material and are furnished for guidance only.

(a) Temperature between pressing surfaces of 300° F minimum and 320° F maximum, at the fuseline (not the temperature at the clock).

(b) Pressure between pressing surfaces of 6 pounds force per square inch ($1b_f/in^2$) minimum and 7 $1b_f/in^2$ maximum.

(c) Pressing time of 12 seconds minimum and 14 seconds maximum.

(d) Heat-dry.

6.7 Peel strength test. The procedure for the peel strength testing with a spring scale should be obtained from the supplier of the fusible material, and shall be accomplished 2 hours after fusing.

6.8 Changes from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

6.9 Subject term (key word) listing.

Band
Dress
Jacket
Woman's

Preparing Activity:
Navy - MC
Project No. 8410-N874



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

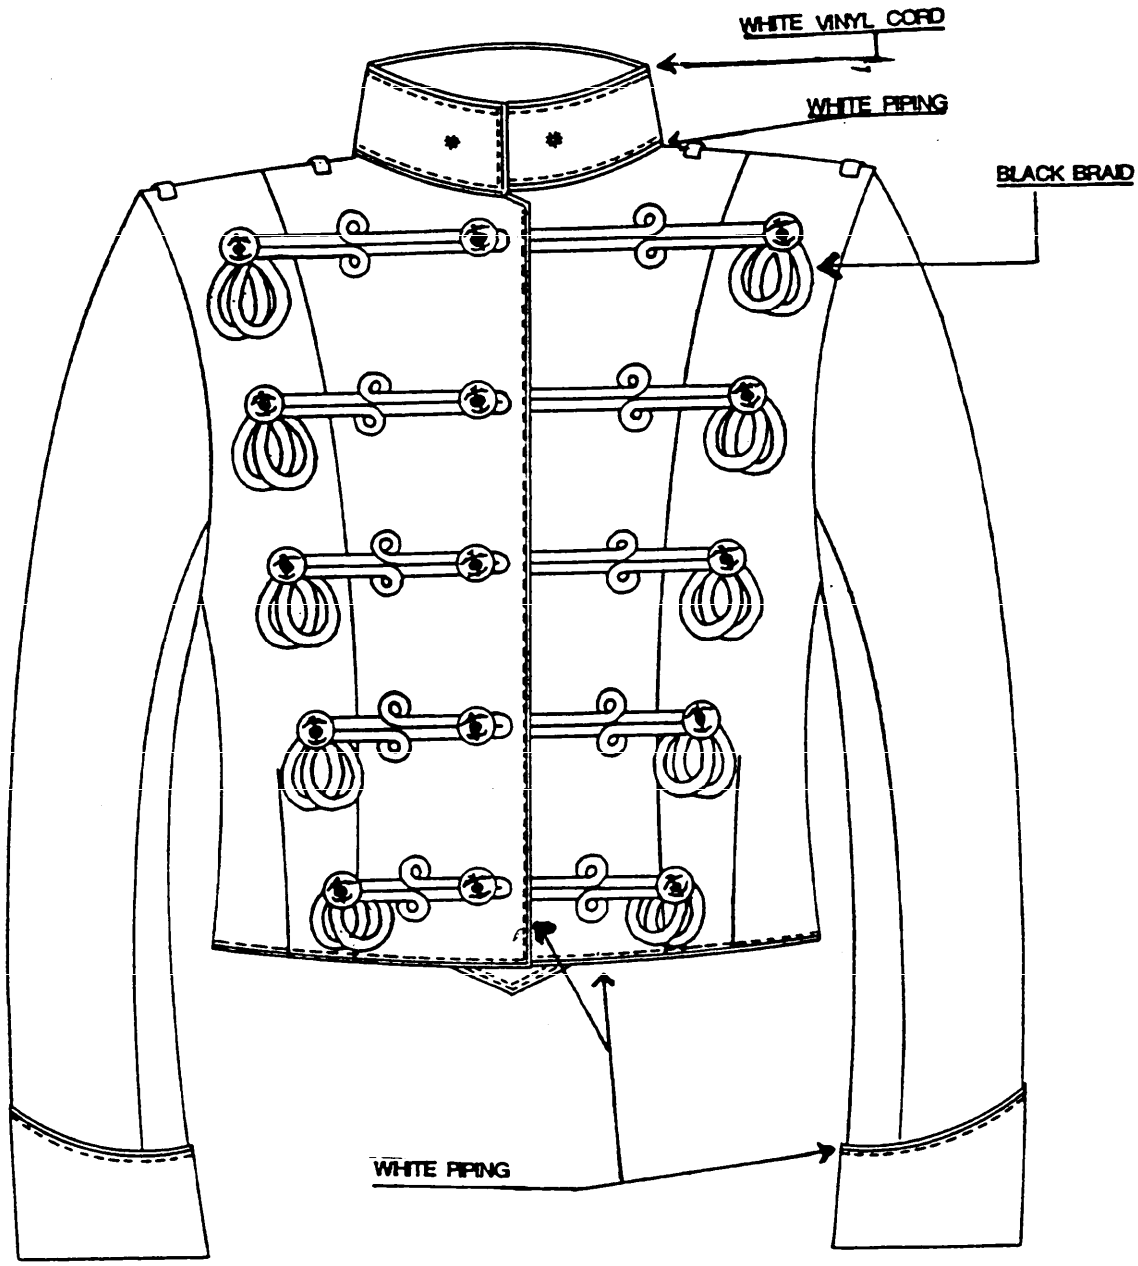



FIG. 1 JACKET, WOMEN'S FULL DRESS SCARLET, U.S. MARINE BAND, MUSICIAN



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.


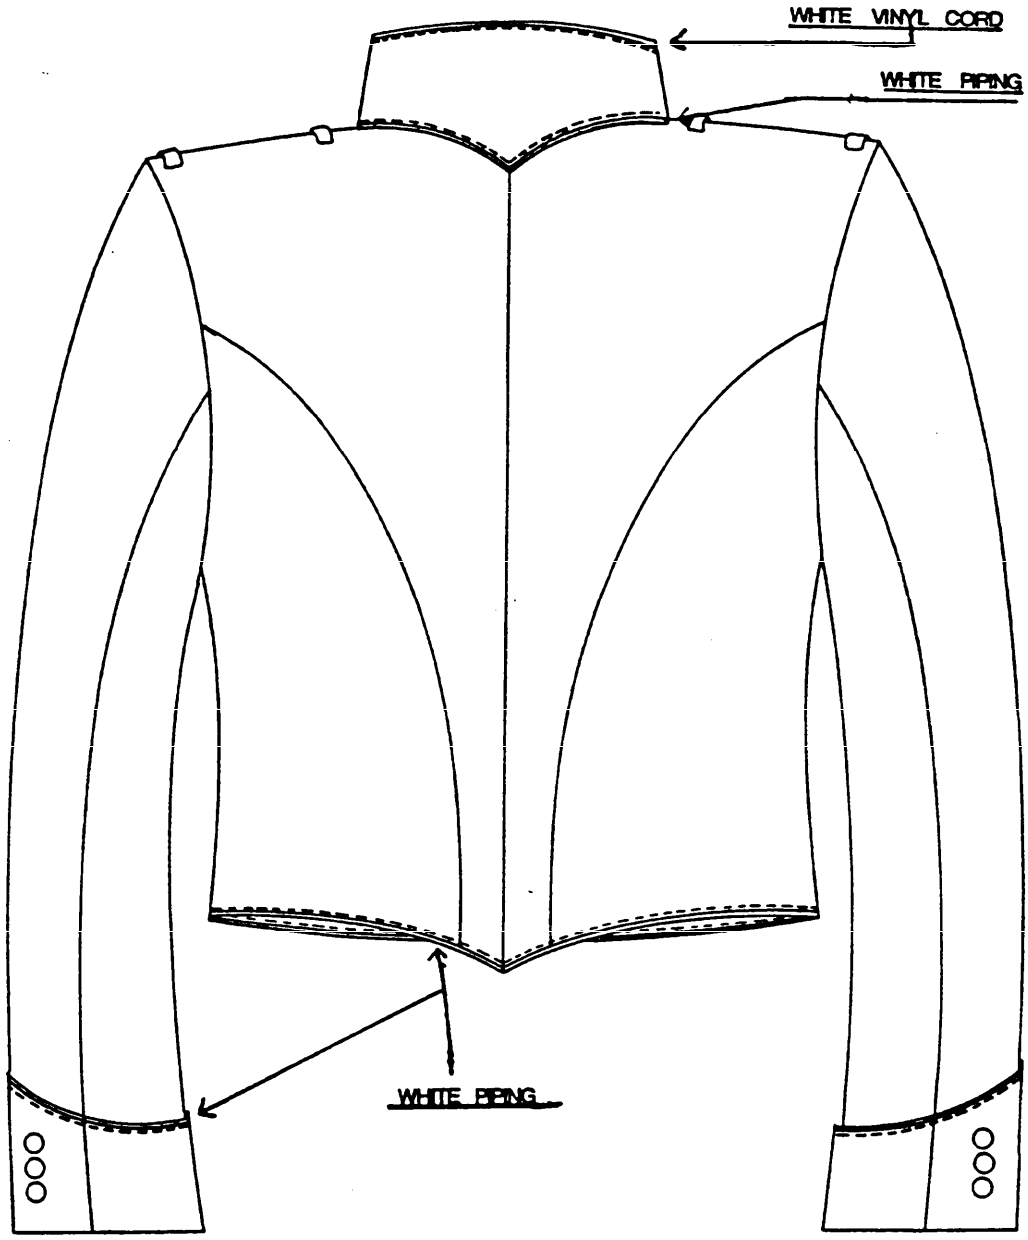



FIG. 2 JACKET, WOMEN'S FULL DRESS SCARLET, U.S. MARINE BAND



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

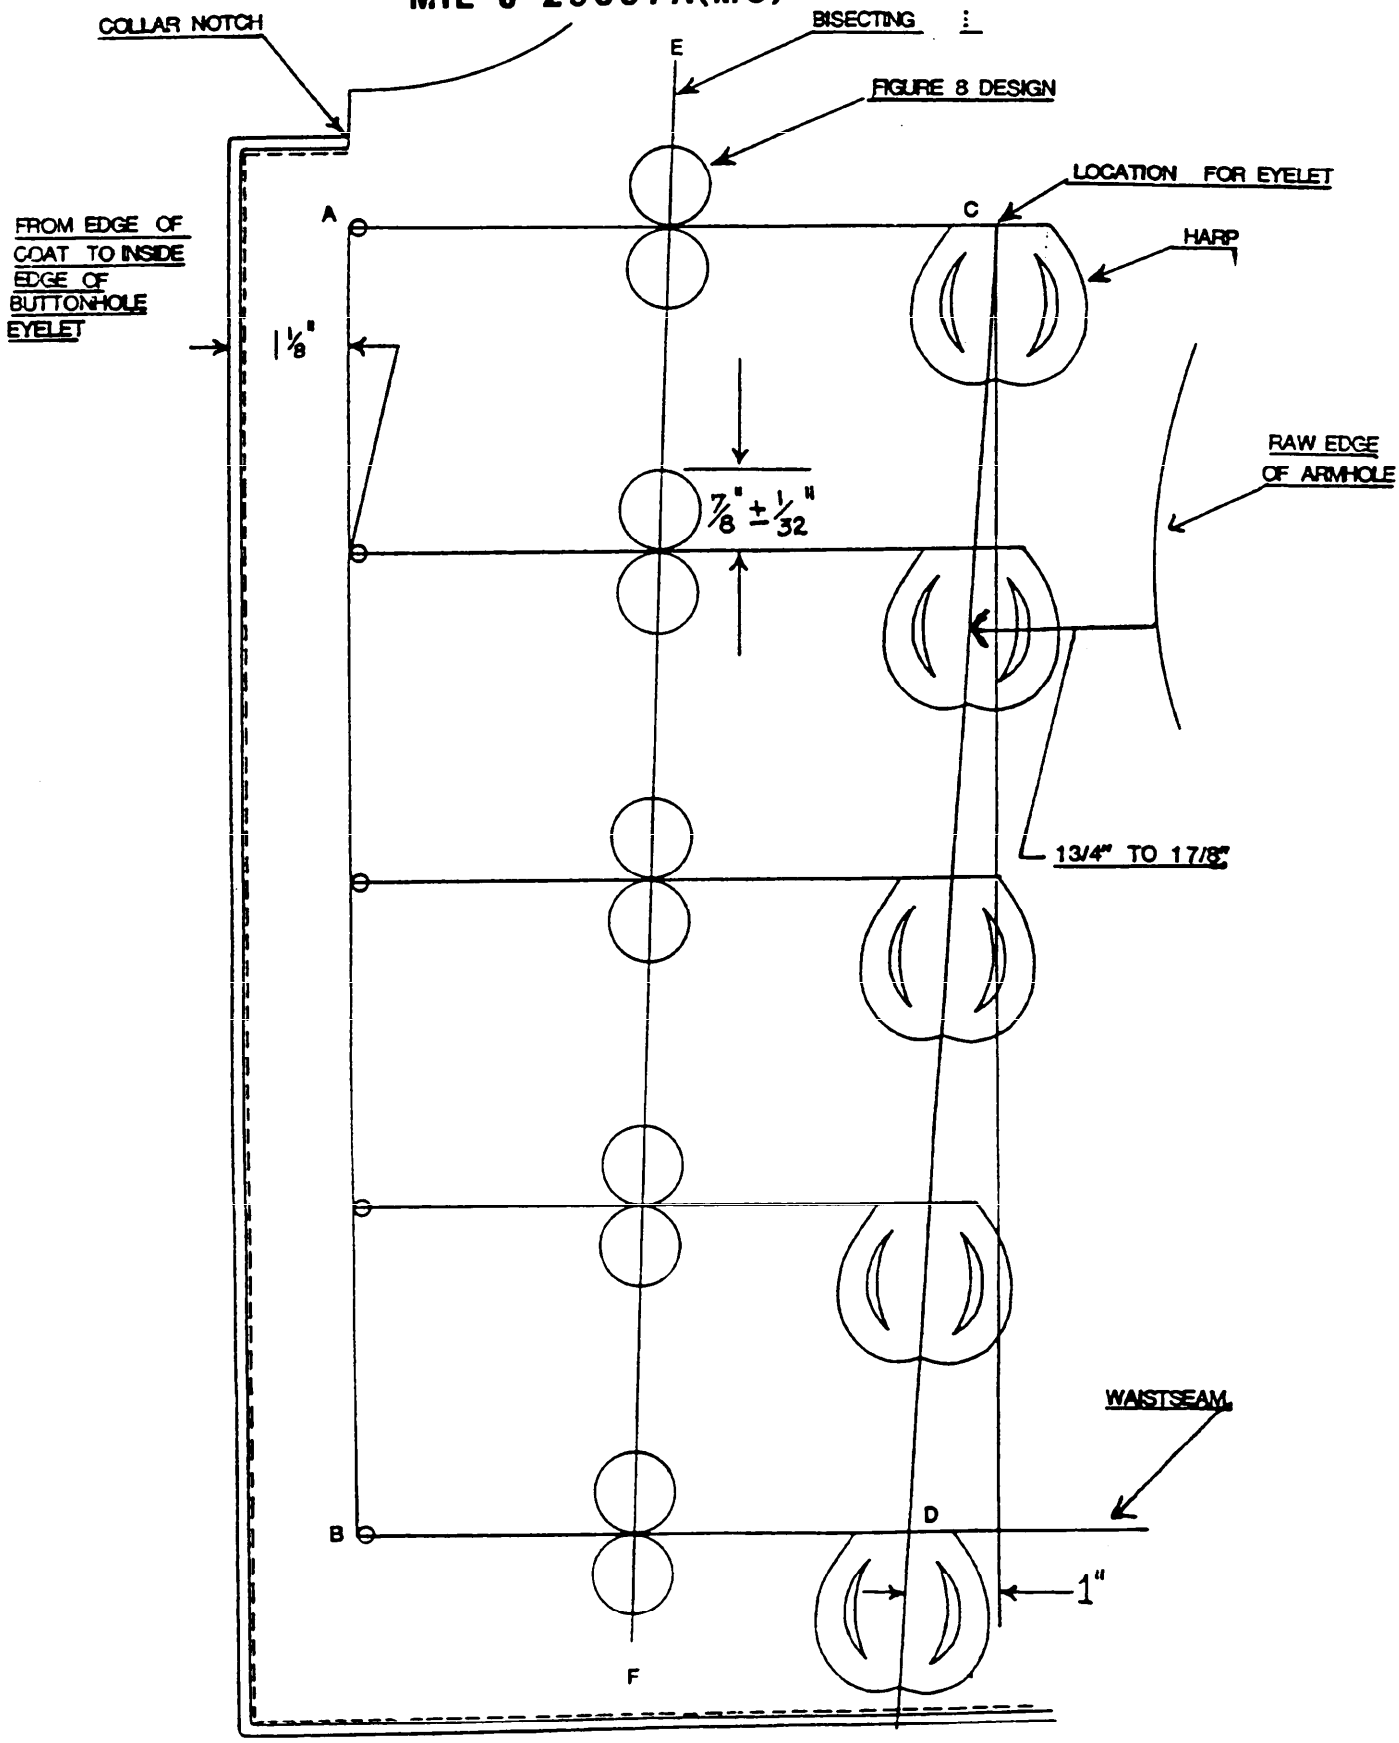



BRAID PLACEMENT DIAGRAM - LEFT FRONT

FIG. 3 JACKET, WOMEN'S FULL DRESS SCARLET, U.S. MARINE BAND, MUSICIAN




Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

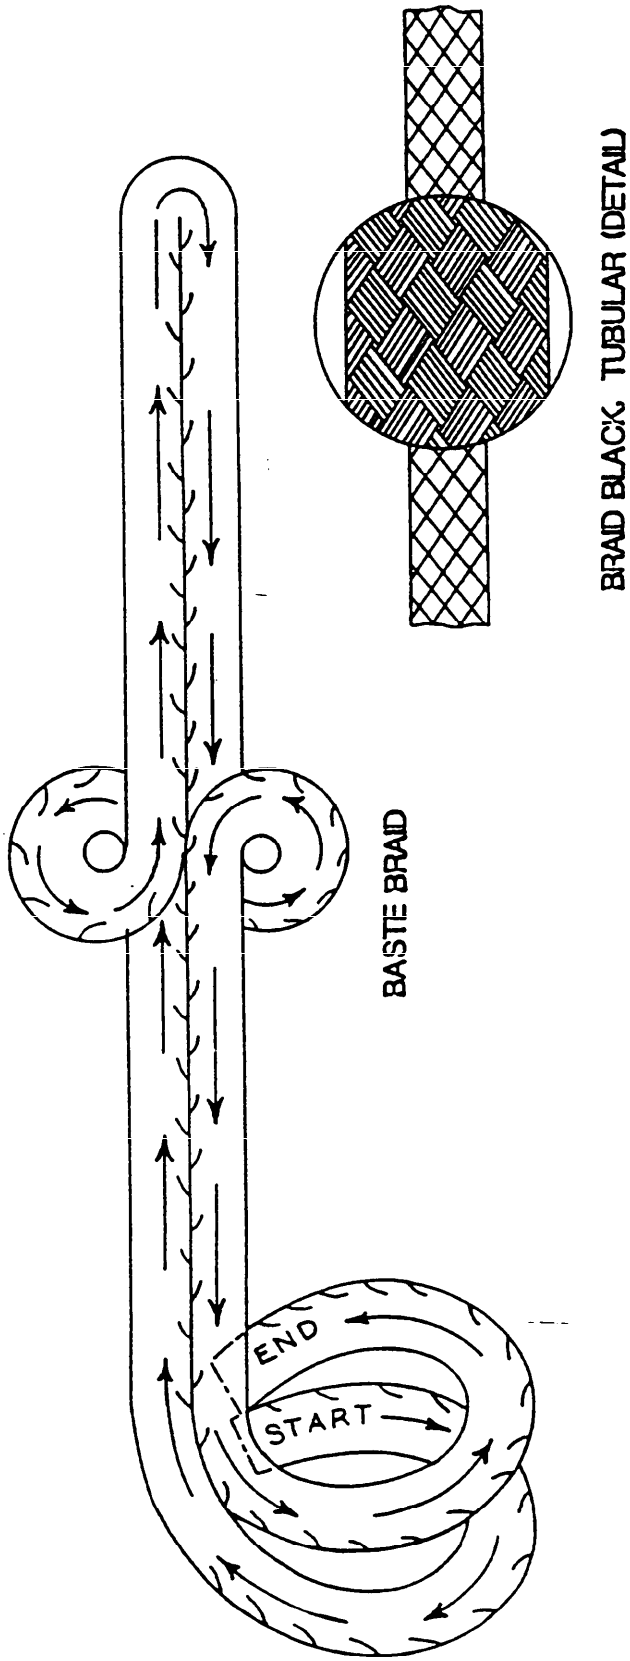


BASTE BRAID



BRAID BLACK TUBULAR (DETAIL)

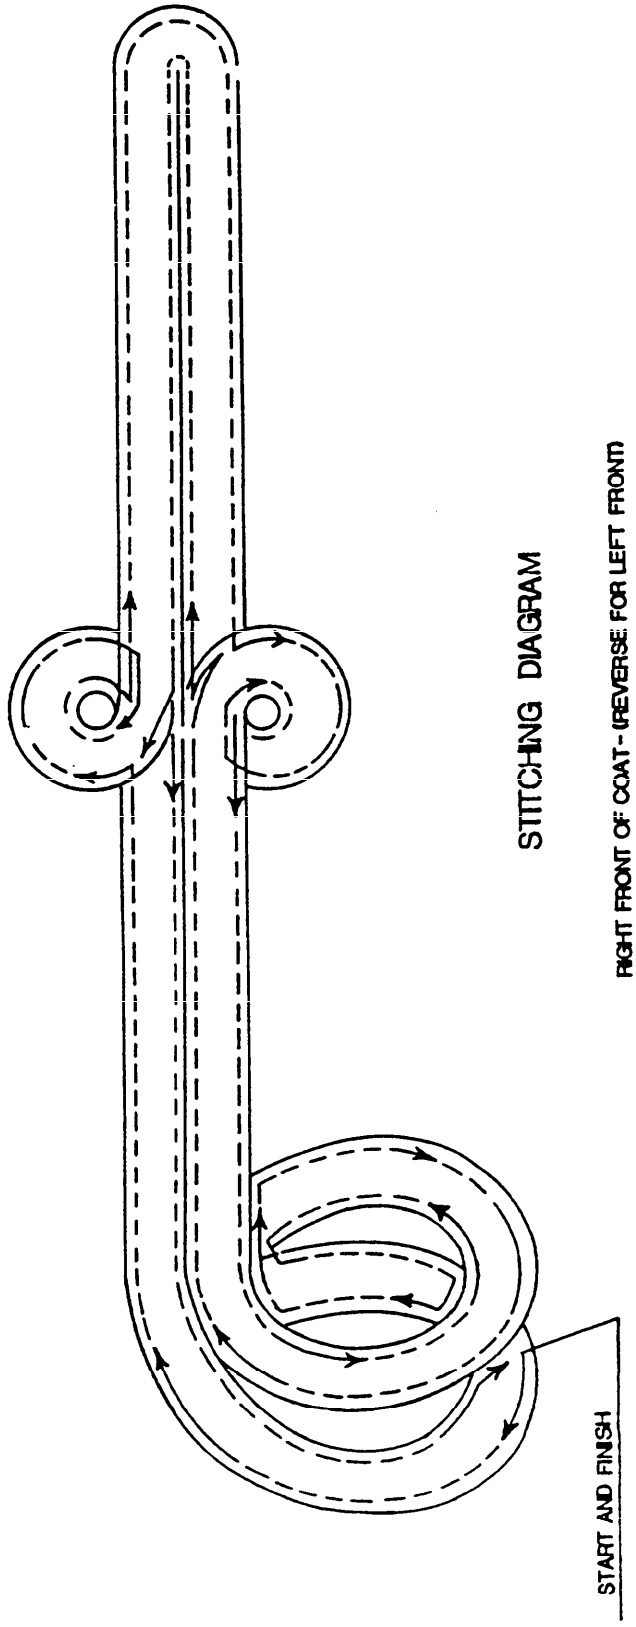


STITCHING DIAGRAM

RIGHT FRONT OF COAT - (REVERSE FOR LEFT FRONT)

FIG. 4. JACKET, WOMEN'S FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN



Source: https://assist.dla.mil -- Downloaded: 202610-20T22:53Z
Check the source to verify that this is the currentversion before use.

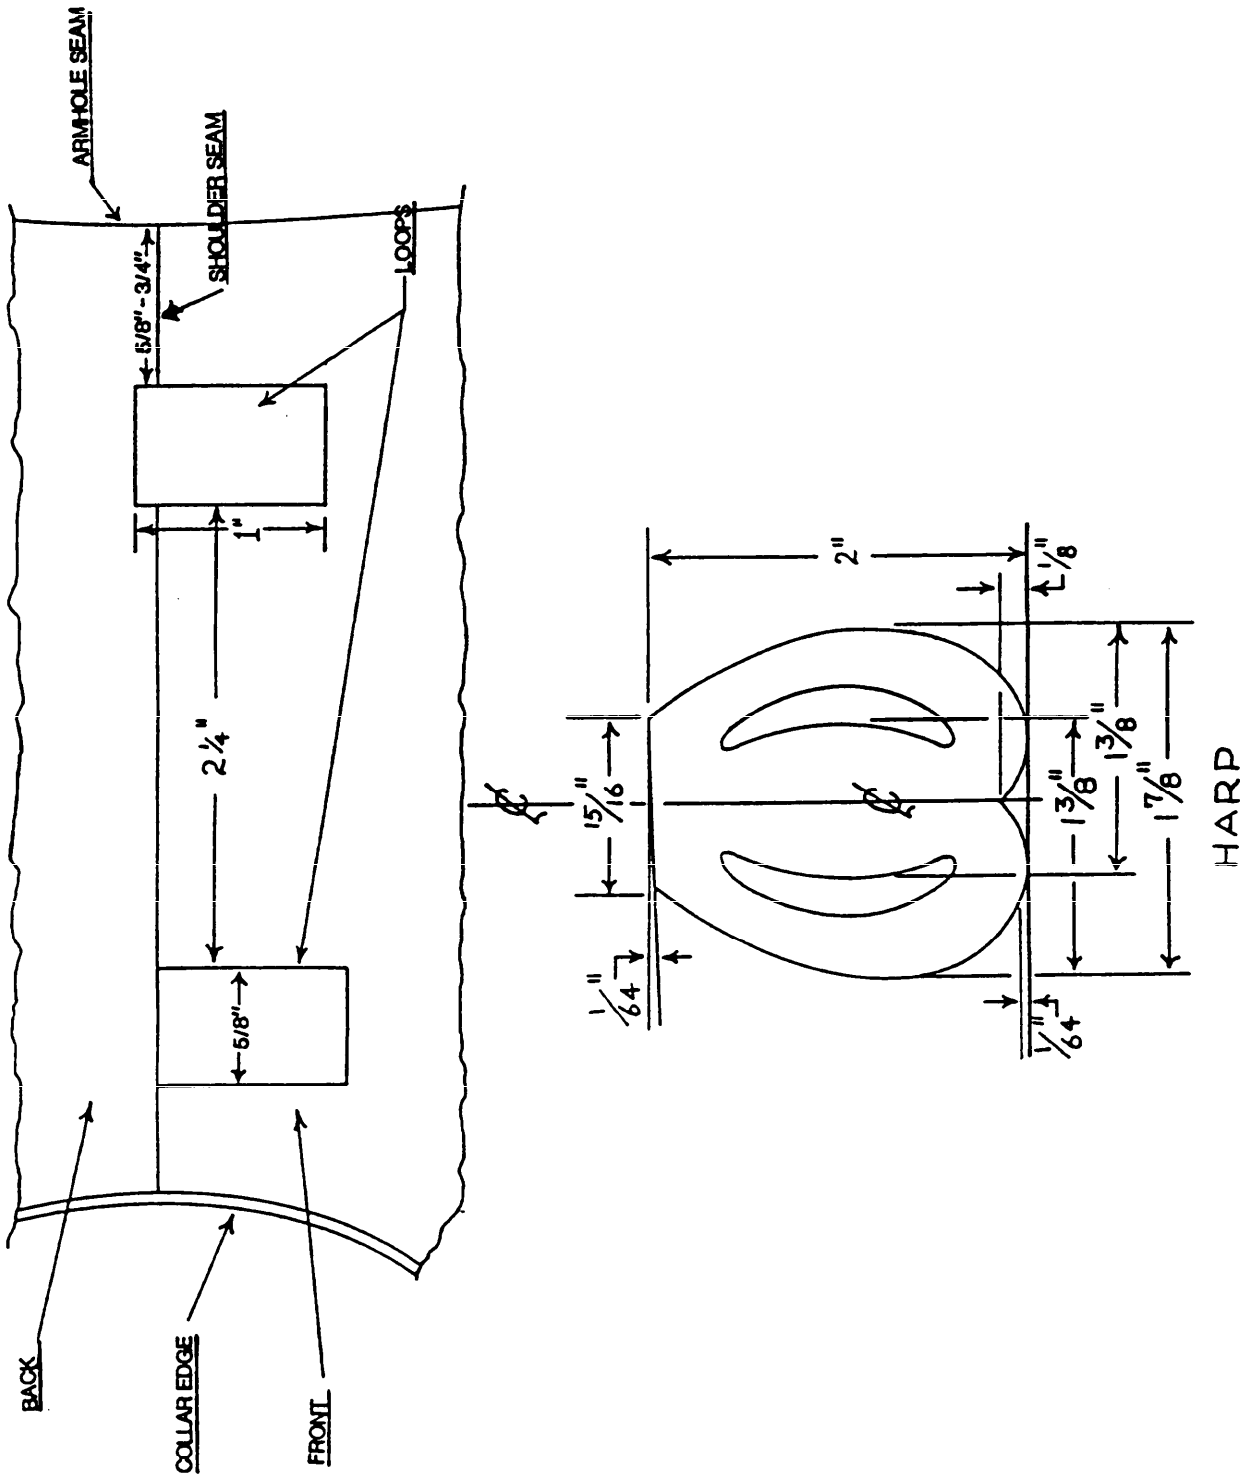



FIG. 5 JACKET, WOMEN'S FULL DRESS SC ET, U.S. MARINE BAND MUSICIAN



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

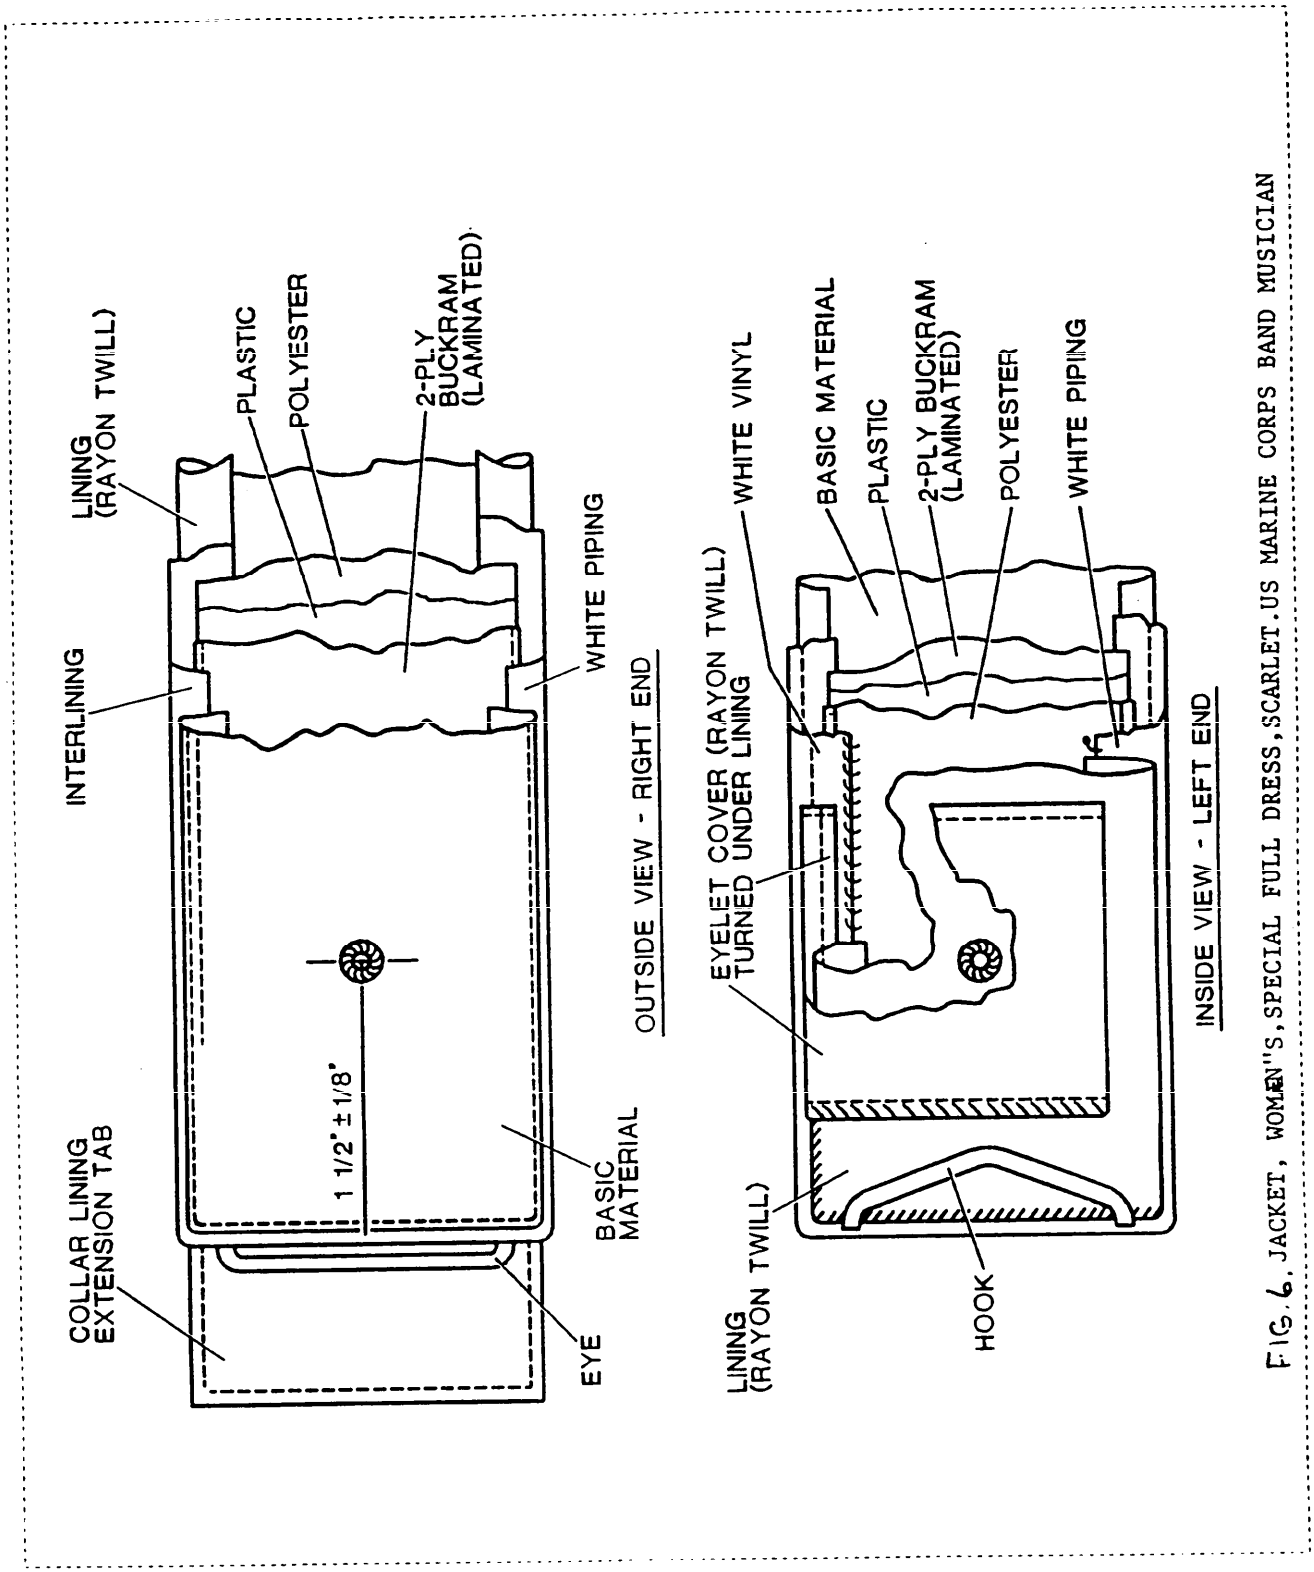



FIG. 6. JACKET, WOMEN'S, SPECIAL FULL DRESS, SCARLET. US MARINE CORPS BAND MUSICIAN



//AGW_71/PALMER/6-CLOTHING/COLLAR-1.G4
7-MAR-1995 09:29

True Size: 42 x 51 picas = 7.0" x 8.5"
Plot Scale Factor: 1.00

Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

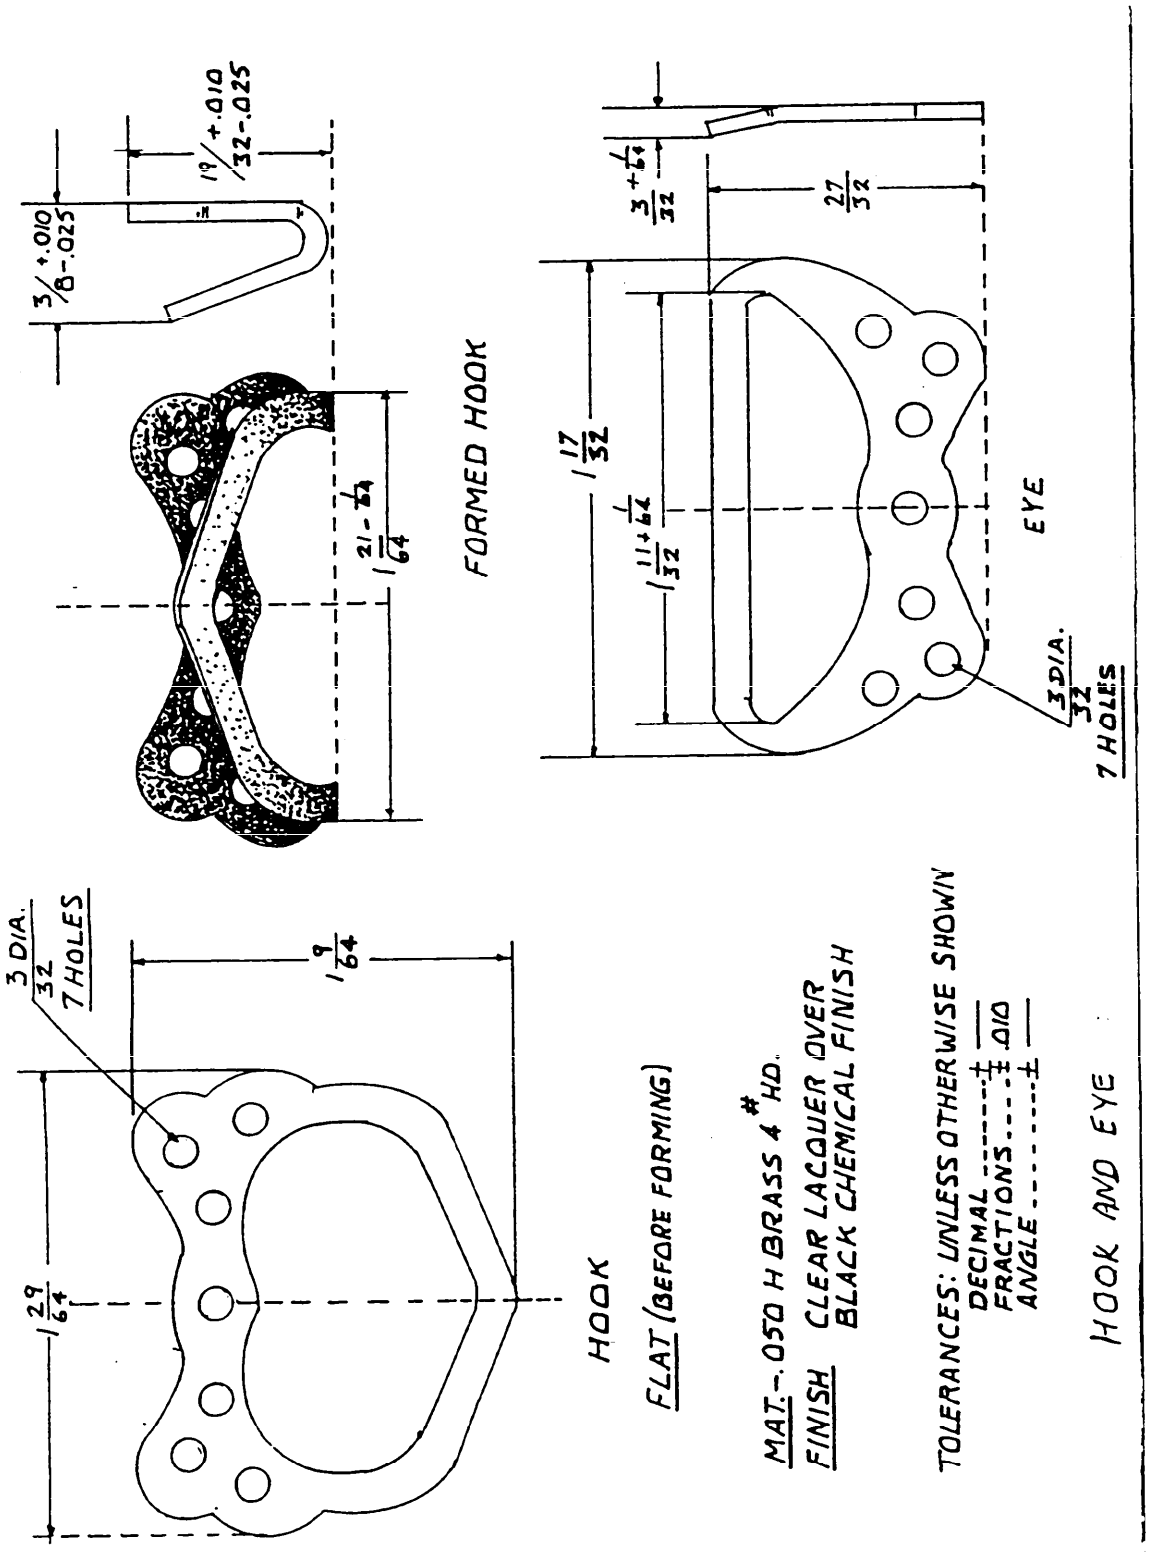



Fig 7' Jacket, Women's, Full Dress, Scarlet, US Marine Band, Musician



Source: https://assist.dla.mil -- Downloaded: 202610-20T22:53Z
Check the source to verify that this is the current version before use.

# STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

## INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

| I RECOMMEND A CHANGE: | 1. DOCUMENT NUMBER | 2. DOCUMENT DATE (YYMMDD) |
|---|---|---|
| | MIL-J-29397A(MC) | 950623 |

**3. DOCUMENT TITLE**

JACKET, WOMAN'S: FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN'S

**4. NATURE OF CHANGE** *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

**5. REASON FOR RECOMMENDATION**

**6. SUBMITTER**

| a. NAME (Last, First, Middle Initial) | b. ORGANIZATION | |
|---|---|---|
| c. ADDRESS (Include Zip Code) | d. TELEPHONE (Include Area Code)<br>(1) Commercial<br>(2) AUTOVON (If applicable) | 7. DATE SUBMITTED (YYMMDD) |

**8. PREPARING ACTIVITY**

| a. NAME | b. TELEPHONE (Include Area Code)<br>(1) Commercial | (2) AUTOVON |
|---|---|---|
| COMMANDER, ATTN PSE-C/S | (703) 784-4584 | 278-4584 |
| c. ADDRESS (Include Zip Code)<br>MARCORSYSCOM<br>2033 BARNETT AVENUE SUITE 315<br>QUANTICO VA 22134-5010 | IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT:<br>Defense Quality and Standardization Office<br>5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466<br>Telephone (703) 756-2340 AUTOVON 289-2340 | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

## 2. APPLICABLE DOCUMENTS

### 2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

| | |
|---|---|
| A-A-50186 | - Cloth, Cotton, Buckram |
| A-A-50196 | - Thread, Silk |
| A-A-50198 | - Thread, Gimp, Cotton, Buttonhole |
| A-A-50199 | - Thread, Polyester Core, Cotton or Polyester Covered |
| A-A-52071 | - Tape, Textile, Cotton, General Purpose (Unbleached, Bleached or Dyed) |
| A-A-52094 | - Thread, Cotton |
| A-A-52106 | - Cloth, Twill or Plain Weave, Polyester or Polyester Blend |
| DDD-L-20 | - Label, for Clothing, Equipage and Tentage (General Use) |

MILITARY

| | |
|---|---|
| MIL-C-368 | - Cloth, Satin, Rayon and Cloth Twill Rayon |
| MIL-B-3461 | - Buttons, Insignia, Metal, Uniform and Cap |
| MIL-P-15064 | - Pad, Shoulder and Sleeve Head |
| MIL-E-20652 | - Eyelets, Metallic and Eyelet Washers (General Specification For) |
| MIL-C-21115 | - Cloth, Tropical, Wool, Polyester and Rayon |
| MIL-C-41820 | - Cloth, Gabardine, Polyester and Rayon |
| MIL-C-44296 | - Cloth, Fusible |
| MIL-C-82114 | - Coat Front for Coats, Musician |

STANDARDS

FEDERAL

| | |
|---|---|
| FED-STD-191 | - Textile Test Methods |
| FED-STD-751 | - Stitches, Seams and Stitchings |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by attributes
MIL-STD-129 - Marking for Shipment and Storage

(Unless otherwise indicated, copies of federal and military specifications and standards are available from the Standardization Documents Order Desk, Building 4D, 700 Robins Avenue, Philadelphia, PA 19111-5094)

2.2 Non-Government publications. The following document(s) form a part of this document to the extent specified herein. Unless otherwise specified, the issues of documents which are DOD adopted shall be those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation (see 6.2).

Department of Defense (DOD Standard Color Card of Standardized Shades for Sewing Threads

(Applications for copies should be addressed to the Color Association of the United States, 409 W. 44th Street, New York, NY 10016-0927.)

AMERICAN SOCIETY OF TESTING MATERIALS
ASTM D 3951 - Standard Practice for Commercial Packaging

(Application for copies should be addressed to the American Society for Testing Materials, 1916 Race Street, Philadelphia, PA 19103-1187.)

(Non-government standards and other publications are normally available from the organizations that prepare or distribute the documents. These documents also may be available in or through libraries or other informational services.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Guide samples. Guide samples are furnished solely for guidance and information to the contractor (see 6.4). Variation from the specification may appear in the sample, in which case the specification shall govern.



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

3.2 First article. When specified (see 6.2), a sample shall be subjected to first article inspection (see 6.4) in accordance with 4.4.

3.3 Materials

3.3.1 Basic material. The basic material shall be cloth, wool, tropical, scarlet shade 2502 (see 6.3), 10.5 ounce, conforming to type I, class 1 of MIL-C-21115.

3.3.2 Collar and sleeve cuff material. The material for the collar and cuffs shall be cloth, polyester/wool blend, black shade 2607 (see 6.3), conforming to type III, class 1 of MIL-C-21115.

3.3.3 Lining. The material for lining the jacket and collar, and for making the front facing eyelet cover and jacket hanger shall be cloth, rayon twill, scarlet shade 2506 (see 6.3), conforming to class 1 of MIL-C-368.

3.3.3.1 Bias binding. The binding of the underarm shield shall be bias cut out of the lining material specified in 3.3.3. The binding shall be cut 5/8 to 7/8 inches wide and shall have sized edges.

3.3.4 Piping. The material for piping shall be cloth, gabardine, polyester/rayon, white shade 3042 (see 6.3), conforming to type I of MIL-C-41820, cut 5/8 to 3/4 inches wide for piping the lower collar edge and ornamental sleeve cuff and 1 inch wide for piping the front and bottom edges of the jacket.

3.3.4.1 Vinyl piping. The white vinyl cord for piping the upper edge of the collar shall be tubular, with 7/16 inch wide welt and serrated edge as manufactured by Pearl Binding Corporation of Philadelphia or equal.

3.3.5 Cloth twill or plain weave, polyester or polyester blend. The stays for armhole and shoulder seams, the collar interlining and the binding for the neck edge of front interlining shall be cut from cloth, twill or plain weave , polyester or polyester blend conforming to A-A-52106. The color of the cloth shall be natural for the armhole, shoulder seam stays and the binding for the neck edge of the coat front interlining; and black for binding the lower edge of the collar interlining.

3.3.6 Front interlining. The interlining for the front and side front shall be fusible cloth conforming to type V, class 2 of MIL-C-44296.



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

3.3.7. Collar interlining. The material for interlining the collar shall be cloth, cotton buckram, natural color, conforming to type I of A-A-50186.

3.3.7.1 Plastic. The plastic strip used in the collar interlining shall be clear plastic pattern stock 0.20 inches thick. It shall be cut using the cotton buckram pattern.

3.3.8 Jacket fronts. The jacket fronts shall conform to class 5 of MIL-C-82114.

3.3.9 Shoulder pads. The shoulder pads shall conform to type I, class 2 of MIL-P-15064.

3.3.10 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.11 Stay tape. The stay tapes for the armholes and waist seam shall be cotton, 1/4 inch wide, conforming to type II, class 1 of A-A-52071.

3.3.12 Thread.

3.3.12.1 Silk thread. The silk thread shall conform to A-A-50196 as follows, except the requirements for extractable matter shall not apply:

| Use | Type | Class | Ticket no | Ply |
|---|---|---|---|---|
| Bartacks and all outside seaming and stitching. | I | - | A | - |
| Machine felling. | - | - | O | |
| Making buttonholes in coat. | I | - | B and F | 3 |
| Hand felling and hand sew. | III | 3 | C | 2 |

3.3.12.2 Cotton thread. The cotton thread shall conform to A-A-52094 as follows:

| Use | Type | Ticket No | Ply |
|---|---|---|---|
| All inside seaming and stitching. | III | A | 3 |
| Serging and overedge stitching. | I | 70 | 2 |
| Machine tacking armholes and sewing buttons. | I | 40 | 3 |



Source: https://assist.dla.mil -- Downloaded: 2026-10-20T22:53Z
Check the source to verify that this is the current version before use.

The thread for basting shall be good commercial grade cotton. As an alternate to the cotton thread, a polyester core, cotton or polyester covered thread conforming to A-A-50199, ticket No. 50, 2 ply or ticket No. 70, 2 ply may be used.

3.3.12.3 Color and colorfastness. All thread shall be scarlet shade W, cable No. 66040 except: the silk thread for stitching collar, cuffs and braid, which shall be black; the cotton thread for basting and overedge stitching the piping at the bottom edge of the jacket shall be white. The colored threads shall show the following colorfastness when tested as specified in the applicable thread specification:

| Thread | Color | Wet (dry) cleaning | Light |
|---|---|---|---|
| Cotton | Scarlet | Good | --- |
| Silk | Scarlet | Fair | Fair |
| Silk | Black | Good | Good |

3.3.13. Gimp. The buttonhole gimp shall be cotton No.8, soft or glazed finish, conforming to type I or type II of A-A-50198. The color of the gimp shall be scarlet, shade W, cable No. 66040 and shall show good fastness to wet (dry) cleaning.

3.3.14 Ornamental braid. The ornamental braid for the front of the jacket shall be mohair, black, tubular, 3/8 ± 1/16 inch wide conforming to the following:

| | |
|---|---|
| Weave | Plain |
| Weight per gross yards, ounce (minimum) | 35 |
| Picks per inch (minimum) | 9 |
| Total carriers (minimum) | 16 |
| Ends per carriers (minimum) | 6 |
| Breaking strength, pounds (minimum) | 105 |
| Shrinkage:<br>- length, percent (maximum)<br>- width | <br>2.0<br>Not less than the original width |
| Colorfastness to:<br>- wet (dry) cleaning<br>- light | <br>Good<br>Good |



Source: https://assist.dla.mil -- Downloaded: 202610-20T22:53Z
Check the source to verify that this is the currentversion before use.

3.3.15 Buttons

3.3.15.1 Insignia buttons. The insignia buttons shall be metal, gold plated, 27-line and 40-line conforming to type I, style 3, class A, subclass 1 of MIL-B-3461.

3.3.15.2 Ring toggles. Ring toggles for securing the buttons to fronts and sleeves shall conform to MIL-B-3461.

3.3.16 Collar closure hook and eye. The hook and eye for closing the collar shall be brass, black japanned finish or black chemical finish in accordance with MIL-F-495, followed by a clear lacquer coating and conform to the requirements of Figure 7 which will replace the hook and eye details contained in Figure 6.

3.3.16.1 Eyelets. The eyelets for the collar shall be brass, rolled flange type, with the barrel scored 6 to 8 scores. The eyelets shall conform to MIL-E-20652, sheet 1A-BE108 and be enameled a black shade.

3.3.17. Labels. Each jacket shall have a combination identification/instruction label and a size label. The jackets are intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.17.1 Identification/instruction label. The combination identification/instruction label shall conform to type VI, class 14 of DDD-L-20, except the lines of printing shall be a minimum of 10 point (approximately 1/8 inch). The content and format shall be as follows:

NOMENCLATURE_____
CONTRACT NO._____
NAME OF CONTRACTOR_____
WOOL PRODUCTS ACT INFORMATION
_____
DRY CLEAN ONLY

3.3.17.2 Size label. The size label shall conform to type VI, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2, followed by the letter S, R, or L, for Short, Regular and Long as:

14R



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

3.4 Design. The jacket shall be the U.S. Marine Corps design shown on Figures 1 and 2, a formfitting, single-breasted, fully lined jacket with 10 gold plated insignia buttons on the left front and 5 on the right front, having fronts with black braid, a four-piece back, ornamental sleeve cuffs with gold plated insignia buttons, a standup collar with a hook and eye front closure and worked eyelets, and 2 cloth loops on each shoulder for attaching epaulets. The fronts and bottom edges of the collar, the front and bottom edges of the jacket, and the top edge of the ornamental sleeve cuff shall be piped with white vinyl cord.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard pattern. The standard pattern shall provide 3/4 inch allowance for side seams, 5/8 inch allowance for center back seam and 3/8 inch allowance for all other seams except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

3.5.1 List of pattern parts. The jackets shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

| Item | Pattern Nomenclature<br>Material basic: Cloth, wool tropical | No. of Cut Parts |
|---|---|---|
| 1. | Center front | 2 |
| 2. | Side front | 2 |
| 3. | Side back | 2 |
| 4. | Center back | 2 |
| 5. | Top sleeve | 2 |
| 6. | Under sleeve | 2 |
| 7. | Front facing-right | 1 |
| 8. | Front facing-left | 1 |
| 9. | Underarm shield | 2 |
| Item | Material: Cloth, Polyester/Wool, Black | |
| 10. | Collar outer ply | 1 |
| 11. | Sleeve cuff | 2 |
| 12. | Sleeve cuff eyelet facing( top ply) | 2 |
| 13. | Sleeve cuff eyelet facing (under ply) | 2 |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

| | Pattern Nomenclature | No. of Cut parts |
|---|---|---|
| | Material: Cloth, Rayon Twill | |
| 14. | Front | 2 |
| 15. | Side, back | 2 |
| 16. | Center back | 2 |
| 17. | Top sleeve | 2 |
| 18. | Under sleeve | 2 |
| 19. | Collar lining | 1 |
| 20. | Collar eyelet cover | 2 |
| 21. | Front facing eyelet cover | 1 |
| | Material: Cloth, Cotton Buckram | |
| 22. | Collar interlining | 1 |
| | Material: Cloth, Twill or Plain Weave, Polyester | |
| 23. | Collar interlining | 1 |
| | Material, Interlining (Fusible) | |
| 24. | Center front | 2 |
| 25. | Side front | 2 |
| | Marker | |
| 26. | Sleeve cuff and eyelet marker | |
| | Shaper | |
| 27. | Bottom shaper | |

3.6 Construction.

3.6.1 Manufacturing requirements. The jackets shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table 1. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the jackets.

3.6.1.1 Stitches, seams and stitchings. The stitch, seam and stitching types specified in Table I shall conform to FED-STD 751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching and serging shall be done on serging machines with a knife attachment properly set to trim the raveled edges without cutting the material.



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

3.3.6.1.2 Thread breaks and ends of seams. The ends of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitchings shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secure back of break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of each jacket cut from one piece of the wool and lining material, including pairs of sleeve lining and underarm shields when not cut from ends, shall be shade marked to insure uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.
(b) Sew-on shade tickets.
(c) Adhesive-type tickets which show discoloration and the use of an adhesive mass which adheres to the material upon removal of the tickets.

3.6.3 Fusing operations. The fusing operations for fusing the fusible interlining specified in 3.3.6 to the basic material of the outer shell specified in 3.3.1 shall be performed on a fusing press. Specific settings (see 6.6) for the particular fusing style and press to be used should be obtained from the supplier of the fusible material so that optimum results can be obtained.



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 1 | Cutting.<br><br>a. Cut jackets in strict accordance with patterns furnished by the Government.<br><br>b. Cut all materials in the direction of the warp as indicated by the directional lines on the pattern.<br><br>c. Cut all scarlet wool parts of the jacket from one piece of the basic material.<br><br>d. Cut the strapping for the shoulder loops from basic material in the direction of the warp 2-3/4 inches long and of sufficient width so that the finished loops will be 5/8 ± 1/8 inch wide.<br><br>e. Cut the body and collar linings, collar eyelet covers and left front facing eyelet cover from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the sleeve lining shall match. Cut the strips for the jacket hanger 1-1/8 inches wide. Cut front eyelet cover in accordance with the pattern. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 1 | Cutting. (cont'd)<br><br>f. Cut the sleeve cuffs, outer ply of collar, and cuff eyelet facings from one piece of the material specified in 3.3.2.<br><br>g. Cut twill or plain weave polyester stays for armhole and shoulder seams on the bias 3/4 inch wide and 4 ± 1/4 inches long. Cut twill or plain weave polyester for collar interlining in accordance with the patterns furnished. Cut the twill or plain weave polyester for binding the neck edge of the jacket front interlining on the bias, 3/4 inch wide and approximately 5 inches long.<br><br>h. Cut the cotton buckram and the plastic strip for interlining the collar in accordance with the pattern furnished.<br><br>i. Cut the piping material (see 3.3.4) for piping the front and bottom edges of jackets, lower edge and ends of collar and top edge of ornamental sleeve cuffs on the straight. The piping shall be cut 5/8 to 3/4 inch wide for collar and ornamental sleeve cuffs, and 1-1/4 inch wide for | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 1 | Cutting. (cont'd)<br><br>bottom and front edges of jacket. | | | | | |
| 2 | Replacement of damaged parts.<br><br>a. Replace at time of cutting any part of jacket containing holes, seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc., affecting appearance.<br><br>b. Replace any part damaged during the manufacturing process by needle chews which may develop into holes, scissor or knife cuts, tears, holes, mends or burns in the material, affecting appearance. | | | | | |
| 3 | Shade marking.<br><br>a. Mark or ticket all component parts (see 3.6.2) cut from one piece of the basic material. Mark or ticket all component parts cut from one piece of rayon lining material and the pairs of sleeve linings when cut from ends. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 3 | Shade marking. (cont'd) | | | | | |
| | b. The use of tickets with any metal fastening devices is prohibited on the rayon lining. | | | | | |
| 4 | Make shoulder loops. | | | | | |
| | Finished appearance. The finished loops shall be uniform in width and shall finish 5/8 ± 1/8 inches wide. | | | | | |
| | a. Fold the strap for the loops in half lengthwise and seam together 1/4 inch from raw edges. | 301 | SSa-1 | 10-14 | A | A |
| | b. Press the seam open, smooth and flat with a heated pressing iron. | | | | | |
| | c. Turn strap right side out, with seam line placed in center on the underside and press smooth and flat with a heated pressing iron. | | | | | |
| 5 | Make jacket hanger. | | | | | |
| | Finished appearance. The jacket hanger shall finish 1/4 to 3/8 inch wide. | | | | | |
| | a. Fold the 1-1/8 inch wide strip of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges. | 301 | EFp-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 5 | Make jacket hanger. (cont'd) | | | | | |
| | b. Cut the jacket hanger 3-3/4 ± 1/4 inches long. | | | | | |
| 6 | Make collar eyelet covers. | | | | | |
| | Finished appearance. The collar eyelet covers shall finish 1-3/4 ± 1/8 inches wide. | | | | | |
| | a. Turn under the side edges of the collar eyelet covers and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching. | 301 | EFa-1 (each side edge) | 10-14 | A | A |
| | b. Fold each cover in half across the width and seam 1/16 inch from the folded side edges. | 301 | SSa-1 | 10-14 | A | A |
| 7 | Make front eyelet cover. | | | | | |
| | a. Fold front eyelet cover in half lengthwise and stitch across the bottom edge with a 1/4 inch seam. | 301 | SSa-1 | 10-14 | A | A |
| | b. Turn the cover right side out. Press and crease the folded edge smooth and flat with a heated pressing iron. | | | | | |
| 8 | Make underarm shields. | | | | | |
| | Finished appearance. The underarm shields shall finish smooth and flat without puckers, pleats, | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 8 | Make underarm shields. (cont'd)<br><br>gathers or other distortions.<br><br>a. Bind the rounded edge of shield with bias binding, turning under the outside edge of the binding only and catching the turned under portion in the stitching 1/16 inch from the folded edge.<br><br>b. Press the shields smooth and flat with a heated pressing iron or pressing machine. | 301 | BSb-1 | 10-14 | A | A |
| 9 | Make cuffs and eyelet opening.<br><br>Finished appearance. The cuffs shall be uniform in appearance, shall finish smooth and flat, without twists, gathers, pleats, puckers or other distortions. The cuffs shall finish 5 inches high at the point on top sleeve and 3 inches high at the backarm, including piping. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the sleeve cuff.<br><br>a. The cuffs shall be made of one ply of material specified in 3.3.2 piped with material specified in 3.3.4. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 9 | Make cuffs and eyelet opening. (cont'd) | | | | | |
| | b. Position one ply of the cuff eyelet facing on the outside of sleeve cuff, face to face, with back edges even and notches matching. Join the two plies together from notch to notch with a 3/8 inch seam. | 301 | LSq-2 (a) | 10-14 | A | A |
| | c. Extend the depth of the notches to the seam line. Turn back the facing and top stitch the facing to the cuff 1/16 to 1/8 inch from the raised edge. | 301 | LSq-3 (b) | 10-14 | A | A |
| | d. Mark location for 3 eyelets on each cuff for removable buttons. | | | | | |
| | e. Make 1/8 inch eyelet on each of the marks through both plies. | Eyelet | | 22 per eyelet | A | A |
| | f. Position the cuff on the facing with back edges even and notches matching, with the right side faced up. Stitch the ends of the opening through the facing 1/4 inch from back raw edges. | 301 | SSa-1 (each end) | 10-14 | A | A |
| | g. Position the strip of piping material on the outside of sleeve cuff and stitch together 1/8 inch from the upper curved and pointed edge of cuff. | 301 | BSm-1 (a) | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

seams shall be [illegible] joining

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 9 | Make cuffs and eyelet opening. (cont'd) | | | | | |
| | h. Turn back the cuff and piping, working the folded edge of the piping 1/8 inch beyond edge of cuff. Top stitch the cuff to the piping 3/16 inch from folded edge of piping. | 301 | SSa-1 | 10-14 | A (Silk) | A |
| | i. Press the cuffs smooth and flat with a heated pressing iron or pressing machine. | | | | | |
| 10 | Seam sleeves at forearm. | | | | | |
| | Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly. | | | | | |
| | a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of undersleeve and with notches in the lower forearm edge of top and undersleeve matching. Seam top and undersleeve together 3/8 inch from forearm edge of topsleeve, forming a tapered outlet on the undersleeve. | 301 | SSbd-1 to SSa-1 | 10-14 | A | A |
| | b. Spread open the seam and press flat with a heated pressing iron. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 11 | Join cuffs to sleeve.<br><br>Finished appearance. The cuff shall be uniformly stitched to the sleeve without twists, gathers, puckers or raw edges. In the finished jacket (after pressing), the point of the cuff shall be centered between the lower forearm edge and the backarm edge of sleeve.<br><br>a. Mark the sleeves in accordance with the sleeve cuff marker for positioning of the cuffs, with notches on the cuff marker matching the forearm seam line and bottom edge of marker in line with the bottom raw edge of sleeve. | | | | | |
| | b. Position the piped edge of cuff at the mark and stitch cuff to sleeve along the piped edge. The line of stitching shall be adjacent to the stitching of the cuff piped edge. | 301 | LSa-1 | 10-14 | A (Silk) | A |
| | c. Lift the cuff up and stitch the bottom edge of sleeves to the eyelet facing 1/4 to 3/8 inch from the bottom raw edge.<br><br>d. Trim excess facing even with the bottom edge of sleeve. | 301 | SSa-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 12 | Seam sleeves at backarm.<br><br>Finished appearance. The backarm seam shall finish smooth and flat without distortions and shall start and finish evenly.<br>a. Join the top and under sleeves together at the backarm with a 3/8 inch seam, catching the ends of the cuff in the seam and leaving an opening on the cuff between notches.<br><br>b. Spread open the sleeve and cuff seams and press smooth and flat with a heated pressing iron. | 301 | SSa-1 | 10-14 | A (Silk) | A |
| 13 | Baste and tack cuff to sleeve.<br><br>a. Turn the bottom of the cuff to the inside against the bottom edge of sleeve in accordance with notches, and baste along the turned edge of the cuff. | 301 or Hand | | | | |
| | b. Tack the raw edge of cuff to the body of sleeves with blind stitching. The blind stitching shall not be exposed on, or caught to, the outside of the cuff.<br><br>c. On the finished jacket, the height of the cuff, when measured from folded bottom edge of cuff, shall be 3 ± 1/8 inches at the forearm | 301 | EFe-1 (b) | 4-6 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 13 | Baste and tack cuff to sleeve. (cont'd) | | | | | |
| | seams, and 5 ± 1/8 inches at the point. | | | | | |
| 14 | Seam sleeve lining at forearm. | | | | | |
| | Finished appearance. The forearm seam shall finish smooth and flat without puckers, twists, gathers or pleats and shall start and finish evenly. | | | | | |
| | a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the notches in lower forearm edge of top and under sleeve lining matching. Seam the top and under sleeve lining together 3/8 inch from the forearm edge of top sleeve lining, forming a tapered outlet on the under sleeve lining. | 301 | SSbd-1 or SSa-1 | 12-16 | A | A |
| 15 | Seam sleeve lining at backarm. | | | | | |
| | Finished appearance. The backarm shall finish smooth and flat, without twists, gathers, puckers or pleats and shall start and finish evenly. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 15 | Seam sleeve lining at backarm. (cont'd) | | | | | |
| | a. Join the top and under sleeve linings at the backarm with a 3/8 inch seam. | 301 | SSa-1 | 10-14 | A | A |
| 16 | Assemble sleeve and sleeve lining. | | | | | |
| | Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers or pleats. | | | | | |
| | a. Position the sleeve lining on the sleeve with upper edge of the lining extending approximately 1 inch beyond the armhole edge of the sleeve. | | | | | |
| | b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the sleeve, commencing at the top edge of the cuff and extending to approximately 6 inches from the armhole edge at the backarm and approximately 4-1/2 inches from armhole edge at forearm. | 301 or Hand | | 4-6<br>1-2 | A | A |
| | c. Turn sleeve lining over the sleeve. | | | | | |
| 17 | Fell sleeve lining turnup/press sleeves. | | | | | |
| | Finished appearance. The sleeve lining shall not be | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 17 | Fell sleeve lining turnup/press sleeves. (cont'd) | | | | | |
| | short, tight or twisted at bottom of sleeves. | | | | | |
| | a. Turn under the bottom edge of the sleeve lining to finish 1 to 1-1/4 inches above the finished end of sleeve, and baste to turnup of cuff, or the sleeve lining may be felled to bottom sleeve without basting. | 101 or Hand | | | | |
| | b. Fell the folded edge of sleeve lining to the turnup of the cuff with blind stitching. | Hand or 301 | EFc-1 (b) | 8-10<br>6-8 | C (Silk)<br>O (Silk) | <br>O |
| | c. Turn sleeves right side out and assemble in pairs. Insert a sleeve pad in the sleeve to avoid creasing the front and back edges and press smooth and flat with a heated pressing machine. | | | | | |
| 18 | Assemble collar interlining. | | | | | |
| | a. The collar interlining assembly shall consist of one ply of buckram and one ply of twill or plain weave polyester and one ply of plastic. | | | | | |
| | b. Position the plastic strip, polyester and buckram interlinings for the collar with all edges | 301 | SSa-1 (each edge) | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 18 | Assemble collar interlining. (cont'd) | | | | | |
| | even and seam together 1/8 to 3/16 inch from the edges. | | | | | |
| 19 | Pipe outer ply of collar. | | | | | |
| | Finished appearance. The piping shall extend at the lower and side edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers or pleats. | | | | | |
| | a. The outer ply of the collar shall be made of one ply of material specified in 3.3.1, piped with material specified in 3.3.4. | | | | | |
| | b. Seam a 5/8 to 3/4 inch wide strip of piping to outer ply 1/8 inch from sides and lower edge. | 301 | SSaa-1 | 10-14 | A (Silk) | A |
| | c. Turn back the piping and outer ply, uniformly working the folded edge of the piping beyond the edges. Topstitch the outer ply uniformly 3/16 inch from the folded edge of piping. | 301 | SSa-1 | 10-14 | A (Silk) | A |
| 20 | Assemble collar. | | | | | |
| | Finished appearance. The collar shall be assembled without twists, gathers, puckers or pleats. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 20 | Assemble collar. (cont'd) | | | | | |
| | a. Position the interlining assembly on the inside of the outer ply under the unattached edge of piping. Tack all the raw edges of piping to the polyester interlining, making the outer ply form a smooth and snug fit. | Hand | | 2-3 | C (Silk) | |
| | b. Fold the upper raw edge of the outer collar over the interlining and tack to the polyester. | Hand | | 2-3 | C (Silk) | |
| | c. Press the collar smooth and flat with a heated pressing iron or pressing machine. | | | | | |
| | d. Position the collar on the vinyl cord, with the upper edge of the collar abutted against the cord edge. Stitch collar to the vinyl cord 1/16 inch from edge of collar. Trim the ends of the cord even with the ends of the collar. | 301 | LSa-1 | 10-14 | A (Silk) | A |
| | e. Position an eyelet cover on the underside at each end of the collar, with one edge of the cover 3/4 to 7/8 inch from the front end, and the bottom raw edge of the eyelet cover 1/2 to 5/8 inch from the upper cord edge. Stitch collar to cover along the cord edge adjacent to the stitching | 301 | LSa-1 | 10-14 | A (Silk) | A |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 20 | Assemble collar. (cont'd) | | | | | |
| | line of the collar. | | | | | |
| | f. Lap the upper cord edge of collar over the top raw edge of collar lining approximately 1/2 inch with lining face up. Stitch collar to the lining along the cord edge adjacent to the stitching line of the collar. The collar lining shall extend not less than 2-1/2 inches beyond the left end of the collar and 1/2 inch beyond the right end of the collar for the extension tab. | 301 | SSa-1 | 10-14 | A (Silk) | A |
| | g. Turn collar lining and eyelet cover at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine. | | | | | |
| 21 | Make collar extension tab. | | | | | |
| | Finished appearance. The collar extension tab shall extend 3/4 to 1 inch beyond the folded edge of the left end of the collar. | | | | | |
| | a. Turn the top and bottom edges and the end of the collar lining at the left end of the collar to the inside of the lining and baste the turned portion along the top, front and bottom | Hand | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 21 | Make collar extension tab. (cont'd)<br><br>edges to the body of the lining, forming the collar extension tab. | | | | | |
| | b. Stitch the collar extension tab 1/16 inch from the top, front and bottom edges and continue the stitching at the back of tab to top row, forming a 1-3/8 to 1-1/2 inch wide box stitch. | 301 | SSc-1 (top and bottom edges) OSf-1 (front edge) SSa-1 (back edge) | 10-14 | A (Silk) | A |
| | c. Attach metal eyelets on each end of the collar through all plies, midway between the upper and lower edges of the collar and 1-1/2 inch from the finished ends. | | | | | |
| 22 | Assembly body lining.<br><br>Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.<br><br>a. The body lining shall consist of a front, a side back panel, and center back panel. | | | | | |
| | b. Fold the front lining lengthwise with notches matching, and stitch front darts in accordance with | 301 | OSf-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 22 | Assembly body lining. (cont'd) | | | | | |
| | marks as indicated on the patterns. The line of stitching for the waist darts shall be 3/8 inch from the folded edge of the dart at the bottom tapering to a flat point at the top end, and securely backtacked. | | | | | |
| | c. Position the center back edges even with notches matching. Seam together from the upper notches for a distance of approximately 2 inches, and from that point seam horizontally to 3/8 inch from the back edge, and continue seaming to the bottom end of lining. | 301 | SSa-1 | 10-14 | A | A |
| | d. Position the center back to the respective side backs with edges even and notches matching. Join together with a 3/8 inch seam. | 301 | SSa-1 | 10-14 | A | A |
| | e. Position side back and side front face to face with edges even and join together at the side with a 3/4 inch seam. | 301 | SSa-1 | 10-14 | A | A |
| | f. Press the darts and side seams of lining smooth and flat with a heated pressing iron toward the back, and press the left and right side back lining seam toward | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 22 | Assembly body lining. (cont'd)<br><br>the center back.<br><br>g. Press the pleat at center back smooth and flat from top to bottom edge. The folded edge of the pleat on the outside of the lining shall be toward the right side as worn. | | | | | |
| 23 | Attach front eyelet cover to facing.<br><br>a. Position the eyelet cover on the outside of the left front facing, with the top, bottom and front raw edges even. Stitch the cover to the facing 3/16 to 1/4 inch from raw edges. | 301 | SSa-1 | 10-14 | A | A |
| 24 | Seam wool facing to lining assembly.<br><br>Finished appearance. The lining shall be carefully aligned and seamed to the facing so that in the finished jacket, the lining shall lie smooth and flat along the facing without bulges, creases, overlapping of excess material or other defect or distortion.<br><br>a. Position the lining on the wool facing with the top edges even and notches matching. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 24 | Seam wool facing to lining assembly. (cont'd) | | | | | |
| | b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from the top edge of the facing to approximately 1-1/4 inches from the bottom edge of facing. | 301 | SSa-1 | 10-14 | A | A |
| 25 | Sew on identification label. | | | | | |
| | Finished appearance. The identification label shall be positioned so that in the finished jacket, the label shall be midway between front and back edge of the left facing, with the bottom edge of label approximately 4 inches from the bottom finished edge of jacket. | | | | | |
| | a. Sew the identification label to the outside of the left facing with a single row of stitches 1/16 inch from each edge. | 301 | SSa-1 (each edge) | 10-14 | A | A |
| 26 | Assemble fronts. | | | | | |
| | Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 26 | Assemble fronts. (cont'd)<br><br>a. The assembly shall consist of front, side front, side back and center back.<br><br>b. Position the front and side front interlining on the inside of their respective front and side front and fuse (see 3.6.3). | | | | | |
| | c. Fold the side fronts lengthwise with notches matching. Stitch the entire length of the dart 3/8 inch from the lower end and tapering to a point at the upper end. | 301 | SSa-1 | 10-14 | A | A |
| | d. Position the front and side front panel with edges even, and join together with a 3/8 inch seam.<br><br>e. Spread open seams and press smooth and flat with a heated pressing iron.<br><br>f. Press the waist darts flat on the dart seam without turning the dart either to the right or left. | 301 | SSa-1 | 10-14 | A | A |
| 27 | Join backs.<br><br>Finished appearance. The side and center backs shall be joined without gathers, pleats or puckers. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 27 | Join backs. (cont'd) | | | | | |
| | a. Position the center backs with edges even, and join together with a 5/8 inch seam, from the top to the bottom edges. | 301 | SSa-1 | 10-14 | A | A |
| | b. Join the left and right side backs to the respective center backs with a 3/8 inch seam. | 301 | SSa-1 | 10-14 | A | A |
| 28 | Join back and front at sides. | | | | | |
| | a. Position the side back and side fronts face to face with edges even, and join together at the side with a 3/4 inch seam. | 301 | SSa-1 | 10-14 | A | A |
| | b. Spread open side and back seams and press smooth and flat with a heated pressing iron. | | | | | |
| | c. Mark and shape the bottom of front and back in accordance with the pattern shaper. | | | | | |
| 29 | Seam reinforcement stay to shoulder, armhole, gorge and neck. | | | | | |
| | Finished appearance. The reinforcement stays shall be sewn to the armhole and shoulder edge of the front without gathers, pleats or puckers. The top end of the armhole stay and lower end of the shoulder stay shall form a right angle | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 29 | Seam reinforcement stay to shoulder, armhole, gorge and neck. (cont'd) | | | | | |
| | at the armhole without the stays overlapping each other. | | | | | |
| | a. Seam the 3/4 inch wide stays to the underside of the front along the shoulder edges and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from neck and armholes respectively. The strip for the upper edge of the armholes shall be positioned approximately 1/2 inch from the shoulder. The strip for the gorge shall be positioned approximately 1/2 inch from shoulder seams across center back. The strip for the neck shall be positioned 1/2 inch from the shoulder seams to 1/2 inch from front collar notches. | 301 | SSaa-1 | 10-14 | A | A |
| 30 | Mark and dress right front. | | | | | |
| | a. Mark and dress the right front edge of jacket. The mark line shall be 1 inch from the upper front edge to the bottom front edge. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 30 | Mark and dress right front. (cont'd)<br><br>NOTE: The dressing and shaping of the right front shall be performed in the sewing room. | | | | | |
| 31 | Tape armholes.<br><br>a. Sew the cotton tape to the armhole starting with one end approximately 1 inch above the notch in the fronts and continuing along the lower and back edge of the armhole to approximately 1 inch from shoulder edge.<br>b. The tape shall be stitched with slight tension along the lower front edges of the armholes and shall be held taut while stitching along the back edge. | 301 | SSaa-1 | 10-14 | A | A |
| 32 | Press shoulder blades and armhole tapes.<br><br>a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or suitable type pressing machine. | | | | | |
| 33 | Stitch piping to jacket.<br><br>Finished appearance. The piping shall be uniformly stitched to the jacket without twists, puckers or pleats. The piping shall extend from the collar | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 33 | Stitch piping to jacket. (cont'd)<br><br>notch at top edge of the right front to the collar notch at top edge of the left front. | | | | | |
| | a. Position the 1-1/4 inch wide strip of piping material on the outside of left and right front, with one edge even with top, front and bottom edges of jacket. Stitch piping to jacket 1/8 inch from edge. The piping shall extend from the collar notch at the top, along the left and right front and the bottom edge of the jacket. | 301 | SSa-1 | 10-14 | A | A |
| | b. Turn the piping to the inside, working out the folded edge of piping 1/8 inch beyond edges of jacket. Topstitch jacket to the piping 3/16 inch from the folded edge of piping, catching the turned under portion of the piping in the stitching. | 301 | SSe-2 (b) | 10-14 | A (Silk) | A |
| | c. Notch out the excess piping material at the top and bottom front corners to eliminate bulkiness. Trim the inner edge of piping on the right front only from the upper front down to approximately 1 to 1-1/2 inches from bottom edge of front, so that the piping will not interfere | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 33 | Stitch piping to jacket. (cont'd)<br><br>with front buttonholes.<br><br>d. Press fronts and bottom edges, smooth and flat, with a heated pressing machine. | | | | | |
| 34 | Mark fronts for positioning the braid and buttonholes (see Figure 3).<br><br>a. Mark the location of 5 buttonholes on the outside of the right front. The top buttonhole (line A) shall be positioned 1 inch below the upper piped edge and 5/8 inch from the front piped edge. The lower buttonhole (line B) shall be 2-1/4 ± 1/8 inches from bottom piped edge and 5/8 inch from the front piped edge. The remaining three buttonhole marks shall be evenly spaced.<br><br>b. Extend each buttonhole line towards the back and armhole edge. (Line B shall be 1 inch shorter than line A.) The length of the top and bottom line is determined by the position of the harp on the first line, top, which shall be approximately 1-7/8 inches from the armhole edge to the center of the harp. The top line | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 34 | Mark fronts for positioning the braid and buttonholes (see Figure 3). (cont'd)<br><br>shall be measured from the front edge of the buttonhole line to the center of the harp. Transfer this measurement to the bottom line and reduce length by 1 inch. Draw a straight line from the bottom line mark through the center of the harp up to the top line, establishing line C-D as shown on Figure 3.<br><br>c. Bisect the top line A-C and bottom line B-D and connect the bisecting points with a straight line E-F.<br><br>d. Position the right front of jacket on left front, face to face with the collar notches even and the right front edge 1 inch back of the left front edge from the collar notch to the bottom and armhole and bottom edges even.<br><br>e. Trace the five lines on the left front to coincide with the lines on the right front; the lines on the left front shall extend approximately 2 to 2-1/4 inches from the front piped edge. The vertical lines on the left | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 34 | Mark fronts for positioning the braid and buttonholes (see Figure 3). (cont'd)<br><br>front shall be identical to lines C-D-E-F on the right front.<br><br>f. Draw a circle 7/8 ± 1/32 inch in diameter on each side of the five horizontal lines, centered to bisect line E-F and with the edge of each circle touching the horizontal line forming a figure 8 design as shown on Figure 3.<br><br>g. Position the center of the harp pattern at the line C-D, with the upper edge of the pattern positioned at the bottom side of each horizontal line. Mark the harp in accordance with the pattern marker. The bottom edge of the harp must be not less than 1/2 inch from the line beneath. | | | | | |
| 35 | Baste braid (see Figure 4).<br><br>a. Baste braid by hand along each side of the horizontal line and around the circle figure 8 design and around the harp. The braid shall begin and end at the harp with both ends of the braid secured and | Hand | | 6-8 | C (Silk) | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 35 | Baste braid (see Figure 4). (cont'd)<br><br>tacked under the horizontal braid. On the right front, the braid shall be basted around the buttonhole line with the outer edge of the braid 1/4 to 3/8 inch from the piped front edge. (On the left front, the outside edge of braid shall stop 1/4 inch from left eyelet marks.) | | | | | |
| | b. Begin with cut end of braid even with straight line at top of harp. Baste the braid along its forward edge down the center of harp to the forward edge of harp center. Continue up the backarm along the back edge of harp to the straight line at top using the same edge of the braid. | Hand | | 2-6 | C (Silk) (Black) | |
| | c. Baste the bottom edge of braid along the straight line to the circle, follow circle back to straight line and continue to end of straight line. | Hand | | 2-6 | C (Silk) (Black) | |
| | d. Repeat steps a, b and c on each marking on fronts. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 36 | Tack braid. | | | | | |
| | a. Securely tack all unattached edges of braid to provide a smooth secure and flat surface of stitching. | Hand | | 2-6 | C (Silk) (Black) | |
| | b. Tack inside edges of braid circles to jacket, forming an inner hole approximately 1/8 inch in diameter. | Hand | | 2-6 | C (Silk) (Black) | |
| | c. Tack loops at button edge of jacket to finish secure and flat. | Hand | | 2-6 | C (Silk) (Black) | |
| 37 | Stitch braid (see Figure 4). | | | | | |
| | Finished appearance. All stitching shall be done 1/16 inch from all edges whenever possible. All stitching shall be uniform. All stitching shall be performed with one continuous thread whenever possible. Stitching across braid strands shall be done only as described or when absolutely necessary. All edges of the braid shall be securely attached to the jacket at all points. The braid and the stitching shall present a smooth, neat, uniform appearance. The braid on the right front only shall be stitched for approximately 3 inches from front end of | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 37 | Stitch braid (see Figure 4). (cont'd) | | | | | |
| | buttonhole loop braid. | | | | | |
| | a. Stitch braid through fronts and interlining on both sides of the braid 1/16 inch from edges. The line of stitching shall start and finish at the harp as shown on Figure 4. | 301 | SSav-2 | 10-14 | A (Silk) | A |
| | b. Braid may be stitched without basting, provided the requirements previously mentioned are maintained. | 301 | SSav-2 | 10-14 | A (Silk) | A |
| | c. Hand stitch the inner edges of horizontal braid together on both fronts from harp ends to end of buttonhole opening on right front end of braid on left front. | Hand | | 8-10 | C (Silk) | |
| 38 | Interline fronts. | | | | | |
| | a. Position the left and right fronts on the respective jacket front interlining and baste the front to the interlining from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom edge of the front. | 301 or Hand | Hopper | | | |
| | b. Baste along the shoulder, allowing room for setting the shoulder pad and working fullness | 301 or Hand | Hopper | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 38 | Interline fronts. (cont'd)<br><br>toward the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of the interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulders to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of fronts. | | | | | |
| 39 | Trim jacket front interlining.<br><br>a. Trim the top edge of jacket interlining even with the top edge of fronts from the point of shoulder to the collar notch.<br><br>b. Notch the top edge of the interlining in line with the collar notch.<br><br>c. Remove stitches joining front edge of polyester and cotton to jacket front interlining, approximately 1/2 inch back from front and top edge of fronts. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 2026l0-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 39 | Trim jacket front interlining. (cont'd)<br><br>d. Turn the jacket inside out and trim the interlining only, approximately 1/4 inch back from the front and top edge of fronts.<br><br>e. Trim the shoulder edge of the jacket front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck. | | | | | |
| 40 | Bind front edge and gorge of interlining.<br><br>Fold polyester and cotton back over the top and front raw edge of the interlining. Stitch along the top and front edge with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the turned-under portion in the stitching. | 301 | EFa-3 | 8-10 | A | A |
| 41 | Bind top neck edge of interlining.<br><br>Finished appearance. The polyester and cotton binding shall be uniformly stitched along the gorge of the jacket front interlining from the collar notch to the | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 41 | Bind top neck edge of interlining. (cont'd) | | | | | |
| | shoulder point. | | | | | |
| | a. Lap the 3/4 inch wide strip of binding on the outside of the jacket front interlining from the collar notch to shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding. | 301 | LSa-1 | 8-10 | A | A |
| | b. Smoothly fold the free edge the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding. | 301 | SSa-1 | 10-14 | A | A |
| 42 | Fell piping to jacket front interlining. | | | | | |
| | a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts. | 101 | | | | |
| | b. Fell the front and lower edge of the piping to the jacket front interlining. | 301 or Hand | EFc-1 | 4-6<br>4-6 | A<br>C (Silk) | A |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 42 | Fell piping to jacket front interlining. (cont'd) | | | | | |
| | c. Tack the raw edge of the bottom piping to each seam allowance of jacket. | Hand | | 4-6 | C | |
| | d. Pull and remove basting stitches from piping. | | | | | |
| 43 | Join facing to fronts. | | | | | |
| | a. Position the left and right fronts to the respective front facing (face to face), with the notch of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark the facing along the top, front and bottom edges of jacket. | | | | | |
| | b. Lap the front edge of the right and left fronts, respectively, on the outside of the facing at the marks and join the fronts to facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to bottom edge of jacket front edge only and the eyelet cover shall be caught in the stitching. | 301 | LSa-1 | 10-14 | A | A |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 43 | Join facing to fronts. (cont'd) | | | | | |
| | c. Trim excess facing material where necessary. | | | | | |
| 44 | Baste front edges. | | | | | |
| | a. Turn the facing-lining assemblies to the inside of fronts, completely working out the edges. | | | | | |
| | b. Baste along the front edge of left and right fronts, working the facing and eyelet cover back from the folded edge of piping. | 101 or Hand | | | | |
| 45 | Baste facing (second time). | | | | | |
| | a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the jacket, holding the lower corner of the jacket in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing. | Hand or 301 | Hopper | | | |
| | b. Turn under and baste the top edge of the facing even with the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting. | Hand or 301 | Hopper | | | |
| | c. Baste the facing to the fronts as close as possible to the facing- | Hand or 301 | Hopper | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 45 | Baste facing (second time). (cont'd) | | | | | |
| | lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of facings to approximately 1-1/4 inches from the lower edge of facing. | | | | | |
| | d. Turn under the bottom edge of facing at the mark and baste along the folded edge. | Hand or 301 | Hopper | | | |
| 46 | Tack facing to interlining. | | | | | |
| | a. Tack the right and left facing-lining seam allowance to the respective jacket front interlining from approximately 2 inches from bottom edge of jacket to approximately 3 inches from the shoulder edge. | Hand or 301 | SSm-1 | 4-6<br>4-6 | | |
| 47 | Baste linings to jacket. | | | | | |
| | a. Fold the front lining in accordance with the notches forming the chest pleat, and baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole. | Hand or 301 | Hopper | | | |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 47 | Baste linings to jacket. (cont'd) | | | | | |
| | b. Baste the front lining to the jacket, starting at the lower end of the chest pleat, continuing along lower edge of armhole approximately 2 inches from the edge and ending at the side seam. Match side seams of jacket and lining and continue basting as close as possible to the side seam and then across the bottom towards the front approximately 3 inches from piped bottom edge of jacket. | Hand or 301 | Hopper | | | |
| 48 | Baste back lining to jacket. | | | | | |
| | a. Fold the back lining, forming approximately a 1 inch wide pleat at the center back. Baste the back lining to the jacket along the center pleat from the top approximately 3 inches from the bottom finished edge of jacket. | Hand or 301 | Hopper | | | |
| | b. Baste back lining to jacket starting at side seam and continuing approximately 3 inches from the armhole and shoulder edges, allowing room for shoulder pads. | Hand or 301 | Hopper | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 48 | Baste back lining to jacket. (cont'd) | | | | | |
| | c. Turn under the bottom edges of front and back lining, and baste along the bottom edge of jacket, with the folded edge of lining positioned approximately 1/2 inch from the bottom piped edge of jacket. | Hand or 301 | Hopper | | | |
| 49 | Fell lining to bottom piping. | | | | | |
| | a. Fell the turned-under portion of lining along the bottom piping of the jacket with blind stitching 1/4 to 3/8 inch from the bottom folded edge of lining. Only the under ply of the folded edge of lining shall be caught in the stitching. | 301 or Hand | EFc-1 (b) | 6-8<br>6-8 | O (Silk)<br>C (Silk) | O |
| 50 | Trim lining and interlining. | | | | | |
| | a. Trim the excess jacket front interlining and front lining at the armhole. | | | | | |
| | b. Trim the back lining even with the neck. | | | | | |
| | c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck. | | | | | |



Source: https://assist.dla.mil -- Downloaded: 20261O-20T22:53Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 51 | Press fronts.<br><br>a. Press each front smooth and flat on a suitable type heated pressing machine to conform to the shape of the body and eliminate excess fullness in the breast. | | | | | |
| 52 | Make buttonholes.<br><br>Finished appearance. The buttonholes shall be clean cut, well made, well worked over gimp to fit 40-line insignia buttons. The gimp and thread shall be pulled through to the outside of the front. The purling of the buttonholes shall be on the facing side. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of jacket. The buttonholes shall be cut first type.<br><br>a. Remove the basting on the unstitched portion of the braid. | | | | | |
| | b. Make a horizontal eyelet-end square-bar type buttonhole cut 1-1/4 inches long at each of the marks. | Button-hole | | 60 stitches per button-hole | B (Silk) | F |
| | c. Securely bartack the end of each buttonhole, catching the ends of the | Bartack | | 21 per bartack | A (Silk) | A |



Source: https://assist.dla.mil -- Downloaded: 20260-20T22:53Z
Check the source to verify that this is the current version before use.