MILITARY SPECIFICATION

# SIGNAL, ILLUMINATION
# RED STAR, DISTRESS, PARACHUTE, M131
# PARTS AND LOADING, ASSEMBLING AND PACKING

This specification is approved for use by the U.S. Army Armaments Research and Development Center, and is available for use by all Departments and Agencies of the Department of Defense.

## 1. SCOPE

1.1 This specification contains requirements not covered by the drawings and provides quality assurance provisions for the fabrication of parts, assembly and packing for one type of distress signal designated as Signal, Illumination, Red Star, Distress, Parachute, M131.

## 2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. Unless otherwise specified (see 6.2), the following specifications and standards of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification For

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes

FSC 1370

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Center, Attn DRSMC-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

MIL-STD-1234 - Pyrotechnics: Sampling Inspection and Testing

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publication form a part of this specification to the extent specified herein.

DRAWINGS

U.S. ARMY ARMAMENT RESEARCH AND DEVELOPMENT CENTER (ARDC)

8837837 - Box, Packing, Ammunition for Signal, Distress Red Star, Parachute, M131
8837838 - Container, Ammunition, Metal M291, for Signal Distress, Red Star, Parachute, M131
8838071 - Signal, Illumination, Red Star, Distress, parachute, M131 Assembly

(Copies of specifications, standards, handbooks, drawings and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer.)

2.1.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

3. REQUIREMENTS

3.1 Material. Materials and parts shall be in accordance with applicable specifications and drawings.

3.2 Assembly. The assembly shall comply with all requirements specified on Drawing (dwg.) 8838071 and with all requirements specified in applicable specifications.

3.3 Spring embrittlement. The spring shall not break when extended to the point of minimum (min.) permanent distortion.

3.4 Moisture content. The moisture content of the first fire composition at the loading station, at the time of loading with signal assemblies, shall not exceed 0.10 percent, when determined as specified in 4.5.2.



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

3.5 Waterproofness. The packed sealed containers shall show no evidence of leakage after immersion for 15 seconds min.

3.6 Functioning. The signal assemblies shall function when tested as specified in 4.5.8 and shall comply with the following requirements.

3.6.1 Premature burst. The signal assembly shall not burst in or within 100 feet of the launcher. The illuminant assembly shall not eject within 100 feet of the launcher. Any signal in which the illuminant assembly is ejected upon ground impact due to fuze failure after normal flight, will not be considered a critical defect.

3.6.2 Ambient temperature. (70 ± 5°F).

3.6.2.1 Altitude and vertical angle. No assembly shall emit the first trace of red light at an altitude of less than 1350 feet, or be ejected at an angle of more than 30 degrees from the vertical. The altitude of the signal at the end of 27 seconds of burning time shall be not less than 900 feet. The average angle from the vertical for all signals which function within the maximum (max.) angle from the vertical (30 degrees) shall be not more than 15 degrees.

3.6.2.2 Burning time. The illuminant assembly in flight shall burn not less than 27 seconds.

3.6.3 Cold temperature. (minus 65 ± 5°F).

3.6.3.1 Altitude and vertical angle. No assembly shall emit the first trace of red light at less than 1100 foot altitude or be ejected at an angle of more than 70 degrees from the vertical. The average angle for all signals which function within the max. angle from the vertical (70 degrees) shall be not more than 25 degrees.

3.6.3.2 Burning time. The illuminant assembly in flight shall burn not less than 27 seconds.

3.7 First article inspection. This specification makes provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.



Source: https://assist.dla.mil -- Downloaded: 202610-17T23:15Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. All parts and assemblies shall be fabricated and loaded in a thorough workmanlike manner. They shall be free of burrs, sharp edges, cracks, dirt, rust and other foreign matter. The cleaning method used shall not be injurious to any part nor shall the parts be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined.

4. QUALITY ASSURANCE PROVISIONS

4.1 Reponsibility for inspection and standard quality assurance provisions. Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspections. The following types of inspection shall be conducted on this item:

a. First Article Inspection

b. Quality Conformance Inspection

4.3 First article inspection.

4.3.1 Submission. The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2. The first article sample shall consist of the items in sample quantities as indicated in Table I.

4.3.2 Inspections to be performed. See MIL-A-48078 and Table I specified herein.

4.3.3 Rejection. See MIL-A-48078.



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS** MIL-S-12730E(AR)

| PARAGRAPH | TITLE: Signal, Illumination Red Star, Distress, Parachute, M131 Parts for Loading, Assembling and Packing | | SHEET 1 OF 7 | | DRAWING NUMBER: See below<br>NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| | Arm, Striker<br>(Dwg. 8838028)<br>Examination for defects | 15 | | 3.2 | 4.4.2.1 |
| | Point Striker<br>(Dwg. 8838027)<br>Examination for defects | 15 | | 3.2 | 4.4.2.2 |
| | Striker Assembly<br>(Dwg. 8838029)<br>Examination for defects | 15 | | 3.2 | 4.4.2.3 |
| | Spacer<br>(Dwg. 8838026)<br>Examination for defects | 15 | | 3.2 | 4.4.2.4 |
| | Pin, Latch<br>(Dwg. 8838023)<br>Examination for defects | 15 | | 3.2 | 4.4.2.5 |
| | Pin, Striker<br>(Dwg. 8838025)<br>Examination for defects | 15 | | 3.2 | 4.4.2.6 |
| | Housing<br>(Dwg. 8838002)<br>Examination for defects | 15 | | 3.2 | 4.4.2.7 |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS** MIL-S-12730E(AR)

| PARAGRAPH | TITLE: Signal, Illumination Red Star, Distress, Parachute, M131 Parts for Loading, Assembling and Packing | | SHEET 2 OF 7 | | DRAWING NUMBER: See below<br>NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Latch Safety<br>(Dwg. 8838004)<br>Examination for defects | 15 | | 3.2 | 4.4.2.8 |
| | Spring<br>(Dwg. 8838024)<br>Examination for defects | 15 | | 3.2 | 4.4.2.9 |
| | Spring embrittlement | 15 | | 3.3 | 4.5.1 |
| | Throat<br>(Dwg. 8838042)<br>Examination for defects | 10 | | 3.2 | 4.4.2.10 |
| | Cup, Spacer<br>(Dwg. 8838043)<br>Examination for defects | 10 | | 3.2 | 4.4.2.11 |
| | Cover Assembly<br>(Dwg. 8838061)<br>Examination for defects | 15 | | 3.2 | 4.4.2.12 |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-01-17T23:15Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS** MIL-S-12730E(AR)

| PARAGRAPH | TITLE: Signal, Illumination Red Star, Distress, Parachute, M131 Parts for Loading, Assembling and Packing | | SHEET 3 OF 7 | | DRAWING NUMBER: See below<br>NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Case Assembly (Dwg. 8838064)<br>Examination for defects | 15 | | 3.2 | 4.4.2.13 |
| | Tube Launcher (Dwg. 8838032)<br>Examination for defects | 15 | | 3.2 | 4.4.2.14 |
| | Housing Delay (Dwg. 8838038)<br>Examination for defects | 15 | | 3.2 | 4.4.2.15 |
| | Tube (Dwg. 8838036)<br>Examination for defects | 10 | | 3.2 | 4.4.2.16 |
| | Housing, Exhaust (Dwg. 8838040)<br>Examination for defects | 15 | | 3.2 | 4.4.2.17 |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| | Signal, Illumination Red Star, Distress, Parachute, M131 Parts for Loading, Assembling and Packing | 4 OF 7 | See below |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
|---|---|---|---|---|---|
| | Igniter Assembly (Dwg. 8838030) Examination for defects | | | 3.2 | 4.4.2.18 |
| | Pin Rotating (Dwg. 8838041) Examination for defects | | | 3.2 | 4.4.2.19 |
| | Wad Setback (Dwg. 8838034) Examination for defects | 10 | | 3.2 | 4.4.2.20 |
| | Delay Assembly (Dwg. 8838037) Examination for defects | 10 | | 3.2 | 4.4.2.21 |
| | Motor Assembly (Prior to Loading "A" Rocket Charge) (Dwg. 8838035) Examination for defects | 5 | | 3.2 | 4.4.2.22 |

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection

**CLASSIFICATION OF DEFECTS & TESTS** MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 5 of 7 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| | Signal, Illumination Red Star, Distress, Parachute, M131 Parts for Loading, Assembling and Packing | | | | See below |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE INSPECTION METHOD |
| | Motor Assembly (Prior to Assembling Cup Spacer) (Dwg. 8838035) | | | | |
| | Examination for defects | 5 | | 3.2 | 4.4.2.23 |
| | Motor Assembly (Dwg. 8838035) | | | | |
| | Examination for defects | 10 | | 3.2 | 4.4.2.24 |
| | Illuminant Loading Assembly (Dwg. 8838055) | | | | |
| | Examination for defects | 25 | | 3.2 | 4.4.2.25 |
| | Candlepower and color value | 25 | | 3.2 | 4.5.6 |
| | Illuminant Assembly (Dwg. 8838046) | | | | |
| | Examination for defects | 10 | | 3.2 | 4.4.2.26 |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET | DRAWING NUMBER |
|---|---|---|---|---|
| | Signal, Illumination Red Star, Distress, Parachute, M131 Parts for Loading, Assembling and Packing | | 6 of 7 | See below |
| | | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE INSPECTION METHOD |
|---|---|---|---|---|---|
| | Rocket Assembly (Prior to Assembling Illuminant (Dwg. 8838044) | | | | |
| | Examination for defects | 15 | | 3.2 | 4.4.2.27 |
| | Launcher Assembly (Dwg. 8838031) | | | | |
| | Examination for defects | 15 | | 3.2 | 4.4.2.28 |
| | Moisture content (Note 1) | 15 | | 3.2 | 4.5.2 |
| | Assembly (Prior to Assembling Closing Covers) (Dwg. 8838071) | | | | |
| | Examination for defects | 25 | | 3.2 | 4.4.2.29 |
| | Moisture content | 25 | | 3.4 | 4.5.2 |

NOTES:

1. Moisture content of Wad, Setback, P/N 8838034, to be determined at loading, prior to assembly.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil/ Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730F(AR)

| PARAGRAPH | TITLE: Signal, Illumination Red Star, Distress, Parachute, M131 Parts for Loading, Assembling and Packing | | SHEET 7 OF 7 | | DRAWING NUMBER: See below<br>NEXT HIGHER ASSEMBLY |
|---|---|---|---|---|---|
| CATEGORY | EXAMINATION OR TEST | NO OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| | Sealed Container (Dwg. 8837838) | | | | |
| | Examination for defects | 24 | | 3.2 | 4.4.2.30 |
| | Waterproofness | 24 | | 3.5 | 4.5.4 |
| | Remove from container for: Functioning test | | | | |
| | Cold -65 ± 5°F | 12 | | 3.6.3 | 4.4.3.5 |
| | Ambient 70 ± 5°F | 12 | | 3.6.2 | 4.4.3.5 |
| | Sealed Wood Packing Box (Dwg. 8837837) | | | | |
| | Examination for defects | 25 | | 3.2 | 4.4.2.31 |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20240-17T23:15Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. Inspection lots shall comply wit the lot formation provisions of MIL-A-48078. In addition, inspection lots of Signal Assemblies shall contain:

a. Parts of one interfix lot number from one manufacturer.

b. Primers of one interfix lot number from one manufacturer.

c. Black powder from not more than one lot from one manufacturer.

4.4.2 Examination. See MIL-A-48078.

a. Sampling plans. Unless otherwise specified in the Classification of Defects and Test tables, sampling plans procedures for major and minor defects shall be in accordance with MIL-STD-105.



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.1 | Arm, striker | 1 OF 1 | 8838028 |
| | | | NEXT HIGHER ASSEMBLY: 8838071 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Location of striker point hole | | 0.40% | 3.2 | Gage |
| 102 | Location of pivot hole | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Diameter of pivot hole, maximum (max) | | 0.65% | 3.2 | Gage |
| 202 | Crack | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.2 | Point, Striker | | | | 8838027 |
| | | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Profile of point | | 0.40% | 3.2 | Gage |
| 102 | Outside diameter, max. | | 0.40% | 3.2 | Gage |
| 103 | Length from point to striker arm seat | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-01-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.3 | Striker Assembly | | | | 8838029 |
| | | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Length from pivot hole to point | | 0.40% | 3.2 | Gage |
| 102 | Striker point loose or damaged | | 0.40% | 3.2 | Manual |
| Minor | | | | | |
| 201 | Protective coating damaged exposing base metal | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:





Source: https://assist.dla.mil Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.4 | Spacer | | | | 8838026 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Length, min | | 0.65% | 3.2 | Gage |
| 202 | Protective coating damaged exposing base metal | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil 1-6 Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.5 | Pin, Latch | | | | 8838023 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8828071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Total length, min | | 0.65% | 3.2 | Gage |
| 202 | Small diameter, min | | 0.65% | 3.2 | Gage |
| 203 | Large diameter, min | | 0.65% | 3.2 | Gage |
| 204 | Length from shoulder to shoulder, min | | 0.65% | 3.2 | Gage |
| 205 | Protective coating damaged exposing base metal | | 0.65% | 3.2 | Visual |
| 206 | Finish improper | | 0.65% | 3.2 | Visual |
| 207 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.6 | Pin, Striker | | | | 8838025 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Total length, min | | 0.65% | 3.2 | Gage |
| 202 | Diameter, min | | 0.65% | 3.2 | Gage |
| 203 | Protective coating damaged exposing base metal | | 0.65% | 3.2 | Visual |
| 204 | Finish improper | | 0.65% | 3.2 | Visual |
| 205 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil - Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.7 | Housing | | | | 8838002 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Diameter of primer cavity, max | | 0.40% | 3.2 | Gage |
| 102 | Depth of primer cavity, max | | 0.40% | 3.2 | Gage |
| 103 | Location of primer cavity | | 0.40% | 3.2 | Gage |
| 104 | Pitch diameter of thread, min | | 0.40% | 3.2 | Gage |
| 105 | Major diameter of thread, min | | 0.40% | 3.2 | Gage |
| 106 | Flash hole obstructed | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Depth of primer cavity, min | | 0.65% | 3.2 | Gage |
| 202 | Width between latch pin and striker in supports, max | | 0.65% | 3.2 | Gage |
| 203 | Diameter of latch pin hole, max | | 0.65% | 3.2 | Gage |
| 204 | Diameter of striker pin hole, max | | 0.65% | 3.2 | Gage |
| 205 | Location of latch pin hole | | 0.65% | 3.2 | Gage |
| 206 | Location of striker pin hole | | 0.65% | 3.2 | Gage |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-01-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 2 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.7 | Housing | | | | 8838002 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| 207 | Total length | | 0.65% | 3.2 | Gage |
| 208 | Thickness of supports, min | | 0.65% | 3.2 | Gage |
| 209 | Height of supports | | 0.65% | 3.2 | Gage |
| 210 | Profile of propelling charge cavity, min. | | 0.65% | 3.2 | Gage |
| 211 | Depth of propelling charge cavity, min. | | 0.65% | 3.2 | Gage |
| 212 | Length from threaded end to flange, min. | | 0.65% | 3.2 | Gage |
| 213 | Large outside diameter, min. | | 0.65% | 3.2 | Gage |
| 214 | Evidence of poor workmanship | | 1.0% | 3.2 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil - Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.8 | Latch, Safety | | | | 8838004 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Length from pivot surface to striker assembly end | | 0.40% | 3.2 | Gage |
| 102 | Length from pivot surface to top inside, min | | 0.40% | 3.2 | Gage |
| 103 | Length of striker point bearing surface | | 0.40% | 3.2 | Gage |
| 104 | Crack | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Length betweens striker point bearing surface and top inside | | 0.65% | 3.2 | Gage |
| 202 | Width between pivot surfaces, max | | 0.65% | 3.2 | Gage |
| 203 | Profile of pivot "dog legs" | | 0.65% | 3.2 | GAge |
| 204 | Width of striker point bearing surface | | 0.65% | 3.2 | Gage |
| 205 | Protective finish damaged exposing base metal | | 0.65% | 3.2 | Visual |
| 206 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.9 | Spring | | | | 8838024 |
| | | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Spring embrittlement | 20 | 0-1 | 3.3 | 4.4.1 |
| 102 | Torque test | 50 | 0-1 | 3.2 | 4.5.7 |
| Minor | | | | | |
| 201 | Compressed length | | 0.65% | 3.2 | Gage |
| 202 | Outside diameter | | 0.65% | 3.2 | Gage |
| 203 | Protective coating damaged exposing base metal | | 0.65% | 3.2 | Visual |
| 204 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 8838042 |
|---|---|---|---|---|---|
| 4.4.2.10 | Throat | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Inside diameter, max | | 0.65% | 3.2 | Gage |
| 202 | Outside diameter, min | | 0.65% | 3.2 | Gage |
| 203 | Total length, min | | 0.65% | 3.2 | Gage |
| 204 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.11 | Cup, Spacer | 1 OF 1 | 8838043 |
| | | | NEXT HIGHER ASSEMBLY: 8838071 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Width, min | | 0.65% | 3.2 | Gage |
| 202 | Outside diameter, min | | 0.65% | 3.2 | Gage |
| 203 | Wall thickness | | 0.65% | 3.2 | Gage |
| 204 | Hole diameter, max | | 0.65% | 3.2 | Gage |
| 205 | Finish improper or incomplete | | 0.65% | 3.2 | Visual |
| 206 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil - Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.12 | Cover Assembly | | | | 8838061 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Cover cut by crimp | | 0.40% | 3.2 | Visual/Manual |
| 102 | Crimp incomplete | | 0.40% | 3.2 | Visual |
| 103 | Adhesive missing or improperly applied | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Total length, max. | | 0.65% | 3.2 | Gage |
| 202 | Outside diameter, max. | | 0.65% | 3.2 | Gage |
| 203 | Length to disc, max. | | 0.65% | 3.2 | Gage |
| 204 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 8838064 |
|---|---|---|---|---|---|
| 4.4.2.13 | Case Assembly | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Cap insecure | | 0.65% | 3.2 | Manual |
| 202 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.14 | Tube, Launcher | | | | 8838032 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Distance across grooves | | 0.40% | 3.2 | Gage |
| 102 | Width of grooves | | 0.40% | 3.2 | Gage |
| 103 | Location of grooves | | 0.40% | 3.2 | Gage |
| 104 | Pitch diameter of thread, max | | 0.40% | 3.2 | Gage |
| 105 | Minor diameter of thread, max | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Total length, min | | 0.65% | 3.2 | Gage |
| 202 | Length of thread, min | | 0.65% | 3.2 | Gage |
| 203 | Inside diameter, min | | 0.65% | 3.2 | Gage |
| 204 | Outside diameter, min | | 0.65% | 3.2 | Visual |
| 205 | Knurl missing | | 0.65% | 3.2 | Visual |
| 206 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.15 | Housing, Delay | | | | 8838038 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Depth of expelling charge cavity, max | | 0.40% | 3.2 | Gage |
| 102 | Location of delay and booster charge cavity | | 0.40% | 3.2 | Gage |
| 103 | Diameter of delay and booster charge cavity, max | | 0.40% | 3.2 | Gage |
| 104 | Thickness, min | | 0.40% | 3.2 | Gage |
| 105 | Depth of delay and booster charge cavity | | 0.40% | 3.2 | Gage |
| 106 | Flash hole missing or obstructed | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Diameter of expelling charge cavity, min | | 0.65% | 3.2 | Gage |
| 202 | Depth of crimping groove, min | | 0.65% | 3.2 | Gage |
| 203 | Location of expelling charge flash hole | | 0.65% | 3.2 | Gage |
| 204 | Location of delay and booster cavity flash hole | | 0.65% | 3.2 | Gage |
| 205 | Outside diameter | | 0.65% | 3.2 | Gage |
| 206 | Evidence of poor workmanship | | 1.0 | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 8838036 |
|---|---|---|---|---|---|
| 4.4.2.16 | Tube | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Wall thickness, min | | 0.65% | 3.2 | Gage |
| 202 | Inside diameter, max | | 0.65% | 3.2 | Gage |
| 203 | Total length, min | | 0.65% | 3.2 | Gage |
| 204 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-01-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.17 | Housing, Exhaust | | | | 8838040 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | | | | | |
| 1. | Hole missing | | 100% | 3.2 | Visual |
| Major | | | | | |
| 101 | Angle of holes | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Outside diameter, min | | 0.65% | 3.2 | Gage |
| 202 | Thickness, min | | 0.65% | 3.2 | Gage |
| 203 | Location of holes | | 0.65% | 3.2 | Gage |
| 204 | Diameter of holes | | 0.65% | 3.2 | Gage |
| 205 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.18 | Igniter Assembly | | | | 8838030 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Any component missing or improperly assembled | | 0.40% | 3.2 | Visual/Manual |
| Minor | | | | | |
| 201 | Thread damaged | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.19 | Pin, Rotating | | 8838041 |
| | | | NEXT HIGHER ASSEMBLY 8838071 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Diameter, min | | 0.40% | 3.2 | Gage |
| 102 | Length, min | | 0.40% | 3.2 | Gage |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 8838034 |
|---|---|---|---|---|---|
| 4.4.2.20 | Wad, Setback | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Location of holes | | 0.40% | 3.2 | Gage |
| 102 | Incorrect number of holes | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 8838037 |
|---|---|---|---|---|---|
| 4.4.2.21 | Delay Assembly | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Delay or booster charge missing | | 0.40% | 3.2 | Visual |
| 102 | Plug missing | | 0.40% | 3.2 | Visual |
| 103 | Fire clay visible through ignition hole | | 0.40% | 3.2 | Visual |
| 104 | Drilled holes missing | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.22 | Motor Assembly, (Prior to Loading "A" Rocket Charge) | 1 | 1 | 8838035 |
| | | | | NEXT HIGHER ASSEMBLY 8838071 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Distance to delay assembly | | 0.40% | 3.2 | Gage |
| 102 | Delay assembly not crimped 360 degrees | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.23 | Motor Assembly, (Prior to Assembling Cup Spacer) | 1 | 1 | 8838035 |
| | | | | NEXT HIGHER ASSEMBLY: 8838071 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Any component missing | | 0.40% | 3.2 | Visual |
| 102 | Quickmatch missing | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 8838035 |
|---|---|---|---|---|---|
| 4.4.2.24 | Motor Assembly | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Length over pins, min | | 0.40% | 3.2 | Gage |
| 102 | Length to pins | | 0.40% | 3.2 | Gage |
| 103 | Location of pins | | 0.40% | 3.2 | Gage |
| 104 | Length of crimped end, min | | 0.40% | 3.2 | Gage |
| 105 | Any component missing | | 0.40% | 3.2 | Visual |
| 106 | Crimped end protrudes over exhaust holes | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.25 | Illuminant Loading Assembly | | | | 8838055 |
| | | | | | NEXT HIGHER ASSEMBLY 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Total length, max | | 0.40% | 3.2 | Gage |
| 102 | Any component missing, damaged or insecure | | 0.40% | 3.2 | Visual/Manual |
| 103 | Candlepower and color value | | 0.40% | 3.2 | 4.5.6 |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-01-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.26 | Illuminant Assembly | | | | 8838046 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Relay charge missing or loose | | 0.40% | 3.2 | Visual/Manual |
| 102 | Illuminant cap loose | | 0.40% | 3.2 | Manual |
| 103 | Expelling charge missing | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Cement missing or incomplete 360 degrees | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.27 | Rocket Assembly (Prior to Assembling Illuminant Assembly) | 1 OF 1 | 8838044 |
| | | | NEXT HIGHER ASSEMBLY 8838071 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Quickmatch missing | | 0.40% | 3.2 | Visual |
| 102 | Ejecting charge missing | | 0.40% | 3.2 | Visual |
| 103 | Wad missing | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:



Source: https://assist.dla.mil -- Downloaded: 2026-01-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.28 | Launcher assembly | | | | 8838031 |
| | | | | | NEXT HIGHER ASSEMBLY |
| | | | | | 8838071 |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | | | | | |
| 1. | Weight of propelling charge, min. | | 100% | 3.2 | Balance |
| Major | | | | | |
| 101 | Propellant charge missing | | 0.40% | 3.2 | Visual |
| 102 | Retaining disc torn or missing | | 0.40% | 3.2 | Visual |
| 103 | Set back wad holes not properly aligned | | 0.40% | 3.2 | Visual/Manual |
| 104 | Moisture content (Note 1) | | 0.40% | 3.4 | 4.5.2 |
| Minor | | | | | |
| 201 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES: 1. Moisture content of Wad, Setback, P/N 8838034, to be determined at loading, prior to assembly.

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.29 | Assembly (Prior to Assemblying Closing Covers) | | | | 8838071 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE / INSPECTION METHOD |
| Critical | | | | | |
| 1. | Safety latch missing | | 100% | 3.2 | Visual |
| Major | | | | | |
| 101 | Spring improperly assembled | | 0.40% | 3.2 | Manual |
| 102 | Retaining washer missing or insecure | | 0.40% | 3.2 | Visual/Manual |
| 103 | Rocket assembly inverted | | 0.40% | 3.2 | Visual |
| 104 | Primer missing | | 0.40% | 3.2 | Visual |
| 105 | Moisture content (Note 1) | | 0.40% | 3.4 | 4.5.2 |
| Minor | | | | | |
| 201 | Pull ring missing | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES: Moisture content to be determined at loading, prior to assembly.

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.30 | Sealed Container | | | | 8837838 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Container not hermetically sealed | | 0.40% | 3.2 | 4.5.4 |
| 102 | Contents loose | | 0.40% | 3.2 | Manual |
| 103 | Container dented so that signal cannot be removed easily | | 0.40% | 3.2 | Visual/Manual |
| 104 | Pull tab and tear strip extension missing or improperly assembled | | 0.40% | 3.2 | Visual |
| 105 | Marking misleading or unidentifiable | | 0.40% | 3.2 | Visual |
| 106 | Waterproofness | 100% | | 3.5 | 4.5.4 |
| 107 | Remove from container for functioning<br>Cold -65 ± 5°F<br>Ambient 70 ± 5°F | | 4.4.3.5 | 3.6 | 4.5.8 |
| Minor | | | | | |
| 201 | Container dented or damaged, but not interfering with removal of signal | | 0.65% | 3.2 | Visual/Manual |
| 202 | Container not completely painted | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.00% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77



Source: https://assist.dla.mil -- Downloaded: 20260-17T23:15Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-S-12730E(AR)

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.31 | Sealed Wood Packing Box | | | | 8837837 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major | | | | | |
| 101 | Contents loose | | 0.40% | 3.2 | Manual |
| 102 | Box damaged or broken exposing contents | | 0.40% | 3.2 | Visual |
| 103 | Hardware or strapping broken or missing | | 0.40% | 3.2 | Visual |
| 104 | Marking misleading or unidentifiable | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Strapping loose or improperly assembled | | 0.65% | 3.2 | Visual/Manual |
| 202 | Car seal missing or improperly assembled | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.0% | 3.8 | Visual |

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-01-17T23:15Z
Check the source to verify that this is the current version before use.

4 .4.3 Testing.

4 .4.3.1 Moisture content. (See Table II) - Major defects

TABLE II - Moisture Content Requirements

| Material |
|---|
| Cloth, paper and paper products (see applicable dwg.) |
| Black powder (see dwg. 8838046) |
| First fire composition (see 3.4) |
| Illuminant composition (see dwg. 8838055) |
| Rocket motor (see dwg. 8838071) |

The contractor shall provide adequate controls to assure that the materials comply with the requirement. For verification, the contractor shall select and subject to test, one sample of each material from each eight hours production. A composite sample shall not be used. If the moisture content of a sample exceeds the requirements and loading has not begun, the material represented by the sample shall be rejected. If components have been loaded with a material containing excess moisture, the remaining unloaded material and the loaded components shall be rejected. The determination shall be performed as specified in 4.4.2.

4.4.3.2 Breaking strength of suspension chain (See dwg. 8838068). Major defect.

4.4.3.2.1 First three lots produced. Beginning with the first lot produced and continuing until three consecutive lots have complied with the acceptance criteria, 125 suspension chains shall be selected from each lot for this test. The lot shall be rejected, if during the test, two or more chains fail to meet the requirement specified. The test shall be performed as specified in 4.5.3.

4.4.3.2.2 After three consecutive lots. After three consecutive lots have complied with the criteria of 4.4 .3.2.1 fifty (50) items shall be tested. The lot shall be rejected if one failure occurs.



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

4.4.3.3 Candlepower and color value. (See dwg. 8838055) - Major defect.

4.4.3.3.1 First three lots produced. Beginning with the first lot produced and continuing until three consecutive lots have complied with the acceptance criteria, a sample of 150 illuminant loading assemblies shall be selected from each lot for this test. If five or more illuminant assemblies fail to meet the requirements specified, the lot shall be rejected. The test shall be performed as specified in 4.5.6.

4.4.3.3.2 After three consecutive lots. After three consecutive lots have complied with the criteria of 4.4.3.3.1, a sample fo 50 illuminant loading assemblies shall be selected from each lot for this test. If two or more assemblies fail to meet the requirements specified, the lot shall be rejected.

4.4.3.4 Density of rocket charge. (See dwg. 8838071) - Major defect. A sample of ten rocket charges shall be selected from each lot for this test. If any charge fails to comply with the requirement specified, the lot shall be rejected. The test shall be performed as specified in 4.5.5.

4.4.3.5 Functioning. The signal assemblies shall be observed for any evidence of failure to comply with the requirements, as classified in Table III, when tested as specified in 4.5.8.

TABLE III - Defect Classification

| Defect | Classification |
|---|---|
| Premature burst (see 3.6.1) | Critical |
| Incorrect color value (see dwg. 8838055) | Critical |
| Altitude, vertical angle and average angle from vertical (ambient) (3.6.2.1) | Major |
| Burning time (ambient) (3.6.2.2) | Major |
| Altitude, vertical angle and average angle from vertical (cold) (see 3.6.3.1) | Major |
| Burning time (cold) (see 3.6.3.2) | Major |



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

4.4.3.5.1 First three lots. Beginning with the first lot produced and continuing until three consecutive lots have complied with the acceptance criteria, 150 signal assemblies in sealed metal containers shall be selected from each lot for this test. Ninety signals shall be conditioned for 24 hours at 70 ± 5°F and sixty at minus 65 ± 5°F. If 12 or more fail to comply with the requirements specified, the lot shall be rejected. The test shall be performed as specified in 4.5.8.

4.4.3.5.2 After three consecutive lots. After three consecutive lots have complied with the criteria of 4.4.3.5.1, a sample of 60 signal assemblies shall be selected from each lot for this test. If five or more assemblies fail to meet the requirements specified, the lot shall be rejected.

4.4.4 Inspection equipment. The inspection equipment required to perform the examinations and tests prescribed in this section is identified under the “Method of Inspection” headings in 4.4.2 and in the procedures in 4.5 (see 6.3).

4.5 Test methods and procedures.

4.5.1 Embrittlement of springs. The spring shall be stretched along its longitudinal axis until it no longer returned to its original length or profile it shall be considered permanently distorted. Any spring that breaks during the test shall be classed defective. Springs subjected to test shall not be returned to the lot. (Destructive test)

4.5.2 Moisture content (See 6.5). The Karl Fischer Method as stated in Standard MIL-STD-1234, Method 101.2 up to paragraph 5.4 shall be used. A 50 g. sample ± 0.1 g. (ground up) shall be added to a 500 mL. volumetric flask containing approximately 300 to 400 mL. mixture of carbon tetrachloride methanol 50/50 and 25 g. of dry sodium nitrate. The flask shall be stoppered and the contents swirled cautiously for several minutes until the material is thoroughly dispersed. The sample shall be allowed to remain in contact with the mixture of carbon tetrachloride methanol 50/50 for approximately two hours. Then the 500mL. volumetric flask shall be filled up to the 500 mL. mark with the mixture of carbon tetrachloride methanol 50/50 and swirled again. A blank without the sample shall be put through the same procedure. After the sample has settled, a 50 mL. aliquot of the clear supernatant liquid shall be withdrawn and immediately transferred to the standard titration vessel containing approximately 100 mL. of the mixture of carbon tetrachloride methanol 50/50 which has just been titrated to the preliminary end point as described in Standard MIL-STD-1234, Method



Source: https://assist.dla.mil -- Downloaded: 202610-17T23:15Z
Check the source to verify that this is the current version before use.

101.2 paragraph 5. 1. The final end point shall be reached in 3.5 minutes in the manner described in Standard MIL-STD-1234 Method 101.2 paragraph 5.4. A 100 mL. aliquot of the blank shall be titrated in the same manner. The water content shall be calculated as follows:

$$\text{Percent water equal } \frac{(VR-S) - (V^1 R-S^1)}{W} \times 100$$

where:

F = g. of water per mL. of standard water in methanol solution.
V = mL. of Karl Fischer reagent added to the sample.
$V^1$ = mL. of Karl Fischer reagent added to the blank.
R = mL. of standard water in methanol solution per mL. of Karl Fischer reagent.
S = mL. of standard water in methanol solution for back titration of sample.
$S^1$ = mL. of standard water methanol solution for back titration of blank.
W = sample weight, g.

4.5.2.1 Alternate method. The moisture content of the illuminant compositions may be determined as specified in 4.5.2 with the following changes: A ten g. sample shall be used. Dimethylamine shall be used in lieu of methanol throughout the determination.

4.5.3 Strength of suspension chain. One end of the suspension chain shall be fastened to the fixture and held stationary. A minimum load of 90 pounds shall be applied along the longitudinal axis of the chain without shock. Observation shall be made for compliance with the applicable requirement. (Non-destructive test)

4.5.4 Waterproofness. The packed sealed container shall be placed in a tank of water and submerged to a minimum depth of 2 inches. The air above the water shall be evacuated to a pressure of 5 to 7 pounds per square inch absolute. After the air inside the tank has been evacuated to the required pressure, the container assembly shall be observed for 15 seconds minimum for evidence of a stream of bubbles which indicate a leak. Any assembly that fails to comply with the applicable requirement shall be classed defective and removed from the lot.

4.5.5 Density. (See 6.6) The rocket charges shall be removed from the motor assembly by removing the tube around the charge. The charges shall be cut into five approximately equal sections with the cut at right angles to the longitudinal axis. Each section shall be accurately weighed. Fill the beaker with clean mercury (see figure 1), insert the immersing fixture and level off the mercury by pressing down with the flat glass plate until it is even with the top of the beaker. Then place the section beneath the prongs of the



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

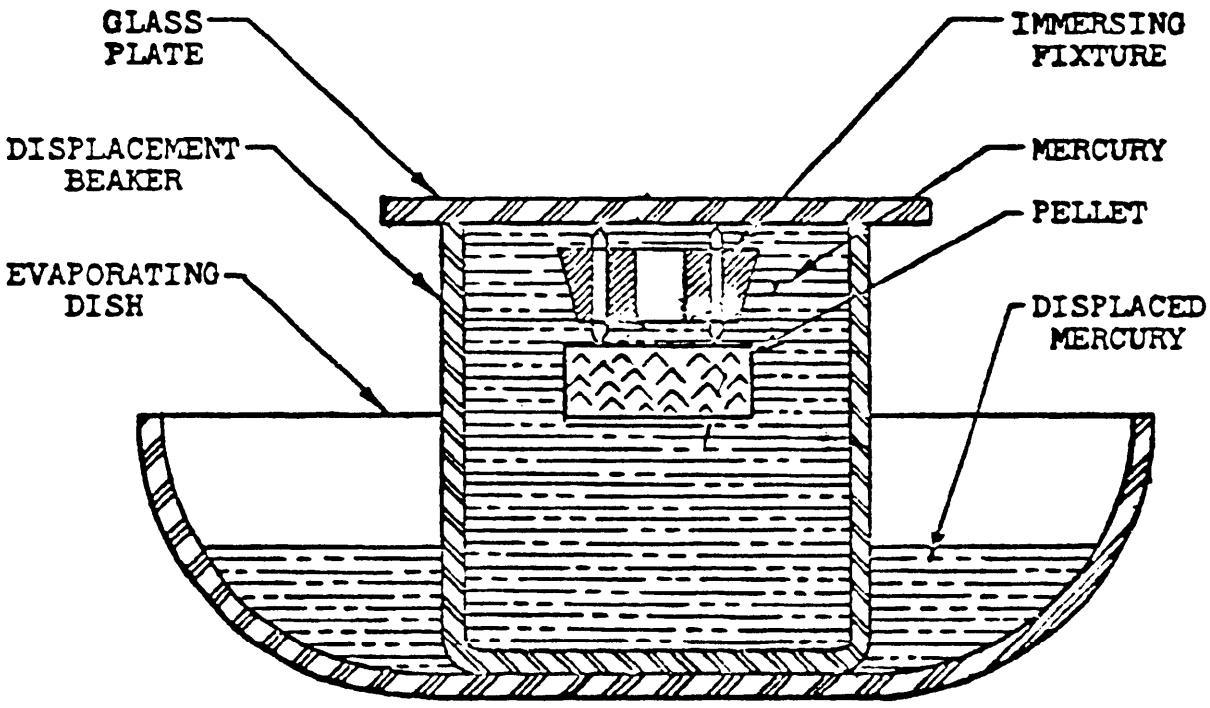



FIGURE I -- EQUIPMENT SET-UP FOR DETERMINING SPECIFIC GRAVITY



Source: https://assist.dla.mil -- Downloaded: 202610-17T23:15Z
Check the source to verify that this is the current version before use.

immersing fixture and level the mercury by pressing down with the flat glass until it is even with the top of the beaker. Catch the excess mercury in a clean evaporating dish. Weigh the mercury displaced by the section. Calculate the density of the section as follows:

$$\text{Density} = \frac{13.54W}{\text{Mercury in gr.}}$$

where:
W = weight of the cylinder in grams.

4.5.6 Candlepower and color value. The illuminant assemblies shall be supported in a suitable fixture with the ignition end up and ignited-with a quickmatch. The determination of the candlepower and color value shall be made in accordance with the procedures and equipment specified in 4.4.4.

4.5.7 Torque test of spring. The spring shall be distorted the specified amounts and the distortion forces recorded for compassion with the dwg. requirements. The test equipment used shall be as specified in 4.4.4. (Destructive test)

4.5.8 Functioning. Thirty signal assemblies shall be conditioned at 70 ± 5°F temperature and 30 signal assemblies conditioned at minus 65 ± 5°F temperature for not less than 24 hours prior to firing. All assemblies conditioned at 70°F and 20 assemblies conditioned at minus 65°F shall be fired from an approved fixture. The 10 remaining assemblies that were conditioned at minus 65°F shall be fired by hand. The wind velocity shall not exceed 15 miles per hour or the ceiling visibility be less than 1500 feet when firing the assemblies. Personnel hand firing signals shall wear Arctic mittens and other necessary protective clothing. Individual functioning altitude, burning time, burn out altitude, and angle of ejection from the vertical, shall be recorded. Observation shall be made for conformance with the applicable requirement.

5. PACKING

5.1 Packaging.

5.1.1 Level A. The signals shall be preserved and packaged in accordance with dwg. 8837838.

5.2 Packing.

5.2.1 Level A. The containers shall be packed in accordance with dwg. 8837837.

5.3 Marking. The containers and box shall be marked as specified on dwgs. 8837837 and 8837838.



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

6. NOTES

6.1 Intended use. The components covered by this specification are intended for use on the Signal, Illumination Red Star, Distress, Parachute, M131.

6.2 Ordering data. See MIL-A-48078.

6.3 Submission of inspection equipment for design approvals. See MIL-A-48078. Submit designs as required to: Commander, US Army Armament Research and Development Center, ATTN: DRSMC-QAT-I (D), Dover, NJ 07801.

6.4 Distribution of ammunition data cards. Distribution of data cards include the following: Commander, US Army Armament Research and Development Center, ATTN: DRSMC-QAT-M (D), Dover, NJ 07801.

6.5 Solvents. If the solvent specified in the test procedure conflicts with safety regulations or N10SH/OSHA, an equivalent solvent may be used providing prior approval has been obtained from the Technical Agency.

6.6 Test methods. If the test procedure conflicts with safety regulations or N10SH/OSHA, an equivalent test method may be used providing prior approval has been obtained from the Technical Agency (See 6.7).

6.7 Equivalent test methods. The test methods given in this specification are the official methods to be used. The contractor may propose alternate methods providing the proposed method is equivalent (accuracy and precision) to that specified herein. Prior approval of the Contracting Officer is required for use of equivalent test methods. A decryption of the proposed method should be submitted through the Contracting Officer to: Commander, ARDC, ATTN: DRSMC-QAT-M D), Dover, NJ 07801. This description should include, but not be limited to, the proposed procedure, the accuracy and precision of the method, test data to demonstrate the accuracy and precision of the method and drawings of any special equipment required (see MIL-I-45208).

Custodian:
Army-AR

Preparing Activity:
Army-AR

(Project 1370-A157)



Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

**INSTRUCTIONS:** In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

*NOTE:* This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

*(Fold along this line)*

*(Fold along this line)*

DEPARTMENT OF THE ARMY

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

**BUSINESS REPLY MAIL**
FIRST CLASS PERMIT NO 12062 WASHINGTON D C
POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE ARMY

COMMANDER
US ARMY ARMAMENT RESEARCH & DEVELOPMENT CENTER
ATTN: DRSMC-QA
DOVER, NJ 07801

Source: https://assist.dla.mil -- Downloaded: 202610-17T23:15Z
Check the source to verify that this is the current version before use.

# STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

*(See Instructions - Reverse Side)*

| 1. DOCUMENT NUMBER | 2. DOCUMENT TITLE |
|---|---|
| MIL-S-12730E | Signal, Illumination Red Star, Distress, Parachute, M131 Par |

| 3a. NAME OF SUBMITTING ORGAN ZATION | 4. TYPE OF ORGANIZATION *(Mark one)* |
|---|---|
| | ☐ VENDOR |
| b. ADDRESS *(Street, City, State, ZIP Code)* | ☐ USER |
| | ☐ MANUFACTURER |
| | ☐ OTHER *(Specify)* _____ |

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording

c. Reason/Rationale for Recommendation

6. REMARKS

| 7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional | b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional |
|---|---|
| c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional | 8. DATE OF SUBMISSION *(YYMMDD)* |

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-17T23:15Z
Check the source to verify that this is the current version before use.