MIL-P-18516(NOrd)

20 May 1955
SUPERSEDING
NAVORD OS 2954 E
27 AUGUST 1954

MILITARY SPECIFICATION

PRIMER MK 108, MK 112, MK 113, MK 114, ALL MODS

1. SCOPE

1.1 This specification governs the manufacture, assembly, loading and preparation for delivery of Primer (Fuze, Electric) Mk 108 All Mods, Mk 112 All Mods, Mk 113 All Mods, and Mk 114 All Mods and the methods of inspection and tests upon which acceptance shall be based.

2. APPLICABLE DOCUMENTS

2.1 The following specifications, drawings, and publications, of the issue in effect on date of invitation for bids, form a part of this specification:

SPECIFICATIONS

FEDERAL

L-P-406	-- Plastics, Organics: General Specifications, Test Methods.
NN-B-621	-- Boxes, Wood, Nailed and Lock-Corner.
RR-S-366	-- Sieves, Standard for Testing Purposes.
PPP-B-601	-- Boxes, Wood, Cleated-Plywood.
PPP-B-676	-- Boxes, Set-Up Paperboard.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T11:39Z
Check the source to verify that this is the current version before use.

MILITARY

JAN-P-120 -- Packaging and Packing for Overseas Shipment - Cartons, Folding, Paperboard.
JAN-P-125 -- Packaging and Packing for Overseas Shipment.
JAN-P-133 -- Packaging and Packing for Overseas Shipment - Boxes, Set-Up, Paperboard.
MIL-A-148 -- Aluminum Foil
JAN-N-244 -- Nitrocellulose (For Use in Explosives).

STANDARDS

MIL-STD-105 -- Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-129 -- Marking of Shipments.

DRAWINGS

BUREAU OF ORDNANCE

LD 292019 -- Primer Mk 108 Mod 0
LD 166550 -- Primer (Fuze, Electric) Mk 112 Mod 0.
LD 166551 -- Primer (Fuze, Electric) Mk 113 Mod 0.
LD 296079 -- Primer (Fuze, Electric) Mk 113 Mod 1.
LD 166552 -- Primer (Fuze, Electric) Mk 114 Mod 0.
LD 267029 -- Primer Mk 114 Mod 1 (Electric).
LD 284624 -- Primer Mk 114 Mod 2
LD 169937 -- Test Set Mk 148 Mod 0 (Sand Bomb)
LD 267056 -- Test Set Mk 161 Mod 0 (Insulation Resistance).
LD 267058 -- Test Set Mk 152 Mod 0 (Primer).
LD 267064 -- Forty foot drop test fixture.
LD 267280 -- Test Set Mk 238 Mod 0 (Primer Resistance).
And all specifications, standards, and drawings listed on the above LD's.

PUBLICATIONS

BUREAU OF ORDNANCE

NAVORD OD 6652 -- Preparation of Diazodinitrophenol Ignition Mixture for Use in Electric Primers.
NAVORD OD 6819 -- Test Set Mk 161 Mod 0.
NAVORD OD 6821 -- Test Set Mk 152 Mod 0.
NAVORD OD 6854 -- Test Set Mk 238 Mod 0.
NAVORD OD 7231 -- Sand Test of Primers and Detonators.

Source: https://assist.dla.mil -- Downloaded: 20260-18T11:39Z
Check the source to verify that this is the current version before use.

OP 400 -- General Instructions for the Design, Manufacture and Inspection of Naval Ordnance Equipment. (Copies of specifications, drawings, and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer).

2.2 Other Publications. -- The following documents form a part of this specification. Unless otherwise indicated, the issue in effect on date of invitation for bids shall apply.

CODE OF FEDERAL REGULATIONS

49 CFR 71-78 -- Transportation, Interstate Commerce Commission, Explosives and Other Dangerous Articles.
(The Interstate Commerce Commission regulations are now a part of the Code of Federal Regulations (1949 Edition Revised 1950) available from the Superintendent of Documents, Government Printing Office, Washington 25, D. C. Orders for the above publication should cite "49 CFR 71-78 (Rev. 1950)").

3. REQUIREMENTS

3.1 General.

3.1.1 Primer (Fuze, Electric) Type covered by this specification shall be manufactured in accordance with all documents listed on the following LD's:

(a) LD 292019 -- Primer Mk 108 Mod 0
(b) LD 166550 -- Primer (Fuze, Electric) Mk 112 Mod 0
(c) LD 166551 -- Primer (Fuze, Electric) Mk 113 Mod 0
(d) LD 296079 -- Primer (Fuze, Electric) Mk 113 Mod 1
(e) LD 166552 -- Primer (Fuze, Electric) Mk 114 Mod 0
(f) LD 267029 -- Primer Mk 114 Mod 1 (Electric)
(g) LD 284624 -- Primer Mk 114 Mod 2

3.1.2 The requirements and procedures established in OP 400 shall be adhered to wherever applicable.

3.2 Wire for Bridge. -- The wire for the bridge shall be capable withstanding a static tensile load of 17 grams without breaking. The wire shall be free from kinks, nicks and other imperfections.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T11:39Z
Check the source to verify that this is the current version before use.

3.3 Base Charge. -- The base charge shall be an intimate mixture of powdered potassium chlorate and tabular diazodinitrophenol. The moisture content of the mixture shall not exceed the drawing limit as determined in accordance with 4.5.2. Particular care in handling the mixed product shall be exercised to prevent separation or segregation of the constituents.

3.4 Flash Charge.

3.4.1 Nitro Starch. -- The nitro starch shall be pure nitrated starch of good quality having a weight percentage of nitrogen between the limits of 12.75 percent and 13.30 percent as determined by the procedure of 4.5.3.1. The stability shall be such that the nitro starch resists ignition or explosion when heated at 100°C for 48 hours. Test procedure shall be in accordance with 4.5.3.2.

3.4.2 Milling and Preparation of Charge. -- The ingredients prescribed on the drawing shall be finely ground and uniformly mixed to provide finished primers that meet the functional requirements. An advisory procedure for preparation of the charge is provided in NavOrd OD 6652.

3.5 Plug and Lead Wire Subassembly.

3.5.1 Chemical Properties. -- The resinous part of the subassembly shall be a thoroughly cured phenolic resin having an acetone extract value of 5 percent maximum as determined by the procedure of 4.5.1.1. The plug shall have a glossy finish free from checks and cracks.

3.5.2 Insulation. -- The insulation resistance between the assembled lead wires of each subassembly shall be greater than 50 megohms under an applied potential of 1000 volts a.c. RMS. The resistance as ascertained by Test Set Mark 161 Mod 0 under the procedure of 4.5.1.2 shall be applicable.

3.5.3 Mechanical Properties. -- The lead wires shall be free from kinks and nicks and shall be capable of withstanding a pull along the axis of the plug sufficient to break the leads without showing any signs of slipping in the plug. The rate of pull or loading shall not exceed 0.5 inches per minute.

Source: https://assist.dla.mil -- Downloaded: 202640-18T11:39Z
Check the source to verify that this is the current version before use.

3.6 Bridge Wire Subassembly.

3.6.1 Bridge Wire. -- The bridge wire shall be attached to the lead wires both electrically and mechanically in a sound manner. After attachment, tension on the wire shall be relieved by slightly bending the terminal wires toward each other until visible curvature of the bridge wire is obtained. The resistance of the subassembly measured between the lead wire terminals should be between the limits of 3 and 7 ohms in order to meet the resistance requirements of the finished primer.

3.6.2 Soldering.

3.6.2.1 Application. -- Solder shall be applied only to bright clean surfaces. Fluxing and heating shall be such as to avoid flux inclusions. Operations shall be conducted to avoid insecure or pasty joints caused by vibration of the joint while the solder is setting. The lead wires shall be shielded to prevent contamination with flux during the soldering.

3.6.2.2 Flux. -- Organic or inorganic fluxes will be permitted provided the fluxes can be removed by acceptable solvents. Highly corrosive materials shall be avoided.

3.6.2.3. Cleaning.

3.6.2.3.1 Water Soluble Fluxes. -- The parts shall be rinsed and cleaned in hot water and then dipped in a solution containing 5 ounces of sodium citrate (technical grade) per gallon of water. Again rinse in clean cold water and then in clean hot water and dry.

3.6.2.3.2 Water Insoluble Fluxes. -- Solvent cleaning to remove all visible trace of the flux shall be employed. The solvent shall evaporate cleanly leaving neither solid nor liquid residue and shall not be capable of attacking the lead wire insulation under normal conditions of usage.

3.6.3 Welding. -- This alternate method of bridge wire assembly shall be subject to approval by the Bureau of Ordnance prior to employment.

Source: https://assist.dla.mil -- Downloaded: 202610-18T11:39Z
Check the source to verify that this is the currenversion before use.

3.7 Loading and Assembly.

3.7.1 Ignition Subassembly.

3.7.1.1 Sleeve. -- The sleeve shall be pressed into place on the bridge wire subassembly. Care shall be exercised that neither the bridge wire nor other parts of the subassembly are injured in the assembly operation. The sleeve shall fit securely on the plug.

3.7.1.2 Loading Flash Charge. -- The technique of wet loading the flash charge shall be such as to avoid damage to the bridge wire or other parts. An advisory technique for loading the milled flash charge is given in 6.2. The flash charge, when consolidated to assure freedom from voids, shall be smoothed off flush with the top of the sleeve. The ignition subassembly shall be dried at a temperature of 120°F for a minimum of 16 hours. At least 4 hours of drying shall immediately precede the insertion of the ignition subassembly into the cup. The metallic parts of the electrical circuit shall be entirely covered.

3.7.2 Loading Cup.

3.7.2.1 Assembly of Loaded Cup and Ignition Subassembly. -- The dried ignition subassembly shall be force fitted into the charged cup with sufficient force to provide a consolidation pressure upon the base charge of approximately 600 lbs. per square inch. The fitting operation shall be conducted to maintain the force fit provided by the drawing dimensions.

3.8 Electrical Resistance. -- Before shunting the lead wires, the resistance of the circuit between the lead wires of the primer assembly shall be not less than 3.0 or more than 7.0 ohms. Test procedure shall be in accordance with 4.5.1.3.

3.9 Primer Assembly.

3.9.1 Insulation. -- The insulation resistance between the shunted lead wires and the cup of each assembly shall be greater than 50 megohms under an applied potential of 1000 volts a.c. RMS. The resistance as ascertained by Test Set Mark 161 Mod 0 under the procedure of 4.5.4.1 shall be applicable.

Source: https://assist.dla.mil -- Downloaded: 202610-18T11:39Z
Check the source to verify that this is the currentversion before use.

3.9.2 Lead Wire Flexibility. -- Each lead wire shall be capable of withstanding, without breaking, successive bends in opposite directions of 90°, 180° and 90° as prescribed in paragraph 4.5.4.2.

3.9.3. Functioning. -- The primers shall function when subjected to the discharge of a 1.0 ± .02 microfarad condenser charged to 38.5 volts. The discharge shall be applied by means of Test Set Mark 152 Mod 0 which includes a 4 ohm resistor in series with the primer. Acceptance and testing shall be conducted in accordance with 4.5.4.3.

3.9.4 Output. -- On subjecting primers to the sand test of 4.5.4.4, the average weight of sand crushed shall exceed 5.0 grams and no individual primer shall crush less than 3.5 grams of sand.

3.10 Durability.

3.10.1 Low Temperature Functioning. -- The primers shall function at -65°F. Test procedure shall be in accordance with 4.5.4.5.1.

3.10.2 Cycling. -- The primers shall maintain the 3.0 to 7.0 ohms electrical resistance of 3.8 and functioning characteristics of 3.9.3 after undergoing the cycling schedule of 4.5.4.5.2.

3.10.3 Ruggedness. -- The primers shall be safe and functionally serviceable as a fuze component after subjection to the forces incident to handling and firing. The primers shall not be damaged by the drop test of 4.5.4.5.3.

4. QUALITY ASSURANCE PROVISIONS AND TEST REQUIREMENTS

4.1 Sampling. - Unless otherwise specified, and when applicable, the sampling plans and procedures used by the Government Inspector in the determination of the acceptability of products submitted by a supplier for Government Inspection will be in accordance with the provisions of MIL-STD-105.

Source: https://assist.dla.mil -- Downloaded: 202610-18T11:39Z
Check the source to verify that this is the current version before use.

4.1.1 Lot. -- As applied to the Government inspection of units of product, the term "lot" shall mean "inspection lot", i.e. a collection of units of the product used as a basis for Government Inspection. Unless otherwise specified, the number of units of product in "inspection lots" shall be as determined by the Government Inspector, and may differ from the quantity designated in the contract or order as a lot for production, shipment, or other purpose.

4.2 Preproduction Sample. -- Before entering into quantity production, a preproduction sample of 1000 primers shall be delivered by the contractor for test to an agency designated by the procuring agency. These primers shall be manufactured by the same procedures and processes and at the same location proposed by the contractor for the execution of the contract. When a preproduction sample is received which proves to be satisfactory for the purpose intended, the contractor will be notified and will be authorized by the procuring agency to proceed with the submission of the product for acceptance. Accepted samples will become the property of the procuring agency and will be included in the number called for in the contract schedule.

4.2.1 Preproduction Sample for a Subsequent Contract. -- The necessity for a preproduction sample will be determined by the procuring agency when production under a new contract by the same contractor at the same location follows the manufacture of satisfactory material as covered by this specification.

4.3 Inspection. -- The general inspection procedures shall be in accordance with General Instructions for the Design, Manufacture, and Inspection of Naval Ordnance Equipment, OP 400; Government Inspection shall be in accordance with the provisions of General Procedure for Government Inspection and Contractor's Inspection shall be in accordance with Inspection by Contractor, as contained in OP 400.

4.4 Production Lot. -- Each production lot shall consist of 10,000 primers plus those required for tests. The primers of a lot shall be of consecutive manufacture. The production lot shall be used for delivery and identification of primers and shall not be confused with the inspection lot as defined in 4.1.1.

Source: https://assist.dla.mil -- Downloaded: 20260-18T11:39Z
Check the source to verify that this is the current version before use.

4.5 Tests.

4.5.1 Plug and Lead Wire Subassembly Tests.

4.5.1.1 Acetone Extract of Plastic Housing. -- At least one test of each lot and additional tests, where necessary, to yield one sample for each batch of uncured resin or major change in curing procedure, shall be made. Select sufficient sample plug and lead wire subassemblies to conduct an acetone extraction test as prescribed in method No. 7021, Federal Specification [illegible]. In cases where the extract exceeds 5 percent, all plugs represented by the samples shall be rejected.

4.5.1.2 Insulation Test. -- Apply a potential of 1000 volts RMS a.c. using the lead wires as terminals. The voltage shall be applied by means of Test Set Mark 161 Mod 0 for a period of at least one second. See NAVORD OD 6819. The test temperature and relative humidity shall not exceed 79°F and 80 percent respectively. To facilitate production, ambient conditions may exceed the prescribed limits for acceptance, but rejection of material shall be based on tests conducted as prescribed. Assemblies which have an insulation resistance less than 50 megohms as ascertained by Test Set Mark 161 Mod 0 shall be considered defectives.

4.5.1.3 Primer Circuit Electrical Resistance Test. -- Before shunting the lead wires, the resistance of the bridge wire circuit shall be tested by means of Test Set Mark 238 Mod 0, which limits the current in the bridge circuit to less than 5 milliamperes. See NAVORD OD 6854. Measurements shall be made to an accuracy of ±0.1 ohm. Primers having a resistance outside the limits of 3.0 and 7.0 ohms shall be considered defectives.

4.5.2 Moisture Test of Base Charge. -- Conduct at least one test for each lot and such additional tests as the inspector considers warranted by variations in the process and materials. Collect sufficient charges from the cups in a tared container to make an approximately two gram sample. Selection shall be made at the site of final assembly immediately prior to assembly of the ignition subassembly and the charged cup. Stopper the container and weigh; reopen and expose the sample for drying at 50 ± 2°C until constant weight is obtained. Cool the sample in a desiccator, and weigh. Calculate the loss in weight as percentage of moisture in the sample. All weighings shall be accurate to ± 0.5 milligram. The presence of moisture

Source: https://assist.dla.mil -- Downloaded: 2026l0-18T11:39Z
Check the source to verify that this is the currentversion before use.

in excess of 0.30 percent shall cause suspension of the base charge loading operation until permanent corrective measures satisfactory to the Government Inspector have been completed. The defective lot shall be rejected.

4.5.3 Test of Nitro-Starch. -- Samples for test shall be collected from each production batch or shipment of nitro-starch used in the manufacture of primers. The Government Inspector may retest any batch or shipment at any time to assure that the nitro-starch has not deteriorated.

4.5.3.1 Nitrogen Content. -- The nitrometer method shall be used to determine the nitrogen content of the nitro-starch. Sampling and chemical analysis shall be in accordance with Container Sampling and Nitrogen Content procedures specified in specification JAN-N-244. Batches which do not meet the requirements of 3.4.1 shall be rejected.

4.5.3.2 Stability Test. -- A representative sample of air dried nitro-starch selected under the supervision of the inspector shall be dried at 100°C for twenty minutes. Introduce a 0.6 gram sample of the dried nitro-starch into a standard test tube approximately 75mm length and 10mm diameter. Heat the test tube and contents at 100°C ± 0.5°C for 48 hours in an ambient atmosphere having a maximum absolute humidity of .008 gram water per gram of dry air (60 percent relative humidity at 65°F). The batch of nitro-starch shall be rejected if ignition or explosion occurs during the test.

4.5.4 Tests on Finished Primer Assembly.

4.5.4.1 Insulation Test of Primer. -- Apply a potential of 1000 volts RMS a.c. using the twisted lead wires and the primer cup as terminals. The voltage shall be applied by means of Test Set Mark 161 Mod 0 for a period of at least one second. See NAVORD OD 6819. The test temperature and relative humidity shall be less than 79°F and 80 percent respectively. To facilitate production, ambient conditions may exceed the prescribed limits for acceptance, but rejection of primers shall be based on tests conducted as prescribed. Primers which have insulation resistance less than 50 megohms as ascertained by Test Set Mark 161 Mod 0 shall be considered defectives.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T11:39Z
Check the source to verify that this is the current version before use.

4.5.4.2 Lead Wire Flexibility Test. -- Samples shall be selected and tested from each production lot in accordance with MIL-STD-105, Table VI-I, Multiple Sampling Plan, AQL 1.0 percent defective. Tested samples which pass this test shall not be returned to the lot but may be used to fulfill the Output test requirements of 4.5.4.4. Each lead shall withstand without breaking, successive bends in opposite directions of 90°, 180° and 90° while a tensile force of 1500 p.s.i. is applied to the wire. The bending shall take place as close as possible to the plug face, in a plane normal to the plug face, using the point of exit as a fulcrum and shall be at the rate of approximately three seconds per bend.

4.5.4.3 Functioning Test. -- Samples shall be selected and tested from each lot in accordance with the sequential sampling plan, level I, AQL .25 percent defective as given in MIL-STD-105. When the inspection lot is greater than the production lot, additional tests shall be conducted to provide at least one test for each production lot. Attach the leads of a primer to the terminals of Test Set Mark 152 Mod 0. See NAVORD OD 6821. The leads between the test set and the firing chamber shall have the shortest practicable length. Adjust the capacitor voltage of the test set to 38.5 volts, and close the firing circuit by means of the switch. Primers which do not explode on receiving the first capacitor discharge shall be considered defectives. Disposition of the lot shall be governed by the applicable sampling table.

4.5.4.4 Output Test. -- Primers shall be tested by means of Test Set (Sand Bomb) Mark 148 Mod 0, using Test Set Mk 152 Mod 0 to initiate the primer. Operating procedures for Test Set Mk 148 Mod 0 shall be in accordance with NAVORD OD 7231. The test shall be conducted on the basis of ten explosions, ignoring any failure to explode. The lot shall be rejected if the average quantity of sand crushed is less than 5 grams or if an individual primer crushes less than 3.5 grams of sand. When the inspection lot is greater than the production lot, additional tests shall be conducted to provide at least one test for each production lot.

4.5.4.5 Durability Tests. -- The following durability tests shall be conducted at a site designated by the Government. These tests will be normally restricted to preproduction samples and programs which are conducted specially.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T11:39Z
Check the source to verify that this is the current version before use.

4.5.4.5.1 Low Temperature Functioning Test. -- Maintain 100 sample primers at a temperature of -65° ±2°F for a period of at least two hours. The samples shall be subjected to the functioning test of 4.5.4.3. The primers shall be maintained substantially at the conditioning temperature of -65°F until the test impulse is applied. The incidence of two defective primers in the 100 samples shall cause rejection of the lot.

4.5.4.5.2 Cycling Test. -- Subject 100 primers to the following conditioning cycle:

18 hours at 125° ± 5°F and 95 percent minumum relative humidity.

6 hours at 77° ± 2°F and 80 percent maximum relative humidity.

Repeat the treatment until a total of four cycles have been completed. The samples shall be subjected to the circuit resistance test of 4.5.1.3 and the functioning test of 4.5.4.3. The incidence of two defective primers in the 100 samples shall cause rejection of the lot.

4.5.4.5.3 Drop Test. -- Mount 36 primers in the forty foot drop test fixture LD 267064. The cavitated housing shall orient the axes of 18 primers normal to the projectile axis and 18 primers parallel to the projectile axis with the primer cup nearest to the projectile base. The housings shall be securely attached by means of an adapter to a 5"/38 projectile. The projectile shall be dropped from a height of 40 feet for base impact on a solidly supported 3 inch armor plate. When tested for functioning in accordance with 4.5.4.3, the failure of two primers shall cause rejection of the lot.

5. PREPARATION FOR DELIVERY

5.1 Packaging. -- Twenty-five (25) primers shall be bundled together and packaged in accordance with Figures 1 and 2 (Steps 1, 2, and 3). Representative test samples selected at random shall be packaged as outlined above also.

5.2 Packing. -- No more than 2500 primers packaged as specified in paragraph 5.1, shall be packed in accordance with Figure 2, Step 4.

Source: https://assist.dla.mil -- Downloaded: 20260-18T11:39Z
Check the source to verify that this is the current version before use.

5.3 Marking. -- In addition to any special marking shown on Figures 1 and 2, and any special markings required by the contract or order, all markings shall be in accordance with MIL-STD-129, "Marking of Shipments" and Interstate Commerce Commission Code of Federal Regulations 49 CDR 71-78.

6. NOTES

6.1 Shorting Leads. -- Operations involving the ignition assembly and the primer assembly prior to twisting the lead wires are accompanied by risk of explosion initiated by stray currents. It is recommended that clips or removable shunts be employed to render the circuit safe pending final shunting.

6.2 Charging. -- An advisory technique for loading the milled flash charge, as specified in 3.4.2, into the cavity of the bridge wire subassembly is given by the following steps:

(a) The loading room shall have a relative humidity of 70-80 percent. The moisture content shall be maintained at all times.
(b) Only approximately 2 grams of charge shall be present at each loading station and only when an operator is present.
(c) Any mixture which is spilled shall be cleaned up immediately by means of a cloth wet with butyl acetate; the soiled cloth shall be placed in a special disposal can.
(d) The mixing and loading of the flash charge shall be done behind an approved shield whenever possible.
(e) All fixtures, equipment, benches, floors, etc. shall be properly grounded to prevent accidental ignition due to static discharges, electrical arcing, or sparking.
(f) Butyl acetate is used as a grinding medium and as the liquid element in the prepared slurry used in loading. This liquid confers a degree of resistance to explosion and ignition by impact and friction. However, it is emphasized that the resistance to explosion obtained by wetting with butyl acetate is of a lower order than that obtained by water wetting. Butyl acetate is flammable and can produce ignitable vapors at dry-house temperatures.

Source: https://assist.dla.mil -- Downloaded: 20260-18T11:39Z
Check the source to verify that this is the current version before use.

(g) The loading dish shall be constantly checked to prevent the mixture from becoming too dry, particularly around the edges and on the top of the dish. If necessary, the operator shall add butyl acetate and work the mixture to the proper buttering consistency.

(h) To charge the subassembly with the flash charge, convey sufficient mixture on a nonsparking spatula to butter one unit. Scrape off and press the mixture into the sleeve cavity using short rapid strokes downward and outward. Excess mixture shall be scraped off flush with the surface of the sleeve. The bridge wire shall not be visible.

(i) Clean off all excess mixture from the sides of the subassembly using clean muslin wet with butyl acetate.

(j) The flash charge shall be mixed to the proper consistency using a vulcanized fiber rod.


(k) All utensils and tools shall be kept clean and free of any dried charge. Empty dishes and soiled cloths shall be placed in approved containers.

(l) Extreme care and precautions shall be exercised at all times in the handling and loading of charge.


Patent Notice. -- When Government Drawings, specifications, or other data are used for any purpose other than in connection with a definitely related Government procurement operation, the United States Government thereby incurs no responsibility nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use, or sell any patented invention that may in any way be related thereto.

Source: https://assist.dla.mil -- Downloaded: 20260-18T11:39Z
Check the source to verify that this is the current version before use.

FIGURE 1

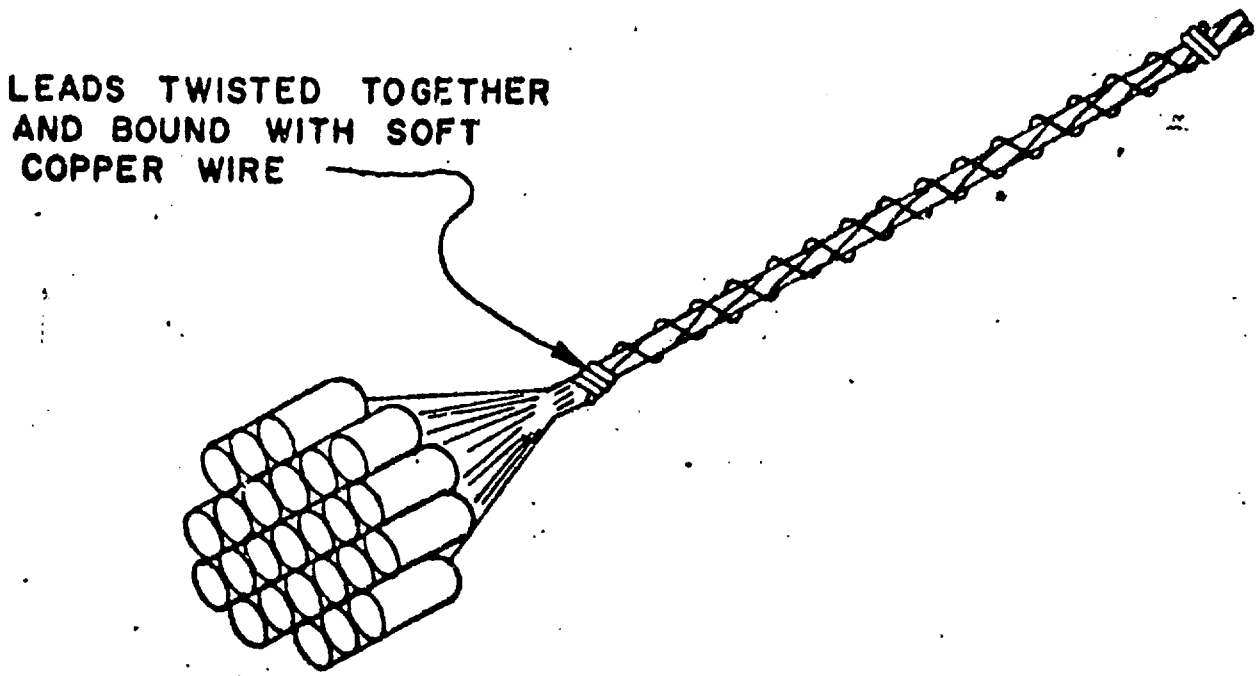


STEP 1

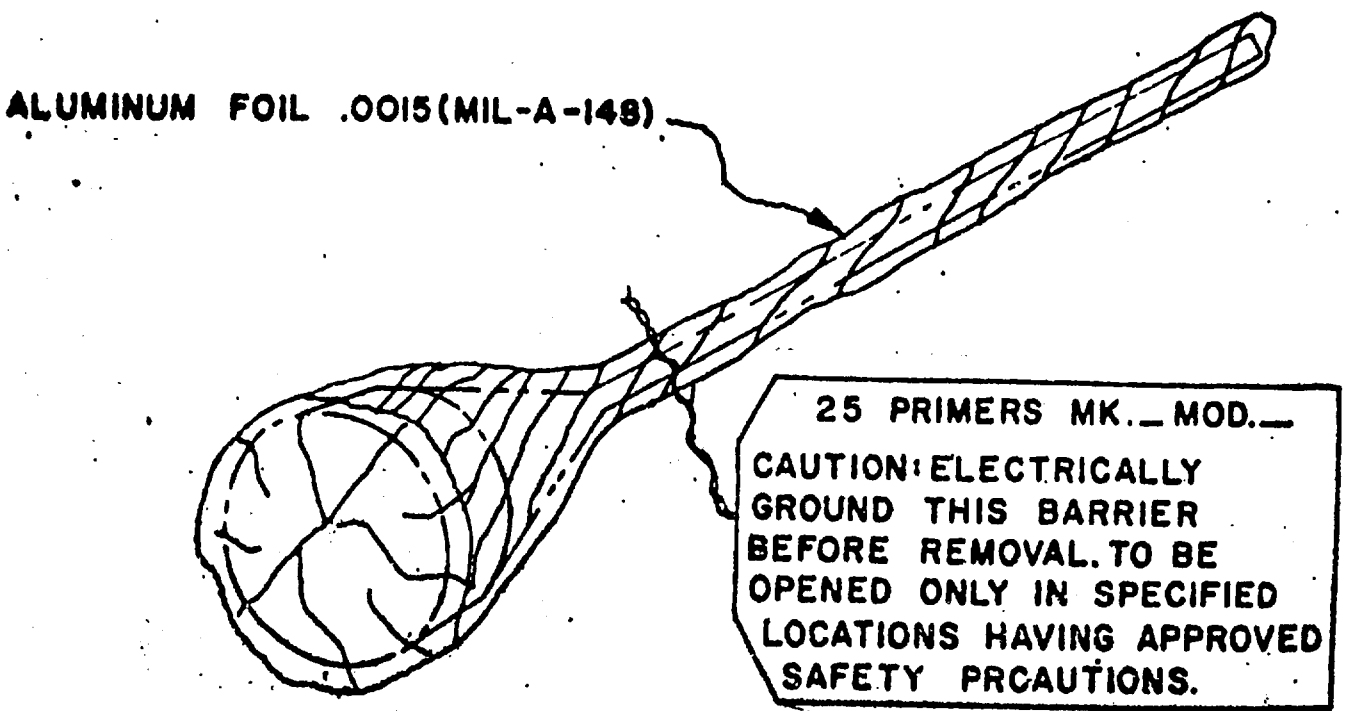

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T11:39Z
Check the source to verify that this is the current version before use.


CARTON SPECIFICATION
JAN-P-120 OR PPP-B-676

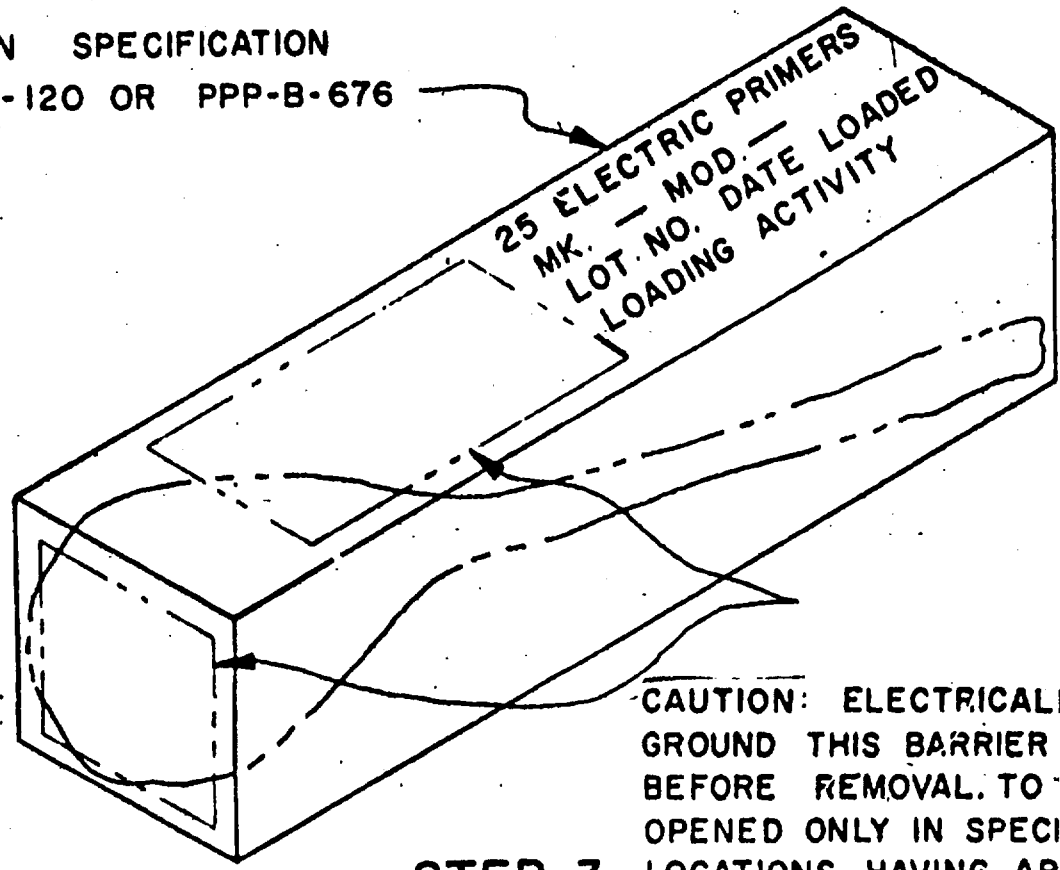

CAUTION: ELECTRICALLY GROUND THIS BARRIER BEFORE REMOVAL. TO BE OPENED ONLY IN SPECIFIED LOCATIONS HAVING APPROVED SAFETY PRECAUTIONS. (1 SIDE AND 1 END)

STEP 3

CASE LINER
JAN-P-125, TYPE 12 OR M

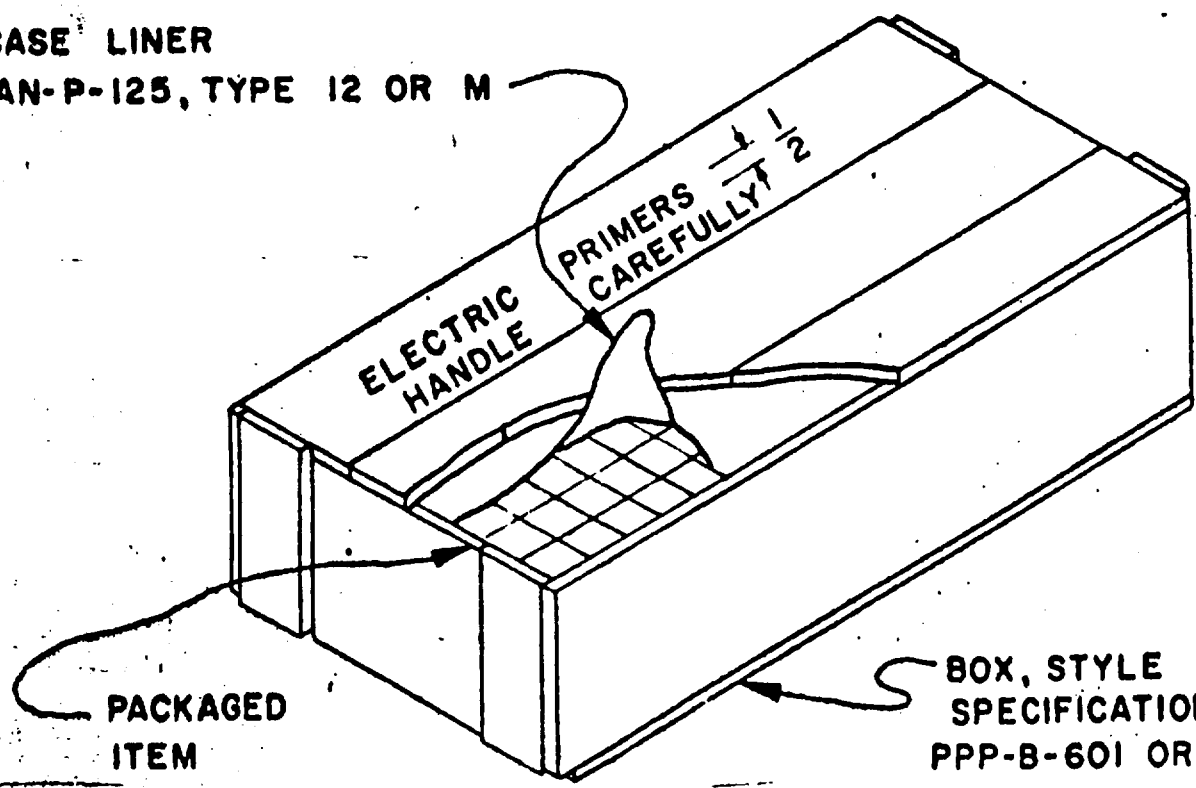

STEP 4

Source: https://assist.dla.mil -- Downloaded: 20260-18T11:39Z
Check the source to verify that this is the current version before use.