MIL-C-37186B
30 November 1976
SUPERSEDING
MIL-C-37186A (DSA-DM)
11 March 1976

MILITARY SPECIFICATION

COATS, MEDICAL ATTENDANT'S, MAN'S, WHITE, COTTON-POLYESTER, DURABLE PRESS

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirements for one type and four sizes of a durable press, cotton-polyester, white, man's, medical attendant's coat.

1.2 Classification. The coats shall be furnished in the following sizes, as specified (see 6.2):

SIZES

Small	Medium	Large	Extra Large

2. APPLICABLE DOCUMENTS

2.1 Issues of documents. The following documents of the issue in effect on date of invitation for bids or request for proposal form a part of this specification to the extent specified herein:

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Headquarters, Defense Personnel Support Center, ATTN: Directorate of Medical Materiel, Code ATT, 2800 South 20th Street, Philadelphia, Pa. 19101, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 6532

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

V-B-871	- Button, Sewing Hole, and Button, Staple, (Plastic).
V-T-280	- Thread, Cotton, Gimp, Buttonhole.
DDD-L-20	- Label, for Clothing, Equipage and Tentage, (General Use).
PPP-B-636	- Boxes, Shipping, Fiberboard.

MILITARY

MIL-T-43548	- Thread, Polyester, Cotton-covered.
MIL-T-43624	- Thread, Polyester, Spun.

STANDARDS

FEDERAL

FED-TEST METHOD STD-191	- Textile Test Methods.
FED-STD-751	- Stitches, Seams and Stitching.

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-129	- Marking for Shipment and Storage.

(Copies of specifications, standards, drawings, and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issues in effect on date of invitation for bids or request for proposal shall apply.

TECHNICAL MANUAL OF THE AMERICAN ASSOCIATION OF TEXTILE CHEMISTS AND COLORISTS (AATCC)

88B	Appearance of Seams in Wash and Wear Items After Home Laundering
124	Appearance of Durable Press Fabrics After Repeated Home Launderings

(Application for copies should be addressed to the American Association of Textile Chemists and Colorists, P.O. Box 12215, Research Triangle Park, NC 27709.)

Source: https://assist.dla.mil -- Downloaded: 202610-21T10:08Z
Check the source to verify that this is the current version before use.

COLOR ASSOCIATION OF THE UNITED STATES, INCORPORATED

TCA Cable Numbers and Colors

(Application for TCA Cabel numbers and colors should be addressed to the Color Association of the United States, Incorporated, 200 Madison Avenue, New York, NY 10016.)

(Technical society and technical association specifications and standards are generally available for reference from libraries. They are also distributed among technical groups and using Federal agencies.)

3. REQUIREMENTS

3.1 Materials and components. The materials and components shall conform to the applicable specifications and standards as listed or required herein.

3.1.1 Cloth.

3.1.1.1 Coats. The coats shall be fabricated from the untreated cloth, 3.1.1.1.1, treated with a durable press finish, 3.1.1.1.2.

3.1.1.1.1 Untreated. The untreated cloth shall be fabricated from warp and filling yarns containing a blend of polyester (polyethylene glycol terephthalate) and combed cotton. When inspected as specified in 4.3.1. and 4.3.1.1, the cloth shall conform to the requirements of table I.

TABLE I. Untreated coat cloth properties.

Characteristics	Requirements
Fiber content:	
Polyester, percent	65 ± 3
Combed cotton	Remainder
Weave	Twill $\frac{2}{1}$ or $\frac{2}{2}$
Color 1/	Non-yellowing white
Nonfibrous material, percent maximum 2/	2.0
Finish 3/	Scoured, mercerized, bleached and stabilized.

1/ The whiteness may be supplemented by an optical brightener which fluoresces in the blue band of the spectrum.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

2/ Includes chloroform and water soluble materials and starch and protein content.

3/ Sequence of finishing not mandatory.

3.1.1.1.2 Treated. The untreated cloth, 3.1.1.1.1, shall be treated with a suitable catalyzed resin system and hand modifiers resulting in a pre-cured or post-cured type durable press finish. A wetting agent may be used to facilitate the processing. The treated and cured cloth, laundered 15 times, shall conform to the requirements of table II when inspected as specified in 4.3.2 through 4.3.2.4.

TABLE II. Treated and cured coat cloth properties.

Characteristics	Requirements
Ounces per square yard, minimum	7.0
Yarns per inch, minimum:	
Warp	124
Filling	47
Breaking strength, pounds minimum:	
Warp	175
Filling	120
pH	5.0 to 8.5
Dimensional stability, percent maximum:	
Warp	3.0
Filling	2.0

3.1.1.2 Pockets, hanger and collar. The pockets, hanger and collar shall be fabricated from the treated cloth, 3.1.1.1.2.

3.1.2 Thread.

3.1.2.1 Sewing. All the sewing operations shall be performed with the cotton-covered, polyester thread conforming to MIL-T-43548, Ticket Number 70 and Ticket Number 50, 2 ply; or the spun polyester thread conforming to MIL-T-43624, Class 1 or 2, Ticket Number 70, 2 or 3 ply or Ticket Number 40, 3 ply and Ticket Number 50, 3 ply (see table III). When spun polyester thread is used, the Ticket Number 40, 3 ply and Ticket Number 50, 3 ply may be substituted for the Ticket Number 50, 2 ply; and the Ticket Number 70, 2 or 3 ply may be substituted for the Ticket Number 70, 2 ply (see table III). The color of the sewing threads shall be white.

3.1.2.2 Gimp. The gimp for reinforcing the buttonholes shall be cotton conforming to V-T-280, Type I or II, Size 8, White or Natural in color.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

3.1.3 Buttons. The buttons shall conform to V-B-871, Type II, Class K, Style 24, Size 30 line, 4 Sewing Holes, Color Pearl.

3.2 Design. The coat shall be a single breasted, straight front, three button front closure, notched lapels, one mitered left breast patch pocket with a pencil compartment, two mitered lower patch pockets, long sleeves and a two piece back. The coat shall conform in appearance to figure 1.

3.3 Construction.

3.3.1 Cutting. The coats shall be cut in strict accordance with the patterns furnished by the Government (see 6.3), which provide for seam allowance, size, shape, and placement of the pockets, buttonholes and buttons, directional lines for cutting, and notches for the proper assembling of all the parts. The directional lines shall be in the warp direction. The patterns provide a seam allowance of 1/2 inch for all the safety seams, operation numbers 4a, 7a, 8a, 9a and 10a. The Government patterns shall not be altered in any manner and shall be used for making the working patterns. The working patterns shall be identical to the Government furnished patterns. The component parts of the coat shall be cut from the same ply of the lay. The hanger may be cut from the ends. The hanger may also be prefabricated from one continuous piece of the treated and cured coat cloth and then cut to the proper length as required by operation numbers 1a or 1b. The part of each front that is to be used as the facing shall contain the selvage edge.

3.3.2 Shade and size marking. Except for those parts cut from the ends (see 3.3.1), all the component parts of the coat shall be marked or ticketed by any commercial method to insure a uniform shade throughout the coat and for the proper assembly of the coats. No metal fastening device or sewn-on ticket shall be used. The shade and size markings may be accomplished by the use of an ink pad numbering machine, rubber stamp, or pencil, provided the markings do not show through the outerside of the coats and are not deleterious to the cloth. The markings placed on the seam allowance shall not be visible on the outerside of the coats. The adhesive type shade and size marking tickets may be used for the shade and size markings, provided they conform to 3.3.2.1. The assembled coat shall not contain any shade or size marking or ticket nor any marking that was used for locating the position for attaching of any component. Drill holes, if used, shall not be visible on the surface of the coats and shall not be greater than 1/16 inch in diameter.

3.3.2.1 Adhesive shade and size marking tickets. The adhesive shade and size marking tickets shall be fabricated from paper and shall contain a thermo-activated type adhesive on one side. The adhesive shall not discolor or damage the cloth and the adhesive mass shall not adhere to the cloth, upon removal of the ticket. The heat used to attach the thermo-activated adhesive tickets shall not stiffen, scorch, or damage the cloth in any manner.

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the current version before use.

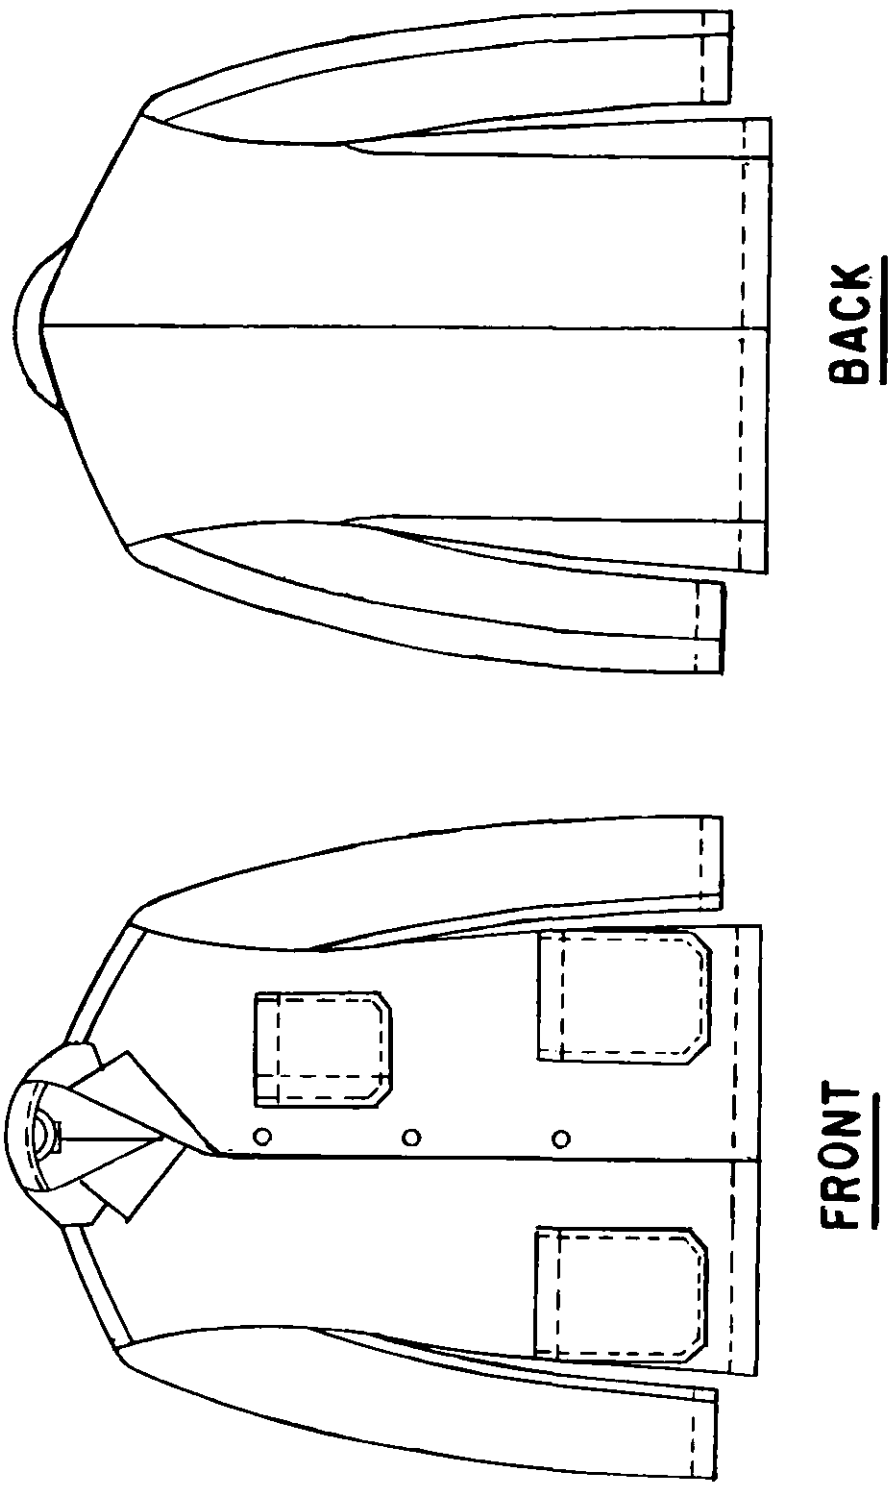


FIGURE 1. Coat, medical attendant's

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

3.3.3 Replacement of defective components and cut parts. Care shall be exercised during the spreading, cutting and manufacturing processes to assure that any component and cut part containing any defect or damage that is classified in this specification as a defect shall be replaced with a non-defective and properly matched component or cut part, as applicable.

3.3.4 Seams and stitching. All the seams and stitching used in the fabrication of the coats shall conform to table III. The seam and stitch types shall conform to FED-STD-751. When two or more seam or stitch types are specified for the same part of the operation, the contractor may select one of them for the operation. The minimum and maximum number of stitches for each operation shall conform to table III. When Stitch Type 401 is used, the looper thread shall be on the innerside of the garment. The bight of all the overedge stitching shall be 3/16 to 7/16 inch from the edge of the cloth. The seam allowances shall be maintained so that no runoff or open seam shall occur. All seams shall start and finish uniformly. No seam or component shall be twisted, puckered or pleated and no part of the coat shall be caught in an unrelated operation or seam. All the seam edges shall be properly forced out and shall not contain any folds. All the thread ends shall be trimmed to a maximum length of 1/4 inch. No cut or raw edge shall be visible on the interior or exterior of the coat.

3.3.4.1 Sewing. Each row of stitching shall be straight and parallel to the seam edge. The straightness of the stitching, in any row, shall be maintained within a tolerance of plus or minus 1/32 inch. The same tolerance for spacing and parallelism shall be applicable for the double row of stitches. The ends of the Stitch Type 301 stitching that are not caught in other seams or stitching shall be backstitched, by overlapping on themselves, a minimum of 1/2 inch. Each thread break, skip, and run-off shall be overstitched not less than 1/2 inch. Skipped stitches or thread breaks on Stitch Type 401 stitching may be repaired using Stitch Type 301. The thread tension shall be maintained so that there shall not be any loose or tight stitching and the lock shall be embedded in the materials sewn together. Attention is invited to the seaming and stitching information (precautions) contained in 6.4.

3.3.5 Manufacturing operation requirements. The coats shall be manufactured in accordance with the operation requirements specified in table III. Any additional basting or holding stitches used to facilitate the fabrication of the coats are permissible, provided the thread does not show on the surface of the assembled coat. The entire coat after assembly shall be pressed as required by operation numbers 17a and 17b and then followed, when applicable, by the curing operation number 18a.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing Operations.

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM & STITCHING TYPE	STITCHES PER INCH	THREAD	
					NEEDLE	BOBBIN OR LOOPER
1.	Form the hanger					
	a. Fold the material lengthwise so that the raw edges abut each other in the center of the material. Stitch the butted edges together with a row of stitches extending across and covering the edges of the material. The covering stitches shall be on the underside of the hanger. The hanger shall be 1/4 to 3/8 inch wide and 3 to 3-1/2 inches long (see operation numbers 11b and 11d).	406	EFh-1	8 to 10	50/2	70/2
	-OR-					
	b. Fold the material in half lengthwise. with the raw edges turned under on the inside and double stitch 3/16 to 1/4 inch apart. The size of the hanger shall be as specified in operation number 1a (see operation numbers 11b and 11d).	301	EFp-2	8 to 10	50/2	50/2
2.	Hem the pockets					
	a. Fold the top of each pocket down with the raw edge turned under and stitch to the pocket 1/16 to 1/8 inch from the turned edge of the hem. The width of the hem shall be 1-1/8 ± 1/8 inches.	301	EFb-1	8 to 10	50/2	50/2
3.	Form the collar					
	a. Fold the collar in half longitudinally so that the cut edges of the sides and bottom of the collar coincide and the face of the cloth shall be on the inner-side. The sides shall be joined together with one row of stitches located 1/4 inch from the cut edges.	301	SSa-1	8 to 10	50/2	50/2
	b. Trim the points and turn the collar inside out so that the face sides of the cloth are on the exterior of the collar. Work out the points and edges. The folded edge shall be the back edge of the collar. If desired, the collar may be pressed on the underside with a hand iron. The back folded edge may also be creased					

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing Operations. (continued)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM & STITCHING TYPE	STITCHES PER INCH	THREAD	
					NEEDLE	BOBBIN OR LOOPER
3.	Form the collar (cont'd) during the hand pressing. The assembled collar shall not contain any folds. The collar shall finish smooth and flat. The undercollar shall not be exposed beyond the edge of the top collar and the points shall be uniform in shape. c. If desired, the assembled collar may be hot head pressed as specified in operation numbers 17a and 17b, prior to being attached to the coat.					
4.	Form the sleeves					
	a. Superimpose the face of the top sleeve onto the face of the undersleeve and join together at the out and inseams.	512 515 516 517 518 or 519	SSa-2 SSa-2	8 to 10 8 to 10	50/2 50/2 (chain) and 70/2 (overedge)	50/2 70/2
	b. Upon completion of operation number 4a, joining together of the sleeve out and inseams, fold the wrist end of each sleeve down with the raw edge turned under and stitch to the sleeve 1/16 to 1/8 inch from the turned edge. The width of the hem shall be 1-1/2 + 1/8 inches. The hem shall be on the inside of the sleeve. c. The sleeve inseam and outseam, if desired, may be underpressed with a hand iron. d. Turn the sleeves right side out. The sleeve hem, if desired, may be pressed with a hand iron.	301	EFb-1	8 to 10	50/2	50/2
	-OR-					
	e. Superimpose the face of the top sleeve onto the face of the undersleeve and join together at the inseam.	512 515 516 517 518 or 519	SSa-2 SSa-2	8 to 10 8 to 10	50/2 50/2 (chain) and 70/2 (overedge)	50/2 70/2

Source: https://assist.dla.mil -- Downloaded: 202610-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing Operations. (continued)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM & STITCHING TYPE	STITCHES PER INCH	THREAD	
					NEEDLE	BOBBIN OR LOOPER
4.	Form the sleeves (cont'd)					
	f. Fold the wrist end of each sleeve down with the raw edge turned under and stitch to the sleeve 1/16 to 1/8 inch from the turned edge. The width of the hem shall be 1-1/2 ± 1/8 inches. The hem shall be on the inside of the sleeve.	301	EFb-1	8 to 10	50/2	50/2
	g. If desired, the sleeve may be hot head pressed as specified in operation numbers 17a and 17b, prior to being closed at the outseam.					
	h. Join the sleeve together at the outseam.	512 515 516 517 518 or 519	SSa-2 SSa-2	8 to 10 8 to 10	50/2 50/2 (chain) and 70/2 (overedge)	50/2 70/2
	i. Fold back the serge stitch tails at each wrist end of the outseam and secure in place with 1/2 ± 1/8 inch long horizontal bartack; or automatic line tack or bartack 1/2 ± 1/8 inch long horizontally. The bartack or tacks, as applicable, shall be centered across the outseam. The side of the bartack or tack, as applicable, shall be 1/8 to 3/16 inch from the end of the sleeve.	Bartack or 301		28 per bartack 28 per tack	50/2 50/2	50/2 50/2
	j. The outseam, if desired, may be underpressed with a hand iron, prior to being attached to the coat at the arm hole. Turn the sleeves right side out.					
5.	Attach the lower patch pockets					
	a. Position the right and left lower patch pockets on the fronts as indicated by the patterns. Turn under the raw edges of the sides and bottom for the amount specified by the patterns so that the dimensions of the attached pockets shall comply with operation number 5c. Attach the pockets to the fronts with one	301	LSd-1	8 to 10	50/2	50/2

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the currentversion before use.

TABLE III. Manufacturing Operations. (continued)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM & STITCHING TYPE	STITCHES PER INCH	THREAD	
					NEEDLE	BOBBIN OR LOOPER
5.	Attach the lower patch pockets (cont'd)					
	row of stitching 1/16 to 1/8 inch from the pocket edges. The pockets may be precreased.					
	b. Bartack each end of the pocket opening with 1/2 ± 1/8 inch long vertical bartack; or automatic line tack or back tack 1/2 ± 1/8 inch long vertically. The bartacks or tacking, as applicable, shall be superimposed on the row of the attaching stitching.	Bartack or 301		28 per bartack 28 per tack	50/2 50/2	50/2 50/2
	c. Each attached lower patch pocket, measured in the center of the pocket, shall be 7 ± 3/8 inches wide and 7-7/8 ± 3/8 inches deep.					
	d. The side of each pocket shall be parallel to the front opening within 1/4 inch.					
6.	Attach the breast patch pocket					
	a. Position the breast pocket on the left front in the position indicated by the patterns. Turn under the raw edges of the sides and bottom for the amount specified by the patterns so that the dimensions of the attached pocket shall comply with the operation number 6d. Attach the pocket to the front with one row of stitching 1/16 to 1/8 inch from the pocket edges. The pocket may be precreased.	301	LSd-1	8 to 10	50/2	50/2
	b. Form a pencil pocket by stitching through the entire depth of the pocket with one vertical row of stitches 1-3/8 ± 1/8 inches in from the right side of the pocket (the side nearest the front opening).	301	SSv-1	8 to 10	50/2	50/2
	c. Bartack each end of the pocket opening and the top of the pencil pocket stitching with 1/2 ± 1/8 inch long vertical bartack; or automatic line tack or back tack 1/2 ± 1/8 inch long vertically.	Bartack or 301		28 per bartack 28 per tack	50/2 50/2	50/2 50/2

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing Operations. (continued)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM & STITCHING TYPE	STITCHES PER INCH	THREAD	
					NEEDLE	BOBBIN OR LOOPER
6.	Attach the breast patch pocket (cont'd) The bartacks or tacking, as applicable, shall be superimposed on the attaching stitching and on the pencil pocket stitching. d. Each attached breast pocket, measured in the center of the pocket, shall be 4-3/4 ± 1/8 inches wide and 4-7/8 ± 1/8 inches deep. e. The side of the pocket shall be parallel to the front opening within 1/4 inch.					
7.	Join the backs					
	a. Join the backs together at the center of the back.	512 515 516 517 518 or 519	SSa-2 SSa-2	8 to 10 8 to 10	50/2 50/2 (chain) and 70/2 (overedge)	50/2 70/2
8.	Join the fronts to the back at the shoulders					
	a. With the front and back face to face join each front to the back at the shoulder.	512 515 516 517 518 or 519	SSa-2 SSa-2	8 to 10 8 to 10	50/2 50/2 (chain) and 70/2 (overedge)	50/2 70/2
9.	Join the fronts to the back at the sides					
	a. With the fronts and back face to face, join the fronts to the back at the sides from the bottom to the armholes.	512 515 516 517 518 or 519	SSa-2 SSa-2	8 to 10 8 to 10	50/2 50/2 (chain) and 70/2 (overedge)	50/2 70/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing Operations. (continued)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM & STITCHING TYPE	STITCHES PER INCH	THREAD	
					NEEDLE	BOBBIN OR LOOPER
10.	Attach the sleeves					
	a. Join each sleeve to their respective armhole and distribute the fullness evenly.	512 515 516 517 518 or 519	SSa-2 SSa-2	8 to 10 8 to 10	50/2 50/2 (chain) and 70/2 (overedge)	50/2 70/2
	b. If the ends of the armhole seam are staggered, the staggering shall not exceed 1/2 inch.					
11.	Attach the collar and hanger and if desired the combination label					
	a. Form the facings as specified by the patterns. With the facings and fronts face to face, position the face of the collar between them so that the cut edges coincide. With the ends of the collar uniformly from each side, join together with one row of stitches 1/4 to 3/8 inch from the edges, from the lapel point to the collar setting point. Continue stitching to a point 3/4 to one inch from the ends of the facings (see patterns). Notch the seam allowances and continue stitching the undercollar to the neck of the coat.	301 or 401 and 301	SSa-1 SSa-1 LSd-1	8 to 10 8 to 10 8 to 10	50/2 50/2 50/2	50/2 50/2 50/2
	b. Turn under the raw edge of the unattached portion of the top collar approximately 1/4 inch. Place the top end of each facing (with the cut edges of the facings turned under at each shoulder seam), the ends of the hanger and if applicable, the top of the combination label (see operation, number 15a) under the top collar and stitch to the back with the stitches 1/16 to 1/8 inch from the turned edge. The stitching shall extend beyond each shoulder seam for approximately 2 inches. The overedged shoulder seam allowance shall face the back. The stitching shall not be through the printing on the label.	301	LScf-2	8 to 10	50/2	50/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing Operations. (continued)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM & STITCHING TYPE	STITCHES PER INCH	THREAD	
					NEEDLE	BOBBIN OR LOOPER
11.	Attach the collar and hanger and if desired the combination label (cont'd)					
	c. The upper back (selvage) edge of the facing from the collar seam downward shall be attached to the coat for a length of 1-1/2 ± 1/4 inches with one row of stitches 1/16 to 1/8 inch from the back edge of the facing.	301	LSbj-1	8 to 10	50/2	50/2
	d. The hanger shall be attached so that the inside dimension of the loop formed shall be 1-1/2 to 1-3/4 inches. The hanger shall be located in the center of the back within 1/2 inch. The hanger shall be on top of the label.					
	e. The difference between the length of the collar points and the difference between the sides of the collar at the point of attachment to the front opening edges shall be equal within 1/4 inch. The collar shall be located in the center of the coat within 1/2 inch.					
12.	Hem the bottom of the coat					
	a. Fold under the bottom of the coat with the raw edges turned under to form a hem 3/4 ± 1/8 inch wide. The stitching shall be 1/16 to 1/8 inch from the turned edge. The facing shall be smooth, flat and under the hem.	301	EFb-1	8 to 10	50/2	50/2
13.	Make the buttonholes					
	a. The buttonholes shall be 7/8 to one inch cut length eyelet end taper-bar type or eyelet end square-bar type, worked over gimp with the ends tacked or bartacked. The purling shall be on the outerside of the coat. The bar at the end shall have a minimum of 4 tacks in addition to the cross over stitch which shall be considered part of the buttonhole stitching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing Operations. (continued)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM & STITCHING TYPE	STITCHES PER INCH	THREAD	
					NEEDLE	BOBBIN OR LOOPER
13.	Make the buttonholes (cont'd)					
	b. Mark or gage 3 buttonholes on the left front of the coat as specified by the patterns. The inside edge of the eyelet shall be 5/8 ± 1/8 inch from the edge.	Button-hole		48 to 54 per button-hole including the tack	50/2	50/2
14.	Attach the buttons					
	a. Securely attach the 3 buttons on the right exterior side of the front opening in such a manner that they shall align and mate with the buttonholes without causing any distortion, twisting or puckering of the fronts. The center of the buttons shall be 3/4 ± 1/8 inch from the front edge.	301		14 to 16 per button	50/2	50/2
		or 101		14 to 16 per button	50/2	50/2
15.	Attach the combination label					
	a. Position the combination label on the center of the back, on the innerside of the garment, within 1/2 inch, with the top of the label not more than 1/4 inch below the edge of the collar. Attach the label on all four sides. If desired, the top edge of the combination label may be caught in the collar attaching seam (see operation number 11b). Attach the remaining three sides.	301	LSbj-1	8 to 10	50/2	50/2
16.	Trim all thread ends and remove all thread scraps and foreign matter.					
17.	Press the coats					
	a. Pressing of the coats shall only be performed upon the completion of all the sewing operations. Pressing of individual cut parts during manufacturing shall be unacceptable, except for operation numbers 3b, 3c, and 4c, 4d, 4g and 4j. Use of any pressing equipment, other than that specified in 17b shall be unacceptable, except for operation numbers 3b, 4c, 4d and 4j.					

Source: https://assist.dla.mil -- Downloaded: 202610-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE III. Manufacturing Operations. (continued)

NO.	MANUFACTURING OPERATIONS REQUIREMENTS	STITCH TYPE	SEAM & STITCHING TYPE	STITCHES PER INCH	THREAD	
					NEEDLE	BOBBIN OR LOOPER
17.	Press the coats (cont'd) b. The entire assembled coat shall be hot head pressed. The sleeves and lapels shall be pressed but not creased. The collar and sleeve inseam and outseam may be underpressed with a hand iron (see operation numbers 3b, 3c, 4c, 4d, and 4j). The hot head press used shall be capable of controlling the temperature, pressure and dwell time. The pressure, temperature and dwell time shall be adequate to obtain the desired results. It is suggested that the supplier of the cloth be contacted for information concerning the aforementioned for the optimum conditions.					
18.	Curing (post-cured only) a. Upon completion of operation number 17b, pressing of the coats, each pressed coat shall be individually suspended on a hanger with all the buttons mated with their respective buttonholes. The coat shall be buttoned (all buttons). The buttoned coat shall be subjected to dry oven heat. The temperature and curing time shall be adequate to obtain the required results. It is suggested that the supplier of the cloth be contacted for information concerning the aforementioned for the optimum conditions. The curing operation shall be applicable only when the coats are fabricated from post-cured cloth. After curing, the coats shall remain suspended by the hangers until they reach equillibrium at room temperature.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

3.4 Dimensions. The coats after assembly shall conform to the dimensions for the different sizes specified in table IV when measured as specified in 4.3.6. The variation in length between the left and right sleeve dimensions shall not exceed 1/2 inch in any coat.

TABLE IV. Coat dimensions in inches.

Location	SIZE				Tolerance
	Small	Medium	Large	Extra Large	
Chest	21	23	25	26-1/2	± 1/2
Sleeve Inseam	17-3/4	18	18-1/4	18-1/2	± 1/2
Back Length	30	30-1/2	31	31-1/2	± 1/2

3.5 Performance inspection.

3.5.1 Cloth, seam and hem appearance. The rating of the cloth, seam and hem appearance of the assembled, pressed and cured coat, when inspected as specified in 4.3.7 through 4.3.7.2 shall conform to the following:

LOCATION	MINIMUM AVERAGE RATING PER COAT
CLOTH APPEARANCE	3.5
SEAM APPEARANCE:	
ALL THE SEAMS AND HEMS INCLUDING THE FRONTS, SLEEVES, POCKETS AND BOTTOM HEM	3.5

3.6 Label. The combination identification and washing information label for each coat shall conform to DDD-L-20, type I, class 1 and 3, Launderable Label, except that the color of the label shall be one of the following colors for the appropriate coat size:

COLOR	TCA CABLE NUMBER	COAT SIZE
Peach Blossom	70098	Small
Lemon Yellow	70205	Medium
Indian Orange	70072	Large
Primitive Green	70167	Extra Large

When inspected as specified in 4.3.3.1, the color of the label shall approximately match the crepe side of the applicable TCA Cable Number. The color of the label shall be obtained with vat or naphthol dyes and shall show at least "good" colorfastness to laundering transference and at least "fair" colorfastness to accelerated laundering. The color of the printing medium shall be black. The size of the label shall be adequate to contain the following information:

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

COAT, MEDICAL ATTENDANT'S, MAN'S, WHITE
COTTON-POLYESTER, DURABLE PRESS
MIL-C-37186B
SIZE
CONTRACT OR ORDER NUMBER
NSN
WOOL OR FIBER PRODUCTS ACT INFORMATION

The above information shall be on the left side of the label (right side of the coat when worn) adjacent and separated from the washing information by a vertical line approximately 1/16 inch wide. The washing information shall be as follows:

WASHING INFORMATION

1. For machine washing, use wash and wear cycle or durable press cycle. Wash with moderately hot water (140°F), using soap or mild detergent.

2. For hand washing, wash in moderately hot water as described above. DO NOT WRING OR TWIST.

3. Dry in tumble dryer at hot setting. Remove immediately at end of drying. Shape and hang.

4. To drip dry, remove from water before last spin cycle. Shape and hang.

5. If touching up is required, iron at a moderate heat setting.

DO NOT REMOVE THIS LABEL

3.6.1 Alternate. An alternate combination identification and washing information label fabricated from cotton coutril or poplin cloth having a greige weight of 2.11 yards per pound (45 inch width) may be used in lieu of the label specified in 3.6. The printing medium and printing shall conform to DDD-L-20, type I, class 1 and 3, Lauderable Label. The color and colorfastness of the label shall be as specified in 3.6. The label shall contain the same information as specified in 3.6.

3.7 Workmanship. The coats shall not contain any spot, stain, hole, abraded area, tear, cut, mend, patch, scorch, needle chew or any other defect which detracts from the appearance or may impair its serviceability. The coats shall conform to the quality and grade established by this specification. The occurence of defects shall not exceed the acceptance criteria established herein.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the insepction requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Material and component inspection. In accordance with 4.1, the materials and components shall be inspected and tested in accordance with all the requirements of the referenced specifications and standards, unless otherwise excluded, amended, modified, or qualified in this specification or purchase document.

4.1.2 Certificates of quality. When certificates of quality are submitted in accordance with table V, they shall contain verfiable actual test and inspection data. The Government reserves the right to inspect and test the components to verify the validity of the certification.

4.1.3 Inspection. Inspection, as used in this specification, is defined as both examination (an investigation without the use of special laboratory apparatus or procedures such as visual) and testing (a determination by technical means of the physical and chemical properties) of the item.

4.2 Quality conformance inspection. The sampling and inspection shall conform to MIL-STD-105, except where otherwise indicated hereinafter. The quality conformance inspection shall consist of the tests and examinations specified in table V.

4.2.1 Sampling.

4.2.1.1 Inspection lot.

4.2.1.1.1 Treated coat cloth. An inspection lot size shall be expressed in units of one linear yard of the pre-cured or post-cured treated coat cloth, as applicable, and shall consist of all the treated coat cloth received by the coat manufacturer at one time. The sample unit for inspection shall be four linear yards of the treated coat cloth pre-cured or post-cured, as applicable. If the cloth contains a post-cured type finish, the cloth shall be cured in the same manner as the assembled coats, prior to the cloth being inspected for its chemical and physical characteristics (see 4.3.2 through 4.3.2.4).

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the currentversion before use.

4.2.1.1.2 Labels. An inspection lot size shall be expressed in units of one label and shall consist of all the labels received by the coat manufacturer at one time. The sample unit for inspection shall be one label.

4.2.1.1.3 Alternate label cloth. An inspection lot size shall be expressed in units of one linear yard of the alternate label cloth and shall consist of all the alternate label cloth received by the coat manufacturer at one time. The sample unit for inspection shall be one linear yard of the alternate label cloth.

4.2.1.1.4 Coats. An inspection lot size shall be expressed in units of one coat made essentially under the same conditions and from the same materials and components. The sample unit for inspection shall be one coat.

4.2.1.2 Sampling for tests and examinations of the untreated and treated and cured coat cloth, labels, alternate label cloth and coats. The sample size, acceptance criteria, tests and examinations required for the untreated and treated and cured coat cloth, labels, alternate label cloth and coats, as applicable, shall be specified in table V.

TABLE V. Sample size, acceptance criteria, tests, and examinations for the untreated and treated and cured coat cloths, labels, alternate label cloth and coats.

Item	Inspection	Paragraph		Sample size	Acceptance Criteria	
		Requirement	Method			
Untreated coat cloth 1/	Fiber identificaton:					
	Polyester	3.1.1.1.1	4.3.1.1	2/	2/	4/
	Cotton	3.1.1.1.1	4.3.1	2/	2/	4/
	Fiber content:					
	Polyester	3.1.1.1.1	4.3.1.1	2/	2/	4/
	Cotton	3.1.1.1.1	4.3.1.1	2/	2/	4/
	Weave	3.1.1.1.1	Visual	2/	2/	4/
	Color	3.1.1.1.1	Visual	2/	2/	4/
	Nonfibrous material	3.1.1.1.1	4.3.1	2/	2/	4/
	Finish	3.1.1.1.1	4/	2/	2/	4/

Source: https://assist.dla.mil -- Downloaded: 202610-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE V. Sample size, acceptance criteria, tests, and examinations for the untreated and treated and cured coat cloths, labels, alternate label cloth and coats. (continued)

Item	Inspection	Paragraph		Sample size	Acceptance Criteria	
		Requirement	Method			
Treated and cured coat cloth 1/	Weight	3.1.1.1.2	4.3.2.2	2/	2/	
	Yarns per inch	3.1.1.1.2	4.3.2.2	2/	2/	
	Breaking strength	3.1.1.1.2	4.3.2.2	2/	2/	
	pH	3.1.1.1.2	4.3.2.4	2/	2/	
	Dimensional stability	3.1.1.1.2	4.3.2.3	2/	2/	
Labels 1/	Color comparison 5/	3.6	4.3.3.1	3/	3/	4/
Alternate label cloth 1/	Cotton identification	3.6.1	4.3.4	2/	2/	4/
	Weight	3.6.1	4.3.4	2/	2/	4/
	Kind of cloth	3.6.1	4.3.4.1	2/	2/	4/
Coats	Visual examination	3.2 through 3.3.5 and 3.6 through 3.7	4.3.5.1	Inspection Level II	An acceptable quality level of 2.5 defects per 100 units for Major defects and 10.0 defects per 100 units for total (Major plus Minor) defects	
	Dimensional check	3.4	4.3.5.1	Inspection Level S-3	An acceptable quality level of 4.0 defects per 100 units	
	Cloth, seam and hem appearance	3.5.1	4.3.7 through 4.3.7.2	6/	6/	

Source: https://assist.dla.mil -- Downloaded: 202610-21T10:08Z
Check the source to verify that this is the current version before use.

1/ The inspection of the untreated coat cloth, treated and cured coat cloth, labels, and alternate label cloth, as applicable, shall be conducted either at the contractor's or subcontractor's plant.

2/ The sampling for the testing of the untreated coat cloth, the treated and cured coat cloth and the alternate label cloth shall be in accordance with 4.2.1.1.1 and 4.2.1.1.3, as applicable, and as follows:

Lot Size (Yards)	Sample Size
800 or less	2
801 up to and including 22,000	3
22,001 and over	5

The samples shall be taken from the beginning of each roll. The lot shall be unacceptable if one or more sample units fail to meet any of the requirements specified in table V. Each sample unit taken for inspection shall be used to determine all the characteristics of the untreated coat cloth, treated and cured coat cloth and alternate label cloth specified in table V. The sample unit for the untreated coat cloth shall be 1/2 linear yard.

3/ The sampling for the testing of the labels shall be in accordance with 4.2.1.1.2 and as follows:

Lot Size (Number of Labels)	Sample Size
800 or less	2
801 up to and including 22,000	3
22,001 and over	5

The lot shall be unacceptable if one or more of the sample units fail to meet the color comparison requirement.

4/ A certificate of quality may be submitted for the stated requirement (see 4.1.2).

5/ This inspection is applicable to all the kinds of labels.

6/ The sampling for the testing of the pressed, cured and assembled coat for cloth, seam and hem appearance shall be in accordance with 4.2.1.1.4 and as follows:

Lot Size (Number of coats)	Sample Size
800 or less	2
801 up to and including 22,000	3
22,001 and over	5

The lot shall be unacceptable if one or more of the sample units fail to meet the requirements for cloth, seam and hem appearance.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

4.3 Inspection methods.

4.3.1 Untreated coat cloth. The untreated coat cloth characteristics shall be determined in accordance with the inspection methods of FED-TEST METHOD STD-191 specified in table VI and 4.3.1.1.

TABLE VI. Untreated coat cloth properties.

Characteristics	FED-TEST METHOD STD-191 Method
Cotton identification	1200
Nonfibrous material	2611

4.3.1.1 Polyester identification and fiber content. The polyester identification and fiber content shall be determined by any standard commercial method.

4.3.2 Treated and cured coat cloth. Prior to determining the weight, yarns per inch and breaking strength characteristics of the treated and cured coat cloth (see 4.3.2.2), the treated and cured coat cloth (see 4.2.1.1.1) shall be laundered and dried for 15 times as specified in 4.3.2.1 through 4.3.2.1.2. The dimensional stability characteristics shall be determined on specimens of the treated and cured coat cloth prepared and then laundered for 15 times as specified in 4.3.2.3. The pH characteristic shall be determined on the treated and cured coat cloth in the cured condition, prior to laundering (see 4.3.2.4).

4.3.2.1 Laundering and drying.

4.3.2.1.1 Apparatus, detergent and ballast. The apparatus, detergent and ballast to be used in the laundering procedure shall be as follows:

a. Kenmore Automatic Washing Machine Model 600 or equivalent. In the event of a dispute, the Kenmore Automatic Washing Machine Model 600 shall be used.
b. Kenmore Automatic Dryer Model 600 or equivalent.
c. AATCC Standard Detergent 124 or equivalent.
d. Ballast consisting of 36 by 36 inches of hemmed Type 128 cotton sheeting shall be added to the inspection samples, if necessary, to make up a four pound load.

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the current version before use.

4.3.2.1.2 Procedure. The inspection samples, and when necessary, the ballast to make up a four pound load, shall be placed in the washing machine. The washer shall be set for the high water level, hot water temperature and a 12 minute wash on the "Normal" cycle. The water used shall have a maximum hardness of 50 parts per million. The temperature of the water shall be 140° ± 5° Fahrenheit (F.) (60° ± 2.7° Centigrade (C.)). Fill the washer to the high water level and add 140 ± 1 grams of the detergent. When the washer has completed the final spin cycle, remove the inspection samples and ballast immediately and if tangled, separate them from each other. Then place the washed inspection samples and ballast in the dryer. Dry at the "Normal" cycle and at a setting which shall generate an exhaust temperature of 140° to 160° F. (60° to 71.1° C.). The dryer shall be operated until the washed inspection samples and ballast are dried. Then for a cooling down cycle continue to operate the dryer without any heat for an additional 5 minutes. Upon completion of the cooling down cycle, remove the inspection samples and ballast immediately and repeat the washing and drying cycles until a total of 15 washings and dryings have been completed. Upon completion of the 15th washing and drying cycle, the inspection samples shall be conditioned to equilibrium under standard atmospheric conditions as specified in FED-TEST METHOD STD-191.

4.3.2.2 Weight, yarns per inch and breaking strength. The weight, yarns per inch and breaking strength of the treated and cured coat cloth after being laundered and dried for 15 times and conditioned to equilibrium as specified in 4.3.2.1 through 4.3.2.1.2 shall be determined in accordance with the inspection methods of FED-TEST METHOD STD-191 specified in table VII.

TABLE VII. Treated, cured, laundered and dried coat cloth properties.

Characteristics	FED-TEST METHOD STD-191 METHOD
Weight	5041
Yarns per inch	5050
Breaking strength	5100

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the current version before use.

4.3.2.3 Dimensional stability. Three specimens, 22 by 22 inches, measured parallel to the warp and filling, shall be cut from each treated and cured coat cloth inspection sample. If necessary, the specimens shall be pressed flat. Two specimens shall be cut from the sides of each sample unit, one from each side within three inches from each selvage edge. The third specimen shall be cut from the center of each inspection sample. No two specimens shall contain the same filling yarns. The specimens shall be conditioned to equilibrium under standard atmospheric conditions as specified in FED-TEST METHOD STD-191. The conditioned specimens shall be laid flat, without tension, on a smooth flat surface and shall be free from any wrinkles and creases. Three distances, each a minimum of 18 inches, shall be measured and marked parallel to the warp and filling directions of each specimen. Each pair of markings shall be a minimum of 6 inches apart and within one inch from any edge of the specimen. The beginning and ending of each 18 inch distance may be marked with a fine pointed pen or stamping used indelible ink or by sewing fine threads into the specimen. The measured distances shall be parallel to the respective yarns. The marked specimens shall be laundered and dried for 15 times and conditioned to equilibrium as specified in 4.3.2.1 through 4.3.2.1.2. After being conditioned to equilibrium, the specimens shall be measured to determine the dimensional stability. The dimensional stability for each specimen shall be calculated as follows:

$$\text{Dimensional change, percent} = \frac{A - B}{A} \times 100$$

A = Average of the 3 initial measurements in the warp or filling direction, as applicable, per specimen.
B = Average of the 3 measurements after laundering, drying and conditioning in the warp or filling direction, as applicable, per specimen.

The dimensional change of each sample unit shall be the average of the warp or filling directions, as applicable, of the 3 specimens inspected. The dimensional change shall be reported to the nearest 0.1 percent for each direction. The individual results used to calculate the average shall also be reported.

4.3.2.4 pH. The pH valve of the water extract of the treated and cured coat cloth shall be determined in accordance with FED-TEST METHOD STD-191, Method 2811.

4.3.3 Labels. The color comparison characteristic which is applicable to all the kinds of labels shall be determined in accordance with 4.3.3.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

4.3.3.1 Color matching. The color of the labels shall be compared to the crepe side of the approved shade under natural (north sky) daylight or artificial daylight having a color temperature of 7500° Kelvin.

4.3.4 Alternate label cloth. The characteristics of the alternate label cloth shall be determined in accordance with the inspection methods of FED-TEST METHOD STD-191 specified in table VIII and 4.3.4.1.

TABLE VIII. Alternate label cloth properties.

Characteristics	FED-TEST METHOD STD-191 METHOD
Cotton identification	1200
Weight	5041

4.3.4.1 Kind of alternate label cloth. The kind of cloth used for the alternate label cloth shall be determined by any standard commercial method.

4.3.5 Visual examination.

4.3.5.1 Coats. Each coat selected in accordance with table V as a sample unit from the lot shall be thoroughly checked dimensionally and examined visually to determine conformance to this specification. The classification and lists of defects, tables IX and X, as applicable, shall be used to classify and enumerate the defects found.

TABLE IX. Classification of defects for the visual examination of the assembled coats.

DEFECT	MAJOR	MINOR
GENERAL		
a. Any hole (except drill holes), scissors or knife cut, tear, mend, burn, or weakening defect such as smash, multiple float, loose slub, needle chew, or abraded area on the outerside of the coat.	X	
b. Any hole (except drill holes), scissors or knife cut, tear, mend, burn, or weakening defect such as smash, multiple float, loose slub, needle chew, or abraded area on the innerside of the coat.		X

Source: https://assist.dla.mil -- Downloaded: 202610-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE IX. Classification of defects for the visual examination of the assembled coats. (cont'd)

DEFECT	MAJOR	MINOR
GENERAL (cont'd)		
c. Any drill hole visible on the outerside of the coat or greater than 1/16 inch diameter when visible on the innerside of the coat.		X
d. Any portion of the coat stiffened or scorched by any process of manufacturing.	X	
e. Any missing, broken or coarse yarn, thin place, misweave, woven in waste, loose yarn, or snagged thread.	1/	
f. Any permanent crease in the coat visible on the outerside of the coat.	1/	
SHADED PARTS		
a. Any part shaded or any shade bar.		X
b. Color of any component not as specified or not uniform.		X
CLEANNESS		
a. Three or more thread ends not trimmed to a maximum length of 1/4 inch or three or more thread scraps not removed.		X
b. Any unsightly slub, spot, or stain; any discoloration of the cloth caused by the removal of any shade and size marking ticket; any shade and size marking ticket, excluding the metal fastening or sewn-on kind, not removed; any shade and size marking identification stamping visible on the outerside of the coat; or any shade and size marking adhesive mass adhering to the cloth.		X
c. Any metal fastening device or sewn-on shade and size marking ticket attached to the coat.	X	
d. Any shade or size marking or any marking used for locating the position for attaching any component visible on the top or underside of the coat.		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE IX. Classification of defects for the visual examination of the assembled coats. (cont'd)

DEFECT	MAJOR	MINOR
COMPONENTS AND ASSEMBLY		
a. Any component not as specified or any defect of a component or defect of assembly, not herein classified.	1/	
b. Any component, component part, or required operation omitted, or any operation improperly performed, not herein classified.	1/	
c. Any component part not cut in accordance with the patterns (see 3.3.1), not herein classified.	1/	
d. Any dimension not as specified, not herein classified.	1/	
SEAMS AND STITCHING		
a. Accuracy of seaming:		
1. Any seam, hem, or attachment of any component twisted, puckered, or pleated; any part of the coat or of any component caught in an unrelated operation or stitching; any seam edge not properly forced out or contains any fold.		X
2. Ends of stitching that are not caught in other seams or stitching:		
(a) Any not securely backstitched.	X	
(b) Any secure but backstitched for a distance less than 1/2 inch or the backstitching is not overlapped on itself.		X
3. Thread breaks:		
(a) Any not securely overstitched.	X	
(b) Any secure but overstitched for a distance less than 1/2 inch.		X
4. Ends of any armhole seam, at the side seam, staggered by more than 1/2 inch.		X
b. Gage of stitching 2/:		
1. Any stitching irregular, uneven, not gaged as specified, or not uniform.		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE IX. Classification of defects for the visual examination of the assembled coats. (cont'd)

DEFECT	MAJOR	MINOR
SEAMS AND STITCHING (cont'd)		
c. Open seams 3/:		
1. Other than on any hem:		
(a) Any more than 1/8 inch but not more than 1/4 inch.		X
(b) Any more than 1/4 inch.	X	
2. On any hem:		
(a) Any more than 1/4 inch but not more than 1/2 inch.		X
(b) Any more than 1/2 inch.	X	
d. Raw edges 4/:		
1. Outerside or innerside of the coat:		
(a) Any more than 1/4 inch but not more than 1/2 inch.		X
(b) Any more than 1/2 inch.	X	
e. Seam and stitch type:		
1. Not specified seam or stitch.	1/ X	
2. Any looper thread on the outerside of any coat seam when Stitch Type 401 is used.		
f. Stitch tension:		
1. Any loose stitching. 5/	1/ X	
2. Any tight stitching resulting in breakage of the stitches when normal pull is applied. 6/		
g. Stitches per inch 7/:		
1. Stitches more or less than specified:		
(a) Coat (excluding label):		
(1) One		X
(2) More than one	X	

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE IX. Classification of defects for the visual examination of the assembled coats. (cont'd)

DEFECT	MAJOR	MINOR
SEAMS AND STITCHING (cont'd)		
(b) Label:		
(1) One or 2		X
(2) More than 2	X	
h. Bartacks or tacks:		
1. Any missing, loose, misplaced, or not serving the intended purpose.	X	
2. Length of any not as specified.	1/	
3. Any not located as specified.	1/	
i. Buttonholes:		
1. One or more omitted or added.	X	
2. Stitching on one or more buttonholes not caught in the cloth, causing the stitching to pull away from the cloth.	X	
3. Any cut length less than 7/8 inch or more than one inch.	X	
4. One or more broken stitches or more than two skipped stitches in one or more buttonholes.	X	
5. Any buttonhole less than 1/2 inch or more than 3/4 inch from the front edge measured from the inside of the eyelet.	1/	
6. Any gimp omitted on one or more buttonholes or ends of the gimp not pulled through to the underside.	X	
7. Any finished with the purling on the inside.		X
8. Any with ragged edges.		X
9. Any uncut or not as specified.	1/	
10. Any end not securely tacked in one or more buttonholes.	X	
11. Any bar at the end having less than 4 tacks (do not count the first cross-over stitch as it is part of the buttonhole and not the bar).		X

Source: https://assist.dla.mil -- Downloaded: 20261021T10:08Z
Check the source to verify that this is the current version before use.

TABLE IX. Classification of defects for the visual examination of the assembled coats. (cont'd)

DEFECT	MAJOR	MINOR
SEAMS AND STITCHING (cont'd)		
j. Buttons:		
1. Any missing, loose, broken or not attached as specified.	X	
2. Any not specified type, size or color.	X	
3. Any improperly positioned so that the coat does not button properly causing puckering or twisting to the fronts.	X	
4. Stitching on one or more buttons not locked at the end of the cycle. 8/	X	
DETAILED DEFECTS APPLICABLE TO SPECIFIC PARTS OF THE COAT		
COLLAR		
a. Top collar or undercollar twisted; any color edge curled; or any collar end not securely tacked to the coat.	X	
b. Any edge crooked, undercollar edge exposed or any point not uniform in shape.	X	
c. Off center:		
1. More than 1/4 inch but not more than 1/2 inch.		X
2. More than 1/2 inch.	X	
d. Points uneven in length by more than 1/4 inch.	X	
e. The differences between the sides of the collar at the point of attachment to the front opening edge greater than 1/4 inch.	X	
LAPELS		
a. Any twisted or not uniformly shaped.	1/	
b. Lapel step uneven in length by more than 3/8 inch.	X	
c. Any lapel creased by pressing.	X	
HANGER		
a. Any end not securely caught in the collar seam stitching.		X
b. Misplaced, off center of the back by more than 1/2 inch.		X
c. Loop formed less than 1-1/2 inches or more than 1-3/4 inches.		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

TABLE IX. Classification of defects for the visual examination of the assembled coats. (cont'd)

DEFECT	MAJOR	MINOR
FRONT OPENING		
a. Fronts uneven in length at the bottom when the coat is buttoned (all buttons):		
1. More than 3/8 inch but not more than 3/4 inch.		X
2. More than 3/4 inch.	X	
b. Left or right front at bottom not straight design.	X	
c. Any facing short, tight, or twisted causing puckering or twisting to any front or lapel.	X	
POCKETS		
a. Any pocket out of horizontal or vertical alignment:		
1. More than 3/8 inch but not more than 1/2 inch.		X
2. More than 1/2 inch.	X	
b. Any not of uniform size and shape or the bottom of any pocket not mitered.		X
c. The side of any pocket not parallel to the front opening by more than 1/4 inch.	X	
d. The width of the breast pocket less than 4-5/8 inches or greater than 4-7/8 inches.		X
e. The depth of the breast pocket less than 4-3/4 inches or more than 5 inches.		X
f. The width of the pencil pocket in the breast pocket less than 1-1/4 inches or more than 1-1/2 inches.		X
g. The width of any lower pocket less than 6-5/8 inches or more than 7-3/8 inches.		X
h. The depth of any lower pocket less than 7-1/2 inches or greater than 8-1/4 inches.		X
i. The width of the hem on any pocket less than one inch or more than 1-1/4 inches.		X
j. The top of any pocket sewn partially or completely closed.	X	
k. Any hem varying in umiformity of the width by more than 1/4 inch.	X	

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the currenversion before use.

TABLE IX. Classification of defects for the visual examination of the assembled coats. (cont'd)

DEFECT	MAJOR	MINOR
SLEEVES		
a. Right sleeve in the left armhole or left sleeve in the right armhole or any sleeve, in its proper armhole, installed in a reverse position.	X	
b. Any pleated at any armhole seam or any tight at any armhole seam causing puckers on any front or back.		X
c. The width of any sleeve hem less than 3/8 inches or greater than 5/8 inches.		X
d. Any hem varying in uniformity of the width by more than 1/4 inch.		X
BOTTOM HEM		
a. Varies in uniformity of the width by more than 1/4 inch.		X
b. Width of the bottom hem less than 5/8 inch or more than 7/8 inch.		X
LABEL		
a. Size missing, incorrect, or illegible or color of the label is not as specified.	X	
b. Other than the size information or color, identification information incomplete, incorrect, or illegible.		X
c. Misplaced, off center of the back by more than 1/2 inch.		X
d. Stitching omitted on one or more edges.		X
e. Any washing information missing, incorrect, incomplete, or illegible.	X	
f. Not located as specified.		X
PRESSING		
a. Any portion of the coat stiffened or scorched by pressing.	X	
b. Pressing omitted.	X	
c. Any coat improperly pressed.	1/	

1/ The defect shall be classified as scored as a major defect when it seriously affects the serviceability or appearance, otherwise it shall be classified and scored as a minor defect.

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the current version before use.

2/ The gage of stitching defect shall be scored only when the condition exists for more than 2 inches on any row of stitching.

3/ A seam shall be classified and scored as open when one or more stitches joining a seam are broken or when two or more continuous skipped stitches or run-offs occur. On double stitched seams, a seam shall be classified and scored as open when either one or both sides of the seam contain any of the aforementioned for a single stitched seam.

4/ Any edge that should be turned under and is not but is securely caught in the stitching shall be classified and scored as a raw edge. Any raw edge that is not securely caught in the stitching shall be classified and scored as an open seam.

5/ A seam shall be classified and scored as loose when the top and bobbin threads are on the same surface.

6/ Puckering is evidence of tight tension or gathering of the material. When puckering is evident and is not caused by the gathering of the material, the stitching shall be inspected for tight tension and breaking of stitches by exerting normal pull in the lengthwise direction of the stitching by pulling the material taut to straighten out the seam. Puckering due to the gathering of the material shall be classified and scored as an accuracy of seaming defect.

7/ The stitches per inch defect shall be scored only when the condition exists for more than 3 inches on any row of stitching.

8/ To determine if the stitching on the buttons is locked at the end of the cycle, pull the loose end of the thread when accessible to determine if the stitching will ravel.

TABLE X. List of defects for the dimensions of the assembled coats.

Assembled Measurement	Defect
Measure the chest, sleeve inseam and back length.	Any measurement deviating from the measurements specified in 3.4 and table IV and applicable tolerance shall be enumerated as a dimensional defect.
Equal Length Sleeves	The variation in length between the left and right sleeve dimension shall be enumerated as a dimensional defect when it exceeds 1/2 inch.

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the currentversion before use.

4.3.5.2 Packaging inspection. The inspection of the unit package, packing and marking for shipment and storage shall be in accordance with quality assurance provisions of the applicable container specification and marking requirements of MIL-STD-129.

4.3.6 Procedure for measuring. The coat to be measured shall be buttoned (all buttons), laid flat, without tension, on a smooth, flat surface so that any wrinkles or creases shall not affect the measurement. Unless otherwise specified, the measurements shall be made with the garment face up and with the use of any suitable measuring device. The measurements shall be made as follows:

a. The chest dimension shall be taken at the base of the armholes from the side folded edge to the side folded edge.

b. The sleeve inseam measurement shall be taken from the armhole to the end of the sleeve along the inseam.

c. The back length shall be determined on the back of the garment at the center of the back from the collar attaching seam to the bottom of the coat.

4.3.7 Cloth, seam and hem appearance.

4.3.7.1 Laundering procedure. The coat or coats, as applicable, shall be laundered and dried for five times as specified in 4.3.2.1 through 4.3.2.1.2. During any interruption of the laundering and drying cycles, each coat shall be individually hung on a wooden or plastic hanger, buttoned (all buttons) and suspended on a rack, line, rod or something similar. Upon completion of the fifth cycle, each coat shall be similarly hung, suspended and conditioned for two hours under standard atmospheric conditions as specified in FED-TEST METHOD STD-191, prior to evaluation.

4.3.7.2 Evaluation. Each laundered, dried and conditioned coat shall be evaluated by three trained observers, independent of each other, for cloth, seam and hem appearance. The evaluation shall be conducted in a room containing overhead lights conforming to AATCC Test Method 124. The evaluation shall be conducted in a room where the only source of light shall be that used for the observations. To eliminate and prevent light reflections and glare that shall interfere with the evaluation, the walls of the room may be painted a flat nonreflecting black or blackout curtains may be hung on each side of the viewing area. The coat to be evaluated shall be placed on a wooden or plastic hanger, buttoned (all buttons) and suspended on the viewing board in such a manner that the coat lies flat on the surface of the viewing board. The cloth or the single needle seam appearance standards conforming to AATCC Test Methods 88B or 124, as applicable, shall be placed on the viewing board beside the coat. The observer shall stand directly in front of the viewing board but at a

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

distance of four feet. The observer shall then compare the coat in each of the areas specified in 3.5.1 to the photographic standards. A rating value shall be assigned to each of the specified areas. The rating value assigned to an area by the observer shall be the numerical value of the photographic standard that most nearly matches the area. Estimation of rating values falling between the numerical values of the photographic standard may be utilized. The average of the rating values assigned by each observer shall be the rating for the cloth, seams and hems of the coat. The individual rating values of each observer shall also be reported.

5. PACKAGING

5.1 Packaging. Packaging shall be level A or C as specified (see 6.2).

5.1.1 Level A. Each top buttoned coat or if desired, all buttons mated with their respective buttonholes, shall be laid front down, the sides and sleeves folded in over the back and the bottom folded up to the shoulders to approximate dimensions of 12 by 11 inches. The coat size on the label shall be clearly visible in front so as to permit ready identification. Each folded coat shall be individually inserted in a snug-fitting flat style, clear polyethylene film bag of 0.00125 inch thickness (± 20% tolerance). The bag shall be formed with heat sealed seams that are straight, continuous and parallel to each other and the formed edges of the bag. The final closure of the bag shall be heat sealed with the heat seal made as close as possible to the open end. A 1/4-inch diameter hole shall be made at one corner of the polyethylene bag to allow excess air to escape. Alternatively, the final closure of the polyethylene bag may be accomplished by means of a tuck or reverse flap.

5.1.2 Level C. Coats shall be packaged to afford adequate protection against physical damage during shipment from the supply source to the first receiving activity. The supplier may use his standard practice when it meets this requirement.

5.2 Packing. Packing shall be level A, B, or C as specified (see 6.2).

5.2.1 Level A. Twenty-four coats of one size only, packaged as specified in 5.1.1, shall be packed in a fiberboard shipping container conforming to style RSC-L, V2s of PPP-B-636. The inside of each container shall be fitted with a taped liner conforming to V3c of PPP-B-636. Each container shall have the contents completely covered on the top and bottom with a sheet of 30 pounds minimum basis weight kraft paper. Each container shall be closed, waterproofed, and reinforced with flat strapping or tape banding in accordance with the appendix of the container specification.

Source: https://assist.dla.mil -- Downloaded: 202640-21T10:08Z
Check the source to verify that this is the current version before use.

5.2.2 Level B. Twenty-four coats of one size only, packaged as specified in 5.1.1, shall be packed in a fiberboard shipping container conforming to style RSC-L, type CF or SF, variety SW, class doemstic, grade 275 of PPP-B-636. The inside of each shipping container shall be fitted with a taped liner conforming to type CF, variety SW, class doemstic, grade 275 of PPP-B-636. Each container shall have the contents completely covered on the top and bottom with a sheet of 30 pound minimum basis weight kraft paper. Each container shall be closed in accordance with appendix of the container specification.

5.2.3 Level C. Coats shall be packed in a manner to insure carrier acceptance and safe delivery at destination at the lowest transportation rate for such supplies. Containers shall be in accordance with rules or regulations of carriers applicable to the mode of transportation.

5.3 Marking.

5.3.1 Unit package and shipping container. Each unit package and shipping container shall be marked in accordance with MIL-STD-129.

6. NOTES

6.1 Intended use. The durable press, cotton-polyester, white, man's, medical attendant's coats covered by this specification are intended to be worn by para-medics in a clinical environment.

6.2 Ordering data. Procurement documents shall specify the following:

a. Title, number, and date of this specification.
b. Size and quantity desired (see 1.2).
c. Selection of applicable levels of packaging and packing (see 5.1 and 5.2).

6.3 Patterns. The patterns for the coats will be furnished by the contracting officer to the contractor for use in cutting working patterns (see 3.3.1). The pattern parts shall consist of the following:

NOMENCLATURE	CUT PARTS
Front	Two
Back	Two
Top sleeve	Two
Undersleeve	Two
Collar	One
Lower pocket	Two
Breast pocket	One
Pocket templates	Two

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

6.4 Seaming and stitching precaution. In order to minimize the puckering and to produce the flattest seams possible, consideration should be given to the following:

a. The needle should be the smallest size possible with a slim point.
b. The smallest throat plate hole possible should be used to prevent flagging.
c. The pressure foot pressure should be just enough to assure a steady flow of the material.
d. The feed dogs should contain 18 to 20 teeth per inch for normal sewing and 20 to 25 teeth per inch for stitching down.
e. All the sewing machine attachments should be as smooth as possible to permit free flowing of the cloth through the sewing machine.
f. The lightest possible thread tension should be used while maintaining a good stitch.
g. The upper and lower threads should be balanced.
h. Frequent checks should be made to assure blunt needles are eliminated and proper machine adjustments are maintained.

6.6 Catalog information. This specification covers the following items appearing in the Federal Supply Catalog:

National Stock No.	Item Identification
6532-00-080-1684	COAT, MEDICAL ATTENDANT'S, Man's, Durable Press, Small, Each
6532-00-080-1719	COAT, MEDICAL ATTENDANT'S, Man's, Durable Press, Medium, Each
6532-00-080-1825	COAT, MEDICAL ATTENDANT'S, Man's, Durable Press, Large, Each
6532-00-080-1837	COAT, MEDICAL ATTENDANT'S, Man's, Durable Press, Extra Large, Each

Custodians:
Army - MD
Navy - MS
Air Force - 03

Preparing activity:
Defense Supply Agency - DM

Project No. 6532-1119

☆ U. S. GOVERNMENT PRINTING OFFICE: 1976-703-020/344

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE: MIL-C-37186B COATS, MEDICAL ATTENDANT'S, MAN'S, WHITE, COTTON-POLYESTER, DURABLE PRESS.

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 68 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T10:08Z
Check the source to verify that this is the current version before use.