MIL-R-36563A
Amendment-2
13 July 1970
SUPERSEDING
Amendment-1
10 January 1970

MILITARY SPECIFICATION

RESUSCITATOR, FIELD, 110 Volt, 60 Cycle,
AC, or 24 Volt, DC

This amendment forms a part of Military Specification MIL-R-36563A, dated 3 October 1969, and is mandatory for use by all Departments and Agencies of the Department of Defense.

Page 6:

3.3.2 At end of paragraph add: "Part No. 19, Tie Rod, Sheet 3 of Bill of Material and Drawing, Sheet 9 (coordinates G-2) under column "DESCRIPTION" delete dimension 7-11/32 and substitute 7-1/4." "Part No. 28, Ring, Diaphragm, Lower Sheet 4 of Bill of Material, under column "DESCRIPTION" delete "3-1/2 OD. x .500" and substitute "3 inches O.D. x .250." Part No. 107, Valve, Directional Control, Sheet 14 of Bill of Material under column "DESCRIPTION" delete Model "V" and substitute Model "V-10." Part No. 196, Screw, Machine, Flat Head, Sheet No. 22 of Bill of Material under column "DESCRIPTION" Add "Self-Locking, Type L" and under column, "VENDOR" add Allmetal Screw Co., Inc. Garden City, N.Y.

Page 9:

3.3.2.1.4.2, line 5: Delete "valve" and substitute "value."

Page 12:

3.3.2.1.5.7, line 13: Delete "acuating" and substitute "actuating."

line 19: Delete "valve" and substitute "value."

Page 13:

3.3.3.1, line 8: After "die casting" insert "fitted with a lubricant (see 3.3.3.1.1) impregnated bronze outer sleeve."

FSC 6515

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T08:49Z
Check the source to verify that this is the current version before use.

lines 13 and 14: Delete "phenolic disk working on a brass valve seat, held in place by means of a steel retainer spun in place" and substitute "mylar disk, held in place by a steel rivet, working on an aluminum valve seat."

line 18: Delete "ground" and substitute "cold drawn steel."

line 20: Delete "felt" and substitute "polyurethane filter foam."

lines 27 and 28: Delete "A cork crankcase" and substitute "A polyurethane foam crankcase gasket."

line 29: Delete "ground" and substitute "cold drawn."

Page 14:

3.3.3.2 Delete entire paragraph and substitute:

"3.3.3.2 Electric Motor - A 24-29 volt direct current electric motor shall drive the compressor by means of a positive drive belt. The motor shall be shunt wound, continuous duty, rated at 16 ounce-inches torque, and shall operate at a speed of 4300 ± 300 R. P. M. when operated under rated load and a 24 volt DC source. When operated under these conditions there shall be no tendency of the motor armature to lock-in, as evidenced by hesitation in starting, when the armature shaft is in any of its possible angular positions. The motor shall comply with the basic dimensions for Part 67, sheet 13 of the drawing, except that radio interference reduction feed through capacitors shall not be provided, mounting arrangement may be modified (see 3.3.3.2.1) and two (2) drilled holes on the fan shroud for securing the condenser shield, Part 62, shall be omitted. The motor shall be provided with a two-conductor shielded electric lead, color coded, red for positive, black for negative. The shield shall be electrically grounded to the inside of the motor housing. The shielded lead shall be provided with a strain relief where it passes through the motor housing. Electric lead output shall be approximately at the position shown for the lower feed through capacitor, and the lead shall have a free length determined by the manufacturer to adequately reach the radio interference filter terminals (see 3.3.3.3) mounted to the underside of the control box cover, Part 54.

Source: https://assist.dla.mil -- Downloaded: 202640-21T08:49Z
Check the source to verify that this is the current version before use.

Part No. 62 Shield, Capacitor, Sheet 8 of Bill of Material and Sheet 13 of Drawing - Delete entirely.

Part No. 67 Motor, Sheet 9 of Bill of Material - Delete 'SH 2816KBVFC, Small Motors, Inc., Chicago, Ill.' and substitute:

'FBD 3010-1, IMC Magnetics Corp., Westbury, N.Y.' or '8430-BXC, Jones Motrola Corp., Stanford, Conn.' or 'MP-0003, Type 180, Motron Elect. Mfg. Corp., Carlstadt, N. J.'

Part No. 198, Screw, Self-Tapping, Sheet 22 of Bill of Material. Delete entirely."

Page 15:

3.3.3.3 Delete entire paragraph and substitute:

"3.3.3.3 Transformer - Recitifier Power Source. A transformer-rectifier power source shall be provided to permit operation of the direct-current (D.C.) motor from a 105-130 volt alternating-current (A.C.) 60 cycle power source. The source shall consist essentially of a step-down transformer, a silicon diode full wave bridge rectifier, rectifier heat sinks, a switch, fuses with holders, a radio interference filter network, and power cords with the specified plugs and receptacles. The wiring shall be in accordance with diagram shown on sheet 4 of the drawing. The radio interference filter shall be screwed or rivetted to the inside of the control box cover, Part 54, in such position to clear existing electrical components in the control box. The filter network case shall make an electrical ground connection with the cover. The positive lead from switch, S-1, shall contain the fuse holder, Part 132, prior to the interference filter. The electrical wire lead, Part 138, to the fuse holder shall be of sufficient length to pass through the 7/16 diameter hole in the control box cover to reach the fuse holder clipped in the fuse clip on the motor fan shroud. The shielded conductors from the motor shall be soldered to the proper polarity output of the filter network and the shield electrically grounded to the box cover by means of a suitable terminal connector. The motor, motor mount, control box and cover shall all be electrically inter-connected through the fasteners used to join those components. Silicone compound shall be used to insure good thermal contact between the diodes and the heat sinks."

Source: https://assist.dla.mil -- Downloaded: 202610-21T08:49Z
Check the source to verify that this is the current version before use.

Wiring Diagram, Sheet 4 of Drawing. - Delete present diagram, and substitute new diagram as shown on Figure I.

Retainer-Transformer, Part 63, Sheet 13 of Drawing. - Add countersink for flat-head screw on head end to the drilled hole.

Part No. 232, Screw, Round Head, Sheet 25 of Bill of Materials. Change to Screw, Flat Hd.

Add new part to Sheet 25 of Bill of Material, as follows:

Req'd	Part No.	Elec. Desig.	Nomenclature	Material	Vendor
1	237	RF-1	Filter, R.F. Hermetically Sealed	Part No. A2703	All-Tronics, Inc. Westbury, N.Y.

Part No. 228 Diode, Sheet 24 of Bill of Material, Sheet 4 of Drawing 25014 (Coordinate H-7). Delete.

Cover, Control Box, Part 54, Sheet 12 of Drawing. Delete .263 diameter hole for mounting of blocking diode, Part 228.

3.3.3.3.1, line 9: Delete "Formar and substitute "Formvar."

Page 16:

3.3.3.4, line 7: Delete "pushing" and substitute "bushing".

3.3.3.4, line 9: Delete "exclusively" and substitute "excessively."

3.3.5, line 4: At end of paragraph add following: "When measuring the radiated interference, the electrical control box-motor system shall be connected to a good electrical ground."

Page 18:

3.3.5.6 (e) Delete "Sheel" and substitute "Shell".

Page 27:

4.4.1, line 13: Delete "one" and substitute "end."

4.4.1, line 16: Delete "suitable".

Page 28:

4.4.3, line 6: Delete "or" and substitute "on.".

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T08:49Z
Check the source to verify that this is the current version before use.

Custodians
Army - MD
Navy - MS
Air Force - 03


Review activities
Army - MD
Navy - MS
Air Force - 03

Preparing activity
Defense Supply Agency - DM

Project No. 6515-144

Review information is current as of the date of this document. For future coordination of changes to this document, draft circulation should be based on the information in the current DODISS.

Source: https://assist.dla.mil -- Downloaded: 2026-10-21T08:49Z
Check the source to verify that this is the current version before use.

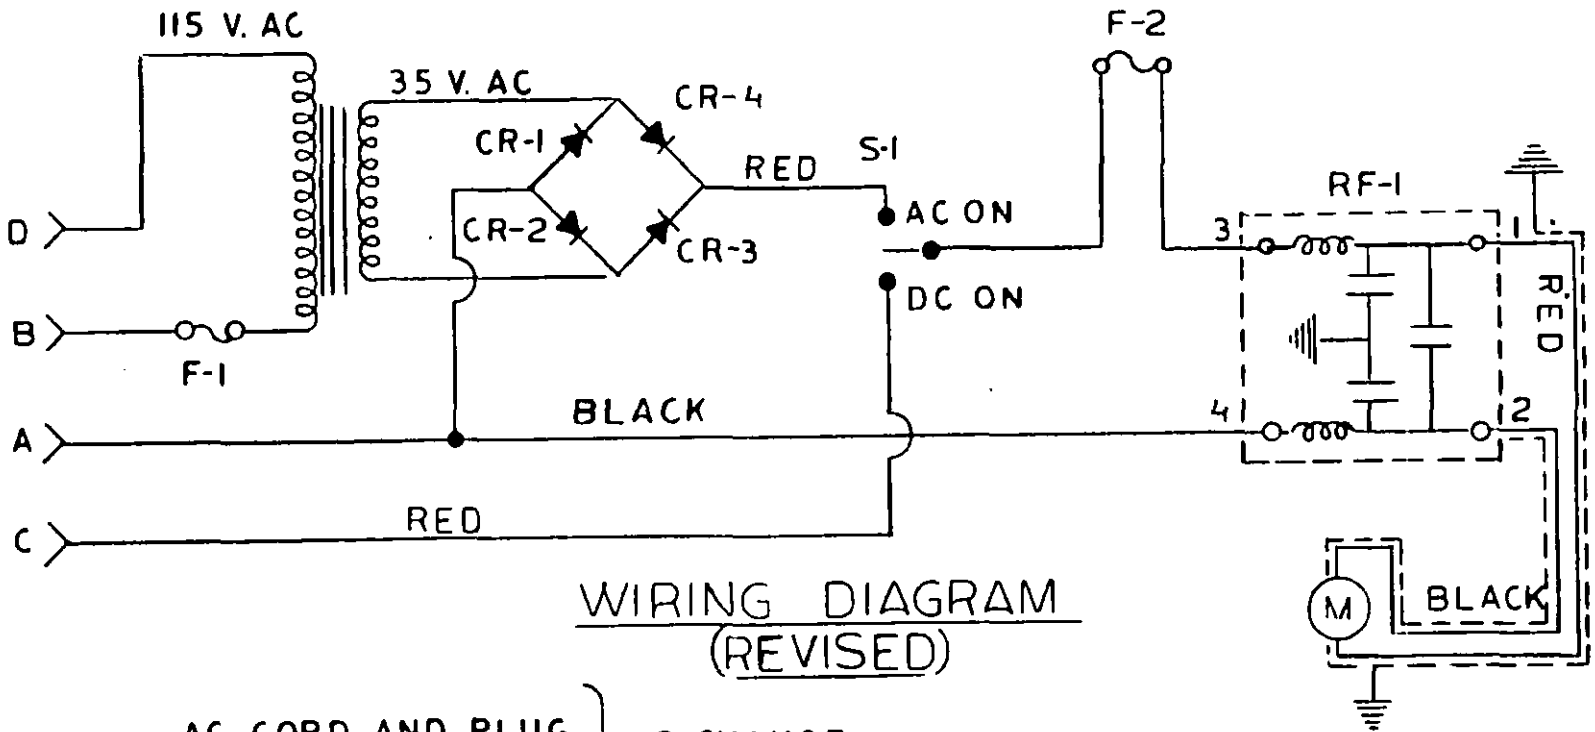

WIRING DIAGRAM
(REVISED)

AC CORD AND PLUG
DC CORD AND PLUG
} NO CHANGE

NOTES

1.
2.
3.
} NO CHANGE

4. DELETE AND SUBSTITUTE:
"4 RF-1 ALL-TRONICS R.F. FILTER MODEL A 2703 (PART 237)"

DWG NO 25014
SHEET 4

FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 2026/0-21T08:49Z
Check the source to verify that this is the current version before use.