INCH-POUND

MIL-F-70823A (AR)
AMENDMENT 1
18 September 1996

MILITARY SPECIFICATION

FUZE, ELECTRONIC TIME, M762
LOADING, ASSEMBLING AND PACKING
AND
FUZE, ELECTRONIC TIME, M767 LESS BOOSTER

This amendment forms a part of Military Specification MIL-F-70823A (AR) dated 02 June 1994, and is approved for use by the US Army Armament, Research, Development and Engineering Center and is available for use by all Departments and Agencies of the Department of Defense.

PAGE 2

2.1.1, Standards:

Delete:

MIL-STD-109 in its entirety.
MIL-STD-2000 in its entirety

PAGE 3

2.1.2, Other Government documents, drawings, and publications.

Delete the following:

8886458 - Box, Pallet Type, Wirebound, Packing, Ammunition for Artillery Type and Rocket Fuzes (within M2A1 Box)

DISTRIBUTION STATEMENT A. **Approved for public; distribution is unlimited.**

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

PAGE 11

4.3.1.b, Delete in it's entirety and substitute the following:

"b. Two hundred fifty-five (255) complete M762 Fuze assemblies or one hundred ninety (190) M767 Fuze less booster assemblies. Inspection shall be per 4.3.2.2."

4.3.2.2, Delete in it's entirety and substitute the following:

"4.3.2.2 Functioning performance tests. The fuze assemblies submitted in accordance with 4.3.1.b shall be subjected to the following tests:

a. Cold temperature sequential operational and safety tests per TABLES I-A and I-C.

b. Hot temperature sequential operational, safety and accelerated aging per TABLES I-B and I-C.

c. Reliability tests per TABLES II, III and IV

PAGE 12

4.3.3.2.1.a, Delete in it's entirety and substitute the following:

"a. Safe position - critical defect - Any fuze found with S&A module not in the safe position (see 6.7.8) prior to gunfire shall be cause for rejection. The S&A module shall be examined using x-ray techniques."

PAGE 14

Delete TABLE I-A in its entirety and substitute new TABLE I-A included.

PAGE 15

Delete TABLE I-B in its entirety and substitute new TABLE I-B included.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

PAGE 16

Delete TABLE I-C in its entirety and substitute new TABLE I-C included.

PAGE 17

Delete TABLE II in its entirety and substitute new TABLE II included.

PAGE 18

Delete TABLE III in its entirety and substitute new TABLE III included.

PAGE 19

Delete TABLE IV in its entirety and substitute new TABLE IV included.

PAGE 20

4.4.2, Delete in its entirety and substitute the following:

"4.4.2 Sampling for functioning performance tests. The lot sample size for M762 fuze and M762 fuze less booster shall be according to TABLE V."


4.4.2.1, Delete in its entirety and substitute the following:

"4.4.2.1 Switching criteria for M762 reduced sample. Until three consecutive lots are accepted, the sample size shall be one hundred sixteen (116) fuzes. After three consecutive lots are passed, the sample shall be reduced to fifty-five (55) fuzes as shown in Note 'b' of TABLE V with the criteria of reintroduction of the large sample size if one reduced sample fails to meet the criteria of 4.4.2.3."

4.4.2.2, Add: "for M762 Fuze." to the end of title.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.


TABLE I-A M762/M767 less booster first article cold temperature sequential operational and safety tests

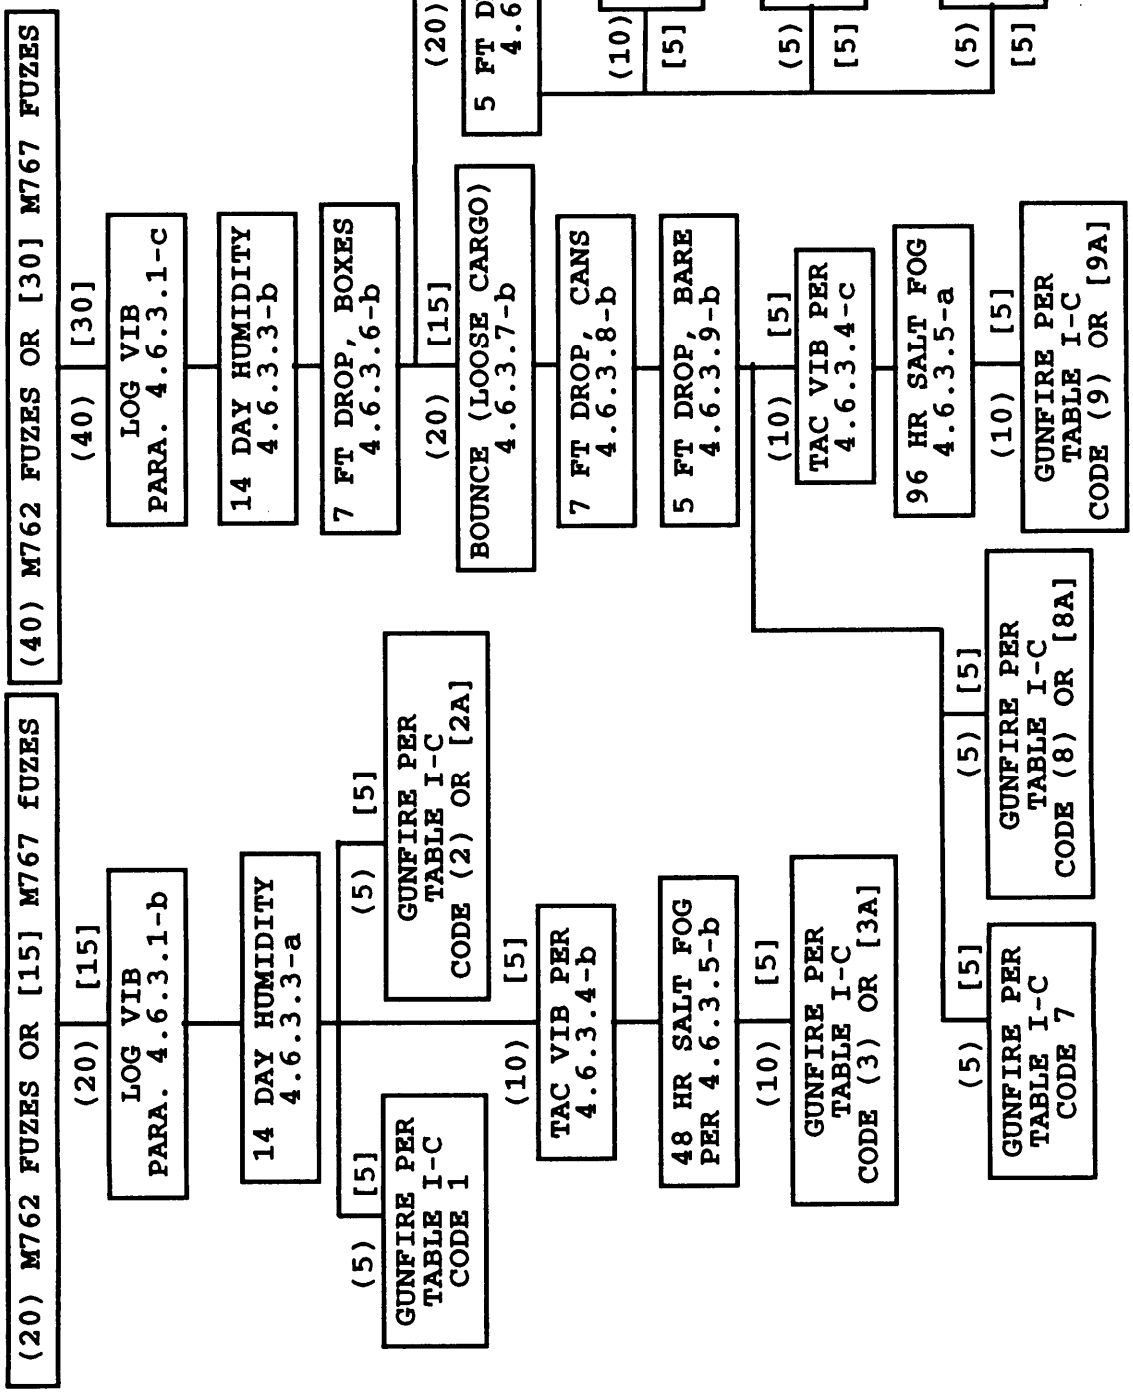

Note: The numbers enclosed by ( ) brackets shall apply to M762 fuze only.
The numbers enclosed by [ ] brackets shall apply to M767 fuze less booster only.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

TABLE I-B M762/M767 less booster first article hot temperature sequential operational and safety tests

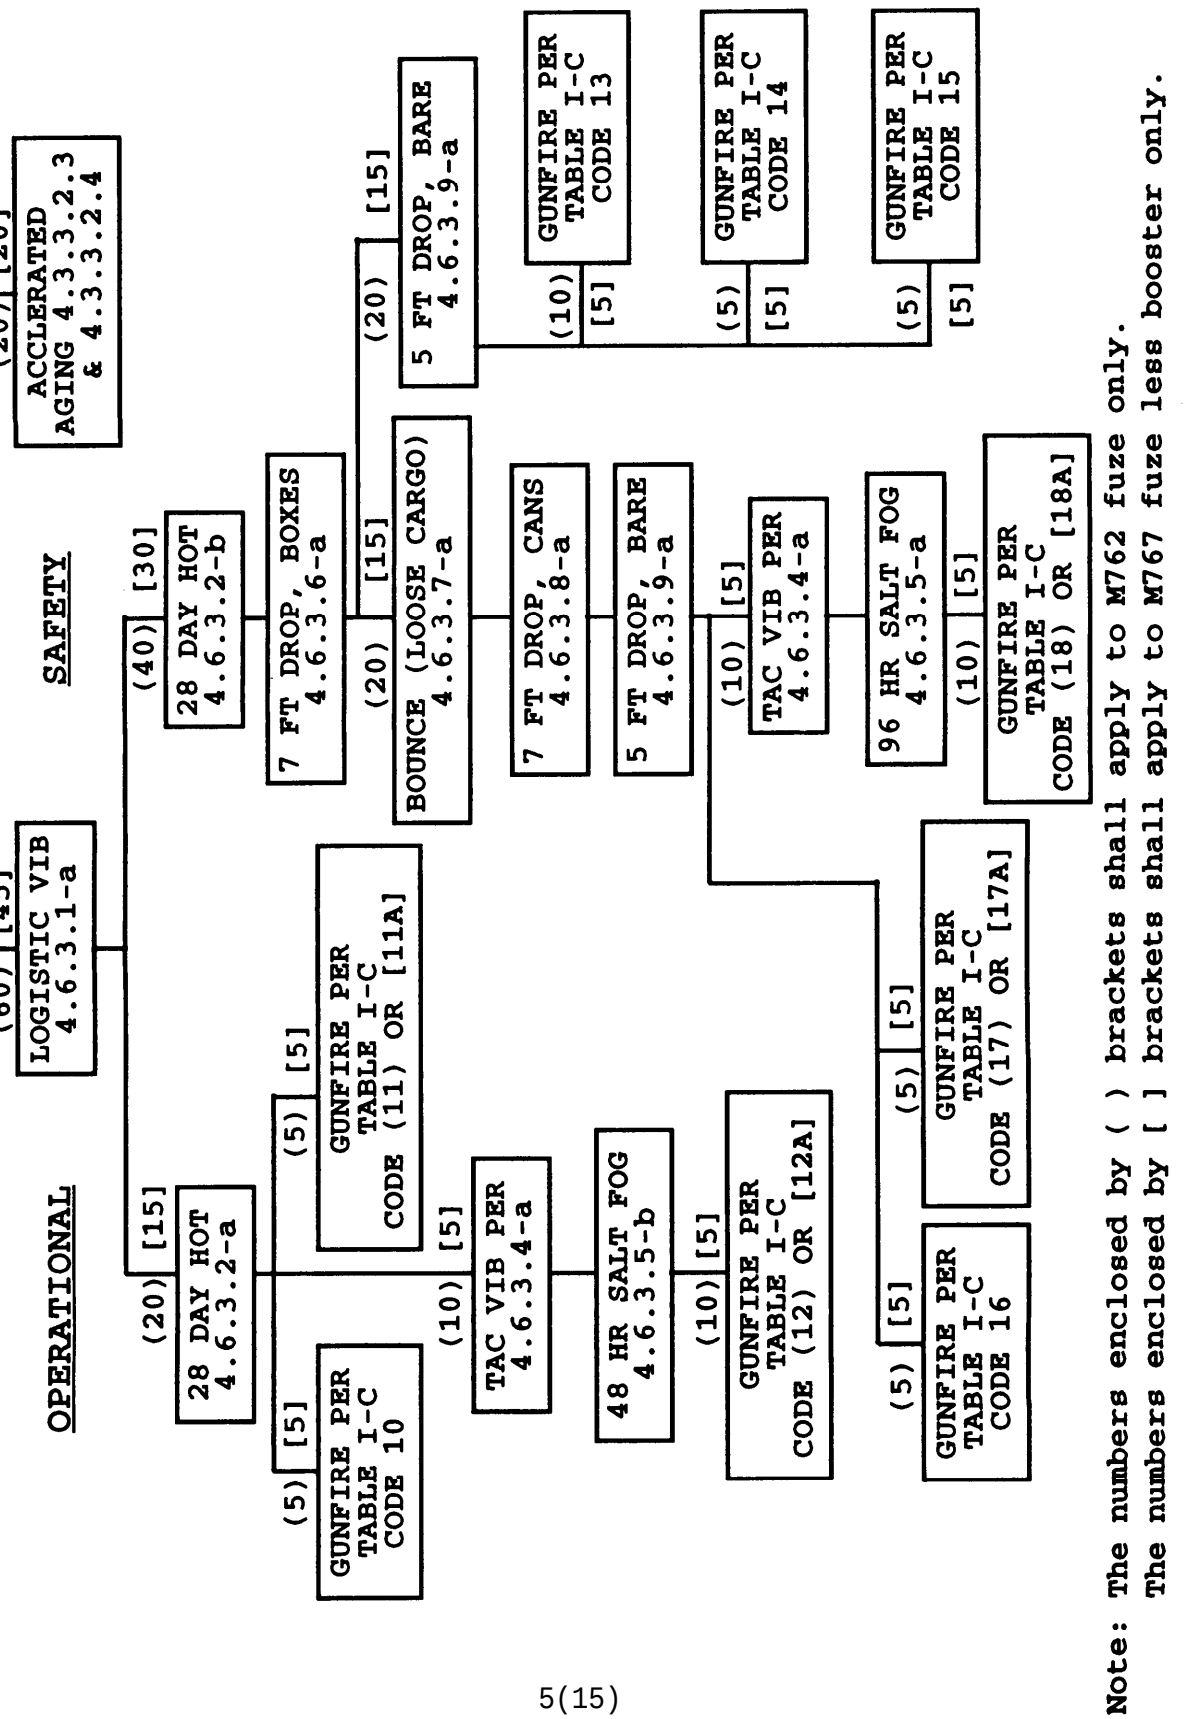

Note: The numbers enclosed by ( ) brackets shall apply to M762 fuze only.
The numbers enclosed by [ ] brackets shall apply to M767 fuze less booster only.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

TABLE I-C M762/M767 less booster first article safety / sequential operational gunfire matrix

CODE[1]	CALIBER	WEAPON	TUBE[2]	PROPELLANT	ZONE[3]	PROJECTILE[4]	TEMP[5] FUZE	TEMP[5] PROJ	TEMP[5] PROP
1	105MM	M119	M20A1	M200	8	M760	-45°F	+70°F	+70°F
(2)	8 INCH	M110A2	M201A1	M188A1	9	M106	-45°F	-45°F	+70°F
[2A]	8 INCH	M110A2	M201A1	M188A1	9	M650A1[6]	-45°F	-45°F	+70°F
(3)	155MM	M198	M199	M203A1	8S	M864	-45°F	-45°F	+70°F
[3A]	155MM	M198	M199	M203A1	8S	M549A1[6]	-45°F	-45°F	+70°F
4	105MM	M101A1	M2A2	M67	1	M1	-60°F	+70°F	+70°F
5	8 INCH	M110A2	M201A1	M1	1	M106	-60°F	-60°F	+70°F
6	155MM	M109A2/A3	M185	M3A1	2	M107	-60°F	-60°F	+70°F
7	105MM	M119	M20A1	M200	8	M760	-60°F	+70°F	+70°F
(8)	8 INCH	M110A2	M201A1	M188A1	9	M106	-60°F	-60°F	+70°F
[8A]	8 INCH	M110A2	M201A1	M188A1	9	M650A1[6]	-60°F	-60°F	+70°F
(9)	155MM	M198	M199	M203A1	8S	M864	-60°F	-60°F	+70°F
[9A]	155MM	M198	M199	M203A1	8S	M549A1[6]	-60°F	-60°F	+70°F
10	105MM	M119	M20A1	M200	8	M760	+145°F	+145°F	+145°F
(11)	8 INCH	M110A2	M201A1	M188A1	9	M106	+145°F	+145°F	+145°F
[11A]	8 INCH	M110A2	M201A1	M188A1	9	M650A1[6]	+145°F	+145°F	+145°F
(12)	155MM	M198	M199	M203A1	8S	M864	+145°F	+145°F	+145°F
[12A]	155MM	M198	M199	M203A1	8S	M549A1[6]	+145°F	+145°F	+145°F
13	105MM	M101A1	M2A2	M67	1	M1	+145°F	+145°F	+145°F
14	8 INCH	M110A2	M201A1	M1	1	M106	+145°F	+145°F	+145°F
15	155MM	M109A2/A3	M185	M3A1	2	M107	+145°F	+145°F	+145°F
16	105MM	M119	M20A1	M200	8	M760	+145°F	+145°F	+145°F
(17)	8 INCH	M110A2	M201A1	M188A1	9	M106	+145°F	+145°F	+145°F
[17A]	8 INCH	M110A2	M201A1	M188A1	9	M650A1[6]	+145°F	+145°F	+145°F
(18)	155MM	M198	M199	M203A1	8S	M864	+145°F	+145°F	+145°F
[18A]	155MM	M198	M199	M203A1	8S	M549A1[6]	+145°F	+145°F	+145°F

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

TABLE I-C M762/M767 less booster first article safety / sequential operational gunfire matrix (continue)

Notes:

1. Code numbers are from Table I-A or I-B. Code numbers enclosed ( ) brackets shall apply to M762 fuze only while the code numbers enclosed by [ ] brackets shall apply to M767 fuze less booster only. Code numbers without any brackets shall apply to both type of fuzes.
2. All tubes to have 90% remaining life or better.
3. Approximately 80% of the M762 fuzes and 40% of the M767 fuzes shall be set in the time mode. The time mode setting shall be so that a minimum of 75 % range will be achieved using standard weapon quadrant elevations. Time and PD mode settings shall be per paragraph 4.7.3. The remaining fuzes shall be fired in the PD mode at a quadrant elevation between 800 and 900 mils.
4. The the booster for fuzes shall be the M767 booster assembly. M767 booster assembly shall not be subjected to sequential environments and shall be installed at the test site.
5. Hot projectile temperature may be lowered to 125°F to avoid exudation. For the 105mm, projectile and charge shall be conditioned at the same temperature.
6. Projectiles shall be fired in Rocket-On mode.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

TABLE II M762/M767 less booster first article test
(reliability)
(105mm)

FUZE TYPE	HOWITZER	TUBE[3]	PROJECTILE	CHARGE	ZONE	TEMP[1]	NO.	SETTING[6]	APPROX. QUADRANT (MILS)
M762 FUZE[9]	M101A1	M2A2	M1	M67	1	COLD	5	27.4[7]	1108
						HOT	5	27.4[7]	1108
	M101A1	M2A2E2	M1	M67	5	COLD	5	49.4[7]	985
						HOT	5	49.4[7]	985
	M119	M20A1	M760	M200	8	HOT	5	50.1[7]	770
	M119	M20A1 (INERT)[8]	M760	M200	8	HOT	5	P.D.[2,4]	---
	M101A1	M2A2 (INERT)[8]	M1	M67	1	HOT	5	P.D.[2,5]	---
	TOTAL						35		
M767 FUZE[9] LESS BOO-STER	M101A1	M2A2	M1	M67	1	COLD	10	P.D.[2,5]	---
	M119	M20A1	M760	M200	8	HOT	5	P.D.	770
							5	50.1[7]	770
	TOTAL						20		

Notes:

1. Hot and Cold temperature shall be at +145°F and -45°F respectively. Fuze/projectile/propellant shall be at the same temperature. Hot projectile temperature may be lowered to 125°F to avoid exudation. In this case, the propellant temperature shall also be lowered to 125°F.
2. See paragraph 4.7.2.
3. Tubes to have 90% or better remaining life.
4. Target distance to be 1200 ft. minimum.
5. Target distance to be 450 ft. minimum.
6. Setting per paragraph 4.7.3.
7. Setting times may vary from those shown depending on conditions at the time of testing.
8. All spotting charges to be T2 with inert projectiles.
9. Booster assembly installed at test site. M767 booster assembly shall be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

TABLE III M762/M767 less booster first article test
(155mm reliability)

FUUZE TYPE	HOWITZER	TUBE[3]	PROJECTILE	CHARGE	ZONE	TEMP[1]	NO.	SETTING[5]	APPROX. QUADRANT (mils)
M762 FUZE	M109A2/A3	M185	M107[8]	M3A1	2	COLD/HOT	5/5	20.5[6]	575
	M109A2/A3	M185	M107[8]	M119A2	7R	COLD/HOT	5/5	66.7[6]	870
	M109A2/A3	M185	M483A1	M3A1	3	COLD/HOT	5/5	26.1[6]	679
	M109A2/A3	M185	M483A1	M4A2	7	COLD/HOT	5/5	76.4[6]	1170
	M198	M199	M864	M203A1	8S	HOT	5	97.4[6]	909
	M109A2/A3	M185	M107(INERT)[7,8]	M3A1	2	COLD	5	P.D.[2,4]	---
	TOTAL						50		
M767 FUZE LESS BOO-STER	M109A2/A3	M185	M107[8]	M119A2	7R	HOT	5	P.D	870
	M198	M199	M549A1[8,9,10]	M203A1	8S	HOT/COLD	5/5	97.4[6]	909
	M198	M199	M549A1[8,9,10]	M203A1	8S	HOT/COLD	5/5	P.D.	909
	M109A2/A3	M185	M107(INERT)[7,8]	M3A1	2	COLD	10	P.D.[2,4]	---
	M109A2/A3	M185	M107(INERT)[7,8]	M4A2	7	AMBIENT	5	P.D.[2,4]	---
	TOTAL						40		

Notes:

1. Hot and Cold temperature shall be at +145°F and -45°F respectively. Fuze/projectile/propellant shall be at the same temperature.
2. See paragraph 4.7.2.
3. Tubes to have 90% or better remaining life.
4. Target distance to be 1100 ft. min. for zone 7 and 450 ft. min. for zone 2.
5. Setting per paragraph 4.7.3.
6. Setting times may vary from those shown depending on conditions at the time of testing.
7. All spotting charges to be T2 with inert projectiles.
8. Booster assembly installed at test site. M767 booster assembly shall be used.
9. Projectile shall be fired in Rocket-ON mode.
10. Hot projectile temperature may be lowered to 125°F to avoid exudation.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

TABLE IV M762/M767 less booster first article test
(8 inch reliability)

FUZE TYPE	HOWITZER	TUBE[3]	PROJECTILE	CHARGE	ZONE	TEMP[1]	NO.	SETTING[5]	APPROX. QUADRANT (mils)
M762 Fuze	M110A2	M201A1	M106[9]	M1	1	COLD/HOT	5/5	40.0[7]	1100[6]
	M110A2	M201A1	M106[9]	M188A1	9	HOT	5	119.6[7]	1100[6]
	M110A2	M201A1	M509A1	M1	1	COLD	5	20.0[7]	600
	M110A2	M201A1	M106(INERT)[8,9]	M1	1	COLD	5	P.D.[2,4]	---
	M110A2	M201A1	M106(INERT)[8,9]	M188A1	9	HOT	5	P.D.[2,4]	---
	TATAL						30		
M767 FUZE LESS BOO-STER	M110A2	M201A1	M650A1[9,10,11]	M188A1	9	HOT	5	P.D.	1100[6]
	M110A2	M201A1	M650A1[9,10,11]	M188A1	9	COLD	5	119.6[7]	1100[6]
	M110A2	M201A1	M106(INERT)[8,9]	M1	1	COLD	10	P.D.[2,4]	---
	TOTAL						20		

Notes:

1. Hot and Cold temperature shall be at +145°F and -45°F respectively. Fuze/projectile/propellant shall be at the same temperature.
2. See paragraph 4.7.2.
3. Tubes to have 90% or better remaining life.
4. Target distance shall be 500 ft. min. for zone 1 and 1800 ft. min. for zone 9.
5. Setting per paragraph 4.7.3.
6. Maximum testing Quadrant Elevation.
7. Setting times may vary from those shown depending on conditions at the time of testing.
8. All spotting charges to be T2 with inert projectiles.
9. Booster assembly installed at test site. M767 booster assembly shall be used.
10. The projectile shall be fired in Rocket On-mode.
11. Hot projectile temperature may be lowered to 125°F to avoid exudation.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

PAGE 21

4.4.2.2.f, Delete in its entirety and substitute the following:

"4.4.2.2.f Time duds-major defect. - More than two time duds (see 6.7.3) per caliber or more than three time duds for all configurations and temperatures."

4.4.2.3, delete title in its entirety and substitute the following:

"4.4.2.3 Rejection criteria for M762 fuze reduced sample and M767 fuze less booster."

PAGE 23

Delete (TABLE V) in its entirety and substitute new Table V included.

PAGE 26

4.4.3.1 Inspection Method Reference, delete "MIL-STD-2000" and substitute "Visual".

PAGE 30

4.4.3.5 Inspection Method Reference, delete "MIL-STD-2000" and substitute "Visual"

PAGE 38

4.4.3.13 Inspection Method Reference, delete "MIL-STD-2000" and substitute "Visual".

PAGE 39

4.4.3.14 Inspection Method Reference, delete "MIL-STD-2000" and substitute "Visual".

PAGE 40

4.4.3.15 Inspection Method Reference, delete "MIL-STD-2000" and substitute "Visual".

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

TABLE V M762/M767 less booster lot operational and safety test matrix

FUZE TYPE	TEST	CALIBER	WEAPON	TUBE f	PROJECTILE	CHARGE	ZONE	TEMP e,j	SAMPLE SIZE	SAMPLE SIZE b
M762 FUZE k,g	PD MODE NON FUNCTIONING	105MM	M102	M137A1	M1 a,i	M67	1	-45°F	5/5c,m	5/5c,m
		155MM	M109A2/A3	M185	M107 a,i	M3A1	2	+70°F	5/5c,m	-
	PD MODE FUNCTIONING	155MM	M109A2/A3	M185	M107 a,i	M3A1	2	-45°F	5 n	5/5c,n
						M4A2	7	+70°F	5/5c,n	-
	TIME MODE 1	105MM	M101A1	M2A2	M1 a	M67	1	-45°F	10	5
			M119	M20A1	M760 a	M200	8	+145°F	15	5
		8-INCH	M110A2	M201A1	M106 a	M188A1	9	+145°F	10	5
			M110A2	M201A1	M106 a	M1	1	-45°F	5	5
		155MM	M109A2/A3	M185	d,h	M3A1	3	-45°F	16	5
			M198	M199	o,h	M203A1	8S	+70°F	10	-
			M198	M199	o,h	M203A1	8S	+145°F	15	10
	TOTAL								116	55
M767 FUZE LESS BOOSTER a,k g	PD MODE NON FUNCTIONING	155MM	M109A2/A3	M185	M107 i	M3A1	2	+145°F	5 c,m	-
	PD MODE FUNCTIONING	155MM	M109A2/A3	M185	M107 i	M3A1	2	-45°F	10 c,n	-
			M198	M199	M549A1,q	M203A1	8S	-45°F	5 r	-
			M198	M199	M549A1,q	M203A1	8S	+145°F	5 r	-
		8-INCH	M110A2	M201A1	M650A1,q	M188A1	9	+145°F	5 c,r	-
	TIME MODE FUNCTIONING 1	105MM	M119	M20A1	M760	M200	8	+145°F	4	-
		155MM	M109A2/A3	M185	M107	M3A1	3	-45°F	4	-
			M198	M199	M549A1,q	M203A1	8S	-45°F	4	-
			M198	M199	M549A1,q	M203A1	8S	+145°F	4 c	-
		8-INCH	M110A2	M201A1	M106	M1	1	-45°F	4	-
			M110A2	M201A1	M650A1,q	M188A1	9	+145°F	4 c	-
	TOTAL								54	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

TABLE V M762/M767 less booster Lot operational and safety test matrix (continue)

Notes:

a. Booster assembly installed at test site. M767 booster assembly shall be used.
b. For subsequent lots after three consecutive acceptable lots (see 4.4.2.1).
c. Logistic Vibration samples (per 4.6.3.1, except at ambient temperature).
d. Use any cargo carrying projectiles as authorized by TM 43-0001-28-6 (inert cargo projectiles are acceptable), or use M107, HE, Projectile with boostered fuze.
e. Fuze/projectile/propellant shall be at the same temperature. Hot projectile temperature may be lowered to 125°F to avoid exudation. In this case, the 105mm projectile and propellant shall be at the same temperature.
f. All tubes will have 90% remaining life or better.
g. Fuzes to be activated and set per 4.7.3.
h. Fuze shall be assembled with self registration charge, T2 spotter charge, APG charge or expulsion charge as required.
i. All spotting charges to be T2 or APG with inert projectiles.
j. All temperature preconditioning per 4.6.3.10.
k. 80% of fuzes will be hand activated and set (do not verify setting with autosetter)/20% of fuzes will be auto activated and set. Only one attempt at hot (+145°F) and two attempts at ambient and cold (-45°F) shall be made to activate and set the fuze.
fuze failing to activate or set shall be counted against the fuze unsettable category.
l. The Quadrant Elevation (QE) and Setting (seconds) shall be as specified in 6.9.
m. Per 4.7.1 (Target distance to be at 400 calibers).
n. Per 4.7.2 (Target distance to be approximately 500 feet for zone 2 and 1200 feet for zone 7.
o. Use only cargo carrying projectiles as authorized by TM 43-0001-28-7. Inert cargo projectile are acceptable.
q. Projectiles shall be fired in Rocket-On mode.
r. Fired in the PD mode for function on Ground Impact. The QE shall be selected so that a minimum of 75% range will be achieved.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.22	Battery assembly	1 OF 1	12550890
			NEXT HIGHER ASSEMBLY 12550880

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Weld pull test, Contact, Negative (destructive test)	(a)	3.2	4.6.2.2.1a Note 1
102	Weld pull test, Lead, Battery (destructive test)	(a)	3.2	4.6.2.2.1b Note 2
103	Weld pull test, Lead, Battery (non-destructive test)	Level IV	3.2	4.6.2.2.1c Note 2
104	Weld integrity (fractured weld or hole in case)	100%	3.2	Visual Note 2
105	Leak test	Level IV	3.2	4.6.2.2.2 Note 2
106	Voltage and resistance test	100%	3.9.3	4.6.1.7
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES: (a) Three (3) samples per lot
Note 1. See 3.9
Note 2. Applies to Hard-Wire configuration only

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

PAGE 47

4.4.3.22, Delete (C of C sheet) in its entirety and substitute new C of C sheet included.

PAGE 86

4.4.3.61, Inspection Method Reference, delete “MIL-STD-2000” and substitute “Visual”.

delete Major 101 on the EXAMINATION OR TEST column and substitute the following:

“Solderability test shall be performed on the following drawings:
12550831 Printed Wiring Board, M762, Multiplexed
12550837 Pin, Contact
12550839 Printed Wiring Board, M767, Multiplexed
12550818 Clip
12550931 Safe & Arm Contact plate”

PAGE 87

4.4.3.62, add note (a) as follows:

“(a) Major 103 shall apply to M762 fuze only.”

PAGE 93

Add measurement condition 'e' to test parameter 14.0 of TABLE VII.

“e. Check Dud Latch per 18.0”

PAGE 96

Table VII, test parameter 22.00:

Delete “

Ambient		-60 F		+155 F	
LL	HL	LL	HL	LL	HL
19.3us	28.1us	16.3us	30.1us	16.3us	30.1us

”

and substitute:

Ambient		-60 F		+155 F	
LL	HL	LL	HL	LL	HL
393us	652us	332us	698us	332us	698us

”

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

4.6.2.2, delete in its entirety and substitute the following:

"4.6.2.2 Test of battery and lead assembly.

a. Battery weld pull test, Contact, Negative. The weld strength of the battery assembly negative contact (12550890), shall be tested to ensure weld bond integrity during gunfire. This directly related to the weld strength of the terminal plate assembly (12550995) and the negative contact (12550893). These representative parts can be pull tested in place of the battery assembly for safety reasons.

The welded assembly shall be placed in a fixture which supports the negative contact, (12550893). Force is then applied to the battery (12550985), or the representative terminal plate assembly (125500995). Care must be taken to apply force only to the battery or terminal plate and not to the negative contact (12550983). Force shall be applied by a system capable of measuring force up to 100 LB, in increments of 0.1 LB with an accuracy of 0.25% of full scale (each range), with the ability to maintain the maximum force applied. The weld must not separate completely at any force less than that shown on 12550890.

b. Pull test of battery and lead assembly leads. (Destructive Test) One battery at the start of each shift and one battery of every 100 manufactured shall be subjected to a destructive pull force on each of the two leads of 9 pounds minimum along the longitudinal axis of each lead. Evidence of residual lead material shall be present on the battery after the pull test to assure weld integrity.

c. Pull test of battery and lead assembly leads. (Non-Destructive Test) Each lead of each battery and lead assembly shall withstand a non-destructive pull force of 5=2 pounds along the longitudinal axis of the lead without degradation or failure.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.

d. Leak test of battery and lead assembly. One assembly at the start of each shift and one assembly of every 100 manufactured shall be tested for compliance with the gross and fine leak requirements of MIL-B-70824, paragraph 4.6.4.1 and 4.6.4.2. Any unit failing to meet the requirements shall reject the lot (Non-Destructive Test).

PAGE 108

5.1.1:

Delete:

"packaging shall be in accordance with Drawing 8864492 and MIL-P-60412."

and substitute:

"Packaging shall be in accordance with Drawing 8864492 and MIL-P-60412, except, no barrier bag shall be used in the packaging for the M767 Fuze Less Booster."

PAGE 109

Delete Section 5. PACKAGING in its entirety and substitute the following:

"5. PREPARATION FOR DELIVERY

5.1 Packaging. Packaging shall be in accordance with Drawing 8864492.

5.2 Packing. Packing shall be in accordance with Drawing 8861213.

5.3 Marking. Marking shall be in accordance with Drawing 8864492 and 8861213."

PAGE 112

6.10, add new 6.10f as follows:

"f. Use MIL-STD-109 as guidance."

Custodian:
Army-AR

Preparing activity
Army-AR

(Project 1390-0855)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T04:04Z
Check the source to verify that this is the current version before use.