INCH-POUND

MIL-DTL-82189C(MC)
30 October 1997
SUPERSEDING
MIL-C-82189B(MC)
22 June 1995

DETAIL SPECIFICATION

COAT, MAN'S - FULL DRESS, U.S. MARINE BAND, OFFICER'S

This specification is approved for use by U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1. Scope. This specification covers the requirements for a U.S. Marine Band Officer's full dress coat.

1.2. Classification. The coats will be of one type in the following classes and sizes as specified (see 6.2).

Class 1 - Director, Coat, Full Dress, Black
Class 2 - Assistant Director, Coat Full Dress, Scarlet

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-D), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Schedule of sizes

(Short, Regular, Long, Extra Long)

34 35 36 37 38 39 40 41 42 44 46

1.3. Individual orders. When the coat is custom tailored to an individual order, this specification will govern, except the detailed requirements of Section 3, Table I may be modified to the extent necessary for good custom tailoring practice.

2. APPLICABLE DOCUMENTS

2.1. General. The documents listed in this section are specified in sections 3 and 4 of this specification. This section does not include documents cited in other sections of this specification or recommended for additional information or as examples. While every effort has been made to ensure the completeness of this list, document users are cautioned that they must meet all specified requirements documents cited in sections 3 and 4 of this specification, whether or not they are listed.

2.2. Government documents.

2.2.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation (see 6.2).

SPECIFICATIONS

FEDERAL

A-A-50186 - Cloth, Cotton, Buckram
A-A-50196 - Thread, Silk
A-A-50198 - Thread, Gimp, Cotton, Buttonhole
A-A-50199 - Thread, Polyester Core, Cotton or Polyester Covered
A-A-52071 - Tape, Textile, Cotton, General Purpose (Unbleached, Bleached, or Dyed)
A-A-52094 - Thread, Cotton
A-A-52097 - Cloth, Wigan, Cotton

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

A-A-52106 - Cloth, Twill or Plain Weave Polyester and Polyester Blend
DDD-L-20 - Label: For Clothing Equipage, and Tentage, (General Use)

DEPARTMENT OF DEFENSE
MIL-C-368 - Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-DTL-3461 - Button, Insignia, Metal, Uniform and Cap
MIL-P-15064 - Pads, Shoulder and Sleeve-Head
MIL-L-17507 - Lace, Ornamental
MIL-E-20652 - Eyelets, Metallic, Eyelet Washers, (General Specification For)
MIL-C-21115 - Cloth, Tropical, Wool, Polyester/Wool
MIL-DTL-82114 - Coat Front - For Coats, Musicians
MIL-DTL-82194 - Ornamentation - For Jacket, Man's Evening Dress

STANDARDS

FEDERAL
FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitches, Seams, and Stitchings

(Unless otherwise indicated, copies of the above specifications, standards, handbooks are available from the Standardization Document Order Desk, 700 Robbins Avenue, Building 4D, Philadelphia, PA 19111-5094.)

2.3. Non-Government publications. The following document(s) form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DoDISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DoDISS are the issues of the documents cited in the solicitation (see 6.2).

ASTM E1282 - Standard Guide for Specifying the Chemical Compositions and Selecting Sampling Practices and Quantitative Analysis Methods for Metals and Alloys

(Application for copies should be addressed to American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

ANSI/ASQC Z1.4 - Sampling Procedures and Tables for Inspection by Attributes

(Application for copies should be addressed to the American National Standards Institute, 11 West 42nd Street, New York, NY 10036.)

Department of Defense (DoD) Standard Color Card of Official Standardized Shades for Sewing Threads 1968

(Application for copies should be addressed to the Color Association of the United States, Inc., 409 W. 44th Street, New York, NY 10016-0927.)

2.4. Order of precedence. In the event of a conflict between the text of this document and the references cited herein (except for related associated specifications or specification sheets), the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1. Standard sample. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2. First article. When specified (see 6.2), a sample shall be subjected to first article inspection in accordance with 4.3.

3.3. Materials.

3.3.1 Basic material. The basic material for each class of coat shall be as follows:

3.3.1.1. Class 1. Cloth, polyester and wool, tropical, black, shade 2607, 10.5 ounce, conforming to type III of MIL-C-21115.

3.3.1.2. Class 2. Cloth, wool, tropical, scarlet, shade 2502, 10.5 ounce, conforming to type I, class 1 of MIL-C-21115.

3.3.2 Lining. The material for lining the coats and collar and for making the underarm shields, collar eyelet covers, coat hanger and straps to secure the lining to the bottom edge of the

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

coat shall be cloth, rayon twill, black, shade 2604 for class 1 and scarlet, shade 2506 for class 2, conforming to class 1 of MIL-C-368.

3.3.3 Cloth, twill or plain weave polyester. The stays for the armhole and shoulder seams, reinforcement pieces for the collar eyelets, bindings for the lower edge of the collar, and neck edge of the coat front interlinings shall be cut from cloth, polyester or polyester blend, conforming to A-A-52106, except the requirement for non-fibrous material and seam efficiency shall not apply. The polyester or polyester blend shall be khaki, shade 3707 for the armhole and shoulder seam stays, the collar eyelet reinforcement pieces and the binding for the neck edge of front interlining; and black for the binding for the lower edge of the collar interlining.

3.3.4 Collar interlining. The material for the collar interlining shall be cloth, cotton, buckram, double texture, laminated, starch finish, natural color, conforming to type IV of A-A-50186. The weight of the laminated cloth shall be 21 to 23 ounces per square yard.

3.3.4.1. Plastic. The plastic strip used in the collar interlining shall be clear plastic stock, 0.020 inch thick. It shall be cut using the cotton buckram pattern.

3.3.4.2. Plastic interlining. The plastic interlining must withstand wet (dry) cleaning. It must not melt or become distorted under wet (dry) cleaning or pressing.

3.3.5 Reinforcement disc. The reinforcement discs for buttons secured to the side seam, with ring toggles, shall be punched from the cloth, cotton, buckram specified in 3.3.4. The reinforcement discs shall be 7/8 inch in diameter with a 1/8 inch diameter hole at the center.

3.3.6 Coat fronts. The coat fronts shall conform to the requirements of class 1 of MIL-DTL-82114.

3.3.7 Shoulder pads. The shoulder pads shall conform to the requirements of type I, class 2 of MIL-P-15064.

3.3.8 Sleeve-head pads. The sleeve-head pads shall conform to the requirements of type IV of MIL-P-15064.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

3.3.9 Stay tape. The stay tape for the armhole shall be cotton, unbleached, 1/4 inch wide, conforming to type II, class 1 of A-A-52071, except the requirement for non-fibrous material shall not apply.

3.3.10 Piping. The piping materials for the front and bottom edges of the coat and the ornamental back patch shall be cut 1-1/8 inches wide and shall conform to the following:

3.3.10.1.Class 1. Cloth, wool, tropical, scarlet, shade 2502, 10.5 ounce, conforming to type I, class 1 of MIL-C-21115.

3.3.10.2.Class 2. Cloth, polyester and wool, tropical, black, shade 2607, 8.5 to 9.5 ounce, conforming to type III of MIL-C-21115.

3.3.11 Binding. The binding for the collar interlining shall be cut one inch wide from the following materials:

a. Upper edge of collar interlining - cloth, polyester/wool blend as specified in 3.3.10.
b. Lower edge of collar interlining and underarm shields - cloth, polyester or polyester blend as specified in 3.3.3.

3.3.12 Wigan. The material for reinforcing the bottom edge of the sleeves shall be cloth, cotton, wigan, 2.5 ounces, conforming to A-A-52097.

3.3.13 Threads.

3.3.13.1.Silk thread. The silk thread shall conform to A-A-50196 as follows, except the requirements for extractable material shall not apply.

Use	Type	Class	Ticket No.	Ply
Bartacks and all outside seaming and stitching.	I	-	A	-
Machine felling.	-	-	O	-
Making buttonholes in coat.	I	-	B and F	3
Hand felling; and hand sewing.	III	3	C	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

3.3.13.2.Cotton thread. The cotton thread shall conform to A-A-52094 as follows:

Use	Type	Ticket No.	Ply
All inside seaming and stitching.	III	A	3
Serging and overedge stitching.	I	70	2
Machine tacking armholes and sewing on buttons.	I	24	3

The thread for basting shall be good commercial grade cotton. As an alternate to the cotton thread, a polyester core, cotton or polyester covered thread conforming to A-A-50199, ticket No. 50, 2 ply or ticket No. 70, 2 ply may be used.

3.3.13.3.Color and colorfastness. All thread shall be black shade for class 1 coats and scarlet, shade W, cable No. 66040 for class 2 coats, except the silk thread for stitching the braid shall be yellow and the cotton thread for tacking the sleeve lining, hand felling facing to interlining, and basting and machine tacking armholes may be white. The colored thread shall show the following colorfastness when tested as specified in the applicable thread specification (see DoD Standard Color Card of Standardized Shades For Sewing Threads 1968).

Thread	Color	Wet (dry) cleaning	Light
Cotton	Scarlet	Good	-
Silk	Scarlet	Fair	Fair
Silk	Black	Good	Good

3.3.14 Gimp. The buttonhole gimp shall be cotton, ticket No. 8, soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be black for class 1 coats and scarlet, shade W, cable No. 66040 for class 2 coats and shall show good fastness to wet (dry) cleaning.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

3.3.15 Ornamental braid. The ornamental braid for the coat fronts shall conform to the following requirements when tested as specified in Section 4, Table III:

Cover	
- material (covering)	metal thread
- color of wire	light gold
- metal wire (undercoating)	silver and copper
- plating material	gold
- winding thread	2 ply white or yellow cotton thread
Core (Stuffer)	
- material	cotton thread (soft)
- number of threads (minimum)	7
- ply of thread (minimum)	2
- color	gold
Weave	plain braided
- number of carrier (minimum)	12
- ends/carriers	6-8 (total 79)
- shape	tubular
- width (inch) (minimum)	3/8 + 1/16
- weight/linear yd. (grains)	154.5
Metal content (%)	
- gold	0.3
- silver	0.6
- copper	remainder (traces of nickel and zinc)
Fastness to	
- water	good
- wet (dry) cleaning	good

3.3.16 Buttons.

3.3.16.1. Insignia button. The insignia buttons shall be metal, gold plated, 27-line for ornamental sleeve patches; and 40-line

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

for fronts and back patches, conforming to type I, style 3, class A, subclass 1 of MIL-DTL-3461.

3.3.16.2.Ring toggle. Ring toggles for securing the 27-line buttons to ornamental sleeve patches and the 40-line buttons to the fronts and ornamental back panel shall conform to MIL-DTL-3461.

3.3.17 Collar closure for hook and eye. The hook and eye for closing the collar shall be brass, black japanned finish or black chemical finish followed by a clear lacquer coating and conform to the requirements of Figure 13.

3.3.17.1.Eyelets. The eyelets for the collar shall be brass, rolled flange type, with barrel scored 6 to 8 scores. The eyelets shall conform to MIL-E-20652, sheet 1A-BE108 and be enameled in a black shade.

3.3.18 Labels. Each coat shall have a combination instruction/identification label and a size label as follows. The coat is intended to be wet (dry) cleaned and the labels shall show fastness to wet (dry) cleaning.

3.3.18.1.Combination instruction/identification label. The combination instruction/identification label shall conform to type VI, classes 1 and 3 (combined) of DDD-L-20 except all printing and the space between the lines of printing shall be minimum 10 point (approximately 1/8 inch). The content and format shall be as follows:

Nomenclature: (item description)
Contract number:
Date:
Name of contractor:
Wool Products Act information:
DRY CLEAN ONLY

3.3.18.2.Size label. The size label shall conform to type VI, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S (short), R (regular), L (long), or XL (extra long), as shown by the following example:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

3.3.19 Vinyl piping. The white vinyl cord for piping the upper edge of the collar shall be tubular, with 7/16 inch-wide welt and serrated edges.

3.3.20 Sleeve ornamentation. The sleeve ornamentation for the coat shall conform to type III of MIL-DTL-82194.

3.3.21 Collar gold lace. The gold lace for the collar shall conform to type II, class 1, of style A of MIL-L-17507.

3.4. Design. The coat shall be the U.S. Marine Corps design shown on Figures 1 through 13, a seven-button, single breasted, semiform-fitting, fully lined coat with 14 gold plated buttons on the right front and seven buttons on the left front and seven rows of gold braid on the upper fronts; skirt type lower body parts with waist darts; a waist seam, a three piece back with six gold plated buttons on the ornamental patch at the center back; ornamental sleeve piece (sleeve piece normally provided by customer) with three gold plated buttons; a standup collar with gold braid, hook and eye closure and metal collar eyelets. The front and bottom edges of coat and back ornamental pieces shall be piped with the applicable piping for each class coat.

3.5. Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard pattern. The standard patterns shall provide 3/4 inch allowance for joining side seams and for seams joining skirt to center back; and 3/8 inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

3.5.1 List of pattern parts. Coats shall be cut from the specified materials in accordance with the pattern parts as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

ITEM	PATTERN NOMENCLATURE	NO. OF CUT PARTS
	Material basic: Cloth, wool, tropical	
1	Front	2
2	Front facing, right	1
3	Front facing, left	1
4	Side body front	2
5	Center back	1
6	Top sleeve	2
7	Under sleeve	2
8	Collar, outer ply	2
9	Skirt (lower body part)	2
10	Side back	2
11	Ornamental back patches	4
12	Underarm shields	2
	Material: Cloth, rayon, lining	
13	Skirt (lower body lining)	2
14	Front upper	2
15	Side back	2
16	Center back	2
17	Top sleeve	2
18	Under sleeve	2
19	Collar lining	1
20	Collar eyelet cover	2
21	Front eyelet cover	1
	Material: Cloth, cotton, buckram	
22	Collar interlining	1
	Material: Cloth, polyester/polyester blend	
23	Collar interlining	1
	Material: Mylar plastic	
24	Collar interlining	1
	Material: Cloth, cotton, wigan	
25	Reinforcement (bottom edges of sleeves)	2
	Markers	
26	Sleeve ornamentation	-

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

3.6. Construction.

3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam, and stitching type specified in Table I.

3.6.1.1. Operations. The contractor is not required to follow the exact sequence of operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1.2. Stitches, seams, and stitchings. The stitch, seam, and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicate the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.2.1 Thread breaks and ends of seams. The ends of all seams and stitching produced with 301 type stitch, except ends of a continuous line of stitching when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

3.6.1.3. Shade marking. The component parts of the coat, cut from one piece of wool and lining materials, including pairs of sleeve linings and underarm shields when cut from ends, shall be shade marked to ensure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.
(b) Sew-on shade tickets.
(c) Adhesive type tickets where adhesive causes discoloration or whose adhesive mass adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
1	Cutting. a. Cut coats in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction of warp as indicated by directional lines on the patterns. c. Cut all poly/wool/wool parts from one piece of basic material. Cut the strips for the shoulder loops from the basic 2-3/4 inches long and sufficient width so they finish 5/8 ± 1/8 inch wide and 3/4 to 1 inch long. d. Cut the body and collar linings, the collar eyelet covers, and the front eyelet cover from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the sleeve shall match. Cut the strips for coat hanger and lining securing straps 1-1/8 inch wide. e. Cut polyester or polyester blend stays for armhole, shoulder seams and armhole shields on the bias, 3/4 inch wide and 4 ± 1/4 inches long. Cut the polyester or polyester blend for binding the neck edge of the coat front interlining on the bias, 3/4 inch wide and approximately 5 inches long. Cut the polyester or polyester blend for the collar interlining on the straight in accordance with the pattern furnished. f. Cut the cotton buckram and plastic strip for interlining the collar on the straight in accordance with the pattern furnished.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
1	Cutting. (cont'd) g. Cut the cotton felt for padding the collar 1-1/4 inches wide and of sufficient length to fold over the ends of the interlining for each size of collar. h. Cut the piping material (see 3.3.10) for piping the front and bottom edges of coats, and ornamental back patches on the straight. The piping shall be cut 5/8 to 3/4 inch wide for ornamental back patches, and 1-1/8 inches wide for the front and bottom edges of the coat. i. Cut the wigan for reinforcing the bottom of sleeves on the bias in accordance with the pattern. j. Punch the reinforcement discs for buttons secured to the back patches from cloth cotton buckram. The reinforcement disc shall be 7/8 inch diameter with a 1/8 inch diameter hole at the center. k. The use of drill holes is prohibited.					
2	Replacement of damaged parts. a. At time of cutting, replace all parts of coat containing holes; seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, etc., expected to develop into holes; shade bars and dye streaks; or unsightly slubs, etc., affecting appearance. b. Replace any part damaged during the manufacturing process by needle chews which may be expected to develop into a hole, scissors or knife cuts, tears, holes, mends or burns.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
3	Shade marking.					
	a. Mark or ticket (see 3.6.1.3) all component parts cut from one piece of basic and lining materials, and pairs of sleeve linings when cut from ends, to insure uniform shade and size throughout the coat.					
	b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					
4	Make coat hanger and lining securing straps.					
	Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8 inch wide strip of lining material in half length-wise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	12-16	A	A
	b. Cut the coat hanger 3-3/4 ± 1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ± 1/4 inches long.					
5	Make collar eyelet covers.					
	Finished appearance. The collar eyelet covers shall finish 1-3/4 ± 1/8 inches wide.					
	a. Turn under the side edges of the collar eyelet covers. Stitch 1/16 to 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1 (each side edge)	12-16	A	A
	b. Fold each cover in half across the width. Seam 1/16 to 1/8 inch from the folded side edges.	301	SSa-1	12-16	A	A
6	Make underarm shields.					
	Finished appearance. The shields shall be finished smooth and flat without puckers, pleats, gathers, or other distortions.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
6	Make underarm shields. (cont'd)					
	a. Position the two plies of material for the underarm shields with edges even. Seam the two plies together along the curved side and bottom edges 3/8 inch from the edges.	301	SSa-1	12-16	A	A
	b. Turn the shield right side out, working out the seamed edges completely.					
	c. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
7	Make shoulder loops.					
	Finished appearance. The shoulder loops shall be uniform in appearance and shall finish smooth and flat without puckers, pleats, gathers, or other distortions. The loops shall finish 3/4 inch +1/8 wide and 1+ 1/8 inch in length.					
	a. Fold the strip for the loops in half lengthwise and seam together 1/4 inch from the raw edge.	301	EFp-1	12-16	A	A
	b. Press the seam open, smooth and flat with a heated pressing iron.					
	c. Turn loops right side out, with seamline in center of underside and press smooth and flat with a heated pressing iron.					
8	Stitch and press dart in under sleeve.					
	a. Fold the under sleeve, matching the cut edges of the sleeve darts. Stitch the entire length of the dart, 1/4 inch from the cut edges of the armhole, and taper the line of stitching to zero at the lower folded edges.	301	SSa-1 (cut edges) OSf-1 folded edge	12-16	A	A
	b. Turn the cut edges of the dart toward the forearm edge and press the entire dart smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
9	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of under sleeve. The notches in the lower forearm edge of top and under sleeve shall match. Seam top and under sleeves together, 3/8 inch from the forearm edge of top of the sleeve, forming a tapered outlet on the under sleeve.	301	SSbd-1 and SSa-1	12-16	A	A
	b. Spread open the seam and press flat with a heated pressing iron.					
	c. Mark sleeve end for turnup; and mark the top sleeve for positioning the ornamental sleeve patch with the pattern marker.					
10	Baste wigan reinforcement to sleeve.					
	a. Position the sleeve on the wigan reinforcement piece with the marks and notches matching.					
	b. Baste the sleeve and wigan piece together at the mark for the bottom turnup.	101 or Hand				
	c. Tack the sleeve to the reinforcement piece along the forearm seam allowance, and along the backarm edges of the top and under sleeve.	101 or 301	SSa-1	8-12 8-12	A A	A A
11	Make front eyelet cover.					
	a. Fold front eyelet cover in half lengthwise and stitch across bottom edge with a 1/4 inch seam.	301	SSa-1	10-14	A	A
	b. Turn the cover right side out. Press and crease the folded and seamed edges smooth and flat with a iron or machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
12	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve together at the backarm with a 3/8 inch seam, catching the ends in the wigan reinforcement piece in the stitching.	301	SSa-1	12-16	A (silk)	A (silk)
	b. Spread open the seam and press smooth and flat with a heated pressing iron.					
13	Baste and tack sleeve turnup to reinforcement.					
	a. Turn up the bottom edge of sleeve to the inside at the mark and baste along the turned edge.	101 or Hand				
	b. Tack the raw edge of the turn up portion to the reinforcement wigan piece with blind stitching.	301 or Hand	EFc-1	4-6 4-6	C (silk) A	A (silk)
14	Stitch and press dart in under sleeve linings.					
	a. Fold the under sleeve lining, matching the cut edges of the under sleeve dart. Stitch the entire length of the dart, 1/4 inch from the cut edges at the armhole, and taper the line of stitching to zero at the lower folded edge.	301	SSa-1 (cut edges) OSf-1 folded edge	12-16	A	A
	b. Turn the cut edges of the dart toward the forearm edge and press the entire dart smooth and flat with a heated pressing iron.					
15	Seam sleeve lining at forearm.					
	Finish appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
15	Seam sleeve lining at forearm. (cont'd)					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of the under sleeve lining. The notches at the lower forearm edge of the top and under sleeve lining shall match. Seam the top and under sleeve lining together, 3/8 inch from the forearm edge of top sleeve lining, forming a tapered outlet on the under sleeve lining.	301	SSbd-1 and SSa-1	12-16	A	A
16	Seam sleeve lining at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve linings at the backarm with a 3/8 inch seam.	301	SSa-1	12-16	A	A
17	Assemble sleeve and sleeve lining.					
	Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of the lining extending approximately 1 inch beyond the armhole edge of the sleeve.					
	b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the top sleeve, commencing at the top edge of the wigan reinforcement piece and extending to approximately 6 inches from the armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand	SSa-1	6-8 4-6	A	A
	c. Pull sleeve through lining.					
18	Fell turnup of sleeve lining.					
	Finished appearance. The sleeve lining shall not be short, tight, or twisted at bottom of sleeves.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
18	Fell turnup of sleeve lining. (cont'd)					
	a. Turn under the bottom edge of the sleeve lining to finish 1 to 1-1/4 inches above the finished end of the sleeve. Baste to turnup of sleeve; or the sleeve lining may be felled to bottom sleeve without basting.	Hand or 101				
	b. Fell the folded edge of the sleeve lining to the turnup of the sleeve with blind stitching.	Hand or 301	EFc-1 (b)	8-10 6-8	0 (silk) C (silk)	0 (silk)
19	Press sleeves.					
	a. Turn the sleeve right side out and assemble in pairs. Press the lower half of sleeve smooth and flat, creasing at the forearm and backarm. The backarm crease shall be on the backarm seam. Remove the basting at lower end of the sleeve.					
20	Assemble collar interlining.					
	Finished appearance. The interlining is made of one ply of plastic (mylar), one ply of laminated buckram and one ply of polyester or polyester blend cloth. The interlining shall be constructed without distortions, pleats, or twists.					
	a. Position one ply of plastic, laminated buckram, and polyester or polyester blend cloth together and join with a 1/8 inch seam on the upper and lower edges. The interlining shall finish with the polyester or polyester blend cloth positioned on the inside and the plastic (mylar) on the outside. (See Figure 10)	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
20	Assemble collar interlining. (cont'd)					
	b. Lap the raw edge of the collar eyelet cover 1/2 to 5/8 inch on the top inside edge of the collar interlining. Seam the covers to the interlining 1/4 inch from the raw edge of the cover. In the finished coat, the collar eyelet covers shall be centered over the eyelet in the collar.	301	LSa-1	12-16	A	A
21	Pipe outer ply of collar.					
	Finished appearance. The piping shall extend at lower, upper and side edges of the outer ply. It shall be uniformly stitched without twists, gathers, puckers, or pleats.					
	a. The outer ply shall consist of two plies of basic material piped at lower edges with 3/4 inch wide strip of the piping material specified in 3.3.10. The upper edge is piped with the white vinyl specified in 3.3.19.					
	b. Position the two plies of the outer collar together (face up and edges even) and stitch together from end to end, 1/8 inch from upper and lower edges.	301	SSa-1	12-16	A (silk)	A (silk)
	c. Seam the 3/4 inch wide strip of piping and vinyl to the two plies of the collar from end to end, 1/8 inch from upper and lower edges.	301	SSe-2	12-16	A (silk)	A (silk)
	d. Turn back the piping and outer ply at the lower edges, uniformly working the folded edge of the piping beyond the edges. Topstitch the outer ply uniformly, 3/16 inch from the folded edge of the piping. The vinyl piping on the upper collar edge shall be trimmed even with the end of the collar.	301	BSm-3 (b)	12-16	A (silk)	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
22	Assemble collar.					
	a. Center the interlining assembly on the outer collar. Fold the upper and lower edges of the collar over the interlining assembly and stitch together with a 1/4 inch seam from the folded edge.	301	SSa-1	12-14	A	A
	b. The piping shall be positioned 1/8 inch above the folded upper edge and on the inside of the collar. The piping and collar shall be stitched together from end to end with a 1/8 inch seam from the edge of the collar. (The piping shall be as specified in 3.3.10).	301	SSa-1	12-14	A	A
	c. Lap the upper edge of the collar over the top raw edge of collar lining, approximately 1/2 inch, with the lining and eyelet cover facing up. Stitch collar to lining and eyelet cover 3/16 inch in along the upper edge. The stitching shall extend from center to center of eyelet covers.	301	SSa-1	12-14	A	A
	d. Stitch the gold lace to the finished folded edges of the top collar 1/16 inch from both edges of the lace and positioned 1/8 inch in from the finished scarlet edges. The lining and eyelet covers shall be facing up. The lace may be stitched without basting provided the proper appearance and neatness requirements are maintained.	301	SSaa-2 (strands) OSe-1 (corners)	12-14	A	A
	e. Turn collar lining and eyelet covers at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine.					
23	Make collar extension tab.					
	Finished appearance. The collar extension tab shall extend 3/4 to 7/8 inch beyond the folded edge at the left end of the collar.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
23	Make collar extension tab. (cont'd)					
	a. Turn the top and bottom edges, and the end of the collar lining at the left end of the collar, to the inside of the lining. Baste the turned portion along the top, front, and bottom edges to the body of the lining forming the collar extension tab.	Hand				
	b. Stitch the collar extension tab 1/16 inch from the top, front and bottom edges. Continue the stitching at the back of tab to top row, forming a 1-3/8 to 1/2 inch wide box stitch.	301	SSc-1 (top and bottom edges) OSf-1 (front edge) SSa-1 (back edge)	12-16	A (silk)	A (silk)
24	Fell ends of collar.					
	Finished appearance. The upper piped edges of the collar at each end shall not be visible on the outside of the finished collar.					
	a. Fold the ends of collar to the inside, against the ends of interlining. Tack collar to reinforcement pieces and eyelet covers with overcast stitching.	Hand		2-3	C (silk)	
	b. Attach metal eyelets on each end of the collar midway between the top and bottom edges and 1-3/4 inch ± 1/8 inch from the finished ends.					
25	Assemble body lining.					
	Finished appearance. The darts and seams shall finish without gathers, puckers, or pleats.					
	a. The body lining shall consist of an upper front, a side front, a side back panel, a center back panel and skirt.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
25	Assemble body lining. (cont'd)					
	b. Fold the upper front lining lengthwise, with notches matching, and stitch front darts in accordance with the marks on the pattern. The line of stitching for the waist dart shall be 3/8 inch from the folded edge of the dart at the waist, tapering to a flat point at the top end, and shall be securely backtacked.	301	OSf-1	10-14	A	A
	c. Fold the underarm dart in front and seam with a 3/8 inch seam at the center, tapering to zero at the upper and lower ends.	301	OSf-1	10-14	A	A
	d. Position the back side panel and fronts with edges even and notches matching. Seam together at the side seam with 3/4 inch seam.	301	SSa-1	10-14	A	A
	e. Position center back panel and side back panel with edges even and notches matching. Join together with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	f. Overedge the side front seam allowance together.	503 or 504	EFd-1	6-10	70/2	70/2
			EFd-1	6-10	70/2	70/2
	g. Overedge stitch the side back seam allowance together.	503 or 504	EFs-1	6-10	70/2	70/2
	h. Fold the skirt dart in accordance with marks on patterns and press the length of the dart. Lower end of the dart shall taper to a flat point. Dart shall finish approximately 5-1/4 inch long.					
	i. Position the upper and lower parts of assembly with front edges even and join together at the waist with a 3/8 inch seam and with the upper edge of the 3/4 inch fold dart in the stitches.	301	SSa-1	10-14	A	A
26	Attach front eyelet cover to facing.					
	a. Fold front eyelet cover in half lengthwise right side out. Press the cover smooth and flat with a heated iron or machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
	b. Position the eyelet cover on the outside of the left front facing with top, bottom and front raw edges even. Stitch the cover to the facing 3/16 to 1/4 inch from raw edge.	301	SSa-1	12-16	A	A
27	Sew on identification label.					
	Finished appearance. The identification label shall be positioned so that in the finished coat, the label shall be midway between front and back edges of the right facing and the bottom edge of the label shall be approximately four inches from the bottom finished edge of the coat.					
	a. Sew the identification label to the outside of the right facing with a single row of stitches 1/16 to 1/8 inch from each edge.	301	SSa-1 (each edge)	12-16	A	A
28	Join front lining to wool facing.					
	Finished appearance. The lining shall be carefully joined to the facing so that, in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material, or other distortion.					
	a. Position the lining on the wool facing with the top edges even.					
	b. Seam front edges of the lining to the back edge of the facing, 3/8 inch from the edge. The stitching shall extend from the top edge of facing to approximately 1-1/4 inches from the bottom edge.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
29	Make outer assembly. Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly. a. The assembly shall consist of an upper front, a side front panel, a side back panel, center back and skirt.					
	b. Overedge stitch the following raw edges of basic material; the waist seam, underarm seam, side seam and side back seam.	503 or 504	EFd-1	6-10	70/2	70/2
	c. Fold upper front lengthwise with bottom notches matching and stitch front darts in accordance with marks on pattern. The line of stitching shall be 1/2 inch from the folded edge of the dart at the bottom, tapering to a flat point at the top end of dart and shall be securely backtacked.	301	OSf-1	12-16	A	A
	d. Properly position the upper front and side panel with edges even, and join together with a 3/8 inch seam.	301	SSa-1	12-16	A	A
	e. Position the back side panel with edges even and notches matching. Seam together at the side seam with a 3/4 inch seam.	301	SSa-1	12-16	A	A
	f. Fold the back skirt lengthwise with the upper notches matching and stitch darts in accordance with marks on pattern. The line of stitching shall be 3/4 inch from the folded edge of the dart at the top, tapering to a flat point at the bottom end of dart and shall be securely backtacked.	301	OSf-1	12-16	A	A
	g. Press skirt dart and upper front waist dart flat on dart seam without turning dart either to the right or left. Dart shall be equally distributed between right and left side of dart seam.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
29	Make outer assembly. (cont'd)					
	h. Spread open the under arm side seam and press flat with a heated iron.					
	i. Position the upper and lower assemblies with front and edges even and join together at the waist with a 3/8 inch seam. The 1/4 inch wide stay tape shall be positioned on the upper assemblies 1/4 inch from the lower edge and shall be caught in the stitching.	301	SSa-1	12-16	A	A
	j. The tape shall be sewn with normal tension not loose or tight, and shall extend from the side back seam to not more than 3 inches from the front edge of the front.					
	k. Spread open the waist seam and press smooth and flat with a heated iron.					
	l. Press and shape the fronts on a suitable heated pressing machine from the waist to the top edge, shrinking the fronts to eliminate the excess fullness of the chest.					
30	Make ornamental back patches.					
	Finished appearance. The back patch shall be uniform in appearance and shall finish smooth and flat, without twists, gathers, pleats, puckers or other distortions. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the back patch.					
	a. The back patch shall be made of two plies of basic material, piped with a 5/8 inch wide strip of piping material specified in 3.3.10.					
	b. Turn under one edge of the piping 1/4 inch and seamed the turned portion to the body of the piping 1/8 inch from the folded edge.	301	EFa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
30	Make ornamental back patches. (cont'd)					
	c. Position the scalloped side and the bottom raw edges of the top ply of patch even with the raw turned under edge of piping.					
	d. Seam the piping to the scalloped side and the bottom edges of the top ply, 1/8 inch from the edges. Trim and notch piping in accordance with good practice in order to prevent pulling, and to eliminate gathers and bulges at the corners.	301	EFa-1	12-16	A	A
	e. Position and seam together the top and under plies of the patch through the piping, 1/8 inch from the raw piped edges of the top ply. Trim the excess material from the under ply where necessary.	302	SSk-1 (a) with out cord and top-stitch	12-16	A (silk)	A (silk)
	f. Turn the patches, working the piping out completely and forming smooth corners and point at the scalloped side edges.					
	g. Topstitch the back patches uniformly 3/16 inch from the folded edge of the piping.	301	SSk-1 (b)	12-16	A	A
	h. Press back patches smooth and flat with an iron or machine. Assemble patches in pairs.					
31	Stitch ornamental back patches to skirt.					
	Finished appearance. Patches shall be joined without distortion either to patch or coat.					
	a. Position the patch on back edge of skirt with raw top and back edges even. Join together 3/8 inch from the back raw edge starting 1/2 inch below the top edge of waist line.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
32	Make eyelets in back.					
	Finished appearance. The eyelets shall be well worked with the purling on the outside of the back and shall finish with a 1/8 inch opening. All stitches shall be securely caught in the fabric.					
	a. Mark location of eyelets in the back patches for removable buttons in accordance with marks on pattern.					
	b. Make an eyelet at each mark through back patches.	Eyelet		22 (min)	A (silk)	A (silk)
33	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The polyester reinforcement stay shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers, or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4 inch wide polyester stays to the underside of the front at the shoulder edge and upper front edge of the armhole, 1/8 inch from the outer edge. The stay at the armhole shall extend from 1/2 inch below the shoulder seam down the front edge of armhole approximately 4-1/2 inches. The stay on the shoulder shall extend from approximately 1/2 inch from armhole and neck.	301	SSaa-1	12-16	A	A
34	Tape armholes.					
	a. Sew the cotton tape to the armhole starting with one end approximately one inch above the notch in the fronts and continuing along the lower and back edges of the armhole to approximately 1/2 inch from the shoulder edge.	301	SSaa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
34	Tape armholes. (cont'd) b. The tape shall be stitched with slight tension along the lower front edge of the armhole and shall be held taut while stitching along the back edge.					
35	Press shoulder blades and armhole tapes. a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or machine.					
36	Shape fronts and trim bottom. a. Mark and shape the front edges of the coat. Dress left front on a line running from the top notch to the waist seam, 1 inch from waist seam to notch at bottom, as indicated on the pattern. b. Mark and shape the lower edge of coat. Trim 1/4 inch from the bottom of right front beginning at front edge and tapering to zero approximately 4 inches from dressed front. c. Trim the bottom edge of coat, matching the length of the right and left parts. Trim the bottom end of the seams. d. In the finished coat, the left front shall overlap the right front 4 $\pm$ 1/4 inches from the edge.					
37	Stitch piping to coat. Finished appearance. The piping shall be uniformly stitched to the coat without twists, gathers, puckers, or pleats. The piping shall extend from the collar notch at top edge of the right front, along the bottom and up to the collar notch at the top edge of the left front.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
37	Stitch piping to coat. (cont'd)					
	a. Position the 1-1/8 inch strip of piping material on the outside of left and right fronts, with edge even with top, front, and bottom edges of coat. Stitch the piping to coat 1/8 inch from edge. The piping shall extend from the bottom right front edge to the collar notch at the top edge of left front.	301	SSa-1	12-16	A (silk)	A (silk)
	b. Turn the piping to the inside, folding the corners smooth and flat and working out the folded edge of piping uniformly, 1/8 inch beyond the edges of the coat.					
	c. Topstitch the piped edges of the coat evenly 3/16 inch from the folded edge of the piping, catching the turned under portion of the piping in the stitching.	301	SSe-2	12-16	A (silk)	A (silk)
	d. Notch out any excess piping material at the top and bottom front corners to eliminate bulkiness. Trim the inner edge of piping only on the left front from the upper front down to approximately 1 to 1-1/2 inches below waistline, so that the piping will not interfere with the front buttonholes.					
	e. Serge stitch the raw edge of the piping at the bottom edge of the coat only.	503 or 504	EFd-1 EFd-1	6-8 6-8	70/2 70/2	70/2 70/2
	f. Press the piped edges of coat smooth and flat with a heated pressing iron or pressing machine.					
38	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlinings. Baste the interlining and fronts together from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
38	Interline fronts. (cont'd)					
	b. Baste along the shoulder, allowing room for setting the shoulder pad, working the fullness in the fronts towards the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge. Continue to baste down the back edge of interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulder to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of the fronts.	Hand or 301	Hopper			
39	Trim coat front interlining.					
	a. Trim the top edge of coat interlining even with the top edge of fronts from the point of the shoulder to the collar notch.					
	b. Notch the top edge of the interlining in line with collar notch.					
	c. Remove stitches joining the front edge of polyester to coat front interlining, approximately 1/2 inch back from the front and top edges of fronts.					
	d. Turn the fronts inside out and trim the interlining only, approximately 1/4 inch back from the front and top edges of fronts.					
	e. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts. Taper the trimming to 3/8 inch at the neck.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
40	Bind front and top edge of interlining.					
	a. Fold the polyester twill back and over the top and front raw edge of the interlining. Stitch the front turned under portion of the polyester twill to the body of the interlining with three rows of stitches, 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the upper turned under portion in the stitching.	301	EFa-3	12-16	A	A
41	Bind top neck edge of interlining.					
	Finished appearance. The polyester binding shall be uniformly stitched to the top edge of the coat front interlining from the collar notch to the shoulder point.					
	a. Lap the 3/4 inch wide binding on the outside of the coat front interlining from the collar notch to the shoulder point approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	12-16	A	A
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301	EFa-1	12-16	A	A
42	Fell piping to coat front interlining.					
	a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste the piping to the interlining through the fronts.	101				
	b. Fell the upper front and lower inner edge of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A (silk) A	C (silk)
	c. Pull and remove basting stitches from the piping.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
42	Fell piping to coat front interlining. (cont'd) d. Press the left and right fronts on a suitable type of heated pressing machine, with the chest to conform to the shape of the body.					
43	Mark fronts for positioning the braid, buttonholes and eyelets (see Figure 6). a. Mark the location of buttonholes on the outside of the left front. The top and bottom buttonholes shall be in accordance with the marks on the pattern. The remaining buttonholes shall be evenly spaced. b. Extend each buttonhole line towards the armhole edge. (Line B shall be one inch shorter than line A. The length of the top and bottom line is determined by the position of the harp on the second line from the top which shall be approximately 1-7/8 inches from armhole edge to the center of the harp. The second line from the top shall be measured from the front edge of the buttonhole line to the center of the harp. Transfer the same measurement to the bottom line less one inch. Draw a straight line from the bottom mark through the center of the harp mark up to the top line, establishing line A-C and B-D as shown on Figure 6.) c. Bisect the top line A-C and bottom B-D, and connect the points with a straight line E-F. d. Position left front on right front, face to face with collar notches even and left front edge one inch back from the right front edge at the collar notch and with waist seam and armhole edges even.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
43	Mark fronts for positioning the braid, buttonholes and eyelets (see Figure 6). (cont'd) e. Trace the lines on the right front to coincide with the lines on the left front. The lines on the right front shall extend approximately 2 to 2-1/4 inches from the front piped edge. The vertical lines on the right front shall be identical to lines C-D-E-F on the left front. f. Draw a circle 7/8 inch in diameter on each side of the horizontal lines, centered to bisect line E-F and with the edge of each circle touching the horizontal line forming a figure eight design as shown on Figure 6. g. Position the center of the harp pattern on the line C-D, with the upper edge of the pattern positioned at the bottom of each horizontal line. Mark the harp in accordance with the pattern marker. The bottom edge of the harp should be of equal distance from the line below. The braid shall not overlap, but may touch on the shorter/smaller sizes.					
44	Baste gold braid to fronts (see Figures 6 and 7). a. The braid shall be basted as shown in Figure 7 to the fronts on the marks shown in Figure 6. On the left side of the coat, the edge of the braid shall follow the edge of the buttonhole marks and the eyelet marks.	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
45	Stitch gold braid to fronts (see Figure 7).					
	a. The braid shall be stitched to the fronts as shown in Figure 7, 1/16 inch from each edge of the braid, except the stitching shall not cross over the center of the figure eight design. The braid on the left front shall be unstitched for approximately 3 inches from the front end of the buttonhole loop braid. The braid on the right front shall not be stitched for approximately 3 inches from the front end of button loop braid to allow for the placement of eyelets.	301	SSa-1 (each side)	12-16	A (silk)	A (silk)
46	Join facing to fronts.					
	a. Position the left and right fronts to the respective front facings (face to face), with the waistline notch of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of the facing. Mark the facing along the top, front, and bottom edges.					
	b. Lap the front edge of the right and left fronts, respectively at the marks on the outside of the facing. Join the front and facing together as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from top to bottom edge of coat front edge only.	301	LSa-1	12-16	A (silk)	A (silk)
	c. Trim excess facing material where necessary.					
47	Baste front edges.					
	a. Turn the facing-lining assemblies to the inside of fronts. Baste along the front edge of left and right fronts, working the facing back from the folded edge of the piping.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
48	Baste facing (second time).					
	a. Baste the facing to the fronts, approximately 1-1/4 inches from the top, front and bottom edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 301	Hopper			
	b. Turn under and baste the top edge of the facing to the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	Hand or 301	Hopper			
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend approximately 3 inches from shoulder edge of facings to approximately 1-1/4 inches from the lower edge of facing.	Hand or 301	Hopper			
	d. Turn under the bottom edge of the facing at the mark and baste along the folded edge.	Hand or 301	Hopper			
49	Tack facings to interlining.					
	a. Tack the right and left facing-lining seam allowances to the respective coat front interlinings from approximately 2-1/2 inches from the bottom edge of the coat to approximately 3 inches from the shoulder edge.	Hand or 103	SSm-1	4-6 4-6	A (silk) C (silk)	
50	Baste front linings to coat.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat. Baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
50	Baste front linings to coat. (cont'd)					
	b. Baste the front lining to the coat. Start at the lower end of chest pleat, continue along lower edge of armhole approximately 2 inches from the edge, and end at the side seam. Match side seams of coat and lining. Continue basting as close as possible to the side seam and then across the bottom towards the front, approximately 4 inches from the piped bottom edge of the coat.	Hand or 301	Hopper			
51	Baste back lining to coat.					
	a. Fold the back lining, forming approximately a 1 inch wide pleat at the center back. Baste the back lining to the coat along the center pleat from the top end, to approximately 4 inches from bottom finished edge of the coat.	Hand or 301	Hopper			
	b. Baste back lining to coat. Starting at side seam and continue approximately 3 inches from the armhole and shoulder edges.	Hand or 301	Hopper			
52	Hem bottom edge of lining.					
	Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, or pleats. The hem shall be 3/4 $\pm$ 1/8 inch wide. The lining securing straps shall be positioned on the side seam outlets of the lining with one edge even with the serged edge.					
	a. Hem the bottom edge of body lining with the raw edge turned under and one end of the securing straps positioned and caught in the stitching, 1/16 inch from the upper folded edge of hem.	301	EFb-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
53	Tack the lining securing straps to bottom of coat.					
	Finished appearance. The lining securing straps, when tacked to the bottom edge of coat, shall not cause twists or other distortions to either the coat or the lining. The end of the securing straps shall finish between the piping at bottom edge of coat and side seam allowance. In the finished coat, the lining shall not be visible below the bottom edge of the coat.					
	a. Position and securely tack the free end of the securing straps to the piping at the bottom edge of coat through the side seam allowance.	301	SSbh-3	12-16	A	A
	b. Position the bottom edge of the lining so that, in the finished coat, the lining shall not be visible below the bottom edge of the coat. Fold the lining securing straps across the width and stitch approximately 1/4 inch from the folded end in order to hold the lining in position.	301	OSf-1	6-10	A	A
54	Fell facings.					
	a. Fell the facings to the piping at the bottom edge of the coat. Start at the bottom edge of the lining and continue along the back and bottom edges of the facing to the front edge of the coat.	Hand		8-10	C (silk)	
	b. Fell the folded edge of the facings to the piping along the top edge from collar notch to front edge of coat.	Hand		8-10	C (silk)	
55	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim back lining even at the neck.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
55	Trim lining and interlining. (cont'd) c. Trim the shoulder edge of the front and back linings to approximately 3/4 inch from shoulder at the armhole edge.					
56	Baste shoulder pad to coat. a. Insert shoulder pads between interlining and chest padding of coat fronts. Securely tack the pads to the interlining and chest padding only.	Hand or 301	Hopper			
57	Make buttonholes. Finished appearance. The buttonholes shall be clean cut, well made, well worked over gimp to fit 40-line insignia buttons. The stitching of the buttonholes shall be securely caught in the basic material. The gimp and thread shall be pulled through to the underside of the front. The purling of the buttonholes shall be on the outside of the fronts. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of the coat. The buttonholes shall be cut first type. a. Remove the basting on the unstitched portion of the braid. b. Mark the left front for the location of buttonholes. The marks for the top and bottom buttonholes shall be in accordance with the patterns. The marks for the remaining buttonholes shall be evenly spaced. c. Make one horizontal eyelet end, square bar type buttonhole, cut 1-1/4 inches long, at each of the marks.	Button hole		60 per button hole (not incl. bartack)	B (silk)	F (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
57	Make buttonholes. (cont'd)					
	d. Securely bartack the end of each buttonhole, catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bartack		21 per bartack	A (silk)	A (silk)
	e. Rebaste the unstitched portion of the braid around the buttonholes and completely stitch that portion of the braid through the facing as shown on Figure 7.	301	SSav-2	10-14	A (silk)	A (silk)
58	Mark and make eyelets.					
	a. Mark the location of eyelets on the right and left fronts for removable buttons. The marks shall be between the braid strands at the top end of each loop.					
	b. Make the right front eyelets to engage with the buttonholes. The mark for the top eyelet shall be in line with the right end of the collar and the other eyelets shall be in vertical alignment with the top mark and equal distance from the front edge.	Eyelet		22 per eyelet	A	A
59	Seam shoulders.					
	Finished appearance. The shoulder seam shall finish without a distorted appearance.					
	a. Join the back to the fronts at the shoulders with a 3/8 inch seam, working in the fullness on the back in accordance with good manufacturing practice.	301	SSa-1	12-16	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulders short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
60	Set shoulder loops to coat.					
	a. The front end of each loop shall be stitched 5/8 inch in front of the shoulder seam and aligned with each other.	301	EFb-1	12-16	A	A
	b. Fold loop to the back turning under the raw end of the loop to the one inch required length of the finished loop. Stitch the loop to the coat 1/16 inch from the folded edge, catching the turned under end in the stitching.	301	EFb-1	12-16	A	A
	c. Position the front lining and coat front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the shoulder seam and gorge, catching the shoulder pad in the basting. Turn the coat on the inside.	Hand or 301	Hopper			
61	Baste back lining and facing-lining assembly at shoulders.					
	a. Turn under and lap the shoulder edge of the back lining on the facing-lining assembly. Baste lining to the coat along the folded edge of the back lining with the top end of the chest pleat caught in the basting.	Hand				
62	Seam neckline with size label and coat hanger.					
	Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label shall be positioned between the ends of the coat hanger. The ends of the coat hanger shall be positioned so that, in the finished coat, the hanger opening shall be 2 $\pm$ 1/8 inches long when measured along the lower edge of collar lining.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
62	Seam neckline with size label and coat hanger. (cont'd)					
	a. Join facings and back lining to coat at the neckline, from collar notch to collar notch, with a 1/4 inch seam. The upper edge of the size label and the ends of the hanger shall be positioned and caught in the stitching at the inside center back.	301	SSa-1	12-16	A	A
	b. Press the neckline of the coat smooth and flat with a heated pressing iron or pressing machine.					
63	Set collar with lining.					
	Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar.					
	a. Mark the neckline on the inside 3/8 to 1/2 inch from top edge for proper positioning of collar.					
	b. Position the collar with the lower edge lapped on the outside top edge of the coat at the mark.					
	c. Seam the collar to the coat from end to end as close as possible to, but not on top of the stitching for the piping, at the lower edge of the collar. The stitching shall not be through the collar lining.	301	LSa-1	12-16	A (silk)	A (silk)
64	Set sleeves.					
	Finished appearance. The armhole sleeve shall finish without twists, gathers, puckers, or pleats.					
	a. Position sleeve on outside of coat at the armhole, with backarm seam of sleeve matching the side back seam, and the notch in top sleeve and front matching.					
	b. Join the sleeve to the coat with a 3/8 inch seam, catching the end of the shoulder straps in the stitching.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
64	Set sleeves. (cont'd)					
	c. Press the entire armhole smooth and flat with a heated pressing iron, exercising care not to stretch the armhole. Spread open upper part of the armhole-sleeve seam from the backarm seam from the backarm seam of the sleeve to approximately midway between shoulder seam and notch at the front edge of armhole. Press smooth and flat with a heated pressing iron.					
	d. Fold the excess material at the armhole pit up to the line of stitching of the armhole sleeve seam, forming a hinge effect. The fold shall extend from the armhole notch to approximately four inches from the backarm seam.					
	e. Press the fold smooth and flat with a heated pressing iron.					
65	Baste armhole.					
	a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad, and front lining in place. Distribute fullness evenly. Turn the coat on the outside.	Hand or 301	Hopper			
	b. Baste around the outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm of the sleeve to the front notch of coat.	Hand or 301	Hopper			
66	Set underarm shields.					
	a. Baste or tack underarm shields at the base of the armhole.	Hand or 301				
67	Stitch sleeve-head pads and lining at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve-head pads and linings at the armhole.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
67	Stitch sleeve-head pads and lining at armhole. (cont'd)					
	a. Position the sleeve-head pad on the sleeve with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam and with the one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve-head pad to the sleeve front, end to end, through the armhole-sleeve seam allowance, 1/8 inch from the folded edge of the pad catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.	301	SSa-1	4-6	A	A
	c. The underarm shield may be basted to the armhole prior to stitching.					
68	Tack underarm shield to lining.					
	Finished appearance. The tacking for the underarm shield shall finish approximately 1/2 inch from the seamed edges.					
	a. Tack the underside of the underarm shield to the body lining along the side and bottom edges.	Hand		4-6	C (silk)	
69	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and the facing-lining assembly together at the shoulders. Place the stitching over the folded edge of the back lining and secure the top end of the chest pleat in the felling.	Hand		8-10	C (silk)	
	b. Fell the folded edge of facing to the piping along the top edge from collar notch to front edge of coat.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
70	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve lining matching.					
	b. Turn under the armhole edge of the sleeve lining. Lap the lining on the outside of the front and back linings and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole. Place the stitching over the folded edge of the sleeve lining, catching the underarm shield in the filling, and distribute the fullness in accordance with good commercial practice. Backstitch the lower armhole edge from backarm seam of the sleeve to the front edge of the shield.	Hand		8-10	C (silk)	
	-or-					
	c. Machine stitch the lower edge of the sleeve lining at the armhole, on the inside, from forearm seam to backarm seam. Hand fell the remaining portion as specified in operations 69.b.	301	SSa-1	12-16	A	A
	-or-					
	d. Machine stitch the lower edge of the sleeve lining at the armhole, on the inside, from forearm seam to backarm seam. Stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling.	Machine		8-10	C (silk)	
	NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.					
71	Sew hook and eye to collar.					
	Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at the front of the collar without misalignment.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
71	Sew hook and eye to collar. (cont'd)					
	a. Position and securely sew the hook to the right end and the eye to the left end of the collar. The hook and eye shall be positioned with their front edges even with the respective front ends of collar and securely sewn to the collar at the top and bottom edge of the hook and eye. The stitching on each side shall not be more than 3/8 inch from the front end of the collar, through the individual holes at the rear of the hook and eye.	Hand		16 per hook 16 per eye	C (silk)	
72	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (silk)	
	b. Turn under the end and top edge of the lining at the right end of the collar. Position the folded edge of the lining under the hook. Fell the folded end of the collar lining and continue felling along the top folded edge to the end of the stitching joining the lining to the collar.	Hand		8-10	C (silk)	
	c. Turn under and fell the lower edge of the collar lining to the coat from end to end. Catching the turned under portion of the lining at the right end in the felling. NOTE: The lower edge of collar lining may be basted to coat prior to felling.	Hand		8-10	C (silk)	
	d. Fell the collar extension tab to the left end of the collar. Continue along the folded top edge to the end of the stitching joining the lining to the collar.	Hand		8-10	C (silk)	
	e. Turn the collar eyelet covers to the inside of the collar. Fell the front edge from the top to bottom edge. Continue the felling along the bottom edge for a distance of 1/2 inch from front edge.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
73	Clean coat. a. Pull any basting thread, trim and remove any loose ends of thread; and remove any spots, stains and tickets without injury to the material.					
74	Press coat. a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. b. Press the fronts smooth and flat, straightening and shaping the front edges and working fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. c. Press the entire collar smooth and flat. d. Press the fronts on a body machine, shrinking and properly shaping the chest. e. Press the sides, working the fullness towards the back. f. Press the back smooth and flat, removing all fullness. g. Press the sleeves smooth and flat, creasing at the backarm and forearm. The backarm crease shall be on the backarm seam. The forearm and backarm creases shall extend uniformly to a point approximately 3 to 3-1/2 inches below the base of the armhole. h. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine. Press the shoulder straps flat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

TABLE I. Manufacturing requirements - Continued.

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/IN	NDL	BOB/ LPR
74	Press coat. (cont'd) i. Press the armholes solid from the inside, creasing the armhole at the front, and creasing the excess material at the armpit. The armpit and back of the armhole shall be held short while pressing. j. Block the armholes on a pressing buck, shrinking the top sleeves. k. Press lower edge of coat smooth, flat and even. l. Press body lining throughout, removing all back wrinkles and creases. Press the front and back lining pleats smooth and flat. m. Remove all gloss marks. n. Remove any wrinkles and creases missed by previous pressing operations.					
75	Attach buttons. Finished appearance. The buttons shall be aligned with the buttonholes to secure a smooth and complete closure without bulging or misalignment. a. Insert a 40 line button through each eyelet on the fronts and ornamental back patches and secure with a ring toggle. NOTE: All buttons shall be attached with the eagle's head in the upright position.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

3.7. Finished measurements. The finished coat shall conform to the measurements specified in Table II.

Table II. Finished measurements. 1/

Size (inches)	Breast 2/ (inches)	Back length 3/ (inches)	Sleeve length 4/ (inches)
		Short	
34	35	28-3/4	17-1/2
35	36	28-7/8	17-1/2
36	37	29	17-1/2
37	38	29-1/8	17-1/2
38	39	29-1/4	17-1/2
39	40	29-3/8	17-1/2
40	41	29-1/2	17-1/2
41	42	29-5/8	17-1/2
42	43	29-3/4	17-1/2
44	45	30	17-1/2
46	47	30-1/4	17-1/2
		Regular	
34	35	29-3/4	18-1/2
35	36	29-7/8	18-1/2
36	37	30	18-1/2
37	38	30-1/8	18-1/2
38	39	30-3/8	18-1/2
39	40	30-3/8	18-1/2
40	41	30-1/2	18-1/2
41	42	30-5/8	18-1/2
42	43	30-3/4	18-1/2
44	45	31	18-1/2
46	47	31-1/4	18-1/2
		Long	
34	35	30-3/4	19-1/2
35	36	30-7/8	19-1/2
36	37	31	19-1/2
37	38	31-1/8	19-1/2
38	39	31-1/4	19-1/2
39	40	31-3/8	19-1/2
40	41	31-1/2	19-1/2
41	42	31-5/8	19-1/2
42	43	31-3/4	19-1/2
44	45	32	19-1/2
46	47	32-1/4	19-1/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Table II. Finished measurements - Continued. 1/

Size (inches)	Breast 2/ (inches)	Back length 3/ (inches)	Sleeve length 4/ (inches)
Extra Long			
34	35	32-1/4	20-1/2
35	36	32-3/8	20-1/2
36	37	32-1/2	20-1/2
37	38	32-5/8	20-1/2
38	39	32-3/4	20-1/2
39	40	32-7/8	20-1/2
40	41	33	20-1/2
41	42	33-1/8	20-1/2
42	43	33-1/4	20-1/2
44	45	33-1/2	20-1/2
46	47	33-3/4	20-1/2

1/ Tolerance for all measurements ± 3/8 inch.

2/ Breast measurement shall be taken, with coat buttoned, from folded edge to folded edge in line with the pit of the armhole; multiply by 2.

3/ Back length measurement shall be taken along the center back seam, from the lower edge of the collar to the piped bottom edge of coat.

4/ Sleeve length measurement shall be taken along the forearm seam from the pit of the armhole to the bottom edge of the sleeve.

3.8. Workmanship. The finished coat shall conform to the quality and grade of product established by this specification.

3.9. Recycled, recovered, or environmentally preferable materials. Recycled, recovered, or environmentally preferable materials should be used to the maximum extent possible provided that the material meets or exceeds the operational and maintenance requirements, and promotes economically advantageous life cycle costs.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

4. VERIFICATION

4.1. Classification of inspection. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.3).
b. Conformance inspection (see 4.4.1).
c. In-process inspection (see 4.4.1.2).

4.2. Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in Table III.

4.3. First article inspection. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.4.2.1 through 4.4.2.5. The presence of any defect or failure to pass any test shall be cause for rejection of the first article. The number of units to be inspected shall be specified by the contracting officer (see 6.2).

4.4. Conformance inspection.

4.4.1 Component and material inspection. Components and materials shall be tested in accordance with all the requirements of referenced specifications, figures and standards unless otherwise excluded, amended, modified or qualified in this specification or applicable purchase document. In addition to testing provisions contained in subsidiary specifications, figures and standards, testing shall be performed on the components listed in Table III for the characteristics noted. Wherever applicable, tests shall be conducted in accordance with FED-STD-191. When the "Results reported as" columns are not indicated, they shall be reported as required by the referenced test method. All test reports shall contain individual values utilized in expressing the final results.

4.4.1.1. Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with ANSI/ASQC Z1.4. The unit for expressing lot sizes and sample unit for testing each component shall be in accordance with subsidiary specifications and as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Component	Expressed as	Sample unit for testing
Hook and eye	100 each	2 each, hook and eye
Gold braid	yards	2 yards

4.4.1.2. In-process inspection. Inspection shall be performed during manufacture of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with the specified requirements for operations or subassemblies.

4.4.2 Examination of end item. The end item shall be examined for the defects listed in 4.4.2.1 through 4.4.2.5. The sample unit shall be one completely fabricated coat.

Table III. Test methods.

Components	Characteristics	Reqmt. para.	Test method	No. det. per S/unit	Results reported as
Ornamental braid (front and sleeve)	Cover thread	3.3.15			
	- material identification		1200	1	Pass or fail
	- color		Visual	1	Pass or fail
	- ply		Visual	1	Pass or fail
	Cover wire	3.3.15			
	- metal undercoat		Std. com'l	1	Pass or fail
	- metal plating		Std. com'l	1	Pass or fail
	Core (stuffer)	3.3.15			
	- material identification 1/		1200	1	Pass or fail
	- no. of threads		Visual	1	Pass or fail
	- ply of threads		Visual	1	Pass or fail
	Color	3.3.15	Visual	1	Pass or fail

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Table III. Test methods - Continued.

Components	Characteristics	Reqmt. para.	Test method	No. det. per S/unit	Results reported as
Ornamental braid (front and sleeve) (cont'd)	Weave	3.3.15	Visual	1	Pass or fail
	No. of carriers	3.3.15	Visual	1	Pass or fail
	Ends/carriers	3.3.15	Visual	1	Pass or fail
	Shape	3.3.15	Visual	1	Pass or fail
	Width (in.)	3.3.15	5020	1	Pass or fail
	Metal content (%) - gold - silver - alloy	3.3.15	4.5.3	 2 2 2	To nearest 0.1%
	Fastness to: - water - wet (dry) cleaning 1/	 3.3.15 3.3.15	 5630 5620	1	 Good, fair or poor Good, fair or poor
Hook and eye	Material identification	3.3.17	Std. com'l	1	Pass or fail
	Finish	3.3.17	Std. com'l	1	Pass or fail
	Finish	3.3.17	4.5.2	1	Pass or fail

1/ Except that the colorfastness shall be evaluated after three wet (dry) cleaning cycles.

4.4.2.1. Classification of defects. All defects shall be classified as indicated below, except those numbered 1 through 24 in classification column which shall be classified as follows:

Major defect - When seriously affecting appearance or serviceability.

Minor A defect - When not seriously affecting appearance or serviceability.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

4.4.2.2. General defects. General defects shall be classified as follows:

Examine	Defects	Classification		
		Major	Minor A	Minor B
Buttonholes (construction)	a. One or more omitted, added, or wrong type.	101		
	b. Not corresponding to size of button:			
	- too small, not permitting button to enter buttonhole.	102		
	- too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		201	
	c. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	103		
	d. Bartack missing or loose on:			
	- one buttonhole.		202	
	- two or more buttonholes.	104		
	e. Bartack misplaced, not serving intended purpose on:			
	- one buttonhole.			301
	- two or more buttonholes.		203	
	f. One or more broken stitches in:			
	- one buttonhole.		204	
	- two or more buttonholes.	105		
	g. More than two skipped stitches in:			
	- one buttonhole.			302
	- two or more buttonholes.		205	
	h. Ragged edges, affecting appearance; or exposed interlining not colored with reddish indelible ink.			303
	i. Any uncut buttonhole.		206	
	j. Gimp omitted in one or more buttonholes; or end of gimp not pulled through to underside.		207	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Buttonhole (construction) (cont'd)	k. Stitches per buttonhole (not including bartack) less than the minimum specified:			
	- one or two stitches.			304
	- three or more stitches.		208	
	l. One or more buttonholes finished with purling on the underside.	106		
Buttons or ring toggles	a. One missing, loose, broken, defective, or improper size or type.		209	
	b. Two or more missing, loose, defective, or improper size or type.	107		
NOTE: Buttons shall be considered defective if they have sharp, rough, cracked or split edges; unsound soldering, scratches or dents; blemishes or imbedded foreign matter; loose shanks, or are poorly plated or badly shaded.				
Cleanness	a. One or more spots or stains, of a permanent nature, clearly noticeable:			
	- on the outside.	108		
	- on the inside.		210	
	b. One or more removable spots or stains clearly noticeable.			
	- on the outside.		211	
	- on the inside.			305
	c. Thread ends not trimmed throughout garment, or one or more bastings not removed, or two or more shade tickets not removed.			306
Components and assembly	a. Any component part or required operation omitted (unless otherwise classified herein).	1		
	b. Any defective component or defect of assembly (not herein classified).	2		

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Cutting	a. Any component part of the basic wool material not cut in accordance with directional lines on patterns, or in accordance with specification requirements.	109		
	b. Piping material cut on the bias.		212	
	c. Any lining part not cut in accordance with directional lines on patterns, or not in accordance with specification requirements.		213	
Eyelet (construction)	a. One or more omitted or added.	110		
	b. Wrong type.		214	
	c. Eyelet not securely caught on fabric, causing stitching to pull away from fabric.	111		
	d. Diameter of inside opening less than 1/8 inch or more than 1/4 inch.			307
	e. One or more eyelets uncut.		215	
	f. One or more broken stitches in: - one eyelet. - two or more eyelets.		 216	308
	g. More than two skipped stitches in one or more eyelets.			309
	h. One or more eyelets finished with purling on the underside.		217	
Hook and eye	a. Not specified type or size.		218	
	b. Hook or eye not securely tacked to ends of collar.		219	
	c. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hook and eye is fastened.		220	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Material defects and damages	a. Any weakening defects such as smashes, multiple floats, or loose slubs.	3		
	b. Any hole.	4		
	c. Shade bar, unsightly slub, etc., affecting appearance: - on outside. - on inside.	5	221	
	d. Scissors or knife cut, tear, mend or burn.	6		
	e. Needle chews that may develop into a hole.	7		

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have a negligible effect on serviceability are to be classified as follows:

Material defect - No defect
Workmanship damages - Minor B defect

Pressing	a. Burned or scorched.	8		
	b. Pressing omitted entire garment.		222	
	c. Armhole stretched.	9		
	d. Poorly pressed (unless otherwise indicated).			310
	e. Basting or pressing impressions not removed on major portion of coat.		223	
	f. Gloss not removed on major portion of coat.			311
	g. Armholes not blocked or poorly blocked, affecting appearance.		224	
Pressing (cont'd)	h. Edges bulky; i.e., not pressed solid, affecting appearance.		225	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	i. Inside of armhole not creased as required.		226	
	j. Sleeve not creased at front or backarm seam.		227	
	k. Wrinkles or pressing impressions not removed under side or center back seam allowance.		228	
	l. Linings not pressed smooth.		229	
	m. Armhole seam not pressed open across top as required.		230	
Seams and stitching	a. Accuracy of seaming:			
	1. Any seam twisted, puckered, or pleated affecting appearance.	112		
	2. Part of garment caught in any unrelated operation or stitching.	10		
	3. Unsightly hand felling or blind stitching exposed on outside of coat affecting appearance.		231	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.		232	
	5. Wrong color of thread or two shades of thread used on outside of coat, affecting appearance.	11		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular, i.e., unevenly gaged or various stitchings not uniform, affecting appearance.		233	
Seams and stitching (cont'd)	2. Beyond range of width specified; or varies more than 1/16 inch when no range is specified.			312

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	c. Open seams:			
	1. On outside:			313
	up to 1/4 inch inclusive.			
	- more than 1/4 inch but not more than 1/2 inch.		234	
	- more than 1/2 inch.	113		
	2. On inside:			
	- more than 1/2 inch (except machine felling).		235	
	- up to 1/2 inch inclusive (except machine felling).			314
	- up to 1 inch inclusive (machine felling).			315
	- more than 1 inch (machine felling).		236	

NOTE: One or more broken stitches or two or more continuous skipped or run off stitches constitute an open seam.

	d. Raw edges:			
	1. On outside:			
	- up to 1/8 inch inclusive.			316
	- more than 1/8 inch but not more than 1/4 inch.		237	
	- more than 1/4 inch.	114		
	2. On inside:			
	- more than 1/8 inch but not more than 1/4 inch.			317
	- more than 1/4 inch.		238	

NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as open seams.

	e. Run offs (see classification on open seams).			

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Seams and stitching (cont'd)	f. Stitch tension:			
	1. Loose tension resulting in loose seam.	115		
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		239	
	3. Tight tension (stitches break when normal strain is applied).	116		
NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test the seam by exerting normal pull in lengthwise direction of the seam.				
	g. Stitches per inch (excluding labels).			
	1. Less than minimum specified.			
	- one or two stitches.			318
	- three stitches.		240	
	- four or more stitches.	117		
NOTE: To be scored only if condition exists on major portion of seam.				
	h. Stitch and seam type:			
	1. Wrong stitch or seam type.		241	
	i. Stitching skipped or broken (on edge or raised stitching when seam is seamed, turned, and stitched):			
	- 1/4 inch or more but not more than 1/2 inch.			319
	- more than 1/2 inch.		242	
Shaded parts	a. Any outside part shaded.	12		
	b. Any lining part badly shaded except sleeve lining.		243	
Shaded parts (cont'd)	c. Sleeve lining parts badly shaded, or parts not matching each other.			320

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

4.4.2.3. Detailed defects (outside of coat). Detailed defects on outside of coat with coat buttoned on form shall be classified as follows:

Examine	Defects	Classification		
		Major	Minor A	Minor B
Collar (construction and setting)	a. Interlining omitted.	118		
	b. Interlining tight or twisted, causing puckers on collar, affecting appearance.		244	
	c. Tight at joining to front or back, causing puckers or pleats at neck of coat, affecting appearance.	13		
	d. Piping irregular, affecting appearance.		245	
	e. Collar ends overlapping when fastened.		246	
	f. Collar ends spread open more than 3/8 inch when fastened.		247	
	g. Front finished ends of collar uneven in width by 3/16 inch or more.		248	
	h. One ply of outer basic material.	119		
	i. Binding strip at top or bottom edge of interlining omitted.		249	
	j. Binding strip at top or bottom edge of interlining other than material specified.		250	
Collar (construction and setting) (cont'd)	k. Binding strip at top edge of interlining positioned more than 1/8 inch beyond the top edge of the piping on the outer ply of the collar.		251	
	l. Binding strip at top edge of interlining irregular in width, affecting appearance; or not exposed beyond top edge of piping on outer ply of collar.		252	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	m. Collar braid irregular, affecting appearance.		253	
	n. Center of eyelets from finished ends of collar:			
	- less than 1-3/8 inches but not less than 1-1/4 inches.			321
	- more than 1-5/8 inches but not more than 1-3/4 inches.			322
	- less than 1-1/4 inches or more than 1-3/4 inches.		254	
	o. One or both eyelets off-center with top and bottom edges of collar by more than 1/4 inch.			323
	p. Collar off-center by more than 3/8 inch.		255	
Alignment of front buttons and buttonholes	a. Not aligned, causing a noticeable bulge or twist on the fronts when buttoned, affecting appearance.		256	
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by:			
	- more than 1/8 inch but not more than 1/4 inch.		257	
	- more than 1/4 inch.	120		
Length of buttoned fronts (cont'd)	b. Left front at corner longer than right front by:			
	- more than 1/4 inch but not more than 3/8 inch.			324
	- more than 3/8 inch.		258	
	c. Right front at corner exposed beyond edge of left front by more than 1/8 inch.		259	
Shoulder (construction)	a. Improperly joined or set, causing shoulder or back to twist.	14		
Shoulder pads	a. Not completely caught in armhole tacking.		260	
	b. Misplaced, not serving the intended purpose; i.e., too far back or too far forward.		261	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	c. One or both pads omitted.		262	
Armholes (construction)	a. Badly stretched, affecting appearance.	15		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	16		
	c. Crooked seam, affecting appearance.		263	
	d. Tape stitching exposed and visible on outside surface.			325
	e. Sleeve-head pads not completely tacked to armholes; or misplaced, not serving intended purpose.		264	
	f. One or both sleeve-head pads omitted.		265	
Sleeves	a. Setting and hang:			
	1. Sleeve fullness misplaced, affecting appearance.		266	
Sleeves (cont'd)	2. Backarm seam of sleeve not matching side back seam by:			
	- more than 1/4 inch but not more than 1/2 inch.		267	
	- more than 1/2 inch.	121		
	3. Hang of sleeves on the same coat in opposite direction by more than two inches.		268	
	4. Sleeve tight in armhole, i.e., roll effect not present.		269	
	b. Sleeve lining:			
	1. Twisted, tight, or short, causing bulge, twist or puckering on outside of sleeves.	17		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			326

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of the sleeves.			327
	4. Cut dart on under sleeve omitted.			328
	5. One or both darts not pressed flat.			329
	c. Construction of sleeves:			
	1. Wigan twisted, tight or pleated, causing ridges or puckering on outside of bottom of sleeves, affecting appearance.		270	
	2. Tacking on bottom turnup to body of sleeve omitted or insecure.		271	
	3. Sleeve bottom edge uneven by more than 1/4 inch.			330
Sleeves (cont'd)	4. Tacking on one or both sleeve lining seams to sleeve seams omitted or insecure.			331
	5. Bottom edge of sleeve lining turnup less than one inch or more than 1-1/4 inches up from bottom edge of sleeve.			332
Body (outside)	a. Fitting of body lining:			
	1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	18		
	b. Fitting of front interlinings:			
	1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	19		
	2. Too full, causing coat front to have a wavy appearance.	20		

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Chest darts	a. One or both omitted.	122		
	b. Ends of one or both darts not properly tapered, causing a bulge or fullness, affecting appearance.		272	
	c. Darts not of uniform length by 1/4 inch or more.			333
	d. Cut edges of dart not turned towards armhole.			334
	e. Not pressed smooth and flat, affecting appearance.		273	
Waist darts	a. One or both omitted.	123		
	b. Top or lower end of one or both darts not properly tapered, causing a bulge or fullness, affecting appearance.		274	
Waist darts (cont'd)	c. Length of darts not uniform by 1/4 inch or more.			335
	d. Folded edge not pressed toward side seam.			336
	e. Not pressed smooth and flat.		275	
	f. Alignment of both waist darts: - top or bottom end out of horizontal alignment by 1/4 inch or more.			337
Ornamental front braid (position, construction and setting)	a. One or more rows of braid omitted or added.	124		
	b. One or more rows of braid on left front not horizontally aligned with corresponding row on right front by more than 1/2 inch.	125		
	c. One or more rows of braid not formed with a figure 8.	126		
	d. Diameter of figure 8 circle less than 27/32 inch or more than 7/8 inch.			338

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	e. Stitching of one or more rows of braid not started or ended as indicated by Figure 6.			339
	f. Stitching on one or more rows of braid not uniform in width, affecting appearance.			340
	g. Ends of stitching on one or more rows of braid not securely tacked.		276	
	h. One or more rows of braid not lying smooth; i.e., puckered, twisted, pleated or having excessive fullness, affecting appearance.	21		
Ornamental front braid (position, construction and setting) (cont'd)	i. One or more rows of braid set on tight, causing puckers, twists or pleats on front.	22		
	j. Braid not pressed smooth or flat.			341
	k. Braid loop around one or more buttonholes not properly positioned, restricting use of the buttonhole.		277	
	l. Front edge of one or more rows of braid on left front finished less than 1/4 inch from piping joining seam.		278	
	m. Any row of braid on left front out of vertical alignment by more than 1/8 inch.		279	
Front and bottom edges	a. Front edges stretched, affecting appearance.		280	
	b. Tape or piping set on tight, causing puckering on front, affecting appearance.		281	
	c. Front or bottom piping irregular, affecting appearance.		282	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	d. Bottom edge stretched, puckered, or uneven, affecting appearance.			342
	e. Bottom corner of left front poorly shaped, affecting appearance.		283	
	f. Left front rolling outward below bottom button.	23		
	g. Front edge irregular, affecting appearance.		284	
Front and bottom edges (cont'd)	h. Piping tight on front or bottom edge, causing puckering outside of coat, affecting appearance.		285	
	i. Left front not dressed as specified.		286	
Front facings	a. Short, tight or twisted, causing fullness or twists on fronts, affecting appearance.	24		
Back side panel seams	a. Curved panel seam on back of coat stretched or distorted, affecting appearance.		287	
Front buttonholes position	a. Position from front edge including piped edge: - less than 1/2 inch but not less than 3/8 inch.			343
	- more than 3/4 inch but not more than 7/8 inch.			344
	- less than 3/8 inch or more than 7/8 inch.		288	
	b. More than 1/4 inch from equal spacing.		289	
	c. Top or bottom buttonhole positioned more than 1/2 inch from pattern marks.		290	
	d. Unevenly spaced from front edge by more than 3/16 inch.		291	
Front buttons (position)	a. Out of vertical alignment by 1/4 inch or more.		292	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	b. Center of top button not in vertical alignment with right end of collar by 1/8 inch or more.		293	

4.4.2.4. Detailed defects (inside of coat). Detailed defects on inside of coat shall be classified as follows:

4.4.2.5.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Right front eyelet cover (construction, presence and position)	a. Front raw edges not stitched together prior to seaming to right facing.		294	
	b. Upper or lower seamed edge not hand felled to facing.		295	
	c. Upper or lower seamed edge not securely hand stitched to facing.			345
	d. Omitted.	127		
	e. Front corner of eyelet cover exposed beyond upper edge of right front.			346
	f. Front edge of cover positioned less than 1/4 inch or more than 3/4 inch in from front edge of right front.		296	
Labels	a. Any required label missing, incorrect, illegible; or size label not securely caught in stitching.	128		
	b. Identification label not stitched on four sides.		297	
	c. Bottom edge of identification label less than three inches or more than five inches from bottom finished edge of coat.			347

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	d. Identification label not stitched to outside of right facing.			348
Hanger	a. Hanger omitted or ends not securely stitched.	129		
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along the lower edge of the collar lining.		298	
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.		299	
Hanger (cont'd)	d. Finished width less than 1/4 inch or more than 3/8 inch wide.			349
Front facings	a. Fullness or pleats on facings between eyelets; buttonholes; or between front edge and eyelet or buttonholes.		201a	
	b. Tacking on back edge to one or both interlinings: - omitted. - insecure or incomplete for a distance of more than 4-1/2 inches below shoulder seams; or more than four inches above bottom edge of coat.		202a	350
	c. Felling at bottom edge of front facings or back omitted or insecure on one or both facings.		203a	
	d. Felling along folded edge of one or both facings at collar notch omitted or insecure.		204a	
Body linings	a. Excessive puckering or pleated.			351
	b. Twisted, not affecting smoothness on outside of coat.			352
	c. One or both chest pleats on shoulder omitted.		205a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	d. Folded edge of one or both chest pleats facing front edge of coat.			353
	e. Pleat omitted at center of back lining.		206a	
	f. Pleat less than 1/2 inch in depth at center of back lining.			354
	g. Bottom hem less than 5/8 inch or more than 7/8 inch wide.			355
	h. Lining too long; i.e., exposed beyond bottom edge of coat.		207a	
Body linings (cont'd)	i. Facing-lining seam, side seams, and side back seams not towards back or not pressed smooth and flat.		208a	
	j. Waist darts not towards the side seams or not pressed smooth and flat.		209a	
Lining (securing straps)	a. One or both omitted or insecure.		210a	
	b. Less than 1/4 inch or more than 3/8 inch wide.			356
	c. One or both positioned more than one inch from side seam.			357
	d. End of one or both straps not finished between the piping at the bottom edge of the coat and the side seam allowance.			358
	e. One or both not folded and stitched across width.			359
	f. One or both not properly attached to the lining hem or coat, causing twist or distortion to either the lining or the coat.		211a	
	g. One or both exposed beyond bottom edge of the coat.		212a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
Serge or overedge stitching	a. Basic material: - omitted on one or more raw edges for seams joining fronts and back where specified.		213a	
	b. Lining joined seams: - omitted on one or more seams where specified.		214a	
Underarm shields	a. One or both omitted.		215a	
	b. Not two-piece lining construction.		216a	
Underarm shields (cont'd)	c. Tacking on one or both shields along side or bottom edge to body lining omitted or insecure.			360
	d. Top edge not caught in armhole tacking or stitching when tacked by hand.			361
	e. Puckered, pleated, or twisted.			362
	f. One or both shields misplaced, not serving intended purpose.			363
Inside of armhole	a. Back stitching at armpit of armhole, from backarm seam of sleeve to front edge of shield, omitted.			364
Collar lining extension piece	a. Omitted.	130		
	b. Extended less than 1/2 inch or more than one inch beyond left end of collar.			365
	c. Felling omitted or insecure at end or top edges.		217a	
	d. Stitching at top, front and bottom edges, or across width of collar tab (forming box stitch) omitted.		218a	
Collar lining and eyelet covers	a. Ends of collar lining not securely tacked.		219a	
	b. One or both eyelet covers omitted.		220a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification		
		Major	Minor A	Minor B
	c. One or both eyelet covers not covering eyelet.		221a	
	d. Width of collar eyelet less than 1-5/8 inches or more than 1-7/8 inches.			366
Collar lining and eyelet covers (cont'd)	e. Felling on front edge and along lower corner of one or both eyelet covers omitted.		222a	
	f. Felling along lower corners of one or both eyelet covers extending for a distance of more than 3/4 inch.			367

4.4.2.6. Finished measurements. Any measurement deviating from nominal dimensions and tolerance included in Table II shall be scored as a size measurement defect. Sleeve lengths uneven by more than 1/2 inch shall be scored as a size measurement defect.

4.5. Tests. Tests shall be in accordance with ASTM E1282.

4.5.1 Metal composition. Chemical composition shall be determined in accordance with ASTM E 1282.

4.5.2 Test for tackiness. At room temperature (60°F to 80°F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, and shall fall free when pressure is released.

4.5.3 Quantity of gold and silver. At least two pieces, one yard each, shall be assayed for the quality of gold and silver. The quantities of gold and silver may be determined by standard commercial methods of assay, but in case of dispute, shall be determined in accordance with 4.5.3.1 and 4.5.3.2, respectively.

4.5.3.1. Gold content. Boil sufficient braid to bear one gram of alloy (accurately weighed) with 60 milliliters (ml) 1:1 nitric acid (HNO_3) in a 400 ml beaker using a small flame or hot plate. Continue boiling until all metals except the gold are in

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

solution. Dilute to 200 ml with hot water. Filter through a rapid ash less filter paper, and wash several times with hot water. Take the filter paper with the gold (cutting off any excess filter paper), wrap in a 2-inch by 2-inch piece of silver-free lead foil, and roll into a ball. Place the ball in the hollow of a bone ash cupel, and add lead shot around the ball. Place cupel in a muffle furnace for one hour at 1,000°C. Remove from the furnace, and examine hollow for flakes of gold, impurities and discolored gold bead. If any are noticed, add additional lead shot and return cupel to the muffle furnace for one hour. Otherwise, cool the gold bead and weigh. The gold content shall be calculated as follows:

$$\text{Gold Content} = \frac{W\ (Au)\ X\ 100}{WS} = P\ (Au)$$

Whereas: W(Au) - Weight of gold
WS - Weight of sample
P - Percent of gold

4.5.3.2. Silver content. Dilute the filtrate, from 4.6.3.1 to a 1,000 ml volumetric flask, and dilute to the mark. Pipette a 200 ml aliquot from the flask into a 400 ml beaker. Heat to boiling, and add hydrochloric acid (3:100) drop by drop from a pipette until precipitation is complete (1 ml of hydrochloric acid solution precipitates about 0.038 grams of silver). When solution has cooled and precipitate has settled, determine whether precipitation is complete by adding a few drops of the hydrochloric acid (3:100). If solution remains clear, filter on a weighed porcelain Gooch crucible. Wash the precipitate several times with HNO_3(1:200) and finally with cold water. Protect the silver chloride from the light, dry in an oven for not less than two hours, cool and weigh. The silver content shall be calculated as follows:

$$\text{Silver Content} = \frac{W\ (AgCl)\ X\ 752.63\ X\ 5}{WS}$$

Whereas: W(AgCl)- Weight of silver chloride
WS - Weight of sample minus weight of gold

4.5.3.3. Alloy content. Alloy content is ascertained by the difference between the gold and silver content.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1. Packaging. For acquisition purposes, the packaging requirements shall be as specified in the contract or order (see 6.2). When actual packaging of material is to be performed by Department of Defense (DoD) personnel, these personnel need to contact the responsible packaging activity to ascertain requisite packaging requirements. Packaging requirements are maintained by the Inventory Control Point's packaging activity within the Military Department of Defense Agency, or within the Military Department's Systems Command. Packaging data retrieval is available from the managing Military Department's or Defense Agency's automated packaging files, CD-ROM products, or by contacting the responsible packaging activity.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1. Intended use. The coats described herein are intended for wear by male officers of the U.S. Marine Corps Band (Director and Assistant Director).

6.2. Acquisition requirements. Acquisition documents must specify the following:

a. Title, number, and date of the specification.
b. Issue of DoDISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.2).
c. Packaging requirements (see 5.1).
d. Class coat required.
e. Sizes required (see 1.2).
f. Whether first article is required (see 3.2).
g. Number of coats in first article (see 4.3).

6.3. Standard samples. For information regarding the availability of standard sample coats and standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

6.4. Figures. Figures 1 through 13 show general design of the coats with assembly details and measurements. In the event of

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

conflict between these figures and the text of this specification, the text of this specification will govern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

6.5. Subject term (keyword) listing.

Director
Male
Uniform

6.6. Vinyl piping. Pearl Binding Corporation of Philadelphia, PA has manufactured vinyl cord meeting the requirements of 3.3.19.

6.7. Changes from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extent of the changes.

Preparing Activity:
Navy - MC
Project No. 8405-N323

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

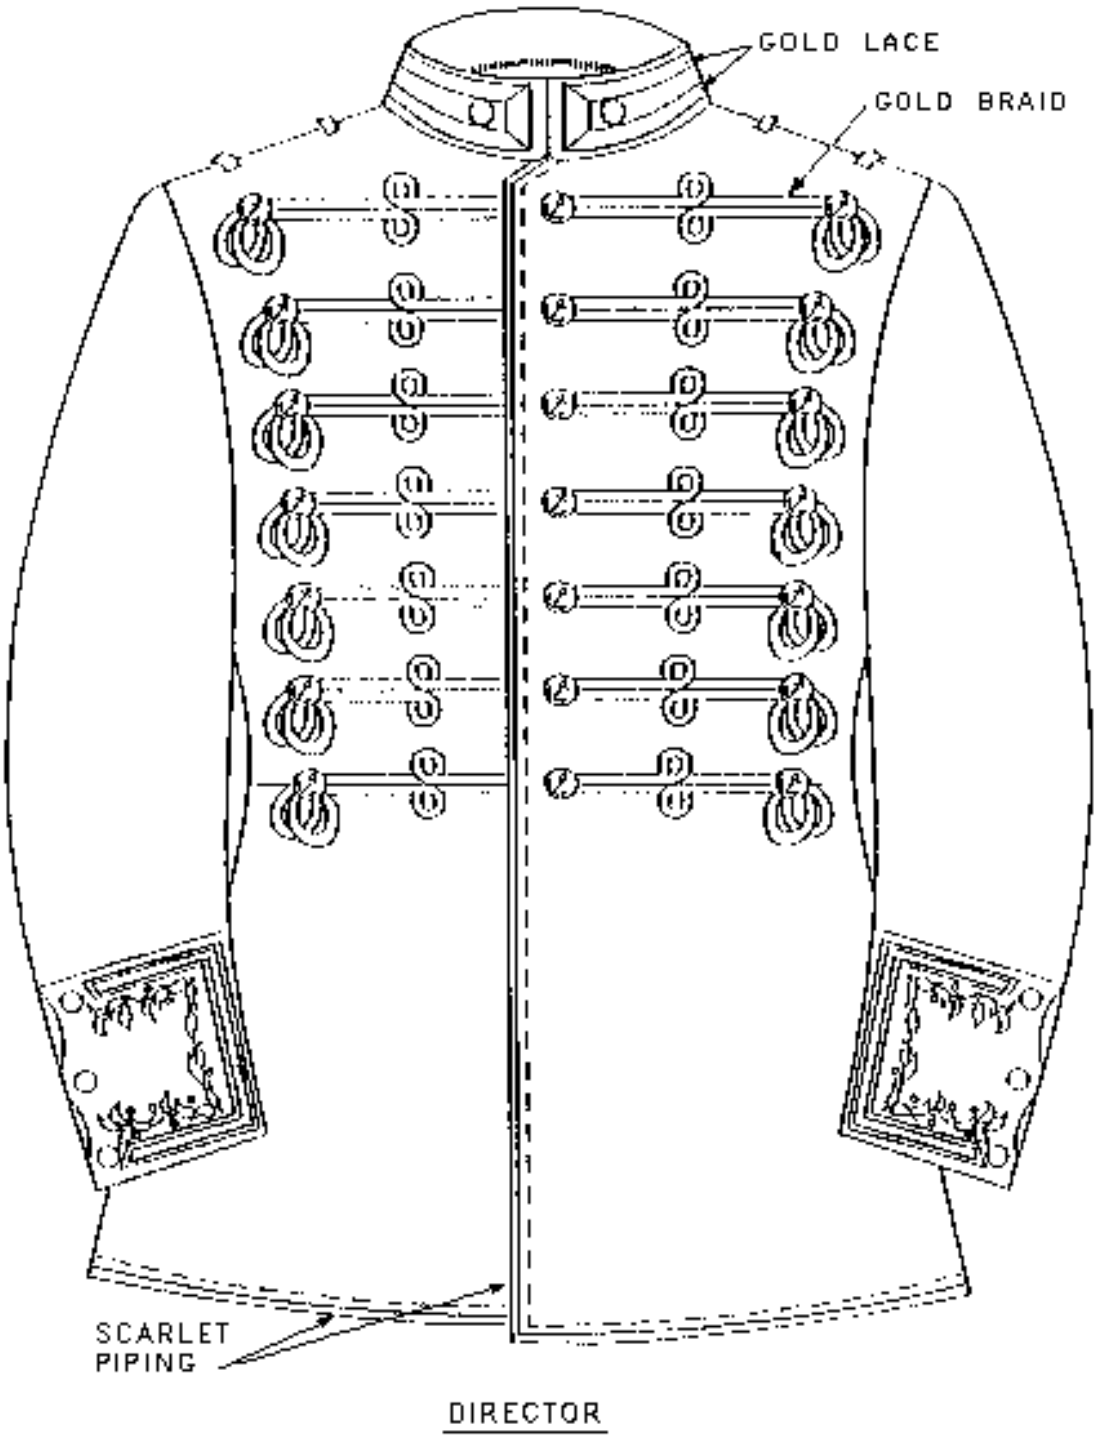


Figure 1. Coat, Man's – Full Dress,
U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

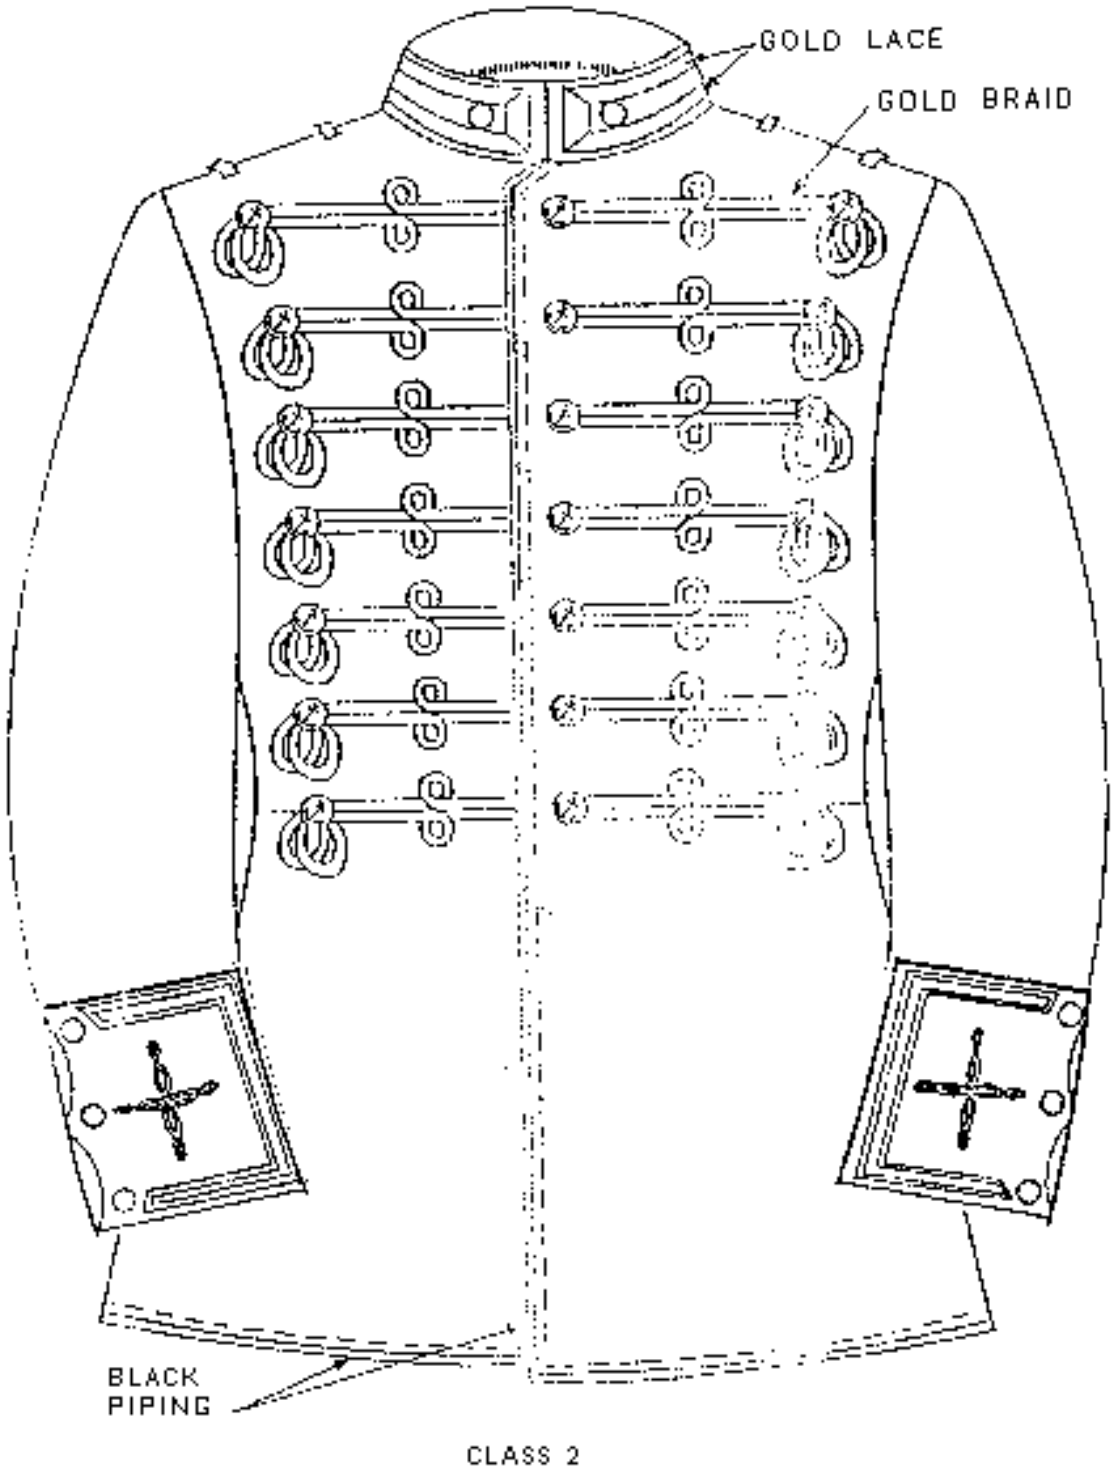


Figure 2. Coat, Man's - Full Dress,
U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

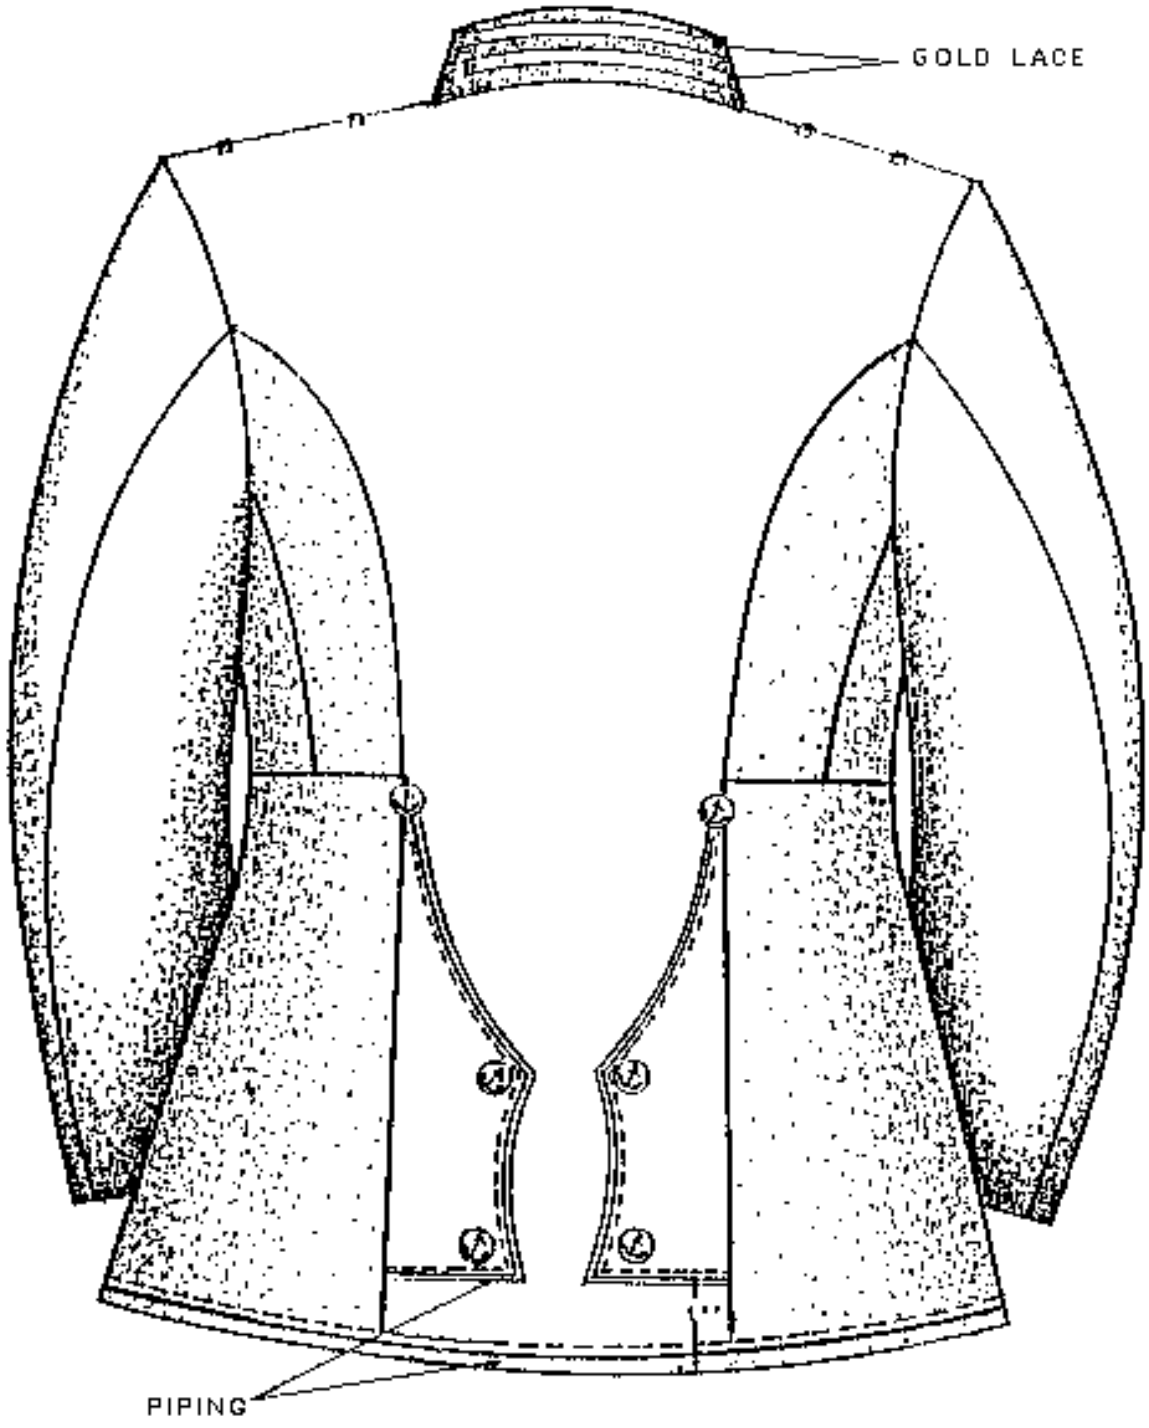


Figure 3. Coat, Man's - Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

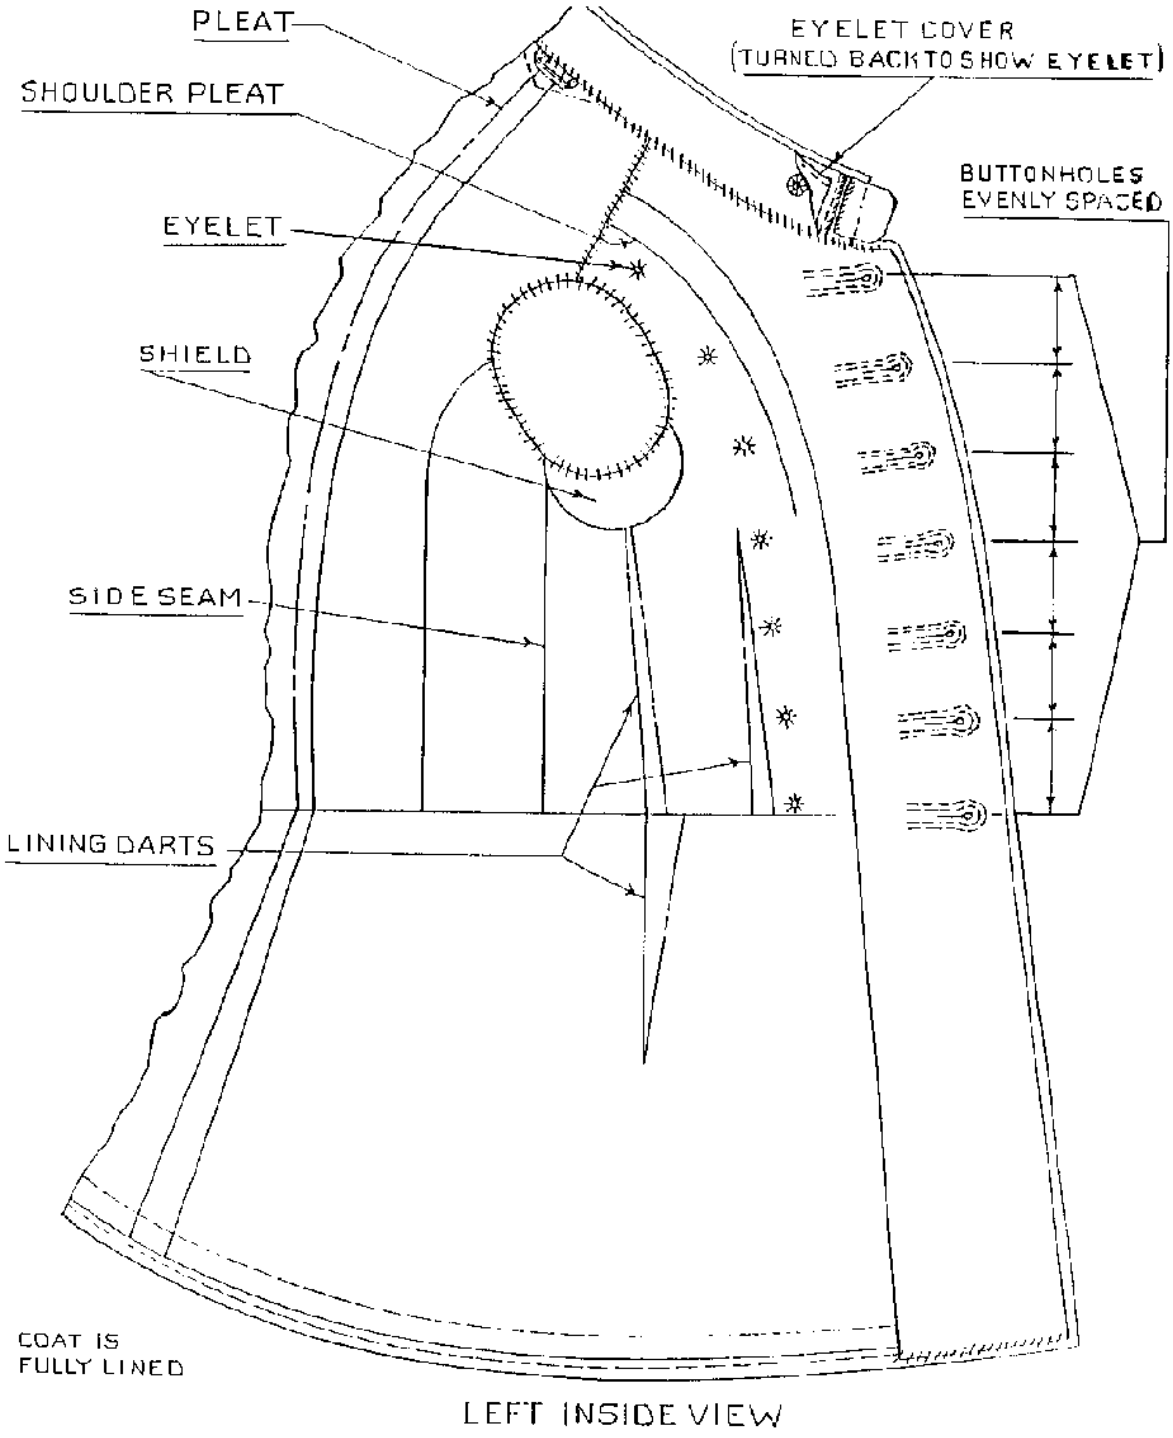


Figure 4. Coat, Man's – Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.


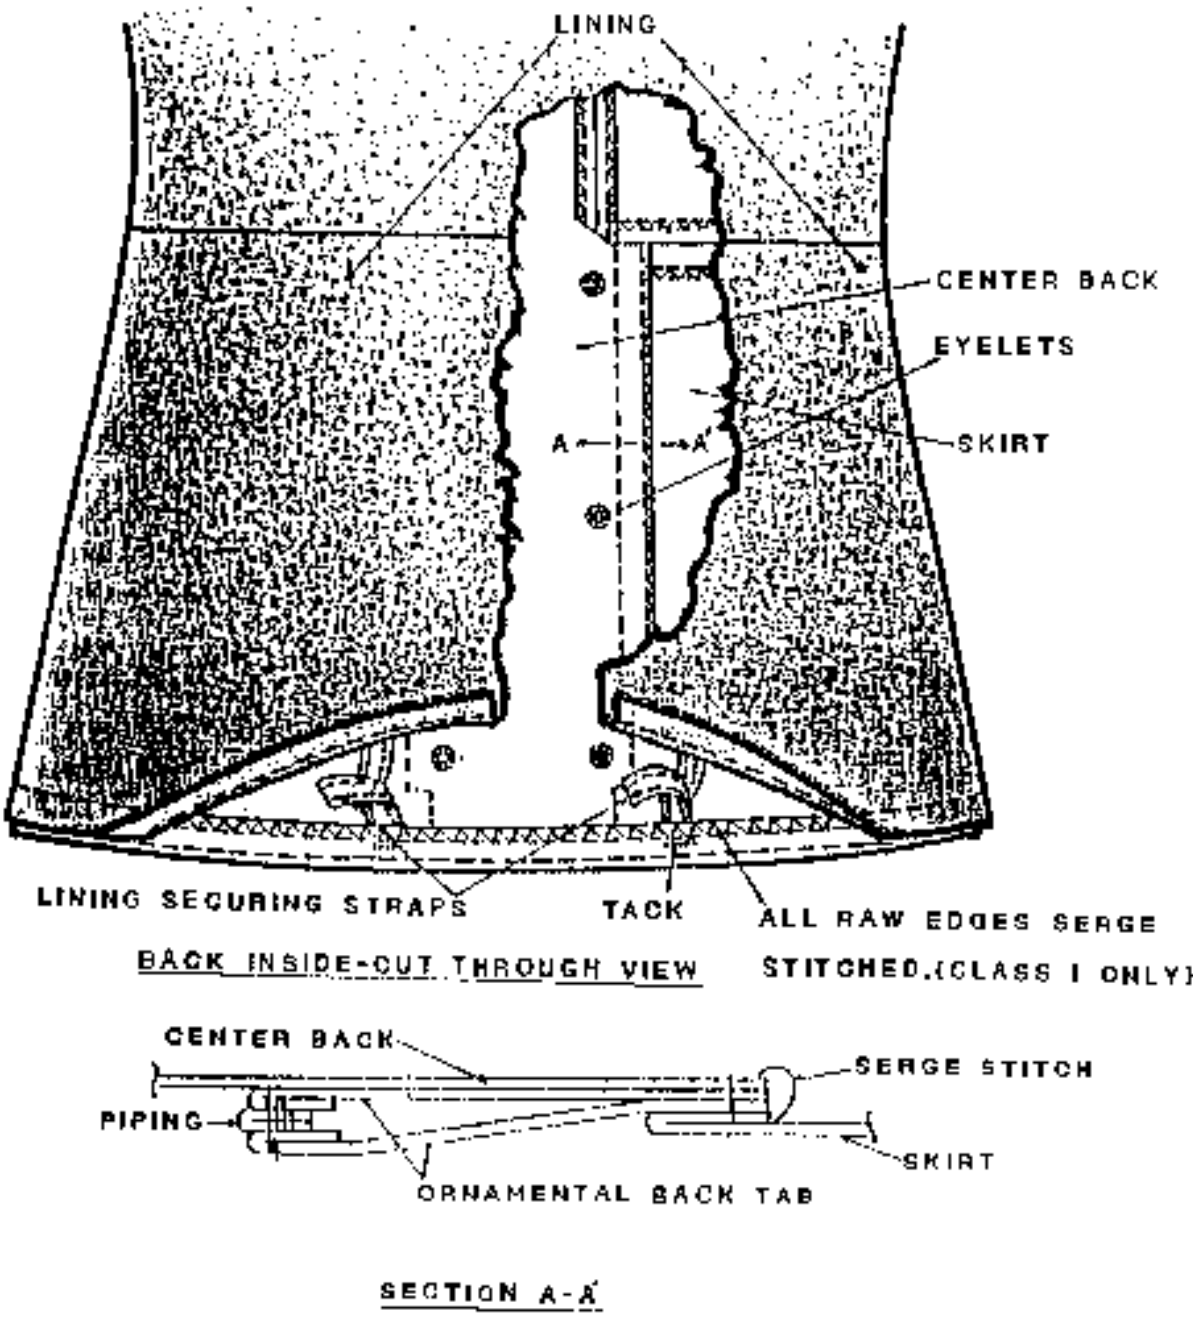


Figure 5. Coat, Man's – Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

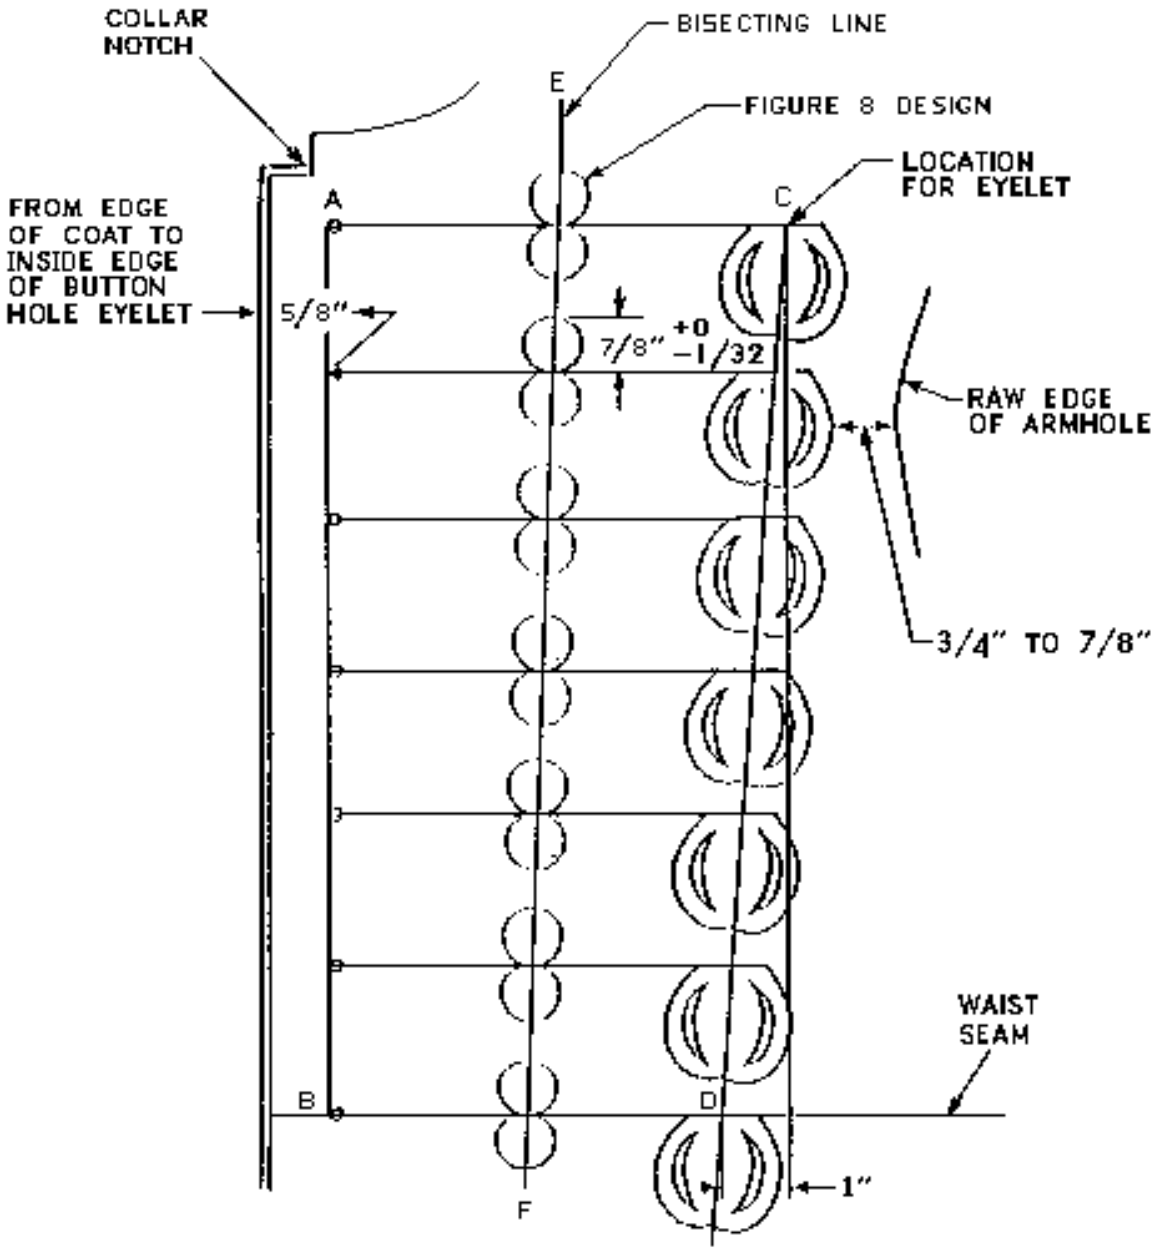

BRAID PLACEMENT DIAGRAM - LEFT FRONT

Figure 6. Coat, Man's - Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

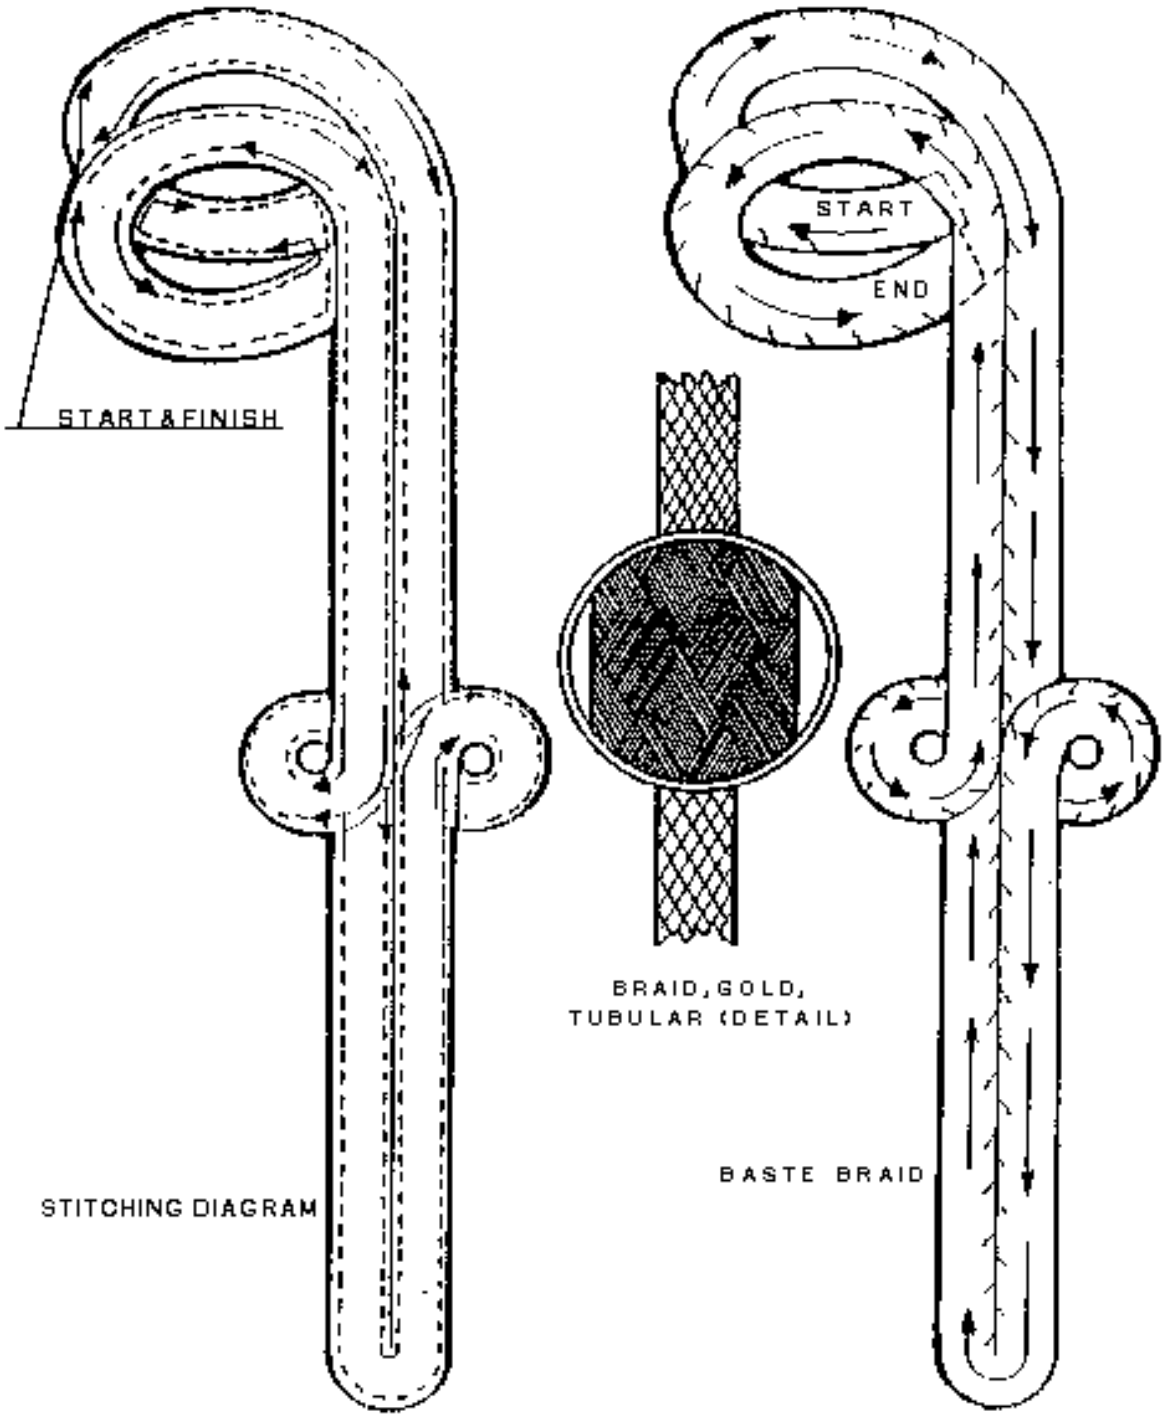


Figure 7. Coat, Man's – Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.


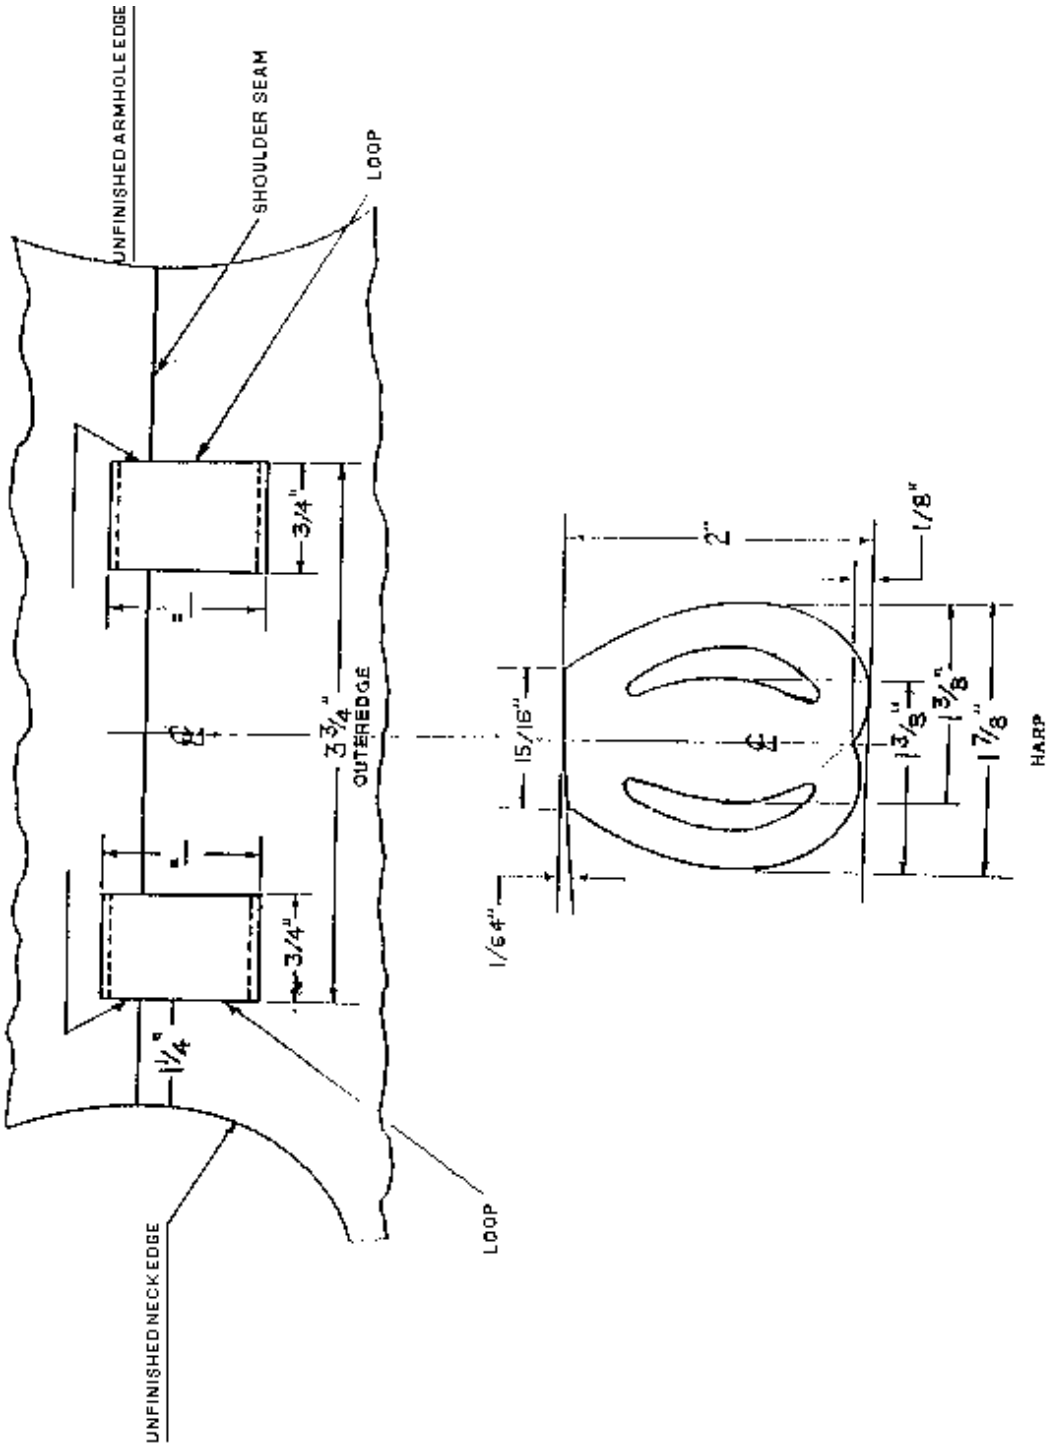


Figure 8. Coat, Man's – Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.



GOLD LACE (DETAIL)

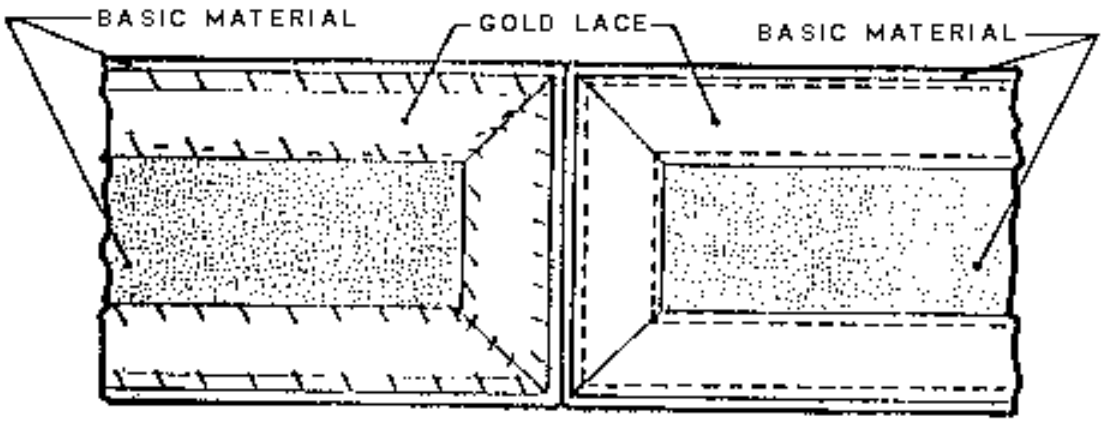

BASTING & STITCHING DIAGRAM

Figure 9. Coat, Man's - Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

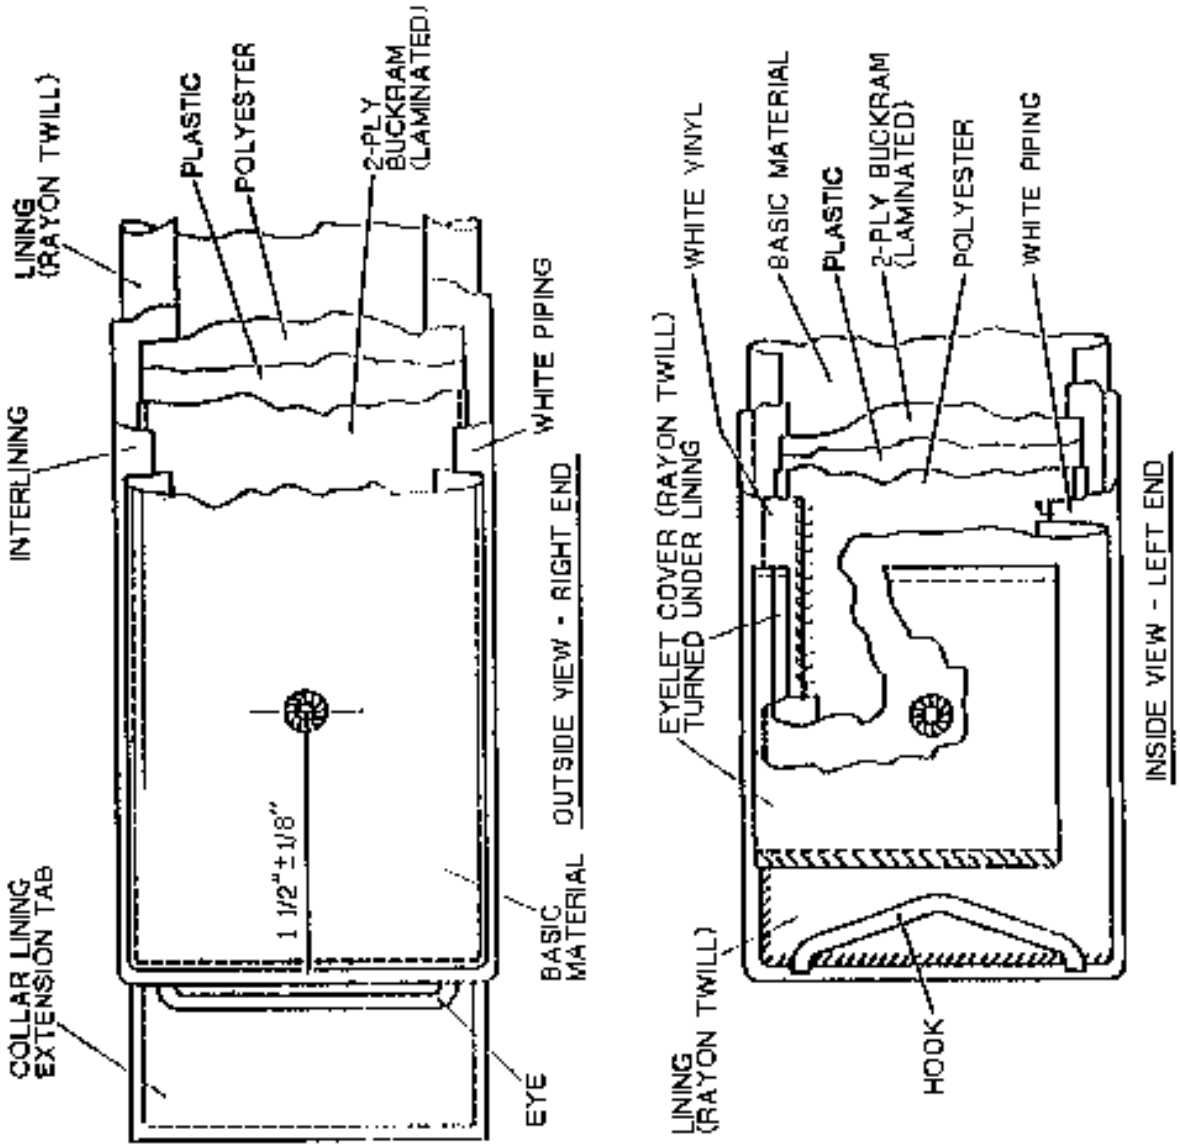


Figure 10. Coat, Man's – Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.


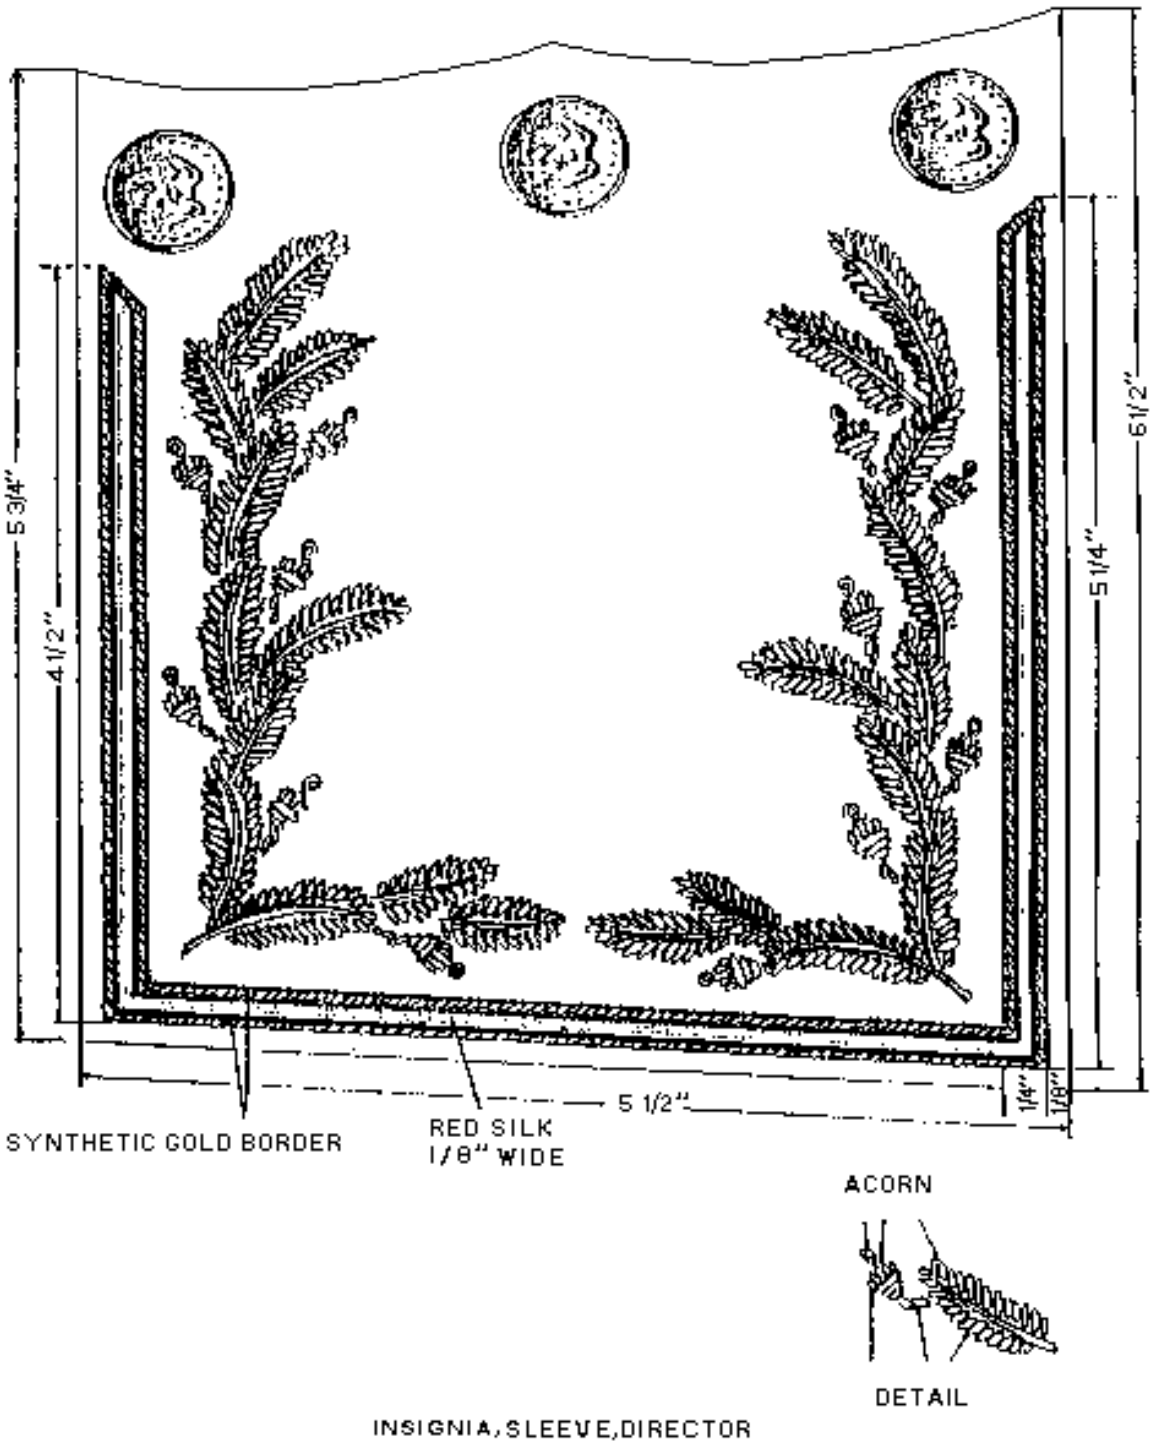


Figure 11. Coat, Man's – Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

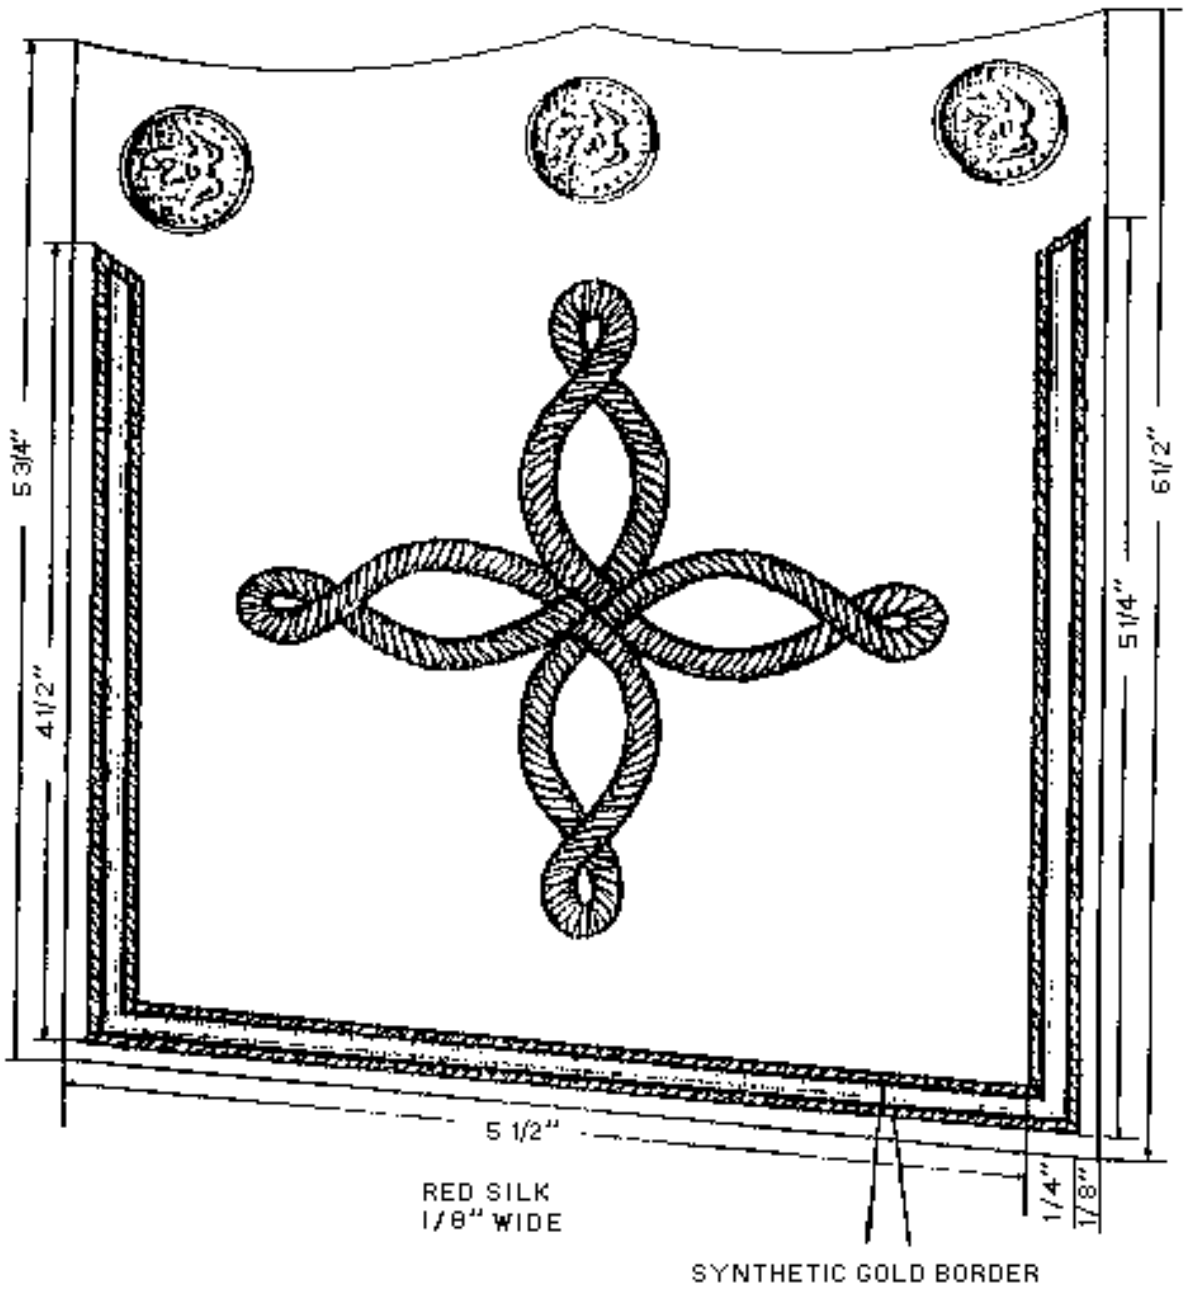

INSIGNIA, SLEEVE, ASS'T DIRECTOR

Figure 12. Coat, Man's – Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

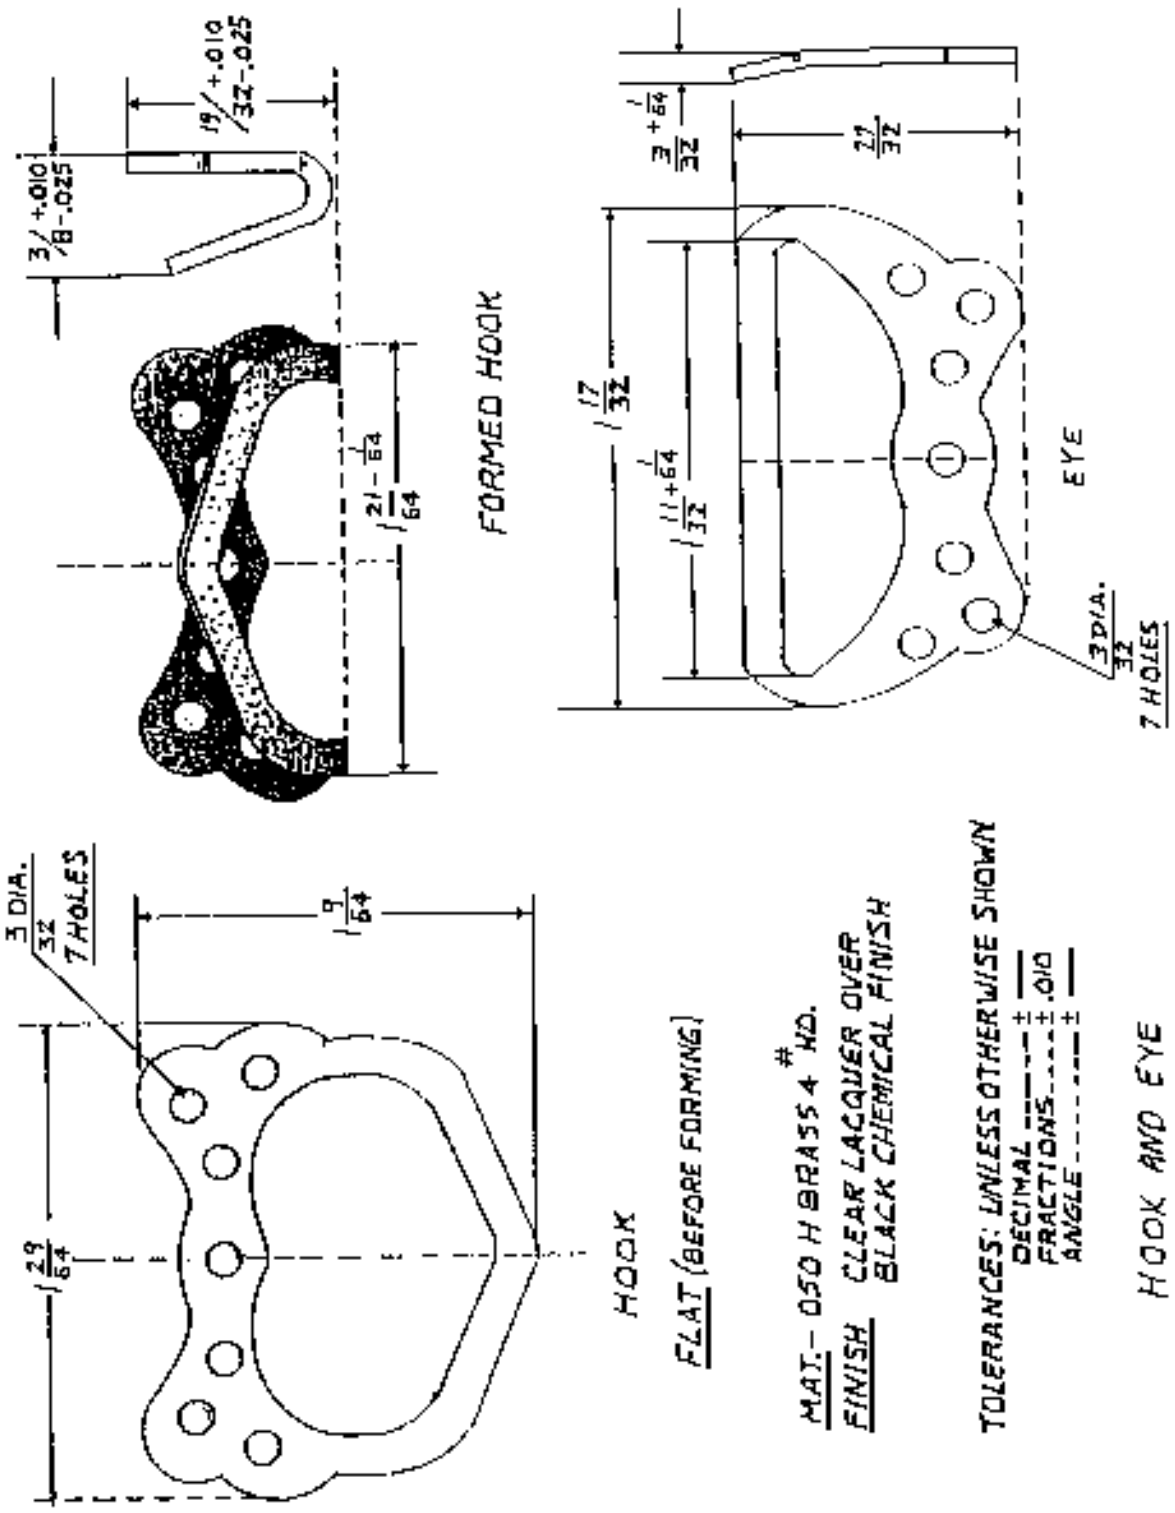


Figure 13. Coat, Man's – Full Dress, U.S. Marine Band; Officer's

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.

2. The submitter of this form must complete blocks 4, 5, 6, and 7.

3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	**1. DOCUMENT NUMBER** MIL-DTL-82189C	**2. DOCUMENT DATE (YYMMDD)** 971030

COAT, MAN'S - FULL DRESS, U.S. MARINE BAND, OFFICER'S

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME *(Last, First, Middle Initial)*	b. ORGANIZATION	
c. ADDRESS *(Include Zip Code)*	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON *(if applicable)*	**7. DATE SUBMITTED** (YYMMDD)

8. PREPARING ACTIVITY

a. NAME COMMANDER, MARCORSYSCOM, CODE PSE-D	b. TELEPHONE *Include Area Code)* (1) Commercial (703) 784-4584 (2) AUTOVON 278-4584
2033 BARNETT AVE, SUITE 315 QUANTICO, VA 22134-5010	Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403 Falls Church, VA 22041-3466 (703) 756-2340 DSN: 289-2340

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T06:53Z
Check the source to verify that this is the current version before use.