MIL-F-45434F (MU)
2 June 1969
SUPERSEDING
MIL-F-45434E (MU)
5 September 1967

MILITARY SPECIFICATION

FUZE, BOMB, TAIL, M905 PARTS FOR

1. SCOPE

1.1 This specification covers the quality assurance provisions, and special requirements not covered by the drawings, for the parts for one type of fuze designated as Fuze, Bomb, Tail, M905.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids, or request for proposals, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-D-1000 - Drawings, Engineering and Associated Lists.
MIL-A-2550 - Ammunition and Special Weapons, General Specification for.
MIL-C-45662 - Calibration of Standards.

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes.
MIL-STD-109 - Quality Assurance Terms and Definitions.
MIL-STD-331 - Fuze and Fuze Components, Environmental and Performance Tests for.
MIL-STD-1167 - Ammunition Data Cards.
MIL-STD-1168 - Lot Numbering of Ammunition.

FSC: 1325

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

MIL-STD-1169 - Packaging, Packing and Marking for Shipment of Inert Ammunition Components.
MIL-STD-1235 - Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes.

FEDERAL

FED-STD-151 - Federal Test Method Standard No. 151 Metal Test Method.

DRAWINGS

US ARMY MUNITIONS COMMAND

8839300 - Fuze, Bomb, Tail, M905, Metal Parts Assembly
8839347 - Cap, Rotor
8839348 - Rotor Assembly (Inert)
8839351 - Spring, Rotor, Torque
8839352 - Detent, Rotor
8839353 - Spring, Rotor Detent
9226247 - Rotor Assembly (Alternate)

PUBLICATIONS

ET-8839300 - Equipment Tabulation.

(Copies of specifications, standards, drawings and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

3. REQUIREMENTS

3.1 Material.-Materials and parts shall be in accordance with applicable drawings and specifications.

3.2 Metal parts.-The metal parts shall comply with all requirements specified on Drawing (dwg.) 8839300 and with all requirements specified in applicable specifications.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

3.3 Embrittlement of springs.-The springs shall not break when extended to the point of minimum permanent distortion. Testing shall be performed as specified in 4.4.1.

3.4 Functioning of input drive housing assembly with internal gear.-When the internal gear (dwg. 8839342) is driven by the input drive housing assembly (dwg. 8839316) 121.5 revolutions, the internal gear shall rotate 45 plus or minus 1/2 degree. Testing shall be as specified in 4.4.2.

3.5 Arming time setting and locking.-The fuze metal parts assembly shall be capable of being set and shall lock at each timing position, except that the assembly shall not be capable of being set in the 4 second position when the stop screw is assembled. Testing shall be performed as specified in 4.4.10.

3.6 Extension shaft locking.-The key spring of the extension shaft shall lock the input drive assembly to the input drive housing assembly to provide a positive safeguard against arming and partial arming.

3.7 Transportation vibration.-The fuze metal parts assemblies shall withstand the transportation-vibration test when tested as specified in 4.4.7. In addition, the metal parts assemblies shall be considered to have remained in the safe position as evidenced by:

a. The entire white mark on the internal gear remaining visible through the window of the input drive housing assembly.

b. The rotor release assembly has not withdrawn from the rotor cavity.

3.8 Arming.-The fuze metal parts, with the timing lock positioned in the 20 second setting slot shall arm within 608 plus or minus 6 revolutions of the extension shaft as indicated by the rotary movement of a simulated rotor assembly. In addition, the collar of the rotor release assembly must retract to flush or below flush with the bottom surface of the rotor cavity. The point of the firing pin assembly shall be capable of entering the delay element cavity both at the time of functioning and when further rotation of the extension shaft becomes restrictive due to excessive torque. The torque resistance of the extension shaft during the test shall not exceed 1.0 inch-ounce except at initial starting of arming test and at the approximate time the shear pin is severed, and the rotational speed of the extension

Source: https://assist.dla.mil -- Downloaded: 202640-22T02:59Z
Check the source to verify that this is the currentversion before use.

shaft shall be 1800 plus or minus 200 revolutions per minute. Testing shall be performed as specified in 4.4.8. Note: If used, a simulated rotor assembly shall apply a force of 0.55 plus or minus 0.05 pounds normal to the surface of the rotor release collar on a line through the center of the fuze body and rotor release assembly in the same manner as the conventional rotor. The contact face of the simulated rotor shall be parallel to the axis of the fuze body and shall extend from the bottom surface of the rotor cavity to a height greater than the projection of the rotor release assembly with the fuze in the safe condition. The simulated rotor assembly shall in no way assist in the retraction of the rotor release assembly.

3.9 Arming setting.-The fuzes shall be set at the 20 second position prior to final inspection.

3.10 Load test of firing pin (alternate) (dwg. 9217286).-The firing pin tab shall not break, crack or bend beyond the point which would allow the firing pin point to protrude into the delay element cavity of the fuze body, when an impact load of 16 foot pounds, minimum is applied to the top surface of the firing pin when tested as specified in 4.4.14.

3.11 Delay lock pin washer load test.-The delay lock pin, spring and washer, as assembled to the fuze body assembly, shall withstand a 50 pound (lb) minimum (min) load without separation, when tested as specified in 4.4.15.

3.12 Protective finish

3.12.1 Salt spray

3.12.1.1 First article.-Compoents and sub-assemblies requiring protective finishes (not applicable to painted surfaces) shall exhibit no white salts or evidence of corrosion of the base metal after being exposed to a salt spray, containing 5 percent sodium chloride for a minimum of 96 hours.

3.12.1.2 Regular production.-Components and sub-assemblies requiring protective finishes (not applicable to painted surfaces) shall exhibit no white salts or evidence of corrosion of the base metal after being exposed to a salt spray, containing 5 percent sodium chloride for a minimum of 24 hours.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

3.12.2 Plating thickness of firing pin assembly (9217286 only).- The plating thickness of the firing pin assembly shall be not less than .0003 minimum, when tested as specified in 4.4.11.

3.13 Workmanship.-All manufacturing, processing and assembly operations shall be performed in a thorough workmanlike manner. Parts shall be free from burrs, chips, cracks, raised metal, sharp edges where not required, cuts, grease, corrosion, salt deposits and other foreign material. The cleaning method shall not be injurious to any part nor shall the parts be contaminated by the cleaning agent. Protective requirements shall be in accordance with the applicable drawing and specification.

3.14 Porosity of fuze body (applicable when die casting is utilized.)

3.14.1 Castings.-The fuze body as cast shall show no evidence of porosity in excess of the following limits:


a. No holes extending through from one surface to another (parallel surfaces).

b. Cold shuts not to extend more than 1/16 inch (") inward from any surface.

c. Individual pores shall not exceed the limits specified for each particular area (see Figure I). Measurement shall be made across the largest dimension.

d. The maximum total length of individual pores shall not exceed the limits specified for each particular area (see Figure I). Measurement shall be made across the largest dimension of individual pores (disregard pores 1/64" or smaller) and these measurements shall be added.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

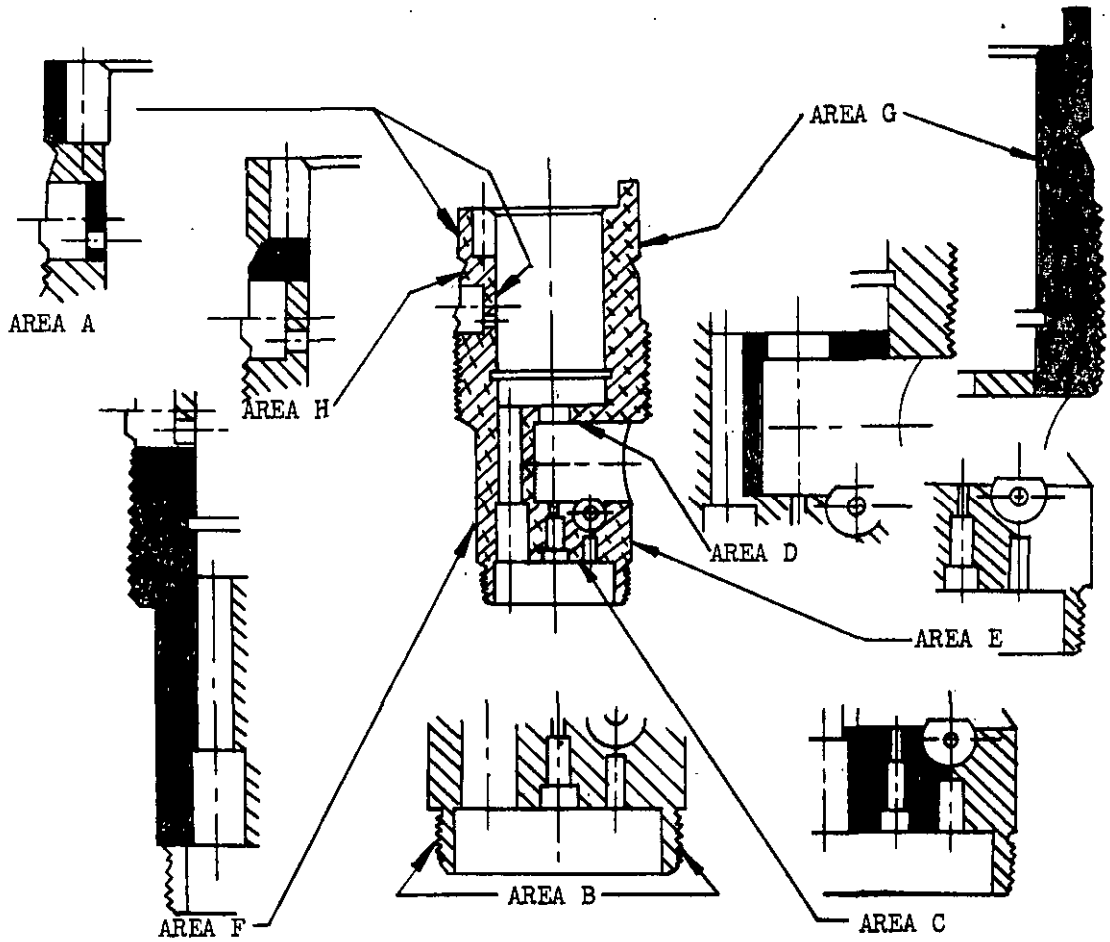

AREA (DARKENED)	MAX. LENGTH OR DIA. OF INDIVIDUAL PORES	MAX. TOTAL LENGTH OF ALL PORES
A	1/16"	1/8"
B	1/32"	3/32"
C	1/16"	3/16"
D	1/16"	3/16"
E	1/8"	3/16"
F	3/16"	3/8"
G	3/16"	3/8"
H	1/8"	3/16"

FIGURE I

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

3.14.2 After final machining.-The die-cast fuze body, after final machining and finishing shall not contain porosity in excess of the limits specified in Figure II.

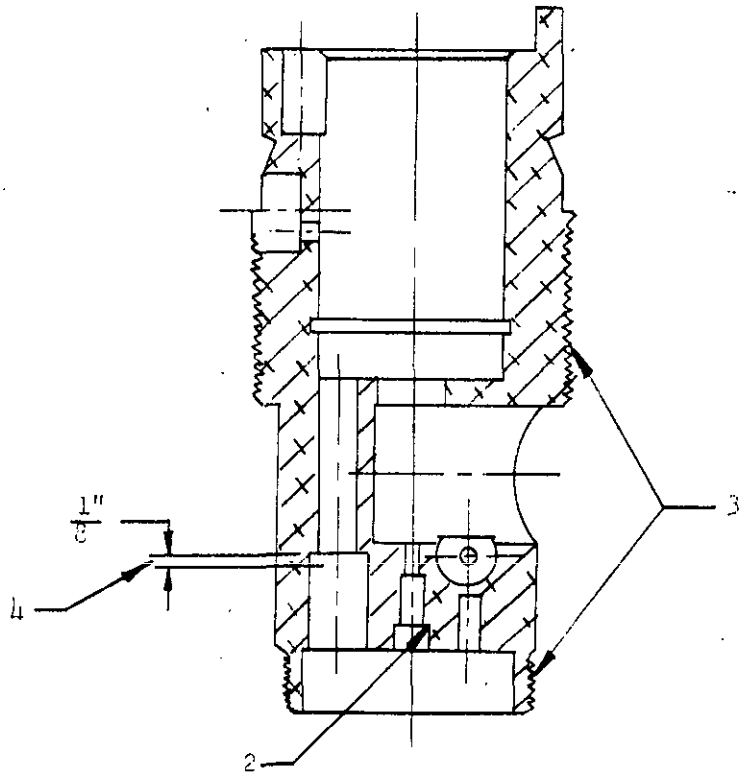


FIGURE II

1. No holes extending through from one surface to another (parallel surfaces).
2. No hole or missing area greater than 1/32" on shoulder (measured across the largest dimension).
3. Not more than 1/8" of broken or missing thread per running inch of thread.
4. No hole greater than 1/32" (measured across the largest dimension) in the circumference of hole for the specified length (measured from shoulder).

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection.-Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements. Reference shall be made to Standard MIL-STD-109 in order to define terms used herein. The provisions of Specification MIL-A-2550 shall apply.

4.1.1 Submission of product.-At the time each completed lot of items deliverable under the contract is submitted to the Government for acceptance, the contractor shall supply the following information accompanied by a certificate which attests that the information provided is correct and applicable to the product being submitted:

a. A statement that the lot complies with all of the quality assurance provisions specified in this specification.

b. Drawing and specification number and date, together with identification and date of changes thereto.

c. A statement that all material purchased by the contractor meets requirements, when such material is controlled by Government or commercial specifications referenced in any of the contractual documents, and that certificates of conformance are on file and available for review.

d. Number of items in the lot.

e. Date submitted.

The certificate shall be signed by a responsible agent of the certifying organization. The initial certificate submitted shall be substantiated by evidence of the agent's authority to bind his principal. Substantiation of the agent's authority will not be required with subsequent certificates unless, during the course of the contract, this authority is vested in another agent of the certifying organization.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

4.2 First Article Inspection.

4.2.1 Prior to the start of regular production, the contractor shall submit a first article sample to a Government approved facility as designated by the Contracting Officer (see 6.4) for evaluation in accordance with the provisions of 4.2.2. The first article sample shall consist of 75 complete assemblies and 10 complete sets of parts (i.e., 10 each of every component and every sub-assembly) which have been produced by the contractor or furnished by a supplier and which have been manufactured using the same production process, procedures and equipment which will be used in fulfilling the contract. (When multiple cavity mold is used in the manufacturing process, five (5) components from each mold cavity shall be submitted and each component shall be identified with its mold cavity.) The components shall bear a mark which identifies the component with the individual cavities. The mark shall be located where subsequent machining operations will not obliterate the mark. All parts and materials, including packaging and packing, shall be obtained from the same source of supply as will be used in regular production. The sample shall be accompanied by certificates of analysis for materials. A first article sample, or portion thereof, as directed by the Contracting Officer, shall also be submitted whenever there is a lapse in production for a period in excess of 90 days, or whenever a change occurs in manufacturing process (repairs or adjustment to a cavity or mold shall be dimensionally examined until five (5) consecutive units meet all requirements affected by the repairs or adjustments), material used, drawing, specification or source of supply as to significantly affect product uniformity as determined by the Government. Prior to submission, the contractor shall inspect the sample to the degree necessary to assure that it conforms to the requirements of the contract and submit a record of this inspection with the sample. A sample containing known defects will not be submitted unless specifically authorized by the Contracting Officer.

4.2.2 Inspection to be performed.-Assemblies and components will be subjected by the Government to any or all of the examinations or tests specified in 4.3.2 and 4.3.3.1 of this specification and any or all requirements of the applicable drawings. The complete assemblies shall be submitted to test in the following order: extension shaft locking, arming setting, transportation vibration, and arming.

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

4.2.3 Rejection.-If any assembly, subassembly, or component fails to comply with any of the applicable requirements, the first article sample shall be rejected. The Government reserves the right to terminate its inspection upon any failure of an assembly or component in the sample to comply with any of the stated requirements. In the event of rejection, the Government reserves the right to require the contractor to take corrective action and submit a new first article sample, or portion thereof. Until a first article sample is accepted, the contractor is in no way authorized by the Government to initiate regular production unless otherwise directed by the Contracting Officer.

4.3 Inspection provisions

4.3.1 Lot formation.-The term "lot" as used throughout this specification is defined as an essentially homogeneous collection of units of product from which a representative sample is drawn and inspected to determine conformance with applicable requirements. The sample selected shall represent only that quantity of units from which the sample was drawn and shall not be construed to represent any prior or subsequent quantities presented for inspection. Homogeneity shall be considered to exist provided the lot has been produced by one manufacturer, in one unchanged process, in accordance with the same drawing, same drawing revision, same specification and same specification revision and complies with the provisions for submission of product as specified in MIL-STD-105. Changes to the process, specification, or drawing not affecting safety, performance, interchangeablity, or storage, as determined by the Government, shall not be deemed to alter the homogeneity of an inspection lot. All material submitted for inspection in accordance with this specification shall comply with the homogeneity criteria specified herein regardless of the type of sampling procedure which is being applied to determine conformance with requirements. Lot numbering, as required, shall be in accordance with MIL-STD-1168.

4.3.2 Examination.-The examinations listed in the following subparagraphs shall be performed on inspection lots (see 4.3.1) of the components or assemblies designated in the applicable paragraph headings. Inspection for critical defects (and major defects, when so specified) shall be 100 percent. Sampling plans

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

for major and minor defects shall be in accordance with MIL-STD-105 except that continuous sampling plans in accordance with MIL-STD-1235 may be used if approved by the Government. Instead of applying the AQL's designated herein to the groups of major and minor defects listed, the contractor may elect to apply AQL's to individual defects using an AQL of 0.40 percent for each major defect and an AQL of 0.65 percent for each minor defect. When this method is elected, it shall be applied to all of the major and minor defects listed in the applicable subparagraphs of this section, except where 100 percent inspection is specified, and be documented as part of the contractor's inspection system. Equipment necessary for the performance of the inspection listed shall be in accordance with 4.3.4.

4.3.2.1 Spring, rotor release (see dwg. 8839312 covering a detail of dwg. 8839309).

Categories	Defects	Method of Inspection	Code No. (see 6.2)
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Solid height, maximum (max)....	Gage	01001
102.	Load at assembled height.....	Gage	01002
103.	Outside diameter, max.....	Gage	01003
104.	Inside diameter, minimum (min).	Gage	01004
105.	Wire cut or nicked.....	Visual	01005
Minor:	AQL 1.50 percent		
201.	Protective finish damaged exposing base metal.....	Visual	01006
202.	Ends not closed.....	Visual	01007
203.	Evidence of poor workmanship (see 3.13).....	Visual	01008

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.2 Plunger, rotor release (see dwg. 8839310 covering a detail of dwg. 8839309).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Total length	Gage	02001
102.	Diameter of shoulder at shear pin end, max	Gage	02002
103.	Diameter of spring area below shoulder	Gage	02003
104.	Distance to rotor release collar seat	Gage	02004
105.	Surface finish improper	Visual	02005
Minor:	AQL 1.00 percent		
201.	Length of shoulder at shear pin hole end	Gage	02006
202.	Evidence of poor workmanship (see 3.13)	Visual	02007

4.3.2.3 Rotor release assembly (see dwg. 8839309 covering a detail of dwg. 8839300).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Diameter rotor release collar, max	Gage	03001
102.	Diameter of shear pin, max	Gage	03002
103.	Length of shear pin protrusion	Gage	03003
104.	Concentricity of rotor release collar with plunger	Gage	03004
105.	Component missing	Visual	03005
106.	Chamfer missing from plunger or collar	Visual	03006

Source: https://assist.dla.mil -- Downloaded: 202640-22T02:59Z
Check the source to verify that this is the current version before use.

107.	Surface finish improper	Visual	03007
108.	Pin or plunger distorted due to staking or flaring	Visual	03008
109.	Staking of shear pin incomplete	Visual	03009
Minor:	AQL 1.50 percent		
201.	Protective finish damaged (bare spot or scratch exposing base metal)	Visual	03010
202.	Flare incomplete	Visual	03011
203.	Evidence of poor workmanship (see 3.13)	Visual	03012

4.3.2.4 Spring, compression (see dwg. 8839306 covering a detail of dwg. 8839302).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Solid height, max	Gage	04001
102.	Load at assembled height	Gage	04002
103.	Outside diameter, max	Gage	04003
104.	Inside diameter, min	Gage	04004
105.	Wire cut, nicked or burred	Visual	04005
Minor:	AQL 1.50 percent		
201.	Protective finish damaged exposing base metal	Visual	04006
202.	Ends not closed	Visual	04007
203.	Evidence of poor workmanship (see 3.13)	Visual	04008

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.5 Pin, delay lock (see dwg. 8839305 covering a detail of dwg. 8839302).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Total length, max.	Gage	05001
102.	Diameter of delay lock shoulder, max.	Gage	05002
103.	Distance to delay lock shoulder	Gage	05003
104.	Length of delay lock shoulder	Gage	05004
105.	Pin damaged or bent	Visual	05005
Minor:	AQL 1.50 percent		
201.	Chamfer missing	Visual	05006
202.	Protective finish damaged exposing base metal	Visual	05007
203.	Evidence of poor workmanship (see 3.13)	Visual	05008

4.3.2.6 Guide, firing pin (see dwg. 8839315 covering a detail of dwg. 8839302).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.50 percent		
101.	Diameter of flange, max.	Gage	06001
102.	Thickness of flange	Gage	06002
103.	Diameter of firing pin hole	Gage	06003
104.	Concentricity of firing pin hole with diameter of flange	Gage	06004
105.	Distance to keyway lug in firing pin hole	Gage	06005
106.	Width of keyway lug in firing pin hole, min.	Gage	06006

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

107.	Angular location of edge of rotor release assembly cut-out (shear side) with edge of key and firing pin hole	Gage	06007
108.	Profile of slot in flange	Gage	06008
109.	Location of annular groove	Gage	06009
110.	Profile and radius of annular groove (end to end)	Gage	06010
111.	Depth of counterbore including key	Gage	06011
112.	Finish improper	Visual	06012
113.	Chamfer missing	Visual	06013
114.	Evidence of poor workmanship (see 3.13)	Visual	06014
Minor:	AQL 2.50 percent		
201.	Total length	Gage	06015
202.	Outside diameter of shank	Gage	06016
203.	Diameter of firing pin hole counterbore, min	Gage	06017
204.	Depth of annular groove, min	Gage	06018
205.	Protective finish inadequate exposing base metal	Visual	06019

4.3.2.7 Spring, creep (see dwg. 8839341 covering a detail of dwg. 8839300).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Load at assembled height	Gage	07001
102.	Solid height, max	Gage	07002
103.	Inside diameter, min	Gage	07003
104.	Wire cut, nicked or burred	Visual	07004
105.	Ends not closed	Visual	07005
Minor:	AQL 1.00 percent		
201.	Plating damaged exposing base metal	Visual	07006
202.	Evidence of poor workmanship (see 3.13)	Visual	07007

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.8 Firing pin assembly (see dwg. 8839338) or firing pin assembly (alternative) (see dwg. 9217286 and 9243289) covering a detail of dwg. 8839300).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.50 percent		
101.	Load test (see 4.4.4) (as applicable)	Test	08001
102.	Total length of firing pin, max.	Gage	08002
103.	Diameter of firing pin shaft	Gage	08003
104.	Thickness of firing pin shaft to base of slot, max.	Gage	08004
105.	Width of slot, min.	Gage	08005
106.	Length of slot, min.	Gage	08006
107.	Diameter of firing pin flange	Gage	08007
108.	Concentricity of firing pin flange with firing pin shaft	Gage	08008
109.	Concentricity of firing pin point with firing pin shaft	Gage	08009
110.	Alignment of firing pin disc tab with slot	Gage	08010
111.	Distance from disc end to face of flange at shaft side	Gage	08011
112.	Distance from base of firing pin point to flange	Gage	08012
113.	Length of firing pin point, min.	Gage	08013
114.	Profile of firing pin point	Gage	08014
Minor:	AQL 2.50 percent		
201.	Chamfer missing from flange or shaft	Visual	08015
202.	Protective finish damaged exposing base metal	Visual	08016
203.	Finish improper	Visual	08017
204.	Evidence of poor workmanship (see 3.13)	Visual	08018

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.9 Gear, internal (see dwg. 8839342 covering a detail of dwg. 8839300).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Diameter of center hole, min.	Gage	09001
102.	Concentricity of gear with center hole	Gage	09002
103.	Distance from hub to web (gear side)	Gage	09003
104.	Location of gear stop (Area A) relative to cut out	Gage	09004
105.	Maximum width (circumferentially of white portion of peripheral surface and location relative to firing pin disc tab cut out)	Gage	09005
106.	Gear teeth damaged (nicked, chipped or burred)	Visual	09006
107.	Paint missing or incorrectly applied	Visual	09007
108.	Material damaged (chipped, nicked or burred)	Visual	09008
109.	Finish improper	Visual	09009
Minor:	AQL 2.50 percent		
201.	Outside diameter	Gage	09010
202.	Total length of internal gear	Gage	09011
203.	Diameter of cavity (firing pin disc slot side)	Gage	09012
204.	Protective finish incomplete (base metal exposed)	Visual	09013
205.	Evidence of poor workmanship (see 3.13)	Visual	09014

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.10 Cup, gear train (see dwg. 8839336 covering a detail of dwg. 8839316).

Categories	Defects	Method of	Code No.
Critical: None defined.			
Major:	AQL 1.50 percent		
101.	Diameter of center hole	Gage	10001
102.	Outside diameter, min	Gage	10002
103.	Concentricity of outside diameter with center hole	Gage	10003
104.	Total height	Gage	10004
105.	Height of screw legs	Gage	10005
106.	Distance from face of screw leg to top of internal gear shaft	Gage	10006
107.	Distance from face of screw leg to boss of internal gear shaft	Gage	10007
108.	Diameter of internal gear shaft, max	Gage	10008
109.	Concentricity of internal gear shaft with center hole	Gage	10009
110.	Diameter of output pinion hole, min	Gage	10010
111.	Location of output pinion hole relative to center hole	Gage	10011
112.	Location of idler stud hole relative to center hole	Gage	10012
113.	Distance from face of legs to top of cut out at open end, min	Gage	10013
114.	Location of cut-out at open end	Gage	10014
115.	True position of hole in leg with center hole	Gage	10015
116.	Window hole missing	Visual	10016
117.	Crack or split	Visual	10017

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

Minor:	AQL 1.50 percent		
201.	Protective finish inadequate exposing base metal	Visual	10018
202.	Finish improper	Visual	10019
203.	Evidence of poor workmanship (see 3.13)	Visual	10020

4.3.2.11 Output pinion assembly (see dwg. 8839332 covering a detail of dwg. 8839316).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Torque test (see 4.4.5)	Test	11001
102.	Inside diameter, min	Gage	11002
103.	Height of crimp above adjacent surface of reduction gear, max.	Gage	11003
104.	Diameter of adapter	Gage	11004
105.	Material damaged due to crimping operation (gear dished or distorted)	Visual	11005
Minor:	AQL 1.50 percent		
201.	Protective finish inadequate exposing base metal	Visual	11006
202.	Finish improper	Visual	11007
203.	Evidence of poor workmanship (see 3.13)	Visual	11008

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.12 Pinion, input shaft (see dwg. 8839323 covering a detail of dwg. 8839316).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.65 percent		
101.	Smaller diameter at end of shaft	Gage	12001
102.	Distance from face of gear to shoulder at smaller diameter, max	Gage	12002
103.	Distance from face of gear to end of shaft (pin end)	Gage	12003
104.	Diameter of drive pin hole, max	Gage	12004
Minor:	AQL 1.50 percent		
201.	Total length	Gage	12005
202.	Diameter of shaft (pin end), min	Gage	12006
203.	Protective finish inadequate (base metal exposed)	Visual	12007
204.	Evidence of poor workmanship (see 3.13)	Visual	12008

4.3.2.12A Pin, straight groove (see dwg. 8839327 covering a detail of dwg. 8839322).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.40 percent		
101.	Diameter over raised portion of grooves, min	Gage	12009
Minor: None defined.			

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.13 Input drive assembly (see dwg. 8839322 covering a detail of dwg. 8839316).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Smaller diameter of bushing housing	Gage	13001
102.	Larger diameter of extension shaft	Gage	13002
103.	Smaller diameter of extension shaft	Gage	13003
104.	Length at smaller diameter of extension shaft	Gage	13004
105.	Key spring, pin, or bushing missing	Visual	13005
106.	Gear teeth damaged	Visual	13006
107.	Chamfer missing at ends	Visual	13007
108.	Bushing cracked	Visual	13008
109.	Assembly damaged (bent or deformed)	Visual	13009
Minor:	AQL 1.50 percent		
201.	Protective finish inadequate (base metal exposed)	Visual	13010
202.	Finish improper	Visual	13011
203.	Evidence of poor workmanship (see 3.13)	Visual	13012

Source: https://assist.dla.mil -- Downloaded: 20261O-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.14 Stud, output (see dwg. 8839319 covering a detail of dwg. 8839316).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 1.00 percent		
101.	Distance from crimping end to shoulder, min.	Gage	14001
102.	Length of shoulder	Gage	14002
103.	Diameter of crimping end, min.	Gage	14003
104.	Diameter of longer end (gear assembly)	Gage	14004
105.	Finish improper	Visual	14005
Minor:	AQL 1.50 percent		
201.	Diameter of shoulder, min.	Gage	14006
202.	Depth at crimping lip, min.	Gage	14007
203.	Chamfer missing	Visual	14008
204.	Evidence of poor workmanship (see 3.13)	Visual	14009

4.3.2.15 Stud, idler (see dwg. 8839320 covering a detail of dwg. 8839316).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 1.00 percent		
101.	Distance from crimping end to shoulder, min.	Gage	15001
102.	Length of shoulder	Gage	15002
103.	Diameter at crimping end, min.	Gage	15003
104.	Diameter of longer end (gear assembly)	Gage	15004
105.	Finish improper	Visual	15005

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

Minor:		AQL 1.50 percent	
201.	Diameter of shoulder, min.	Gage	15006
202.	Depth at crimping lip, min.	Gage	15007
203.	Chamfer missing	Visual	15008
204.	Evidence of poor workmanship (see 3.13)	Visual	15009

4.3.2.16 Housing (see dwg. 8839318 covering a detail of dwg. 8839316).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.50 percent		
101.	Inside diameter of large cavity	Gage	16001
102.	Symmetrical and angular location of timing lock slots with inside diameter of large cavity	Gage	16002
103.	Concentricity of outside diameter with inside diameter of large cavity	Gage	16003
104.	Depth to bottom of large cavity	Gage	16004
105.	Diameter of extension shaft hole	Gage	16005
106.	Concentricity of extension shaft hole with inside diameter of large cavity	Gage	16006
107.	Outside diameter of coupling end, max	Gage	16007
108.	Concentricity of outside diameter of coupling end with inside diameter of large cavity	Gage	16008
109.	Distance to shoulder of coupling locking groove	Gage	16009
110.	Diameter of shoulder of coupling locking groove	Gage	16010

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the currentversion before use.

111.	Width of shoulder of coupling locking groove	Gage	16011
112.	Profile and depth of coupling locking groove	Gage	16012
113.	Width of key spring slot in extension shaft hole, min	Gage	16013
114.	Location of window hole	Gage	16014
115.	True position of gear stud holes with diameter of extension shaft hole	Gage	16015
116.	Wall thickness of web containing shaft hole, min	Gage	16016
Minor:	AQL 2.50 percent		
201.	Depth to bottom of cavity at coupling end	Gage	16017
202.	Location of spring slot in extension shaft hole	Gage	16018
203.	Location of stop screw hole	Gage	16019
204.	Protective finish inadequate (bare spot or scratch)	Visual	16020
205.	Evidence of poor workmanship (see 3.13)	Visual	16021

4.3.2.17 Reduction gear and pinion assembly (see dwg. 8839329 and dwg. 9223835 covering a detail of dwg. 8839316).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major: (8839329)	AQL 1.00 percent		
101.	Torque test failure (see 4.4.5)	Test	17001
102.	Diameter of stud hole in pinion	Gage	17002
103.	Distortion due to staking	Visual	17003
104.	Gear tooth damaged (rolled edge, cut, chipped or burred)	Visual	17004
105.	Flat side of gear not toward staked side of assembly	Visual	17005

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

Major: (9223835) AQL 0.40 percent

106.	Diameter of stud hole	Gage	17006
107.	Component incomplete	Visual	17007

Minor: (8839329) AQL 1.50 percent

201.	Protective finish damaged exposing base metal	Visual	17008
202.	Evidence of poor workmanship (see 3.13)	Visual	17009

4.3.2.18 Input drive housing assembly (see dwg. 8839316 covering a detail of dwg. 8839300).

Categories	Defects	Method of Inspection	Code No.

Critical: None defined.

Major: AQL 0.65 percent

101.	Component improperly positioned	Visual	18001
102.	Crimp of studs to housing incomplete or damaged	Visual	18002
103.	Hole in gear train cup not in alignment with housing window	Visual	18003
104.	Gear cup train leg screw missing or loose	Visual-Manual	18004

Minor: None defined.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.19 Body, fuze, (see dwg. 8839303 covering a detail of dwg. 8839302).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 2.50 percent		
101.	Pitch diameter of large thread	Gage	19001
102.	Major diameter of large thread	Gage	19002
103.	Pitch diameter of rotor cap thread, min	Gage	19003
104.	Major diameter of rotor cap thread, min	Gage	19004
105.	Diameter of rotor cavity	Gage	19005
106.	Depth of rotor cavity	Gage	19006
107.	Diameter of rotor release plunger hole, min	Gage	19007
108.	Diameter of rotor release collar hole, min	Gage	19008
109.	Location of rotor pivot pin cavity	Gage	19009
110.	Diameter of rotor pivot pin cavity, min	Gage	19010
111.	Depth of rotor pivot pin cavity	Gage	19011
112.	Location of rotor detent cavity	Gage	19012
113.	Diameter of relay assembly cavity, min	Gage	19013
114.	Depth to bottom of relay assembly cavity	Gage	19014
115.	Depth to top of relay assembly cavity, max	Gage	19015
116.	Diameter of flash hole, min	Gage	19016
117.	Symmetrical location of delay element cavity with firing pin assembly cavity	Gage	19017

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

118.	Distance from bottom of rotor cavity to delay element cavity	Gage	19018
119.	Location of delay element lock pin hole	Gage	19019
120.	Diameter of firing pin guide cavity, min	Gage	19020
121.	Distance to bottom of firing pin guide cavity	Gage	19021
122.	Diameter of firing pin hole, min	Gage	19022
123.	Concentricity of firing pin hole with firing pin guide cavity	Gage	19023
124.	Diameter of body at housing end	Gage	19024
125.	Concentricity of body at housing end with firing pin guide cavity	Gage	19025
126.	Location of lug at housing end	Gage	19026
127.	Depth and profile of firing pin tab slot, min	Gage	19027
128.	Distance to housing locking tab chamfer, max	Gage	19028
129.	Distance from housing locking tab chamfer to housing seat	Gage	19029
130.	Profile of housing locking tab chamfer	Gage	19030
131.	True position of timing lock assembly hole to large inside diameter and rotor release plunger hole	Gage	19031
132.	True position of firing pin disc cavity to large inside diameter and rotor release plunger hole	Gage	19032
133.	True position of tang to large inside diameter and rotor release plunger hole	Gage	19033
134.	Width of tang	Gage	19034
135.	Depth of detent hole	Gage	19035
136.	Diameter of detent cavity	Gage	19036
137.	Depth of delay lock pin washer counterbore, min	Gage	19037
138.	Diameter of delay lock pin washer counterbore, max	Gage	19038

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

139.	Concentricity of rotor release collar hole with plunger hole	Gage	19039
140.	Finish improper	Visual	19040
141.	Evidence of excessive porosity (see 3.14.2)	Visual	19041
Minor:	AQL 4.00 percent		
201.	Total length (less lug at housing end)	Gage	19042
202.	Distance to shoulder at rotor cap end	Gage	19043
203.	Distance from rotor cap end to shoulder at start of large thread	Gage	19044
204.	Diameter of delay element cavity, min	Gage	19045
205.	Diameter of firing pin guide cavity, max	Gage	19046
206.	Diameter of timing lock hole	Gage	19047
207.	Protective finish inadequate (bare spot or scratch)	Visual	19048
208.	Evidence of poor workmanship (see 3.13)	Visual	19049

4.3.2.20 Fuze body assembly (see dwg. 8839302 covering a detail of dwg. 8839300).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Distance from guide pin (delay guide) to wall of delay element cavity	Gage	20001
102.	Symmetry of guide pin with delay element cavity	Gage	20002
103.	Movement of rotor release assembly not free	Manual	20003
104.	Stake of delay lock pin washer inadequate (4 places not equally spaced)	Visual	20004
105.	Firing pin guide retaining ring missing or incorrectly assembled	Visual	20005

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	20006

4.3.2.21 Metal parts assembly (see dwg. 8839300).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Fuze partially or completely armed as indicated by red showing in the window and if when the viewing window shows white, the rotor release pin is flush with bottom surface of the rotor cavity and the key of the firing pin guide is visable in the firing pin hole (viewed through delay element cavity) the fuze shall be considered armed (see 3.7)	Visual	21001
Major:	AQL 1.50 percent		
101.	Arming time setting and locking (see 3.5 and 4.4.10)	Test	21002
102.	Input drive collar distorted by stamping, max	Gage	21003
103.	Compression spring missing (depress delay lock pin)	Manual	21004
104.	Freeness of rotation of input drive assembly	Manual	21005
105.	Rotor release assembly missing	Visual	21006
106.	Housing tabs in cut-outs cracked, or not bent over locking tab chamfer	Visual	21007
107.	Thread damaged	Visual	21008
108.	Assembly set at improper arming time (see 3.9)	Visual	21009
109.	Delay lock pin damaged (bent, burred, nicked, etc)	Visual	21010

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

110.	Extention shaft damaged (bent, burred, nicked, etc).....	Visual	21011
111.	Extension shaft key spring missing or damaged.....	Visual	21012
112.	Spring pin missing from delay element cavity.....	Visual	21013
113.	Stop screw missing from side wall.....	Visual	21014
114.	Flash relief hole missing from delay element cavity.....	Visual	21015
Minor:	AQL 2.50 percent		
201.	Total length, max.....	Gage	21016
202.	Window cracked or punctured, or missing.....	Visual	21017
203.	Rotor cavity window stake missing.....	Visual	21018
204.	Marking misleading or unidentifiable.....	Visual	21019
205.	Evidence of poor workmanship (see 3.13).....	Visual	21020

4.3.2.22 Detent, rotor (see dwg. 8839352 covering a detail of dwg. 8839354).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Total length, max.....	Gage	22001
102.	Distance from centerline to edge of longer leg.....	Gage	22002
103.	Effective diameter including any longitudinal bend of swaged length, max.....	Gage	22003
104.	Length to diameter affected by swaging, max.....	Gage	22004
105.	Radius along outer edge of longer leg missing.....	Visual	22005
106.	Protective finish missing, incomplete or damaged, exposing base metal.....	Visual	22006

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	22007

4.3.2.23 Spring, rotor, detent, (see dwg. 8839353 covering a detail of dwg. 8839354).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Torque test (see 4.4.13)	Test	23001
102.	Solid height, max	Gage	23002
103.	Inside diameter	Gage	23003
104.	Length of short arm, min	Gage	23004
105.	Length of long arm, min	Gage	23005
106.	Winding incorrect	Visual	23006
107.	Protective finish incomplete or inadequate	Visual	23007
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	23008

4.3.2.24 Spring, rotor, torque (see dwg. 8839351).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Torque (see 4.4.13)	Test	24001
102.	Solid height, max	Gage	24002
103.	Winding incorrect	Visual	24003
104.	Protective coating incomplete or inadequate	Visual	24004
105.	Profile at end	Visual	24005

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	24006

4.3.2.25 Rotor (see dwg. 8839349).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.50 percent		
101.	Profile of rotor	Gage	25001
102.	Diameter of pivot pin hole, max	Gage	25002
103.	Diameter of detonator hole, max	Gage	25003
104.	Diameter of detonator flash hole	Gage	25004
105.	Location of pivot pin hole	Gage	25005
106.	Location of detonator hole	Gage	25006
107.	Parallelism of top surface with bottom surface	Gage	25007
108.	Depth of detonator hole	Gage	25008
109.	Thickness, max	Gage	25009
110.	Radial length from detonator hole to outside surface	Gage	25010
111.	Finish improper	Visual	25011
112.	Protective finish incomplete or inadequate	Visual	25012
113.	Paint extending on to face of rotor	Visual	25013
Minor:	AQL 1.00 percent		
201.	Width of cutaway	Gage	25014
202.	Evidence of poor workmanship (see 3.13)	Visual	25015

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.26 Pin, pivot, rotor (see dwg. 8839350 covering a detail of dwg. 8839348 and 8839343).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.65 percent		
101.	Diameter of pin above knurl	Gage	26001
102.	Diameter of knurl, min	Gage	26002
103.	Length	Gage	26003
104.	Protective finish inadequate or incomplete	Visual	26004
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	26005

4.3.2.27 Assembly, rotor (inert) (see dwg. 8839348 and dwg. 9226247, as applicable, covering a detail of dwg. 8839354).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Letter "A" on warning cutaway missing, incomplete, damaged, improper color or improperly located (see 6.9)	Visual	27001
2.	Red paint on warning cutaway missing, incomplete or damaged (see 6.9)	Visual	27002

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

Major:	AQL 0.65 percent		
101.	Perpendicularity of pivot pin with bottom surface	Gage	27003
102.	Height to end of rotor pivot pin, max	Gage	27004
103.	Pivot pin above flush with top surface	Visual	27005
104.	Protective finish incomplete or inadequate	Visual	27006
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.13)	Visual	27007

4.3.2.28 Cap, rotor (see dwg. 8839347 covering a detail of dwg. 8839354).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Pitch diameter of thread, min.	Gage	28001
102.	Minor diameter of thread	Gage	28002
103.	Diameter of center relief in counterbore	Gage	28003
104.	Thickness of center relief in counterbore	Gage	28004
105.	Length of perfect thread, min.	Gage	28005
106.	Crack or split	Visual	28006
Minor:	AQL 1.50 percent		
201.	Surface finish improper	Visual	28007
202.	Protective finish damaged exposing base metal	Visual	28008
203.	Evidence of poor workmanship (see 3.13)	Visual	28009

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.2.29 Key spring (see dwg. 8839326 covering a detail of dwg. 8839322).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.40 percent		
101.	Inside profile, min.....	Gage	29001
102.	Key spring cracked.....	Visual	29002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.13).....	Visual	29003

4.3.2.30 Assembly, rotor (Alternative) (inert) (see dwg. 9226247 covering a detail of dwg. 8839337).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Letter "A" on warning cutaway missing, incomplete, damaged, improper color or improperly located (see 6.9).....	Visual	30001
2.	Red paint on warning cutaway missing, incomplete or damaged (see 6.9).....	Visual	30002
Major:	AQL 1.50 percent		
101.	Profile of rotor.....	Gage	30003
102.	Height of rotor pivot pin beyond end surface, max.....	Gage	30004
103.	Diameter of detonator hole, max.....	Gage	30005
104.	Diameter of detonator flash hole.....	Gage	30006
105.	Location of detonator hole with pivot pin.....	Gage	30007

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

106.	Parallelism of top surface with bottom surface	Gage	30008
107.	Depth of detonator hole	Gage	30009
108.	Thickness, max	Gage	30010
109.	Perpendicularity of pivot pin with bottom surface	Gage	30011
110.	Radial length from detonator hole to outside surface	Gage	30012
111.	Diameter of pin	Gage	30013
112.	Finish improper	Visual	30014
113.	Protective finish incomplete or inadequate	Visual	30015
114.	Paint extending onto face of rotor	Visual	30016
115.	Pivot pin above flush with top surface	Visual	30017
Minor:	AQL 1.00 percent		
201.	Width of cutaway	Gage	30018
202.	Evidence of poor workmanship (see 3.13)	Visual	30019

4.3.3 Testing.

4.3.3.1 **First article testing** (see 4.2.1).-The samples submitted as the first article quantity shall be tested as specified below after having been examined for any or all other drawing requirements. Rejection and re-submission shall be in accordance with 4.2.3.

4.3.3.1.1 Spring embrittlement (see 3.3 and 4.4.1).-spring key, Code No. 29004; spring rotor release, Code No. 01009; spring creep, Code No. 07008; spring compression, Code No. 04009, spring timing lock, Code No. 21021, spring rotor detent, Code No. 23009 and spring, rotor torque, Code No. 24007.

4.3.3.1.2 Functioning of input drive housing assembly with internal gear (see 3.4 and 4.4.2) - Code No. 18005.

4.3.3.1.3 Presence of shear pin (see dwg. 8839302 and 4.4.3) - Code No. 20007.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.3.1.4 Extension shaft locking (see 3.6 and 4.4.6) - Code No. 21022.

4.3.3.1.5 Transportation vibration (see 3.7 and 4.4.7), Arming - Code No. 21023; functional impairment - Code No. 21024.

4.3.3.1.6 Arming (see 3.8 and 4.4.8) - Code No. 21025.

4.3.3.1.7 Porosity of die-cast body (see 3.11 and 4.4.9) - Code No. 19050.

4.3.3.1.8 Protective finish

4.3.3.1.8.1 Salt spray (see 3.12 and 4.4.11) Code No. 31001.-Three specimens of each component and each sub-assembly, when applicable, shall be tested as specified in 4.4.11.

4.3.3.1.8.2 Plating thickness of firing pin assembly (see dwg. 9217286 only) Code No. 31002.-Three firing pin assemblies shall be tested as specified in 4.4.11.

4.3.3.1.9 Spring torque.-Spring rotor detent (see dwg. 8839353 and 4.4.13) Code No. 23010 and spring rotor torque (see dwg. 8839351 and 4.4.13) Code No. 24007.

4.3.3.2 Production testing.

4.3.3.2.1 Spring embrittlement (see 3.3).-Spring key (dwg. 8839326) Critical defect, Code No. 29004; spring rotor release (dwg. 8839312) Major defect, Code No. 01009; spring, creep (dwg. 8839341) Major defect, Code No. 07008; spring compression (dwg. 8839306) Major defect, Code No. 04009; spring timing lock (dwg. 8839346) Major defect, Code No. 21021; spring rotor detent (dwg. 8839353) Major defect, Code No. 23009; and spring rotor, torque (dwg. 8839351) Major defect, Code No. 24007.-A sample of 10 springs shall be selected from each embrittlement relief batch for this test. The test shall be performed as specified in 4.4.1. Failure of one or more springs to comply with the specified requirement shall reject the entire embrittlement relief batch represented by the sample.

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.3.2.2 Functioning of input drive housing assembly with internal gear (see 3.4) - Major defect - Code No. 18005.-This test shall be performed 100 percent using the applicable test equipment of 4.3.4. Any assembly exhibiting a rotation outside the permitted range shall be classed defective and be removed from the lot. Testing shall be as specified in 4.4.2.

4.3.3.2.3 Presence of shear pin (see dwg. 8839302) - Major defect - Code No. 20007.-This determination shall be performed 100 percent using the applicable equipment of 4.3.4. Any unit in which rotation is unlimited shall be classed defective and be removed from the lot. Testing shall be as specified in 4.4.3.

4.3.3.2.4 Extension shaft locking (see 3.6) Critical defect - Code No. 21022.-A sample of 300 input drive housing assemblies shall be selected from each lot and tested as specified in 4.4.6 using test equipment specified in 4.3.4. If one or more key springs are found missing, damaged, broken or cracked, one or more input drive pin assemblies are missing or insecure, or one or more assemblies fail to comply with the specified requirement, the entire lot shall be tested 100 percent and defective assemblies shall be rejected and removed from the lot.

4.3.3.2.5 Transportation vibration (see 3.7) (a) Critical defect (Code No. 21023) if a unit arms; (b) Major defect (Code No. 21024) for any functional impairment.-A sample of 75 units shall be selected from each lot for these tests. If one or more units arm, the lot shall be rejected. Functional failure in 2 or more units shall reject the lot. Testing shall be in accordance with 4.4.7 using the applicable equipment of 4.3.4.

4.3.3.2.6 Arming (see 3.8) - Code No. 21025 - Major defect.- The accepted sample of 4.3.3.2.5 shall be submitted to this test which shall be performed as specified in 4.4.8. Failure of two (2) or more units of the sample in meeting the requirement shall reject the lot.

4.3.3.2.7 Porosity of fuze body (see 3.11.1) - Major defect - Code No. 19050.-Prior to the assembly of components into the fuze body (at the prime contractor's plant (see 6.7)) a sample of 5 castings from each die cavity shall be selected from each lot. If two or more bodies fail to comply with the requirement specified, the lot shall be

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

rejected. If no defectives are found, the lot will be accepted. If one defective is found, a second sample of 5 body castings from each die shall be selected and tested. If the combined number of defectives in both the first and second sample is two or more, the lot shall be rejected. The test shall be performed as specified in 4.4.9 using the test equipment specified in 4.3.4.

4.3.3.2.8 Protective finish

4.3.3.2.8.1 Salt spray (see 3.12) Major defect, Code No. 31001.- A sample of three specimen components and sub-assemblies (when plating is required on sub-assemblies) shall be selected from the inspection lot by the Government and subjected to the test specified in 4.4.11, by the contractor. The inspection lot is defined as any quantity which the contractor elects to submit to the Government for Government acceptance. This quantity may consist of any number of "shipments", "batches" or "lots" plated by any number of plating processes but is limited to one plater and one component configuration. This quantity shall be physically in existence and shall be under Government control during the selection of the sample. At the contractor's request and at the contractor's risk, the Government will release the inspection lot to the contractor for further processing or assembly operations prior to completion of the salt spray test. The inspection lot shall be rejected if one or more specimens are classed defective. Rejected inspection lots may be stripped, replated, and resubmitted to the Government for retesting, using a sample size of six. The retested lot shall be rejected if one or more specimens are classed defective. All resubmission is limited to those lots conforming to dimensional requirements after plating.

4.3.3.2.8.2 Plating thickness of firing pin assembly (dwg. 9217286 only) Major defect, Code No. 31002.-A sample of ten (10) firing pin assemblies shall be selected from each lot and tested as specified in 4.4.11. The inspection lot shall be rejected if one or more firing pin assemblies are found defective.

4.3.3.2.9 Load test

4.3.3.2.9.1 Compression test (see dwg. 8839326) Major defect - Code No. 29005.-A sample of twenty (20) key springs shall be selected from each key spring inspection lot and tested as specified in 4.4.12. The inspection lot shall be rejected if one or more key springs are classed defective. This is a destructive test and the samples shall not be returned to the lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

4.3.3.2.9.2 Opening test (see dwg. 8839326) - Major defect - Code No. 29006.-A sample of twenty (20) key springs shall be selected from each key spring inspection lot and tested as specified in 4.4.12. The inspection lot shall be rejected if one or more key springs are classed defective. This is a destructive test and the samples shall not be returned to the lot.

4.3.3.2.10 Fuze body assembly (see dwg. 8839302) Collar of rotor release assembly not below surface of hole in bottom of rotor cavity - Major defect - Code No. 20008.-This inspection shall be accomplished prior to assembly of firing pin guide. Sampling plan for this inspection shall be in accordance with Standard MIL-STD-105, using applicable sample size code letter under general inspection level II, in accordance with Table I, using a single sampling plan under Table II-A at an AQL of 0.040 percent. Any collar of the rotor release assembly that fails to comply with the specified drawing requirement shall be classed defective.

4.3.3.2.11 Load test of firing pin (alternate) (see 3.10 and dwg. 9217286) Critical defect, Code No. 08019.-A sample of 75 firing pins shall be selected from each lot for this test. The test shall be performed as specified in 4.4.14, using test equipment specified in 4.3.4. If one or more sample units are found defective, the lot shall be rejected. This test is considered destructive and tested samples shall not be returned to the lot.

4.3.3.2.12 Delay lock pin washer load test (see 3.11 and dwg. 8839302) Major defect, Code No. 20009.-A sample of fifty (50) fuze body assemblies shall be selected from each lot for this test. The test shall be performed as specified in 4.4.15, using test equipment specified in 4.3.4. If two or more defectives are found, the lot shall be rejected. If only one defective is found, a second sample of fifty (50) assemblies shall be selected and tested. If in the combined first and second sample a total of two or more defectives are found, the lot shall be rejected.

4.3.3.2.13 Fuze body assembly (see dwg. 8839302), Symmetry of guide pin with delay cavity, including failing to lock in place - Major defect, Code No. 20010.-This inspection shall be performed using equiment in accordance with 4.3.4. Sampling plan for this inspection shall be in accordance with Standard MIL-STD-105, using

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

applicable sample size code letter under Inspection Level II, in accordance with Table I, using a single sampling plan under Table II-A and an AQL of 0.040 percent. Any fuze body assembly which fails to comply with the specified drawing requirement shall be classed defective. Rejection shall be as specified in Standard MIL-STD-105.

4.3.4 *Inspection Equipment.-Equipment* Tabulation Number ET-8839300 identifies the inspection equipment required to perform the examinations and tests prescribed in this section. The contractor shall design inspection equipment in accordance with the instructions in paragraph 6.3.1.

4.3.4.1 Government rights to documentation.-Inspection equipment drawings and lists provided and revised in accordance with the requirements of the ET may be used by DOD activities for design, procurement, manufacture, testing, evaluation, production and receiving inspection, overhaul, shipping, storage, identification of stock, ordering and storage of replacement parts, inspection of items at overhaul, general maintenance of equipment, construction, survey and whenever inspection equipment drawings are needed.

4.3.4.2 Calibration.-The contractor shall have available a set of master gages, standards, and appropriate instruments for regularly scheduled calibrations of his acceptance inspection equipment. Records of such regularly scheduled calibrations shall be maintained by the contractor and made available for review by the Government. The calibration of gages, standards, and instruments shall be in accordance with Specification MIL-C-45662.

4.4 *Test methods and procedures.-The test method and procedures* described in each of the following tests represents only one method and one procedure which has been proven in use and is approved by the Government for Government acceptance purposes. Producers and manufacturers have the option of using substitute methods and procedures only after obtaining Government approval. Government approval will be based on an evaluation to determine that the substitute method and procedure will result in an equal or better quality evaluation than that specified herein.

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the currentversion before use.

4.4.1 Spring embrittlement.-The coil springs shall be extended and re-extended to greater lengths until each sample spring no longer returns to its original configuration indicating it has reached the minimum point of permanent deformation. The key spring shall be distorted to the dimensions specified on the applicable drawing. Any spring which shows evidence of cracking or breaking when it is stressed to the minimum point of permanent distortion shall be classed defective.

4.4.2 Functioning of input drive housing assembly with internal gear.-The input drive housing assembly with an internal gear assembled thereto shall be assembled into the applicable test fixture of 4.3.4. The input drive shaft shall be rotated in the clockwise direction for the required number of revolutions. Observation shall be made of the rotation of the internal gear. Any unit rotating the gear outside the permitted range shall be classed defective.

4.4.3 Presence of shear pin.-A tool shall be inserted into the center hole of the striker pin guide of the body assembly. The tool shall be rotated until a torque of 50 to 100 inch-ounces is developed. Any unit exhibiting unlimited rotation of the tool shall be classed defective. The striker pin guide of accepted units shall be returned to the correct position.

4.4.4 Load test of firing pin assembly.-The firing pin assembly shall be assembled into the applicable test fixture of 4.3.4 and the required force shall be applied as indicated on the drawing. Observation shall be made for movement of the disc. Any unit exhibiting such movement shall be classed defective.

4.4.5 Torque testing the output pinion assembly and the reduction gear and pinion assembly.-Either assembly shall be assembled into its applicable test fixture of 4.3.4 and the required torque shall be applied. Observation shall be made for movement of components. Any assembly exhibiting movement shall be classed defective.

4.4.6 Extension shaft locking.-A simulated drive coupling shall be used to depress the key spring of the input drive assembly. The simulated drive coupling shall contain a cavity 1 inch deep minimum, and the cavity shall be 0.285 to 0.287 inch in diameter. The coupling shall be slipped over the input drive assembly until it contacts the

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

housing, and turned in either direction for 15 to 90 degrees, and the coupling removed. If the key spring does not appear to be damaged, and if the input drive pin assembly is present and secure, the extension shaft shall be turned to its original slot engagement, being careful not to depress the key spring or influence its engagement into the housing slot. Engagement of the key spring into the housing slot shall be evidenced by attempting to rotate the extension shaft manually in either direction, without depressing the key spring. If locking action has occurred, the key spring shall be depressed and the input drive assembly rotated slightly (in either direction) so as to prevent re-entry of the key spring into the housing slot. A weight of 14 to 18 ounces shall then be suspended (by a 0.020 inch maximum diameter length of music wire formed in the shape of a hook) from the loop of the key spring with the complete parts assembly held inverted with the longitudinal axis of the assembly forming not more than a 10 degree angle from the vertical. The direction of pull by the attached weight shall be along the longitudinal axis of the extension shaft and away from the housing. With the weight suspended freely, the extension shaft shall be manually turned to permit re-engagement of the key spring into the housing slot. The turning action of the extension shaft shall be effected by grasping the extension shaft between the thumb and forefinger, taking care not to depress the key spring. Observation shall be made for positive engagement of the key spring into the housing slot and locking. This test shall be repeated, using the opposite slot, and the fuze reset to the original slot. The assembly shall be classed defective if the extension shaft or spring fails to engage and remain locked in either housing slot while the weight is freely suspended from the key spring.

4.4.7 Transportation vibration.-Metal parts assemblies shall be subjected to the transportation vibration test as specified in Standard MIL-STD-331 test method 104, procedure II (2.2 not being applicable). After test, observation shall be made for evidence of fuze arming (see 6.5). If arming does not occur, the sample shall be submitted to the tests of 4.4.8.

4.4.8 Arming.-The fuze metal parts assemblies to be tested for arming shall have demonstrated compliance with the arming time setting, extension shaft locking, and transportation vibration test requirements specified. The stop screw shall be removed and discarded and the fuze setting shall be moved from the 20 second setting down

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

to the 4 second setting and back to the 20 second setting. The sample shall be divided into 3 groups of 25 each. The conditioning chamber shall be at the required temperature prior to start of fuze conditioning time and shall be maintained within 5 degrees of the required temperature during the entire conditioning time period. The arming test for individual fuzes shall be accomplished within 5 minutes of removal from the conditioning chamber. At the option of the contractor, the fuzes may be placed in a heated chamber, wherein the temperature shall not exceed 140 degrees, to drive off any excess moisture, and sealed in vapor proof bags prior to the required temperature conditioning. The key spring of the input drive assembly shall be examined to determine that it is not broken and the setting shall be examined for positive locking action. The fuze shall be assembled to the applicable test equipment and the input drive assembly rotated at the prescribed speed in a clockwise direction (as viewed from the input drive end) until arming occurs. During this test, the test equipment shall restrain only the fuze body, the housing shall not be restrained in any manner whatsoever. The test equipment shall record the number of revolutions of the input drive assembly to the nearest 0.1 turn. The test equipment shall turn the input drive assembly at a rate of 1,700 to 1,900 revolutions per minute, and shall incorporate a braking device to stop the rotation of the input drive assembly within 1.0 turn maximum after arming has occurred. The arming turns shall be counted from when the input drive assembly begins to move until the simulated rotor moves through an arc of 15 to 25 degrees (considering the pivot point to be the center of the rotor pivot pin hole in the fuze body.) The input torque shall be monitored during the entire test to determine any excess arming torque. The fuze shall be removed from the test equipment and the rotor release assembly examined to determine the degree of retraction. The key spring shall be examined to determine if it is broken. A finger shall be placed in the delay element cavity to determine if the firing pin freely enters the delay element cavity by applying approximately a one gravity acceleration to the fuze in a direction which would cause the firing pin to move into the cavity. The fuze shall be reassembled to the test equipment and the arming operation continued until a minimum of 60 additional turns are completed or until a constant torque of 6 inch-ounces is exceeded. (This may be accomplished by a manual operation at the option of the contractor.) The fuze shall then be examined and a determination again made for entry of the firing pin into the delay element cavity as described above. The number of arming turns shall be rounded off to the nearest whole number. Numbers ending with and including .5 shall be reduced to the next lower number while

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

those ending with .6 and over shall be increased to the next higher whole number. The fuze shall be classed defective if one or more of the following defects are observed:

a. Number of arming turns fails to conform to the specified limits, after rounding off as described above.

b. The maximum specified input torque is exceeded at any time during the arming turns test except during initial starting of the arming turns test and at the approximate time the shear pin is severed.

c. The rotor release assembly fails to retract to at least flush with the bottom of the rotor cavity when the arming has occurred as indicated by a 150 to 250 rotation of the simulated rotor.

d. The key spring is found broken at any time up to the end of the arming turns test.

e. The firing pin fails to enter the delay element cavity in either or both tests.

f. The time setting, is not positively locked and maintained in position by the timing lock assembly.

4.4.9 Porosity of fuze body.-The fuze body shall be sectioned in a plane through the centerline along the longitudinal axis through the approximate center of the rotor release cavity and observation for porosity shall be made in each half of the sectioned sample. Any half of a fuze body which is porous in excess of the specified requirements shall cause the fuze body to be classed defective.

4.4.10 Arming time setting and locking.-Depress the timing lock and rotate the input drive housing assembly so that the setting slot aligns with the boss on the timing lock. Release the timing lock and the boss shall engage the slot, locking the assembly at that particular setting. Set and lock the assembly at each setting (including the 4 second setting) and attempt to set the assembly in the 4 second setting with the stop screw in place. At completion of test, the assembly shall be set and locked at the 20 second position and the stop screw shall be checked for engagement and tightness.

4.4.11 Protective finish

4.4.11.1 Salt spray.-The sample shall be tested as specified in Federal Test Method Standard No. 151 Method 811.1 with the specific exceptions specified in the requirements. After testing for the required time, visual observation shall be made to determine compliance with the requirements. Any component or sub-assembly which fails to conform to the specified requirements shall be classed defective.

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

4.4.11.2 Plating thickness of firing pin assembly (dwg. 9217286 only).-The sample firing pin assembly shall be cross sectioned through the shaft between the flange and disc surface. The side and bottom of the (.103 - .015) surface shall be examined and tested as specified in Federal Test Method Standard No. 151, Method 521.1. If one or more firing pin assemblies fail to comply with the specified requirement, the lot shall be rejected.

4.4.12 Load test.

4.4.12.1 Compression test.-After clamping the spring at the location specified on the drawing, a load shall be applied at the location specified to compress the spring to the larger of the two dimensions specified on the drawing. The spring shall then be measured to determine compliance with the angular requirements, after compression, specified on the drawing. Then with the spring clamped as above, a load shall be applied as above to compress the spring to the smaller dimension specified on the drawing. The spring shall be classed defective if it breaks during either of the compression tests, or if it fails to return to the minimum angular dimension specified after being compressed to the larger dimension.

4.4.12.2 Opening test.-After clamping the spring at the location specified on the drawing, a load shall be applied at the location specified to open the spring to the angular dimension specified on the drawing. The spring shall be classed defective if it breaks during this test or is found to be cracked after this test.

4.4.13 Torque test for springs.-The spring shall be assembled into the applicable test equipment of 4.3.4 and the torque measured. Any unit failing to meet the requirement shall be classed defective.

4.4.14 Load test of firing pin (alternate).-For the performance of this test a standard M905 fuze body (dwg. 8839303) may be modified by attaching a steel ring (Rockwell C-50, minimum hardness) 1/8 inch thick to the top surface of the fuze body. The steel ring shall be of the same configuration as the top end surface of the fuze body. A steel firing pin guide (Rockwell C-50, minimum hardness) shall be secured in the fuze body by means of a standard retaining ring (MS 16625-1118). The steel firing pin guide shall be of the same configuration as the standard firing pin guide (dwg. 8839315) except that the key shall be omitted.

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

The modified fuze body shall then be assembled to the applicable test fixture specified in 4.3.4 and the sample firing pin inserted into the fuze body and firing pin guide with the tab on the firing pin completely out-of-line with the firing pin tab cut-out in the fuze body.

A 4 pound, minimum weight shall then be dropped to impact the top surface of the firing pin from a height of 4 feet, minimum. Observation shall then be made for protrusion of the firing pin point into the delay element cavity. Any firing pin which fails to comply with the specified requirement shall cause the lot to be rejected.

4.4.15 Delay lock pin washer load test.-The delay lock pin, spring and washer, as assembled to the fuze body, shall be subjected to this test by applying the specified load against the end of the delay lock pin with the pressure being exerted against the inside surface of the delay lock pin washer. Any assembly which fails to comply with the specified requirement shall be classed defective.

5. PREPARATION FOR DELIVERY

5.1 Packaging and packing.

5.1.1 Level C.

5.1.1.1 Fuzes.-The fuze shall be packaged and packed in accordance with Standard MIL-STD-1169.

5.1.1.2 Unassembled parts.-The unassembled parts (see 3.2) shall be packaged and packed in accordance with Standard MIL-STD-1169 and shall be kept segregated as to configuration and acceptance lots.

5.2 Marking.-Marking of the packaging and packing shall be in accordance with Standard MIL-STD-1169.

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

6. NOTES

6.1 Ordering data.-Procurement documents shall specify the following:

a. Title, number and date of this specification.

b. Data cards.-Data cards shall be prepared for each lot in accordance with the information specified in Standard MIL-STD-1167.

6.2 Inspection code numbers.-The five digit code numbers assigned to the inspections herein are to facilitate future data collection and analysis by the Government. These code numbers are used to correlate the characteristics cited on Equipment Lists with the inspections listed in this specification. They should also be cited as references on drawings of equipment designs submitted by the contractor (see 6.3.5).

6.3 Inspection equipment.-The contractor shall design inspection equipment as required by the referenced inspection Equipment Lists (EL) in accordance with the instructions of paragraphs 6.3.1 through 6.3.5.

6.3.1 Inspection equipment lists.-Inspection equipment lists indicate the availability of inspection equipment designs by showing in the "number" column of the list of inspection equipment (Form SMUPA 1010) the numbers of drawings or Federal Stock numbers of existing equipment designs, or codes as indicated in paragraph 6.3.2. Design action required of the contractor is described in paragraphs 6.3.3 and 6.3.4. The contractor will be required to prepare detailed drawings in accordance with 6.3.4 for all the equipment coded as "Contractor Design" in the number column. These contractor designs must be approved by the Government prior to fabrication or procuring of the equipment. Designs shall be submitted for approval as specified in 6.3.5.

6.3.2 Inspection equipment list codes.-The inspection equipment as defined in 6.3.3 and 6.3.4 will be designated in the EL by the following codes:

CD - Contractor design on controlled contractor format and/or commercial equipment.
MU - Army design, mandatory for use.

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

6.3.3 Army designs.-Army designs are reflected on detailed drawings which completely depict all the information necessary for the fabrication of the item of inspection equipment. The contractor need provide no design when an Army design is listed for an item of inspection equipment. Army designs fall into two basic classifications; mandatory (designated "MU") and non-mandatory (indicated by drawing or Federal Stock Number). When an inspection equipment list references mandatory Army designs, the contractor shall comply with, and use these designs accordingly. The contractor may, however, in connection with non-mandatory designs, and with the approval of the Government, design alternate inspection equipment or use comparable commercial equipment to facilitate his operations. Such contractor prepared designs or commercial equipment selections must be approved by the Government prior to fabrication or procuring of the equipment. Designs shall be submitted for approval as specified in 6.3.5.

6.3.4 Contractor designs.-Contractor designs are designs of inspection equipment for which the Government has assigned design responsibility to the contractor. Contractor designs shall be supported by detailed drawings which depict all information necessary to completely fabricate, calibrate and operate an item of inspection equipment. This requires that the necessary views, dimensions, materials, finish, notes, operating and calibration instructions be properly depicted in accordance with approved practices to the extent that further calculation or clarification will not be required. Unless otherwise specified, contractor designs may be developed on the format the contractor normally employs in his equipment design procedure provided such format reflects the detail and information specified above, subject to the following controls: All submitted contractor designs shall conform to MIL-D-1000, Category E, Form 2. Legibility and reproducibility shall permit conventional making of clearly understandable, high contrast reproductions. Contractors shall submit one copy of final designs as a rolled set. Designs shall be submitted for approval as specified in 6.3.5.

6.3.5 Submission of contractor designs.-All submitted designs shall contain a reference to the applicable 5 digit Code Number contained in section 4 of this specification and the appropriate component or assembly drawing number and revision letter to which the specific design applies. Unless otherwise specified on the

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.

EL, all designs of equipment for inspection of defects classified as critical and major shall be submitted for approval to the Commanding Officer, Picatinny Arsenal, ATTN: SMUPA-ND11. All other designs of inspection equipment shall be approved by the inspection element of the agency administering the contract; submission shall be as directed by the contracting officer. Partial submission of inspection equipment designs is permissible and encouraged. However, the Arsenal completion date for design review will be based on the date of the final submission of designs. Picatinny Arsenal design review will be accomplished normally within one month after receipt.

6.4 Submission of first article samples.-Instructions, as to the location for the evaluation of first article sample shall be obtained from the contracting officer. Upon receipt of such request, the contracting officer shall advise Picatinny Arsenal and instructions will be issued accordingly. All inquiries shall be forwarded to: Commanding Officer, Picatinny Arsenal, ATTN: SMUPA-NI, Dover, New Jersey 07801.

6.5 Arming.-The fuze shall be considered to be in the armed position when the red area of the internal gear is visible through the window in the input drive housing assembly and when the rotor release assembly has completely (fully) retracted from the rotor cavity of the metal parts assembly and the firing pin is free to move into the delay element cavity when the bias load of the creep spring is overcome.

6.6 Quality assurance provisions of other documents.-The quality assurance provisions of other documents which are required to be a part of the contractors written description include, but are not limited to, those which relate to plating or other protective coating, physical, chemical and other properties, for which specific quality assurance or inspection provisions are included in the applicable material and process specifications.

6.7 Porosity of die cast fuze body in sectioned surfaces.-Samples for determination of porosity in accordance with 3.14 shall be selected by the Government from die casting inspection lots at any stage of manufacture, at the option of the contractor, from raw castings to completely machined fuze bodies. This option is intended to extend the flexibility of the production process

Source: https://assist.dla.mil -- Downloaded: 2026-10-22T02:59Z
Check the source to verify that this is the current version before use.

which any particular contractor may choose to pursue. For example, if the castings are produced at a location where no Government inspection is available and the contractor transfers the castings to another location for machining and Government inspection is again not available, then the first opportunity for Government sample selection will be at the prime contractors plant, where the assembly operations will be performed.

6.8 Lot identification.-Fuze lots containing any plastic gears shall bear different lot interfix numbers than those metal parts fuze lots from the same manufacturer which contain only metal gears.

6.9 Letter "A" on rotor assembly warning cutaway improperly located.-Any rotor assembly subject to controversy as to the letter "A" not being properly located, shall be assembled into the rotor cavity of an empty fuze body (dwg. 8839303), move the rotor assembly to the fully armed position, and viewed through the rotor viewing window. Any rotor assembly which does not show the complete letter "A" within the window area shall be classed defective. Additionally, one set of colored photographs depicting lettering and paint visual standards VS 1-1 and VS 2-1 respectively, dated 6 May 1969, will be supplied to each contractor and one set to each Government representative at each contractor's facility for final comparison and determination.

Custodian:
Army-MU

Preparing activity:
Army-MU

Project Number: 1325-A-353

☆U.S. GOVERNMENT PRINTING OFFICE:1969-393-037/895

Source: https://assist.dla.mil -- Downloaded: 202610-22T02:59Z
Check the source to verify that this is the current version before use.