MILITARY SPECIFICATION

MINE, AT, PRACTICE, HEAVY: M20, PARTS FOR AND LOADING, ASSEMBLING AND PACKING

This specification is approved for use by the U. S. Army Armament Research and Development Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers quality assurance provisions and preparation for delivery for Mine, AT, Practice, Heavy, M20.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications and standards. Unless otherwise specified (see 6.2), the following specifications and standards of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-A-48078	-	Ammunition, Standard Quality Assurance Provisions, General Specification For.
MIL-A-63529	-	Activator, Practice: M1, Parts For And Loading, Assembling and Packing.

STANDARDS

MILITARY

MIL-STD-105	-	Sampling Procedures and Tables for Inspection by Attributes.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 1345

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein.

DRAWINGS (See 6.5)

US ARMY ARMAMENT RESEARCH AND DEVELOPMENT COMMAND

7548124	-	Mine, AT, Practice, Heavy: M20, Assembly, Complete.
7548171	-	Box, Packing, Ammunition, For, Mine, AT, Heavy, Practice: M20.
7548279	-	M20 Wrench, Arming Plug Assembly.

(Copies of specifications, standards, handbooks, drawings, and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer.)

2.2 Other publications. The following document(s) form a part of this specification to the extent specified herein. The issues of the documents which are indicated as DoD adopted shall be the issue listed in the current DoDISS and the supplement thereto, if applicable.

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

ASTM E 18	-	Rockwell Hardness and Rockwell Superficial Hardness of Metallic Materials.
ASTM B 117	-	Salt Spray (Fog) Testing.

(Application for copies of ASTM publications should be addressed to the American Society for Testing and Materials, 1916 Race Street, Philadelphia, Pennsylvania 19103.)

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, the text of this specification shall take precedence.

3. REQUIREMENTS

3.1 Materials and parts. Materials and parts shall be in accordance with the applicable drawings, specifications and standards.

3.2 Mine assemblies. The mine assemblies shall comply with all requirements specified on Drawing (Dwg.) 7548124, all associated drawings, and with all requirements specified in applicable specifications and standards.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

3.3 Pull test of slide handle clip. The slide handle clip of the base cover assembly (Dwg. 7548146) shall show no evidence of breakage when subjected to the pull test as specified in 4.5.3.

3.4 Functioning. The mine shall function satisfactorily when tested as specified in 4.5.5. Satisfactory functioning shall be evidenced by functioning of the fuze, activator and firing device and no mine assembly being damaged beyond reuse.

3.5 First article inspection. This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.6 Workmanship.

3.6.1 Welding and brazing. All welds and brazes shall be reasonably smooth and free of craters. They shall exhibit characteristics of good fusion, penetration, and soundness of deposit representative of good welding and brazing practice. The process shall be such as to prevent warpage and distortion. There shall be no crack in or near welded or brazed areas.

3.6.2 Workmanship. All parts and assemblies shall be fabricated and assembled in a thorough, workmanlike manner. They shall be free of burrs, chips, weld spatter, sharp edges, chipped edges, gouges, cracks, surface defects, dirt, grease, rust, corrosion products, and other foreign matter. The cleaning method used shall not be injurious to any part nor shall the parts be contaminated by the cleaning agents. All required markings shall be neat and sharply defined. External threads shall be full, complete and undamaged for their entire length.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection and standard quality assurance provisions. Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.3).

b. Quality conformance inspection (see 4.4).

4.3 First article inspection.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

4.3.1 Submission. The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2. The first article sample shall consist of the following items in sample quantities as indicated below and Table I.

Part Description	Drawings	Quantity
Mine, AT, Practice: M20	7548124	25
Metal Parts Assembly	7548128	10
Base Assembly	7548129	10
Support Assembly	7548130	10
Support	7548131	10
Base	7548133	10
Inner Cup	7548134	10
Activator Bushing	7548135	10
Side Activator Cup	7548136	10
Bottom Activator Cup	7548138	10
Fuse Well Cup	7548139	10
Handle Assembly	7548140	10
Slide Handle Clip	7548141	10
Closing Cap	7548144	10
Retainer Ring	7548145	10
Base Cover Assembly	7548146	10
Base Cover	7548147	10
Belleville Spring Assembly	7548148	10
Metallic Belleville Spring	7548153	10
Pressure Plate Assembly	7548154	10
Bushing Pressure Plate	7548155	10
Pressure Plate Cover	7548156	10
Pressure Plate	7548157	10
Moisture Seal	7548158	10
Arming Plug	7548160	10
Body	7548161	10
Cup	7548162	10
Gasket	7548163	10
Setting Knob	7548164	10
Shutter Bearing Pin	7548165	10
Shutter Guide Pin	7548166	10
Seal	7548167	10
Shutter	7548168	10
Wrench, Arming Plug Assembly	7548279	10
Wrench, Arming	7548280	10
Bail	7548281	10

4.3.2 Inspections to be performed. See MIL-A-48078 and Table I specified herein.

4.3.3 Rejection. See MIL-A-48078.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
	Mine, AT, Practice: M20	1 OF 7	See Below
			NEXT HIGHER ASSEMBLY
			--

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Support Dwg. 7548131 *Examination for Defects	10		3.2	4.4.2.1
	Base Dwg. 7548133 Examination for Defects	10		3.2	4.4.2.2
	Cup, Inner Dwg. 7548134 Examination for Defects	10		3.2	4.4.2.3
	Bushing, Activator Dwg. 7548135 *Examination for Defects	10		3.2	4.4.2.4
	Cup, Activator, Side Dwg. 7548136 *Examination for Defects	10		3.2	4.4.2.5

NOTES:

*Examination for Defects includes all tests specified thereon.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 2 OF 7		DRAWING NUMBER
Cont'd.	Mine, AT, Practice: M20				See Below
					NEXT HIGHER ASSEMBLY
					--
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Cup, Activator, Bottom Dwg. 7548138 *Examination for Defects	10		3.2	4.4.2.6
	Cup, Fuse Well Dwg. 7548139 Examinaton for Defects	10		3.2	4.4.2.7
	Handle Assembly Dwg. 7548140 Examinaton for Defects	10		3.2	4.4.2.8
	Clip, Slide Handle Dwg. 7548141 *Examination for Defects	10		3.2	4.4.2.9
	Cap, Closing Dwg. 7548144 *Examination for Defects	10		3.2	4.4.2.10

NOTES: *Examination for Defects includes all tests specified thereon.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil-- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 3 OF 7		DRAWING NUMBER
Cont'd.	Mine, AT, Practice: M20				See Below
					NEXT HIGHER ASSEMBLY --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Ring, Retainer Dwg. 7548145 Examination for Defects	10		3.2	4.4.2.11
	Base Cover Assembly Dwg. 7548146 *Examination for Defects	10		3.2	4.4.2.12
	Cover, Base Dwg. 7548147 Examination for Defects	10		3.2	4.4.2.13
	Belleville Spring Assembly Dwg. 7548148 *Examination for Defects	10		3.2	4.4.2.14
	Spring, Belleville, Metallic Dwg. 7548153 Examination for Defects	10		3.2	4.4.2.15

NOTES: *Examination for Defects includes all tests specified thereon.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 4 OF 7		DRAWING NUMBER
Cont'd.	Mine, AT, Practice: M20				See Below
					NEXT HIGHER ASSEMBLY
					--
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Pressure Plate Assembly Dwg. 7548154 Examination for Defects	10		3.2	4.4.2.16
	Bushing, Pressure Plate Dwg. 7548155 *Examination for Defects	10		3.2	4.4.2.17
	Cover, Pressure Plate, M20 Dwg. 7548156 Examination for Defects	10		3.2	4.4.2.18
	Plate, Pressure, M20 Dwg. 7548157 Examination for Defects	10		3.2	4.4.2.19
	Seal, Moisture Dwg. 7548158 Examination for Defects	10		3.2	4.4.2.20

NOTES: *Examination for defects includes all tests specified thereon.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection.

CLASSIFICATION OF DEFECTS & TESTS MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 5 OF 7		DRAWING NUMBER
Cont'd.	Mine, AT, Practice: M20				See Below
					NEXT HIGHER ASSEMBLY --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Arming Plug, Mine, AT, Prac., M4, Assy.				
	Dwg. 7548160 Examination for Defects	10		3.2	4.4.2.21
	Body Dwg. 7548161 *Examination for Defects	10		3.2	4.4.2.22
	Cup Dwg. 7548162 *Examination for Defects	10		3.2	4.4.2.23
	Gasket Dwg. 7548163 Examination for Defects	10		3.2	4.4.2.24
	Knob, Setting Dwg. 7548164 *Examination for Defects	10		3.2	4.4.2.25
	Pin, Shutter Bearing Dwg. 7548165 *Examination for Defects	10		3.2	4.4.2.26

NOTES:
*Examination for Defects includes all tests specified thereon.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil - Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection.

CLASSIFICATION OF DEFECTS & TESTS MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 6 OF 7		DRAWING NUMBER
Cont'd.	Mine, AT, Practice: M20				See Below
					NEXT HIGHER ASSEMBLY --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Pin, Shutter Guide Dwg. 7548166 *Examination for Defects	10		3.2	4.4.2.27
	Seal Dwg. 7548167 Examination for Defects	10		3.2	4.4.2.28
	Shutter Dwg. 7548168 *Examination for Defects	10		3.2	4.4.2.29
	Wrench, Arming Plug Assembly Dwg. 7548279 *Examination for Defects	10		3.2	4.4.2.30
	Wrench, Arming Dwg. 7548280 Examination for Defects	10		3.2	4.4.2.31

NOTES:
*Examination for Defects includes all tests specified thereon.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

TABLE I. First article inspection.

CLASSIFICATION OF DEFECTS & TESTS MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 7 OF 7		DRAWING NUMBER
Cont'd.	Mine, AT, Practice: M20				See Below
					NEXT HIGHER ASSEMBLY --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Bail Dwg. 7548281 Examination for Defects	10		3.2	4.4.2.32
	Support Assembly Dwg. 7548130 Examination for Defects	10		3.2	4.4.2.33
	Base Assembly Dwg. 7548129 Examination for Defects	10		3.2	4.4.2.34
	Metal Parts Assembly Dwg. 7548128 Examination for Defects	10		3.2	4.4.2.35
	Mine, AT, Practice, Heavy: M20. Assy. Dwg. 7548124 *Examination for Defects	25		3.2	4.4.2.36

NOTES:
*Examination for Defects includes all tests specified thereon.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil/ - 11. Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, each lot shall contain:

a. Arming plug wrenches of one lot interfix number from one manufacturer. (When applicable)

b. Mine Fuses, M604, of one lot interfix number from one manufacturer.

c. Firing devices, M3, of one lot interfix number from one manufacturer.

d. Activators, M1, of one lot interfix number from one manufacturer. (See 4.4.5)

4.4.2 Examination. See MIL-A-48078.

a. Sampling plans. Unless otherwise specified in the classification of Defects and Tests Tables, sampling plans and procedures for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 7548131
4.4.2.1	Support				NEXT HIGHER ASSEMBLY 7548130
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined.				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Diameter across ends		0.40%	3.2	Gage
Minor					
201	Finish improper		0.65%	3.2	Visual
202	Poor workmanship		1.0%	3.6.2	Visual

NOTES: (a) Three samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If any sample shows evidence of corrosion or salt deposits, the lot shall be rejected.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.2	Base				7548133
					NEXT HIGHER ASSEMBLY
					7548129
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter (12.650)		0.40%(a)	3.2	Gage
102	Diameter across inside wall of recess (8.750)		0.40%(a)	3.2	Gage
103	Depth of top surface of recess (.87)		0.40%(a)	3.2	Gage
104	Total height		0.40%(a)	3.2	Gage
105	Distance between slots in top (5.44)		0.40%(a)	3.2	Gage
106	Inside diameter in top		0.40%(a)	3.2	Gage
107	Base damaged (dented or deformed)		0.40%	3.2	Visual
Minor					
201	Finish improper		0.65%	3.2	Visual
202	Poor workmanship		1.0%	3.6.2	Visual

NOTES: (a) See 4.4.3.1 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 7548134
4.4.2.3	Cup, Inner				NEXT HIGHER ASSEMBLY 7548129
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter at top		0.40%(a)	3.2	Gage
102	Outside diameter at bottom		0.40%(a)	3.2	Gage
103	Height		0.40%(a)	3.2	Gage
104	Thickness through bottom		0.40%(a)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:
(a). See 4.4.3.1 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.4	Bushing, Activator		7548135
			NEXT HIGHER ASSEMBLY 7548129

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Minor diameter of thread		0.40%(b)	3.2	Gage
103	Pitch diameter of thread		0.40%(b)	3.2	Gage
104	Larger outside diameter		0.40%(b)	3.2	Gage
105	Smaller outside diameter		0.40%(b)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

(a). Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If any sample shows evidence of corrosion or salt deposits, the lot shall be rejected.

(b). See 4.4.3.2 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.5	Cup, Activator, Side				7548136
					NEXT HIGHER ASSEMBLY
					7548129
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Inside diameter		0.40%(b)	3.2	Gage
103	Thickness through bottom		0.40%(b)	3.2	Gage
104	Depth from top surface to bottom		0.40%(b)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If any sample shows evidence of corrosion or salt deposits, the lot shall be rejected.

(b) See 4.4.3.1 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

Quality conformance inspection

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.6	Cup, Activator, Bottom				7548138
					NEXT HIGHER ASSEMBLY
					7548146
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Diameter across flange		0.40%(b)	3.2	Gage
103	Inside diameter		0.40%(b)	3.2	Gage
104	Total height		0.40%(b)	3.2	Gage
105	Thickness through flange		0.40%(b)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If any sample shows evidence of corrosion or salt deposits, the lot shall be rejected.
(b) See 4.4.3.1 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.7	Cup, Fuse, Well	1 OF 1	7548139
			NEXT HIGHER ASSEMBLY: 7548129

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter across flange		0.40%(a)	3.2	Gage
102	Inside diameter		0.40%(a)	3.2	Gage
103	Depth to bottom		0.40%(a)	3.2	Gage
104	Thickness through bottom		0.40%(a)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

(a) See 4.4.3.1 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.8	Handle Assembly		7548140
			NEXT HIGHER ASSEMBLY 7548146

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Grip missing		0.40%	3.2	Visual
102	Crimp missing or unsatisfactory		0.40%	3.2	Visual
103	Grip improperly located		0.40%	3.2	Visual
104	Protective finish on handle or grip inadequate or damaged (corrosion or white salts)		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.9	Clip, Slide Handle				7548141
					NEXT HIGHER ASSEMBLY
					7548146
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray	(a)		3.2	4.5.1
102	Length		0.40%(b)	3.2	Gage
103	Width		0.40%(b)	3.2	Gage
104	Inside width		0.40%(b)	3.2	Gage
Minor					
201	Weld projection missing		0.65%	3.2	Visual
202	Poor workmanship		1.0%	3.6.2	Visual
(a)	Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If any sample shows evidence of corrosion or salt deposits, the lot shall be rejected.				
(b)	See 4.4.3.1 for alternate method of sampling.				

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.10	Cap, Closing		7548144
			NEXT HIGHER ASSEMBLY
			7548128

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Outside diameter		0.40%(b)	3.2	Gage
103	Total height		0.40%(b)	3.2	Gage
104	Depth to bottom of dish (.175)		0.40%(b)	3.2	Gage
105	Diameter of flat surface in dish, min (.80)		0.40%(b)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If any sample shows evidence of corrosion or salt deposits, the lot shall be rejected.

(b) See 4.4.3.1 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.11	Ring, Retainer				7548145
					NEXT HIGHER ASSEMBLY
					7548128
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter - 2 places, 180° apart (after corrugating)		0.40%(a)	3.2	Gage
102	Inside diameter - (after corrugating)		0.40%(a)	3.2	Gage
103	Thickness through top		0.40%(a)	3.2	Gage
Minor					
201	Corrugation unsatisfactory		0.65%(a)	3.2	Visual
202	Poor workmanship		1.0%(a)	3.6.2	Visual

NOTES: (a) See 4.4.3.1 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.12	Base Cover Assembly				7548146
					NEXT HIGHER ASSEMBLY
					7548128
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Pull test of slide handle clip	(a)		3.3	4.5.3
102	Distance between side and shipping sleeve		0.40%	3.2	Gage
103	Assembly damaged (dented, deformed, bent or punctured)		0.40%	3.2	Visual
104	Part or subassembly improperly assembled		0.40%	3.2	Visual
105	Part or assembly missing		0.40%	3.2	Visual
106	Braze or weld missing		0.40%	3.2	Visual
107	Braze or weld workmanship unsatisfactory		0.40%	3.6.1	Visual
Minor					
201	Crimp less than 360° or missing		0.65%	3.2	Visual
202	Protective coating inadequate or missing		0.65%	3.2	Visual
203	Paint missing or color incorrect		0.65%	3.2	Visual
204	Poor workmanship		1.0%	3.6.2	Visual

NOTES: (a) Fifty (50) base cover assemblies shall be selected from each lot for this test. If two (2) or more assemblies fail to comply with the specified requirements, the lot shall be rejected.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.13	Cover, Base				7548147
					NEXT HIGHER ASSEMBLY
					--
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Inside diameter across bent rim		0.40%(a)	3.2	Gage
102	Thickness of bent rim, min		0.40%(a)	3.2	Gage
103	Large recess missing (4)		0.40%(a)	3.2	Visual
104	Smallest hole missing (Note 4 on Dwg.)		0.40%(a)	3.2	Visual
105	Hole slot missing (Note 3 on Dwg.)		0.40%(a)	3.2	Visual
Minor					
201	Part damaged (dented or deformed)		0.65%	3.2	Visual
202	Poor workmanship		1.0%	3.6.2	Visual

NOTES: (a) See 4.4.3.1 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 7548148
4.4.2.14	Belleville Spring Assembly				NEXT HIGHER ASSEMBLY 7548128
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Solid height, max.		0.40%	3.2	Gage
102	Free height, min		0.40%	3.2	Gage
103	Loads at three specified heights		0.40%	3.2	Gage
104	Improperly assembly		0.40%	3.2	Visual
105	Part missing (outside, inside, top and end spacers, spring)		0.40%	3.2	Visual
106	Spring cracked		0.40%	3.2	Visual
107	Paint missing		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.15	Spring, Belleville, Metallic		7548153
			NEXT HIGHER ASSEMBLY 7548145

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Embrittlement	(a)		3.2	4.5.4
102	Outside diameter		0.40%(b)	3.2	Gage
103	Inside diameter		0.40%(b)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

(a) Ten (10) springs shall be selected from each heat treat batch for this test. If one or more springs show evidence of embrittlement, the heat treat batch shall be rejected.

(b) See 4.4.3.3 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.16	Pressure Plate Assembly	1 OF 1	7548154
			NEXT HIGHER ASSEMBLY: 7548128

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Plate or cover damaged (dented or punctured)		0.40%	3.2	Visual
102	Part improperly assembled		0.40%	3.2	Visual
103	Part missing		0.40%	3.2	Visual
104	Moisture seal cement inadequate or missing		0.40%	3.2	Visual
105	Brazing or welding workmanship poor		0.40%	3.6.1	Visual
106	Protective coating inadequate or missing		0.40%	3.2	Visual
107	Holes misaligned		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.17	Bushing, Pressure Plate	1 OF 1	7548155
			NEXT HIGHER ASSEMBLY: 7548154

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Minor diameter of thread		0.40%	3.2	Gage
103	Pitch diameter of thread		0.40%	3.2	Gage
104	Total height (less projections)		0.40%	3.2	Gage
105	Diameter across projections, at top, min (when applicable)		0.40%	3.2	Gage
106	Diameter across projections at bottom, min (when applicable)		0.40%	3.2	Gage
107	Outside diameter across top		0.40%	3.2	Gage
108	Diameter of hole in bottom		0.40%	3.2	Gage
109	Flat surface missing in bottom (see Dwg. note)		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If any sample shows evidence of corrosion or salt deposits, the lot shall be rejected.

Source: https://assist.dla.mil - Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.18	Cover, Pressure, Plate		7548156
			NEXT HIGHER ASSEMBLY 7548154

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter		0.40%(a)	3.2	Gage
102	Diameter across start of raised portion (7.56)		0.40%(a)	3.2	Gage
103	Inside diameter at top side (2.70)		0.40%(a)	3.2	Gage
104	Smaller inside diameter at top side (2.58)		0.40%(a)	3.2	Gage
105	Largest inside diameter at bottom side (3.02)		0.40%(a)	3.2	Gage
106	Smaller inside diameter at bottom side (2.368)		0.40%(a)	3.2	Gage
107	Smallest inside diameter at bottom side (1.75)		0.40%(a)	3.2	Gage
108	Thickness at rim		0.40%(a)	3.2	Gage
109	Height near middle (.272)		0.40%(a)	3.2	Gage
110	Hole missing or improperly positioned		0.40%(a)	3.2	Gage
111	Part damaged (dented, deformed)		0.40%(a)	3.2	Visual
Minor					
201	Poor workmanship		1.0%(a)	3.6.2	Visual

NOTES:

(a) See 4.4.3.1 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.19	Plate, Pressure	1 OF 1	7548157
			NEXT HIGHER ASSEMBLY: 7548154

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Outside diameter at top		0.40%(a)	3.2	Gage
102	Outside diameter across rim		0.40%(a)	3.2	Gage
103	Diameter of hole		0.40%(a)	3.2	Gage
104	Height, less rim		0.40%(a)	3.2	Gage
105	Thickness of metal		0.40%(a)	3.2	Gage
106	Hole improperly positioned or missing		0.40%(a)	3.2	Gage
107	Part damaged (dented, deformed)		0.40%(a)	3.2	Visual
Minor					
201	Poor workmanship		1.0%(a)	3.6.2	Visual

NOTES:

(a) See 4.4.3.1 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.20	Seal, Moisture		7548158
			NEXT HIGHER ASSEMBLY 7548154

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Diameter across side		0.65%(a)	3.2	Gage
202	Largest diameter across rim (as indicated)		0.65%(a)	3.2	Gage
203	Diameter across top (as indicated)		0.65%(a)	3.2	Gage
204	Thickness through top		0.65%(a)	3.2	Gage
205	Defects affecting sealing qualities (holes, tears, cracks, etc.)		0.65%(a)	3.2	Visual
206	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

(a) See 4.4.3.4 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.21	Arming Plug, Mine, AT, Practice, M4, Ass'y	1 OF 1	7548160
			NEXT HIGHER ASSEMBLY: 7548128

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Stamping or lettering incorrect or improperly located (Arrowhead not facing "SAFE")		100%	3.2	Gage
102	Width, less body flange, max.		0.40%	3.2	Gage
103	Part improperly assembled		0.40%	3.2	Visual
104	Part missing (shutter pins (2), setting knob, shutter, gasket, cup, seal)		0.40%	3.2	Visual
105	Thread damaged		0.40%	3.2	Visual
106	Protective finish on any part		0.40%	3.2	Visual
107	Missing or damaged (bare spot)		0.40%	3.2	Visual
108	Weld unsatisfactory or missing		0.40%	3.6.1	Visual
109	Shutter pin rivet above flush		0.65%	3.2	Visual
110	Paint color in noted area incorrect or missing		0.65%	3.2	Visual
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.22	Body				7548161
					NEXT HIGHER ASSEMBLY
					7548160
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Diameter across lugs		0.40%(b)	3.2	Gage
103	Diameter of cup hole		0.40%(b)	3.2	Gage
104	Outside diameter under cup (gasket seat)		0.40%(b)	3.2	Gage
105	Major diameter of thread		0.40%(b)	3.2	Gage
106	Pitch diameter of thread		0.40%(b)	3.2	Gage
107	Perpendicularity of gasket seal with thread		0.40%(b)	3.2	Gage
108	Inside diameter (setting knob side)		0.40%(b)	3.2	Gage
109	Length to gasket seal (.605)		0.40%(b)	3.2	Gage
110	Thickness of part around cup hole (.121)		0.40%(b)	3.2	Gage
111	Lettering incorrectly positioned		0.40%(b)	3.2	Gage
112	Thickness of lug, min		0.40%(b)	3.2	Gage
Minor					
201	Part damaged (dented or deformed)		0.65%	3.2	Visual
202	Poor workmanship		1.0%	3.6.2	Visual

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If any sample shows evidence of corrosion or salt deposits, the lot shall be rejected.
(b) See 4.4.3.1 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.23	Cup	1 OF 1	7548162
			NEXT HIGHER ASSEMBLY: 7548160

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Outside diameter across flange		0.40%(b)	3.2	Gage
103	Smaller inside diameter in bottom		0.40%(b)	3.2	Gage
104	Outside diameter under flange		0.40%(b)	3.2	Gage
105	Distance between underside of flange and adjacent shoulder (.286)		0.40%(a)	3.2	Gage
106	Width, less flange (.676)		0.40%(a)	3.2	Gage
107	True position of side under flange		0.40%(a)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If any sample shows evidence of corrosion or salt deposits, the lot shall be rejected.
(b) See 4.4.3.1 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.24	Gasket				7548163
					NEXT HIGHER ASSEMBLY
					7548160
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Inside diamter		0.65%(a)	3.2	Gage
202	Thickness through side		0.65%(a)	3.2	Gage
203	Width of larger outside diameter		0.65%(a)	3.2	Gage
204	Rubber defects affecting service ability (blisters, cuts, pits, voids, porosity)		0.65%(a)	3.2	Visual
205	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

(a) See 4.4.3.4 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.25	Knob, Setting				7548164
					NEXT HIGHER ASSEMBLY 7548160
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Outside diameter across flange		0.40%(b)	3.2	Gage
103	Outside diameter under flange		0.40%(b)	3.2	Gage
104	Distance between flange face and bottom (.357)		0.40%(b)	3.2	Gage
105	Arrowhead paint incorrect color, unsatisfactory or missing		0.40%	3.2	Visual
106	Protective coating on probibited surfaces		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.0%	3.62	Visual

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If one sample shows evidence of corrosion or salt deposits, the lot shall be rejected.
(b) See 4.4.3.1 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.26	Pin, Shutter bearing				7548165
					NEXT HIGHER ASSEMBLY 7548160
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Diameter of flange		0.40%(b)	3.2	Gage
103	Diameter under flange		0.40%(b)	3.2	Gage
104	Smallest diameter		0.40%(b)	3.2	Gage
105	Length of shank under flange		0.40%(b)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If one sample shows evidence of corrosion or salt deposits, the lot shall be rejected.
(b) See 4.4.3.2 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.27	Pin, Shutter Guide		7548166
			NEXT HIGHER ASSEMBLY 7548160

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Diameter of flange		0.40%(b)	3.2	Gage
103	Diameter under flange		0.40%(b)	3.2	Gage
104	Smallest diameter		0.40%(b)	3.2	Gage
105	Length of shank under flange		0.40%(b)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If one sample shows evidence of corrosion or salt deposits, the lot shall be rejected.
(b) See 4.4.3.2 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.28	Seal		7548167
			NEXT HIGHER ASSEMBLY 7548160

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Outside diameter		0.65%(a)	3.2	Gage
202	Inside diameter		0.65%(a)	3.2	Gage
203	Thickness at edge		0.65%(a)	3.2	Gage
204	Thickness through raised portion		0.65%(a)	3.2	Gage
205	Rubber defects affecting serviceability (blisters, cuts, pits, voids, porosity)		0.65%	3.2	Visual
206	Poor workmanship		1.0%	3.6.2	Visual

NOTES:
(a) See 4.4.3.4 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.29	Shutter				7548168
					NEXT HIGHER ASSEMBLY 7548160
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray	(a)		3.2	4.5.1
102	Hardness	(b)		3.2	4.5.2
103	Profile		0.40%(c)	3.2	Gage
104	Thickness of part (smaller hole ends)		0.40%(c)	3.2	Gage
105	Total thickness		0.40%(c)	3.2	Gage
106	Diameter of smaller hole		0.40%(c)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

(a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If one sample shows evidence of corrosion or salt deposits, the lot shall be rejected.

(b) Five (5) samples shall be selected from each heat treat batch and subjected to the hardness test. If any sample fails to comply with the hardness requirement specified, the heat treat batch shall be rejected.

(c) See 4.4.3.1 for alternate method of sampling.

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.30	Wrench, Arming Plug Assembly				7548279
					NEXT HIGHER ASSEMBLY --
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Salt spray test	(a)		3.2	4.5.1
102	Total length, max		0.40%	3.2	Gage
103	Bail or wrench damaged (cracked, beat or deformed)		0.40%	3.2	Visual
104	Bail missing		0.40%	3.2	Visual
Minor					
201	Protective coating on bail inadequate, damaged or missing (bare spot)		0.65%	3.2	Visual
202	Poor workmanship		1.0%	3.6.2	Visual

NOTES: (a) Three (3) samples shall be selected from each lot for this test. Lot formation provisions shall be as specified in the applicable finish specification. If one sample shows evidence of corrosion or salt deposits, the lot shall be rejected.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.31	Wrench, Arming	1 OF 2	7548280
			NEXT HIGHER ASSEMBLY: 7548279

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Total length		0.40%(a)	3.2	Gage
102	Width (bail end)		0.40%(a)	3.2	Gage
103	Width (hook end)		0.40%(a)	3.2	Gage
104	Length of arming knob setting tabs (4) (.83)		0.40%(a)	3.2	Gage
105	Distance between arming knob setting tabs at ends (2) (.58)		0.40%(a)	3.2	Gage
106	Distance between arming knob setting tabs cutout and hook end (2.500)		0.40%(a)	3.2	Gage
107	Height of arming knob setting tabs (.30)		0.40%(a)	3.2	Gage
108	Width of side tab (.75)		0.40%(a)	3.2	Gage
109	Distance between side and end of side tab (.740)		0.40%(a)	3.2	Gage
110	Distance between bent tabs in sidewall above crown-shaped cutout (.59)		0.40%(a)	3.2	Gage
111	Thickness of each sidewall (both ends) (.0508)		0.40%(a)	3.2	Gage
112	Crown-shaped cutout (hookend) missing		0.40%(a)	3.2	Visual
113	Saml1 cutouts (.25) missing (both ends)		0.40%(a)	3.2	Visual

NOTES:

(a) See 4.4.3.1 for alternate method of sampling.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER 7548280
4.4.2.31 Cont'd.	Wrench, Arming				NEXT HIGHER ASSEMBLY 7548279
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Minor					
201	Stamping incorrect, unidentifiable or missing		0.65%	3.2	Visual
202	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.32	Bail				7548281
					NEXT HIGHER ASSEMBLY 7548279
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Inside width		0.40%(a)	3.2	Gage
102	Outside width		0.40%(a)	3.2	Gage
103	Distance between side and ends		0.40%(a)	3.2	Gae
104	Diameter of wire		0.40%(a)	3.2	Gage
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

(a) See 4.4.3.1 for alternate method of sampling.

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.33	Support Assembly		7548130
			NEXT HIGHER ASSEMBLY 7548129

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Distance between end and nearer support ring		0.40%	3.2	Gage
102	Distance between open end and farther support ring		0.40%	3.2	Gage
103	Ring improperly positioned		0.40%	3.2	Visual
104	Assembly damaged (dented, deformed)		0.40%	3.2	Visual
105	Ring missing		0.40%	3.2	Visual
106	Weld workmanship unsatisfactory		0.40%	3.6.1	Visual
107	Protective coating or painting unsatisfactory or missing		0.40%	3.2	Visual
Minor					
201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.34	Base Assembly				7548129
					NEXT HIGHER ASSEMBLY 7548130
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Depth from top surface to bottom of fuze well cup		0.40%	3.2	Gage
102	Weld or braze missing or workmanship poor		0.40%	3.6.1	Visual
103	Part improperly assembled (innder cup, support assembly, fuze well cup)		0.40%	3.2	Visual
104	Part damaged (punctured, dented, deformed)		0.40%	3.2	Visual
105	Part missing (activator cup, inner cup, support assembly, fuze well cup)		0.40%	3.2	Visual
106	Protective coating or paint missing, damaged or inadequate (bare spots exposing base metal)		0.40%	3.2	Visual
107	Welds improperly positioned (see Dwg. (note) (inner cup dud bare)		0.40%	3.2	Visual
108	Welds uniting base and fuze well cup improperly positioned (See Dwg. note)		0.40%	3.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.34 Cont'd.	Base Assembly				7548129
					NEXT HIGHER ASSEMBLY
					7548130
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Major 109	Incomplete contact between support assembly, inner cup and fuze well cup		0.40%	3.2	Visual
Minor 201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.35	Metal Parts Assembly	1 OF 2	7548128
			NEXT HIGHER ASSEMBLY: 7548124

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Arming plug improperly positioned or incorrectly marked (Arrowhead not pointing toward "SAFE")		100%	3.2	Visual
102	Location of activator well in base cover assembly (see Dwg. note)		0.40%	3.2	Gage
103	Distance between bottom of fuze well cup and underside of arming plug		0.40%	3.2	Gage
104	Well or braze missing or workmanship poor		0.40%	3.2	Visual
105	Protective coating or paint missing, damaged, or inadequate (bare spots exposing base metal)		0.40%	3.2	Visual
106	Part or assembly improperly assembled		0.40%	3.2	Visual
107	Part or assembly damaged (bent, dented, deformed)		0.40%	3.2	Visual
108	Part or assembly missing (closing cap (3) activator bushing, base cover assembly, retainer ring, holding tape)		0.40%	3.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.35 Cont'd.	Metal Parts Assembly				7548128
					NEXT HIGHER ASSEMBLY
					7548124
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
109	Crimp around base cover assembly unsatisfactory (less than 360°)		0.40%	3.2	Visual
110	Weld residue protruding above surface of pressure plate under arming plug (See Dwg. note)		0.40%	3.2	Visual
111	Holes in pressure plate assembly and base assembly not aligned (See Dwg. note)		0.40%	3.2	Visual
Minor 201	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.36	Mine, AT, Practice, Heavy: M20, Assembly	1 OF 2	7548124
			NEXT HIGHER ASSEMBLY: --

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Arming plug improperly positioned or incorrectly marked (Arrowhead not pointing toward "SAFE")		100%	3.2	Visual
102	Functioning test	4.5.5	-	3.4	4.5.5
103	Total height, max		0.40%	3.2	Gage
104	Diameter across base cover, max		0.40%	3.2	Gage
105	Paint color incorrect		0.40%	3.2	Visual
106	Protective coating or paint missing, damaged or inadequate (bare spots exposing base metal)		0.40%	3.2	Visual
107	Part missing (tapes, closing caps, shipping sleeve, handle assembly		0.40%	3.2	Visual
108	Part or assembly damaged (bent, dented, deformed, punctured)		0.40%	3.2	Visual
109	Cementing of moisture seal to base unsatisfactory or missing (seal peeling or separating from base)		0.40%	3.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-M-63984(AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.36 Cont'd.	Mine, AT, Practice, Heavy: M20 Assembly				7548124
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
110	Paint or foreign matter in any cup or cavity		0.40%	3.2	Visual
111	Crimp at bushing activator missing or unsatisfactory (less than 360°)		0.40%	3.2	Visual
112	Marking or stamping improperly located		0.40%	3.2	Visual
Minor					
201	Marking or stamping misleading, unidentifiable or missing		0.65%	3.2	Visual
202	Poor workmanship		1.0%	3.6.2	Visual

NOTES:

DRDAR-QA Form 160 Jul 77

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

4.4.3 Testing. Testing is described in the First article and Quality conformance inspection tables.

4.4.3.1 Dimensional control of stamped parts. In place of the normal sampling associated with the Classification of Defects, and with the approval of the Contracting Officer, a sample of at least ten (10) parts may be dimensionally inspected to qualify the tool used in the stamping process for use in production. In addition, a random sample of five (5) parts shall be selected from the last portion of each hour's production for dimensional inspection as a control of the tool during production.

If any defective parts are found during qualification of the tool, the tool producing the defective part shall not be used in production.

If any defective parts are found when inspection is performed for control of the tool, the tool producing the defective part shall be removed from production. Further, that portion of production since the last tool control check shall be returned to the contractor for corrective action.

All tools removed from production because of some fault, may, after reworking, be returned to production providing they pass the qualification test above. The contractor may request a change of inspection frequency providing he presents objective evidence to the Contracting Officer to substantiate the request.

4.4.3.2 Alternate method of inspection of dimensional characteristics of activator bushing. In place of the normal sampling associated with the Classification of Defects, and with the approval of the Contracting Officer, a sample of at least ten (10) parts shall be dimensionally inspected to qualify the machine used in the fabricating of the part for use in production. In addition, a random sample of five (5) parts shall be selected from the last portion of each hour's production for dimensional inspection as a control of the machine during production.

If any defective parts are found during qualification of the machine, the machine producing the defective part shall not be used in production until adjustments or rework of the machine are made to produce acceptable parts.

If any defective parts are found when inspection is performed for control of the machine, the machine producing the defective part shall be removed from production. Further, that portion of production since the last machine control check shall be returned to the contractor for corrective action.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

All machines removed from production because of some fault, may, after reworking, or readjustment, be returned to production providing they pass the qualification test above. The contractor may request a change of inspection frequency providing he presents objective evidence to the Contracting Officer to substantiate the request.

4.4.3.3 Alternate method of inspection of dimensional characteristics of Belleville Spring. In place of the normal sampling associated with the Classification of Defects, and with the approval of the Contracting Officer, a sample of at least ten (10) springs shall be dimensionally inspected to qualify the tool used in the stamping process for use in production. If addition, a random sample of five (5) springs shall be selected from the last portion of each hour's production for dimensional inspection as a control of the tool during production.

If any defective springs are found during qualification of the tool, the tool producing the defective spring shall not be used in production.

If any defective springs are found when inspection is performed for control of the tool, the tool producing the defective spring shall be removed from production. Further, that portion of production since the last tool control check shall be returned to the contractor for corrective action.

All tools removed from production because of some fault, may, after reworking, be returned to production providing they pass the qualification test above. The contractor may request a change of inspection frequency providing he presents objective evidence to the Contracting Officer to substantiate the request.

4.4.3.4 Dimensional control of molded parts. In place of the normal sampling associated with the Classification of Defects, and with the approval of the Contracting Officer, and after a curing time for the parts has been approved (See Note), a sample of three (3) parts (as molded) from each cavity may be dimensionally inspected to qualify a new or reworked cavity for use in production or as a control of each cavity during production.

The inspection of the parts shall be performed only when the curing time for the parts has been reached. The inspection for control of each cavity during production shall be performed on the above quantities from each cavity after production of each 5000 parts or at the end of each shift, providing the number of parts produced during that shift is less that 5000 parts. Of the three (3) samples, one (1) sample shall be the last part produced. Parts that fail to comply with dimensional requirements after dimensional stability has been attained shall be classed defective.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

If any defective parts are found during qualification of the cavity the cavity producing the defective part will not be used in production. If any defective parts are found when inspection is performed for control of the cavity, the cavity producing the defective part shall be removed from production. Further, that portion of production since the last control check shall be returned to the contractor for corrective action.

All cavities formerly removed from production because of some fault may, after reworking, be returned to production providing they pass the qualification test as above. The contractor may request a change of inspection frequency providing he presents objective evidence to substantiate the request to the Contracting Officer.

NOTE: In establishing a curing time dimensionally check ten (10) parts from each cavity at periodic intervals (e.g., every 30 min, 60 min, etc.), until dimensional stability is attained. The curing time will be from the time the part comes out of the mold until dimensional stability is attained. The inspection data used in determining the curing time shall be sent to U.S. Army Armament Research and Development Command (ARRADCOM), Dover, NJ 07801, ATTN: DRDAR-QAT-M. If there is a change in material, cycle time, or if a cavity is reworked, or a new cavity is used, a new curing time shall be established and approved.

4.4.4 Insection equipment. The inspection equipment required to perform the inspections and tests prescribed in this specification is identified in the "Paragraph Reference/Inspection Method" column in the tables starting with paragraph 4.4.2.1, and the test method paragraph (See 4.5). The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and 6.3 herein.

4.4.5 Check test for deterioration of activators (See MIL-A-63529. If the total time between original acceptance of any lot and the assembly of that lot into the mines exceeds two years, or if the activators have been subjected to adverse conditions, however brief, at any time since previous tests, the activator lot shall be subjected to and must satisfactorily pass, the check test for deterioration specified in MIL-A-63529 immediately before the activator lot is assembled into the mines. This test shall be performed by the contractor on activators selected by the Government Inspector at the facility assembling the activators into the mines, (See 6.3).

4.5 Methods of inspection.

4.5.1 Salt spray test. The salt spray test shall be performed utilizing the equipment, methods and procedures specified in ASTM B-117 and in accordance with the applicable detailed specification for the protective finish. Exposure time shall be not less than one and one-half (1 1/2) hours using an atomized sodium chloride solution of five percent (5%).

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

4.5.2 Hardness. This test shall be performed as specified in ASTM E 18. Each heat treat batch shall remain segregated until completion of all required tests.

4.5.3 Pull test of slide handle clip. The slide handle clip of the base cover assembly shall be subjected to a tensile load of not less than seventy-five (75) pounds in a direction perpendicular to the surface of the base. The load shall be distributed approximately equal over the four spot welds which hold the handle clip to the base cover. Observation shall be made to determine compliance with 3.3.

4.5.4 Embrittlement of Belleville spring. The Belleville springs shall be tested for embrittlement by compressing the springs until the minimum point of permanent distortion is reached. If any spring breaks when compressed to this point of distortion, it shall be classed defective.

4.5.5 Function test. Ten (10) mines shall be selected from each lot and tested as follows.

4.5.5.1 Fuze functioning. Fuzes (Practice: M604) shall be assembled to each of the ten (10) mines and functioned by applying a load of four hundred fifty plus or minus five (450 ± 5.0) pounds to the top of the pressure plate. Test functioning shall be in the manner prescribed in Figure 1. The test shall be performed three (3) times on each of the ten (10) mines thus utilizing thirty (30) fuzes.

4.5.5.2 Side cup well functioning. The ten (10) mines, tested as specified in 4.5.5.1, shall have the side cup well tested by assembling the Practice Activator, M1, and the Firing Device, M3, into the side cup well of each mine. This test shall be performed three (3) times on each of the ten (10) mines. Any mine which has been damaged beyond reuse when tested as specified in 4.5.5.1 shall not be used in this test. A replacement mine shall be used. Failure of the M1 activator or the M3 firing device to function shall not be considered a defect and the mine may be discarded. A replacement mine shall be used and this test performed three (3) times. The firing device shall be initiated by any suitable means.

4.5.5.3 Bottom cup well functioning. The ten (10) mines, tested as specified in 4.5.5.1 and 4.5.5.2, shall be tested as specified in 4.5.5.2 except that the bottom cup well shall be used to assemble the activators and firing devices. The use of replacement mines and failure of activators and firing devices shall be governed by the applicable provisions of 4.5.5.2.

4.5.5.4 Retest. A retest using an equal number of samples may be conducted for any or all of the tests of 4.5.5.1, 4.5.5.2, or 4.5.5.3 provided that, in the original test:

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

a. Not more than two fuzes fail to function or not more than three mines are damaged beyond reuse in the test described in 4.5.5.1.

b. Not more than two mines are damaged beyond reuse in the test described in 4.5.5.2.

c. Not more than two mines are damaged beyond reuse in the test described in 4.5.5.3.

The lot shall be rejected if, in the aggregate of test and retest:

a. Four (4) or more mines were damaged beyond reuse as tested in 4.5.5.1 and more than two fuzes fail to function.

b. Four (4) or more mines were damaged byond reuse as tested in 4.5.5.2.

c. Four (4) or more mines were damaged beyond reuse as tested in 4.5.5.3.

5. PACKAGING.

5.1 Packing.

5.1.1 Level A. The mines, with Arming plug wrench, M20, shall be packed in accordance with Dwg. 7548171.

5.2 Marking. Marking of the boxes shall be in accordance with Dwg. 7548171.

5.3 Shipping. when mines from more than one lot are shipped at one time, each lot shall be kept separate, and the division between lots clearly indicated to prevent mixing of the lots in transit.

6. NOTES

6.1 Ordering data. See MIL-A-48078.

6.2 Submission of inspection equipment designs for approval. (See MIL-A-48078). Equipment designs shall be submitted as required to: Commander, U.S. Army Armament Research and Development Command, ATTN: DRDAR-QAT-I, Dover, New Jersey 07801. Request letter of submittal should state contractor, contract number, specification number, item nomenclature, and classification of defects and test paragraph number.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

6.3 Cost of check test. The contracting officer will arrange for the contractor to be reimbursed for the expense incurred in the performance of the check test for deterioration of the activators. The tests shall be conducted at Goverment expense without cost to the contractor who loaded the activators or to the contractor assembling the activators into the mines; and shall not constitute a basis for rejection against either contractor except where deterioration has occured as a direct result of carelessness in handling, storage, etc., permitted while the activator lot was under the jurisdication of either contractor.

6.4 Data cards. (See MIL-A-48078). Distribution of data cards shall include the following: Commander, U.S. Army Armament Research and Development Command, ATTN: DRDAR-QAT-M, Dover, New Jersey 07801.

6.5 Drawings. Drawings listed in Section 2 of this specification under the heading US Army Armament Research and Development Command (ARRADCOM) may also include drawings prepared by, and identified as, Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal or Picatinny Arsenal drawings. Technical data originally prepared by these activities are now under the cognizance of ARRADCOM.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

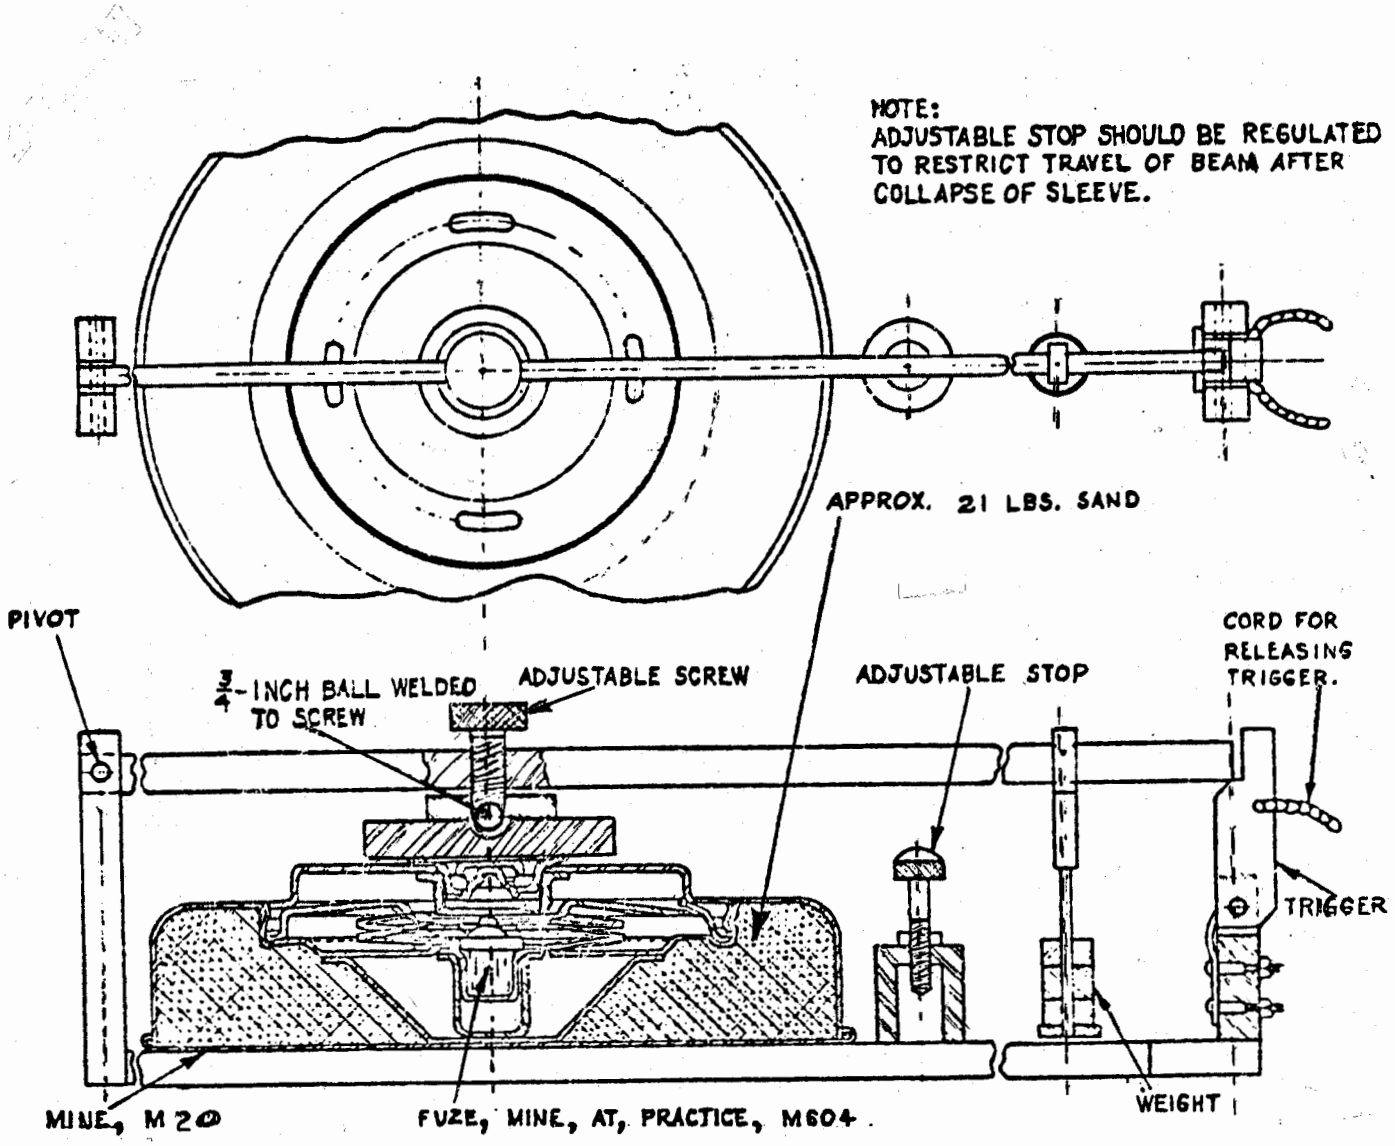


FIGURE I. Set-up for fuze functioning test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1345-A197)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T03:07Z
Check the source to verify that this is the current version before use.