MIL-R-22618(WEP)
AMENDMENT-1
15 AUGUST 1963

MILITARY SPECIFICATION

Release, Bomb Shackle, Aero 7A Series
and
Release, Bomb Rack Aero 7B Series

This amendment forms a part of Military Specification MIL-R-22618(WEP) dated 15 September 1960 and has been approved by the Bureau of Naval Weapons, Department of the Navy.

Page 3: Add

"3.2.7 Leakage - Each release shall be capable of withstanding, without evidence of leakage, other than the amount permitted, the leakage test specified herein."

Page 5, paragraph 4.2.1: Add

"(12) Leakage Test (4.4.19)"

Page 9: Add

"4.4.19 Leakage Test - Each release unit shall be leak tested at 5 PSIG internal air pressure using clean, dry, oil free air. The maximum allowable leakage rate shall not exceed 0.7 standard Liters per minute (SLPM) measured after 30 seconds of pressurization. A cap 60A121A3 shall be suitably drilled and tapped for a pressure fitting to permit pressurizing the release unit to 5 PSIG. This test shall be conducted with the release unit in a cocked position. Units which leak in excess of 0.7 SLPM may be immersed in water, while pressurized, to aid in locating the source of leakage. This test shall be performed prior to final assembly of the cap 60A121A3 with "LOCKTITE". A suitable air flow indicating flowmeter (Fisher Porter Manostat Model FM 1044B or equal) shall be used in the air supply line to measure the leakage (Fig. 3).

NOTE: Indicated flows shall be corrected to standard flows with proper consideration given to local barometric pressures, ambient temperature and the test pressure of 5 PSI gage.

$$Vstd. = Vind. \sqrt{\frac{P}{14.7} \times \frac{530}{T}}$$

Where: Vstd = Standard Liters per minute
Vind = Indicated flow
P = Pressure in test unit (gage pressure)
T = °R = °F+460"

Source: https://assist.dla.mil - Downloaded: 2026-10-19T13:06Z
Check the source to verify that this is the current version before use.

Page 9, paragraph 5.1: Add

"For level A packaging, Method 1C-1 of Specification MIL-R-116 shall be utilized."

Page 10: Add


"6.6 Leakage Test Rejects - Units rejected because of excessive leakage may be disassembled and resealed utilizing any one or all of the following methods:

(a) Apply more "LOCKTITE" on the body plug threads.
(b) Apply "Permatex" non hardening automotive gasket compound on the switch cover screws, gasket and cable grommet.
(c) Replace "O" ring and Kapseal assemblies.
(d) Replace porous body castings. After accomplishing the above the unit(s) shall be retested as per paragraph 4.4.19."

Page 12: Add

"Figure 3."

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:06Z
Check the source to verify that this is the current version before use.

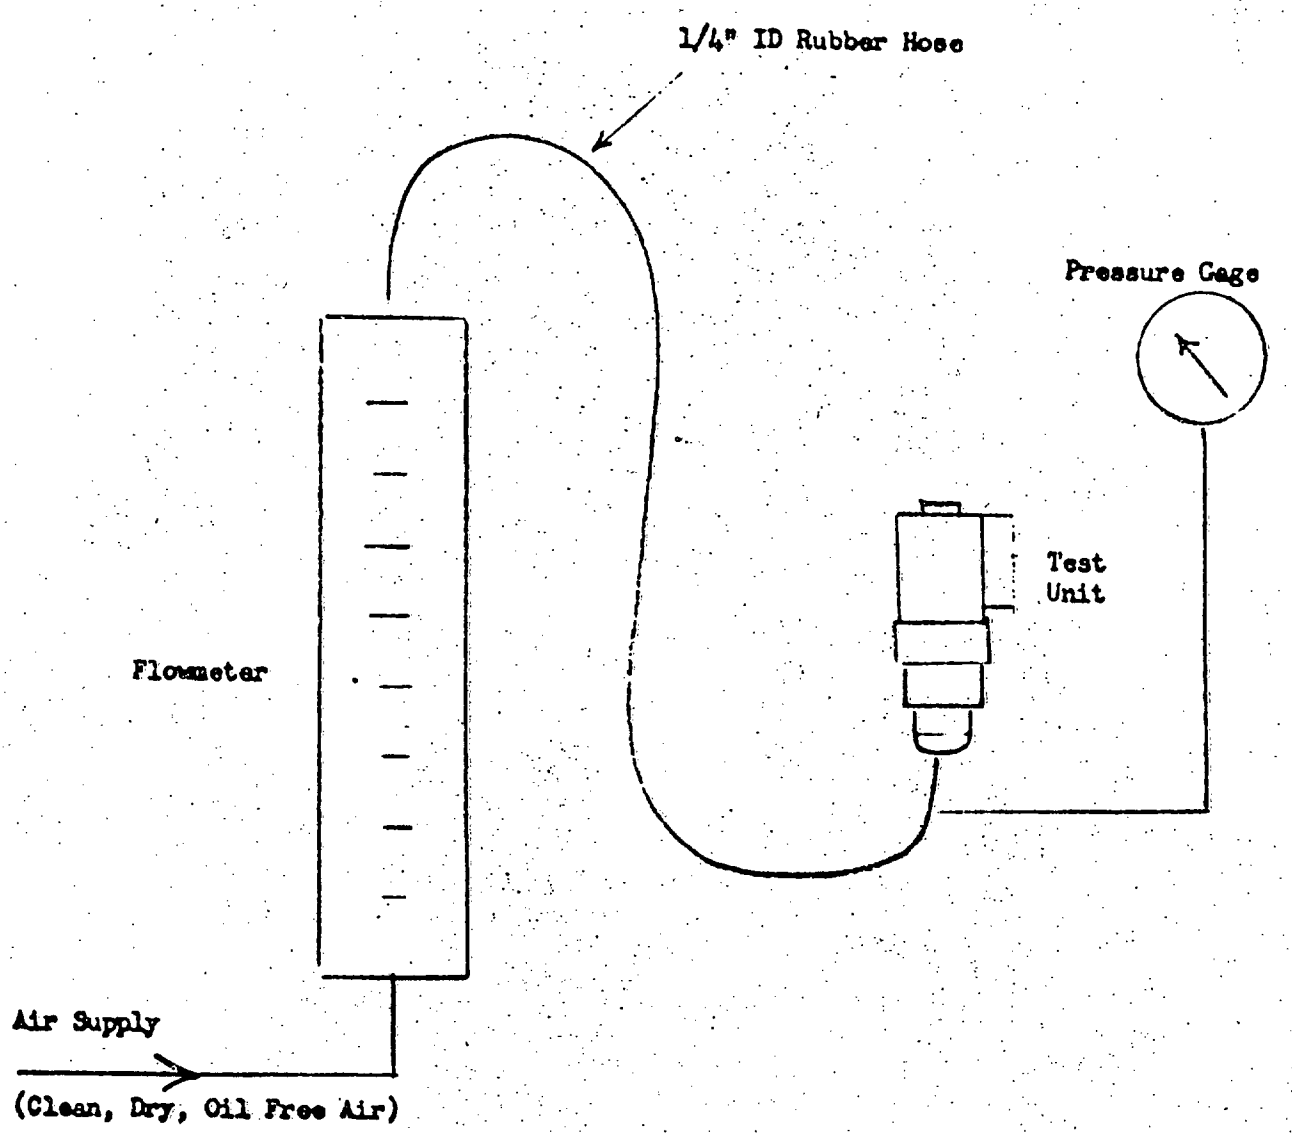

LEAKAGE TEST

Figure 3

Source: https://assist.dla.mil -- Downloaded: 2026-10-19T13:06Z
Check the source to verify that this is the current version before use.