INCH POUND

MIL-C-29427A(MC)
9 OCTOBER 1990
SUPERSEDING
MIL-C-29427(MC)
10 February 1987

MILITARY SPECIFICATION

COATS, WOMEN'S

This specification is approved for use by U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for women's coats.

1.2 Classification. The coats shall be of one type in the following classes and sizes as specified (see 6.2):

Class 1 - Polyester/Wool Gabardine, Green 2212
Class 2 - Wool, Gabardine, Green 2210
Class 3 - Wool, Elastique; Dark Blue 2310

Schedule of sizes

Short	Regular	Long
4	4	
6	6	6
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18
20	20	20
	22	22

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commanding General (PSE-C), Marine Corps Research, Development and Acquisition Command, Washington, D.C. 20380-0001, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release, distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

A-A-203 - Paper, Kraft, Untreated
A-A-50198 - Thread, Gimp, Cotton, Buttonhole
A-A-50199 - Thread, Polyester Core, Cotton - or Polyester - Covered
V-T-276 - Thread, Cotton
V-T-295 - Thread, Nylon
V-T-301 - Thread, Silk
NN-P-71 - Pallet, Material Handling, Wood, Stringer Construction, 2 Way and 4 Way (Partial)
CCC-C-438 - Cloth, Buckram, Woven and Nonwoven
DDD-L-20 - Label; For Clothing, Equipage, and Tentage (General Use)
DDD-T-86 - Tape, Textile, Cotton, General Purpose (Unbleached, Bleached or Dyed)

MILITARY

MIL-C-297 - Cloth, Interlining, Cotton Warp, and Spun Hair-Wool Filling
MIL-C-368 - Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-371 - Braid, Textile, Tubular
MIL-B-3461 - Button, Insignia, Metal, Uniform and Cap
MIL-C-3738 - Cloth, Elastique, Wool
MIL-C-10176 - Cloth, Gabardine: Wool, Polyester/Wool
MIL-P-15011 - Pallet, Material Handling, Wood, Post Construction, 4 Way Entry
MIL-C-15062 - Cloth, Flannel, Wool, Undercollar Cloth
MIL-P-15064 - Pad, Shoulder and Sleeve-head
MIL-C-15065 - Coat, Fronts
MIL-B-17757 - Box, Shipping, Fiberboard (Modular Sizes)
MIL-B-20289 - Button, Insignia, Plastic
MIL-C-29137 - Cloth, Felt Fabric, Composite Undercollar
MIL-C-43718 - Cloth, Twill, Polyester and Cotton, Polyester and Rayon, for Pockets
MIL-C-44192 - Container, Shipping and Storage, Coat (Hanger Pack)

STANDARDS

FEDERAL

FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitches, Seams, and Stitchings

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-147 - Palletized, Unit Load
MIL-STD-1608- Provisions for Evaluating Quality of Coats, Women's, Dress
MIL-STD-731 - Quality of Wood Members for Containers and Pallets

(Unless otherwise indicated, copies of federal and military specifications, standards and handbooks are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094).

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

LAWS AND REGULATIONS

U. S. Postal Service Manual

(Applications for copies of the manual should be addressed to the Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402.)

Department of Defense (DOD) Standard Color Card
for Sewing Threads

(Application for copies should be addressed to the Color Association of the United States Inc., 343 Lexington Avenue, New York, New York 10016.)

2.2 Non-Government publications. The following document(s) form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of the documents which are DOD adopted shall be those listed in the issue of the DODISS specified in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS shall be the issue of the nongovernment documents which is current on the date of the solicitation.

UNIFORM CLASSIFICATION COMMITTEE

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association Inc., Tariff Order Section, 1616 P. Street, N.W., Washington, D.C. 20202.)

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein. The text of this specification

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Standard samples. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.4 and 6.4).

3.3 Materials.

3.3.1 Basic material. The basic material for each class coat shall be as follows:

(a) Class 1. Cloth, polyester/wool gabardine 10.6 ounce green shade 2212 conforming to type II, class 12 of MIL-C-10176 (see 6.3).

(b) Class 2. Cloth, wool gabardine , 14.5 ounce, green shade 2210 conforming to type I, class 5, of MIL-C-10176 (see 6.3).

(c) Class 3. Cloth, wool, elastique, dark blue shade 2310, 18 ounce, conforming to type I, class 1 of MIL-C-3738 (see 6.3).

3.3.2 Lining. The material for lining the coats shall be cloth, rayon, twill, 3.7 ounce, conforming to class 1 of MIL-C-368 in shades as follows:

(a) Classes 1 and 2. Green Shade 2209

(b) Class 3. Black shade 2604

3.3.3 Bias binding. The binding for the underarm shield shall be bias cut from the lining material specified in 3.3.2. The binding shall be cut 5/8 to 7/8 inch wide and shall have sized edges.

3.3.4 Undercollar material. The undercollar material shall be cloth, wool flannel conforming to MIL-C-15062. The material shall be dyed a shade approximating the shade of the basic materials specified in 3.3.1, and shall show good colorfastness to wet (dry) cleaning. The acidity (pH) requirement and colorfastness to perspiration and crocking requirements shall not apply. As an alternate, a composite undercollar fabric conforming to MIL-C-29137 may be used in a shade approximating the shade of the basic material specified in 3.3.1.

3.3.5 Collar interlining material. The collar interlining material for all classes shall be cloth, cotton buckram, natural or dyed black shade 341 conforming to type I, class 2 of CCC-C-438, except that the test for shrinkage shall be in accordance with Method 5580 of FED-STD-191.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

3.3.6 Polyester and cotton. The material for the stays for the simulated breast pocket, armhole seam and shoulder seam shall be cloth polyester and cotton twill, shade black, conforming to class 2 of MIL-C-43718, except the seam efficiency and colorfastness requirements for perspiration and crocking shall not apply. Cloth shall be bias cut for shoulder and armhole stays.

3.3.7 Tape. The cotton tape shall conform to type III, class 1 of DDD-T-86, 1/4 inch wide for reinforcing the folded edge of the simulated pocket welt and armholes for all classes of coats, 3/8 inch wide for the front edges of all classes of coats. The bridle tape for the breakline shall be 3/8 inch wide for all classes of coats.

3.3.8 Coat fronts. The coat fronts for each class coat shall be as follows:

(a) Class 1. Type XV of MIL-C-15065, except that the cotton and polyester stays shall be dyed black.

(b) Classes 2 and 3. Type XIII of MIL-C-15065

3.3.9 Shoulder pads. The shoulder pads shall conform to type III, class 1 of MIL-P-15064.

3.3.10 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.11 Fusible interlinings

3.3.11.1 Fusible interlining for small parts. The fusible interlining for the collar and full front facing, shoulder straps and top welt shall be a nonwoven cloth, 20 percent nylon and 80 percent polyester, polyamide dot, 1.25 to 1.75 ounces per square yard. The color shall be black or charcoal. The fusible shall be Pellon Style 8313, Handler 7208 or equal. The fusing conditions shall be as directed by the supplier or temperature 280°-290°F, 140°-145°CE, time 12-15 seconds, pressure 4-6 PSI.

3.3.11.2 Fusible coat fronts. The coat front may be fused using a twill weave woven fusible conforming to 100 percent cotton warp, 75-90 percent rayon, 10-25 percent wool, weight minimum 3.5 to 4.0 ounces maximum, polyamide dot color black or charcoal. The fusible shall be Kufner Style G35, National Style 200FL, Crown Style 241 or equal. The fusing conditions shall be as directed by the supplier or 300°-310°F, 150°-155°CE temperature; 12-15 seconds time; 4-5 PSI pressure.

3.3.12 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid, 1/8 to 3/16 inch wide, having a breaking strength of not less than 50 pounds in the warp direction and shall conform to type IX, class 1 of MIL-B-371. The color for classes 1 and 2 shall closely match shade T-1, Cable No. 66023 and the color for class 3 coats shall be black.

3.3.13 Thread.

3.3.13.1 Silk thread. The silk thread shall conform to V-T-301. The thread for machine sewing shall conform to type I, size A for all outside seaming and stitching; size B and size F for buttonhole, needle and looper threads, respectively;

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

and size 0 for machine felling. The thread for hand sewing shall be type III, class 3, size C, 2-ply of V-T-301.

3.3.13.2 Cotton thread. The cotton thread shall conform to V-T-276; type IC2, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching, over-edge stitching, and for belt and belt fastener buttonholes; type IB3, glazed finish, ticket No. 24, 4-ply for sewing on buttons and machine tacking armholes. The thread for basting shall be a good commercial grade. As an alternate for cotton thread, a polyester cotton covered thread conforming to A-A-50199, ticket No. 50, 2 or 3 ply may be used. The thread for basting shall be good commercial grade cotton.

3.3.12.3 Nylon thread. The nylon thread for padding lapels of coats shall conform to type III, size 00 of V-T-295.

3.3.13.4 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.3.13.5 Color and colorfastness. The thread for class 1 and 2 coats shall be dyed shade T-1, Cable No. 66023 and the thread for class 3 coats shall be black AA, Cable No. 66043 (see DOD Standard Color Card of Official Standardized Shades for Sewing Threads 1968). The cotton thread for basting and for machine tacking armholes may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning and, in addition, the silk thread shall show good fastness to light.

3.3.14 Gimp. The buttonhole gimp shall be cotton, No. 8 soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be shade T-1, cable No. 66023 for classes 1 and 2 and black AA Cable No. 66043 for class 3 coats. The gimp shall show good fastness to wet (dry) cleaning.

3.3.15 Buttons

3.3.15.1 Classes 1 and 2. The insignia buttons shall be plastic, black color, conforming to MIL-B-20289, type I, 40 line and type II, 27 line, or as an alternate, metal insignia buttons conforming to MIL-B-3461, type II, style 3, class B, subclass 2 may be used. A dull black epoxy finish in lieu of dull black enamel finish is acceptable with prior approval.

3.3.15.2 Class 3. The insignia buttons shall be metal, gold plated, 27-line and 40-line, regular shank conforming to type I, style 3, class A, subclass 1 of MIL-B-3461.

3.3.16 Labels. Each coat shall have an identification label and a size label as follows. The coats are intended to be dry cleaned and the labels shall show fastness to dry cleaning.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

3.3.16.1 Identification label. The identification label shall conform to type VI, class 1 of DDD-L-20. The content and format shall be as follows:

Nomenclature (item description)
Contract number
Name of contractor
Wool Products Act Information

3.3.16.2 Size label. The size label shall conform to type I, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letter S, R, or L for Short, Regular and Long and the stock number as shown by the following example:

$$\frac{14R}{\text{Stock Number}}$$

The stock number may be incorporated in the identification label instead of in the size label.

3.4 Design. The coats shall be the U. S. Marine Corps design shown in Figures 1, 2, and 3, a four-button, single-breasted, semiformfitting, fully lined coat having a panel type front, a four-piece back with center vent, simulated breast pocket with outside welt, shoulder straps to button, ornamental sleeve cuffs, rolled collar with worked eyelet in each end for branch of service insignia, and notched lapel. The class 2 and 3 coats shall have a sword slit.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working pattern. The contractor's working pattern shall be identical to the standard patterns. The standard patterns shall provide 3/16-inch allowance for seams at the edges of lapels, front edges of coat and for shoulder straps, 3/4-inch allowance for side seams, 5/8-inch for center back seam and 3/8-inch allowance for all other seams except as otherwise specified in Table I. Standard patterns show size, seam allowances, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts.

3.5.1 List of pattern parts. The coats shall be cut from the materials specified herein in accordance with the number of pattern parts indicated below:

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

Item	Pattern Nomenclature: Material: Polyester/wool gabardine (class 1) Cloth, Wool/gabardine (class 2)No. of Cloth, wool, elastique (class 3)	cut parts
1.	Front	2
2.	Side front	2
3.	Center back	2
4.	Side back	2
5.	Front facing (right)	1
6.	Front facing (left)	1
7.	Top sleeve	2
8.	Under sleeve	2
9.	Top collar	1
10.	Armhole shields	2
11.	Pocket Welt	1
12.	Shoulder straps	2
13.	Cuff	2
14.	Sword slit Tab (Class 2 and 3 only)	1
	Material: Cloth, twill, rayon	
15.	Front	2
16.	Right center back	1
17.	Left center back	1
18.	Side back	2
19.	Top sleeve	2
20.	Under sleeve	2
21.	Sword slit tab lining (class 2 and 3 only)	1
Item	Material: Cloth, twill, cotton or polyester/cotton twill	cut parts
22.	Breast pocket stay	1
23.	Inside pocket	2
	Material: Cloth, cotton buckram	
24.	Undercollar	1 or 2
25.	Sword slit patch (class 2 and 3 only)	1
	Material: Cloth, wool flannel	
26.	Undercollar	1
	Shapers	
27.	Undercollar shaper	
28.	Lapel working shaper	
29.	Finished collar & lapel	
30.	Left vent shaper	
	Markers	
31.	Breast pocket marker	
32.	Collarstand marker	
33.	Sleeve cuff marker	
34.	Right front marker	

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

3.6 Construction. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table I. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1 Stitches, seams and stitchings. The stitch, seam, and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted.

3.6.1.1 Tacking and backstitching. Ends of seams and stitching produced with 301 stitch type, when not caught in other seams or stitching, shall be backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of each coat cut from one piece of basic material and lining material, including pairs of sleeve linings when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Sized parts cut from ends shall be identified for size. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.

(b) Adhesive type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets.

(c) Sew-on shade tickets.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1.	Cutting. a. Cut the coats in strict accordance with patterns furnished by the Government. b. Cut all material in the direction indicated by the directional lines on the pattern. The directional lines shall be placed in the warp direction of the cloth unless otherwise indicated on the pattern. c. All wool or polyester/wool parts of the coat shall be cut from one piece of basic material, except armhole shields may be cut from ends. The welt piece for the simulated breast pocket shall be cut in accordance with the patterns furnished. When armhole shields are cut from ends, the shields shall match each other. d. The fronts, side backs and center back lining shall be cut from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the lining in each pair shall match. e. The interlining for the stay for the simulated breast pocket shall be cut in accordance with the patterns furnished. Cut the cotton and polyester twill stays for armhole, back neckline and shoulder seam on the bias, 3/4 inch wide and 4 to 4-1/2 inches long. f. For class 1 coats, cut the cotton warp spun hair-wool filling cloth for the undercollar interlining in accordance with the pattern					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1.	Cutting. (cont'd) g. For class 2 and 3 coats, cut the cotton, buckram cloth for the undercollar interlining in accordance with the patterns furnished. h. Cut the undercollar from undercollar material in accordance with pattern furnished. i. The right front shall be dressed in the front shaping operation only (see Oper.38). j. The use of drill holes is prohibited.					
2.	Replacement of damaged parts. a. Replace, at time of cutting, any parts of the coat containing holes or serious weakening defects such as smashes, multiple floats, loose weakening slubs, etc., expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc. b. Replace any parts damaged during the manufacturing process by needle chews which may develop into a hole, scissor or knife cuts, tears, holes, mends or burns in the material.					
3.	Shade marking. a. Mark or ticket (see 3.6.2) all component parts cut from one piece of basic material, and the two parts of the undercollar to insure uniform shade and size throughout the coat. All lining parts shall be marked, bundled or ticketed to insure uniform shade and size throughout the garment.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
3.	Shade marking. (cont'd)					
	b. The use of tickets with any metal fastening devices or sew-on shade tickets is prohibited on the rayon lining.					
4.	Make shoulder straps.					
	Finished appearance. The shoulder strap shall be uniformly stitched and shall finish smooth and flat, without twists, gathers or puckers. The buttonhole shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button and the stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonhole and the purling of the buttonhole shall be on the outside of the strap. The shoulder strap may be fused.					
	a. The shoulder straps shall be made of one ply of basic material and one ply of interlining.					
	b. Fold side edges, face to face, and seam together with a 1/4-inch seam.	301	SSe-2 (a)	10-14		
	c. Press seam open with a heated pressing iron or pressing machine.	301	SSe-2 (a)	10-14		
	d. Stitch pointed end of straps with a 1/4-inch seam.	301	SSe-2 (b)	10-14		
	e. Trim points and turn the straps.					
	f. Fold the edges in accordance with the notches and topstitch the straps uniformly 1/8 inch from the edge.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
4.	Make shoulder straps. (cont'd)					
	g. Make a horizontal, eyelet end, square bar type, cut first buttonhole, 3/4 inch long, in each strap, through all plies midway between the back and front edges with the inside edge of the eyelet placed so that in the finshed coat, the edge of the shoulder strap button will be 1/4 to 1/2 inch from the edge of the collar. The purling shall finish on the outside of the strap.	Buttonhole		38 per buttonhole (minimum) (not including bartack)	A	A
	h. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside.					
	i. Securely bartack the ends of the buttonhole and trim the ends of the thread and gimp.	Bartack		21 per bartack (minimum)	A	A
5.	Make undercollar.					
	a. The undercollar assembly shall consist of one piece of undercollar cloth and a single piece of interlining material.					
	b. Pad the interlining to the undercollar with 6 to 7 rows of blindstitching. Press undercollar flat.	103	SSm-1 (each row)	4-6	A	
	c. Mark and trim undercollar in accordance with the shape of the pattern. Trim the interlining 1/8 inch back from the neck edge of the undercollar and collar ends.					
	d. Mark the breakline of the undercollar with the collarstand marker.					
	e. Stitch the breakline in accordance with the mark and stitch the undercollar to interlining 1/2 inch from outer and end edges.	301 or 401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6.	Assemble topcollar and undercollar.					
	Finished appearance. The collar shall be uniform in appearance and shall finish smooth and flat without twists, gathers, puckers, pleats or raw edges (outer and sides). The felling shall not be too tight or loose and the collar material shall be securely caught in the stitching. The eyelets shall be well worked with the purling on either side of the collar and shall finish with a 1/8-inch diameter opening.					
	a. Position topcollar between undercollar and interlining with the outer edge abutting the undercollar-interlining seam and with notches aligned. Join topcollar to interlining with a row of stitching 3/16 inch from the lapped edge of the topcollar.	301	LSa-1	6-8	A	A
	b. Join topcollar to undercollar at outer edge with zigzag stitching, properly distributing the fullness between the notches. The zigzag stitching shall extend to the end of the collar.	304	LSa-1	8-10	A	A
	c. Turn the topcollar to the inside, face to face with the undercollar, folding even with the top edge of the interlining. Stitch the ends of the undercollar to the top collar with a 1/8-inch seam. Trim the ends and the corner of the seam and turn assembly, forcing out the collar points.	301	SSa-1	8-10	A	A
	d. Baste the top edge and ends, forcing out the points of the outer corners of collar and baste along the breakline with the fullness placed between the two rows of basting stitches.	101 or Hopper				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6.	Assemble topcollar and under collar. (cont'd)					
	e. Press the collar smooth and flat with a heated pressing machine. Edges and corners shall be smooth, flat and uniformly even.					
	f. Trim the neck edge of the topcollar to provide for proper seaming to the coat, and cut a guide notch in the lower edge of the topcollar at the center.					
	g. Make one eyelet at each end of the collar 1 inch from the end and outer edge, respectively. The eyelet shall be well worked, and shall finish with 1/8-inch opening.	Eyelet		20 per eyelet minimum	A 0	A (silk) 0 (silk)
7.	Stitch point of cuff.					
	a. Fold the cuff lengthwise at the point, with wrong side out, and stitch the point 1/8 inch from the raw edges.	301	SSa-1	10-14	A	A
	b. Turn cuff, completely working out the point.					
	c. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern. Press smooth and flat with a heated pressing iron or pressing machine, creasing the edge, or the upper edge may be basted instead of pressed.	101 or Hand				
8.	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats, and shall start and finish evenly.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8.	Seam sleeves at forearm. (cont'd)					
	a. Position the top and undersleeve with notches matching and join at the forearm with a 3/8-inch seam.	301 or 401	SSa-1	12-16	A	A
	b. Spread open the seam and press flat, holding seam short, with a heated pressing iron.					
9.	Join cuff to sleeve.					
	Finished appearance. The upper curved edge of cuffs shall be uniformly stitched to sleeves.					
	a. Mark the sleeve in accordance with the sleeve cuff marker for positioning the cuffs, with notch on the cuff pattern marker matching the forearm seam line and the lower edge of pattern in line with the bottom raw edge of sleeve.					
	b. Position the cuff at the mark and seam to the body of the sleeve 1/8 inch from the upper edge. Trim the ends of the cuff even with the backarm edge of the top and undersleeve, if necessary.	301	LSd-1	12-16	A (silk) or O (silk)	A O
10.	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats, and shall start and finish evenly.					
	a. Position the top and undersleeve together at the backarm and stitch with a 3/8-inch seam. Continue the seam to the bottom of the cuff.	301 or 401	SSa-1	12-16	A	A
	b. Spread open the backarm and cuff seams and press flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
11.	Tack cuff to sleeve.					
	Finished appearance. The bottom edge of the cuff shall finish smooth and flat without pleats, puckers, or bulges.					
	a. Turn the cuff outlet to the inside against the bottom end of the sleeves, in accordance with notches, and baste along the turned edge of cuff.	Hand or 101				
	b. Tack the raw edge of the cuff to the body of the sleeve with blindstitching. The blindstitches shall not be exposed on the outside of sleeve cuff.	103	SSm-1	4-6	A	
	c. On the finished coat, the height of the cuff, when measured from folded bottom edge of cuff, shall be 2-3/4 ± 1/4 inches at the forearm and backarm seams, and 4-3/4 ± 1/4 inches at the point.					
12.	Seam sleeve lining.					
	Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched, and shall finish smooth and flat without twists, gathers, puckers or pleats. The seams shall start and finish evenly.					
	a. Position the top and under sleeve lining in accordance with notches on pattern and join the forearm and backarm, respectively, with a 3/8-inch seam.	301 or 401	SSa-1 or SSbd-1	10-14	A	A
	As an alternate, when using a sleeve lining felling machine, join back arm seam and forearm seam of sleeve lining. The distance between the notches on the forearm seam shall be left open.	301 or 401	SSa-1 SSa-1	10-14 10-14	50 50	50 50

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12.	Seam sleeve lining. (cont'd)					
	Position the sleeve lining top notches to the top of forearm seam and top of the backarm sleeve hem. Tack the forearm seam and backarm seam of the sleeve lining to the forearm seam and backarm seam, respectively. The backarm seam tacking shall extend from approximately the midpoint of the backarm seam to not more than 6 inches above creased bottom edge. The forearm seam tacking shall be for a distance of 1-1/2 to 2 inches below the bottom left open forearm seam notch.	Hand or 301		2-3 4-8	50	50
13.	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve lining shall be positioned and seamed, or tacked, to sleeve without twists, gathers, puckers, or pleats.					
	a. Position the under sleeve lining on the under sleeve with the top notch in the backarm of under sleeve lining aligned with top edge of under sleeve and the upper edge of sleeve lining extending 3/4 to 1 inch beyond the armhole edge of the sleeve.					
	b. Seam or tack by hand the forearm and backarm sleeve lining seam allowance to the top sleeve backarm and forearm seam allowance, respectively, properly distributing the fullness in the lining. The stitching shall extend from approximately 5 inches above the finished bottom edge of the sleeve, up to approximately midway to the armhole edge of the underarm and backarm edge.	301 or Hand	SSa-1	4-5	A Commercial	A
	c. Turn sleeve lining over the sleeve.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
14.	Fell turnup of sleeve lining; press sleeves.					
	Finished appearance. The sleeve linings shall not be short, tight or twisted					
	a. Turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 inches the finished bottom edge of sleeve, and baste to turnup of sleeve.	101 or Hand				
	b. Fell the folded edge of sleeve lining to turnup of sleeve with blindstitching.	314 or Hand	SSm-1	6-8 8-10	O (silk)	O
	c. Turn sleeves right side out and assemble in pairs. Insert a sleeve pad in the sleeve to avoid creasing the front and back edge. Press smooth and flat with a heated pressing machine.					
15.	Make welt.					
	Finished appearance. The welt shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges.					
	a. The welt for the simulated breast pocket shall be made of a single piece of basic material folded in accordance with notches and reinforced at the inside folded edge with 1/4-inch-wide cotton tape.					
	b. Position the tape on the underside of the welt piece with one edge even with the fold notches and seam 1/16 inch from the edge of the tape next to the fold line.	301	LSbj-1	10-14	A	A
	c. Fold the welt at the fold notches with the tape on the outside and close the ends with a 1/4-inch seam.	301 or 401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
15.	Make welt. (cont'd)					
	d. Turn the welt face side out, working out the edges and corners completely. Edgestitch welt 1/8 inch from seamed and folded edges. The welt shall finish with the cotton tape stitched to the inside of the welt.	301	SSe-2 (b) (sides) OSf-1 folded edge	12-16	A (silk) O (silk)	A O
	e. Press the welt smooth and flat with a heated pressing iron or pressing machine.					
16.	Make armhole shields.					
	Finished appearance. The armhole shields shall be made from one ply of basic material and shall finish without puckers, gathers, or raw edges.					
	a. Bind the rounded edge of shield with bias binding, turning under the outside raw edge of the binding only, and catching the turned under portion in the stitching 1/16 inch from folded edge.	301 or 401	BSb-1	10-14	A	A
17.	Stitch darts in front lining.					
	Finished appearance. The darts shall be tapered to a point at upper ends.					
	a. Sew the darts with a 3/8-inch seam, tapering the dart to a point at the upper ends and securely back tack.	301	SSa-1	10-14	A	A
18.	Make inside pocket.					
	Finished appearance. The pocket shall be uniformly stitched and finish smooth and flat without causing distortion.					
	a. The pocket shall be made of 2 plys of poly/cotton material 5" wide X 6 1/2" long.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18.	Make inside pocket. (cont'd)					
	b. Position both plys of pocketing material face to face with notches matching and stitch together from the top notch across the top, back, bottom and up the front to the bottom notch with a 3/8 inch seam leaving a 4 1/2 inch opening for the pocket.	301	SSa-1	10-14	A	A
	c. Attach the front pocket openings in accordance with the notches to the right front facing and the right front lining respectively with a 3/8 inch seam leaving a 4 1/2 inch pocket opening.	301	SSa-1	10-14	A	A
	d. Raise stitch the pocket material on to the facing and lining respectively with a 1/16 inch topstitch.	301	SSc-1	10-14	A	A
19.	Seam front lining to facing and sew on label.					
	Finished appearance. The lining shall be carefully seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.					
	a. Position the lining on the facing with notches matching and seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from top (shoulder) edge of facing to the bottom notch of facing approximately 1-1/4 inches from the bottom edge.	301 or 401	SSa-1	10-14	A	
	b. Sew the identification label to the left front lining with a single row of stitching 1/16 inch from each edge of the label. The label shall be positioned horizontally with the lower edge of label	301	SSbj-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
19.	Seam front lining to facing and sew on label. (cont'd)					
	3 inches above the bottom edge of the finished coat. The ends of the label stitching shall overlap not less than three stitches.					
20.	Press front lining and waist darts.					
	a. Press the facing joining seams and waist darts smooth and flat with a heated pressing iron or pressing machine.					
	b. The facing-lining joining seam shall be pressed with the raw edge of the seam allowance toward the back. The waist darts shall be pressed with the edge towards the back.					
21.	Join back lining parts.					
	Finished appearance. Back linings shall be carefully joined without pleats, puckers or gathers. The seam shall start and finish evenly at seam line.					
	a. Position back linings with notches matching and join together at the center with a 3/8-inch seam, stopping at the top of the vent.	301	SSa-1	10-14	A	A
	b. Position left and right side back linings to the respective center back linings, matching notches and join with a 3/8-inch seam.	301	SSa-1	10-14	A	A
22.	Join back and front linings.					
	Finished appearance. The linings shall be carefully joined without pleats, puckers or gathers. The seam shall start and finish evenly at seam line.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22.	Join back and front linings. (cont'd)					
	a. Position the back and front linings together and join at the sides with a 3/4-inch seam.	301	SSa-1	10-14	A	A
23.	Press lining seams and darts.					
	a. Press the facing-lining joining seams, side and back seams and the waist darts smooth and flat with a heated pressing iron or pressing machine.					
	b. The facing-lining joining seams, side seams and left and right back seams shall be pressed with the raw edges of the seam allowance toward the back. The lining shall be folded face to face along the center back seam and the seam pressed flat. The waist darts shall be pressed with the edges toward the back. Fold back and press flat the facing and lining seam allowance of the unstitched portion of the lining-facing joining seam at the bottom edge.					
24.	Join backs.					
	Finished appearance. The side and center backs shall be joined without gathers, puckers or pleats. The folded edge of the left vent shall be in vertical line with the center back seam.					
	a. Stitch the 1/4-inch-wide stay tape to the inside of left center back along the vent, with the edge of the tape positioned approximately 1/8 inch in front of the fold notch of the vent.	301	SSaa-1	10-14	A	A
	b. Position the center backs with edges even and join with a 5/8-inch seam from the top edge of the backs to approximately 3/4 inch	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24.	Join backs. (cont'd)					
	below top end of the vent, and from that point continue to stitch diagonally across the top end of the vent.					
	c. Turn the left vent to the inside of the left center back, in accordance with the notches, and edge stitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam line.	301	OSf-1	10-14	A	A
	d. Join the left and right side backs to the respective center backs with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	e. Seam the 3/4-inch-wide poly/ cotton twill stay to the underside of back neckline 1/8 inch from the outer edge of neckline.	301	SSaa-1	10-14	A	A
25.	Press back seams.					
	a. The side and center back seams shall be pressed with a heated pressing iron or pressing machine.					
	b. Notch the top end of the right vent diagonally from the juncture point of the vent and the center back to the lower end of the stitching for the center back seam.					
	c. Spread open the side and center back seams, respectively, and press flat.					
26.	Topstitch top end of vent.					
	Finished appearance. The edge of right side of vent shall extend beyond the center seam allowance of the left back part.					
	a. Stitch and backstitch across the top end of vent through all plies from the back center seam to	301	SSa-1	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
26.	Topstitch top end of vent. (cont'd)					
	the edge of the vent, for a distance of 1 inch.					
27.	Join front and side front.					
	Finished appearance. Bust lines on both sides shall be alike. Fronts and side fronts shall be carefully joined without puckers or gathers. The seams shall start and finish evenly at the seam line. The contour of the waist and hip line shall be maintained in the seaming.					
	a. Sew the dart with a 3/8-inch seam, tapering to a point at the upper end, and securely back tack.	301	OSf-1	10-14	A	A
	b. Position front and side fronts with notches matching and join together with 3/8-inch seams.	301 or 401	SSa-1	10-14	A	A
	c. Spread open the front seam and waist darts and press flat with a heated pressing iron, maintaining contour.					
	d. Tape gorge line on underside with 1/4-inch tape from shoulder to 1/4 inch below top of lapel.	301	SSaa-1	10-14	A	A
28.	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The polyester and cotton twill reinforcement stays shall be sewn to the armhole and shoulder edges of the front without gathers, puckers or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide polyester and cotton twill stays to the	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28.	Seam reinforcement stay to armhole and shoulder. (cont'd)					
	underside of the fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges.					
29.	Assemble simulated breast pocket welt on left front.					
	Finished appearance. The simulated breast pocket shall be smooth and flat with the ends of the welt uniformly stitched and with no puckering. In the finished garment, the breast pocket welt shall be horizontal with the bottom edge of coat.					
	a. Mark the left front in accordance with breast pocket marker for position of breast pocket welt. Mark welt seam line on the underside 1 inch from folded edge for proper seaming to front.					
	b. Position the polyester and cotton twill stay piece for the pocket on the underside of the front. Position the welt on the outside of the left front, with marks on welt and front matching and with folded edge of welt towards the bottom edge of coat. Seam top ply of welt to the front at the mark through the stay piece.	301	LSbj-1	10-14	A	A
	c. Turn the welt with the folded edge of the welt towards top of front. Topstitch both ends of welt to the front, 1/8 inch from the seamed edges of welt. The line of stitching shall extend from the lower seamed line of the welt up to the folded edge of welt. The welt shall be blindstitched to the body of the coat and the stitching shall not be visible on the outside of welt.	301	SSe-2 (b) (both sides)	10-14	A	A (silk)

Source: https://assist.dla.mil -- Downloaded: 20260410-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
29.	Assemble simulated breast pocket welt on left front. (cont'd)					
	d. On the outside of the finished coat, the welt for the simulated pocket shall measure 1 ± 1/16 inch in height, and the width for each size coat, measured along top edge of welt, shall be as follows: Coat size — Width of Welt (inches) 6 through 14 — 3-1/2 16 through 22 — 4					
30.	Make buttonhole tab. (Class 2 and 3)					
	Finished appearance. The sword slit buttonhole tab shall finish smooth and flat without distortion. The stitching shall be uniform and the buttonhole shall be properly positioned. The tab shall finish 2-3/8 ± 1/8 inches long and 2 ± 1/8 inches wide.					
	a. Buttonhole tab for sword slit shall be made of one ply of basic material and one ply of rayon lining material.					
	b. Seam together the lining piece and basic material at side and bottom edges of tab 3/16 inch. Turn and topstitch 1/8 inch from seamed edge.	301	SSe-2 (shows finished seam)	10-14	A (silk)	
	c. Seam the pieces together 1/8 inch from raw edges at top end of tab.	301	SSa-1	12-16	A (silk)	
	d. Make a vertical eyelet-end taper-bar type buttonhole, cut 5/8 inch long, in center of tab with the inside edge of the buttonhole eyelet placed 5/8 inch above the bottom edge of the tab. The buttonhole shall be well worked over gimp to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the lining side of the tab.	Button-hole		60 per Button-hole (including tack)		

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31.	Make sword slit and attach button-hole tab.(Class 2 and 3) Finished appearance. The sword slit shall finish without bulges or excessive bulkiness. All parts shall be securely fastened and properly positioned. The flap shall be securely attached and properly positioned to cover slit properly. a. Mark left front for a 2-inch diagonal slit in side body dart seam (2nd seam in from edge of coat). The top of the sword slit shall be in line with the center of the second button from the bot-tom of coat.					
	b. Topstitch the front for 2 inches at the marks for the sword slit, 1/16 inch on either side of dart seam. The stitching shall be through the seam allowance only.	301	OSf-1	12-16	A	A (silk)
	c. Tack across the seam at each end of the topstitching to prevent seam from opening when sword slit is cut. The tacks shall be 1/8 inch long, 1/16 inch on each side of seam.	301	SSa-1	12-16	A	A (silk)
	d. Mark the tab 1-3/4 inches from bottom edge. Cut dart seam open for sword slit and position tab on outside of front, basic fabric up, with top end inserted through slit toward front edge of coat. Align mark on tab with front folded edge of slit. Topstitch through seam allowance and tab and securely tack each side of the tab to the front at the opening. The basic fabric side of the tab shall be towards the outside of the coat.	301	LSd-1	12-16	A	A (silk)

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
32.	Join fronts and back at sides.					
	Finished appearance. The fronts and side backs shall be joined together without puckers or pleats. The seams shall start and finish evenly at seam line. The contour of the waist and hip line shall be maintained in the seaming.					
	a. Position side fronts to the side backs at the sides and join with 3/4-inch seams.	301 or 401	SSa-1	10-14	A	A
33.	Press side seam.					
	a. Spread open the side seams and press flat with a heated pressing iron.					
34.	Tape armholes.					
	a. Sew the 1/4-inch-wide stay tape to the inside at the lower edge of the armhole, starting from approximately 1 inch above the notch in the fronts and continuing to side seam. Cut the tape and continue stitching tape along bottom and back edge to lower notch holding tape taut. Continue to stitch tape to back armhole to 1-1/4 inches from the shoulder.	301 or 401	SSaa-1	10-14	A	A
	b. From the lower back notch, continue stitching the tape, holding the tape taut along the back edge of armhole to 3/4 inch from the shoulder.	301	SSaa-1	10-14	A	A
	c. Press armhole tapes and shoulder blade smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 20260410-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35.	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste along the front seams, properly distributing the fullness over the breast area. The basting shall extend from approximately 3 inches from the shoulder edge of fronts to approximately 1-1/2 inches from the bottom edge.					
	b. Baste the left front along the welt-joining seam line on the outside, with the front and interlining lying smooth and flat.	101 Hopper				
	c. Tack the front and back ends of the simulated pocket stay to the coat front interlining. The tacking shall be as close as possible to the corners of the pocket.	101 Hopper or Hand				
	d. Baste horizontally along the shoulder, allowing room for setting shoulder pads and working the fullness on the front towards the armhole. Baste along the front of armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining to approximately 1-1/2 inches from bottom edge of front.	101 Hopper				
	e. Baste along the breakline of lapel, starting at the gorge, and continue basting along the front edge below the breakline to approximately 1-1/2 inches from bottom edge of front.	101 Hopper				
	f. Baste along the top and front edge of lapel down to the lower end of lapel.	101 Hopper				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36.	Baste bridle tape to lapel.					
	a. Position the 3/8-inch-wide bridle tape on the interlining side of the fronts along the breakline of lapel, with the front edge of the tape in line with notch in the gorge.					
	b. Baste tape through the interlining and the front of coat along the breakline of lapel evenly and smoothly, holding the tape taut and properly distributing the fullness. The tape shall extend from the gorge notch to approximately 1-1/2 inches from the lower edge of lapel.	101 or Hand		6-8		
37.	Pad lapels.					
	a. Pad the lapels with seven to eight rows of blindstitching, from approximately 3/4 inch from front edge to the breakline, properly distributing the fullness of the interlining between the rows of stitching to roll the lapels.	103 or	SSm-7 or 8	4-8	A or 00	
		314	SSm-7 or 8	4-8	A or 00	A 00
	b. Blindstitch both edges of bridle tape to interlining.	103 or	SSm-2	4-8	A or 00	
		314	SSm-2	4-8	A or 00	A 00
38.	Press chest and lapels.					
	a. Roll press the lapels, shrinking to eliminate the fullness from the interlining, on a suitable type heated pressing machine.					
	b. Press the fronts individually on a suitable type heated pressing machine to conform to the shape of the body to eliminate excess fullness in the breast.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39.	Shape fronts. a. Mark and shape the front edge of the coat. Mark and shape the lapels in accordance with the shaper furnished. b. Mark the coat 1-1/4 inches from the bottom edge for the bottom turnup. c. Trim the coat front interlining 1/4 inch back from the front edge of the fronts and top edge of the lapel. Trim bottom of interlining to approximately 1/4 inch above the mark for the bottom turnup. NOTE: In-process inspection of this operation shall take place at this point before going to the next operation.					
40.	Baste facing-lining assemblies to fronts. a. Position the facing-lining assembly on outside of respective fronts and baste along the breakline, distributing the fullness in the breast area and continue to baste along the front and bottom edge. Baste front along top and front edges of lapel down to the lower end of lapel, working the fullness towards the center of lapel.	101 Hopper				
41.	Join facings and fronts with tape. a. Join the facings and fronts together 3/16 inch from the top and front edges of lapel and front edges of coat, with the stay tape, 3/8 inch wide for all classes positioned on the interlining side of fronts. The edge of the tape shall be 1/8 inch from the front edges and caught in the stitching.	301	SSab-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41.	Join facings and fronts with tape. (cont'd) Continue stitching along the lower edge of coat 3/16 inch above the front cutout with the tape properly positioned and caught in the stitching. b. The tape shall extend from the lapel notch to 1-1/2 to 2 inches from the side seams at the bottom of coat, except the tape is not required along the step of the left front. The tape shall be sewn with normal tension along the top and front edges of lapel and with slight tension along front and bottom edges of coat.					
42.	Fell tape to interlining. a. Fell the back edge of the stay tape to the coat front interlining from the collar notch on top of lapel to the end of the tape at the bottom edge. b. Press the fronts and tape at the top and front edges of lapel, and front and bottom edges of coat, smooth and flat with a heated pressing iron or pressing machine. c. Remove all basting stitches. Trim lower front corner and corner of lapels. Notch lapel for proper turning. d. Spread open the front facing seam from lapel notch to the bottom edge of coat and press smooth and flat with a heated pressing iron.	103	SSm-1	4-6	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
43.	Baste fronts and bottom edge of coat.					
	a. Turn the facing-lining assemblies to the inside of the fronts, working the corners of lapels out completely. Turn up the bottom of coat, lapping the back edge of facing on the ends of the bottom turnup and working the front corners out completely.					
	b. Baste along the top and front edges of the lapel, including the step of the left front and finished bottom edges of the coat, working the seams to the edges of the coat.	101 or Hand		4-6		
44.	Baste facing (second time).					
	a. Baste facing to front approximately 1-1/4 inches from the top and front edges of lapel and front and bottom edges of the coat, holding the lower corners of the coat in such a manner as to cause the lower front edge of front to roll inward.	101 or Hand				
	b. Baste along the breakline of the lapel, properly placing the fullness to allow the lapel to roll.	101 or Hand				
	c. Baste the lapel diagonally from the corners to the breakline, properly placing the fullness to allow the lapel to roll.	101 or Hand				
	d. Baste the facings to the front as close to the facing-lining seam as possible, placing the proper fullness over the breast area. The basting shall extend approximately 1-1/2 inches from the bottom edge of the coat to approximately 3 inches from the shoulder edges of facings.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
45.	Tack facings at back edge to interlining.					
	a. Raise the lining and tack the seam allowance at back edge of the facings to the coat front interlining with blindstitching, starting approximately 2 inches from the bottom edge of the coat and tacking to approximately 2-1/2 inches from the shoulder edge of the interlining. Tacking shall be through seam allowance of facing and linings.	103 or 314 or Hand	SSa-1 SSm-1	4-6 4-6 4-6	A A C (silk)	A
46.	Blindstitch bottom turnup.	103 or	EF1-1	4-6	0 (silk)	
	a. Blindstitch the bottom turnup.	306 or Hand		4-6 4-6	0 (silk) 0 (silk)	0
47.	Join lining to vent.					
	a. Position the right and left back lining on the respective right and left vent opening, face to face, with notch of lining even with the top of the vent and joining each side respectively with a 3/8-inch seam to 3/4 inch above bottom turnup.		SSe-2(a)	10-14	A	A
	b. The left vent corner shall be finished with a mitre corner (Do not cut corner).	Hand or machine		4-6	0 (silk)	
	Alternate: The left vent corner may be piped for a distance of 1-1/2 to 2 inches and turned up 1-1/4 inches at the hem and stitched by hand or machine.	103 or 306 or Hand	EF-1	4-6	0 (silk)	
	c. Edgestitch the right vent with a 1/8-inch seam from folded edge of vent ensuring the lining is not exposed on the outside.	301	SSe-2(b)	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
48.	Baste body lining to coat.					
	a. Fold the front lining at the shoulder in accordance with notches, forming a chest pleat, and baste the entire length of the pleat. Continue to baste from the lower edge of armhole along the side seam and across the bottom edge of lining. The folded edge of the chest pleat on the outside of the lining shall be toward the armhole.	101 or Hand				
	b. Left side of coat. From side seam of lining at waist, baste across back lining to center vent. Fold lining up from bottom and continue basting lining approximately 1/2 inch from bottom edge of coat.	101 or Hand				
	c. Right side of coat. From side seam of lining at waist, baste across back lining to top of vent. Fold lining up from bottom and continue basting lining approximately 1/2 inch from bottom edge of coat.	101 or Hand				
	d. Baste center pleat from top of vent with a zero pleat, tapering up to the matched notches at the neckline, adding fullness to approximately 2 inches from the neck. The folded edge of the pleat on the outside of lining shall be toward the left side.	101 or Hand				
	e. Baste the back lining along the lower edge of armhole, approximately 2 inches from the edge, and continue up and across the shoulders and neckline down to the other armhole. Leave ample room with basting to permit insertion of the shoulder pads.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
49.	Fell bottoms.					
	a. Fell the lining turnup to the bottom turnup.	Hand or Machine		4-6	O (silk)	O
50.	Trim front lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole. -or- When the shoulder lining seams are joined by machine, trim excess coat front interlining and front and back lining at shoulders to allow insertion of shoulder pads.					
	b. Trim the lining even with the back at the neck.					
51.	Baste shoulder pads.					
	a. Insert shoulder pad between interlining and chest padding of coat front interlining, in line with the armhole edge, and securely tack the pad to the interlining and chest padding only.	101 or Hand				
	b. When type XIII or type XV of MIL-C-15065 is used, place shoulder pad on under side of interlining in line with armhole and securely tack on interlining only.	101 or Hand		4-6		
52.	Seam shoulders.					
	Finished appearance. The shoulders shall be evenly joined with the front and back seam lines matching, working in the proper fullness on the backs in order that the shoulder may be properly shaped.					
	a. Join fronts and backs together at the shoulder with a 3/8-inch seam.	301 or 401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
52.	Seam shoulders. (cont'd) b. Spread open the shoulder seam and press flat with a heated pressing iron or pressing machine over a suitable block, holding the shoulder short. Care shall be exercised in pressing the shoulder seam in order that the shoulders shall not have a distorted appearance in the finished coat.					
53.	Baste lining at shoulders and neckline. a. Position shoulder interlining at neck. Baste upper part of each shoulder on the outside and turn the coat on the inside. Turn under and lap the shoulder edge of the lining on the front lining. Baste lining to coat along the folded edge with top end of chest pleat caught in the basting at the shoulders. Baste the lining to the back at the neck, from shoulder seam to shoulder seam.	Hand or 101 Hopper				
54.	Stitch hanger and label to coat. a. Stitch the ends of the hanger and upper edge of the size label to the neck of coat at the inside center back. b. The hanger opening, in the finished coat, shall be 1-1/2 $\pm$ 1/8 inches long when measured along the neck edge of the collar.	301	SSa-1	10-14	A	A
55.	Set collar. Finished appearance. The seam joining top collar to facing at the gorge shall be of uniform gage and shall finish smooth and flat without twists, puckers, pleats, or other distortions. a. Mark the coat on the outside around the neck from shoulder seam to shoulder seam, 5/8 inch from					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
55.	Set collar. (cont'd)					
	the top edge, and continue to mark along the gorge with the line of marking tapering to 3/8 inch at the lapel notch.					
	b. Join the top collar to the facing at the gorge, from the collar notch to a point not less than 1 inch in back of the lapel breakline.	301	SSa-1	12-16	A	A
	c. Clip the facing at the back end of joining seam.					
56.	Tack top collar to fronts at gorge.					
	a. Spread open the seam joining top collar to facing and tack the seam allowance of the top collar to the front at the gorge, from the collar notch to the back end of the seam, catching the top end of bridle tape in the tacking.	Hand or 301		2-4 12-16	C (silk) A	 A
57.	Baste undercollar to coat.					
	Finished appearance. Fullness in the collar along the neck edge shall be properly placed over the shoulders so that the collar will not be tight along the outer edge over the shoulders.					
	a. Turn the collar to the outside with the lower edge of the undercollar lapped on the outside of the coat at the mark.					
	b. Securely tack the corners of the undercollar across the juncture point of the collar and the lapel.	Hand		8-10	C (silk)	
	c. Baste the undercollar to the fronts and backs, placing proper fullness over shoulder.	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
57.	Baste undercollar to coat. (cont'd)					
	d. In the finished coat, the ends of the collar shall be 1-3/8 ± 1/8 inches for all sizes when measured from the juncture of the collar and lapel to the finished edge.					
58.	Tack coat to collar interlining.					
	a. Raise the lower (neck) edge of the top collar and tack the neck edge of coat to the undercollar interlining with overcast stitches, or blindstitching by machine, catching the back lining in the tacking from shoulder seam to shoulder seam.	Hand or 103	SSm-1	2-3 3-4	C (silk) A	
59.	Baste top collar to coat.					
	a. Turn under the lower edge of the top collar and baste from gorge seam to gorge seam.	Hand or 101		4-6		
	-or-					
	b. In lieu of operations 58.a, and 59.a, join lower edge of top collar from gorge seam to gorge seam.	301	SSa-1	10-14	A	A
60.	Fell collar to coat.					
	a. Fell the neck edge of the undercollar to the fronts and backs from collar notch to collar notch.	Hand or		8-12	C (silk)	
		Machine (hand type felling or	LSa-1	8-12	C (silk)	
		306	LSa-1	8-12	O (silk)	O
	b. Fell the folded edge of the top collar to the coat from gorge seam to gorge seam, catching the top edge of the size label and the ends of the coat hanger in the stitching.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
61.	Edgestitch coat.					
	a. Edgestitch the coat 1/8 inch from the front edges of the coat, the front and top edges of the lapels, and the edges of the collar.	301	SSe-2 (Front edges of coat, front and top edge of lapels) (shows finished seam) SSb-1 (collar)	10-14	A	A
62.	Set shoulder straps.					
	Finished appearance. The shoulder straps shall be uniform in length and setting. In the finished coat, the straps shall be 2-1/4 ± 1/8 inches wide at the armhole seam and shall taper to 1-1/2 inches ± 1/8 inches at the buttonhole eyelet end.					
	a. Position the shoulder straps with the pointed end of the strap even with the edge of the neck and with the seam of the strap centered on the shoulder seam ±1/8 inch.					
	b. Stitch the shoulder straps to the coat 3/16 to 1/4 inch from the armhole edge. Trim the shoulder straps even with the armhole where necessary.	301 or 401	SSa-1	10-14	A	A
63.	Set sleeves.					
	Finished appearance. The sleeves shall be properly and carefully set and shall be uniformly stitched without twists, gathers, pleats, puckers or raw edges.					
	a. Position the outside of the sleeves on the outside of the coat with notches matching and with the sleeve lining turned back from the armhole edge.					
	b. Join the sleeves to the coat with a 3/8-inch seam, evenly distributing the fullness between notches and catching the end of the shoulder strap in the stitching.	301 or 401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
63.	Set sleeves. (cont'd)					
	c. Press the armhole smooth and flat with a heated pressing iron to remove the fullness. Care shall be exercised in pressing the armhole seam in order not to stretch the armhole.					
64.	Baste armhole.					
	a. Baste around inside armhole, positioning yoke lining, shoulder pad, and front lining in place and distributing fullness evenly. Turn the coat on the outside.	101 or Hand				
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend the entire circumference of the armhole.	101 or Hand				
65.	Baste underarm shield to coat.					
	a. Position the underarm shield on the lining side of the coat at the base of armhole, and baste the shield to the coat along the armhole and outer (convex) edges.	101 or Hand				
66.	Tack armhole and stitch sleeve head pads.					
	a. Position the sleeve head pad on the sleeve, with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam and with the front end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad from end to end to the sleeve through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings, shields at the base of armhole and shoulder pad in the stitching. Continue	Hand		4 per tack (minimum)	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
66.	Tack armhole and stitch sleeve head pads. (cont'd)					
	stitching the lining around the remainder of the armhole. Trim away the excess material.					
67.	Tack underarm shields to lining.					
	a. Tack bottom edge of underarm shields on the underside to lining. As an alternate, the underarm shield may be joined to the lining by superimposing the seam on the seam joing the binding to the shield.	Hand		4 per tack (minimum)	C (silk)	
	b. In the finished coat, the shields shall measure not less than 2 inches in length from the folded edge of sleeve lining.					
68.	Finish sword slit.(Class 2 and 3)					
	Finished appearance. The sword slit shall finish flat, smooth, firmly stitched and properly positioned with no puckers, bulges, or raw edges.					
	a. Properly position left front lining and baste to front end around the top to hold in position for cutting of opening in the seam for sword slit tab.	Hand				
	b. Cut opening for sword slit tab in lining seam to correspond with opening in front.					
	c. Fell folded edges of lining at cut opening in order to hold lining in place.	Hand		6-8	C (silk)	
	d. Cut 2-inch-long opening in sword slit patch, 1/2 to 5/8 inch from top edge. The opening shall be 1 inch on each side of vertical center of patch.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
68.	Finish sword slit.(Class 2 and 3) (cont'd)					
	e. Pull tab through opening to inside and insert the tab through the patch opening aligned with the opening in the lining.					
	f. Fell patch to lining on all outer edges and around the raw edges at the opening to the front dart seam allowance and the back edge of tab.	Hand		6-8	C (silk)	
	g. Make sword slit patch for the location of one 22 line sewing hole button to properly engage with the tab buttonhole. Sew button at the mark on the patch and wrap not less than 4 times. The stitching to be through the patch, catching the lining.	Hand		8 (double-thread wrap)		
69.	Join back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, securing the top end of the shoulder pleat in the felling. The felling shall be placed over the folded edge of the back lining.	Hand		8-10	C (silk)	
	-or-					
	Join the back lining and facing lining assembly at the shoulders, securing the top of shoulder pleat in the seam.	301 or 401	SSa-1	10-12	A	A
70.	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole, with the back and forearm seam of the sleeve and sleeve lining matching.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
70.	Fell sleeve lining at armhole. (cont'd)					
	b. Turn under to top raw edge of the sleeve lining and lap 1/4 to 3/8 inch onto the armhole seam allowance over the front and back lining and underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of sleeve lining and distributing the fullness in accordance with good commercial practice. Backstitch 1/8 inch from the felled edge of sleeve lining along the lower armhole from approximately 1-1/2 inches above the forearm seam line in sleeve lining to the side seam line in the body lining.	Hand		8-10	C (silk)	
	- or -					
	c. Machine stitch lower edge of sleeve lining, at the armhole on the inside, from forearm seam to backarm seam and hand fell the remaining portion as specified in operation 69.b above.	301	SSa-1	12-16	A	A
	d. Machine stitch lower edge of sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and stitch remaining portion of the sleeve lining at the armhole with machine simulated hand felling. A Strobel or Durkoff sleeve felling machine is authorized. As an alternate, the armhole lining may be felled utilizing a sleeve lining machine that consists of a feed off the arm machine equipped with a lower and upper feed (review specification requirements for felling of sleeve lining in relation to appropriate turn under).	Machine simulated		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
70.	Fell sleeve lining at armhole. (cont'd)					
	(1) Stitch sleeve lining to armhole on inside from front sleeve notch to backarm seam across undersleeve.	301	SSa-1	10-14	50	50
	(2) Stitch the top sleeve lining to armhole on inside from the front armhole notch to top back arm lining seam across the crown of the top sleeve lining.	306	SSa-1	10-14	50 or mercerized cotton 50/2 or 3 or nylon A	50 or mercerized cotton 50/2 or 3 or nylon A
	(3) Close the previous left opened forearm seam 1/16 to 3/32 inch from edge. NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than hand felling.	301	SSc-1	10-14	50	50
71.	Make buttonholes. Finished appearance. The buttonholes shall be cut-first type, clean cut, well made and well worked over gimp to fit a 40-line insignia button. The stitching of the buttonholes shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the front. The purling of the buttonholes shall be on the outside. a. Mark the right front in accordance with the marks on the pattern for the locations of four buttonholes. The buttonholes shall be evenly spaced.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
71.	Make buttonholes. (cont'd)					
	b. Make one horizontal eyelet-end, square-bar type buttonhole, 1-1/8 inches long at each of the marks. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of the coat.	But-ton-hole		50 per button (minimum) not in-cluding bartack	B (silk)	F
	c. Securely bartack the ends of each buttonhole, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Bar-tack		21 per bartack	A (silk)	A
72.	Clean coat.					
	a. Pull and remove all basting thread. Trim all ends of stitching and remove all loose ends of thread from the coat. Remove all spots, stains and shade tickets and markings without injury to the material.					
73.	Press coat.					
	a. The coat shall be well pressed throughout with a heated iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices.					
	b. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine with shoulder straps properly positioned over shoulder seam and pressed flat.					
	c. Press the armholes solid from the inside, creasing the sleeve lining at the edge of the armhole seam allowance in the front, back and armpit of the lower armhole. The armpit and the back of the armhole shall be held short while pressing.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
73.	Press coat. (cont'd) d. Block the armholes on a pressing buck, shrinking in top sleeves. Sleeves shall not be creased. e. Press the lapels smooth and flat, straightening the edges and working any fullness towards the center of the lapel and removing the fullness by shrinking. f. Press the lapels, uniformly creasing on the lapel breakline from the gorge seam to approximately 3 inches above the top buttonhole. Then roll press the lapel to the front edge of the coat. g. Press the collar on a collar machine, creasing on the breakline and shaping to obtain the proper contour while pressing. h. Press bottom edge of coat smooth and flat, exercising care that the lining is not exposed below the bottom edge. i. Press the sides, working the fullness towards the back. j. Press the back smooth and flat, removing all fullness. k. Insert a sleeve pad in the sleeves in order to prevent creasing, and press sleeves smooth and flat. l. Remove all wrinkles and impressions from under the lapels, collar and shoulder straps. m. Press pleats in upper front lining, center back lining and left vent lining smooth and flat. n. Press lining throughout with a heated pressing iron, removing all wrinkles and creases.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
74.	Mark for buttons.					
	a. Mark the location for sewing four 40-line insignia buttons to the left front of the coat, 1-5/8 inches back from the finished edge, to properly engage buttonholes in the right front.					
	b. Mark the location for sewing one 27-line insignia button to each shoulder to properly engage with the neck end of the buttonhole in the shoulder straps, in order that on the finished coat, the straps shall lie smooth and flat without twisting or bulging.					
75.	Sew on buttons.					
	a. The buttons shall be securely sewn to the coat with the ends of the stitching securely tacked. See 3.3.14 for type of button required for each class of coat.					
	b. Sew one 27-line insignia button at the mark on each shoulder.	Hand or 301 or 101		4-6 per button (double thread) 14-16	24/4	
	c. Sew one 40-line insignia button at each of the marks on the left front through all plies.	Hand or 301 or 101		4-6 per button (double thread) 14-16	24/4	
	d. The insignia buttons on the front shall be sewn with the eagle upright. The shoulder buttons shall be sewn with the head of the eagle towards the edge of the collar.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II. Finished measurement 1/

Size	1/2 Bust (Short, Regular, Long)	2/ Back Length 3/			Sleeve Length 4/		
		Short	Regular	Long	Short	Regular	Long
	inches	inches	inches	inches	inches	inches	inches
4	16-3/4	23-7/8	25-1/8		16-3/4	17-3/4	
6	17-1/4	24-1/8	25-3/8	26-5/8	16-3/4	17-3/4	18-3/4
8	17-3/4	24-3/8	25-5/8	26-7/8	16-3/4	17-3/4	18-3/4
10	18-1/4	24-1/2	25-3/4	27	16-3/4	17-3/4	18-3/4
12	19	24-3/4	26	27-1/4	16-3/4	17-3/4	18-3/4
14	19-3/4	25	26-3/16	27-3/8	16-3/4	17-3/4	18-3/4
16	20-1/2	25-1/8	26-3/8	27-5/8	16-3/4	17-3/4	18-3/4
18	21-1/2	25-3/8	26-5/8	27-7/8	16-3/4	17-3/4	18-3/4
20	22-1/2	25-1/2	26-3/4	28	16-3/4	17-3/4	18-3/4
22	23-1/2		27	28-1/4		17-3/4	18-3/4

1/ Tolerance on all measurements: ± 3/8 inch. Tolerance is on 1/2 bust measurement.

2/ Bust measurement taken with coat buttoned from folded edge to folded edge in line with pit of armhole.

3/ Back length measurement taken along center back seam from lower edge of the undercollar to bottom edge of coat.

4/ Sleeve length measurement taken along forearm seam from the armhole seam line to bottom edge of sleeve.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the applicable point value or defect limit.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.1.2 Certificate of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5).

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be in accordance with the test conditions specified in MIL-STD-1608.

4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standard to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table III for characteristics noted.

Table III - Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. deter. per sample Unit	Results Reported as
Cotton warp, hair wool filling cloth	Colorfastness to:				
	Wet (dry) cleaning	3.3.5	5622		
	Perspiration	3.3.5	5680		
	Steam pressing	3.3.5	5640		

4.5.1.1 Sampling. Sampling of components shall be as follows. The lot size for these sampling tests shall be as specified in MIL-STD-1608. If one or more sample units fail to meet any test requirements listed below, the lot represented shall not be acceptable.

Components	Lot size expressed as	Sample unit for testing
Cotton warp, hair wool filling cloth	yards	1/2 yard

Source: https://assist.dla.mil - Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

4.5.2 Examination of the end item. Prior to the formation of a lot and as a final step in the contractors production control plan, each coat shall be buttoned on a model form and examined for those defects identified by an as terisk (*) and listed as selected defects in MIL-STD-1608. Any coat containing a selected defect shall not be included in the end item lot.

4.5.3 Finished measurement examination. The provisions for the finished measurement examination of the finished coat shall be as specified in MIL-STD-1608 and as outlined in 3.7.

4.5.4 Examination of packaging. Shipping containers that are fully prepared for delivery except for closure shall be subjected to the examination of preparation for delivery described in MIL-STD-1608. The occurrence of defects during this examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1608.

4.5.5 Examination of palletization. An examination shall be made to determine that the palletization complies with Section 5 requirements. Defects shall be scored in accordance with the list below. The sample unit shall be one palletized unit load fully prepared for delivery. The lot size size shall be the number of palletized unit loads in the end item inspection lot. The inspection level shall be S-1 and acceptable quality level (AQL) shall be 6.5 defects per hundred units (DHU's).

Examine	Defect
Finished dimension	Length, width or height exceeds specified maximum requirement.
Palletization	Not as specified.
	Container pattern not as specified.
	Interlocking of loads not as specified.
	Load not bonded with required straps as specified.
Weight	Exceeds maximum load limits.
Marking	Omitted; incorrect; illegible; of improper size, location, sequence or method of application.

5. PACKAGING

5.1 Preservation-packaging. Preservation and packaging shall be level A or hanger pack (see 6.2).

5.1.1 Level A. Each coat shall be laid down and a bending or nonbending paperboard shoulder form conforming to Figure 4 shall be inserted into the coat so as to fit snugly into the collar and shoulders. The buttonhole front shall overlap the button front. The sleeves shall be positioned full length on the front of coat without fullness or wrinkles in the sleeve. The coat shall then be folded in half by bringing the collar portion down even with the bottom edge so that the folded coat measures not more than 23 by 15 inches.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

5.1.2 Hanger pack. Coats shall be hung with left front lapped over right front, unbuttoned, on a molded 14 inch hanger and preserved as specified in the appendix of MIL-C-44192.

5.2 Packing. Packing shall be level A, B, commercial or hanger pack as specified (see 6.2).

5.2.1 Level A. Fifteen coats of one size only, packaged as specified in 5.1.1 shall be packed in a fiberboard shipping container assembled, closed and reinforced conforming to type SF, class weather resistant, grade V2s, size 3A of MIL-B-17757. The fiberboard used for fabricating the box liner shall conform to type CF, class weather-resistant, variety DW, grade V15c of MIL-B-17757. The folded coats shall be stacked flat, collars alternated, ten in depth within a shipping container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper.

5.2.2 Level B

5.2.2.1 Method 1. Fifteen coats of one size only, folded as specified in 5.1.1, shall be packed in a fiberboard shipping container conforming to type CF, variety SW, class domestic, size 3A of MIL-B-17757. The fiberboard used for fabricating the container and the liner shall be grade 275. The folded coats shall be stacked flat, collars alternated, ten in depth, within a shipping container. Each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis weight kraft paper conforming to grade B of A-A-203. Each shipping container shall be assembled, closed, and reinforced as specified in the appendix to the box specification.

5.2.2.2 Method 2. When specified (see 6.2), six level B shipping containers (60 coats of one size only) shall be overpacked in a fiberboard shipping container conforming to type SF, class water resistant, grade V2S, size 4, of MIL-B-17757 reinforced as specified in appendix to the box specification.

5.2.3 Commercial. Coats packaged as specified in 5.1.2, shall be packed in a manner to insure carrier acceptance and safe delivery at destination at the lowest transportation rate for such supplies. The quantity per shipping container shall be the same as that normally used by the supplier for retail distribution. Containers shall comply with the US Postal Service Manual, Uniform Freight Classification Rules, or National Motor Freight Classification Rules, as applicable.

5.2.4 Hanger pack. When specified (see 6.2), 12 coats of one size and length only, packaged as specified in 5.1.2 shall be packed in a type I container, using style A or B hanger bars in accordance with MIL-C-44192. The loaded containers shall be marked and palletized in accordance with MIL-C-44192.

5.3 Marking. In addition to any special marking required by the contract, shipping containers shall be marked in accordance with MIL-STD-129. When hanger pack containers are used, the container shall have marked on each side in bold clear lettering not less than two inches high DO NOT DROP and THIS SIDE UP with arrows pointing to the top of the containers.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

5.4 Palletization. When specified (see 6.2), coats packed as specified in 5.2.1 and 5.2.2 shall be palletized on a 4-way entry pallet in accordance with load type 1A of MIL-STD-147. Pallet type shall be type I (4-way entry), type IV or type V in accordance with MIL-STD-147. Pallets shall be fabricated from wood groups I, II, III or IV of MIL-STD-731. Each prepared load shall be bonded with primary and secondary straps in accordance with bonding means C and D or film bonding means F or G. Pallet pattern shall be in accordance with the appendix of MIL-STD-147. Interlocking of loads shall be effected by reversing the pattern of each course. If the container is of a size which does not conform to any of the patterns specified in MIL-STD-147, the pallet used shall be approved by the contracting officer.

5.4.1 Hanger Pack. When specified (see 6.2), coats packed as specified in 5.2.4 shall be palletized in accordance with the appendix of MIL-C-44192 using pallet load pattern number 95, single layer and interlocking is not required.

6. NOTES

(This section contains information of a general of explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coats described herein are intended for wear by women personnel of the U. S. Marine Corps.

6.2 Ordering data.

6.2.1 Acquisition requirements. Acquisition documents should specify the following:

(a) Title, number and date of this specification.
(b) Class, size required (see 1.2).
(c) Whether first article is required (see 3.2).
(d) Level of packaging, preservation and packing required (see 5.1 and (5.2).
(e) When level B, method 2, packing is required (see 5.2.2.2).
(f) When palletization is required (see 5.4).

6.3 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a preproduction sample. The contracting officer should specify the appropriate type of first article and the number of units to be furnished. The contracting officer should include specific instructions in all acquisition documents regarding arrangements for selection, inspection and approval of the first article.

6.4 Samples and shade samples. For information regarding the availability of sample of the coat and of standard shades specified, address inquiry to the procuring activity issuing the Invitation for Bids.

6.5 Figures. Figures 1, 2 and 3 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the currenversion before use.

6.6 Subject term (key word) listing.
Female
Jacket

6.7 Changes from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

Preparing Activity
Navy - MC

Project No. 8410-N761

Source: https://assist.dla.mil Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

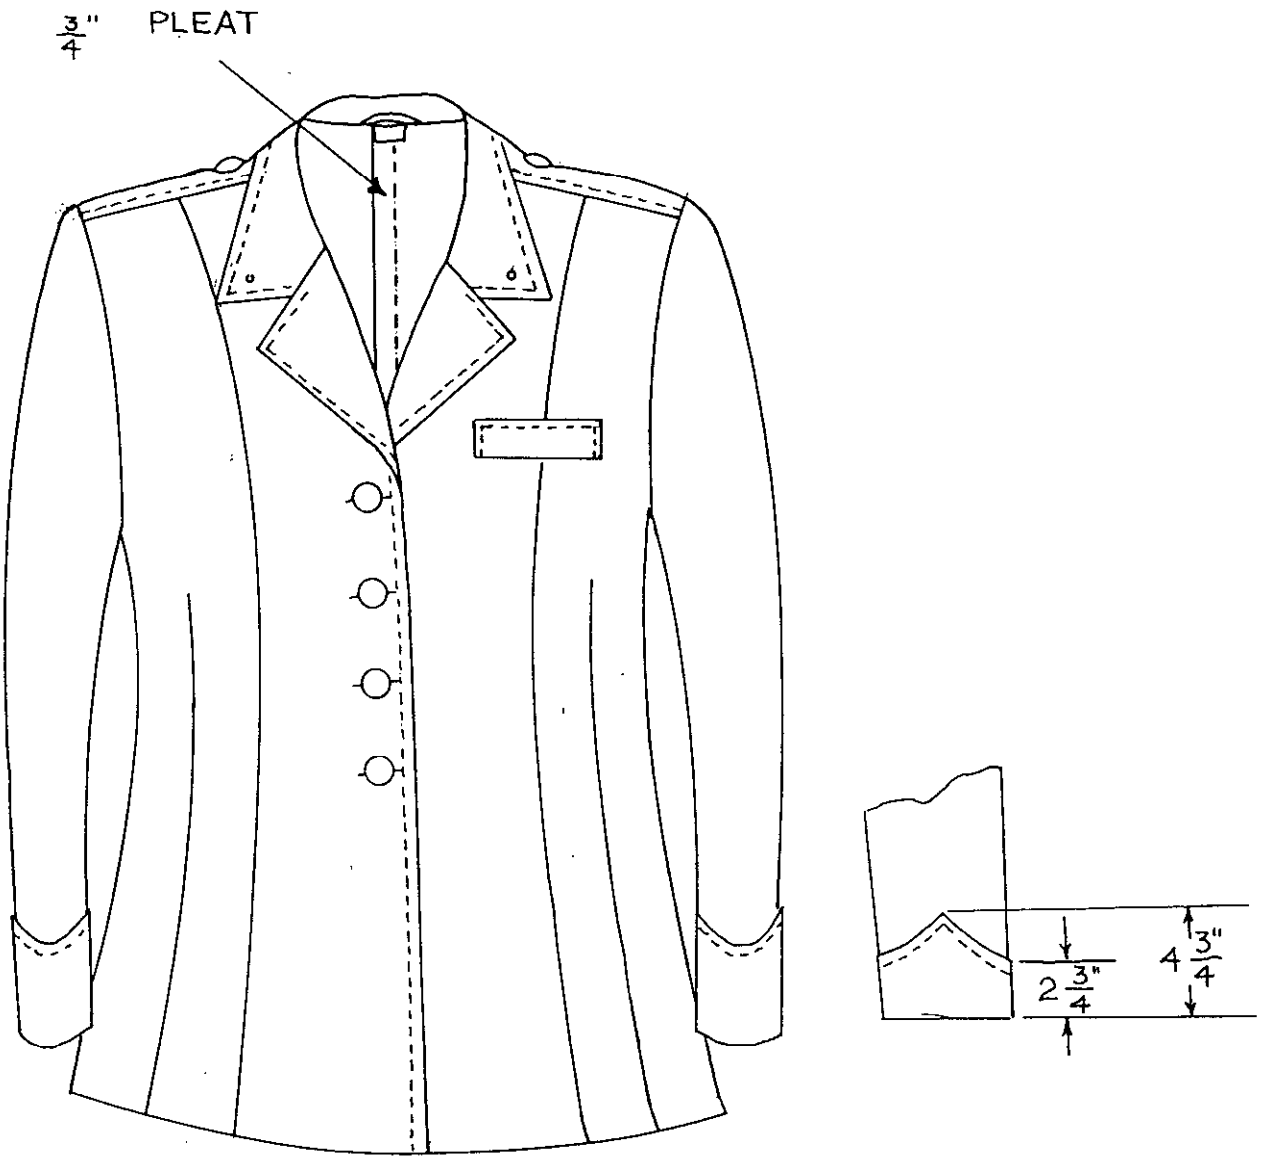


FIG 1: COAT, WOMEN'S

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

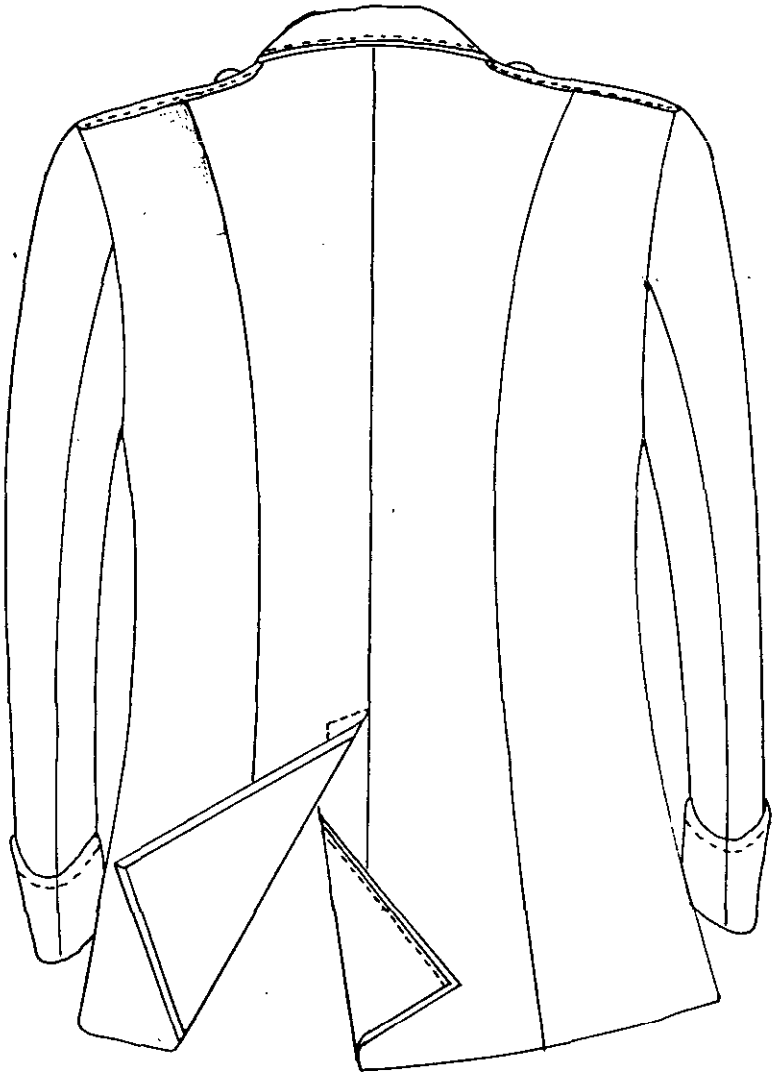


FIG.2 COATS WOMEN'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.


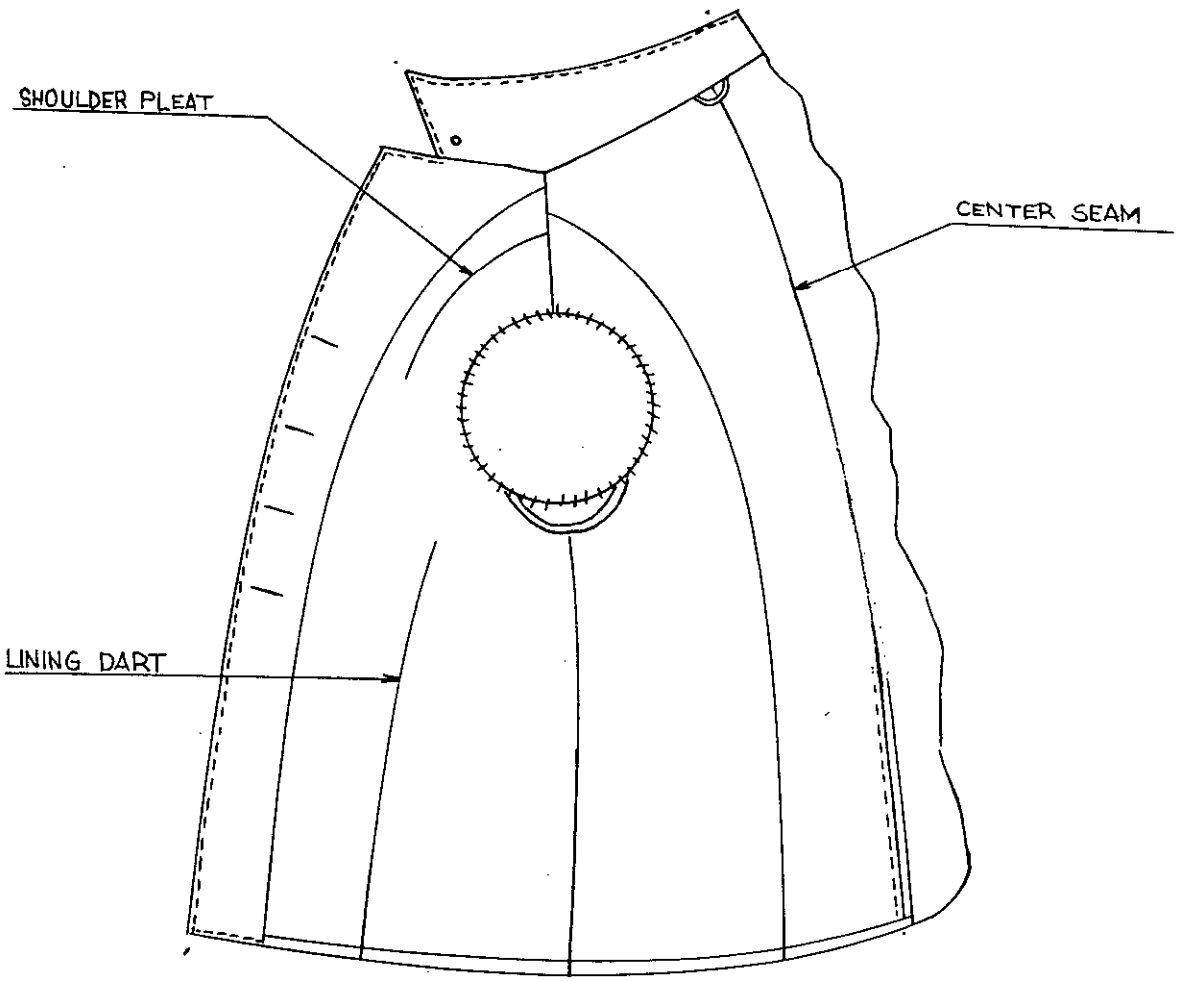


FIG. 3: COAT, WOMAN'S

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

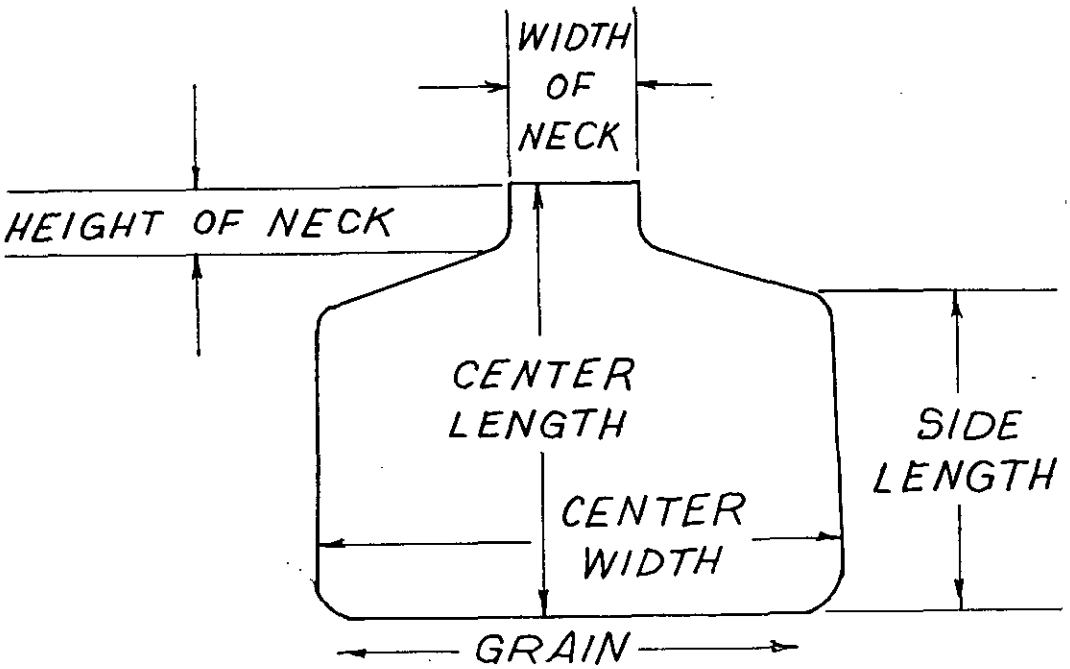

LEGEND

CENTER LENGTH	14-½ INCHES
CENTER WIDTH FOR SIZES:	
6 - 10	15 INCHES
12 - 16	18 INCHES
18 - 22	21 INCHES
SIDE LENGTH	10-½ INCHES
HEIGHT OF NECK	1-½ INCHES
WIDTH OF NECK	3-½ INCHES
PAPERBOARD	0.040 INCH THICK

NOTE: ALL MEASUREMENTS ARE APPROXIMATE

FIG. 4 - SHOULDER FORM

Source: https://assist.dla.mil -- Downloaded: 20261O-20T23:05Z
Check the source to verify that this is the current version before use.