INCH POUND

MIL-C-29427B(MC)
21 November 1994
SUPERSEDING
MIL-C-29427A(MC)
9 October 1990

MILITARY SPECIFICATION

COATS, WOMEN'S

This specification is approved for use by U.S. Marine Corps, Department of the Navy, and is available for use by all departments and agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for women's coats.

1.2 Classification. The coats shall be of one type and class in the following sizes as specified (see 6.2):

Class 1 - Polyester/Wool Gabardine, Green 2212

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Defense Personnel Support Center, Clothing and Textiles Directorate, Attn: DPSC-FQSD, 2800 South 20th Street, Philadelphia, PA 19145-5099, by using the Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

Schedule of sizes

Short	Regular	Long
XO	XO	XO
2	2	2
4	4	4
6	6	6
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18

2. APPLICABLE DOCUMENTS

2.1 Government documents

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation (see 6.2).

SPECIFICATIONS

FEDERAL

A-A-203	-	Paper, Kraft, Untreated
A-A-50067	-	Cloth, Flannel, Wool, Undercollar Cloth
A-A-50186	-	Cloth, Buckram, Woven and Nonwoven
A-A-50196	-	Thread, Silk
A-A-50198	-	Thread, Gimp, Cotton, Buttonhole
A-A-50199	-	Thread, Polyester Core, Cotton- or Polyester-Covered
A-A-52094	-	Thread, Cotton
A-A-52106	-	Cloth, Twill or Plain Weave, Polyester, or Polyester Blend
V-T-295	-	Thread, Nylon
DDD-L-20	-	Label; For Clothing, Equipage, and Tentage (General Use)
DDD-T-86	-	Tape, Textile, Cotton, General Purpose (Unbleached, Bleached, or Dyed)

MILITARY

MIL-C-297	-	Cloth, Interlining, Cotton Warp, and Spun Hair-Wool Filling

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

MIL-C-368	-	Cloth, Satin, Rayon and CLoth, Twill, Rayon
MIL-B-371	-	Braid, Textile, Tubular
MIL-C-10176	-	Cloth, Gabardine; Wool, Polyester/Wool
MIL-P-15064	-	Pad, Shoulder and Sleeve-Head
MIL-C-15065	-	Coat, Fronts
MIL-B-17757	-	Box, Shipping, Fiberboard (Modular Sizes)
MIL-B-20289	-	Button, Insignia, Plastic
MIL-C-29137	-	Cloth, Felt Fabric, Composite Undercollar
MIL-C-44192	-	Container, Shipping and Storage, Coat (Hanger Pack)
MIL-C-44296	-	Cloth, Fusibles

STANDARDS

FEDERAL

FED-STD-191	-	Textile Test Methods
FED-STD-751	-	Stitches, Seams, and Stitchings

MILITARY

MIL-STD-129	-	Marking for Shipment and Storage
MIL-STD-147	-	Palletized Unit Load
MIL-STD-1608	-	Provisions for Evaluating Quality of Coats, Women's, Dress
MIL-STD-731	-	Quality of Wood Members for Containers and Pallets
MIL-STD-984	-	Provisions for Size Labeling of Women's Uniform Clothing

(Unless otherwise indicated, copies of Federal and military specifications, standards and handbooks are available from the Standardization Documents Order Desk, Bldg. 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094.)

2.1.2 Other Government documents. The following other Government document forms a part of this specification to the extent specified herein. Unless otherwise specified, the issues are those cited in the solicitation.

Federal Acquisition Regulation (FAR 52.209)

(Copies of the manual may be obtained from the Superintendent of Documents, US Government Printing Office, Washington, DC 20402-0001.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

2.2 Non-Government publications. The following document(s) form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted shall be those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation (see 6.2).

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense Standard Shades For Sewing Threads

Department of Defense Standard Shades For Buttons

(Applications for copies should be addressed to the Color Association of the United States, 409 W. 44th St., New York, NY 10016-0927).

AMERICAN SOCIETY FOR TESTING AND MATERIALS

ASTM D 3951 - Standard Practice for Commmercial Packaging

(Applications for copies should be addressed to the American Society for Testing and Materials, 1916 Race Street, Philadelphia, PA 19103-1187.)

(Non-Government standards and other publications are normally available from the organizations that prepare or distribute the documents. These documents also may be available in or through libraries or other informational services.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Standard samples. Standard samples, when furnished, are solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.4 and 6.4).

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

3.3 Materials

3.3.1 Basic material. The basic material shall be as follows:

Class 1. Cloth, polyester/wool gabardine, 10.6 ounce, green shade 2212, conforming to type II, class 12 of MIL-C-10176 (see 6.3).

3.3.2 Lining. The material for lining the coats shall be as follows:

Class 1. Cloth, rayon, twill, 3.7 ounce, green shade 2209, conforming to class 1 of MIL-C-368.

3.3.3 Bias binding. The binding for the underarm shield shall be bias cut from the lining material specified in 3.3.2. The binding shall be cut 5/8 to 7/8 inch wide, and shall have sized edges.

3.3.4 Undercollar material. The undercollar material shall be cloth, wool flannel conforming to A-A-50067. The material shall be dyed a shade to approximate the shade of the basic material specified in 3.3.1. The material shall show good colorfastness to wet (dry) cleaning. The acidity (pH) requirement and colorfastness to perspiration and crocking requirements shall not apply. As an alternate, a composite undercollar fabric conforming to MIL-C-29137 may be used in a shade to approximate the shade of the basic material specified in 3.3.1.

3.3.5 Collar interlining material. The collar interlining material for all classes shall be cloth, cotton buckram, natural, conforming to type I, of A-A-50186, except that the test for shrinkage shall be in accordance with Method 5580 of FED-STD-191.

3.3.6 Polyester twill. The material for the stays for the simulated breast pocket, armhole seam, and shoulder seam shall be polyester twill cloth, shade black, conforming to class 1 of A-A-52106, except that the seam efficiency and colorfastness requirements for perspiration and crocking shall not apply. The cloth shall be bias cut for shoulder and armhole stays.

3.3.7 Tape. The cotton tape shall conform to type III, class 1 of DDD-T-86, 1/4 inch wide for reinforcing the folded edge of the simulated pocket welt and armholes for all classes of coats, and 3/8 inch wide for the front edge of all classes of coats.

3.3.8 Coat fronts. The coat fronts shall be as follows:

Class 1. Type XV, of MIL-C-15065, except that the cotton and polyester stays shall be dyed black.

3.3.9 Shoulder pads. The shoulder pads shall conform to type III, class 1 of MIL-P-15064.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

3.3.10 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.11 Fusible interlinings

3.3.11.1 Fusible interlining for small parts. The fusible interlining for the collar and full front facing, shoulder straps, and top welt shall be nonwoven cloth, conforming to type V, class 1, style B of MIL-C-44296. The color shall be black or charcoal. The fusible shall be Pellon Style 8313, Handler 7208, or equal. The fusing conditions shall be as directed by the supplier or temperature 280° to 290°F, 140° to 145°CE, time 12 to 15 seconds, pressure 4 to 6 psi.

3.3.11.2 Fusible coat fronts. The coat front may be fused using a twill weave woven fusible conforming to type III, class 1 style B of MIL-C-44296, or 100 percent cotton warp, 75 to 90 percent rayon, 10 to 25 percent wool, with a weight of 3.5 (minimum) to 4.0 ounces (maximum), and a color of polyamide dot color black or charcoal. The fusible shall be Kufner Style G35, National Style 200FL, Crown Style 241, or equal. The fusing conditions shall be as directed by the supplier or 300° to 310°F, 140° to 145° CE, time 12 to 15 seconds, pressure 4 to 6 psi.

3.3.12 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid, 1/8 to 3/16 inch wide, with a breaking strength of not less than 50 pounds in the warp direction, and shall conform to type IX, class 1 of MIL-B-371. The color for class 1 shall closely match shade T-1, Cable No. 66023.

3.3.13 Thread

3.3.13.1 Silk thread. The silk thread shall conform to A-A-50196. The thread for machine sewing shall conform to type I, size A for all outside seaming and stitching; size B and size F for buttonhole, needle and looper threads, respectively; and size 0 for machine felling. The thread for hand sewing shall be type III, size A, 2-ply.

3.3.13.2 Cotton thread. The cotton thread shall conform to A-A-52094; type III, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching, overedge stitching, and for belt and belt fastener buttonholes; type II, glazed finish, ticket No. 24, 4-ply for sewing on buttons; and type I, ticket No. 20, 3-ply for machine tacking armholes. The thread for basting shall be of good commercial grade. As an alternate for cotton thread, a polyester-cotton-covered thread conforming to A-A-50199, ticket No. 50, 2 or 3-ply may be used. The thread for basting shall be good commercial-grade cotton.

3.3.13.3 Nylon thread. The nylon thread for padding lapels of coats shall conform to type III, size 00 of V-T-295.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

3.3.13.4 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.3.13.5 Color and colorfastness. The thread shall be dyed shade T-1, Cable No. 66023 (see DoD Standard Color Card of Official Standardized Shades for Sewing Threads). The cotton thread for basting and for machine tacking armholes may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good colorfastness to wet (dry) cleaning. In addition, the silk thread shall show good colorfastness to light.

3.3.14 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be shade T-1, Cable No. 66023. The gimp shall show good colorfastness to wet (dry) cleaning.

3.3.15 Buttons

3.3.15.1 Class 1. The insignia buttons shall be plastic, black color, conforming to MIL-B-20289, type I, 40-line and type II, 27-line. As an alternate, metal insignia buttons conforming to MIL-B-3461, type II, style 3, class B, subclass 2 may be used. A dull black epoxy finish in lieu of dull black enamel finish is acceptable with prior approval.

3.3.16 Labels. Each coat shall have an identification label and a size label as specified below. The coats are intended to be dry cleaned and the labels shall show colorfastness to dry cleaning.

3.3.16.1 Identification label. The identification label shall conform to type VI, class 1 of DDD-L-20. The content and format shall be as follows:

Nomenclature (item description)
Contract number
Name of contractor
Fiber content

3.3.16.2 Size label. The size label shall conform to type VI, class 2 of DDD-L-20. The inscription on the size label shall conform to MIL-STD-984, Table II, Body Dimensions for Marine Corps, Table III, Height Ranges, and Figure 2. An examples shall be as follows:

Stock Number:	8410-00-000-0000
Bust Circ:	35"
Hip Circ:	37-1/2"
Height:	63-1/2 to 67-1/2" (R)
	(Size Code 8)

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

3.3.16.3 Label/tag. Each item shall be individually bar-coded with the type VIII, class 17 label/tag of DDD-L-20. This label/tag shall be located so that it is completely visible on the item when it is folded and/or packaged as specified and so that itcauses no damage to the item.

3.4 Design. The coat shall be the US Marine Corps design shown in Figures 1, 2 and 3. It shall be a four-button, single-breasted, semiformfitting, fully-lined coat having a panel-type front, a four-piece back with center vent, simulated breast pocket with outside welt, inside pocket, shoulder straps to button, ornamental sleeve cuffs, rolled collar with worked eyelet in each end for branch of service insignia, and notched lapel.

3.5 Patterns. Standard patterns shall be furnished to the contractor by the Government. The working patterns shall be identical to the Government working patterns. Neither the Government patterns nor the working patterns shall be altered in any way, except that additional notches for using during construction are allowed on the working patterns. The standard patterns shall provide 3/16-inch allowance for seams at the edge of lapels, front edges of coat, and for shoulder straps; 3/4-inch allowance for side seams; 5/8-inch for center back seams; and 3/8-inch allowance for all other seams, except as otherwise specified in Table II. Standard patterns shall show size, seam allowances, and directional lines for cutting. The standard patterns are marked or notched for proper placement and assembly of the component parts.

3.5.1 List of pattern parts. The coats shall be cut from the materials and number of pattern parts specified in Table I.

TABLE I. Pattern parts

Materials	Pattern parts	Cut parts
Polyester/wool gabardine (class 1)	Front	2
	Side front	2
	Center back	2
	Side back	2
	Front facing (right)	1
	Front facing (left)	1
	Top sleeve	2
	Under sleeve	2
	Top collar	1
	Armhole shields	2
	Pocket welt	1
	Shoulder straps	2
	Cuff	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE I. Pattern parts (contd.)

Materials	Pattern parts	Cut parts
Cloth, twill, rayon	Front	2
	Right center back	1
	Left center back	1
	Side back	2
	Top sleeve	2
	Under sleeve	2
Cloth, polyester twill	Breast pocket stay	1
	Inside pocket	2
Cloth, cotton buckram	Undercollar	1 or 2
Cloth, wool flannel	Undercollar	1
Shapers	Undercollar shaper	
	Lapel working shaper	
	Finished collar and lapel	
	Left vent shaper	
Markers	Breast pocket marker	
	Collarstand marker	
	Sleeve cuff marker	
	Right front marker	

3.6 Construction. The coats shall be manufactured in accordance with the operations, and the stitch, seam and stitching types specified in Table II. The contractor is not required to follow the exact sequence of the operation listed in Table II, but all operations specified shall be used to manufacture the coat.

3.6.1 Stitches, seams, and stitching. The stitch, seam, and stitching types specified in Table II shall conform to FED-STD-751. The number of stitches per inch as specified in Table II indicates the minimum and maximum number permitted.

3.6.1.1 Tacking and backstitching. The ends of seams and stitching produced with 301 stitch type, when not caught in other seams or stitching, shall be backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch.

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

3.6.2 Shade marking. The component parts of each coat cut from one piece of basic material and lining material, including pairs of sleeve linings when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Sized parts cut from the ends shall be identified for size. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices

(b) Adhesive-type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets

(c) Sew-on shade tickets

3.7 Figures. The figures are furnished for information purposes only. When inconsistencies exist between the written specification and the figures, the written specification shall govern.

3.8 Manufacturing operations requirements. The coats shall be manufactured in accordance with operation requirements specified in Table II. The contractor is not required to follow the exact sequence of operations provided the finished coat is identical to that produced by following the sequence as listed in Table II . Minor modifications are permitted where necessary when using automatic equipment. These modifications shall not alter the dimensional, serviceability or appearance requirements cited in the specification.

3.8.1 Abbreviations in Table of Operations. The abbreviations used in Table II are as follows:

Stch	-	Stitch
In	-	Inch
Ndl	-	Needle
Bob	-	Bobbin
Lpr	-	Looper
Mchne	-	Machine
Brtck	-	Bartack
Comrcl	-	Commercial
Smlr	-	Similar
Btn	-	Button
Btnhl	-	Buttonhole
Incl	-	Including
Dbl	-	Double

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
1.	Cutting. a. Cut the coats in strict accordance with patterns furnished by the Government. b. Cut all material in the direction indicated by the directional lines on the pattern. The directional lines shall be placed in the warp direction of the cloth unless otherwise indicated on the pattern. c. All polyester/wool parts of the coat shall be cut from one piece of basic material, except armhole shields may be cut from the ends. The welt piece for the simulated breast piece shall be cut in accordance with the patterns furnished. When armhole shields are cut from ends, the shields shall match each other. d. The fronts, side backs, and center back lining shall be cut from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the lining in each pair shall match. e. The interlining for the stay of the simulated breast pocket shall be cut in accordance with the patterns furnished.				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
1.	Cutting. (contd.) Cut the polyester twill stays for armhole, back neckline, and shoulder seam on the bias, 3/4 inch wide and 4 to 4-1/2 inches long. f. Cut the cotton warp spun hairwool filling cloth for the undercollar interlining in accordance with the pattern. g. Cut the undercollar from undercollar material in accordance with pattern furnished. h. The right front shall be dressed in the front opening only (see Oper. 38). i. The use of drill holes is prohibited.				
2.	Replacement of damaged parts. a. Replace, at any time of cutting, any parts of the coat containing holes or serious weakening defects such as smashes, multiple floats, loose weakening slubs, etc., expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc. b. Replace any parts damaged during the manufacturing process by needle chews which may develop into a hole, scissor or knife cuts, tears, holes, mends or burns in the material.				

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
3.	Shade marking. a. Mark or ticket (see 3.6.2) all component parts cut from one piece of basic material, and the two parts of the undercollar to insure uniform shade and size throughout the coat. All lining parts shall be marked, bundled or ticketed to insure uniform shade and size throughout the garment. b. The use of tickets with any metal fastening devices or sew-on shade tickets is prohibited on the rayon lining.				
4.	Make shoulder straps. Finished appearance. The shoulder strap shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, or puckers. The buttonhole shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button and the stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonhole and the purling of the buttonhole shall be on the outside of the strap. The shoulder strap may be fused. a. The shoulder straps shall be made of two plys of basic material and one ply of interlining.				

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
4.	Make shoulder straps. (contd.)					
	b. Fold side edges, face-to-face, and seam together with a 1/4-inch seam.	301	SSe-2(a)	10-14	A	A
	c. Press seam open with a heated pressing iron or pressing machine.					
	d. Stitch pointed end of straps with a 1/4 inch seam.	301	SSe-2(b)	10-14	A	A
	e. Trim points and turn the straps.					
	f. Fold the edges in accordance with the notches and topstitch the straps uniformly 1/8 inch from the edge.	301	BSm-2(a)	10-14	A	A (Silk)
	g. Make a horizontal, eyelet end, square bar type, cut first buttonhole, 3/4 inch long, in each strap through all plies midway between the back and front edges with the inside edge of the eyelet placed so that in the finished coat, the edge of the shoulder strap button will be 1/4 to 1/2 inch from the edge of the collar. The purling shall finish on the outside of the strap.	Btn-hl	-------	38 per btn-hl (minimum not incl br-tck)	A	A
	h. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
4.	Make shoulder straps. (contd.)					
	i. Securely bartack the ends of the buttonhole and trim the ends of the thread and gimp.	Brtck	-------	21 per br-tck (mi-ni-mum)	A	A
5.	Make undercollar					
	a. The undercollar assembly shall consist of one piece of undercollar cloth and a single piece of interlining material.					
	b. Pad the interlining to the undercollar with 6 to 7 rows of blindstitching. Press undercollar flat.	103	SSm-1 (each row)	4-6	A	A
	c. Mark and trim undercollar in accordance with the shape of the pattern. Trim the interlining 1/8 inch back from the neck edge of the under-collar and collar ends.					
	d. Mark the breakline of the undercollar with the collar-stand marker.					
	e. Stitch the breakline in accordance with the mark and stitch the undercollar to the interlining 1/2 inch from the outer and end edges.	301 or	SSa-1	10-14	A	A
		401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
6.	Assemble topcollar and undercollar. Finished appearance. The collar shall be uniform in appearance and shall finish smooth and flat without twists, gathers, puckers, pleats or raw edges (outer and sides). The felling shall not be too tight or loose and the collar material shall be securely caught in the stitching. The eyelets shall be well worked with the purling on either side of the collar and shall finish with a 1/8 inch diameter opening.					
	a. Position topcollar between undercollar and interlining with the outer edge abutting the undercollar interlining seam and with the notches aligned. Join topcollar to interlining with a row of stitching 3/16 inch from the lapped edge of the topcollar.	301	LSa-1	6-8	A	A
	b. Join topcollar to undercollar at outer edge with zigzag stitching, properly distributing the fullness between the notches. The zigzag stitching shall extend to the end of the collar.	304	LSa-1	8-10	A	A
	c. Turn the topcollar to the inside, face to face with the undercollar, folding evenly with the top edge of the interlining.	301	SSa-1	8-10	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
6.	Assemble topcollar and undercollar. (contd.)				
	Stitch the ends of the undercollar to the top collar with a 1/8 inch seam. Trim the ends and the corner of the seam. Trim the ends and the corner of the seam and turn assembly, forcing out the collar points.				
	d. Baste the top edge and ends, forcing out the points of the outer corners of collar and baste along the breakline with the fullness placed between the two rows of basting stitches.	101 or Hopper			
	e. Press the collar smooth and flat with a basted pressing machine. Edges and corners shall be smooth, flat and uniformly even.				
	f. Trim the neck edge of the topcollar to provide for proper seaming to the coat, and cut a guide notch in the lower edge of the topcollar at the center.				
	g. Make one eyelet at each end of the collar 1 inch from the end and outer edge, respectively, The eyelet finish shall be well worked, and shall finish with a 1/8-inch opening.	Eyelet	-------	20 per eyelet minimum	A A (Silk) 0 0 (Silk)

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
7.	Stitch point of cuff.					
	a. Fold the cuff lengthwise at the point, with wrong side out, and stitch the point 1/8 inch from the raw edges.	301	OSf-1	10-14	A	A
	b. Turn cuff, completely working out the point.					
	c. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern. Press smooth and flat with a heated pressing iron or pressing machine, creasing the edge; or the upper edge may be basted instead of pressed.	101 or Hand				
8.	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats, and shall start and finish evenly.					
	a. Position the top and under sleeve with notches matching and join at the forearm with a 3/8-inch seam.	301 or	SSa-1	12-16	A	A
		401	SSa-1	12-16	A	A
	b. Spread open the seam and press flat, holding seam short, with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
9.	Join cuff to sleeve. Finished appearance. The upper curved edge of cuffs shall be uniformly stitched to the sleeves.				
	a. Mark the sleeve in accordance with the sleeve cuff marker for positioning the cuffs, with notch on the cuff pattern marker matching the forearm seam line and the lower edge of pattern in line with the bottom raw edge of sleeve.				
	b. Position the cuff at the mark and seam to the body of the sleeve 1/8 inch from the upper edge. Trim the ends of the cuff even with the backarm edge of the top and undersleeve, if necessary.	301	LSd-1	12-16	A A (Silk) or 0 0 (Silk)
10.	Seam sleeves at backarm. Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats, and shall start and finish evenly.				
	a. Position the top and undersleeve together at the backarm and stitch with a 3/8-inch seam.	301 or	SSa-1	12-16	A A
		401	SSa-1	12-16	A A
	b. Spread open the backarm and cuff seams and press flat with a heated pressing iron.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
11.	Tack cuff to sleeve. Finished appearance. The bottom edge of the cuff shall finish smooth and flat without pleats, puckers, or bulges. a. Turn the cuff outlet to the inside against the bottom end of the sleeves, in accordance with the notches, and baste along the turned edge of the cuff. b. Tack the raw edge of the cuff to the body of the sleeve with blindstitching. The blindstitches shall not be exposed on the outside of the sleeve cuff. c. On the finished coat, the height of the cuff, when measured from folded bottom edge of cuff, shall be 2-3/4 ± 1/4 inches at the forearm and backarm seams, and 4-3/4 ± 1/4 inches at the point.	103	SSM-1	4-6	A --
12.	Seam sleeve lining. Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched, and shall finish smooth and flat without twists, gathers, puckers, or pleats. The seams shall start and finish evenly.				

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
12.	Seam sleeve lining. (contd.)					
	a. Position the top and undersleeve lining in accordance with the notches on the pattern and join the forearm and backarm, respectively, with a 3/8-inch seam.	301 or	SSa-1	10-14	A	A
		401	SSbd-1	10-14	A	A
	As an alternate, when using a sleeve lining felling machine, join backarm seam and forearm seam of sleeve lining. The distance between the notches on the forearm seam shall be left open.	301 or	SSa-1	10-14	50	50
		401	SSa-1	10-14	50	50
	Position the sleeve lining top notches to the top of forearm seam and top of the backarm sleeve hem. Tack the forearm seam and backarm seam of the sleeve lining to the forearm and backarm seam, respectively. The backarm seam tacking shall extend from approximately the midpoint of the backarm seam to not more than 6 inches above creased bottom edge. The forearm seam tacking shall be for a distance of 1-1/2 to 2 inches below the bottom left open forearm seam notch.	Hand or	--------	2-3	--	--
		301	SSa-1	4-8	50	50
13.	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve lining shall be positioned and seamed, or tacked, to sleeve without twists, gathers, puckers, or pleats.					

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
13.	Assemble sleeve and sleeve lining. (contd.)				
	a. Position the undersleeve lining on the undersleeve with the top notch in the backarm of undersleeve lining aligned with top edge of undersleeve and the upper edge of the sleeve lining extending 3/4 to 1 inch beyond the armhole edge of the sleeve.				
	b. Seam or tack by hand the forearm and backarm sleeve lining seam allowance to the top sleeve backarm and forearm seam allowance, respectively, properly distributing the fullness in the lining. The stitching shall extend from approximately 5 inches above the finished bottom edge of the sleeve, up to approximately midway to the armhole edge of the underarm and backarm seam.	301	SSa-1	4-5	A A Comrcl
	c. Turn sleeve lining over the sleeve.				
14.	Fell turnup of sleeve lining; press sleeves.				
	Finished appearance. The sleeve linings shall not be short, tight, or twisted.				
	a. Turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 inches from the finished bottom edge of sleeve, and baste to turnup of sleeve.	101 or Hand			

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
14.	Fell turnup of sleeve lining press sleeves. (contd.)					
	b. Fell the folded edge of sleeve lining to turnup of sleeve with blindstitching.	314 or	SSm-1	6-8	0	0
	c. Turn sleeves right side out and assemble in pairs. Insert a sleeve pad in the sleeve to avoid creasing the front and back edge. Press smooth and flat with a heated pressing machine.	Hand	-----	8-10	(Silk)	
15.	Make welt.					
	Finished appearance. The welt shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges.					
	a. The welt for the simulated breast pocket shall be made of a single piece of basic material folded in accordance with notches and reinforced at the inside folded edge with 1/4-inch wide cotton tape.					
	b. Position the tape on the underside of the welt piece with one edge even with the bold notches and seam 1/16 inch from the edge of the tape next to the fold line.	301	LSbj-1	10-14	A	A
	c. Fold the welt at the fold notches with the tape on the outside and close the ends with a 1/4 inch seam.	301 or	SSa-1	10-14	A	A
		401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
15.	Make welt. (contd.)					
	d. Turn the welt face side out, working out the edges and corners completely. Edge-stitch welt 1/8 inch from the seamed and folded edges. The welt shall finish with the cotton tape stitched to the inside of the welt.	301	SSe-2(b) sides OSf-1 folded edge	12-16	A	A (Silk) 0 (Silk)
	e. Press the welt smooth and flat with a heated pressing pattern.					
16.	Make armhole shields.					
	Finished appearance. The armhole shields shall be made from one ply of basic material and shall finish without puckers, gathers, or raw edges.					
	a. Bind the rounded edge of shield with bias binding, turning under the outside raw edge of the binding only, and catching the turned under portion in the stitching 1/16 inch from the folded edge.	301 or 401	BSb-1 BSb-1	10-14 10-14	A A	A A
17.	Stitch darts in front lining.					
	Finished appearance. The darts shall be tapered to a point at the upper ends.					
	a. Sew the darts with a 3/8-inch seam, tapering the dart to a point at the upper ends and securely back tack.	301	OSf-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
18.	Make inside pocket. Finished appearance. The pocket shall be uniformly stitched and finished smooth and flat without causing distortion. a. The pocket shall be made of 2 plys of poly/twill material 5 inches wide by 6-1/2 inches long.					
	b. Position both plys of pocketing material face-to-face with notches matching and stitch together from the top notch across the top, back, bottom and up the front to the bottom notch with a 3/8-inch seam leaving a 4-1/2 inch opening for the pocket.	301	SSa-1	10-14	A	A
	c. The notch for placement of inside pocket shall be in line with the third buttonhole from the top. Attach the front pocket openings in accordance with the notches to the right front facing and the right front lining, respectively, with a 3/8-inch seam, leaving a 4-1/2 inch pocket opening.	301	SSa-1	10-14	A	A
	d. Raise-stitch the pocket material onto the facing and lining, respectively, with a 1/16 inch topstitch.	301	SSc-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
19.	Seam front lining to facing and sew on label.					
	Finished appearance. The lining shall be carefully seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defects or distortions.					
	a. Position the lining on the facing with notches matching and seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from the top (shoulder) edge of facing to the bottom notch of facing approximately 1-1/4 inches from the bottom edge.	301 or	SSa-1	10-14	A	A
		401	SSa-1	10-14	A	A
	b. Sew the identification label to the left front lining with a single row of stitching 1/16 inch from each edge of the label. The label shall be positioned horizontally with the lower edge of the label 3 inches above the bottom edge of the finished coat. The ends of the label stitching shall overlap not less than three stitches.	301	SSbj-1	10-14	A	A
20.	Press front lining and waist darts.					
	a. Press the facing joining seams and waist darts smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
20.	Press front lining and waist darts. (contd.)					
	b. The facing-lining joining seam shall be pressed with the raw edge of the seam allowance toward the back. The waist darts shall be pressed with the edge towards the back.					
21.	Join back lining parts.					
	Finished appearance. Back linings shall be carefully joined without pleats, puckers, or gathers. The seam shall start and finish evenly at seam line.					
	a. Position back linings with notches matching and join together at the center with a 3/8-inch seam, stopping at the top of the vent.	301	SSa-1	10-14	A	A
	b. Position left and right side to the respective center back linings, matching notches and join with a 3/8 inch seam.	301	SSa-1	10-14	A	A
22.	Join back and front linings.					
	Finished appearance. The linings shall be carefully joined without pleats, puckers, or gathers. The seam shall start and finish evenly at the seam line.					
	a. Position the back and front linings together and join at the sides with a 3/4-inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	BOB/ LPR
23.	Press lining seams and darts.					
	a. Press the facing-lining joining seams, side and back seams and the waist darts smooth and flat with a heated pressing iron or pressing machine.					
	b. The facing-lining joining seams, side seams, and left and right back seams shall be pressed with the raw edges of the seam allowance toward the back. The lining shall be folded face-to-face along the center back seam and the seam shall be pressed flat.					
24.	Join backs.					
	Finished appearance. The side and center backs shall be joined without gathers, puckers, or pleats. The folded edge of the left vent shall be in vertical line with the center back seam.					
	a. Stitch the 1/4-inch wide stay tape to the inside of the left center back along the vent, with the edge of the tape positioned approximately 1/8 inch in front of the fold notch of the vent.	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
24.	Join backs. (contd.)					
	b. Position the center backs with edges even, and join with a 5/8-inch seam from the top edge of the backs to approximately 3/4 inch below the top end of the vent, and from that point continue to stitch diagonally across the top end of the vent.	301	SSa-1	10-14	A	A
	c. Turn the left vent to the inside of the left center back, in accordance with the notches, and edge stitch uniformly 1/8 inch from the folded edge. The folded edge of the vent shall be in line with the center back seam line.	301	OSf-1	10-14	A	A
	d. Join the left and right side backs to the respective center back with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	e. Seam the 3/4 inch-wide poly/cotton twill stay to the underside of the back neckline 1/8 inch from the outer edge of the neckline.	301	SSaa-1	10-14	A	A
25.	Press back seams.					
	a. The side and center back seams shall be pressed with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
25.	Press back seams. (contd.)				
	b. Notch the top end of the right vent diagonally from the juncture point of the vent and the center back to the lower end of the stitching for the center back seam.				
	c. Spread open the side and center back seams, respectively, and press flat.				
26.	Topstitch top end of vent.				
	Finished appearance. The edge of the right side of the vent shall extend beyond the center seam allowance of the left back part.				
	a. Stitch and backstitch across the top end of the vent through all the plies from the back center seam to the edge of the vent, for a distance of 1 inch.	301	SSa-1	10-14	A A (Silk)
27.	Join front and side front.				
	Finished appearance. Bust lines on both sides shall be alike. Fronts and side fronts shall be carefully joined without puckers or gathers. The seams shall start and finish evenly at the seam line. The contour of the waist and hip line shall be maintained in the seaming.				

Source: https://assist.dla.mil -- Downloaded: 20261O-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
27.	Join front and side front. (contd.)					
	a. Sew the dart with a 3/8-inch seam, tapering to a point at the upper end, and securely back tack.	301	SSa-1	10-14	A	A
	b. Position front and side fronts with notches matching, and join together with 3/8-inch seams.	301 or	SSa-1	10-14	A	A
		401	SSa-1	10-14	A	A
	c. Spread open the front seam and waist darts and press flat with a heated pressing iron, maintaining contour.					
	d. Tape gorge line on the underside with a 1/4-inch tape from shoulder to 1/4 inch below the top of the lapel.	301	SSaa-1	10-14	A	A
28.	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The polyester and cotton twill reinforcement stays shall be sewn to the armhole and shoulder edges of the front without gathers, puckers, or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
28.	Seam reinforcement stay to armhole and shoulder. (contd.)					
	a. Seam the 3/4-inch wide polyester and cotton twill stays to the underside of the fronts along the shoulder edge and upper fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges.	301	SSaa-1	10-14	A	A
29.	Assemble simulated breast pocket welt on left front.					
	Finished appearance. The simulated breast pocket shall be smooth and flat with the ends of the welt uniformly stitched and with no puckering. In the finished garment, the breast pocket welt shall be horizontal with the bottom edge of the coat.					
	a. Mark the left front in accordance with the breast pocket marker for position of breast pocket welt. Mark the welt seam line on the underside 1 inch from the folded edge for proper seaming to the front.					
	b. Position the polyester and cotton twill stay piece for the pocket on the underside of the front. Position the welt on the outside of the left front, with marks on the welt and front matching, and the folded edge of the welt towards the bottom edge of the coat.	301	LSbj-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
29.	Assemble simulated breast pocket welt on left front. (contd.) Seam top ply of welt to the front at the mark through the stay piece. c. Turn the welt with the folded edge of the welt towards the top of the front. Topstitch both ends of the welt to the front, 1/8 inch from the seamed edges of the welt. The line of stitching shall extend from the lower seamed line of the welt up to the folded edge of the welt. The welt shall be blind-stitched to the body of the coat, and the stitching shall not be visible on the outside of the welt. d. On the outside of the finished coat, the welt for the simulated pocket shall measure 1 ± 1/16 inch in height, and the width for each size coat, measured along the top edge of the welt, shall be as follows: Coat size — Width of Welt (inches) X0 through 10 — 3-1/2 12 through 18 — 4	301	SSe-2(b)	10-14	A A (Silk)

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
30.	Join fronts and back at sides.					
	Finished appearance. The fronts and side backs shall be joined together without puckers or pleats. The seams shall start and finish evenly at seam line. The contour of the waist and hip line shall be maintained in the seaming.					
	a. Position side fronts to the side backs at the sides and join with 3/4 inch seams.	301 or	SSa-1	10-14	A	A
		401	SSa-1	10-14	A	A
31.	Press side seams.					
	a. Spread open the side seams and press flat with a heated pressing iron.					
32.	Tape armholes.					
	a. Sew the 1/4-inch wide stay tape to the inside at the lower edge of the armhole, starting from approximately 1 inch above the notch in the fronts and continuing to the side seam. Cut the tape and continue stitching tape along bottom and back edge to lower notch holding tape taut. Continue to stitch tape to back armhole to 1-1/4 inches from the shoulder.	301 or	SSaa-1	10-14	A	A
		401	SSaa-1	10-14	A	A
	b. From the lower back notch, continue stitching the tape, holding the tape taut along the back edge of the armhole to 3/4 inch from the shoulder.	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
32.	Tape armholes. (contd.)				
	c. Press armhole tapes and shoulder blade smooth and flat with a heated pressing iron.				
33.	Interline fronts.				
	a. Position the left and right fronts on the respective coat front interlining and baste along the front seams, properly distributing the fullness over the breast area. The basting shall extend from approximately 3 inches from the shoulder edge of fronts to approximately 1-1/2 inches from the bottom edge.	101 Hopper			
	b. Baste the left front along the welt-joining seam line on the outside, with the front and interlining lying smooth and flat.	101 Hopper			
	c. Tack the front and back ends of the simulated pocket stay to the coat front interlining. The tacking shall be as close as possible to the corners of the pocket.	101 Hopper or Hand			
	d. Baste horizontally along the shoulder, allowing room for setting shoulder pads and working the fullness on the front towards the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue basting along the front edge below the breakline to approximately 1-1/2 inches from the bottom edge of front.	101 Hopper			

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
33.	Interline fronts. (contd.)					
	e. Baste along the breakline of lapel, starting at the gorge, and continue basting along the front edge below the breakline to approximately 1-1/2 inches from the bottom edge of the front.	101 Hop-per				
	f. Baste along the top and front edge of lapel down to the lower end of the lapel.	101 Hop-per				
34.	Baste bridle tape to lapel.					
	a. Position the 3/8-inch wide bridle tape on the interlining side of the fronts along the breakline of the lapel, with the front edge of the tape in line with the notch in the gorge.					
	b. Baste tape through the interlining and the front of coat along the breakline of the lapel evenly and smoothly, holding the tape taut and properly distributing the fullness. The tape shall extend from the gorge notch to approximately 1-1/2 inches from the lower edge of the lapel.	101 or Hand	-----	6-8	--	--

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
35.	Pad lapels.					
	a. Pad the lapels with seven to eight rows of blindstitching, from approximately 3/4 inch from the front edge to the breakline, properly distributing the fullness of the interlining between the rows of stitching to roll the lapels.	103	SSm-7	4-8	A	--
		or	or		or	
			SSm-8		00	--
		314	SSm-7	4-8	A	A
			or		or	
			SSm-8		00	00
	b. Blindstitch both edges of the bridle tape to the interlining.	103	SSm-2	4-8	A	--
		or			or	
					00	
		314	SSm-2	4-8	A	A
					or	
					00	00
36.	Press chest and lapels.					
	a. Roll press the lapels, shrinking to eliminate the fullness from the interlining, on a suitable type heated pressing machine.					
	b. Press the fronts individually on a suitable type heated pressing machine to conform to the shape of the body to eliminate excess fullness in the breast.					
37.	Shape fronts.					
	a. Mark and shape the front edge of the coat. Mark and shape the lapels in accordance with the shaper furnished.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
37.	Shape fronts. (contd.)					
	b. Mark the coat 1-1/4 inches from the bottom edge for the bottom turnup.					
	c. Trim the coat front interlining 1/4 inch back from the front edge of the fronts and top edge of the lapel. Trim bottom of interlining to approximately 1/4 inch above the mark for the bottom turnup.					
	NOTE: In-process inspection of this operation shall take place at this point before going to the next operation.					
38.	Baste facing-lining assemblies to front.					
	a. Position the facing-lining assembly on outside of respective fronts and baste along the breakline, distributing the fullness in the breast area and continue to baste along the front and bottom edge. Baste front along top and front edges of lapel down to the lower end of the lapel, working the fullness towards the center of the lapel.	101 Hopper				
39.	Join facings and fronts with tape.					
	a. Join the facings and fronts together 3/16 inch from the top and front edges of lapel and front edges of the	301	SSab-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
39.	Join the facings and fronts with tape. (contd.) the coat, with the stay tape, 3/8 inch wide for all classes positioned on the interlining side of the fronts. The edge of the tape shall be 1/8 inch from the front edges and caught in the stitching. Continue stitching along the lower edge of the coat 3/16 inch above the front cutout with the tape properly positioned and caught in the stitching. b. The tape shall extend from the lapel notch to 1-1/2 to 2 inches from the side seams at the bottom of the coat, except that the tape is not required along the step of the left front. The tape shall be sewn with normal tension along the top and front edges of the lapel and with slight tension along front and bottom edges of coat. c. Alternate. When fusible front construction is used, position tape 1/8 to 3/16 inch from the edge of the coat and stitch 1/16 to 1/8 inch from edge of tape, across the top of the lapel, down the front and across bottom to back of facing. Press edge seam flat toward the front; pull basting thread.	301	SSab-1	4-6	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
40.	Fell tape to interlining.					
	a. Fell the back edge of the stay tape to the coat front interlining from the collar notch on top of the lapel to the end of the tape at the bottom edge.	103	SSm-1	4-6	A	A
	b. Press the fronts and tape at the top and front edges of lapel, and front and bottom edges of the coat, smooth and flat with a heated pressing iron or pressing machine.					
	c. Remove all basting stitches. Trim lower front corner and corner of lapels. Notch lapel for proper turning.					
	d. Spread open the front facing seam from lapel notch to the bottom edge of the coat and press smooth and flat with a heated pressing iron.					
41.	Baste fronts and bottom edge of coat.					
	a. Turn the facing-lining assemblies to the inside of the fronts, working the corners of the lapels out completely. Turn up to the bottom of the coat, lapping the back edge of facing on the ends of the bottom turnup and working the front corners out completely.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
41.	Baste fronts and bottom edge of coat. (contd.)					
	b. Baste along the top and front edges of the lapel, including the step of the left front and finished bottom edges of the coat.	101 or Hand	-----	4-6	--	--
			-----	4-6	--	--
42.	Baste facing (second time).					
	a. Baste facing to the front approximately 1-1/4 inches from the top and front edges of the lapel and front and bottom edges of the coat, holding the lower corners of the coat in such a manner as to cause the lower front edge of the front to roll inward.	101 or Hand				
	b. Baste along the breakline of the lapel, properly placing the fullness to allow the lapel to roll.	101 or Hand				
	c. Baste the lapel diagonally from the corners to the breakline, properly placing the fullness to allow the lapel to roll.	101 or Hand				
	d. Baste the facings to the front as close to the facing-lining seam as possible, placing the proper fullness over the breast area. The basting shall extend approximately 1-1/2 inches from the bottom edge of the coat to approximately 3 inches from the shoulder edges of facings.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
43.	Tack facings at the back edge to interlining.					
	a. Raise the lining and tack the seam allowance at the back edge of the facings to the coat front interlining with blindstitching, starting approximately 2 inches from the bottom edge of the coat and tacking to approximately 2-1/2 inches from the shoulder edge of the interlining. Tacking shall be through seam allowance of facing and linings.	103 or	SSa-1	4-6	A	--
		314 or	SSm-1	4-6	A	A
		Hand	-----	4-6	C (Silk)	--
44.	Blindstitch bottom turnup.					
	a. Blindstitch the bottom turnup.	103 or	EF1-1	4-6	0 (Silk)	--
		306 or	-----	4-6	0 (Silk)	0
		Hand	-----	4-6	0 (Silk)	--
45.	Join lining to vent.					
	a. Position the right and left back lining on the respective right and left vent opening, face to face, with the notch of the lining even with the top of the vent and joining each side, respectively, with a 3/8-inch seam to 3/4 inch above bottom turnup.	301	SSe-2(a)	10-14	A	A
	b. The left vent corner shall be finished with a mitre corner (Do not cut the corner).	Hand or	-----	4-6	0 (Silk)	--
		Mchne	-----	4-6	0 (Silk)	--

Source: https://assist.dla.mil -- Downloaded: 20261O-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
45.	Join lining to vent. (contd.)				
	Alternate. The left vent corner may be piped for a distance of 1-1/2 to 2 inches and turned up 1-1/4 inches at the hem and stitched by hand or machine.	103	EF1-1	4-6	0 -- (Silk)
	c. Edgestitch the right vent with a 1/8 inch seam from the folded edge of vent ensuring the lining is not exposed on the outside.	301	SSe-2(a)	10-14	A A (Silk)
46.	Baste body lining to coat.				
	a. Fold the front lining at the shoulder in accordance with notches, forming a chest pleat. Continue to baste from the lower edge of the armhole along the side seam and across the bottom edge of lining. The folded edge of the chest pleat on the outside of the lining shall be toward the armhole.	101 or Hand			
	b. Left side of coat. From side seam of lining at waist, baste across back lining to center vent. Fold lining up from bottom and continue basting lining approximately 1/2 inch from bottom edge of coat.	101 or Hand			
	c. Right side of coat. From side seam of lining at waist, baste across back lining to top of vent. Fold lining up from bottom and continue basting lining approximately 1/2 inch from bottom edge of coat.	101 or Hand			

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the currenversion before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
46.	Baste body lining to coat. (contd.)				
	d. Baste center pleat from top of vent with a zero pleat, tapering up to the matched notches at the neckline, adding fullness to approximately 2 inches from the neck. The folded edge of the pleat on the outside of the lining shall be toward the left side.	101 or Hand			
	e. Baste the back lining along the lower edge of the armhole, approximately 2 inches from the edge, and continue up and across the shoulders and neckline down to the other armhole. Leave ample room with basting to permit insertion of the shoulder pads.	101 or Hand			
47.	Fell bottoms.				
	a. Fell the lining turnup to the bottom turnup.	Hand or Mchne			
48.	Trim front lining and interlining.				
	a. Trim the excess coat front interlining at the armhole.				
	-or-				
	When the shoulder lining seams are joined by machine, trim excess coat front interlining and front and back lining at shoulders to allow insertion of shoulder pads.				

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
48.	Trim front lining and interlining. (contd.)					
	b. Trim the lining even with the back at the neck.					
49.	Baste shoulder pads.					
	a. Insert shoulder pad between interlining and chest padding of coat front interlining, in line with the armhole edge, and securely tack the pad to the interlining and chest padding only.	101 or Hand				
	b. When type XIII or type XV of MIL-C-15065 is used, place shoulder pad on under side of interlining in line with armhole and securely tack on interlining only.	101 or Hand	-----	4-6	--	--
50.	Seam shoulders.					
	Finished appearance. The shoulders shall be evenly joined with the front and back seam lines matching, working in the proper fullness on the backs in order that the shoulder may be properly shaped.					
	a. Join fronts and backs together at the shoulder with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	b. Spread open the shoulder seam and press flat with a heated pressing iron or pressing machine over a suitable block, holding the shoulder short.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
50.	Seam shoulders. (contd.) Care shall be exercised in pressing the shoulder seam in order that the shoulders shall not have a distorted appearance in the finished coat.					
51.	Baste lining at shoulders and neckline. a. Position shoulder interlining at neck. Baste upper part of each shoulder on the outside and turn the coat on the inside. Turn under and lap the shoulder edge of the lining on the front lining. Baste lining to coat along the folded edge with top end of chest pleat caught in the basting at the shoulders. Baste the lining to the back at the neck, from shoulder seam to shoulder seam.	Hand or 101 Hopper				
52.	Stitch hanger and label to coat. a. Stitch the ends of the hanger and upper edge of the size label to the neck of the coat at the inside center back. b. The hanger opening, in the finished coat, shall be 1-1/2 ± 1/8 inches long when measured along the neck edge of the collar.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
53.	Set collar. Finished appearance. The seam joining top collar to facing at the gorge shall be of uniform gage and shall finish smooth and flat without twists, puckers, pleats, or other distortions. a. Mark the coat on the outside around the neck from shoulder seam to shoulder seam, 5/8 inch from the top edge, and continue to mark along the gorge with the line of marking tapering to 3/8 inch at the lapel notch.					
	b. Join the top collar to the facing at the gorge, from the collar notch to a point not less than 1 inch in back of the lapel breakline.	301	SSa-1	12-16	A	A
	c. Clip the facing at the back end of joining seam.					
54.	Tack top collar to fronts at gorge. a. Spread open the seam joining top collar to facing and tack the seam allowance of the top collar to the front at the gorge, from the collar notch to the back end of the seam, catching the top end of the bridle tape in the tacking.	Hand or 301	----- SSa-1	2-4 12-16	C A	-- (Silk) A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
55.	Baste undercollar to coat. Finished appearance. Fullness in the collar along the neck edge shall be properly placed over the shoulders so that the collar will not be tight along the outer edge over the shoulders. a. Turn the collar to the outside with the lower edge of the undercollar lapped on the outside of the coat at the mark.				
	b. Securely tack the corners of the undercollar across the juncture point of the collar and the lapel.	Hand	-----	8-10	C -- (Silk)
	c. Baste the undercollar to the fronts and backs, placing proper fullness over shoulder.	Hand			
	d. In the finished coat, the ends of the collar shall be 1-3/8 ± 1/8 inches for all sizes when measured from the juncture of the collar and lapel to the finished edge.				
56.	Tack coat to collar interlining.				
	a. Raise the lower (neck) edge of the top collar and tack the neck edge of coat to the undercollar interlining with overcast stitches, or blindstitching by machine, catching the back lining in the tacking from shoulder seam to shoulder seam.	Hand or 102	----- SSm-1	2-3 3-4	C -- (Silk) A --

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
57.	Baste top collar to coat.					
	a. Turn under the lower edge of the top collar and baste from gorge seam to gorge seam.	Hand or 101	-----	4-6	--	--
	-or-					
	b. In lieu of operations 56.a and 57.a, join lower edge of top collar from gorge seam to gorge seam.	301	SSa-1	10-14	A	A
58.	Fell collar to coat.					
	a. Fell the neck edge of the undercollar to the fronts and backs from collar notch to collar notch.	Hand or	-----	8-12	C	-- (Silk)
		Mchne (hand type fell-ing) or	LSa-1	8-12	C	-- (Silk)
		306	LSa-1	8-12	0	0 (Silk)
	b. Fell the folded edge of the top collar to the coat from gorge seam to gorge seam, catching the top edge of the size label and the ends of the coat hanger in the stitching.	Hand	-----	8-10	C	-- (Silk)
59.	Edgestitch coat.					
	a. Edgestitch the coat 1/8 inch from the front edges of the coat, the front and top edges of the lapels, the edges of the collar and the left edge of center back vent.	301	SSe-2 (Front edges of coat front and top edge of lapels)	10-14	A	A
			SSb-1 (shows finished seam for collar)			

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
60.	Set shoulder straps. Finished appearance. The shoulder straps shall be uniform in length and setting. In the finished coat, the straps shall be 2-1/4 ± 1/8 inches wide at the armhole seam and shall taper to 1-1/2 inches ± 1/8 inches at the buttonhole eyelet end. a. Position the shoulder straps with the pointed end of the strap even with the edge of the neck and with the raw edge in line with the armhole and the back finished edge of the strap 1/2 inch behind and in line with the shoulder seam. Correct position of the button shall be in alignment with shoulder strap buttonhole and when buttoned, there shall be no distortion of strap or shoulder.					
	b. Stitch the shoulder straps to the coat 3/16 to 1/4 inch from the armhole edge. Trim the shoulder straps even with the armhole where necessary.	301 or	SSa-1	10-14	A	A
		401	SSa-1	10-14	A	A
61.	Set sleeves. Finished appearance. The sleeves shall be properly and carefully set and shall be uniformly stitched without twists, gathers, pleats, puckers, or raw edges.					

Source: https://assist.dla.mil -- Downloaded: 20261O-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
61.	Set sleeves. (contd.)					
	a. Position the outside of the sleeves on the outside of the coat with notches matching and with the sleeve lining turned back from the armhole edge.					
	b. Join the sleeves to the coat with a 3/8-inch seam, evenly distributing the fullness between notches and catching the end of the shoulder strap in the stitching.	301 or 401	SSa-1 SSa-1	10-14 10-14	A A	A A
	c. Press the armhole smooth and flat with heated pressing iron to remove the fullness. Care shall be exercised in pressing the armhole seam in order not the stretch the armhole.					
62.	Baste armhole.					
	a. Baste around inside armhole, positioning yoke lining, shoulder pad, and front lining in place and distributing fullness evenly. Turn the coat on the outside.	101 or Hand				
	b. Baste around the outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend the entire circumference of the armhole.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the currentversion before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
63.	Baste underarm shield to coat.				
	a. Position the underarm shield on the lining side of the coat at the base of the armhole, and baste the shield to the coat along the armhole and outer (convex) edges.	101 or Hand			
64.	Tack armhole and stitch sleeve head pads.				
	a. Position the sleeve head pad on the sleeve, with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam and with the front end of the pad matching the notch in the fronts.				
	b. Stitch the sleeve had pad from end to end to the sleeve through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings, shields at the base of armhole and shoulder pad in the stitching. Continue stitching the lining around the remainder of the armhole. Trim away the excess material.	Hand	-----	4 per tack (minimum)	C -- (Silk)
65.	Tack underarm shields to lining.				
	a. Tack bottom edge of underarm shields on the underside to lining. As an alternate, the underarm shield may be joined to the lining by superimposing the seam on the seam joining the binding to the shield.	Hand	-----	4 per (minimum)	C -- (Silk)

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
65.	Tack underarm shields to lining. (contd.)				
	b. In the finished coat, the shields shall measure not less than 2 inches in length from the folded edge of the sleeve lining.				
66.	Join back lining and facing-lining assembly at shoulders.				
	a. Fell the back lining and facing-lining assembly together at the shoulders, securing the top end of the shoulder pleat in the felling. The felling shall be placed over the folded edge of the back lining.	Hand	-----	8-10	C -- (Silk)
	-or-				
	Join the back lining and facing lining assembly at the shoulders, securing the top of the shoulder pleat in the seam.	301 or	SSa-1	10-14	A A
		401	SSa-1	10-12	A A
67.	Fell sleeve lining at armhole.				
	a. Position the sleeve lining at the armhole, with the back and forearm seam of the sleeve and sleeve lining matching.				
	b. Turn under to top raw edge of the sleeve lining and lap 1/4 to 3/8 inch onto the armhole seam allowance over the front and back lining and underarm shield.	Hand	-----	8-10	C -- (Silk)

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
67.	Fell sleeve lining at armhole. (contd.) Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of the sleeve lining and distributing the fullness in accordance with good commercial practice. Back stitch 1/8 inch from the felled edge of sleeve lining along the lower armhole from approximately 1-1/2 inches above the forearm seam line in sleeve lining to the side seam line in the body lining.				
	-or-				
	c. Machine stitch lower edge of sleeve lining, at the armhole on the inside, from forearm seam to backarm seam and hand fell the remaining portion as specified in operation 67.b.	301	SSa-1	12-16	A A
	d. Machine stitch lower edge of sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and stitch remaining portion of the sleeve lining at the armhole with machine simulated hand felling. A Strobel or Durkoff sleeve felling machine is authorized.	Mchne (simulated)	-----	8-10	C -- (Silk)

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL	THREAD BOB/ LPR
67.	Fell sleeve lining at armhole. (contd.)					
	As an alternate, the armhole lining may be felled utilizing a sleeve lining machine that consists of a feed off the arm machine equipped with a lower and upper feed (review specification requirements for felling of sleeve lining in relation to appropriate turn under).					
	(1) Stitch sleeve lining to armhole on inside from front sleeve notch to backarm seam across undersleeve.	301	SSa-1	10-14	50	50
	(2) Stitch the top sleeve lining to armhole on inside from the front armhole notch to top back arm lining seam across the crown of the top sleeve lining.	306	SSa-1	10-14	50 or cotton-covered polyester 70 or nylon A	50 A
	(3) Close the previous left opened forearm seam 1/16 to 3/32 inch from edge.	301	SSc-1	10-14	50	50
	NOTE: The simulated hand felling produced by machine shall be equal to or better than hand felling.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
68.	Make buttonholes. Finished appearance. The buttonholes shall be cut-first type, clean cut, well made and well worked over gimp to fit a 40-line insignia button. The stitching of the buttonholes shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the front. The purling of the buttonholes shall be on the outside. a. Mark the right front in accordance with the marks on the pattern for the locations of four buttonholes. The buttonholes shall be evenly spaced.				
	b. Make one horizontal eyelet end, square-bar type buttonhole, 1-1/8 inches long at each of the ends. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of the coat.	Btnhl	-----	50 per btn (minimum) not incl bartack	B F (Silk)
	c. Securely bartack the ends of each buttonhole, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Brtck	-----	21 per brtck	A A (Silk)

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
69.	Clean coat. a. Pull and remove all basting thread. Trim all ends of stitching and remove all loose ends of thread from the coat. Remove all spots, stains, and shade tickets and markings without injury to the material.				
70.	Press coat. a. The coat shall be well pressed throughout with a heated iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. b. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine with shoulder straps properly positioned over shoulder seam and pressed flat. c. Press the armholes solid from the inside, creasing the sleeve lining at the edge of the armhole seam allowance in the front, back and armpit of the lower armhole. The armpit and the back of the armhole shall be held short while pressing. d. Block the armholes on a pressing buck, shrinking in top sleeves. Sleeves shall not be creased.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
70.	Press coat. (contd.) e. Press the lapels smooth and flat, straightening the edges and working any fullness towards the center of the lapel and removing the fullness by shrinking. f. Press the lapels, uniformly creasing on the lapel breakline from the gorge seam to approximately 3 inches above the top buttonhole. Then roll press the lapel to the front edge of the coat. g. Press the collar on a collar machine, creasing on the breakline and shaping to obtain the proper contour while pressing. h. Press bottom edge of coat smooth and flat, exercising care that the lining is not exposed below the bottom edge. i. Press the sides, working the fullness towards the back. j. Press the back smooth and flat, removing all fullness. k. Insert a sleeve pad in the sleeves in order to prevent creasing, and press sleeves smooth and flat. l. Remove all wrinkles and impressions from under the lapels, collar, and shoulder straps.				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
70.	Press coat. (contd.) m. Press pleats in upper front lining, center back lining, center back lining and left vent lining smooth and flat. n. Press lining throughout with a heated pressing iron, removing all wrinkles and creases.				
71.	Mark for buttons. a. Mark the location for sewing four 40-line insignia buttons to the left front of the coat, 1-5/8 inches back from the finished edge, to properly engage buttonholes in the right front. b. Mark the location for sewing one 27-line insignia button to each shoulder to properly engage with the neck end of the buttonhole in the shoulder straps, in order that on the finished coat, the straps shall lie smooth and flat without twisting or bulging.				
72.	Sew on buttons. a. The buttons shall be securely sewn to the coat with the ends of the stitching securely tacked.				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

TABLE II. CONSTRUCTION OF COAT (contd.)

NO.	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH IN	THREAD NDL BOB/ LPR
72.	Sew on buttons. (contd.)				
	b. Sew one 27-line insignia button at the mark on each shoulder.	Hand or 301	-----	4-6 per btn (dbl thr-ead)	24/4
		or			
		101	-----	14-16	
	c. Sew one 40-line insignia button at each of the marks on the left front through all plies.	Hand	-----	4-6 per btn (dbl thr-ead)	24/4
		or			
		101	-----	14-16	
	d. The insignia buttons on the front shall be sewn with the eagle upright. The shoulder buttons shall be sewn with the head of the eagle towards the edge of the collar.				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

3.9 Finished measurements. The finished coat shall conform to the measurements shown in Table III.

TABLE III. Finished measurement 1/

Size	1/2 Bust (Short, Regular, and Long) 2/	Back Length 3/			Sleeve Length 4/		
		Short	Regular	Long	Short	Regular	Long
	inches	inches	inches	inches	inches	inches	inches
XO	16-3/4	23-7/8	25-1/8	26-3/8	16-3/4	17-3/4	18-3/4
2	17-1/4	24-1/8	25-3/8	26-5/8	16-3/4	17-3/4	18-3/4
4	17-3/4	24-3/8	25-5/8	26-7/8	16-3/4	17-3/4	18-3/4
6	18-1/4	24-1/2	25-3/4	27	16-3/4	17-3/4	18-3/4
8	19	24-3/4	26	27-1/4	16-3/4	17-3/4	18-3/4
10	19-3/4	25	26-3/16	27-3/8	16-3/4	17-3/4	18-3/4
12	20-1/2	25-1/8	26-3/8	27-5/8	16-3/4	17-3/4	18-3/4
14	21-1/2	25-3/8	26-5/8	27-7/8	16-3/4	17-3/4	18-3/4
16	22-1/2	25-1/2	26-3/4	28	16-3/4	17-3/4	18-3/4
18	23-1/2	25-3/4	27	28-1/4	16-3/4	17-3/4	18-3/4

1/ Tolerance on measurements shall be as noted below. Tolerance is on 1/2 bust measurement.

2/ Bust measurement shall be taken with coat buttoned from folded edge to folded edge in line with pit of armhole. Tolerance is ± 3/8 inch.

3/ Back length measurement shall be taken along center back seam from lower edge of the undercollar to bottom edge of coat. Tolerance is -3/8, + 5/8 inch.

4/ Sleeve length measurement shall be taken along forearm seam from the armhole seam line to the bottom edge of sleeve. Tolerance is ± 3/8 inch.

3.10 Workmanship. The finished coat shall conform to the quality of product established by this document. The occurrence of defects shall not exceed the contractor's own quality assurance standards and the quality assurance standards defined by the technical data in the bid package.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements (examinations and tests) as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements; however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.1.2 Certificate of compliance. Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4)
2. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be in accordance with the test conditions specified in MIL-STD-1608.

4.4 First article inspection. The first article, submitted in accordance with 3.2, shall be inspected for compliance with design, construction, workmanship and dimensional requirements.

4.5 Quality conformance inspection. Sampling for inspection shall be performed in accordance with MIL-STD-105, except where otherwise indicated.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

4.5.1 Component and material inspection. In accordance with 4.1, components and materials shall be tested in accordance with all the requirements of referenced specifications, drawings, and standards unless otherwise excluded, amended, modified, or qualified in this specification or applicable procurement documents.

4.5.2 Examination of the end item. Examination of the end item shall be in accordance with 4.5.2.1 and 4.5.2.2.

4.5.2.1 Examination of packaging requirements. An examination shall be made to determine that packaging, packing, and marking comply with Section 5 requirements of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully prepared for delivery. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be on the number of shipping containers in the end item inspection lot.

Examine	Defect
Marking (exterior and interior)	Omitted, incorrect, illegible, of improper size, location, sequence, or method of application
Materials	Any component missing, damaged, or not as specified
Workmanship	Inadequate, application of components, such as: incomplete closure of container flaps, loose strapping, improper taping, inadequate stapling bulged or distorted container
Content	Number of items per shipping container is more or less than required. Size shown on one or more items not as specified on shipping container. 1/

1/ For this defect, one item from each shipping container in sample shall be examined.

4.5.2.2 Palletization examination. An examination shall be made to determine that palletization complies with the section 5 requirements. Defects shall be scored in accordance with the list below. The sample unit shall be one palletized unit load fully packaged. The lot size shall be the number of palletized unit loads in the end item inspected lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

Examine	Defect
Finished dimensions	Length, width, or height exceeds specified maximum requirements.
Palletization	Pallet pattern not as specified. Interlocking of loads not as specified. Load not bonded with required straps as specified
Weight	Exceeds maximum load limits.
Marking	Omitted, incorrect, illegible, of improper size, location, sequence, or method of application

5. PACKAGING

5.1 Preservation. Preservation shall be level A, Commercial, or hanger pack, as specified (see 6.2).

5.1.1 Level A. Each coat shall be laid down, and a bending or non-bending paperboard shoulder form conforming to Figure 4 shall be inserted into the coat so as to fit snugly into the collar and shoulders. The buttonhole front shall overlap the button front. The sleeves shall be positioned full length on the front of the coat without fullness or wrinkles in the sleeve. The coat shall then be folded in half by bringing the collar portion down even with the bottom edge so that the folded coat measures nor more than 23 inches by 15 inches.

5.1.2 Commercial. Coats shall be preserved in accordance with ASTM D 3951.

5.1.3 Hanger pack. Coats shall be hung with left front lapped over right front, unbuttoned, on an appropriate size hanger and preserved as specified in the appendix of MIL-C-44192.

5.2 Packing. Packing shall be level A, B, or Commercial, or hanger packs, as specified (see 6.2).

5.2.1 Level A. Fifteen coats of one size only, packaged as specified in 5.1.1,shall be packed in a fiberboard shipping container assembled, closed and reinforced conforming to type SF, class weather-resistant, grade V2s, size 3A of MIL-B-17757. The fiberboard used for fabricating the box liner shall conform to type CF, class weather-resistant, variety DW, grade V15c of MIL-B-17757. The folded coats shall be stacked flat, collars alternated, ten in depth within a shipping container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

5.2.2 Level B. Fifteen coats of one size only, folded as specified in 5.1.1, shall be packed in a fiberboard shipping container conforming to type CF, variety SW, class domestic, size 3A of MIL-B-17757. The fiberboard used for fabricating the container and the liner shall be grade 275. The folded coats shall be stacked flat, collars alternated, ten in depth, within a shipping container. Each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis weight kraft paper conforming to grade B of A-A-203. Each shipping container shall be assembled, closed, and reinforced as specified in the appendix of the box specification.

5.2.3 Commercial. Coats preserved as specified in 5.1.2 shall be packed in accordance with ASTM D 2951.

5.2.4 Hanger pack. When specified (see 6.2), 12 coats of one size and length only, packaged as specified in 5.1.2 shall be packed in a type I container, using style A or B hanger bars in accordance with MIL-C-44192.

5.3 Marking In addition to any special marking required by the contract, shipping containers shall be marked in accordance with MIL-STD-129. When hanger pack containers are used, the container shall have marked on each side in bold clear lettering not less than two inches high "DO NOT DROP" and "THIS SIDE UP" with arrows pointing to the top of the containers.

5.4 Palletization. When specified (see 6.2), coats packed as specified in 5.2.1 and 5.2.2 shall be palletized on a 4-way entry pallet in accordance with load type 1a of MIL-STD-147. Pallets type shall be type I (4-way entry), type IV or type V in accordance with MIL-STD-147. Pallets shall be fabricated from wood groups I, II, III, or IV of MIL-STD-731. Each prepared load shall be bonded with primary and secondary straps in accordance with bonding means C and D, or film bonding means F or G. Pallet pattern shall be in accordance with the appendix of MIL-STD-147. Interlocking of loads shall be effected by reversing the pattern of each course. If the container is of a size which does not conform to any of the patterns specified in MIL-STD-147, the pallet pattern used shall first be approved by the contracting officer.

5.4.1 Hanger pack. When specified (see 6.2), coats packed as specified in 5.2.4 shall be palletized in accordance with the appendix of MIL-C-44192 using pallet load pattern number 95, single layer. Interlocking is not required.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coats are intended for wear by female military personnel of US Marine Corps.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

6.2 Acquisition requirements. Acquisition documents should specify the following:

a. Title, number and date of this specification.
b. Classes and sizes required (see 1.2.1).
c. Issue of DODISS to be cited in the solicitation and, if required, the specific issue of individual documents referenced (see 2.1.1 and 2.2).
d. When first article inspection is required, (see 3.2) the item will be tested and should be a first article sample. The contracting officer should include specific instructions in acquisition documents regarding arrangement for examinations, quantity, and testing and approval.
e. Selection of applicable levels of preservation and packing (see 5.1 and 5.2).
f. When palletization is required (see 5.4).

6.3 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article inspection should be a preproduction sample. The contracting officer should specify the appropriate type of first article and the number of units to be furnished. The contracting officer should include specific instructions in all acquisition documents regarding arrangements for selection, inspection, and approval of the first article.

6.4 Samples and shade samples. For information regarding the availability of sample of the coat and of standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

6.5 Changes from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

6.6 Subject term (key word) listing.

Female
Garment
Jacket
Outerwear

Custodian:


Navy - MC

Preparing Activity:

DLA - CT

Project No. 8410-0851


Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z
Check the source to verify that this is the current version before use.

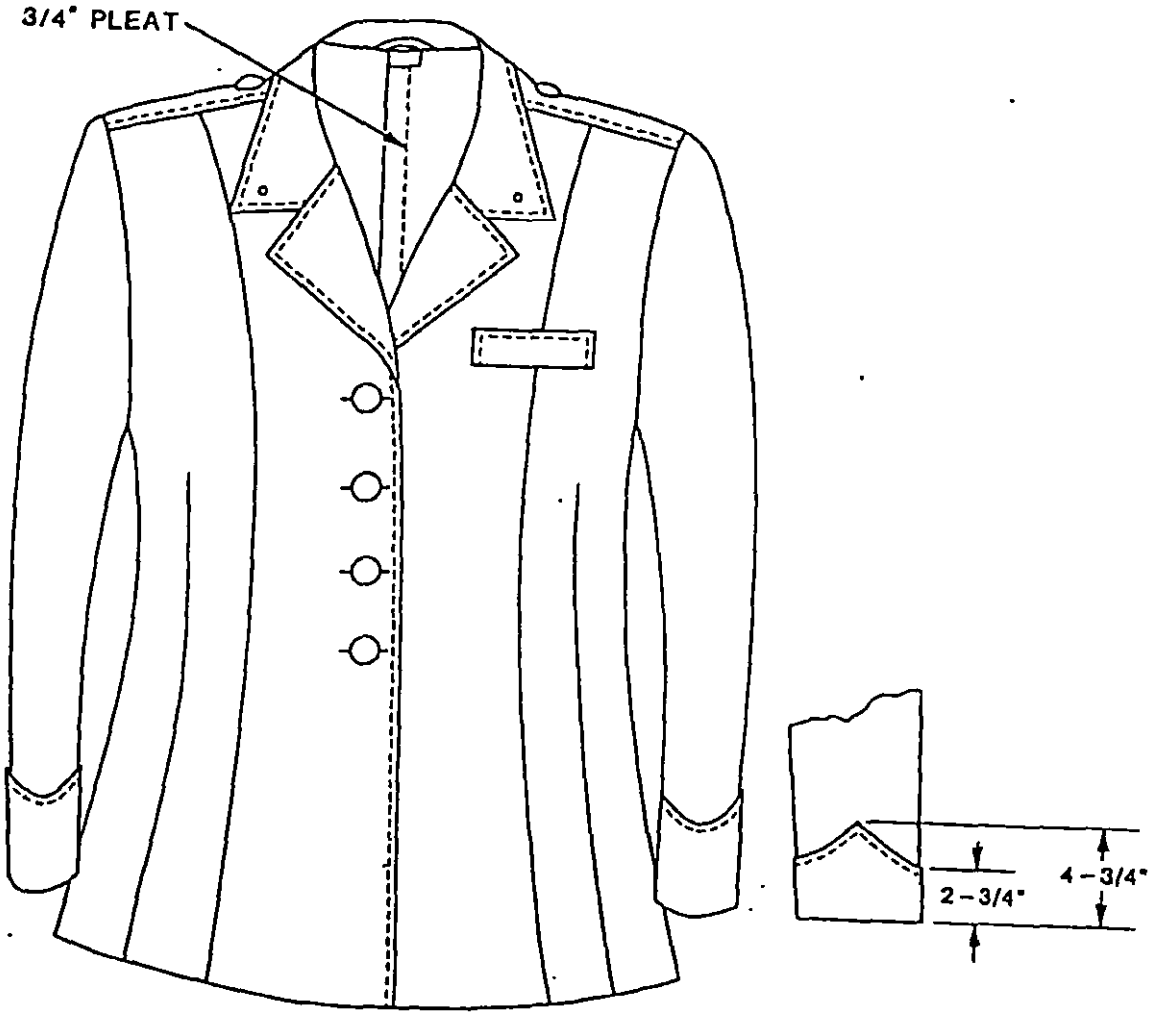

FRONT VIEW

FIGURE 1. COAT, WOMEN'S (FRONT VIEW)

Source: https://assist.dla.mil -- Downloaded: 20260-20T23:05Z
Check the source to verify that this is the current version before use.

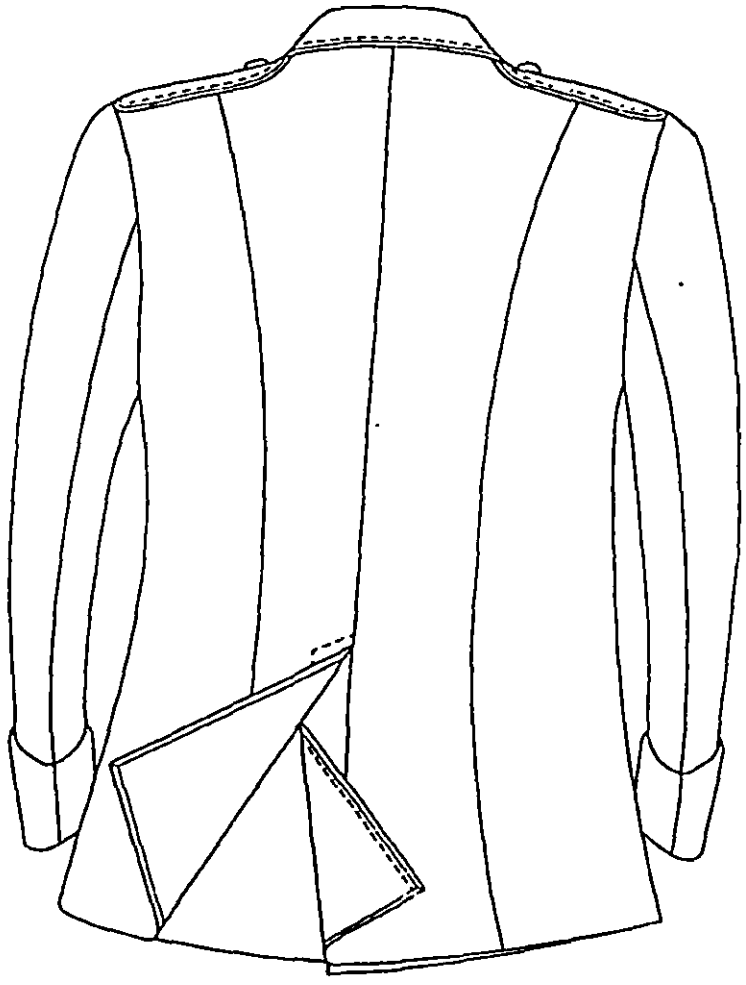

BACK VIEW

FIGURE 2. COAT, WOMEN'S (BACK VIEW)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.


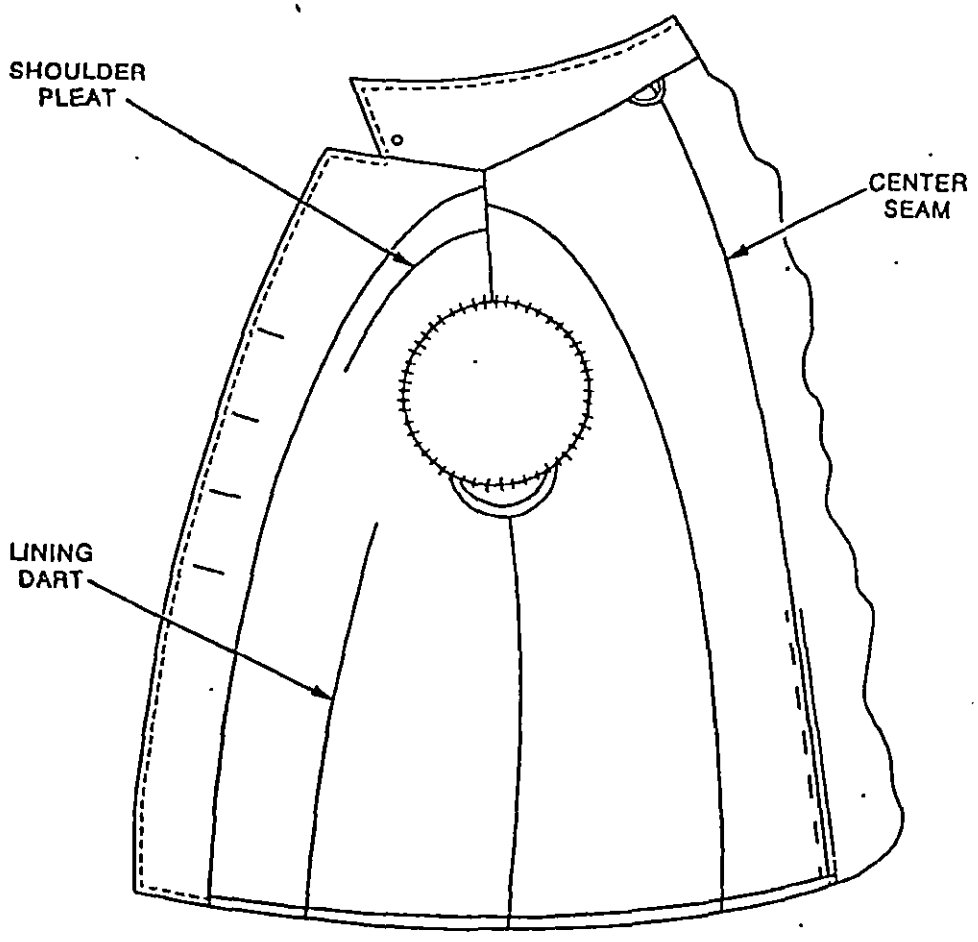


FIGURE 3. COAT, WOMEN'S (INSIDE VIEW)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

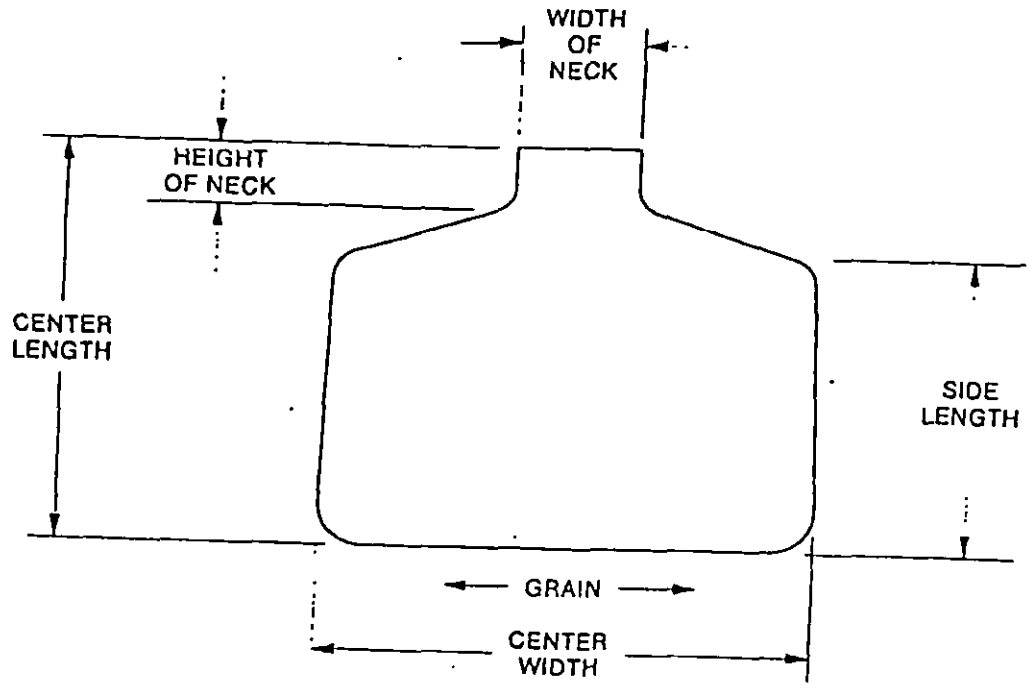

LEGEND

CENTER LENGTH	14 – 1/2 INCHES
CENTER WIDTH FOR SIZES:	
6 – 10	15 INCHES
12 – 16	18 INCHES
18 – 22	21 INCHES
SIDE LENGTH	10 – 1/2 INCHES
HEIGHT OF NECK	1 – 1/2 INCHES
WIDTH OF NECK	3 – 1/2 INCHES
PAPERBOARD	0.040 INCH THICK

NOTE: ALL MEASUREMENTS ARE APPROXIMATE

FIGURE 4. SHOULDER FORM

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:05Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	1. DOCUMENT NUMBER	2. DOCUMENT DATE (YYMMDD)
	MIL-C-29427B(MC)	94-11-21

3. DOCUMENT TITLE
COATS, MEN'S

4. NATURE OF CHANGE (Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a. NAME Defense Personnel Support Center ATTN: DPSC-FQSD (12-3-C)	b. TELEPHONE (Include Area Code) (1) Commercial: 215-737-8105 (2) AUTOVON: 444-8105
c. ADDRESS (Include Zip Code) 2800 South 20th Street Philadelphia, PA 19145-5099	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT: Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340

DD Form 1426, OCT 89 — Previous editions are obsolete. — 198-290

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:05Z-
Check the source to verify that this is the current version before use.