MILITARY SPECIFICATION

# COAT, MAN'S: POLYESTER/WOOL, GREEN (WITH BELT)

This specification is approved for use by U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

## 1. SCOPE

1.1 Scope. This specification covers requirements for green polyester/wool coat with belt.

1.2 Classification. The coat shall be of one type in the following sizes, as specified (see 6.2):

Schedule of Sizes

| Extra Short | Short | Regular | Long | Extra Long |
|---|---|---|---|---|
| 30 | 30 | 30 | 30 | |
| 32 | 32 | 32 | 32 | |
| 33 | 33 | 33 | 33 | |
| 34 | 34 | 34 | 34 | |
| 35 | 35 | 35 | 35 | 35 |
| 36 | 36 | 36 | 36 | 36 |
| 37 | 37 | 37 | 37 | 37 |
| 38 | 38 | 38 | 38 | 38 |
| 39 | 39 | 39 | 39 | 39 |
| 40 | 40 | 40 | 40 | 40 |
| 41 | 41 | 41 | 41 | 41 |
| 42 | 42 | 42 | 42 | 42 |
| | 43 | 43 | 43 | 43 |
| | 44 | 44 | 44 | 44 |
| | 46 | 46 | 46 | 46 |
| | | 48 | 48 | 48 |

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commandant of the Marine Corps, Headquarters, U. S. Marine Corps (LMA-1), Washington, D. C. 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8405

AMSC N/A

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

## 2. APPLICABLE DOCUMENTS

### 2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this specification to the extent specified herein. Unless otherwise specified, the issue of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

| | |
|---|---|
| V-B-871 | -Button, Sewing Hole, and Button, Staple, (Plastic) |
| V-T-276 | -Thread, Cotton |
| V-T-280 | -Thread, Gimp, Cotton, Buttonhole |
| V-T-295 | -Thread, Nylon |
| V-T-301 | -Thread, Silk |
| NN-P-71 | -Pallet, Material Handling, Wood Stringer Construction, 2 Way and 4 Way |
| UU-P-268 | -Paper, Kraft, Wrapping |
| CCC-C-438 | -Cloth, Buckram, Woven and Nonwoven |
| DDD-L-20 | -Label, For Clothing, Equipage, and Tentage (General Use) |
| DDD-T-86 | -Tape, Textile; Cotton, General Purpose (Unbleached, Bleached or Dyed) |

MILITARY

| | |
|---|---|
| MIL-C-368 | -Cloth, Satin, Rayon and Cloth, Twill, Rayon |
| MIL-B-371 | -Braid, Textile, Tubular |
| MIL-F-495 | -Finish, Chemical, Black, For Copper Alloys |
| MIL-B-3461 | -Button, Insignia, Metal Uniform and Cap |
| MIL-P-15011 | -Pallet, Material Handling, Wood, Post Construction, 4 Way Entry |
| MIL-C-15062 | -Cloth, Flannel, Wool, Undercollar Cloth |
| MIL-P-15064 | -Pad, Shoulder and Sleevehead |
| MIL-C-15065 | -Coat, Fronts |
| MIL-B-17757 | -Box, Shipping, Fiberboard, (Modular Sizes) |
| MIL-B-20289 | -Button, Insignia, Plastic |
| MIL-C-21115 | -Cloth, Tropical, Wool, Polyester/Wool |
| MIL-T-43548 | -Thread, Polyester, Cotton-Covered and Rayon Covered |
| MIL-T-43718 | -Cloth, Twill, Polyester, Polyester and Cotton, Polyester and Rayon |

STANDARDS

FEDERAL

| | |
|---|---|
| FED-STD-191 | -Textile, Test Methods |
| FED-STD-751 | -Stitches, Seams, and Stitchings |



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-129 -Marking for Shipment and Storage
MIL-STD-147 -Palletized Unit Loads
MIL-STD-1490 -Provisions for Evaluating Quality of Coats, Men's Dress

(Copies of specifications, standards, handbooks, drawings, and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting activity.)

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

LAWS AND REGULATIONS

U.S. Postal Service Manual

(Application for copies should be addressed to the Superintendent of Documents, U.S. Government Printing Office, Washington D.C. 20402.)

2.2 Other publications. The following document(s) form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted shall be those listed in the issue of the DODISS specified in the solicitation. Unless other specified, the issues of documents not listed in the DODISS shall be the issue of the nongovernment documents which is current on the date of the solicitation.

UNIFORM CLASSIFICATION COMMITEE, AGENT

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to American Trucking Association, ATTN: Order Section, 1616 P Street, N.W., Washington, D.C. 20026.)

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense (DoD) Standard Color Card of Standardized Shades for Serving Threads 1968

Department of Defense (DoD) Standard Shades for Button 1966

(Application for copies should be address to the Color Association of the United States, 343 Lexington Avenue, New York, NY 10016.)



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

(Nongovernment standards are generally available for reference from libraries. They are also distributed among technical groups and using Federal Agencies.)

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein (except for associated detail specifications, specification sheets or MS standards), the text of this specification shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Standard samples. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.4 and 6.5).

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, tropical, polyester/wool, green shade 2241 (see 6.3), conforming to type III, class 3 of MIL-C-21115.

3.3.2 Lining. The material for lining fronts, sleeves, yoke, and vent, making the belt fastener, and facing the inside breast pocket shall be cloth, rayon, twill, green shade 2208 (see 6.3), 3.7 ounce, conforming to class I of MIL-C-368.

3.3.3 Twill, polyester and cotton. The material for lining the upper and lower patch pockets, inside breast pocket, pocket stays and stays for shoulder and armhole seams shall be cloth, twill, polyester and cotton conforming to type I of MIL-C-43718, except the requirements for nonfibrous material and seam efficiency shall not apply. The color shall be black.

3.3.4 Undercollar cloth. The undercollar cloth shall be wool flannel conforming to MIL-C-15062. The color of the cloth shall be green of an approved shade to closely match the basic material. The acidity (ph) requirement and colorfastness to perspiration and crocking requirements shall not apply.

3.3.5 Bias binding. The binding for the upper edge of pockets, back edge of facing, armhole shield, bottom turnup and the raw edge of seam allowances shall be bias cut out of the lining material specified in 3.3.2. The binding shall be 5/8 to 7/8 inch wide and shall have sized edges.

3.3.6 Collar and belt interlining. The material for interlining the collar and belt shall be cloth, buckram, cotton, natural color, conforming to type I, class 2 of CCC-C-438 except that the test for shrinkage shall be in accordance with method 5580 of FED-STD-191.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.7 Coat fronts. The coat fronts shall conform to type IX of MIL-C-15065, except that the cotton warp, hair-wool filling cloth and stays shall be dyed black. The dyed cloth shall show fair fastness to wet (dry) cleaning only. The dyeing of the cotton warp, hair-wool filling cloth shall be accomplished with a selected direct dye and the dyed cloth shall be after treated, preferably with copper sulfate to meet the requirements specified herein. The dyed cotton warp, hair-wool filling cloth shall show fastness to wet (dry) cleaning, perspiration and steam pressing equal to or better than the standard sample. When no standard is available or has not been established, the dyed cotton warp, hair-wool filling cloth shall show good fastness to wet (dry) cleaning, perspiration and steam pressing. The coat fronts when tested as specified in Section 4, Table IV shall comply with the requirements specified herein.

3.3.8 Shoulder pads. The shoulder pads shall conform to type I, class 2 of MIL-P-15064.

3.3.9 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.10 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength 50 pounds, color black conforming to type IX, class 1 of MIL-B-371.

3.3.11 Cotton tape. The cotton tape shall be 5/8-inch and 1/4 inch widths and shall conform to type I, class 1, preshrunk of DDD-T-86, except that the nonfibrous material content shall not apply. The 5/8-inch bridle tape may be dyed black, conforming to class 3 of DDD-T-86, and shall show fastness to wet (dry) cleaning. In the event a standard sample has not been established, the dyed tape shall show good fastness to wet (dry) cleaning.

3.3.12 Polyester & cotton tape. The polyester and cotton tape shall be cross-cut, 1/2 inch wide, made from natural, bleached or dyed black cloth conforming to type I of MIL-C-43718, except the nonfibrous material content shall not apply. The raw edges of the tape shall be treated with a synthetic resin to prevent raveling.

3.3.13 Thread.

3.3.13.1 Cotton thread. The cotton thread shall conform to V-T-276 in the following types and sizes:

| Use | Type | Ticket No. | Ply |
|---|---|---|---|
| Seaming of coat; making buttonhole in belt and belt fastener; making belt loops; bartacking ends of belt keeper | IC2 | A | 3 |
| Tacking armholes and attaching sleeve head pads | IA1 or IA2 | 30 | 3 |
| Button sewing | IA3 or IB3 | 20 | 4 |



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

As an alternate to the cotton thread, a polyester, cotton-covered thread conforming to MIL-T-43548, ticket No. 50, 3 ply or ticket No. 70, 2 ply may be used. The thread for basting shall be good commercial grade cotton. Nylon or cotton 0/2 may be used for blindstitching/felling operation as an alternate.

3.3.13.2 Silk thread. The silk thread for machine sewing shall conform to V-T-301 as follows, except that the requirements for extractable matter shall not apply for the type III thread.

| Use | Type | Class | Ticket No. | Ply |
|---|---|---|---|---|
| Topstitching of coat and belt, and bartacking belt fastener to belt. | I | | A | 3 |
| Making buttonholes in coat | I | | B and F | 3 |
| Bartacking. | I | | B | 3 |
| Hand felling | III | 3 | C | 2 |
| Hand or duplicated felling of lining (armhole sleeve lining) | III | 3 | C | 2 |
| Machine felling | I | | 0 | 3 |

3.3.13.3 Nylon thread. The nylon thread for padding lapels shall conform to type III, size 000 of V-T-295.

3.3.13.4 Synthetic thread. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.3.13.5 Color and colorfastness. The thread shall be dyed shade T-1, cable No. 66023, except cotton thread for basting and for machine tacking armholes may be white. The dyed thread shall show fastness to light and wet (dry) cleaning, equal to or better than the standard sample. When no sample is available, the dyed thread shall show good fastness to light and wet (dry) cleaning. The thread for seaming lining need show fastness to wet (dry) cleaning only. (See DoD Standard Color Card of Official Standardized Shades for Sewing Threads 1968).

3.3.14 Gimp. The buttonhole gimp shall be cotton, No. 8 soft or glazed finish, conforming to type I or II of V-T-280. The color of the gimp shall be shade T-1, cable No. 66023. The dyed gimp shall show fastness to wet (dry) cleaning equal to or better than the standard sample. When no standard sample is available, the dyed gimp shall show fastness to wet (dry) cleaning equal to



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

or better than the standard sample. When no sample is available, the dyed gimp shall show good fastness to wet (dry) cleaning.

3.3.15 Buttons.

3.3.15.1 Insignia buttons. The insignia buttons shall conform to type I, class 2, 40-line, and type II, class 2, 27-line, black finish, conforming to MIL-B-20289.

3.3.15.2 Sewing hole buttons. The sewing hole buttons shall be melamine formaldehyde composition, glossy finish conforming to type II, class D, style 20, 34-line, and style 4, 22-line of V-B-871. The color of the buttons shall be green, cable No. 62017. (See DoD Standard Shades for Buttons 1966).

3.3.16 Fastener, snap. The snap fastener for the belt shall be brass, black japanned finish, or black chemical finish in accordance with MIL-F-495, round or square style, rolled edge, size 1/0 sew-on type. The snap fastener, when tested as specified in Section 4, Table IV, shall comply with the requirements specified herein.

3.3.17 Labels. Each coat shall have an identification label, a size label and an instruction label as follows. The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.17.1 Identification label. The identification label shall conform to type VI, class 1, of DDD-L-20 and shall measure not less than 2-1/2 inches wide by 1-1/2 inches long. The content and format shall be as follows:

Nomenclature (item description)
Contract Number
Name of contractor
Wool Products Act information
Dry Clean Only

NOTE: Size of characters for "Name of contractor" shall be minimum 8 points (Approximately 3/32 inch).

3.3.17.2 Size label. The size label shall be type VI, class 2 of DDD-L-20 and shall measure not less than 1-1/2 inches by 1 inch. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L or XL for Short, Regular, Long and Extra Long, and the stock number as shown by the following example:

$$\frac{40R}{\text{Stock Number}}$$

The stock number may be omitted from the size label, but when omitted, it shall be incorporated in the identification label.

3.3.17.3 Instruction label. The instruction label shall conform to type I, class 3, of DDD-L-20, and shall measure not less than 2-1/4 inches wide by 4 inches long. The content and format shall be as shown in Figure 1. The



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

letters for the caption shall be not less than 5/32 inch in height and all other letters and figures shall be not less than 1/8 inch in height.

3.4 Design. The coat shall be the U.S. Marine Corps design shown on Figures 2 through 4, a four-button, single-breasted, quarter-lined coat with separate belt, having a skirt type front with a side body waist seam and darts, upper and lower patch pockets with flaps to button, a two-piece back with vent, ornamental sleeve cuffs, one inside breast pocket with horizontal piped opening, shoulder straps to button, and notched lapels.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The standard patterns shall provide 3/16-inch allowance for seams at the edges of the lapels, front edge of coat, and for pocket flaps; 3/4-inch allowance for side seams; 5/8-inch allowance for center back seam; and 3/8-inch allowance for all other seams except as otherwise specified in Table I. Standard patterns show size, seam allowances, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts.

3.5.1 List of pattern parts. Coats shall be cut from the materials specified herein in accordance with the number of pattern parts indicated below:

| Item | Pattern Nomenclature | No. of cut parts |
|---|---|---|
| | Material: Polyester and Wool | |
| 1. | Front (upper) | 2 |
| 2. | Skirt (lower front) | 2 |
| 3. | Back | 2 |
| 4. | Side body | 2 |
| 5. | Front facing, right | 1 |
| 6. | Front facing, left | 1 |
| 7. | Top sleeve | 2 |
| 8. | Under sleeve | 2 |
| 9. | Sleeve cuff | 2 |
| 10. | Top collar | 1 |
| 11. | Shoulder strap | 2 |
| 12. | Pocket, upper | 2 |
| 13. | Pocket, lower | 2 |
| 14. | Pocket flap, upper | 2 |
| 15. | Pocket flap, lower | 2 |
| 16. | Belt | 1 |
| 17. | Belt lining | 1 |
| 18. | Armhole shield (one piece) | 2 |



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

| Item | Pattern Nomenclature | No. of cut parts |
|---|---|---|
| | Material: Cloth, Rayon Lining | |
| 19. | Front | 2 |
| 20. | Back yoke | 1 |
| 21. | Top sleeve | 2 |
| 22. | Under sleeve | 2 |
| 23. | Back vent lining | 1 |
| 24. | Inside breast pocket facing | 1 |
| 25. | Pocket flap, upper | 2 |
| 26. | Pocket flap, lower | 2 |
| | Material: Cloth, Polyester and Cotton Twill | |
| 27. | Inside breast pocket | 1 |
| 28. | Inside breast pocket stay | 1 |
| 29. | Stay, upper pocket | 2 |
| 30. | Stay, lower pocket | 2 |
| 31. | Breast pocket, upper | 2 |
| 32. | Lower pockets | 2 |
| | Material: Cloth, Cotton Interlining | |
| 33 | Collar interlining | 1 or 2 |
| | Material: Cloth, Wool, Flannel, Undercollar | |
| 34 | Undercollar | 1 or 2 |
| | Shapers | |
| 35 | Left front shaper | |
| 36 | Working lapel shaper | |
| 37 | Undercollar shaper | |
| 38 | Finished pocket shaper, upper | |
| 39 | Finished pocket shaper, lower | |
| 40 | Finished pocket flap shaper, upper | |
| 41 | Finished pocket flap shaper, lower | |
| 42 | Left vent shaper | |
| 43 | Finished collar and lapel | |
| | Markers | |
| 44 | Undercollar stand marker | |
| 45 | Inside breast pocket marker | |
| 46 | Sleeve cuff marker | |

3.6 Construction. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table 1. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.6.1 Stitches, seams and stitchings. The stitch, seam, and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.1 Tacking and backstitching. Ends of seams and stitching produced with 301 type stitch, when not caught in other seams or stitching, shall be securely backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch.

3.6.2 Shade marking. The component parts of the coat cut from one piece of basic material and lining material, including pairs of sleeve linings when cut from ends, and the two parts of the undercollar cut form undercollar cloth shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.

(b) Adhesive type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets.

(c) Sew-on shade tickets.



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 1. | Cutting.<br><br>a. Cut coats in strict accordance with patterns furnished by the Government.<br><br>b. Cut all materials in the direction indicated by the directional lines on the pattern.<br><br>c. Cut all polyester/wool parts of the coat, including the belt, from one piece of basic material, except the following parts may be cut from ends: armhole shields, belt lining, belt loops and belt keeper; but when so cut, the parts shall harmonize with the shade of the coat. Belt loops and belt keeper may be banded 1 inch wide, and belt lining may be cut from a banding machine 2-1/4 inches wide. When armhole shields are cut from ends, the shields shall match each other.<br><br>d. Cut fronts, yoke and vent lining parts of the coat and facing for inside pocket from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the linings shall match each other. The belt fastener shall be cut 1-5/8 inches wide. Bias binding shall be cut 5/8 to 7/8 inch wide.<br><br>e. The two parts of the undercollar cut from undercollar material shall match each other, or cut the undercollar material in one piece in lieu of two parts.<br><br>f. Cut polyester and cotton twill cloth stays for armhole and shoulder seams on the bias, 3/4 inch wide, 4 $\pm$ 1/4 inches long for front shoulder and armhole edge. Cut polyester and cotton twill cloth for inside pocket and the stays for upper and lower pockets | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 1. | Cutting. (cont'd)<br><br>and inside pocket on the straight in accordance with the patterns furnished. Cut polyester and cotton twill cloth for upper and lower pockets in accordance with the patterns furnished.<br><br>g. Cut the cotton interlining cloth for collar on the bias in accordance with the pattern furnished. Cut the cotton interlining cloth for the belt on the straight, 1-5/8 inches wide.<br><br>h. Dress the left vent in accordance with the shaper furnished.<br><br>i. The use of drill holes is prohibited.<br><br>j. The left front shall be dressed in the front shaping operation only (see opr. 49). | | | | | |
| 2. | Replacement of damaged parts.<br><br>a. Replace at time of cutting any parts of the coat containing holes or serious weakening defects such as smashes, multiple floats, loose weakening slubs, other material defects listed in MIL-STD-1490 expected to develop into holes, shade bars and dye streaks or unsightly slubs affecting appearance.<br><br>b. Replace any parts damaged during the manufacturing process by needle chews which may develop into a hole, scissor or knife cuts, tears, holes, mends or burns in the material affecting appearance. | | | | | |
| 3. | Shade marking.<br><br>a. Mark or ticket (see 3.6.2) all component parts cut from one piece of basic material, and the two parts of the undercollar to insure uniform shade and size throughout the coat. All lining parts shall | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 3. | Shade marking. (cont'd)<br><br>be marked, bundled or ticketed to insure uniform shade and size throughout the garment.<br><br>b. The use of tickets with any metal fastening devices or sew-on shade tickets is prohibited on the rayon lining. | | | | | |
| 4. | Make belt loops and keeper.<br><br>Finished appearance. The belt loops and keeper shall be uniformly stitched, uniform in width and shall finish smooth and flat without pleats, gathers, puckers or other distortion.<br><br>a. The belt loops and keeper shall be made from a 1-inch-wide strip of basic material. | | | | | |
| | b. Fold the sides of the strip lengthwise towards the center, abutting the raw edges, and join the raw edges together with a covering stitch, to finish 1/2 inch wide. The stitching shall be uniformly 1/8 inch from finished edges of the loops and keeper. | 406 | EFb-1 | 10-14 | A | A |
| | c. Cut the loop for the left and right sides of the coat 5-1/2 inches and 3-1/2 inches long, respectively. | | | | | |
| | d. Cut the keeper 4-1/2 inches long, fold in half end to end, and join the ends with a bartack across the width of the keeper. The finished keeper shall measure 2-1/8 ± 1/8 inches from bartack to folded end. | Bartack | | 28 per bartack (minimum) | A<br>A | A<br>A |
| 5. | Make belt fastener (see Figure 5).<br><br>Finished appearance. The belt fastener shall be uniformly stitched, uniform in width and shall finish smooth and flat and without pleats, | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 5. | Make belt fastener (see Figure 5). (cont'd) | | | | | |
| | gathers, puckers or other distortion. The buttonhole shall shall be clean cut, well made and correctly positioned. The buttonhole shall be the straight type and shall be made to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the outside of the fastener and ends of the buttonhole shall be securely tacked. | | | | | |
| | a. The belt fastener shall be made from 1-5/8-inch-wide strip of rayon lining material. | | | | | |
| | b. Fold the strip in half lengthwise, turn in raw edges, and stitch 1/8 inch from each side, catching the turned edges in the stitching, to form a 1/2-to 5/8-inch wide band. Cut the fastener 6-1/2 inches long. | 301 | EFp-2 | 10-14 | A | A (silk) |
| | c. Turn under one end of the fastener 1-1/2 inches and make a horizontal straight type buttonhole, cut 5/8 inch long, through all plies in the center of the turned under portion, securely tacking each end of buttonhole. | But-ton-hole | | 42-48 Button-hole (minimum) (including tack) | A | A |
| 6. | Seam belt (see Figure 5). | | | | | |
| | Finished appearance. The belt shall be uniformly stitched and shall finish smooth and flat without twists, pleats, gathers, puckers, or raw edges. | | | | | |
| | a. The belt shall be made of two plies of basic material, interlined with cotton buckram interlining. | | | | | |
| | b. Place the interlining material between the basic materials and seam together uniformly 1/8 inch from upper and lower edges, with | 301 | EFn-2 | 10-14 | A | A (silk) |

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 6. | Seam belt (see Figure 5). (cont'd)<br><br>the raw side edges of basic materials turned in and caught in the stitching. The stitching shall extend from one end of belt to approximately 1-1/4 inches from the opposite end. | | | | | |
| 7. | Close ends of belt (see Figure 5).<br><br>Finished appearance. The pointed end of the belt shall be well formed with turned-in edges securely caught in the stitching. | | | | | |
| | a. Turn back the under and top ply of basic material at the top and bottom unseamed edges of the belt and trim the interlining approximately 1 inch back from the end. | | | | | |
| | b. Fold the top and under ply of the unseamed end of the belt in half lengthwise face to face, and stitch each ply respectively 1/8 inch from the end. | 301 | SSa-1 | 10-14 | A | A |
| | c. Turn the ends of the top and underply, working out the points. Position the two points even and stitch together 1/8 inch from folded and turned edges, closing the ends and forming a point at the center of the finished end. | 301 | SSc-1 | 10-14 | A | A (silk) |
| | d. Close the opposite end of the belt with overedge stitching. | 502 or 503 | EFd-1 | 10-14 | A | A |
| | | | EFd-1 | 10-14 | A | A |
| | e. Finished width of the belt shall be 1-3/4 +1/16, -1/8 inches. The finished length of the belt for each size coat shall be as shown in Table II. | | | | | |
| 8. | Make buttonhole in belt (see Figure 5).<br><br>Finished appearance. The buttonhole shall be clean cut, well made and correctly positioned. The | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 8. | Make buttonhole in belt (see Figure 5). (cont'd) | | | | | |
| | buttonhole shall be the straight type and shall be made to fit a 22-line sewing hole button. The purling of the buttonhole shall be on the outside of the belt and the ends of the buttonhole shall be securely tacked. | | | | | |
| | a. Make a horizontal, straight type buttonhole, cut 5/8 inch long, midway between upper and lower finished edges of the belt, with the center of the buttonhole 5/8 ± 1/16 inch from the overedge stitched end and with the ends of buttonhole securely tacked. | But-ton-hole | | 50 per button-hole (minimum) (including tack) | A | A |
| 9. | Sew on belt buttons (see Figure 5). | | | | | |
| | Finished appearance. The button shall be positioned and securely sewn to the belt with the ends of the stitching securely tacked. | | | | | |
| | a. Mark the under side of the belt for the location of two 22-line sewing hole buttons. The center of the button for the buckle end shall be 3-5/8 ± 1/8 inches from the overedge stitched end of the belt. The button for the belt fastener shall be positioned in accordance with mark on pattern for each size belt. | | | | | |
| | b. Securely sew one button at each mark. The button for the buckle end shall properly engage buttonhole in buckle end and shall be sewn through all plies of material so that the edge of turnback will not show when button is engaged with buttonhole. The button for the belt fastener shall be sewn through the underside and interlining only. | 101 or Hand | | 21 per button (minimum) 3-4 (double thread) | 20/4 | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 10. | Bartack fastener to belt (see Figure 5). (cont'd)<br><br>Finished appearance. The belt fastener shall be smooth and flat without twisting or bulging when buttoned. The bartack shall extend across the entire width of the fastener and the stitch shall be formed with balanced thread tension.<br><br>a. Mark the underside of the belt in accordance with the mark on pattern for each size belt, for the location of belt fastener.<br><br>b. Turn under the raw end of the fastener 1/2 inch and bartack the fastener to the belt through all plies 1/8 to 3/16 inch from the folded edge. | Bar-tack | | 28 per bartack (minimum) | A (silk) | A |
| 11. | Clean and press belt.<br><br>Finished appearance. The belt and belt keeper shall be clean and well pressed with the keeper attached and secured to the belt.<br><br>a. Trim all ends of stitching and remove all loose ends of thread from the belt. Remove all spots and stains from the belt without injury to the material.<br><br>b. Place the keeper on the belt at the square end and secure by buttoning the end. Press the belt and keeper smooth and flat with a heated pressing iron or pressing machine. | | | | | |
| 12. | Attach snap fasteners (see Figure 5).<br><br>Finished appearance. The snap fasteners shall be securely attached to the belt. On the finished coat, the belt ends shall be fastened without misalignment or gap. The stitching on the socket part of | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 12. | Attach snap fasteners (see Figure 5). (cont'd) | | | | | |
| | the snap shall not catch the outer part of the belt. | | | | | |
| | a. Sew the socket part of the snap fastener to the inside point of the belt 1/2 to 5/8 inch from the point. The stitching shall be tacked off with not less than two stitches. | Hand or 101 | | 3-4 (double thread) 21 per fastener (minimum) | C (silk) O (silk or nylon) | |
| | b. The stud portion of the fastener shall be engaged in the socket portion for ultimate attachment by user. | | | | | |
| 13. | Make upper and lower pocket flaps. | | | | | |
| | Finished appearance. The pocket flaps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges and shall be uniform in shape and size in accordance with the finished pocket flap shaper. The seamed edges, the corners and point of the flaps shall be well worked out and the rayon lining shall not be visible on the outside of the flaps. The buttonholes shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button, and stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonholes and the purling of the buttonholes shall be on the outside of the flaps. | | | | | |
| | a. Pocket flaps shall be made of one ply of basic fabric and lined with one ply of rayon lining. | | | | | |
| | b. Seam the two plies together, face to face, 3/16 inch from the side and bottom edges, evenly trimming the edges for proper turning. | 301 | SSe-1 | 10-14 | A | A |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 13. | Make upper and lower pocket flaps. (cont'd) | | | | | |
| | c. Turn the flaps, working the edges, corners and point out completely. Edgestitch the flaps uniformly 1/8 inch from seamed edges. | 301 | SSe-2 (b) | 10-14 | A (silk) | A |
| | d. Mark and trim the top edge of flaps with the finished shaper so that in the finished coats, the length of the flaps at center point and sides shall conform to measurements shown in Table III. | | | | | |
| | e. Overedge stitch together the top raw edges of flaps. | 502 or 503 | SSa-1 | 8-10 | A | A |
| | | | SSa-1 | 8-10 | A | A |
| | f. Make a vertical, cut first, eyelet end, square bar type buttonhole with a 3/4-inch-long cut, through the center of each breast patch pocket flap with the edge of the eyelet 5/8 inch above the center point. | But-ton-hole | | 38 per Button-hole (not including tack) | B (silk) | F |
| | g. Make a vertical, cut first, eyelet end, square bar type buttonhole with a 3/4-inch-long cut, through the center of each lower patch pocket flap with the inside edge of the eyelet 5/8 inch above the center point of the flap. | But-ton-hole | | 38 per button-hole (not including tack) | B (silk) | F |
| | h. Securely bartack the ends of the buttonholes, catching the ends of the gimp in the bartack. Trim the ends of the gimp. | Bar-tack | | 21 per bartack (minimum) | B (silk) | B |
| | NOTE: Combination cut first buttonhole and bartacking automatic machine is authorized. Care shall be excercised in trimming excess gimp at end of buttonhole. | | | | | |
| | i. Press upper and lower pocket flaps smooth and flat. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 14. | Make upper pockets (creasing machine construction).<br><br>Finished appearance. The binding shall be uniformly stitched; shall not be tight or full causing puckers, gathers, or pleats; and the basic material shall be securely caught in the stitching. The pleats shall be vertically centered and the folded side edges of the pleats shall be parallel. The pockets shall be uniform in shape and size in accordance with the pattern. The pockets shall be lined with polyester/cotton cloth twill and the pleats shall be stitched.<br><br>a. Form a vertical box pleat on the outside center of upper pockets with a heated creasing machine. The pleat shall be 1-1/4 inches wide for size 30 to 34 coats and 1-1/2 inches wide for sizes 35-48 coats, inclusive. | | | | | |
| | b. Secure the pleat with a row of stitches 1/8 inch from the top and bottom edges, respectively. | 301 | SSa-1 | 10-14 | A | A |
| | c. Stitch the abutted edges of the pleat together on the inside of the pocket with blindstitching. | 103 | SSm-1 | 4-8 | A | A |
| | d. Place the polyester and cotton twill lining on the underside of pocket after the pleat is formed and stitched and seam together along the top, sides and bottom 1/8 to 3/16 inch from the raw edges. | 301 | SSa-1 | 10-14 | A | A |
| | e. Bind the upper edge of the pockets, including the lining, with 7/8-inch-wide bias binding, with the pleat closed and the outside edge of the binding only turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding. | 301 | BSb-1 | 10-14 | A | A |
| | f. Turn under and crease the side and bottom edges of the pockets in | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 14. | Make upper pockets (creasing machine construction). (cont'd) | | | | | |
| | a heated edge creasing machine. Trim the lower corners of pockets. | | | | | |
| | -or- | | | | | |
| | g. Fold the pocket in half lengthwise and stitch 1-1/4 or 1-1/2 inches from the edge, as applicable by size. | 301 | OSf-1 | 10-14 | A | A |
| | h. Form the pleat and seam across the top and bottom edges, respectively, 1/8 inch from raw edge. | 301 | SSa-1 | 10-14 | A | A |
| | i. Press pleat in center of pocket flat and smooth. | | | | | |
| | j. Trim the pocket to conform to upper finished pocket shaper with a 3/16-inch seam allowance added. Sew the polyester/cotton twill lining and pocket face to face, after the pleat is formed and seam around the sides and bottom 3/16 inch from the raw edges. | 301 | SSa-1 | 10-14 | A | A |
| | k. Turn the pocket so that the face side is on the outside and baste edges with the twill lining slightly back from pocket edges. Finished pocket must conform to finished shaper. | 101 or Hand | | | Commercial thread | |
| | l. Stitch across top of pocket. | 301 | SSa-1 | 10-14 | A | A |
| | m. Bind the upper edge of the pockets, including the lining, with 7/8-inch-wide bias binding, with the pleat closed and outside edge of the binding turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding. | | | | | |
| 15. | Make lower pocket. | | | | | |
| | Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers or pleats; the basic material and both edges of | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 15. | Make lower pocket. (cont'd) | | | | | |
| | binding shall be securely caught in the stitching. The pockets shall be uniform in shape and size in accordance with finished pocket shaper. The pockets shall be lined with polyester/cotton twill cloth (see 3.3.3). | | | | | |
| | a. Place the polyester/cotton twill lining on the under side of pocket and seam together along the top, sides, and bottom 1/8 to 1/4 inch from raw edges. | 301 | SSa-1 | 10-14 | A | A |
| | b. Bind the upper edge of the pockets, including the lining, with 7/8-inch-wide bias binding. Top edge of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edges of the binding. | 301 | BSc-1 | 10-14 | A | A |
| | c. Turn under and crease the side and bottom edges of the pockets in an edge creasing machine according to the lower pocket finished shaper. | | | | | |
| | -or- | | | | | |
| | d. In lieu of the edge creasing machine technique cited in 15.c., after the polyester/cotton twill lining is sewn and the top edges are bound with 7/8-inch-wide bias binding, mark the lower pocket and turn; baste the side and bottom edges at the chalk mark. | 101 | EFa-1 | | | |
| | e. When edges of pockets are turned under and basted (see 15.d), the pockets shall be pressed and the folded edges creased with a heated pressing iron or pressing machine so that the pocket will finish in accordance with the lower pocket finish shaper. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 16. | Make shoulder straps.<br><br>Finished appearance. The shoulder straps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges. The buttonholes shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button, and the stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the buttonhole, and purling of the buttonholes shall be on the outside of the shoulder straps.<br><br>a. The shoulder straps shall be made of one ply of basic material. | | | | | |
| | b. Fold side edges face to face and seam together with 1/4-inch seam. | 301 | SSe-2 (a) | 10-14 | A | A |
| | c. Press seam open with a heated iron. | | | | | |
| | d. Stitch pointed end of strap with a 1/4-inch seam. | 301 | SSe-2 (a) | 10-14 | A | A |
| | e. Trim points and turn the straps, working the seams out to the edges. Fold straps according to notches and topstitch the strap uniformly 1/8 inch from the edges. | 301 | SSe-2 (b) | 10-14 | A | A |
| | f. Make a horizontal eyelet-end, square bar type, cut first buttonhole, 3/4 inch long, in each strap midway between the back and front edges, with the inside edge of the eyelet placed so that in the finished coat, the edges of the shoulder strap button will be 1/4 to 1/2 inch from the edge of the collar. The purling shall finish on the outside of the strap. | Buttonhole | | 38 per buttonhole (minimum not including bartack) | B (silk) | F |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 16. | Make shoulder straps: (cont'd) | | | | | |
| | g. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside of the buttonhole. | | | | | |
| | h. Securely bartack the ends of the buttonholes and trim the ends of the thread and gimp. | Bar-tack | | 21 per bartack (minimum) | B (silk) | B |
| | i. Press the straps smooth and flat with a heated pressing iron or pressing machine. The strap shall be uniform in shape and size in accordance with the pattern. | | | | | |
| 17. | Make undercollar. | | | | | |
| | a. The undercollar assembly may consist of one or two pieces of undercollar cloth and a single piece of cloth, cotton, buckram interlining material, or the interlining may be two pieces. | | | | | |
| | b. Join the two halves of the undercollar with a 3/8-inch seam (when two-piece construction is used). | 301 | SSa-1 | 10-14 | A | A |
| | c. Spread the seam open and press flat with a heated pressing iron. | | | | | |
| | d. Join the two halves of the interlining together with a 3/8-inch lap seam (when two piece construction is used). | 301 | LSa-1 | 10-14 | A | A |
| | e. Quilt the interlining to the undercollar with 4 to 5 rows of blindstitching. | 103 | SSm-1 | 4-6 | A | A |
| | f. Mark and cut the undercollar in accordance with undercollar shaper or undercollar may be die cut to conform to pattern shaper. Trim undercollar interlining 1/8 inch away from lower edge of undercollar. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 17. | Make undercollar. (cont'd) | | | | | |
| | g. Mark the breakline of undercollar with the undercollar stand marker. | | | | | |
| | h. Stitch undercollar to interlining at breakline; stand shall be 1-1/4 ± 1/8 inches at center. | 301 | SSa-1 | 10-14 | A | A |
| | i. Stitch undercollar to interlining 1/2 ± 1/8 inch from top and side edges. | 301 | SSa-1 | 10-14 | A | A |
| 18. | Assemble topcollar and undercollar. | | | | | |
| | Finished appearance. The collar shall be uniform in appearance and shall finish smooth and flat without twists, gathers, puckers, pleats or raw edges (top and sides). The felling shall not be too tight or loose and the collar material shall be securely caught in the stitching. The eyelets shall be well worked with the purling on outside of the collar and shall finish with a 1/8-inch diameter opening. | | | | | |
| | a. Position topcollar between undercollar and interlining with the upper edge abutting the undercollar-interlining seam and with notches aligned. | | | | | |
| | b. Join topcollar to undercollar at top edge with zig-zag stitching, properly distributing the fullness between the notches. The zig-zag stitching shall extend to the end of the collar. | 304 | LSa-1 | 8-10 | A | A |
| | c. Turn the undercollar inside on the topcollar and stitch the ends with a 1/8-inch seam. | 301 | SSa-1 | 10-14 | A | A |
| | d. Trim and turn the topcollar to the outside, forcing out the ends. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 18. | Assemble topcollar and undercollar. (cont'd) | | | | | |
| | e. Baste the ends and upper edge and along the breakline, with the fullness placed between two rows of basting stitches. | 101 | | | Commercial | |
| | f. If ends of collar are felled by hand, 1/8 inch must be cut off the ends of the undercollar. | Hand | | 8-10 | C (silk) | |
| | NOTE: When collar ends are hand felled, the ends of undercollar will not be turned under. | | | | | |
| | g. Press the collar smooth and flat with a heated pressing machine. Edges and corners shall be smooth, flat and uniformly even. | | | | | |
| | h. Trim the lower edge of the topcollar to provide seam allowance for seaming to the coat. Cut a guide notch in the lower edge of the topcollar at the center. | | | | | |
| | i. Make one eyelet at each end of the collar 1 inch from the side and upper edges, respectively. The eyelets shall be well worked with the purling on the outside of the collar, and shall finish with a 1/8-inch diameter opening. | Eyelet | | 20 per evelet (minimum) | A (silk) | A |
| 19. | Seam sleeves at forearm. | | | | | |
| | Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly. | | | | | |
| | a. Position the top and undersleeves with notches matching and join at the forearm with a 3/8-inch seam. | 301 or 401 | SSa-1 | 10-14 | A | A |
| | b. Spread open the seam and press flat with a heated pressing iron, holding seam short. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 20. | Join cuffs to sleeve. | | | | | |
| | Finished appearance. The upper curved edge of cuffs shall be properly formed and creased and the cuffs shall be uniformly stitched to sleeves. The point of the cuff shall be centered between the lower front creased edge and the creased backarm seam of sleeve. | | | | | |
| | a. Fold the cuff lengthwise at the point with wrong side out. Tack the point 1/8 inch from the raw edges. Turn cuffs, completely working out the point. | 301 | SSa-1 | 10-14 | A | A |
| | b. Turn under the upper edge of the cuff, forming the finished curved edge in accordance with the shape of the pattern. Press smooth and flat with a heated pressing iron or pressing machine, creasing the edge. | | | | | |
| | c. In lieu of pressing, the turn under at upper edge of cuffs may be basted. | 101 or Hand | | | Commercial | |
| | d. Mark the sleeves in accordance with the sleeve cuff marker for positioning the cuffs, with notch on the pattern matching the forearm seam line and with the lower edge of the sleeve and marker even. | | | | | |
| | e. Position the cuffs at the mark on the sleeve and seam uniformly 1/8 inch from the upper folded edge of cuff. | 301 | LSd-1 | 10-14 | A | A (silk) |
| 21. | Seam sleeve at backarm. | | | | | |
| | Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 21. | Seam sleeve at backarm. (cont'd) | | | | | |
| | a. Join the top sleeve to the undersleeve at the backarm with a 3/8-inch seam, catching the ends of the cuff in the seam. | 301 or 401 | SSa-1 / SSa-1 | 10-14 / 10-14 | A / A | A / A |
| | b. Spread open the sleeve and cuff seams and press flat with a heated pressing iron. | | | | | |
| 22. | Tack cuff to sleeve. | | | | | |
| | a. Turn the cuff outlet to the inside, in accordance with notches, against the bottom end of the sleeves and baste along the turned edge of cuff. | Hand or 101 | | | Commercial / Commercial | |
| | b. Tack the raw edge of the cuff to the body of the sleeve with blindstitching. | 103 | SSm-1 | 4-6 | A | A |
| | c. On the finished coat, the length of the cuff shall be 3-1/4 ± 1/4 inches at the front and back creased edges and 6 ± 1/4 inches at the point. | | | | | |
| 23. | Seam sleeve linings. | | | | | |
| | Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The seams shall start and finish evenly. | | | | | |
| | a. Position the top and undersleeve lining pieces in accordance with notches on pattern and join the forearm and backarm respectively, with a 3/8-inch seam, continuously from top to bottom of seam. | 301 or 401 | SSa-1 / SSa-1 | 10-14 / 10-14 | A / A | A / A |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 23. | Seam sleeve linings. (cont'd) | | | | | |
| | NOTE: The seams of the sleeve lining shall be finished on the inside of sleeve linings. | | | | | |
| 24. | Assemble sleeve and sleeve lining. | | | | | |
| | Finished appearance. The sleeve linings shall be properly positioned and seamed to sleeve without twists, gathers, puckers or pleats. | | | | | |
| | a. Position the sleeve lining on the sleeve with the notch on the lining even with the armhole edge of sleeve and extending the same width around the armhole edge of sleeve. | | | | | |
| | b. Seam or tack lining to sleeve backarm and forearm seam allowance, respectively, commencing approximately 4 inches above finished bottom edge of sleeve and extending to approximately 6 inches below armhole edge at the backarm and approximately 4-1/2 inches below armhole edge at the forearm. | 301 or Hand | SSa-1 | 6-8 | A Commercial | A |
| 25. | Fell turnup of sleeve lining; press sleeves. | | | | | |
| | Finished appearance. The sleeve linings shall not be short, tight or twisted at bottom of sleeves, and shall extend to within 1 to 1-1/4 inches from finished end of sleeve. The sleeves shall be properly pressed in accordance with operation 81.g. prior to setting the sleeves to coats. | | | | | |
| | a. Pull sleeves through lining and turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 | Hand or 101 | | | Commercial | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 25. | Fell turnup of sleeve lining; press sleeves. (cont'd) | | | | | |
| | inches above the finished end of the cuff. The sleeve lining may be felled to bottom of sleeve without basting. | | | | | |
| | b. Fell the folded edge of sleeve lining to turnup of the cuff with blindstitching. | 103 or Hand | EFc-1 (b) | 6-8<br>8-10 | 0 (silk or nylon | 0 |
| | c. Turn sleeves and assemble in pairs. The sleeves may be pressed prior to setting. The backarm crease shall be on the backarm seam. | | | | (silk or nylon) | |
| 26. | Hem yoke and front lining. | | | | | |
| | Finished appearance. The hem shall be uniformly stitched, uniform in width, and shall finish smooth and flat without twists, gathers, puckers or pleats. | | | | | |
| | a. Hem the bottom edge of the yoke and front linings, respectively, with the raw edge turned under. Stitch 1/16 inch from the folded upper edge of hem. | 301 | EFb-1 | 10-14 | A | A |
| | b. The hem shall measure 3/8 ± 1/8 inch wide. | | | | | |
| 27. | Make armhole shields. | | | | | |
| | Finished appearance. The armhole shields, of one ply of basic material, shall finish without puckers, gathers, or raw edges. | | | | | |
| | a. Bind the rounded edge of shield with bias binding, turning under the outside raw edge of the binding only and catching the turned under portion in the stitching 1/16 inch from folded edge. | 301 | BSb-1 | 10-14 | A | A |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 28. | Make center pleat in back yoke lining. | | | | | |
| | Finished appearance. The pleat shall be uniform in width and shall finish smooth and flat without puckers or pleats. | | | | | |
| | a. Fold the back yoke lining, in accordance with the notches on the pattern, to form a 1/2-inch-wide pleat at the center back. Tack lengthwise along the pleat in line with the notches for a distance of 1 to 1-1/2 inches from the top end. | 301 | OSf-1 | 10-14 | A | A |
| | -or- | | | | | |
| | b. Form the pleat by stitching across top of pleat at neckline. Press the pleat smooth and flat from the top to the bottom edges of the back yoke lining with a heated pressing iron. The folded edge of the pleat on the outside of the back yoke shall be towards the left side. | 301 | SSa-1 | 10-14 | A | A |
| 29. | Stitch dart in front lining. | | | | | |
| | Finished appearance. The dart shall be tapered to a point at the lower end and shall finish without gathers, puckers, or pleats. | | | | | |
| | a. Fold the front lining, matching the cut edge of the underarm dart. Stitch lengthwise along the dart, tapering from 3/8 inch at the armhole to a point at the lower end not more than 1 inch below the cut of dart. | 301 | SSa-1 | 10-14 | A | A |
| 30. | Seam facing to front lining. | | | | | |
| | Finished appearance. The lining shall be carefully and properly aligned, and seamed to the facing so that in the finished coat, the | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 30. | Seam facing to front lining. (cont'd) | | | | | |
| | lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material or other defect or distortion. | | | | | |
| | a. Position the lining on the facing with the top edges even, matching the notches to form chest pleat across the chest. Bottom finished edge of the lining shall be matched with the notch in the back edge of the facing to insure proper seaming | | | | | |
| | b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge, matching the notches in the lining to form a horizontal pleat. The pleat shall face down. | 301 | SSa-1 | 10-14 | A | A |
| | c. Press the facing lining seam, the pleat, the underarm dart, and the bottom edge of the lining smooth and flat with a heated pressing iron, with the raw edges of the underarm dart toward the side. | | | | | |
| 31. | Assemble inside pocket on lining and facing. | | | | | |
| | a. The inside pocket shall be made of one piece of polyester/cotton twill cloth with a facing of rayon lining at the horizontal piped pocket opening. | | | | | |
| | b. Position the rayon facing on the pocket material with notches matching. Turn under the top and bottom edges, respectively, of the facing and seam the facing to the pocket 1/16 to 1/8 inch from the folded edges with the top edge of identification label centered and | 301 | LSd-1 (each turned edge) SSa-1 (each selvage edge) | 10-14 | A | A |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 31. | Assemble inside pocket on lining and facing. (cont'd) | | | | | |
| | caught in the stitching at the top edge of facing. Selvage edge need not be turned under. | | | | | |
| | c. Stitch the remaining three sides of label to pocket 1/16 inch from each edge. | 301 | SSa-1 | 10-14 | A | A |
| | d. Mark the right facing and the front lining, with the pocket marker furnished, for the position of the pocket opening. | | | | | |
| | e. Position the pocket at the mark with the pocket facing next to the lining material. Place the polyester/cotton twill stay piece on the underside of the lining, with the diagonal extension of the stay extending to the armhole edge of the lining. | | | | | |
| | f. Stitch the pocket to the lining and facing through the stay piece with one row of stitches 3/16 to 1/4 inch on each side of the mark for the pocket opening. | 301 | SSv-2 | 10-14 | A | A |
| | g. Cut the opening for the pocket midway between the two rows of stitches joining the pocket and pocket stay to the lining and facing, tongue notching each end of the opening. | | | | | |
| | h. Turn the pocket through the opening to the inside with the front and the backs of the pocket toward the bottom and top edges, respectively, of the lining. Form the piping at the top and bottom edge of the opening. Topstitch the upper and lower edges of the pocket opening adjacent to the seamed outer edge of the piping. | 301 | BSp-2 | 10-14 | A | A |
| | -or- | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 31. | Assemble inside pocket on lining and facing. (cont'd) | | | | | |
| | i. Accomplish the pocket opening with a double piped pocket machine which stitches, cuts and turns in one operation. When this machine is used, the piping piece may be trimmed to permit insertion into the machine. The joining seam of the top and bottom piped edges shall be raise stitched through lining and coat facing prior to pocket closing and top edgestitched through all plies. Tack ends of pockets opening. | 101<br>or<br>301 | | | A<br><br>A | A<br><br>A |
| | j. Turn down the back part of the pocket and seam the front and back together approximately 1/2 inch from raw side and bottom edges, catching the tonque notch at each end of the pocket opening in the stitching and securely backtacking each end of the tongue notch. Continue to stitch across top of pocket adjacent to top piping seam, catching twill stay in the stitching and closing top of pocket. | 301 | SSa-1 | 10-14 | A | A |
| | k. Stitch the lining, on the outside, to the diagonal extension of the pocket stay from the armhole end of the pocket opening to the armhole. Tacking of the pocket stay to the canvas only is permitted. | 301 | SSv-1 | 10-14 | A | A |
| | l. Notch top of polyester and cotton pocket at front edge of the full width of seam allowance and blindstitch inner ply of pocket to facing (see 77.c for alternate operation). | 103<br>or<br>306 | SSm-1<br><br>SSm-1 | 4-6<br><br>4-6 | A<br><br>A | <br><br>A |
| | m. In the finished coat, the width of the pocket opening shall be 5 $\pm$ 1/4 inches for all sizes and shall not extend into the facing more than 1 inch nor extend into the armhole. The depth of the pocket shall be not less than 6 inches. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 31. | Assemble inside pocket on lining and facing. (cont'd) | | | | | |
| | n. Sew the instruction label to the outside of the right pocket facing, centered, 1/2 inch below pocket opening, with a single row of stitching 1/16 inch from each edge. | 301 | SSa-1 | 10-14 | A | A |
| 32. | Bind backs. | | | | | |
| | Finished appearance. The binding shall be uniformly stitched, shall not be tight or full causing puckers, gathers or pleats and the basic material and edges of binding shall be caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching. | | | | | |
| | a. Bind the raw side edge of the left and right backparts, respectively, with bias binding, from the top edge of backparts to the top end of the vent. The outside raw edge only of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge. When binding the left backpart, continue to bind the raw edge of the vent for the left backpart from the top to the bottom end. The binding is not required along the top edge of the vent. | 301 | BSb-1 | 10-14 | A | A |
| | b. Bind the raw side edge of the left and right backpart, respectively, with bias binding from the top to the bottom edge of the coat. The outside raw edge only of the binding shall be turned under and caught in the stitching 1/16 inch from the inner folded edge. | 301 | BSb-1 | 10-14 | A | A |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 33. | Bind facings.<br><br>Finished appearance. The binding shall be uniformly stitched, and shall not be tight or full causing puckers, gathers, or pleats. The basic material shall be securely caught in the stitching. The binding shall extend from the bottom edge of facing to not less that 1 inch above bottom finished edge of lining. | | | | | |
| | a. Bind the raw back edge of the facing with the 3/4-inch-wide bias cut binding, with the outside raw edge only of the binding turned under and caught in the stitching 1/16 inch from the inner folded edge. | 301 | BSb-1 | 10-14 | A | A |
| 34. | Seam lining to right vent.<br><br>Finished appearance. The vent lining shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. | | | | | |
| | a. Fold vent lining in half lengthwise face to face and stitch along the top, from the notches to the folded edge, with a 5/16-to 3/8-inch seam. Turn vent lining to the right side, forcing out corner and seam. | 301 | SSa-1 | 10-14 | A | A |
| | b. Press vent lining smooth and flat with a heated pressing iron or pressing machine. Position the raw edge of lining on the outside of right vent, with notches on the lining in line with the top end of vent; then seam together 3/8 inch from backedge. The lining shall extend from the notches to the bottom finished edge of coat. | 301 | SSe-2 (a) | 10-14 | A (silk) | A |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 34. | Seam lining to right vent. (cont'd) | | | | | |
| | c. Turn the lining to the inside with seam 1/16 to 1/8 inch back of folded edge. Stitch the entire length of vent 1/8 inch from the folded edge. | 301 | SSe-2 (b) | 10-14 | A (silk) | A |
| 35. | Join backparts. | | | | | |
| | Finished appearance. The backs shall be joined without gathers, puckers or pleats. The folded edge of the left vent shall be in line with the center back seam. In the finished coat, the left backpart shall overlap the right backpart not less than 3 inches, measured at the bottom edge of the coat, and left vent shall be 2 ± 1/8 inches wide measured at the bottom bound edge. | | | | | |
| | a. Position the backparts with edges even and join at the center with a 5/8-inch seam from the top edge of the backs to approximately 3/4 inch below top end of the vent. From that point, continue to stitch diagonally across the top end of the left and right vents to the bound edge of the backs. | 301 | SSa-1 | 10-14 | A | A |
| | b. Turn the left vent to the inside of the left backpart in accordance with the notches and edgestitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam. | 301 | OSf-1 | 10-14 | A (silk) | A |
| 36. | Press center back seam and vent lining. | | | | | |
| | a. Notch the top end of the right vent diagonally from the juncture point of the vent and the center seam allowance of the right back-part to lower end of the stitching for the center back seam. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 36. | Press center back seam and vent lining. (cont'd) | | | | | |
| | b. Spread the center back seam open and press flat with a heated pressing iron. | | | | | |
| 37. | Baste and stitch vent lining. | | | | | |
| | Finished appearance. The folded edge of the lining shall extend beyond the center seam allowance of the right backpart. | | | | | |
| | a. Baste vent lining to coat. | 101 or Hand | | | | |
| | b. Stitch the upper part of vent lining to center back on each side of the seam allowance 1/8 inch from seamed edge of lining. Turn coat on the outside. | 301 | SSa-1 | 10-14 | A (silk) | A |
| | c. Stitch and backstitch through all plies, across the top end of vent, through the vent lining, from the back center seam to the edge of the vent. | 301 | SSa-1 | 10-14 | A (silk) | A |
| 38. | Seam reinforcement stay to armhole and shoulder. | | | | | |
| | Finished appearance. The cotton and polyester twill reinforcement stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers or pleats. | | | | | |
| | a. Seam the 3/4-inch-wide polyester cotton stays to the underside of the fronts along the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other. | 301 | SSaa-1 | 10-14 | A | A |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 39. | Bind lower fronts.<br><br>Finished appearance. The binding shall be uniformly stitched, shall not be tight or full causing puckers, gathers or pleats and the basic material and edges of binding shall be securely caught in the stitching. The outside raw edge only of the binding shall be turned under and caught in the stitching. | | | | | |
| | a. Bind the raw back edge of the lower fronts with bias binding, turning under the outside raw edge of binding only and catching the turned under portion in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the waist seam to the bottom edge of fronts. | 301 | BSb-1 | 10-14 | A | A |
| 40. | Assemble fronts.<br><br>Finished appearance. The waist darts shall be properly tapered and shall finish without gathers, puckers or pleats. The upper and lower front and side body panel shall be joined without gathers, puckers or pleats. | | | | | |
| | a. The fronts shall consist of an upper front, a side body panel, and a lower front (skirt). | | | | | |
| | b. Fold the upper fronts, matching the cut edges of the waist dart, and stitch the entire length of the dart 3/8 inch from the cut edges at the lower end and tapering to a point 1 inch from the end of cut at the upper end. | 301 | SSa-1 | 10-14 | A | A |
| | c. Position the upper front and side-body panel with edges even and join with a 3/8-inch seam. | 301 | SSa-1 | 10-14 | A | A |
| | d. Spread open the waist dart and the underarm seam and press flat with a heated pressing iron. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 40. | Assemble fronts. (cont'd) | | | | | |
| | e. Position the upper and the lower fronts with edges even and join together at the waist with a 3/8-inch seam and with the 1/4-inch-wide stay tape positioned on the upper fronts 1/4 inch from the edge and caught in the stitching. Backtack the front end of seam on the left front for a distance of not less than 1-1/2 inches. | 301 | SSab-1 | 10-14 | A | A |
| | NOTE: The tape may be sewn simultaneously in the joining seam of the waist; or the tape may be sewn to the upper fronts prior to joining the skirt to the upper front. | | | | | |
| | f. The tape shall be sewn with normal tension, not loose or tight, and shall extend from the front edge of the fronts. | | | | | |
| | g. Spread open the waist seam and press flat with a heated pressing iron. | | | | | |
| | h. Press and shape the fronts, from the waist to the top edge, on a suitable type heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest. | | | | | |
| 41. | Set pockets and pocket flaps (see Figure 6). | | | | | |
| | Finished appearance. The pockets and pocket flaps shall be set without twists, gathers, puckers, pleats or raw edges. The stitching for the raised edge of the flaps shall conform to stitching for setting the pockets. The side edges of the pockets shall not be exposed beyond the sides of the flaps. The pocket and pocket flaps on the left and right side, respectively, shall be in horizontal alignment with each other. The | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 41. | Set pockets and pocket flaps (see Figure 6). (cont'd)<br><br>front edge of the upper pockets, pocket flaps, and pleats shall be in parallel alignment with front edge of coat when buttoned. The top of the breast pocket flaps shall be perpendicular to the front edge of coat when buttoned. The point of the upper pocket flap shall be at the center of the pleat on the upper pockets. The center of the pleat on the upper pockets shall be aligned as accurately as possible with the waist darts in the fronts. The top edge of the bottom pocket flap shall be parallel with the waist seam line, and front edge of the flap shall be in line with the front edge of the upper pocket. The lower front corners of the bottom pocket shall be 3/8 inch further back towards the side seam. Pockets and pocket flaps shall conform to the measurments in Table III.<br><br>NOTE: The breast pocket and flap marker (template) constructed by the manufacturer shall be made to ensure that the top of the breast pocket flaps finish perpendicular to front edge of coat and the front edge of the breast patch pocket shall finish in vertical alignment with the front edge of the lower flap.<br><br>a. Mark the fronts in accordance with the marks on the pattern or template when used for position of upper and lower pockets and pocket flaps ensuring adherence to the finished appearance requirements. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 41. | Set pockets and pocket flaps (see Figure 6). (cont'd) | | | | | |
| | b. Position the pocket flaps on the outside of the fronts in accordance with the marks for the upper and lower pocket flaps, respectively. Position the polyester and cotton twill stay piece for the flaps and top corners of the pockets on the underside of the fronts. | | | | | |
| | c. Seam the pocket flaps to the front, through the polyester and cotton twill stay, uniformly 3/16 inch from the serged edge of the flap. | 301 | LSq-2 (a) | 10-14 | A (silk) | A |
| | d. Turn down the flaps and topstitch the flaps 1/8 inch from the raised edge. | 301 | LSq-2 (b) | 10-14 | A (silk) | A |
| | e. Position the pockets in accordance with the marks for the upper and lower pockets and seam to the fronts uniformly 1/8 inch from the side and bottom edges. The top corners of the pockets shall be securely tacked through the twill stay pieces. | 301 | LSd-1 | 10-14 | A (silk) | A |
| 42. | Set belt loops. (See Figures 7 and 8) | | | | | |
| | Finished appearance. The belt loops shall finish vertically straight and shall be positioned 1/4 inch in from the back end of the lower flap and perpendicular to the lower flap. The belt loops shall measure 2-1/2 ± 1/8 inches long from top to bottom folded edges. The underloop for the belt fastener shall have an opening of not less than 1-3/4 inches. | | | | | |
| | a. Position the 5-1/2-inch long belt loop on the left front, 1/4 inch in from back end of the lower pocket flap, with one end approximately 1 inch above the waist seam. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 42. | Set belt loops. (cont'd) | | | | | |
| | Bartack the loop to the front 1/8 inch from the end of the loop. Bartack the loop to the front at the top edge of the lower pocket flap, 1/4 inch from the back end of the flap to form the underloop for the belt fastener. Turn under the top end of the loop to the front 1/8 inch from the folded edge, catching the turned under portion of the loop in the stitching (see Figure 7). | | | | | |
| | b. Position one end of the 3-1/2-inch-long belt loop on the right front and bartack the loop to the front at the top edge of the lower pocket flap 1/4 in inch from the back end of the lower pocket flap. Turn under the top end of the loop and bartack the loop to the fronts 1/8 inch from the folded edge with loop caught in the stitching. | Bar-tack | | 28 per bartack (minimum) | B (silk) | B |
| 43. | Interline fronts. | | | | | |
| | a. Position the left and right fronts on the respective coat front interlining and baste along the top edge of the upper pocket flap on the outside. | 301 or Hand | | | Commercial | |
| | b. Tack the top edge of upper pocket stay and the front end of the upper and lower pocket stay to the coat front interlining. The front end of the stays shall be tacked as close to the side edges of the pocket flap as possible. | 301 or Hand | | | Commercial | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 43. | Interline fronts. (cont'd) | | | | | |
| | c. Baste the interlining and fronts together starting approximately 1-1/2 inches above the top edge of upper pocket flap and baste along the center of the upper pocket flap and pocket, along the waist dart to the top edge of the lower pocket flap, and then diagonally across the front corner of the lower pocket flap to the front edge of the lower pocket. From that point, continue to baste along the front edge of the pocket to the bottom of the coat. | 301 or Hand | | | Commercial | |
| | d. Baste along the breakline of lapel and along the front edge down to the bottom of the coat. | 301 or Hand | | | Commercial | |
| | e. Baste across the shoulder, allowing room for setting the shoulder pad, and working the fullness towards the armhole. Baste along front of armhole and down the back edge of the interlining. | 301 or Hand | | | Commercial | |
| 44. | Baste bridle tape to lapel. | | | | | |
| | a. Position the 5/8-inch bridle tape adjacent to and behind the breakline from the gorge to 1 to 1-1/2 inches from lower end of lapel. | | | | | |
| | b. Baste the tape evenly and smoothly for a distance of 1-1/2 to 2 inches down from the gorge; continue basting for a distance of 4 to 5 inches, holding the tape taut and working in 3/8-to 1/2-inch breast fullness. Baste the remainder of the tape evenly, smoothly and without tension or fullness. Tape and interlining shall be stamp marked to assure proper fullness. | 301 or Hand | | | Commercial | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 45. | Pad labels. | | | | | |
| | a. Pad each lapel from approximately 1 inch from the front edge to the breakline with six rows of blindstitching, properly distributing the fullness in the interlining between the rows of stitches to roll the lapels. | 103 or 306 | SSm-1 | 4-8 | 000 000 | 000 |
| | b. Blindstitch both edges of bridle tape to interlining. | 103 or 306 | SSm-1 | 4-8 | 000 000 | 000 |
| | c. Press the left and right fronts on a suitable type heated pressing machine, with the chest to conform to shape of the body. | | | | | |
| 46. | Join back and fronts at sides. | | | | | |
| | Finished appearance. The back and fronts shall be carefully joined at the sides without twists, gathers, puckers or pleats. | | | | | |
| | a. Position the back and fronts with edges even and join together at the sides with a 3/4-inch seam. | 301 or 401 | SSa-1 SSa-1 | 10-14 10-14 | A A | A A |
| | b. Spread open the side seams and press flat with a heated pressing iron. | | | | | |
| 47. | Tape armholes. | | | | | |
| | a. Sew 1/4-inch-wide tape around the armhole from a point 1 to 1-1/2 inches above notch on the fronts to 3/4 to 1 inch from shoulder edge on the back. | 301 or 401 | SSaa-1 | 10-14 | A | A |
| | b. From the front notch to 1-1/2 to 2 inches back of the underarm seam, the tape shall be stitched with slight tension and from this point up to 1-1/2 to 2 inches above the notch on the back, the tape shall be held taut while stitching and gathering 1/4 to 3/8 inch fullness. | 301 or 401 | SSaa-1 | 10-14 | A | A |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 48. | Press armholes, shoulder blades and lapels.<br><br>a. Press the armhole tapes, the shoulder blades and the lapels smooth and flat with a heated pressing iron or suitable type pressing machine. | | | | | |
| 49. | Shape fronts.<br><br>a. Mark and shape the front edge of the coat; and mark and shape the lapels in accordance with shaper furnished. The left front edge shall be dressed from bottom notch of coat to base of lapel.<br><br>b. Mark the fronts 1-1/2 inches below the bottom edge of the lower pockets for the bottom turnup. Trim the excess material if necessary. In the finished coat, the bottom turnup shall be 1 $\pm$1/8 inches wide. Side seams and left vent shall not be mitered at the bottom.<br><br>c. Trim coat front interlining 1/4 inch back from top and front edges of lapel and front edge of coat. Trim the bottom of the interlining 1/4 inch above the mark for the bottom turnup and the bottom edge of coat, matching the length of right and left backparts at the vent.<br><br>-or-<br><br>d. Marking and shaping the front edges and lapels, and trimming the bottom edge of the coat may be accomplished with a clicker machine using dies conforming to pattern furnished. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 49. | Shape fronts. (cont'd) | | | | | |
| | e. In the finished coat, the left front shall overlap the right front at the bottom edge, and the lapels shall be 2-7/8 ± 1/8 inches wide for all sizes. | | | | | |
| 50. | Bind bottom turnup. | | | | | |
| | Finished appearance. The binding shall be uniformly stitched and shall not be tight or full causing puckers, gathers, or pleats. The basic material and edges of binding shall be securely caught in the stitching. | | | | | |
| | a. Bind the raw edge of the bottom turnup with bias binding, turning under the outside raw edge of binding only and catching the turned under portion in the stitching 1/16 inch from the inner folded edge. The binding shall extend from the back edge of the front cutout to the edge of the vent at the center back. | 301 | BSb-1 | 10-14 | A | A |
| 51. | Baste facing-lining assemblies to fronts. | | | | | |
| | a. Position the right and left facing lining assemblies on the outside of the respective fronts and baste along the breakline, distributing the fullness in the breast area. Continue to baste along the front and bottom edges. Baste from the top and front edge of lapel down to the lower end of lapel, working the fullness towards the center of lapel. | 301 or Hand | | | Commercial | |
| 52. | Join facings and fronts with polyester/cotton tape. | | | | | |
| | a. Join the facings to front 3/16 inch from top and front edges of lapels and front and bottom edges | 301 | SSab-1 | 10-14 | A | A |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 52. | Join facings and fronts with polyester/cotton tape. (cont'd) | | | | | |
| | of coat, with the 1/2-inch-wide polyester/cotton tape positioned on the interlining side of fronts and caught in the stitching. | | | | | |
| | b. The polyester/cotton tape shall extend from 1/2 inch to the back of the lapel notch to 1-1/2 to 2 inches beyond back edge of facing, except the tape is not required along the step of the right front. The tape shall be sewn with normal tension along the top and front edges of the lapel and with slight tension along the front edge of the coat. | | | | | |
| | c. Fell inside edge of 1/2-inch-wide stay tape to the coat front interlining from top end of tape to the bottom edge of interlining. | 103 | SSm-1 | 4-6 | A | A |
| | d. Remove all basting stitches, trim lower front corner of the facings and corner of lapels, and notch the lapels for proper turning. | | | | | |
| | e. Press edges flat and smooth with a heated pressing iron. Edge seam is to be pressed open. | | | | | |
| 53. | Baste front and bottom edge of coat. | | | | | |
| | a. Turn the facing-lining assemblies to the inside of the fronts, completely working out the corners of the lapel. Turn up the bottom of the coat, lapping the facing on the bottom turnup and completely working out the front corner. | | | | | |
| | b. Baste along the top and front edges of the lapels, the front (including the step of the right front) and finished bottom edges of the coat, working the seams to the edge of the coat. | 101 or Hand | | | Commercial | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 54. | Fell bottom turnup. | | | | | |
| | a. Fell the bound edge of the bottom turnup to the fronts and backs with blindstitching. | 103 | | 6-8 | O (silk) | |
| | | or 306 | | 6-8 | O (silk) | |
| | | or Hand | | 6-8 | O (silk) | |
| 55. | Baste facings (second time). | | | | | |
| | a. Baste the facings to the front approximately 1-1/4 inches from the top and front edges of the lapel and front and bottom edge of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward. | 301 or Hand | | | Commercial | |
| | b. Baste the lapels diagonally from the corner to the breakline, properly placing the fullness to allow the lapels to roll. | 301 or Hand | | | Commercial | |
| | c. Baste along the breakline of the lapel, properly placing the fullness to allow the lapels to roll. | 301 or Hand | | | Commercial | |
| | d. Baste as close to the facing lining seam line as possible, placing the fullness over the chest, and continue basting along the bound edge of the facing to the bound edge of the bottom turnup of the coat. | 301 or Hand | | | Commercial | |
| 56. | Fell facings to fronts and tack to interlining. | | | | | |
| | a. Fell the bound edge of the left facing to left front with blind-stitching from the bound edge of the bottom turnup to the lower edge of the front interlining at the waist. | 103 | EFc-1 (b) | 6-8 | O (silk) | O |
| | | or Hand | | | C (silk) | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 56. | Fell facings to fronts and tack to interlining. (cont'd) | | | | | |
| | b. Tack the back edge of the left facing to the interlining only, to not more than 3 inches below the shoulder edge. | 301 or 103 or Hand | SSm-1 | 4-6<br>4-6<br>8-10 | A<br>A<br>C (silk) | A |
| | c. Fell the bound edge of the right facing to the right front with blindstitching from the bound edge of the bottom turnup to not less than 2 inches above the bottom finished edge of the front lining. | 103 or Hand | EFc-1 (b) | 6-8 | O (silk)<br>C (silk) | O |
| | d. Tack the back edge of the right facing to the front interlining only, with one row of blindstitching from not more than 3 inches from shoulder edge to not more than 1 inch above inside pocket opening. Continue the tacking along the outer ply of inside pocket seam allowance the length of the pocket (see 77.c for alternate operation). | 103 or Hand | SSm-1 | 4-6<br>8-10 | A<br>C (silk) | A |
| 57. | Baste yoke lining to back. | | | | | |
| | a. Position and baste the one-piece rayon yoke lining to the inside of the back along the center pleat, armholes, shoulder (allowing room for shoulder pad) and bottom edge of the yoke. | 301 or Hand | | | Commercial | |
| 58. | Baste and fell front lining. | | | | | |
| | a. When necessary, trim the back end of lower pocket stays away from the side seam. | | | | | |
| | b. Tack the upper back corner of inside pocket to coat front interlining. | Hand or Machine | | 4 per tack (minimum) | Commercial | |
| | c. Fold the front lining, forming the chest pleat at the armhole. Continue to baste across the pleat and toward the lower edge of | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 58. | Baste and fell front lining. (cont'd) | | | | | |
| | armhole, along the side seam and across the bottom edge of lining. The folded edge of the chest pleat on the outside of the lining shall be towards the bottom. | | | | | |
| | d. Turn under the back edge of front lining and baste to coat, lapping the folded edge over the side seam and yoke lining and basting to allow room for felling of side seam lining. | Hand or 301 | | | Commercial | |
| | e. Fell the turned-under portion of the front lining to side seam allowance of the fronts and to the yoke lining with blindstitching 1/4 to 3/8 inch from folded edge. Stitching shall extend from bottom finished edge of front lining to the lower edge of armhole. The blindstitching shall not be exposed on the face side of the lining nor shall the blindstitching be exposed on the outside of front (basic material). | 103 or Hand | EFc-1 (b) | 6-8<br>8-10 | O (silk)<br>C (silk) | O |
| 59. | Trim front lining and interlining. | | | | | |
| | a. Trim the excess coat front interlining and front lining at the armhole. | | | | | |
| | b. Trim the yoke lining even with the back at the neck. | | | | | |
| 60. | Baste shoulder pads. | | | | | |
| | a. Insert shoulder pad between interlining and chest padding of coat front interlining in line with the armhole edge and securely tack pad to the interlining and chest padding only. | 301 or Hand | | | Commercial | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 61. | Seam shoulders.<br><br>Finished appearance. The shoulder seam shall be uniformly stitched and the fullness on the backs shall be properly placed in order that the shoulder may be properly shaped. The shoulder seam shall finish without a distorted appearance. | | | | | |
| | a. Join the fronts and back together at the shoulders with a 3/8-inch seam, working in the proper fullness on the backs in accordance with good manufacturing practice. | 301<br>or<br>401 | SSa-1<br><br>SSa-1 | 10-14<br><br>10-14 | A<br><br>A | A<br><br>A |
| | b. Spread open the shoulder seam and press flat, holding the shoulder short and exercising much care in the pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block. | | | | | |
| 62. | Set shoulder straps (see figures 6 and 7).<br><br>Finished appearance. The shoulder straps shall be properly positioned and uniformly stitched to the coat without twists, puckers, pleats or other distortion. On the finished coat, the straps shall be 2 1/4 ± 1/8 inches wide at the armhole seam and shall taper to 1-1/2 ± 1/8 inches at buttonhole eyelet end. | | | | | |
| | a. Position the shoulder straps with the pointed end of the strap even with the edge of the neck, and with the seam of shoulder strap matching the shoulder seam at the armhole edge. | | | | | |
| | b. Seam the shoulder straps to the coat 1/8 to 1/4 inch from the armhole edge. Trim the shoulder strap even with the armhole, where necessary. | 301 | SSa-1 | 10-14 | A | A |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 63. | Baste shoulder. | | | | | |
| | a. Position shoulder interlining and lining in place, baste upper part of each shoulder on the outside and turn the coat on the inside. | Hand or 301 | | | Commercial | |
| | b. Turn raw edge of yoke lining at the shoulders. Baste the upper part of each shoulder over the front lining and continue to baste across neck at back with the end of the back pleat caught in the basting. | Hand or 301 | | | Commercial | |
| | c. In lieu of basting the lining at the shoulder as required in 63.a and b, and hand felling as required in 76.g, trim the shoulder edge of the front lining and yoke lining to approximately 3/8 inch from shoulder at the armhole edge and tapering to 1/8 inch at the neck. Join the yoke lining to the facing-lining assembly at the shoulder with a 3/8-inch seam, working in the proper fullness on the back. In the finished coat, the yoke lining shall be lapped on the facing-lining assembly at the shoulder. | 301 | SSa-1 | 10-14 | A | A |
| 64. | Stitch hanger and size label. | | | | | |
| | Finished appearance. The size label and the ends of the coat hanger shall be centered and sewn to the inside center back of the coat at the neck. | | | | | |
| | a. Stitch the upper edge of the size label and the ends of the hanger to the inside center back of the coat at the neck. | 301 | SSa-1 | 10-14 | A | A |
| | b. The hanger opening in the finished coat shall be 2 ± 1/8 inches long when measured along the lower edge of the collar. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 65. | Set collar.<br><br>Finished appearance. The collar shall finish centered on the back seam with the fullness distributed over the shoulder to conform to and hug the neck.<br><br>a. Mark the coat on the outside around the neck from shoulder seam to shoulder seam 5/8 inch from top edge, and continue to mark along the gorge with the line of marking tapering to 3/8 inch at the lapel notch. | | | | | |
| | b. Join the top collar to the facing at the gorge from the lapel notch to a point not less than 1 inch in back of the lapel breakline. | 301 | SSa-1 | 10-14 | A | A |
| | c. Notch the facing at the end of the gorge seam, in back of the lapel breakline, the width of the seam without cutting the stitching of the seam. | | | | | |
| 66. | Tack top collar to fronts at gorge.<br><br>a. Spread open the seam joining top collar to facing and tack the seam allowance of the top collar to the front at the gorge from the lapel notch to the end of the seam, catching top end of bridle tape in the tacking. | Hand<br>or<br>301 | <br><br>SSa-1 | 2-4<br><br>10-14 | C<br>(silk)<br>A | <br><br>A |
| 67. | Baste undercollar to coat.<br><br>Finished appearance. The center seam of the undercollar shall be in line with center back seam of coat. Fullness in the collar shall be properly placed over the shoulders to permit the collar to lie flat.<br><br>a. Turn the collar to the outside with the lower neck of the undercollar lapped on the outside of the coat at the mark. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 67. | Baste undercollar to coat. (cont'd) | | | | | |
| | b. Securely tack the corners of the collar across the juncture point of the collar and the lapel. | Hand | | 5-8 per tack | C (silk) | |
| | c. Baste the undercollar to the front and back, placing proper fullness over shoulder. | Hand or Mach-ine | | | Commercial | |
| | d. In the finished coat, the ends of the collar and top edge of lapels shall each be 1-5/8 ± 1/8 inches when measured from the tacked corners to the finished edges of collar and lapel, respectively. | | | | | |
| 68. | Tack collar interlining to coat. | | | | | |
| | a. Raise the lower edge of the top collar and tack the collar interlining to upper edge of the coat and the yoke lining with overcast stitching from shoulder seam to shoulder seam. | Hand or 103 or 301 | SSm-1 SSm-1 | 2-3 3-4 3-4 | C (silk) O (silk) O (silk) | O |
| 69. | Baste top collar to coat. | | | | | |
| | a. Turn under the lower edge of the top collar and baste across neck. | Hand or 301 | | | Commercial | |
| | -or- | | | | | |
| | b. In lieu of operations 68a and 69a, join lower edge of top collar from gorge seam to gorge seam across neck. | 301 | SSa-1 | 10-14 | A | A |
| 70. | Edgestitch coat and collar. | | | | | |
| | Finished appearance. The coat shall be uniformly edgestitched the same gage as used on flaps and pockets. | | | | | |
| | a. Stitch the side and top edge of collar, top and front edge of the | 301 | SSb-1 (collar) | 10-14 | A (silk) | A |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 70. | Edgestitch coat and collar. (cont'd) | | | | | |
| | lapels, front edges of the coat (including the step of the right front), and continue the stitching along the bottom edge of the coat the width of the facings. | | SSe-2 (lapels) front & bottom edges of coat (shows finished seam) | | | |
| | b. The stitching shall be uniformly 1/8 inch from the edge. | | | | | |
| 71. | Set sleeves. | | | | | |
| | Finished appearance. The sleeves shall be properly and uniformly set and the fullness at the armholes shall be properly distributed. The armhold sleeve seam shall finish smooth and flat without twists, puckers or pleats. The armhole shall not be stretched or distorted due to pressing. | | | | | |
| | a. Position sleeves on outside of coat at the armholes, with back arm seam of sleeve matching notch in the back, and with notch in top sleeve and fronts matching. | | | | | |
| | b. Join the sleeves to the coat with a 3/8-inch seam, distributing the fullness in accordance with good manufacturing practice and catching the ends of the shoulder straps in the stitching. | 301 | SSa-1 | 10-14 | A | A |
| | | or 401 | SSa-1 | 10-14 | A | A |
| | c. Press the entire armhole smooth and flat with a heated pressing iron to remove the fullness. Press and remove the fullness using a heated iron from the upper part of the armhole sleeve seam from backarm sleeve seam over the shoulder area to approximately midway between shoulder and the notch at front edge of armhole, so that the sleeve seam finishes smooth and flat. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 72. | Baste armhole. | | | | | |
| | a. Position shoulder pad to armhole and baste around outside of armhole, with the stitches adjacent to and no more than 1/8 inch away from armhole seam, forcing out the armhole in the basting so that all fullness is removed from basic material between the lapel and armhole. Care shall be taken not to catch yoke or front lining in the basting on the inside of armhole. The basting stitches shall extend from the backarm seam of the sleeves to the front notch of the coat. Turn coat to inside. | 301 or Hand | | | Commercial | |
| | b. Baste around inside armhole, positioning yoke lining and front lining in place to inside of coat front interlining and shoulder pad around armhole, distributing fullness evenly so that armhole finishes smooth and without fullness, puckers, twists or pleats. | 301 or Hand | | | Commercial | |
| 73. | Baste underarm shield to coat. | | | | | |
| | a. Position the underarm shield on lining side of coat with raw edges even with lower edge of armhole. | | | | | |
| | b. Baste or tack underarm shield at the base of armhole. The shield shall not cover the opening of the inside pocket. | 301 or Hand | | | Commercial | |
| 74. | Tack armhole and stitch sleeve head pads. | | | | | |
| | Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole. | | | | | |
| | a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 74. | Tack armhole and stitch sleeve head pads. (cont'd) | | | | | |
| | from the raw edge of the armhole seam, and with the front end of the pad matching the notch in the fronts. | | | | | |
| | b. Stitch the sleeve head pad to the sleeve from end to end through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the armhole end of the stay for the upper pockets, the front and yoke linings, shields at base of armhole and shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, trimming away the excess material. | 301 | | 4-6 | 30/3 | 30/3 |
| 75. | Fell collar to coat. | | | | | |
| | a. Fell the lower edge of the entire length of under collar to the fronts and backs. | Hand or Machine or Hand type felling or | LSa-1 | 8-12 | C (silk) | |
| | | 306 | LSa-1 | 8-12 | O (silk) | O |
| | b. Fell the folded edge of the top collar to the coat from gorge seam to gorge seam, catching the top edge of the size label and the ends of the coat hanger in the stitching. | Hand | | 8-10 | C (silk) | |
| 76. | Fell linings. | | | | | |
| | a. Position the sleeve lining at the armhole with back and forearm seams of sleeves and linings matched. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and yoke linings at the armhole. Fell the sleeve lining to the coat | Hand | | 8-10 | C (silk) | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 76. | Fell linings. (cont'd)<br><br>around the entire armhole, placing the stitching over the folded edge of sleeve lining, distributing the fullness along the bias front of the armhole and back of armhole from shoulder seam area to 1 to 2 inches below backarm seam and back-stitching the lower armhole edge from approximately 1-1/2 inches to the front of forearm sleeve lining seam to the side seam of body lining. | | | | | |
| | -or- | | | | | |
| | b. Stitch the sleeve lining by machine to the armhole on the inside from forearm seam to backarm seam across undersleeve, and fell the balance of the sleeve lining to the armhole by hand. The forearm and backarm seams of sleeve linings shall be matched. | 301 and Hand | SSa-1 | 10-14<br>8-10 | A<br>C (silk) | A |
| | -or- | | | | | |
| | c. Machine stitch the lower portion of the armhole as required in 76.b. The remaining upper portion of the armhole shall be felled using machine duplicated hand felling with stitching placed over the folded edge of sleeve lining with the fullness distributed along the bias front of armhole and back of armhole from shoulder seam area to 1 to 2 inches below backarm seam.<br><br>NOTE: It is required that the machine duplicated hand stitching shall be equal to or better than felling stitches made by hand. | Machine Duplicated | | 8-10 | C (silk) | |
| | d. Fell the lower corners of the front lining to the facings and the front seam allowance. | Hand | | 8-10 | C (silk) | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 76. | Felling linings. (cont'd) | | | | | |
| | e. Fell the upper back edge of the front lining to the yoke lining, placing the stitching over the folded edge of the front lining. Fell the lower finished edge of the yoke lining to the side seam allowance. | Hand | | 8-10 | C (silk) | |
| | f. Tack bottom edge of armhole shields on the underside to lining. | Hand | | 4 per tack (minimum) | C (silk) | |
| | g. Fell the back lining and facing lining assembly together at the shoulders, placing the stitching over the folded edge of back lining. | Hand or Machine | 301 | 8-10<br>10-12 | C (silk) | |
| 77. | Tack facing and bottom turnup. | | | | | |
| | a. Fell the ends of the bottom turnup to the body of the coat at the vent. | Hand | | 8-10 | C (silk) | |
| | b. Fell the back edge of the facings to the coat from the bottom to the top edge of the bottom turnup. | Hand | | 8-10 | C (silk) | |
| | c. Tack the facings on the outside to the front edge of the inside pocket through the interlining with a hidden backstitch, extending for a distance of 5 inches down from, and in line with, the front end of the pocket opening. | Hand | | 4-6 | C (silk) | |
| 78. | Press left front. | | | | | |
| | a. Press left front smooth and flat, removing any fullness prior to marking and making buttonholes. | | | | | |
| 79. | Make buttonholes. | | | | | |
| | Finished appearance. The buttonhole shall be clean cut, well made, properly positioned, well worked | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| O | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 79. | Make buttonholes. (cont'd)<br><br>over gimp to fit a 40-line insignia button and the 34-line sewing hole button. The stitching shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the front and the purling of the buttonholes shall be on the outside. The waist seam shall not be open beyond the end of the waist buttonhole.<br><br>a. Mark the left front in accordance with the marks on the pattern for the location of four buttonholes. The mark for the bottom buttonhole shall be on the waist seam, the top buttonhole shall be on horizontal line with the eyelet of the buttonhole in the upper pocket flap, and remaining two buttonholes shall be evenly spaced. | | | | | |
| | b. Make one horizontal eyelet-end square bar type cut-first buttonhole, 1-1/8 inches long, at each of the marks, with the purling of the buttonhole to finish on the outside of the front. The inside edge of the eyelet end of the buttonhole shall be 1/2 inch from the front edge for sizes 30 to 34 and 5/8 inch from front edge for sizes 35 to 46. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside. | Buttonhole | | 50 per buttonhole (minimum) (not including bartack) | B (silk) | F |
| | c. Care should be exercised when making the buttonhole in the waist seam, so that the seam does not come open beyond the ends of the buttonhole. | | | | | |
| | d. Securely bartack the ends of each buttonhole and trim the ends of the gimp and thread. | Bartack | | 21 per bartack (minimum) | B (silk) | F |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOBBIN LT |
|---|---|---|---|---|---|---|
| 79. | Make buttonholes. (cont'd)<br><br>e. An automatic one-cycle buttonhole/bartack machine with cut-first attachment may be used to make the required eyelet end, square bar type buttonholes. Stitches and thread requirements remain the same. | | | | | |
| 80. | Clean coat.<br><br>a. Pull and remove all basting threads. Trim and remove all loose ends of thread and remove all spots, stains and shade tickets and markings without injury to the material. | | | | | |
| 81. | Press coat.<br><br>Finished appearance. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices.<br><br>a. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even.<br><br>b. Press the entire collar smooth and flat, smooth stretching where necessary to obtain the proper shape and to straighten the edges, working any fullness towards the center of the collar and removing the fullness by shrinking.<br><br>c. Press the upper front on a body machine, shrinking in and properly shaping the chest.<br><br>d. Press the lower front and pockets smooth and flat. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| ) | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 31. | Press coat. (cont'd)<br><br>e. Press the sides, working fullness towards the back.<br><br>f. Press the back smooth and flat, removing all fullness and lapping the left vent on the right vent.<br><br>g. Press the sleeves smooth and flat, creasing at the backarm and the forearm. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 1 to 1-1/2 inches above the bottom edge of the breast pockets. The backarm crease shall be in line with the forearm crease.<br><br>h. Block the shoulders to remove the fullness. Press shoulders smooth on a shoulder shaping machine with shoulder straps properly positioned over shoulder seam and pressed flat.<br><br>i. Press the armholes solid from the inside, creasing the armholes on the front, back, and armpit. The armpit and the back of the armhole shall be held short while pressing.<br><br>j. Block the armholes on a pressing buck, shrinking in the top sleeves.<br><br>k. Press the lapels smooth and flat, straightening the edges and working any fullness towards the center of the lapel and removing the fullness by shrinking.<br><br>l. Press the lapels, uniformly creasing on the lapel breakline from the gorge seam to approximately 3 inches above the top buttonhole. Then roll press the lapel to the front edge of the coat. | | | | | |

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LP |
|---|---|---|---|---|---|---|
| 81. | Press coat. (cont'd)<br><br>m. Press the collar on a collar machine, creasing on the breakline and shaping to obtain the proper contour while pressing.<br><br>n. Press lower edge of coat smooth, flat and even.<br><br>o. Remove all wrinkles and impressions from under the lapels, collar, shoulder straps and pocket flaps. Press lining throughout, removing all wrinkles and creases. Press the front and yoke lining pleats smooth and flat. Remove all gloss marks. | | | | | |
| 82. | Mark for buttons.<br><br>a. Mark the right front 1-5/8 inches in from the edge for the location of three 40-line insignia buttons and one 34-line sewing hole button to properly engage with the buttonholes in the left front.<br><br>b. Mark each shoulder for the location of one 27-line insignia button to properly engage with the buttonhole in the shoulder straps in order that the straps shall lie smooth and flat without twisting or bulging on the finished coat.<br><br>c. Mark each upper and lower pocket for the location of one 27-line insignia button to properly engage with buttonhole in the flaps. | | | | | |
| 83. | Sew on buttons.<br><br>Finished appearance. The buttons shall be securely sewn to the coat and shall properly engage buttonholes in left front, shoulder straps and upper and lower pocket flaps. The insignia buttons on the front and pockets shall finish with | | | | | |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 83. | Sew on buttons. (cont'd) | | | | | |
| | the head of the eagle in an upright position. The shoulder buttons shall finish with the head of the eagle towards the edge of the collar. When the coat is buttoned, the center of those buttons between the upper pockets shall be midway between the front edge of the pockets. | | | | | |
| | a. Sew one 40-line insignia button at each of the marks on the right front, except at the waist. The button shall be sewn through all plies of material with the head of the eagle in an upright position. | 101 or 301 or Hand | | 21 per button<br>21 per button<br>4-6 per button (double thread) | 20/4<br>20/4<br>20/4 | |
| | b. Sew one 34-line sewing hole button at the waist mark on the right front through all plies, necking the button for shank wrapping. | 101 or 301 or Hand | | 21 per button<br>21 per button<br>6-8 per button (double thread) | 20/4<br>20/4<br>20/4 | 20/4 |
| | c. Shank wrap the 34-line sewing hole button. | Hand or Machince | | 4 wraps (double thread<br>32 stitches per shank | 20/4<br>20/4 | |
| | d. Sew one 27-line insignia button at the mark on each upper and lower pocket. | 101 or 301 or Hand | | 21 per button<br>21 per button<br>4-6 per button (double thread) | 24/4<br>24/4<br>24/4 | 24/4 |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

| NO | OPERATION | STCH TYPE | SEAM/ STCH TYPE | STCH/ IN | NDL | BOB/ LPR |
|---|---|---|---|---|---|---|
| 83. | Sew on buttons. (cont'd) | | | | | |
| | e. Sew a 27-line insignia button at the mark on each shoulder. The button shall be sewn through all plies of material. The head of the eagle shall be towards the edge of the collar. | 101 or 301 or Hand | | 24 per button<br>21 per button<br>4-6 per button (double thread) | 20/4<br>20/4<br>20/4 | |
| 84. | Attach belt to coat. | | | | | |
| | a. Match belt to coat. Place the belt in the loops, thread the belt fastener through the underloop, and button. | | | | | |

3.7 Finished measurements. The finished coat shallconform to measurements shown in Tables II and III.

TABLE II - Coat Measurement 1/

| Size | Breast 2/ inches | Back Length 3/ inches | Sleeve Length 4/ inches | Belt Lenght 5/ inches |
|---|---|---|---|---|
| | | Extra short | | |
| 30 | 32 | 27-1/2 | 17 | 33-1/2 |
| 32 | 34 | 27-3/4 | 17 | 34-1/2 |
| 33 | 35 | 27-7/8 | 17 | 35-1/2 |
| 34 | 36 | 28 | 17 | 36-1/2 |
| 35 | 37 | 28-1/8 | 17 | 37-1/2 |
| 36 | 38 | 28-1/4 | 17 | 38-1/2 |
| 37 | 39 | 28-3/8 | 17 | 39 1/2 |
| 38 | 40 | 28-1/2 | 17 | 40-1/2 |
| 39 | 41 | 28-5/8 | 17 | 41-1/2 |
| 40 | 42 | 28 3/4 | 17 | 42-1/2 |
| 41 | 43 | 28-7/8 | 17 | 43-1/2 |
| 42 | 44 | 29 | 17 | 44-1/2 |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE II - Coat Measurement 1/

| Size | Breast 2/ inches | Back Length 3/ inches | Sleeve Length 4/ inches | Belt Lenght 5/ inches |
|---|---|---|---|---|
| | | Short | | |
| 30 | 32 | 28-1/2 | 18 | 33-1/2 |
| 32 | 34 | 28-3/4 | 18 | 34-1/2 |
| 33 | 35 | 28-7/8 | 18 | 35-1/2 |
| 34 | 36 | 29 | 18 | 36-1/2 |
| 35 | 37 | 29-1/8 | 18 | 37-1/2 |
| 36 | 38 | 29-1/8 | 18 | 38-1/2 |
| 37 | 39 | 29-1/4 | 18 | 39-1/2 |
| 38 | 40 | 29-1/2 | 18 | 40-1/2 |
| 39 | 41 | 29-5/8 | 18 | 41-1/2 |
| 40 | 42 | 29-3/4 | 18 | 42-1/2 |
| 41 | 43 | 29-7/8 | 18 | 43-1/2 |
| 42 | 44 | 30 | 18 | 44-1/2 |
| 43 | 45 | 30-1/8 | 18 | 45-1/2 |
| 44 | 46 | 30-1/4 | 18 | 46-1/2 |
| 46 | 48 | 30-1/2 | 18 | 48-1/2 |
| | | Regular | | |
| 30 | 32 | 29-1/2 | 19 | 33-1/2 |
| 32 | 34 | 29-3/4 | 19 | 34-1/2 |
| 33 | 35 | 29-7/8 | 19 | 35-1/2 |
| 34 | 36 | 30 | 19 | 36-1/2 |
| 35 | 37 | 30-1/8 | 19 | 37-1/2 |
| 36 | 38 | 30-1/4 | 19 | 38-1/2 |
| 37 | 39 | 30-3/8 | 19 | 39-1/2 |
| 38 | 40 | 30-1/2 | 19 | 40-1/2 |
| 39 | 41 | 30-5/8 | 19 | 41-1/2 |
| 40 | 42 | 30-3/4 | 19 | 42-1/2 |
| 41 | 43 | 30-7/8 | 19 | 43-1/2 |
| 42 | 44 | 31 | 19 | 44-1/2 |
| 43 | 45 | 31-1/8 | 19 | 45-1/2 |
| 44 | 46 | 31-1/4 | 19 | 46-1/2 |
| 46 | 48 | 31-1/2 | 19 | 48-1/2 |
| 48 | 50 | 31-3/4 | 19 | 50-1/2 |

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE II - Coat Measurement 1/

| Size | Breast 2/ inches | Back Length 3/ inches | Sleeve Length 4/ inches | Belt Lenght 5/ inches |
|---|---|---|---|---|
| | | Long | | |
| 30 | 32 | 30-1/2 | 20 | 33-1/2 |
| 32 | 34 | 30-3/4 | 20 | 34-1/2 |
| 33 | 35 | 30-7/8 | 20 | 35-1/2 |
| 34 | 36 | 31 | 20 | 36-1/2 |
| 35 | 37 | 31-1/8 | 20 | 37-1/2 |
| 36 | 38 | 31-1/4 | 20 | 38-1/2 |
| 37 | 39 | 31-3/8 | 20 | 39-1/2 |
| 38 | 40 | 31-1/2 | 20 | 40-1/2 |
| 39 | 41 | 31-5/8 | 20 | 41-1/2 |
| 40 | 42 | 31-3/4 | 20 | 42-1/2 |
| 41 | 43 | 31-7/8 | 20 | 43-1/2 |
| 42 | 44 | 32 | 20 | 44-1/2 |
| 43 | 45 | 32-1/8 | 20 | 45-1/2 |
| 44 | 46 | 32-1/4 | 20 | 46-1/2 |
| 46 | 48 | 32-1/2 | 20 | 48-1/2 |
| 48 | 50 | 32-3/4 | 20 | 50-1/2 |
| | | Extra long | | |
| 35 | 37 | 32-5/8 | 21-1/2 | 37-1/2 |
| 36 | 38 | 32-3/4 | 21-1/2 | 38-1/2 |
| 37 | 39 | 32-7/8 | 21-1/2 | 39-1/2 |
| 38 | 40 | 33 | 21-1/2 | 40-1/2 |
| 39 | 41 | 33-1/8 | 21-1/2 | 41-1/2 |
| 40 | 42 | 33-1/4 | 21-1/2 | 42-1/2 |
| 41 | 43 | 33-3/8 | 21-1/2 | 43-1/2 |
| 42 | 44 | 33-1/2 | 21-1/2 | 44-1/2 |
| 43 | 45 | 33-5/8 | 21-1/2 | 45-1/2 |
| 44 | 46 | 33-3/4 | 21-1/2 | 46-1/2 |
| 46 | 48 | 34 | 21-1/2 | 48-1/2 |
| 48 | 50 | 34-1/4 | 21-1/2 | 50-1/2 |

1/ Tolerance on all measurements: + 3/8 inch except tolerance on back length measurement only shall be + 3/4 - 3/8 inch. Tolerance is on 1/2 breast measurment.

2/ Breast measurement shall be taken with coat buttoned from folded edge to folded edge in line with pit of armhole and multiply by 2.

3/ Back length measurement shall be taken along center back seam from lower edge of undercollar to bottom edge of coat.

4/ Sleeve length measurement shall be taken along forearm seam from pit of armhole to bottom edge of cuff.

5/ Belt length measurement shall be taken along the center from end to end.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE III - Pocket and flap measurements 1/

| Upper Pockets and Flaps | | | | |
|---|---|---|---|---|
| Size (X-Short, Short, Regular, Long, X-Long) | 30-34 | 35-38 | 39-41 | 42-48 |
| Length of flap at center point. | 2-3/4 | 2-7/8 | 2-7/8 | 2-7/8 |
| Length of flap at sides. | 2 | 2-1/8 | 2-1/8 | 2-1/8 |
| Width of flap at top edge. | 4-1/2 | 5 | 5-1/2 | 6 |
| Width of pocket at top edge, side edge to side edge. | 4-1/4 | 4-3/4 | 5-1/4 | 5-3/4 |
| Length of pocket, top edge to bottom edge. | 5-1/2 | 6 | 6-1/2 | 6-1/2 |

| Lower Pocket and Flaps | | | | |
|---|---|---|---|---|
| Size (X-Short, Short, Regular, Long, X-Long) | 30-34 | 35-38 | 39-41 | 42-48 |
| Length of flap at center point. | 3-3/8 | 3-3/4 | 3-3/4 | 3-3/4 |
| Length of flap at sides. | 2-1/4 | 2-1/4 | 2-1/4 | 2-1/4 |
| Width of flap at top edge. | 6-1/2 | 7 | 7-3/4 | 8-1/2 |
| Width of pocket at top edge, side edge to side edge. | 6-1/4 | 6-3/4 | 7-1/2 | 8-1/4 |
| Width of pocket at bottom edge, side edge to side edge. | 8-1/2 | 9 | 9-3/4 | 10-1/2 |
| Length of pocket top to bottom edge, all sizes. | | | | |
| X-Short | 9-3/4 | | | |
| Short | 10 | | | |
| Regular | 10-1/4 | | | |
| Long | 10-1/2 | | | |
| X-Long | 11 | | | |

1/ Tolerance on all measurements ± 1/8 inch.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the levels set by the application acceptable quality levels (AQL's).

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4).
2. Quality conformance inspection (see 4.5).
3. In-process inspection (see 4.5.2)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in MIL-STD-1490.

4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table IV for characteristics noted.

TABLE IV - Test Methods

| Components | Characteristics | Rqmt. Para. | Test Method | No. deter. per sample Unit | Results Reported as |
|---|---|---|---|---|---|
| Cotton warp, hair wool filling cloth | Colorfastness to: Wet(dry) cleaning | 3.3.7 | 5622 | | |
| | Perspiration | 3.3.7 | 5680 | | |
| | Steam pressing | 3.3.7 | 5640 | | |
| Fasteners | Material identification 1/ | 3.3.16 | Std. comml. | 1 | Pass or fail |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE IV - Test Methods (cont'd)

| Components | Characteristics | Rqmt. Para. | Test Method | No. deter. per sample Unit | Results Reported as |
|---|---|---|---|---|---|
| Fasteners | Finish | 3.3.16 | Std. comml. | 1 | Pass or fail |
| | Size and type | 3.3.16 | Std. comml. | 1 | Pass or fail |

1/ Accept a certificate of compliance for this requirement.

4.5.1.1 Sampling. Sampling of components shall be as follows. The lot size for these sampling tests shall be as specified in MIL-STD-1490. If one or more sample units fail to meet any test requirements listed below, the lot represented shall not be acceptable.

| Components | Lot size expressed as | Sample unit for testing |
|---|---|---|
| Cotton warp, hair wool filling cloth | yards | 1/2 yard |
| Fastener, snap | 100 | 15 complete sets |

4.5.2 In-process inspection. Examination shall be made of the following operations to establish conformance to specified requirements. Whenever nonconformance is noted, correction shall be make to the items affected, the lot in progress, and to the operation. Parts which cannot be corrected shall be removed from production.

a. Visual and dimensional examination of the working patterns to determine that they conform to the Government patterns in all respects (see 3.5).

b. Visual and dimensional examination of the cut parts to determine that they are properly cut with respect to size, material directional requirements (warp and filling); that location marks and notches on the parts are located correctly; and that parts containing material defects and damages have been removed (see table I, operations 1. through 2.).

c. Visual examination of cut parts during assembly of the coat to determine proper shade matching (see operation 3., table I).



Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

d. Visual and dimensional examination of the upper and lower pockets and flaps to determine proper shape and correct dimensions (see table I, operations 13, 14, 15, and table III).

e. Visual examination of finished collars to determine correct placement of eyelets (see table I, operation 18 i.).

f. Visual examination of setting pockets and flaps to determine conformance to specification requirements (see table I, operation 41).

(1) Upper pockets and flaps.

(a) Horizontal alignment with each other.

(b) Front edge of upper pockets and flaps and pocket pleats in parallel alignment with front edge of coat.

(c) Top edge of upper flaps perpendicular to front edge of coat when buttoned.

(2) Lower pockets and flaps.

(a) Lower pocket flap parallel with waist seam.

(b) Front edge of flaps in line with front edge of upper pocket.

g. Visual examination of interlining fronts, setting bridle tape, padding label, tape armholes, and shape fronts to determine conformance to requirements (see table I, operation 43, 44, 45, 47, and 49).

h. Visual examination of shoulder strap to determine proper placement (see table I, operation 62).

i. Visual examination of sleeves (prior to basting lining to body of coat) to determine sleeves are set uniformly with fullness at armholes distributed without pleats and puckers (see table I, operation 71).

4.5.3 Examination of the end item. Prior to the formation of a lot and as a final step in the contractors production control plan, each coat shall be buttoned on a model form and examined for those defects indentified by an asterisk (*) and listed as selected defects in MIL-STD-1490. Any coat containing a selected defect shall not be included in the end item lot. The model forms used for the separate sizes of coat shall be as shown in Table V. The sample unit shall be one coat.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table V - Form Measurements (1)

| Coat Size(s) | Form Size | Chest | Waist | Seat |
|---|---|---|---|---|
| 30-32 | 30 | 32 | 26 | 32 |
| 33-34 | 32 | 34 | 28 | 34 |
| 35-36 | 34 | 36 | 30 | 36 |
| 37-38 | 36 | 38 | 32 | 38 |
| 39-40 | 38 | 40 | 34 | 40 |
| 41-42 | 40 | 42 | 36 | 42 |
| 43-44 | 42 | 44 | 38 | 44 |
| 46 | 44 | 46 | 40 | 46 |

(NOTE 1: Tolerance of 1/2 inch in all form measurements.)

4.5.4 Finished measurement examination. The provisions for the finished measurement examination of the finished coat shall be as specified in MIL-STD-1490 and Tables II and III of this specification.

4.5.5 Examination of packaging. Shipping containers that are fully prepared for delivery except for closure shall be subjected to the examination of preparation for delivery described in MIL-STD-1490. The occurrence of defects during this examination shall not exceed the applicable point value or defect limit specified in MIL-STD-1490.

5. PACKAGING

5.1 Preservation and packaging. Preservation and packaging shall be level A.

5.1.1 Level A. Each coat with belt attached, shall be laid on a flat surface, with the front of coat facing up. A bending or nonbending paperboard shoulder form conforming to figure 9 shall be inserted into the coat so as to fit snugly into the collar and shoulders. The buttonhole front shall overlap the button front. The sleeves shall be positioned full length so that sleeve ends rest over the lower pockets. The coat shall then be folded in half by bringing the collar portion down even with the bottom edge so that the folded coat measures not more than 23 by 15 inches.

5.2 Packing. Packing shall be level A, B, or commercial as specified (see 6.2).

5.2.1 Level A. Fifteen (15) coats, of one size only, shall be packed with the collar of every other coat in a reverse position, in a fiberboard shipping container conforming to class-weather resistant, grade V2s, size 3A of MIL-B-17757. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis-weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled, closed, and reinforced as specified in the appendix to the box specification.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.2 Level B.

5.2.2.1 Method 1. Fifteen (15) coats, of one size only, shall be packed with collar of every other coat in a reversed position, in a fiberboard shipping container conforming to class-domestic, size 3A of MIL-B-17757. The fiberboard used in fabricating the box shall be grade 275 and for lining grade 200. In addition, each container shall have the contents completely covered on top and bottom with a sheet of 60-pound minimum basis-weight kraft paper conforming to grade B of UU-P-268. Each shipping container shall be assembled and closed as specified in the appendix to the box specification. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.2.2 Method 2. When specified (see 6.2), three level B shipping containers (45 coats of one size only) shall be overpacked in a fiberboard shipping container conforming to class-weather resistant class, size 4, of MIL-B-17757, reinforced as specified in the appendix to the box specification. Towards the end of the contract or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.3 Commercial. Coats shall be packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight and National Motor Freight Classification Rules and U.S. Postal Service Manual or regulations of other carriers applicable to the mode of transportation.

5.3 Marking. In addition to any special marking required by the contract, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

5.3.1 Mixed sizes. Each shipping container that is packed with mixed sizes shall have, securely attached to the end and side, directly under the printing or stenciling, a white paper label 5 inches by 4 inches. The words "MIXED SIZES" shall be plainly stamped or printed on the label and the quantity and sizes of the coats contained in the shipping container shall be legibly stamped or printed thereon.

5.4 Palletization. When specified (see 6.2), coats packed as specified in 5.2 shall be palletized on a 4-way entry pallet in accordance with load type 1A of MIL-STD-147. Each prepared load shall be bonded with primary and secondary straps in accordance with bonding means C, K and L or O or P. Pallet pattern shall be in accordance with the appendix of MIL-STD-147. The pallet shall be 4-way, Type I, Class 1, Style 1, Size A, Wood Group I, II, III, or IV

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

of MIL-P-15011, or, 4-way, Type IV, V or VIII, Class 1, Style A, Size 2, Wood Group I, II, III or IV, Grade A of NN-P-71. Interlocking of loads shall be effected by reversing the pattern of each course. If the container is of a size which does not conform to any of the patterns specified in MIL-STD-147, the pallet pattern used shall be approved by the contracting officer.

6. NOTES

6.1 Intended use. The coat covered by this specification is intended to be worn by male personnel of the U.S. Marine Corps.

6.2 Ordering data.

6.2.1 Acquisition requirements. Acquisition documents should specify the following:

(a) Title, number, and date of this specification.
(b) Size required (see 1.2)
(c) When first article is required (see 3.2).
(d) Level of packing required (see 5.2).
(e) When level B, method 2, packing is required (see 5.2.2.2).
(f) When palletization is required (see 5.4).

6.2.2 Data requirements. When this specification is used in an acquisition and data are required to be delivered, the data requirements identified below shall be developed as specified by an approved Data Item Description (DD Form 1664) and delivered in accordance with the approved Contract Data Requirements List (CDRL), incorporated into the contract. When the provisions of DoD FAR Supplement, Part 27, sub-part 27.410-6 (DD Form 1423) are invoked and the DD Form 1423 is not used, the data specified below shall be delivered by the contractor in accordance with the contract or purchase order requirements. Deliverable data required by this specification are cited in the following paragraphs.

| Paragraph no. | Data requirements | Applicable DID No. | Option |
|---|---|---|---|
| (a) 4 | Inspection System Program Plan | DI-R-4803 | ------ |
| (b) 4.4 | First Article Inspection Procedure | DI-T-4901 | ------ |
| (c) 4.4 | First Article Inspection Report | DI-T-4902 | ------ |
| (d) 4.5 | Production Inspection Report | DI-T-4904 | ------ |

(Data item descriptions related to this specification, and identified in section 6 will be approved and listed as such in DoD 5000.19L., Vol.II, AMDSL. Copies of data item descriptions required by the contractors in connection with specific acquisitions functions should be obtained from the Naval Publications and Forms Center or as directed by the contracting officer.)

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

6.3 Standard sample. The standard sample and color sample may be obtained from the procuring activity or as directed by the contracting officer.

6.4 First article. Examination, tests and approval shall be as specified by the contracting officer (see 3.2).

6.5 Figures. Figures 1 through 8 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

6.6 Changes from previous issue. Asterisks are not used in this revision to identify changes with respect to the previous issue, due to the extensiveness of the changes.

Preparing Activity:
Navy-MC
Project No. 8405-N994

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TO KEEP YOUR COAT LOOKING SMART INSIST ON IT BEING PROPERLY PRESSED.

## PRESSING INSTRUCTIONS

1. AVOID PRESSING DRY OR WITH TOO HOT AN IRON.
2. REMOVE ALL GLOSS FROM EDGES AND SEAMS BY PRESSING WITH DAMP CLOTH.
3. CREASE ONLY LOWER THREE-FOURTHS OF SLEEVES.
4. CREASE COLLAR BREAKLINE SOLID.

**INSTRUCTION LABEL**

FIG. 1 COAT,MAN'S:POLYESTER/WOOL,GREEN W/BELT



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

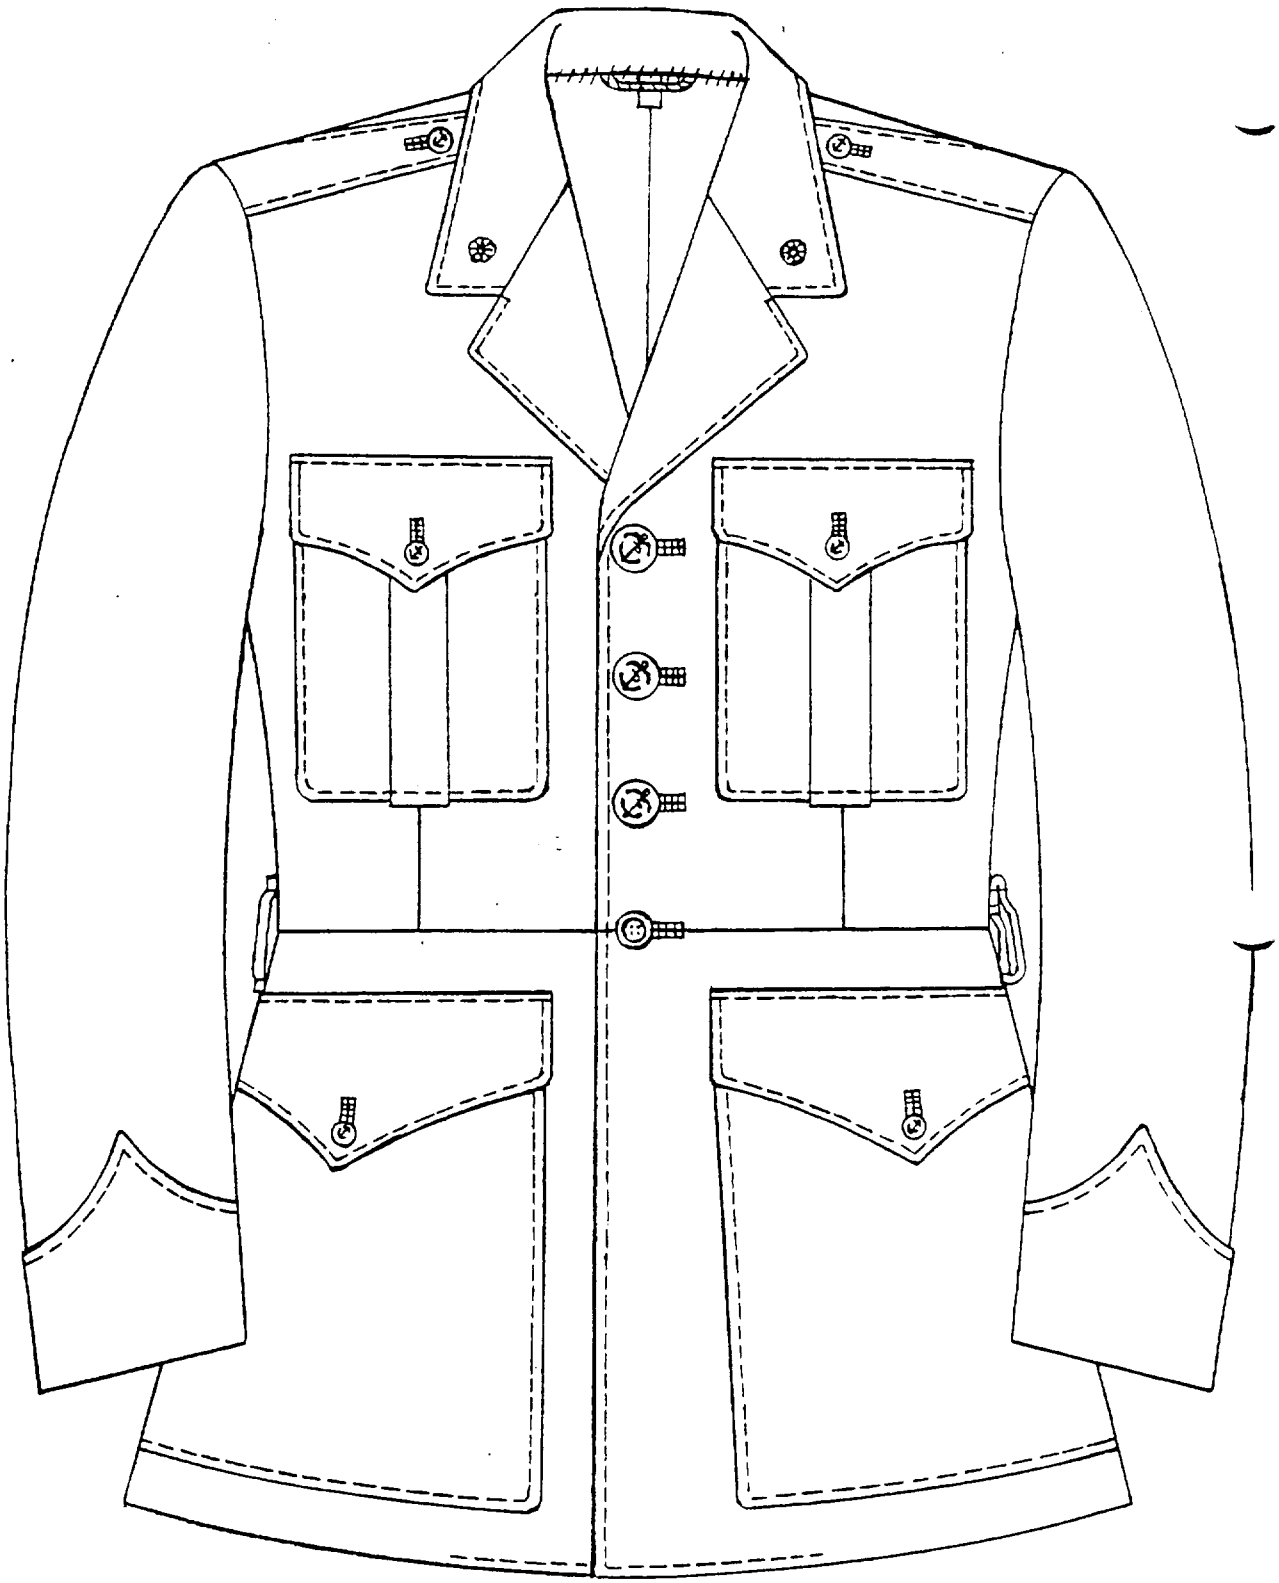


FIG. 2. COAT, MAN'S: POLYESTER/WOOL, GREEN, W/ BEL



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

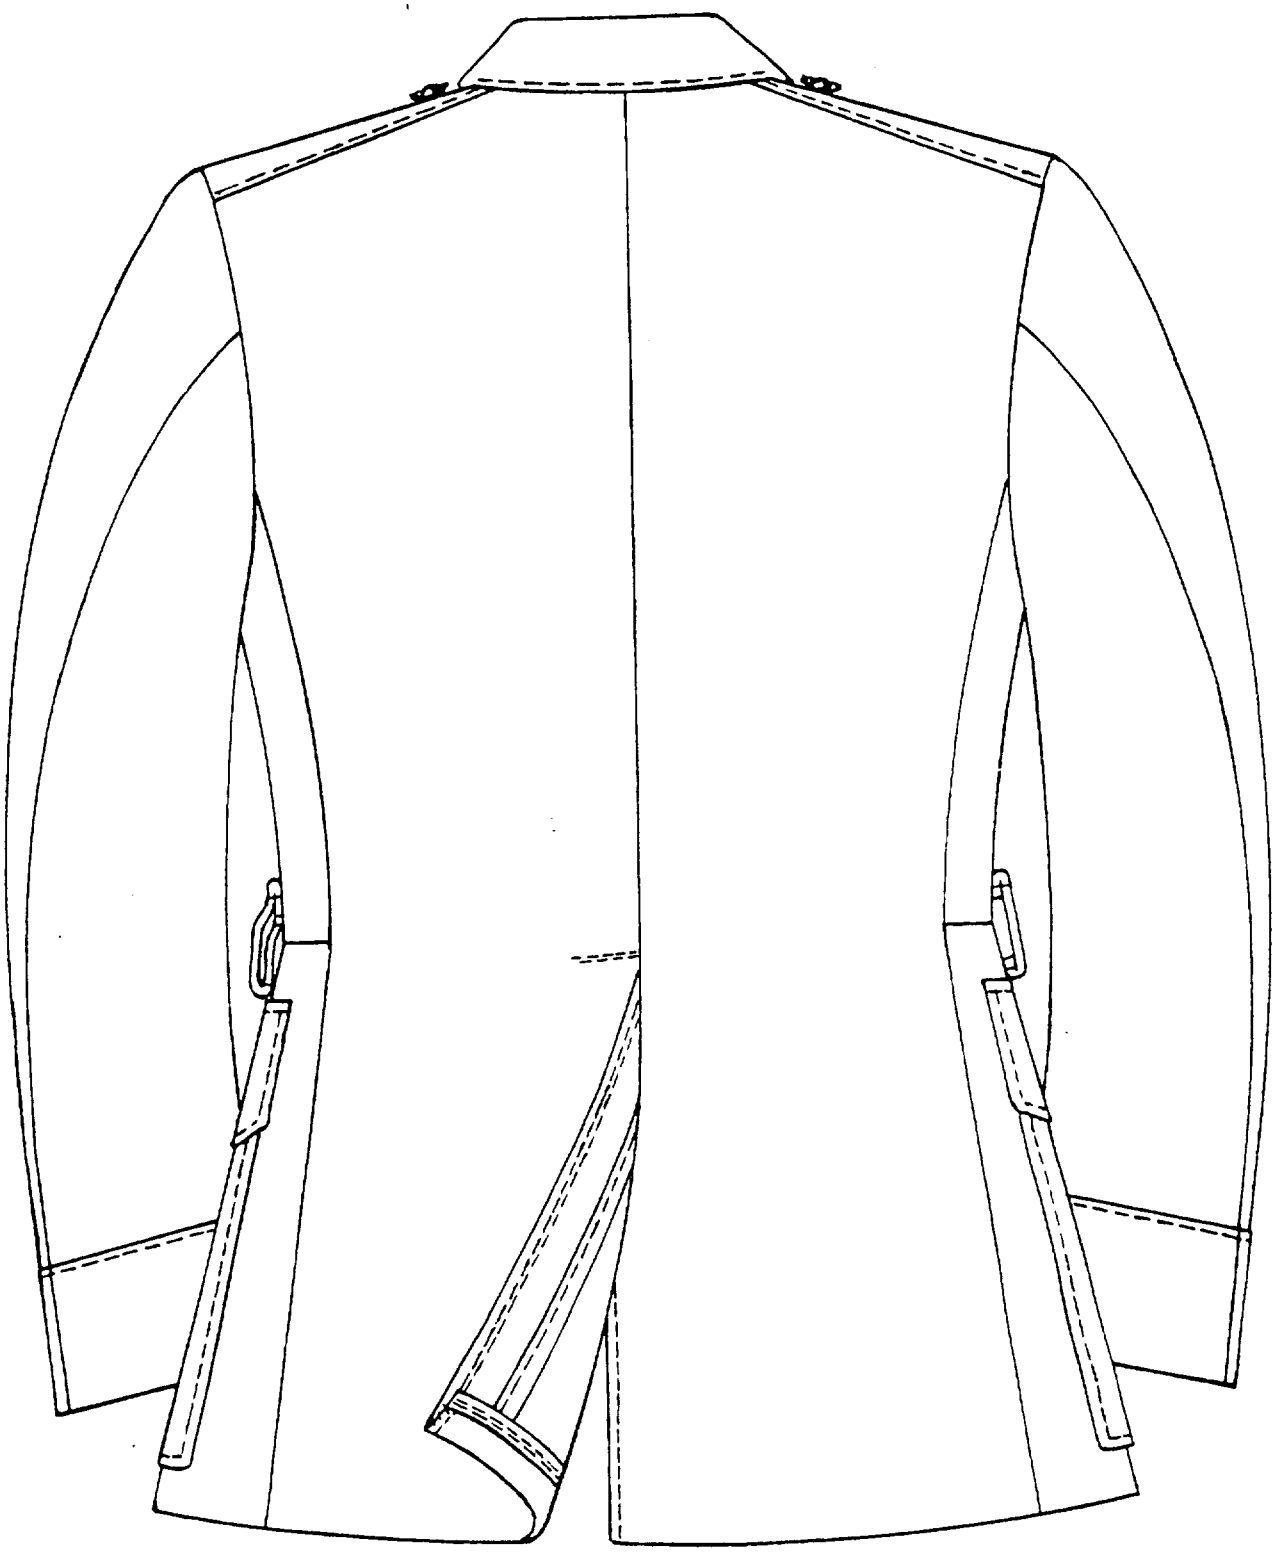


FIG. 3 COAT, MAN'S: POLYESTER/WOOL, GREEN, W/ BELT



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

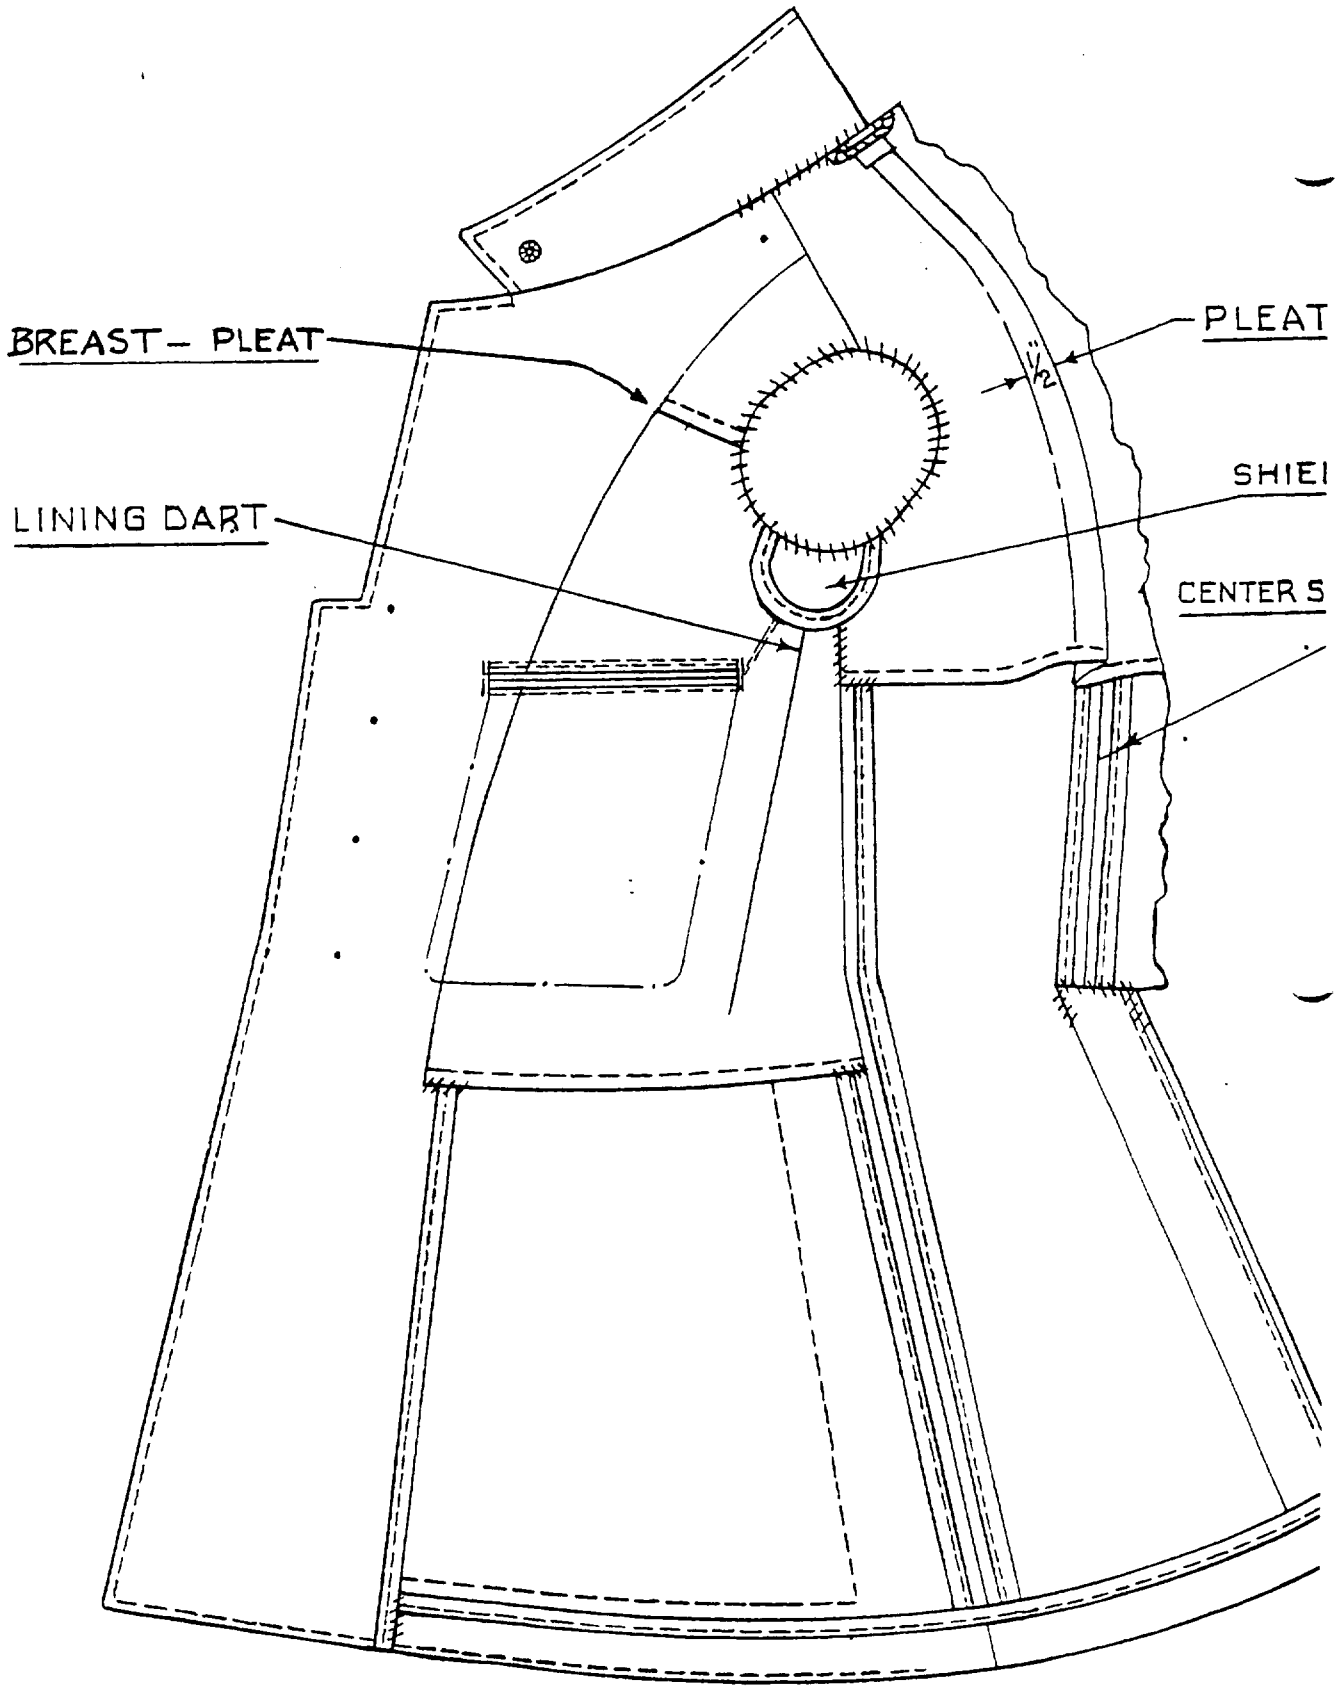



FIG 4 COAT, MAN'S: POLYESTER/WOOL, GREEN, W/ BF



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.


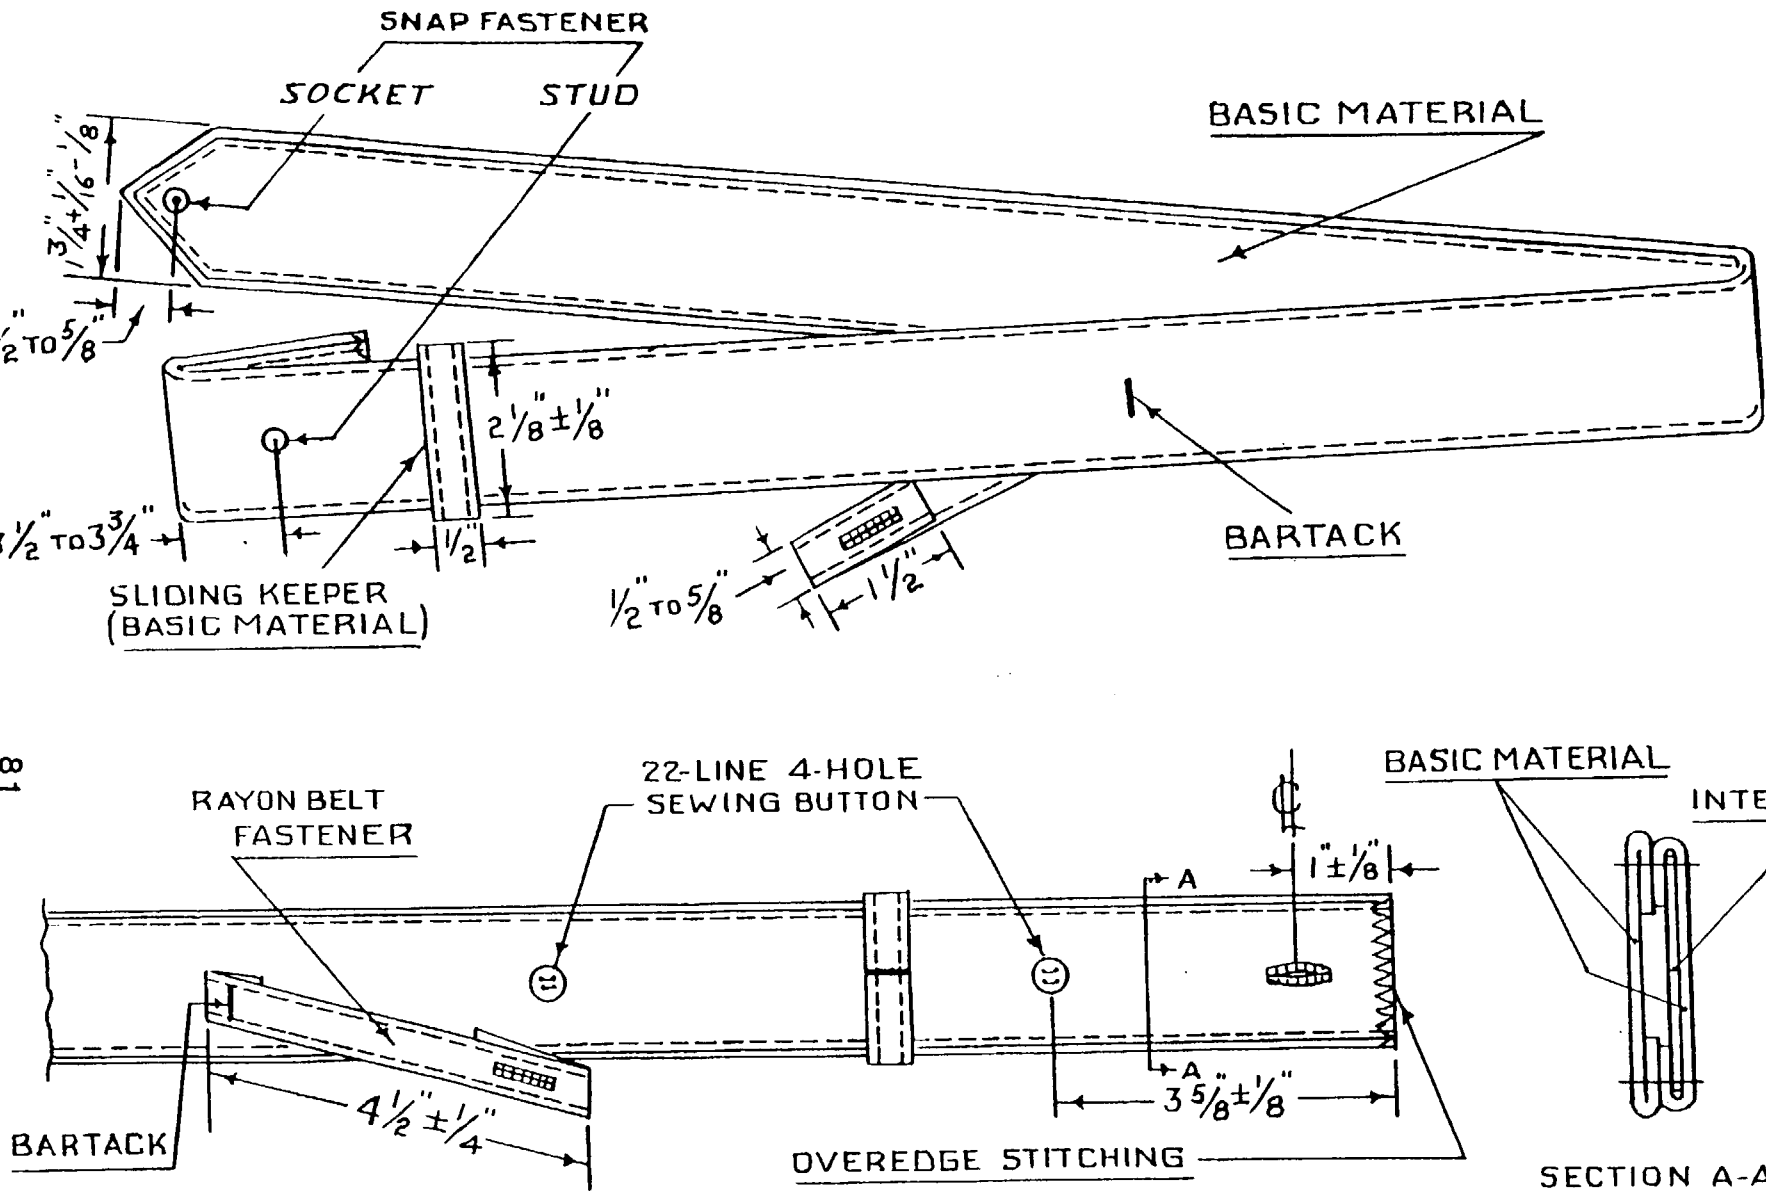



FIGURE 5. COAT, MAN'S: POLYESTER/WOOL, GREEN, W/BELT


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

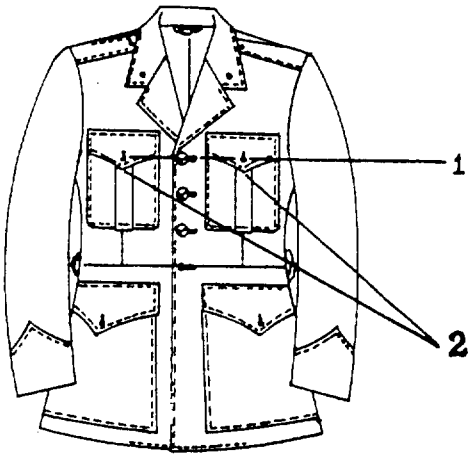


VIEW A

1. Breast Pocket Flap Buttons And Top Front Button Shall Be In Horizontal Alignment Thru Center Of Buttons.


2. Point Of Breast Pocket Flaps Shall Be Centered On Patch Pocket Pleat.

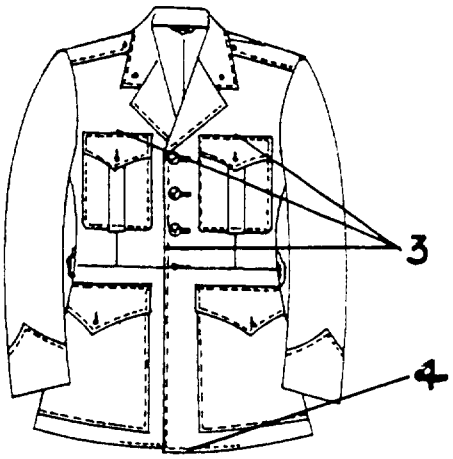


VIEW B

3. Top Edge Of Breast Pocket Flaps Shall Be Perpendicular With The Front Edge Of Coat When Buttoned.


4. Left Front Bottom Edge Shall Be Even With Right.

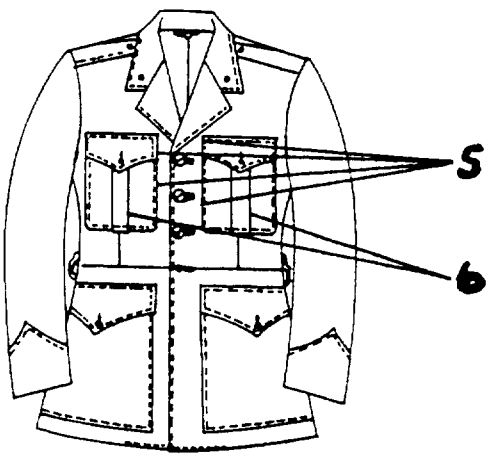


VIEW C

5. Front Edge Of Flaps And Patch Pockets Shall Be Parallel To Front Edge Of Coat When Buttoned.

6. Pleat Of Patch Pocket Shall Be Parallel With Front Edge Of Coat When Buttoned.

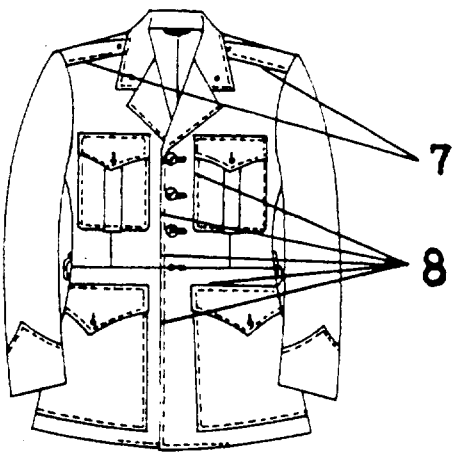


VIEW D

7. Shoulder Straps Shall Be Flat And Smooth Without Distortion.

8. Breast Patch Pockets Shall Be In Horizontal Alignment With Top Front Corner Of Lower Flaps And Front Edge Of Coat When Buttoned.

FIG 6. COAT, MAN'S, POLYESTER/WOOL, GREEN, W/ BELT

Source: https://assist.dla.mil -- Downloaded: 20260126T043822
Check the source to verify that this is the current version before use.

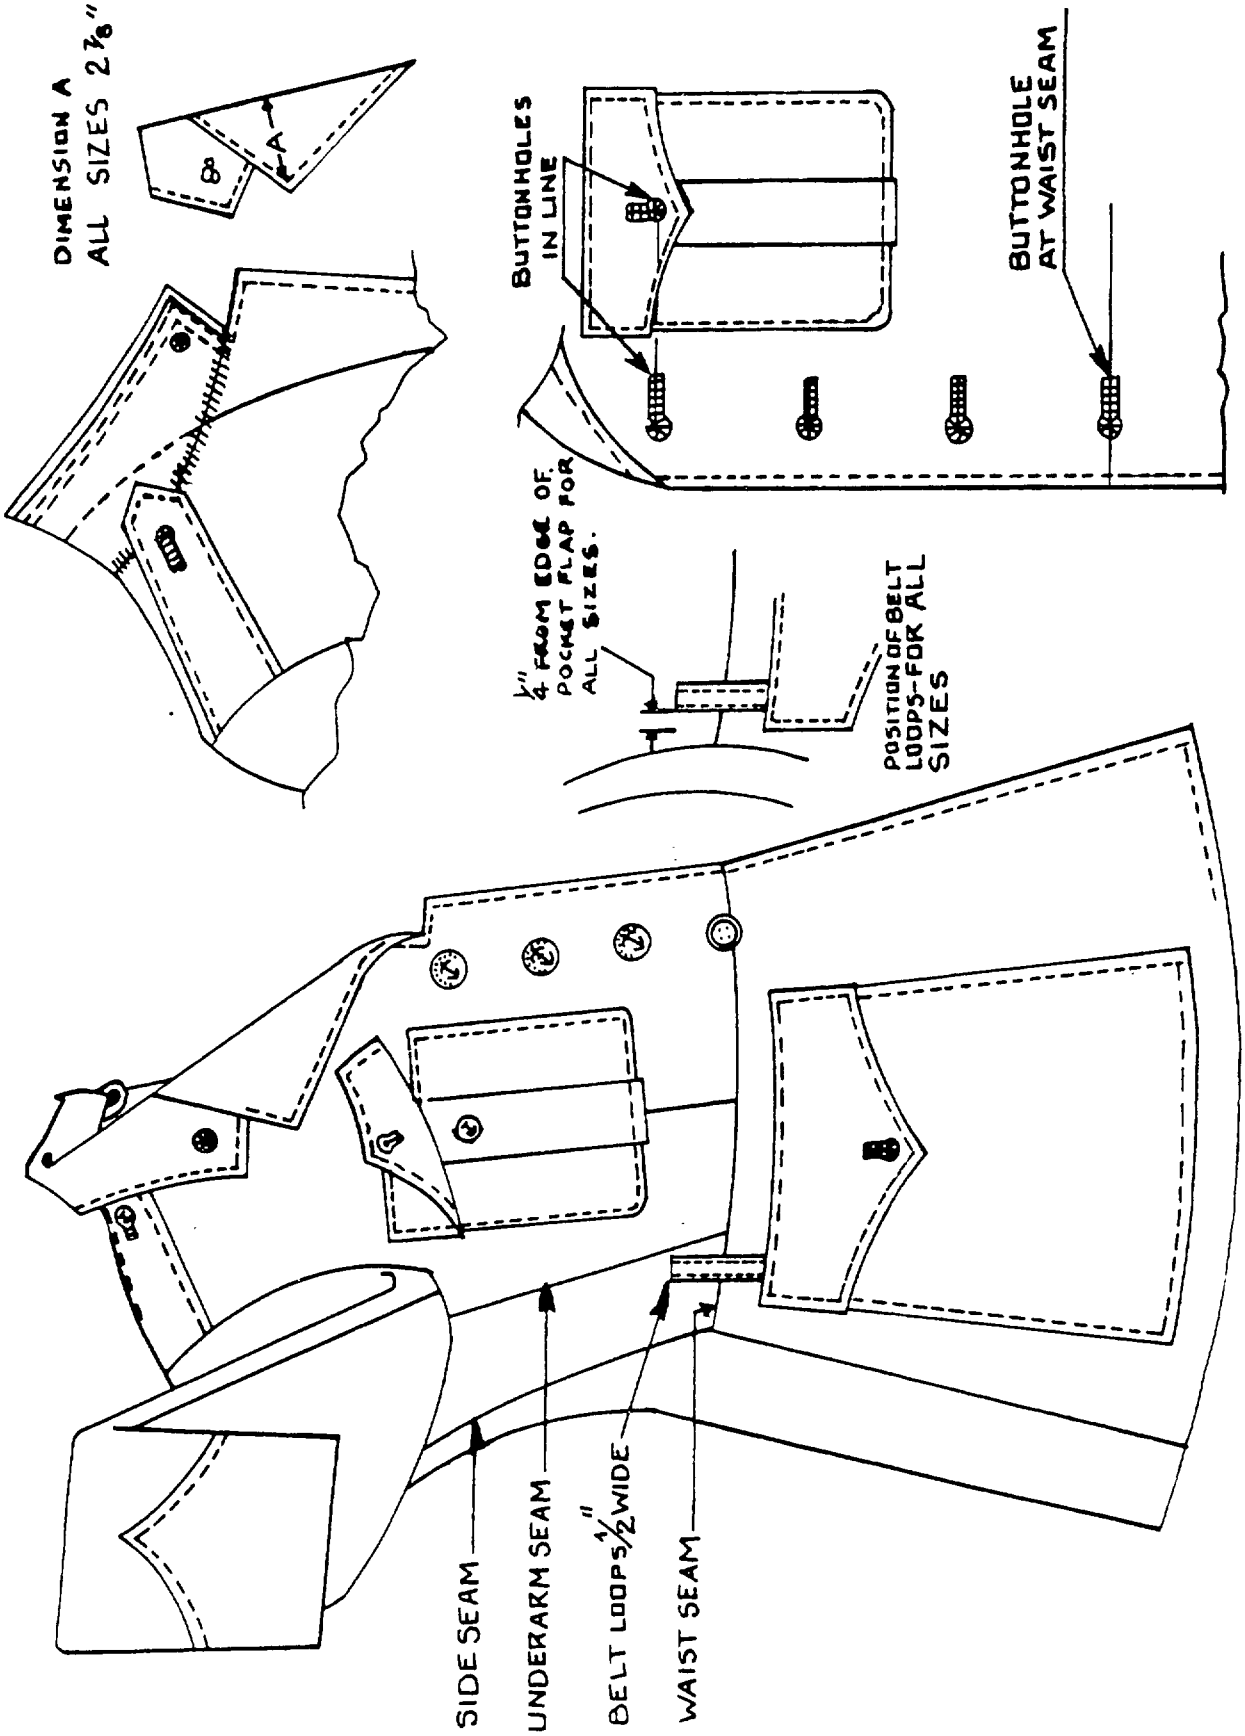



FIGURE 7 COAT, MAN'S: POLYESTER/WOOL, GREEN, W/BELT

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.


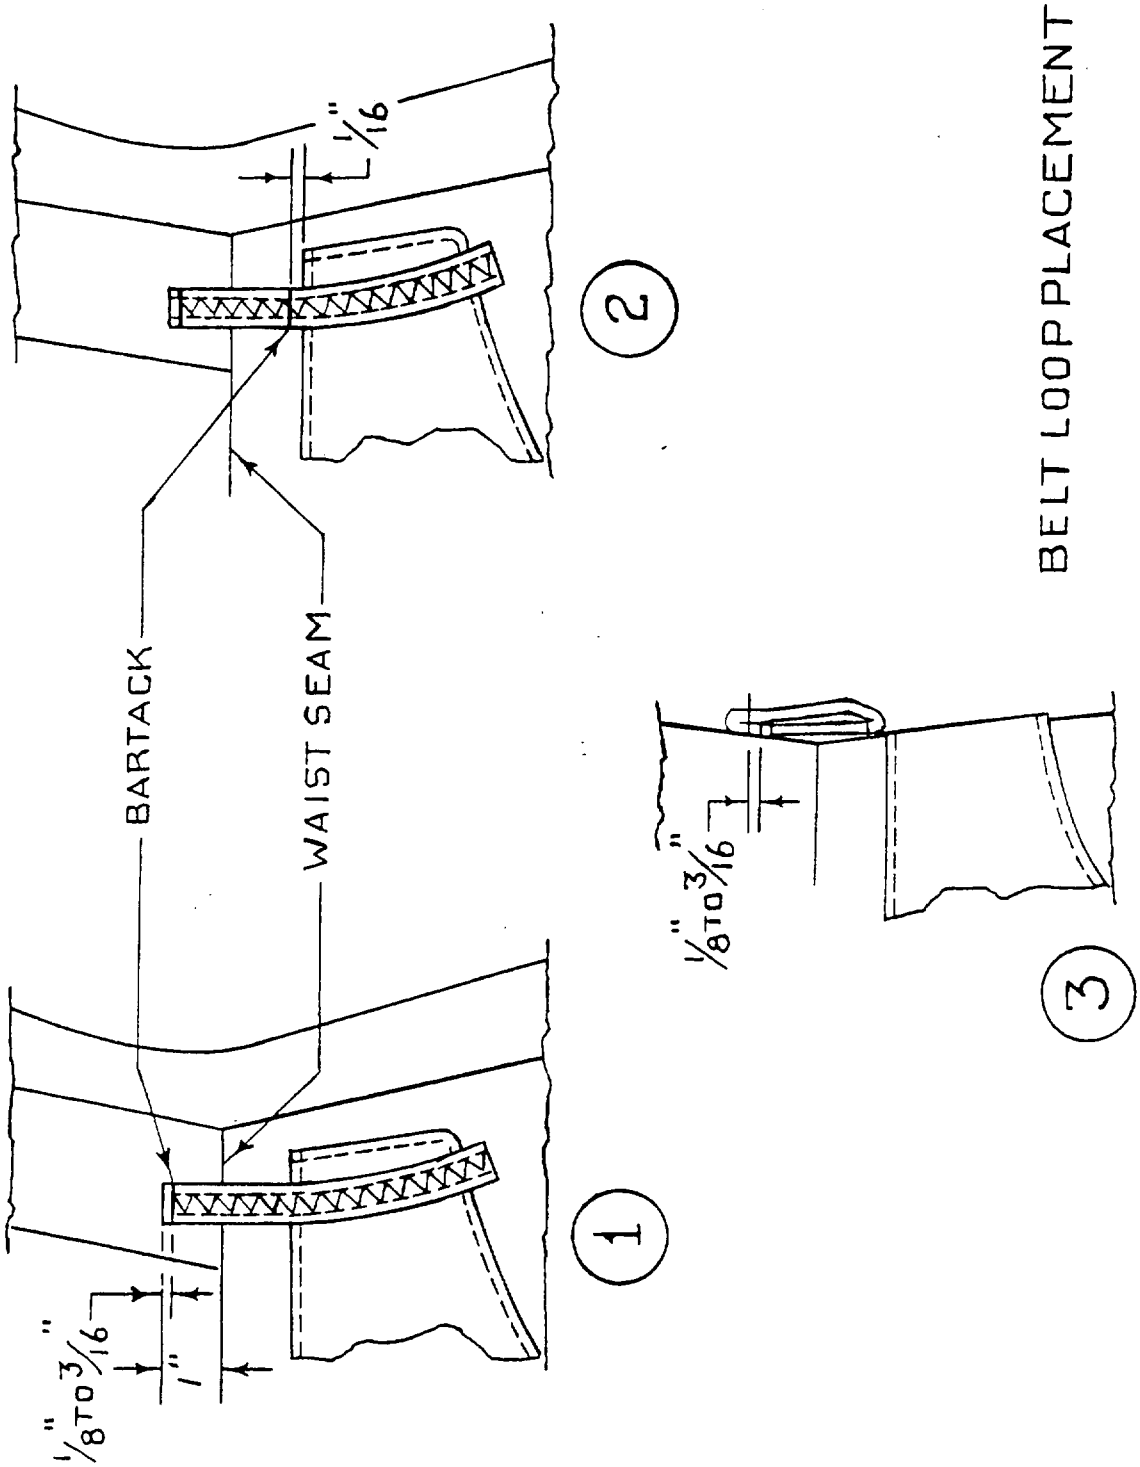



FIGURE 8. COAT, MAN'S: POLYESTER/WOOL, GREEN, W/BELT



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

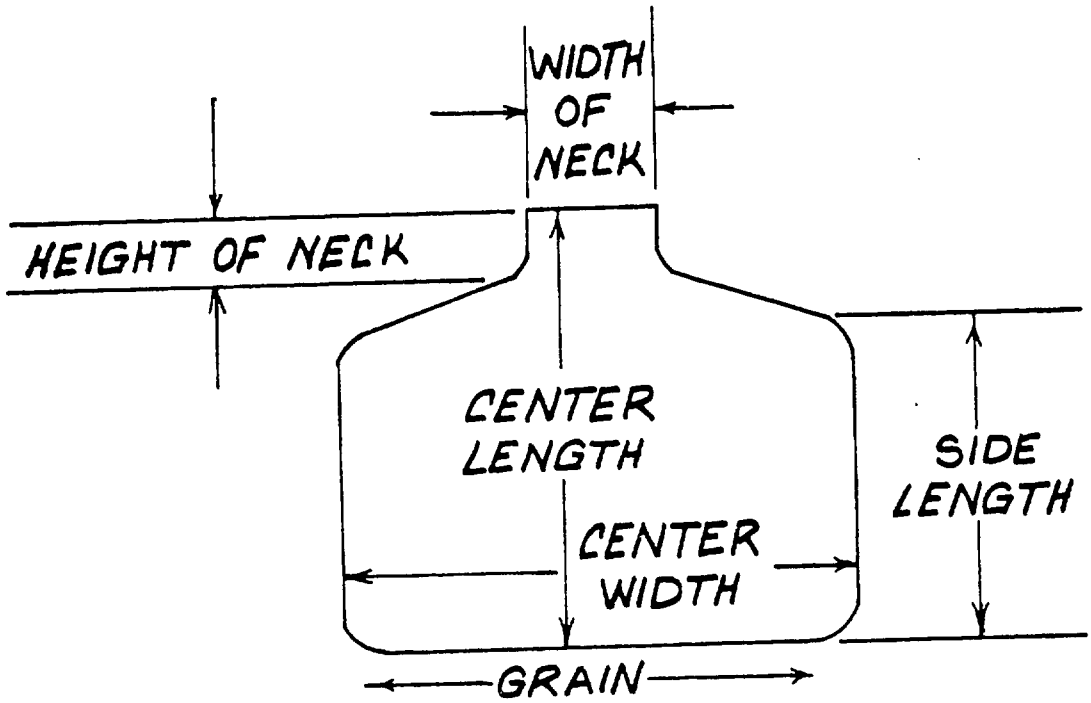


## LEGEND

| | |
|---|---|
| CENTER LENGTH | 14-½ INCHES |
| CENTER WIDTH FOR SIZES: | |
| 30-34 | 15 INCHES |
| 35-40 | 18 INCHES |
| 41-48 | 21 INCHES |
| SIDE LENGTH | 10-½ INCHES |
| HEIGHT OF NECK | 1-½ INCHES |
| WIDTH OF NECK | 3-½ INCHES |
| PAPERBOARD | 0.040 INCH THICK |

NOTE: ALL MEASUREMENTS ARE APPROXIMATE

FIG. 9 SHOULDER FORM



Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

# STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

*(See Instructions – Reverse Side)*

| 1. DOCUMENT NUMBER | 2. DOCUMENT TITLE |
|---|---|
| MIL-C-82186D(MC) | COAT, MAN'S: POLYESTER/WOOL, GREEN (WITH BELT) |

| 3a. NAME OF SUBMITTING ORGANIZATION | 4. TYPE OF ORGANIZATION *(Mark one)* |
|---|---|
| | ☐ VENDOR |
| b. ADDRESS *(Street, City, State, ZIP Code)* | ☐ USER |
| | ☐ MANUFACTURER |
| | ☐ OTHER *(Specify)*: |

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

| 7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional | b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional |
|---|---|
| c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional | 8. DATE OF SUBMISSION *(YYMMDD)* |

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

**INSTRUCTIONS:** In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

*NOTE:* This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

*(Fold along this line)*

*(Fold along this line)*

DEPARTMENT OF THE NAVY

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

**OFFICIAL BUSINESS**
PENALTY FOR PRIVATE USE $300

**BUSINESS REPLY MAIL**
FIRST CLASS PERMIT NO. 12503 WASHINGTON D. C.

POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE NAVY

Commandant of the Marine Corps
Headquarters, U.S. Marine Corps
ATTN: Code LMA-1
Washington, D. C. 20380

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.