INCH-POUND

MIL-J-82122C(MC)

September 20, 1994

SUPERSEDING
MIL-J-82122B(MC)
10 September 1990

MILITARY SPECIFICATION

JACKET, WOMAN'S: EVENING DRESS (OFFICER'S)

This specification is approved for use by the U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirements for women's evening dress jackets.

1.2 Classification. The jackets shall be of one type in the following sizes as specified (see 6.2):

Schedule of Sizes

Short		Regular				Long
4	6	8	10	12	14	16

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

1.3 Individual order. When the jacket is custom tailored to an individual order, this specification shall govern, except that the detailed requirements of table I may be modified to the extent necessary for good custom tailoring practices.

2. APPLICABLE DOCUMENTS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

FEDERAL

V-T-276	- Thread, Cotton
V-T-301	- Thread, Silk
DDD-L-20	- Label; For Clothing, Equipage, And Tentage, (General Use)
DDD-T-86	- Tape, Textile; Cotton, General Purpose (Unbleached, Bleached, Or Dyed)

MILITARY

MIL-C-297	- Cloth, Interlining, Cotton or Synthetic Warp, and Spun Hair-Wool on Rayon Filling
MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-371	- Braid, Textile, Tubular
MIL-B-3461	- Button, Insignia, Metal, Uniform and Cap
MIL-C-15062	- Cloth, Flannel, Wool, Undercollar Cloth
MIL-P-15064	- Pad, Shoulder And Sleeve-Head
MIL-C-16375	- Cloth, Wigan, Cotton
MIL-C-21115	- Cloth, Tropical: Wool; Polyester/Wool
MIL-C-43718	- Cloth, Twill, Polyester; Polyester and Cotton; Polyester and Rayon, For Pockets
MIL-O-82112	- Ornamentation; For Uniform, Woman's; Evening Dress; Officer's

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams And Stitchings

MILITARY

MIL-STD-105	- Sampling Procedures And Tables For Inspection By Attributes
MIL-STD-129	- Marking For Shipment And Storage

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Building 4D, 700 Robins Avenue, Philadelphia, PA 19111-5094)

2.2 Non-Government publications. The following documents form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation.

Department of Defense (DOD) Standard Color Card of Official Standardized Shades for Sewing Threads, 1968.

(Copies may be obtained from the Color Association of the United States, Inc., 343 Lexington Avenue, New York, NY 10016.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Standard samples. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First Article. When specified (see 6.2) a sample shall be subjected to first article inspection (see 6.4) in accordance with 4.4.

3.3 Materials.

3.3.1 Basic material. The basic material (except top and under collar) shall be cloth, tropical, polyester/wool blend, black shade 2607 (see 6.3), 8.5 to 9.5 ounces, conforming to type III, class 1 of MIL-C-21115.

3.3.2 Top collar material. The material for the top collar shall be cloth, tropical, wool, scarlet shade 2502 (see 6.3), 10.5 ounces, conforming to type I, class 1 of MIL-C-21115.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.3 Lining. The material for lining the jacket and for the top and bottom ply of underarm shields shall be cloth, twill, rayon, black shade 2604 (see 6.3), 3.7 ounces, conforming to class 1 of MIL-C-368.

3.3.4 Polyester and cotton. The material for making the pocket stays for armhole and shoulder seams shall be cloth, polyester and cotton, black, 5 ounces, conforming to class 2 of MIL-C-43718.

3.3.5 Under collar material. The under collar material shall be cloth, flannel, wool, conforming to MIL-C-15062. The material shall be dyed black to approximately match the shade of the cloth, tropical wool specified in 3.3.1, and shall show good colorfastness to wet (dry) cleaning, perspiration, and crocking.

3.3.6 Collar interlining. The material for interlining the collar shall be cloth, cotton warp and spun hairwool filling, natural color conforming to type III, class 2 of MIL-C-297.

3.3.7 Interlining for jacket fronts. The material for interlining the jacket fronts shall be cloth, cotton warp, spun hairwool filling, plain weave, conforming to type III, class 2 of MIL-C-297.

3.3.8 Shoulder pads. The shoulder pads shall conform to type III, class 2 of MIL-P-15064.

3.3.9 Sleeve head wadding. The sleeve head wadding shall conform to type IV of MIL-P-15064.

3.3.10 Hanger braid. The braid for the hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength to 50 pounds, color black, conforming to type IX, class 1 of MIL-B-371.

3.3.11 Tape, 3/8 inch. The tape for the armholes, front edges and bridle tape shall be 3/8 inch-wide cotton, unbleached or bleached white, conforming to type III, class 1 or class 2 of DDD-T-86.

3.3.12 Wigan. The material for reinforcing the bottom edge of the sleeve shall be cloth, wigan, cotton, 2.5 ounces, conforming to type I of MIL-C-16375.

3.3.13 Thread.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.13.1 Silk thread. The silk thread shall conform to V-T-301. The thread for machine sewing shall conform to type I, ticket A, 3-ply for all outside seaming and stitching, and ticket 0, 3-ply for machine felling. The thread for hand sewing shall be type III, size C, 2-ply.

3.3.13.2 Cotton thread. The cotton thread shall conform to V-T-276, type IC2, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching; type IB3, glazed finish, ticket No. 16, 4-ply for sewing on buttons. Soft finish cotton thread, type IA3, ticket No. 70, 2-ply shall be used for seaming and stitching the interlining for the coat fronts and ticket No. 30, 3-ply shall be used for machine tacking of the armholes. The thread for basting shall be a good commercial grade.

3.3.13.3 Color and colorfastness. The thread shall be black, cable No. 66043, except cotton thread for basting and for machine tacking armholes may be white. The thread for making the eyelets on collar shall be scarlet w, cable No. 66040. The colored threads, when tested as specified in the applicable thread specification, shall show good colorfastness to wet (dry) cleaning. In addition, the silk thread shall show good colorfastness to light. (See DOD Standard Color Card of Official Standardized Shades for Sewing Threads, 1968).

3.3.14 Buttons.

3.3.14.1 Insignia button. The insignia button for fronts, shoulder straps and ornamental sleeve patches shall be metal, gold plated, officer design, 27-line, conforming to type I, style 3, class A, sub-class 1 of MIL-B-3461.

3.3.14.2 Ring toggles. Ring toggles for securing buttons to ornamental sleeve patches shall conform to MIL-B-3461.

3.3.15 Labels. Each jacket shall have a combination personal-clothing identification label and a size label conforming to DDD-L-20 and the following. Colorfastness for a dry cleaning shall apply.

3.3.15.1 Combination personal-clothing identification label. The combination personal-clothing identification label shall conform to type VI, classes 1 and 10 (combined), of DDD-L-20 except all printing and the space between the lines of printing shall be minimum 10 point (approximately 1/8 inch). The content and format shall be as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Name_____
Service No._____
Collar Size_____
Nomenclature (item description)
_____
Contract No. _____ Date _____
Name of Contractor _____
Wool Products Act Information _____

3.3.15.2 Size label. The size label shall conform to type VI, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, or L for Short, Regular and Long, and the stock number as shown in the following example:

14R
Stock Number

The stock number may be omitted from the size label, but when omitted, it shall be incorporated in the identification label, and the size of the characters shall be as specified for type VI, class 2 labels.

3.3.16 Sleeve patches. The sleeve patches shall be fabricated in accordance with MIL-O-82112. Sleeve patches shall be prefabricated with ornamentation for general, company and field officers, and may be obtained either finished or unfinished, with or without buttons attached. Sleeve patches for general, company and field officers are illustrated in figure 1.

3.3.17 Collar ornamentation. The collar ornamentation design for the top ply of collar shall be fabricated in accordance with MIL-O-82112. The unfinished collar may be furnished prefabricated with ornamentation. The collar ornamentation is illustrated in figure 2.

3.4 Design. The jacket shall be the Marine Corps design shown in figures 1 through 3, a semi-formfitting, fully-lined jacket, designed to be worn open, with two buttons on each front, a front and side front; three-piece back; two-piece sleeves with sleeve ornamentation patch attached; roll collar with ornamentation; worked eyelets; notched collar and lapels; shoulder straps; and an inside pocket on the right side.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.5 Patterns. The standard patterns furnished by the Government shall not be altered in any manner and shall be used only as a guide for cutting working patterns. The standard patterns provide 3/16 inch allowance for seams at the edges of lapels, front edges of jacket, and for shoulder straps; 3/4 inch allowance for side seams; and 3/8 inch for all other seams. These patterns show size, seam allowances, and warp directional lines for cutting. They are marked or notched for proper placement and assembly of component parts.

3.5.1 List of pattern parts. Jackets shall be cut from the specified materials in accordance with the pattern parts indicated below:

Item	Pattern nomenclature	No. of cut parts
	Material: Cloth tropical, polyester/wool blend	
1.	Front	2
2.	Side front	2
3.	Side back	2
4.	Back	1
5.	Top sleeve	2
6.	Under sleeve	2
7.	Front facing	2
8.	Shoulder straps	4
	Material: Cloth, wool, tropical	
9.	Top collar	1
	Material: Cloth, rayon, lining	
10.	Front	2
11.	Back	1
12.	Side back	2
13.	Top sleeve	2
14.	Under sleeve	2
15.	Underarm shield	4
	Material: Cloth, cotton warp, spun hair-wool filling, interlining (coat front)	
16.	Front	2
17.	Side front	2
18.	Collar interlining	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

the chest and [illegible] ... the sleeves shall be lofted at right angles across

Item	Pattern nomenclature	No. of Cut parts
	Material: Cloth, wool, flannel, undercollar	
19.	Undercollar	2
	Material: Cloth, cotton, wigan	
20.	Reinforcement (bottom edge of sleeve)	2
	Material: Cloth, polyester/cotton, black	
21.	Pocket, inside	2
	Shapers	
22.	Undercollar shaper	
23.	Topcollar shaper	
24.	Finished lapel shaper and working lapel shaper	
	Markers	
25.	Sleeve patch marker	
26.	Collar stand marker	

3.6 Construction.

3.6.1 Manufacturing requirements. The jackets shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in table I. The contractor is not required to follow the exact sequence of operations as listed in table I, but all operations specified shall be used to manufacture the jackets.

3.6.1.1 Stitches, seams and stitchings. The stitch, seam, and stitching types specified in table I shall conform to FED-STD-751. The number of stitches per inch, as specified in table I, indicates the minimum and maximum number permitted.

3.6.1.2 End of seams and stitching. Ends of seams and stitching, except ends of a continuous line of stitching produced with 301 stitch type, when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured back of the break, and ends of a continuous line of stitching shall overlap not less than 1/2 inch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.6.2 Shade markings. The component parts of the jacket cut from one piece of basic and lining materials, including pairs of sleeve lining when cut from ends, shall be marked to insure a uniform shade and size throughout the garment. Parts cut from ends that are sized shall be identified for size. The use of tickets with metal fastening device is prohibited on rayon lining. Any method of shade marking may be used except:

a. Corrosive metal fastening devices.

b. Sew-on shade tickets.

c. Adhesive-type tickets which show discoloration and the adhesive mass which adheres to the material upon removal of the tickets.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. a. Cut jackets in strict accordance with the pattern furnished by the Government. b. Cut parts in the warp direction indicated by directional lines on the pattern. c. Cut all wool parts from one piece of basic material, except underply of shoulder straps, which may be cut from ends. d. The top collar shall be cut from the material specified in 3.3.2. e. The body lining of the jacket and the top ply of the underarm shields shall be cut from one piece of rayon lining material.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

accordance with 4.4.2.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) All other rayon parts may be cut from ends. When sleeve linings are cut from ends, the shade of parts and pairs of sleeve lining shall match. f. The two parts of undercollar, cut from undercollar material, shall match each other. g. Cut cotton and polyester stays for front armhole and shoulder seams on the bias 3/4 inch wide and 4 ± 1/4 inches long. h. Cut the cotton interlining cloth for collar on the bias, in accordance with the warp directional line on pattern furnished. i. Cut the interlining for the jacket fronts in strict accordance with the pattern furnished. j. Cut wigan for the bottom edge of sleeves on the bias in accordance with the warp directional line on the pattern furnished. k. Cut the polyester/ cotton pocketing. l. The use of drill holes is prohibited.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

The contracting officer should also include specific instructions

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
2	Replacement of damaged parts. a. Replace at time of cutting any parts containing damage, such as holes, or seriously weakening defects, such as smashes, multiple floats, and slubs likely to develop into holes. b. Replace any parts damaged during the manufacturing process by needle chews, which may be expected to develop into holes, scissors or knife cuts, tears, holes, mends, or burns.					
3	Shade marking. a. Mark or ticket all component parts (see 3.6.2) cut from one piece of basic and lining materials; pairs of sleeve linings, when cut from ends; and the two parts of the undercollar to insure uniform shade and size throughout the jacket. b. The use of tickets with metal fastening devices is prohibited on rayon lining.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
4	Make jacket front interlining.					
	a. Seam the front and side front together 3/8 inch from the edge.	301	SSa-1	4-8	70/2	70/2
	b. Spread the seam open and press flat with a heated pressing iron.					
5	Make shoulder straps.					
	Finished appearance. The shoulder straps shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges. The eyelets shall be well worked with the purling on the outside of shoulder straps and shall finish with a 1/8 inch diameter opening with the purled edge of eyelet away from the opening. The straps shall be uniform in size and shape with the seams worked out to the edge.					
	a. The shoulder straps shall be made of two plies of basic material.					
	b. Seam the two plies together 3/16 inch from edges at the front, back and collar end. Evenly trim all edges of the strap for proper turning.	301	SSe-2 (a)	10-14	A (Silk) or (Cotton)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
5	Make shoulder straps. (cont'd)					
	c. Turn straps, working the seams out to the edges. Topstitch strap uniformly 1/8 inch from seamed edges.	301	SSe-2	10-14	A (Silk)	A
	d. Make one eyelet in each strap midway between the back and front edges and with the edge of the eyelet opening 5/8 to 3/4 inch from the rounded end of the straps.	Eyelet		20 per eyelet (min.)	A (Silk) (Black)	A
	e. Press the straps smooth and flat with a heated pressing iron or pressing machine.					
6	Make undercollar.					
	a. The undercollar assembly shall consist of two pieces of permanent finish interlining material.					
	b. Join the two halves of the undercollar with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	c. Spread the seam open and press flat with a heated pressing iron.					
	d. Join the two halves of the interlining together with a 3/8 inch lap seam.	301	LSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Make undercollar. (cont'd)					
	e. Mark the breakline of the undercollar with collarstand marker. Position the interlining on the undercollar with lower edges even and join together at the mark for the breakline. In the finished jacket, the undercollar stand shall measure 1-1/8 ± 1/8 inches at the vertical center.	301	SSa-1	10-14	A	A
	f. Quilt interlining to undercollar with 4 to 5 rows of blindstitching.	103	SSm-4 or 5	4-6	A	A
	g. Press undercollar smooth and flat with a heated pressing iron or pressing machine.					
	h. Mark and trim undercollar in accordance with the shape of pattern. Trim interlining 1/8 to 3/16 inch back from the lower neck edge of the undercollar.					
	i. Stitch undercollar and interlining together with a row of stitching 1/2 ± 1/8 inch from top (outer) and side edges (ends).	301	OSa-1	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Assemble ornamental topcollar and undercollar. Finished appearance. The collar shall be uniform in appearance and shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges of top (outer) and sides (ends). The felling shall not be too tight or loose and the topcollar material at top (outer) and side edges (ends) shall be securely caught in the zig-zag and felling stitches along the top (outer) and side edges (ends) of the undercollar. The eyelets shall be well worked with the purling on the outside of collar, and shall finish with a 1/8 inch diameter opening with the purled edge away from the opening. Edges and corners shall be smooth, flat and uniformly even. a. Mark ornamental topcollar on its underside in accordance with the shape of pattern. b. Position ornamental topcollar between the undercollar and interlining with the top (outer) edge of the ornamental topcollar abutting the undercollar with interlining notches aligned.	301	LSa-1	6-8	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Assemble ornamental topcollar and undercollar. (cont'd)					
	Seam topcollar to interlining with a 3/16 inch lap seam.					
	c. Join ornamental topcollar to undercollar at top edge with zig-zag stitching, distributing the fullness between the notches. The zig-zag stitching shall extend to approximately 3/4 inch from each side edge (end) of the collar.	304 or Hand	LSa-1	8-10 8-10	A C (Silk)	A
	d. Turn ornamental topcollar to the outside over the top (outer) edge of interlining. Baste along the top (outer) edge and along the breakline with the fullness placed between the two rows of basting stitches. Basting shall extend to approximately 1-1/2 inches from the side edges (ends).	101				
	e. Trim and turn the side edges (ends) of ornamental topcollar 3/8 inch over the interlining between the undercollar and the interlining. Baste the edges, forming the points at the top (outer) corners of the collar.	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Assemble ornamental topcollar and undercollar. (cont'd)					
	f. Fell the top (outer) and side edges (ends) of undercollar to the ornamental topcollar, from end of zig-zag stitching, around pointed corners, and along the side edges (ends).	Hand		8-10	C (Silk)	
	g. Press the collar smooth and flat with a heated pressing machine.					
	h. Trim the lower edge of the ornamental topcollar to provide for seaming to jacket. Cut a guide notch in the lower (neck) edge of topcollar at the center. Press and crease collarstand at breakline to approximately 2 inches from the neck edge at each end.					
	i. Make one eyelet at each end of collar, with edge of eyelet opening 1 inch from the top (outer) and side edges (ends). The eyelets shall be well worked with the purling on the outside of the collar.	Eyelet		20 per eyelet (min.)	A (Silk)	A (Scarlet)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8	Seam sleeves at forearm. Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly. a. Position the topsleeve with upper forearm edge in line with notch at the armhole edge of undersleeve, and with notches at the lower forearm edge of top and undersleeve matching and the edges even. b. Stitch the top and undersleeve together with a 3/8 inch seam, from the forearm edge of the topsleeve, forming a tapered outlet on the undersleeve. c. Spread open the seam and press flat with a heated iron or pressing machine. d. Mark the bottom of the sleeve as indicated by the notch in the pattern for turnup.	301	SSbd-1 to SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Baste wigan reinforcement to sleeve.					
	a. Position the wigan on the sleeves with the notches on the ends of the wigan in line with the turnup notches on the sleeve.					
	b. Tack the left and right sleeves to the reinforcement pieces along the forearm seam allowance of the top or undersleeve, and along the backarm edges of the top and undersleeve. Trim ends of wigan even with backarm edges of top and undersleeve.	101 or Hand or 301		4-6 8-12	A A	 A
	c. Baste sleeve and reinforcement piece together at the mark for the bottom turnup.	101 or Hand		4-6	A	
10	Seam sleeve at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Join the topsleeve to the undersleeve at the backarm with a 3/8-inch seam, catching the ends of the wigan reinforcement piece in the stitching.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Seam sleeve at backarm. (cont'd)					
	b. Spread open the backarm sleeve seam allowance and press smooth and flat with a heated pressing iron.					
11	Tack sleeve turnup to reinforcement.					
	a. Turn up the bottom edge of the sleeve 2 ± 1/4 inches and tack the raw edge to the wigan reinforcement piece with blindstitching. The basic material shall not be caught in the blindstitching.	103 or 301		4-6 4-6	A A	 A
12	Seam sleeve linings.					
	Finished appearance. The sleeve lining parts and pairs of sleeves shall match in shade. The seams shall start and finish evenly at the seam.					
	a. Position the topsleeve lining with the upper forearm edge in line with the notch at the armhole edge of undersleeve lining, with notches at the lower forearm edge of top and undersleeve lining matching, and with the edges even.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12	Seam sleeve linings. (cont'd)					
	b. Stitch the top and undersleeve lining together with a 3/8 inch seam, from the forearm edge of the topsleeve, forming a tapered outlet on the undersleeve.	301	SSbd-1 to SSa-1	10-14	A	A
	c. Join the top and undersleeve lining at the backarm with a 3/8 inch seam.	301	SSa-1	10-14	A	A
13	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve lining seams shall be aligned with the corresponding seams in the sleeve and seamed to sleeve without twists, gathers, puckers, or pleats.					
	a. Position the undersleeve lining on the undersleeve back-to-back with the upper edge of lining extending 3/4 to 1 inch beyond the armhole edge of sleeve.					
	b. Seam or tack the sleeve lining forearm and backarm seam allowance to the respective seam allowance of the topsleeve, starting at the top edge of the wigan reinforcement piece and extending to approximately	301 or Hand	SSa-1	6-8 1-2	A A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Assemble sleeve and sleeve lining. (cont'd) 4 inches below the armhole edge at the backarm and approximately 3 inches below the armhole edge at the forearm. The fullness in the lining shall be evenly distributed.					
14	Fell turnup of sleeve lining; press sleeves. Finished appearance. The sleeve linings shall not be short, tight, or twisted at the bottom of the sleeves, and shall extend to within 1 to 1-1/4 inches from the finished bottom edge of the sleeve.					
	a. Turn under the bottom edge of the sleeve lining, to finish 1 to 1-1/4 inches above the finished bottom edge of sleeve. Baste to the turnup of the sleeve.	101 or Hand				
	b. Fell the folded edge of the sleeve lining to the turn-up of the sleeve with blindstitching.	301 or Hand	EFc-1 (b)	6-8 8-10	O (Silk) C (Silk)	O
	c. Turn sleeves and assemble in pairs. Insert a sleeve pressing pad in the sleeve to avoid creasing the front and back edges, and press smooth and flat with a heated pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
15	Make underarm shields.					
	Finished appearance. The finished shields shall be smooth and flat without puckering, gathering, pleating or raw edges. They shall be uniform in shape and size, and the seam shall be worked out to the edge.					
	a. The underarm shields shall be made of two pieces of lining.					
	b. Seam the two pieces together 1/4 inch from the raw edge, along the outward curved edge. Turn shield, working out the seamed edges.	301	SSa-1	10-14	A	A
	c. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
16	Stitch bust darts in front lining.					
	Finished appearance. The underarm bust dart shall be tapered to a point at front end and shall finish without gathers, puckers, or pleats.					
	a. Fold the front lining with the cut edge of the underarm bust dart even. Stitch the entire length of dart 1/4 inch from the cut edges at the back end, tapering to a point	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
16	Stitch bust darts in front lining. (cont'd) approximately 1/2 inch forward of the front end of the cut. Securely backtack the pointed end.					
17	Make inside pocket. Finished appearance. The pocket shall be uniformly stitched and finish smooth and flat without causing distortion. a. The pocket shall be made of 2 ply poly/cotton material. (5" wide X 6 1/2" long)					
	b. Position both plies of pocketing material face to face with notches matching and stitch together to form the top notch across the top, back, bottom and up the front to the bottom notch with a 3/8 inch seam, leaving a 4 1/2 inch opening for the pocket.	301	SSa-1	10-14	A	A
	c. Attach the front pocket openings to the right front facing and the right front lining respectively with a 3/8 inch seam leaving a 4 1/2 inch opening that starts approximately 3 inches ± 1/2 inch above the bottom hem of the jacket.	301	SSa-1	10-14	A	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE.	STCH/ IN	NDL	BOB/ LPR
17	Make inside pocket. (cont'd)					
	d. Raise stitch the pocket material onto the facing and lining respectively with a 1/16 inch topstitch.	301	SSc-1	10-14	A	A
18	Seam wool facing to front lining; sew on label.					
	Finished appearance. The lining shall be seamed to the facing so that in the finished jacket, the lining shall be smooth and flat along the facing without creases, bulges, over lapping of excess material, or other defect or distortion.					
	a. Position the lining on the wool facing with notches matching and seam the front edge of the lining to the back edge of the facing, 3/8 inch from the edge. The stitching shall extend from the topedge of the facing to approximately 1-1/4 inches from the bottom edge.	301 or	SSa-1	10-14	A	A
	b. Sew the identification label to the left front lining, as worn, with a single row of stitching 1/16 inch from each edge of the label. The label shall be positioned with the right end even with the facing-lining seam and the lower edge	301	SSa-1 (each edge)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18	Seam wool facing to front lining; sew on label. (cont'd) approximately 3 inches above the bottom edge of the jacket.					
19	Assemble body lining.					
	Finished appearance. The front, side back, and back lining shall be uniformly stitched. The lining shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges. Seams shall start and finish evenly at the line of stitching.					
	a. Position and join the left and right side back linings to the corresponding edges of the center back lining with a 3/8 inch seam and with notches matching.	301	SSa-1	10-14	A	A
	b. Position the side back and front linings, with notches matching, and join together at the sides with a 3/4 inch seam. Underarm dart seam allowance shall be turned towards the armhole.	301	SSa-1	10-14	A	A
20	Press lining seams and darts.					
	a. Press the facing-lining seam, the bust dart, and side seam lining smooth and flat with a heated pressing iron, with					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Press lining seams and darts. (cont'd)					
	raw edges of the facing seams and side seams towards the back and the raw edges of the underarm bust dart toward the armhole.					
	b. Press the seams joining the left and right side backs to the center back smooth and flat, toward the center back, with a heated pressing iron.					
21	Assemble fronts.					
	Finished appearance. Front and side fronts shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges. The seams shall start and finish evenly at the line of stitching. The underarm bust darts in the side fronts shall be tapered to a point at the front end.					
	a. Fold the side front, matching the cut edges of the underarm bust dart. Stitch the entire length of the dart 1/4 inch from the cut edges at the back end and tapering to a point at the front end, approximately 1/2 inch forward of the front end	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
21	Assemble fronts. (cont'd)					
	of the cut, securely backtacking the pointed end.					
	b. Position the front and side front with notches matching. Join with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	c. Spread open the dart seam allowance and front-side front joining seams. Press smooth and flat with a heated pressing iron or pressing machine.					
22	Interline fronts.					
	a. Position the left and right assembled jacket fronts on the corresponding jacket front interlining. Baste along the front seam, working fullness into the interlining over the breast area. The basting shall extend from approximately 3 inches from the shoulder edge of fronts to approximately 1-1/2 inches from the bottom edge.	301	Hopper or Hand			
	b. Baste along the shoulder. Allow room for setting shoulder pad and work fullness in the front interlining towards the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue	301	Hopper or Hand			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22	Interline fronts. (cont'd) to baste down the back edge of the interlining to approximately 1-1/2 inches from the bottom edge of front. c. Baste along the breakline of the lapel starting approximately 3 inches down from top edge and baste to approximately 1 inch from front edge and continue basting to bottom of front.	301	Hopper or Hand			
23	Baste bridle tape to lapel. a. Position the 3/8 inch wide bridle tape on the interlining side of fronts along the breakline of the lapel, with the front edge of tape in line with the notch in the gorge. b. Baste tape to the fronts evenly, smoothly and without tension for approximately 1-1/2 inches from the gorge. Continue basting for a distance of 4 to 5 inches. Holding the tape taut and work in 3/8 to 1/2 inch chest fullness. Baste the remainder of the tape evenly and smoothly without tension or fullness.	301	Hopper or Hand			

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
23	Baste bridle tape to lapel. (cont'd) c. The tape shall extend from the top edge of the gorge to approximately 3-1/2 to 4 inches above the lower end of lapel breakline.					
24	Pad lapels. a. Pad the lapels from approximately 1/2 inch from the front edge to the breakline with 6 rows of equally spaced blindstitching. Work in fullness in the interlining between the rows of stitches to roll lapels and with one row of stitches placed over each edge of the bridle tape. b. Press the left and right fronts on a suitable type of heated pressing machine. Maintain the contour through the bust area and shrink out the fullness in the interlining to conform to the shape of the jacket fronts.	103	SSm-6	4-6	A	
25	Shape fronts. a. Mark and shape (trim) the lapels in accordance with the shaper furnished. If necessary mark and trim the front edges of the jacket.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
25	Shape fronts. (cont'd)					
	b. Trim jacket front interlining 1/4 inch back from the top and front edges of lapel and the front edge of the jacket.					
26	Join backparts.					
	Finished appearance. The back and side backparts shall be carefully joined without twists, gathers, puckers, or pleats. Seams shall start and finish evenly at the line of stitching.					
	a. Position and join the left and right backparts to the corresponding edge of the center back with a 3/8 inch seam and with notches matching.	301	SSa-1	10-14	A	A
27	Join back and fronts at sides.					
	Finished appearance. The back and fronts shall be carefully joined at the sides without twists, gathers, puckers, or pleats. Seam shall start and finish evenly at the line of stitching.					
	a. Position the side back and fronts with edges even. Join together at the sides with a 3/4 inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
27	Join back and fronts at sides. (cont'd)					
	b. Spread open the side and back seams. Press flat with a heated pressing iron.					
	c. Trim the bottom of the interlining 1/4 inch above the bottom edge of the jacket.					
	d. Mark the jacket 1-1/4 inches from the bottom edge for the bottom turnup.					
28	Tape armholes.					
	a. Seam the 3/4 inch wide silesia stays to the underside of the fronts along the shoulder edge and upper front edge of the armhole 1/8 inch from the outer edges. The top end of the armhole stay and the armhole end of the shoulder stay shall form a right angle without the stays overlapping each other.	301	SSaa-1	10-14	A	A
	b. Sew the 3/8 inch wide stay tape to the armhole of the basic material only at the lower edge of the armhole. Start from approximately 1/2 inch below the notch in the fronts and continue along the back edge to approximately 3/4 inch from the shoulder edge.	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28	Tape armholes. (cont'd) c. The tape shall be stitched with slight tension from front notch to side seam and shall be held taut along the back edge of the armhole. d. Press armhole tapes smooth and flat with a heated pressing iron.					
29	Baste facing-lining assemblies to fronts. a. Position facing-lining assemblies on the outside of jacket fronts. Baste along breakline, distributing the fullness in the chest area, and continue to baste along the front and bottom edge. Baste along top and front edges of lapel down to the lower end of lapel, working fullness towards the center of lapel.	301	Hopper or Hand			
30	Join facings and fronts with tape. a. Join facings to fronts 3/16 inch gage along top from collar notch and front edges of lapels, and front and bottom edges of jacket with the 3/8 inch wide stay tape positioned on the interlining side of fronts and caught in the stitching.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
30	Join facings and fronts with tape. (cont'd) b. The tape shall extend from the lapel notch to the bottom edge of the jacket and along the bottom edge the width of the front facing. The tape shall be sewn with normal tension along the top and front edges of the lapel and with slight tension along the front and bottom edges of the jacket. The tape shall be folded at the corner with the fold diagonally across the corner and not more than 1/8 inch from the point of the stitching at the corner, or the tape may be stitched continuously around the corner and the excess tape at the corner removed by notching.					
	c. Fell inside edge of 3/8 inch wide stay tape to the jacket front interlining, from end at lapel notch to the bottom edge of interlining.	103	SSm-1	4-6	A	
	d. Press the front edges smooth and flat with a heated pressing iron or pressing machine.					
	e. Remove all basting stitches. Trim lower front corner of the facings, corner of lapels, and slash seam allowance					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
30	Join facings and fronts with tape. (cont'd) of lapel notch for proper turning. f. Spread open the seam along the lapel and front edges, from the lapel notch to the bottom edge of jacket. Press smooth and flat with a heated pressing iron.					
31	Baste front and bottom edge of jacket. a. Turn the facing-lining assemblies to the inside of the fronts. Work out the corners of the lapel and edges completely. Turn up the bottom of the jacket. Lap the back edge of the facing over on the bottom of the jacket. Lap the back edge of facing over on the bottom turnup. Work out the front corner and bottom edge completely for the width of the facing. b. Baste along the top and front edges of the lapels and the front and finished bottom edges of the jacket. Work the seam to the edge of the jacket.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
32	Baste facing. (second time)					
	a. Baste the facings to the front edge parallel to the first basting. Hold the lower corner of front in such a manner as to cause the lower front edge of jacket to roll inward.	301	Hopper			
	b. Baste as close as possible to the facing lining seam, placing the fullness over the chest. Continue to baste down to approximately 1-1/2 inches from the bottom edge of the facing.	301	Hopper			
33	Tack facing to interlining.					
	a. Raise the lining and tack the back edge of facings to the jacket front interlining with blindstitching. Start approximately 3 inches from the bottom edge of jacket and tack to approximately 2-1/2 inches from the shoulder edge of interlining. Tacking shall be through the seam allowance of the facing and lining.	301 or 103 or Hand	SSm-1 SSm-1 	4-6 4-6 4-6	A A C (Silk)	A
34	Fell bottom turnup.					
	a. Fell the raw edge of the bottom turnup with blindstitching. The blindstitching shall extend along the entire	103 or Hand	SSm-1	4-6 4-6	O (Silk) C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34	Fell bottom turnup. (cont'd) bottom edge to the front ends of the hem under the lower back edge facing.					
35	Baste body lining to jacket. a. Fold the front lining in accordance with the notches, forming the shoulder pleat, and baste along the entire length of the pleat. The folded edge of the shoulder pleat on the outside of the lining shall be towards the armhole.	301	Hopper or Hand			
	b. Baste the front lining to the jacket. Start at the lower end of pleat and baste along the lower edge of armhole approximately 2 inches from the edge to the side seam. Match the side seams of the jacket and lining. Continue basting as close as possible to the side seam, to approximately 4 inches from the bottom finished edge of the jacket. From that point, baste horizontally to approximately the center of the front lining.	301	Hopper or Hand			
	c. Fold the backpart lining at the center, forming 3/4 inch wide pleat and baste from the top end of the pleat to	301	Hopper or Hand			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

6.3 The material ... be cloth, flannel, wool, conforming to MIL-C-1504

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35	Baste body lining to jacket. (cont'd) approximately 4 inches from the bottom finished edge of the jacket. The folded edge of the pleat on the outside of the lining shall be towards the right side, as worn. d. Baste the lining to the backparts. Start at the side seam and baste along the armhole and shoulder edges to approximately 2 inches from top end of center back pleat. Allow room at the shoulder for setting of the shoulder pad. e. Turn under the bottom edge of the lining and baste lining to jacket, catching the turned-under portion in the basting and with the folded edge of the lining approximately 1/2 inch above the bottom finished edge of the jacket. f. The fullness in the lining shall be distributed throughout the jacket without excess fullness in any area.	301 301	Hopper or Hand Hopper or Hand			

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36	Fell lining to bottom turnup.					
	a. Fell the turned-under portion of the lining to the bottom turnup of the jacket with blindstitching 1/4 to 3/8 inch from bottom folded edge of lining. Only the underply of the folded bottom edge of lining shall be caught in the blindstitching.	301	EFc-1 (b)	6-8	O (Silk)	O
37	Baste shoulder pad to jacket.					
	a. Position shoulder pad over the interlining with the straight edge of pad even with the edge of armhole seam allowance. Securely tack the pad to the interlining.	301	Hopper or Hand			
38	Seam shoulder.					
	Finished appearance. The shoulder seam shall be evenly gaged when stitched; the fullness on the backs shall be eased in so that the seam in the finished jacket curves slightly toward the front at the neck end and the front shoulder is not stretched.					
	a. Join the fronts and back together at the shoulders with a 3/8 inch seam. Work in the proper fullness on the backs in accordance with good	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
38	Seam shoulder. (cont'd) manufacturing practice. b. Spread open the shoulder seam and press flat. Hold the shoulder short and exercise much care in the pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
39	Set shoulder straps. Finished appearance. The shoulder straps in the finished jacket shall be flat against the shoulder without twists, puckers, pleats, or any other distortion. On the finished jacket, the straps shall be 1-3/4 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/8 ± 1/8 inches, in line with the center of the eyelet. a. Position the shoulder straps with the rounded end of the strap toward the finished lower edge of the collar and with the back finished edge of the shoulder strap 1/2 inch behind and in line with the shoulder seam.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39	Set shoulder straps. (cont'd)					
	b. Seam the shoulder straps to the jacket 1/4 inch from the armhole edge of jacket only. Trim the shoulder straps even with the edge of armhole where necessary.	301	SSa-1	10-14	A	A
40	Stitch hanger and size label.					
	Finished appearance. The size label and the ends of the jacket hanger shall be positioned to the inside center back the of jacket at the neck.					
	a. Stitch the upper edge of the size label and the ends of the hanger to the inside center back of jacket at the neck, through lining and jacket back.	301	SSa-1	10-14	A	A
	b. In the finished jacket, the ends of the hanger shall be spread apart 1-1/2 to 2 inches when measured along the neck seam.					
41	Baste lining at shoulder and neckline.					
	a. Turn under and lap the shoulder edge of the back lining on front lining. Baste the lining to the jacket along the folded edge with the top end of	301	Hopper or Hand			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Baste lining at shoulder and neckline. (cont'd) the shoulder pleat under the folded shoulder edge of lining back and caught in the basting. Baste the lining to the back-part at the neck, from shoulder seam to shoulder seam. b. Mark jacket 5/8 inch from the top of its neck across back from shoulder seam to shoulder seam. Continue the marking on the fronts along the gorge with the line of marking to taper to 3/8 inch from the top edge of label notch.					
42	Join topcollar to facing at gorge. Finished appearance. The seam joining the topcollar to the facing at the gorge shall be of uniform gage and shall finish smooth and flat without twists, puckers, pleats, or other distortions. a. Position the collar on the inside of the jacket with the lower (neck) edge of topcollar and the top edge of the gorge seam of the facing even and with the front ends of the lower (neck) edge of the topcollar and lapel notch matching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
42	Join topcollar to facing at gorge. (cont'd)					
	b. Join the topcollar to the facing at the gorge from the lapel notch to approximately 3/4 inch in back of the break line of the lapel.	301	SSa-1	10-14	A	A
	c. Notch the gorge seam allowance of the facing at the end of the seam.					
43	Tack topcollar to fronts at gorge.					
	a. Spread open the seam joining the topcollar to the facing. Tack by hand or machine all plies of the front seam allowance of the topcollar to the front at the gorge, from the lapel notch to the end of the gorge seam. Distribute the fullness in the topcollar in accordance with good manufacturing practice.	Hand or 301		2-4 10-14	C (Silk) A	 A
44	Baste undercollar to jacket.					
	Finished appearance. The fullness at the neckline in the undercollar shall be placed over the shoulders to permit the collar to closely fit the neck.					
	a. Turn the collar so that the lower neck edge of undercollar is lapped					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
44	Baste undercollar to jacket. (cont'd)					
	on the outside of the jacket at the mark.					
	b. Securely tack the front ends of the undercollar neck edge to the jacket fronts.	Hand		8-10	C (Silk)	
	c. Baste the undercollar to the fronts and back. Place the fullness at the neck edge over the shoulder.	Hand				
	d. In the finished jacket, the ends of collar and top edge of lapels shall each be 1-5/8 ± 1/8 inches when measured from the juncture ends of the collar and the lapel to the finished edges of collar and lapel, respectively.					
45	Tack undercollar interlining to neck edge of jacket.					
	a. Lift up the lower (neck) edge of the topcollar and tack the neck edge of the jacket to the undercollar interlining between the ends of the gorge seam on the front facings.	Hand		2-3	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

manufacturing operations, is of the contract. Sampling inspection, as part of man

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
46	Baste topcollar to jacket.					
	a. Turn under the lower edge of the topcollar from between the ends of the gorge seam on the front facings. Lap the folded edge on the lining at the back. Baste the lower (neck) edge of topcollar to the back neck between the ends of the gorge seams on the front facings.	Hand				
47	Edgestitch jacket.					
	Finished appearance. The jacket shall be uniformly edgestitched.					
	a. Edgestitch the top and front edge of the lapels and the front edges of the jacket.	301	SSe-2 (b)	10-14	A	A
	b. The stitching shall be uniformly 1/8 inch from the edge.					
48	Set sleeves.					
	Finished appearance. The sleeves shall be uniformly set and the fullness evenly distributed without concentrated fullness in any area. The armhole-sleeve seam shall finish smooth and flat over the top of the armhole, without twists, puckers, or pleats. The armhole shall not be stretched or distorted due to pressing.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
48	Set sleeves. (cont'd) a. Position the sleeves on the outside of the jacket at the armholes, with backarm seam of the sleeve matching the notch in the armhole back, and with the notch in topsleeve and the front armhole matching.					
	b. Join the sleeves to the jacket with a 3/8 inch seam. Distribute the fullness in accordance with good manufacturing practice. Catch the ends of the shoulder straps in the stitching.	301	SSA-1	10-14	A	A
	c. Press the entire armhole seam smooth and flat with a heated pressing iron to remove the fullness. Spread open the upper part of the armhole-sleeve seam from the backarm sleeve seam to approximately midway between shoulder seam and notch on front of armhole. Press the seam allowance open, smooth, and flat with a heated pressing iron. Care shall be exercised in pressing the armhole seam in order not to stretch the armhole.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
49	Baste front and backpart lining at armhole.					
	a. Baste the back and front lining to the jacket along the remainder of the shoulder seam with the back lapped over the front around the entire armhole. Catch the shoulder pad in the basting at the shoulders and distribute the fullness in the lining around the armhole.	301	Hopper or Hand			
50	Baste underarm shield to jacket.					
	a. Position the underarm shield on the lining side of the jacket with the center of the shield aligned with the lining side seam and the raw edges even with the lower edge of the armhole.					
	b. Baste the underarm shields to the jacket along the vertical center armhole and outer edges.	301	Hopper or Hand			
51	Baste armhole.					
	a. Baste the jacket and interlining together on the outside as close as possible to the armhole (sleeve seam). Catch the shoulder pad in the basting and force out the jacket front and back toward the armhole while basting.	301	Hopper or Hand			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Knot larger than B anywhere on

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
51	Baste armhole. (cont'd) The basting shall extend from the backarm seam of the sleeve to the notch at the front.					
52	Stitch sleevehead pads and linings at armhole. Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleevehead pads and linings at armhole. a. Position a sleevehead pad on each sleeve with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam, and with the front end of the pad matching the notch in fronts.					
	b. Stitch the sleevehead pad to the sleeve from end to end through the armhole -sleeve seam allowance, 1/8 inch from the folded edge of pad. Catch the front and back-part linings, underarm shield, and shoulder pad in the stitching. Continue stitching the linings around the remainder of armhole. Trim away the excess interlining and any lining extending beyond the raw edge of the seam allowance around the armhole.	301	SSa-1	4-6	16/4	16/4

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
53	Fell collar to jacket.					
	a. Fell the lower (neck) edge of undercollar to the fronts and backs from lapel notch to lapel notch.	Hand		8-10	C (Silk)	
	b. Fell the folded edge of topcollar to the neck edge through the facing, lining and the jacket between the ends of the gorge seam on the facings. Edge of the size label and the ends of jacket hanger shall be caught in the fell stitches.	Hand		8-10	C (Silk)	
54	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders. Secure the top end of the front lining shoulder pleat in the felling. The felling shall be placed over the folded edge of the back lining.	Hand		8-10	C (Silk)	
55	Tack underarm shields to lining.					
	a. Tack the underside of the underarm shields to the body lining at the side seam, approximately 1/2 inch from the outer edge of shield.	Hand		4-6	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
55	Tack underarm shields to lining. (cont'd) b. In the finished jacket, the shields shall measure 2-1/2 ± 1/4 inches at the vertical center.					
56	Fell sleeve linings. a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeves and linings aligned. Turn under the armhole edge of the sleeve lining and lap the linings on the outside of the front and backpart and the top edge of the underarm shield at the armhole. Fell the sleeve lining to the jacket around the entire armhole. Place the fell stitches over the folded edge of sleeve lining. Distribute the fullness in accordance with good commercial practice. Backstitch the lower armhole sleeve edge from approximately 1-1/2 inches to the front of the forearm sleeve lining seam to the side seam of the body lining.	Hand		8-10	C (Silk)	
57	Fell lining to facing. a. Fell lower back, turned-under edge (corner) of facing to the bottom turnup of the jacket and the lower front corner of the front lining to the	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
57	Fell lining to facing. (cont'd) facing and bottom turnup of the jacket for a distance of approximately 1/2 inch along the front and bottom edges.					
58	Clean jacket. a. Pull and remove any basting thread. Trim and remove any loose ends of thread. Remove any spots, stains and shade tickets, and markings without injury to the material.					
59	Press jacket. Finished appearance. The jacket shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. a. Block the shoulders to remove the fullness. Press shoulders smooth on a shoulder shaping machine with shoulder straps positioned flat over the shoulder seam. b. Block the sleevehead and the top the of armhole.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
59	Press jacket. (cont'd) c. Press the armholes solid from the inside, creasing the lining at the edge of the jacket armhole seam allowance in the under part of the armhole. The under part and the back of the armhole shall be held short while pressing. d. Block the armholes on a pressing buck, shrinking in the top sleeves. Sleeves shall not be creased. e. Press the entire collar smooth and flat, stretching the outer edge where necessary. Straighten the edges, working any fullness towards the center of the collar and removing the fullness by shrinking. f. Press the collar across the center back, creasing on the breakline for a distance of approximately 2 inches on each side of the center. g. Press the collar and lapels smooth and flat from the breakline to the front edge. Straighten the edges, working the fullness towards the center of lapel and removing the fullness by shrinking.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
59	Press jacket. (cont'd) Lapels shall not be creased. h. Press the fronts on a body machine, straightening the front edge of jacket. Work the fullness towards the bust and shrink and shape the bust. Care shall be exercised in pressing the fronts so that the bottom edges are even. i. Press the bottom edge of the jacket smooth and flat. Exercise care so that the lining is not exposed below the bottom edge. j. Press the sides, working the fullness towards the back. k. Press the back smooth and flat, removing all fullness. l. Insert a sleeve pressing pad in order to prevent creasing, and press sleeves smooth and flat. m. Remove all wrinkles and impressions from under the lapels, collar and shoulder straps. n. Press the pleat at shoulder of the front lining and the center back					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
59	Press jacket . (cont'd) lining smooth and flat. o. Press lining throughout with a heated pressing iron. Remove all wrinkles and creases.					
60	Mark for buttons. a. Mark the location for sewing two 27-line insignia buttons on the left and right front in accordance with the marks on the pattern. b. Mark the location for sewing one 27-line insignia button to each shoulder corresponding with eyelet in the shoulder strap, with the loop flat against the shoulder.					
61	Sew on buttons. a. The buttons shall be securely sewn to the jacket with the thread ends securely tacked off.					
	b. Insert one 27-line insignia button through the eyelet hole and sew at the mark on each shoulder. The buttons shall not be sewn through the lining.	Hand		4-6 per button (double	16/4 thread)	
	c. Sew one 27-line insignia button at each of the marks on the left and	Hand		4-6 button (double	16/4 thread)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
61	Sew on buttons. (cont'd) right front through all plies. d. The insignia buttons on the front shall be sewn with the eagle upright. The shoulder buttons shall be sewn with the eagle in an upright position towards the edge of the collar.					
62	Sleeve patches. a. Prefabricated sleeve patches, with buttons positioned as shown in Figure 1 and attached by ring fasteners, shall be centered on the top sleeve with the bottom edges of the patch even with the finished bottom edge of sleeves. Patches shall be securely hand felled to the sleeve only on all edges.	Hand		4-6	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.7 Finished measurement. The finished jacket shall conform to the measurements shown in table II.

TABLE II. Finished measurements. 1/

Size	Back Length 2/ Short In.	Regular In.	Long In.	Sleeve length 3/ Short In.	Regular In.	Long In.
4	16-1/8	17-5/8	19-1/8	16	17	18
6	16-1/4	17-3/4	19-1/4	16	17	18
8	16-3/8	17-7/8	19-3/8	16	17	18
10	16-1/2	18	19-1/2	16	17	18
12	16-5/8	18-1/8	19-5/8	16	17	18
14	16-3/4	18-1/4	19-3/4	16	17	18
16	16-7/8	18-3/8	19-7/8	16	17	18

1/ Tolerance on all measurements: ± 3/8 inch.

2/ Back length measurement taken along center back from lower neck edge of undercollar to bottom edge of jacket.

3/ Sleeve length measurement taken along forearm seam from armhole to bottom edge of sleeve.

3.8 Workmanship. The finished jackets shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure supplies and services conform to prescribed requirements.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements; however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.1.2 Certificate of compliance. Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.4).
b. Quality conformance inspection (see 4.5).

4.3 Inspection conditions. All inspections shall be in accordance with the provisions set forth in MIL-STD-105, except where otherwise indicated herein.

4.4 First article inspections. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.5.3.1 through 4.5.3.3. The presence of any defect or failure to pass any test shall be cause for rejection of the first article. The number of units to be inspected shall be specified by the contracting officer (see 6.2).

4.5 Quality conformance inspection.

4.5.1 Testing of component. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing shall be as specified in FED-STD-191, wherever applicable.

4.5.1.1 Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with MIL-STD-105. The unit for expressing lot size and sample unit for testing each component shall be in accordance with the applicable subsidiary specification and as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Component	Lot size expressed as	Sample unit for testing
Collar interlining	yard	1-1/2 continuous yards, full width
Shoulder pads	pair	4 pairs
Sleevehead wadding	pair	2 pairs
Buttons, insignia	gross	20
Ring toggles	gross	10

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.3 Examination of end item. The end item shall be examined for the defects listed in 4.5.3.1 through 4.5.3.3. The sample unit shall be one jacket. All defects shall be classified as indicated in the list below except those numbered 1 through 34 in the classification column which shall be classified as follows. The inspection level shall be II (see 6.5).

Major defect - When seriously affecting appearance or serviceability.

Minor A defect - When not seriously affecting appearance or serviceability.

4.5.3.1 General defects. General defects shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Buttons	a. Missing, insecurely sewn, broken or defective: 1 button. 2 buttons. 3 or more buttons.	101	201	301

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

ends of the panel to the

Examine	Defects	Classification Major	Minor A	Minor B
Buttons (cont'd)	b. Type, size or collar other than specified.		202	
	c. One or more front buttons not sewn with the eagle in an upright position.			302
	d. One or both shoulder strap buttons not sewn with the eagle in an upright position toward the collar.			303
	e. Thread ends of hand sewn buttons not securely tacked off or tacking off omitted.			304
	Note: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; scratches, dents, blemishes, or imbedded foreign matter; loose shanks; or shells, poorly plated or badly shaded.			
Cleanness	a. One or more spots or stains of an obvious permanent nature: - on outside.	102		
	- on inside.		203	
	b. One or more removable spots or stains clearly noticeable: - on outside.	103		
	- on inside.			305
	c. Thread ends not trimmed or loose threads not removed on major portion of jacket.			306
	d. Two or more shade tickets not removed.			307
Components and assembly	a. Any defective component or defect of assembly (not herein classified).	104		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Components and assembly (cont'd)	b. Any component part or required operation omitted (not herein classified).	105		
Cutting	a. Any component part of the polyester/wool material not cut in accordance with the directional lines on the patterns or the specification requirements.	106		
	b. Any component part other than of polyester/wool material not cut in accordance with the directional lines on patterns or the specification requirements.		204	
Collar or shoulder strap eyelets (construction)	a. One or more omitted.	107		
	b. Stitching not securely caught on fabric, causing stitching to pull away from fabric.		205	
	c. One or more broken stitches in: 1 eyelet. 2 or more eyelets.		206	 308
	d. Eyelet uncut: 1 eyelet. 2 or more eyelets.		207	 309
	e. One or more not color of thread specified.	108		
Material defects and workmanship damages	a. Any weakening defect, such as smash, multiple float, loose slub, etc., that may develop into a hole.	109		
	b. Any hole.	110		
	c. Shade bar, slub, knot, etc.: - on outside.	111		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Material defects and workmanship damages (cont'd)	- on inside.		208	
	d. Scissors or knife cut, tear, mend, or burn.	112		
	e. Needle chew that may develop into a hole.	113		
	f. Exposed drill hole.	114		

Note: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which weakens the material of garment or affects appearance. Weakening or non-weakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows:

Material defect - No defect
Workmanship damages - Minor B defect

Seams and stitching	a. Accuracy of seaming:			
	1. Seam twisted, puckered or pleated, affecting appearance.		209	
	2. Part of garment caught in any unrelated operation or stitching.	115		
	3. Unsightly hand felling, or blind stitching exposed and visible on outside of jacket, affecting appearance.		210	
	4. Thread break or end of seam or stitching (when not caught in another seam or stitching, except ends of a continuous row of stitching) not securely backtacked.		211	
	5. Ends of a continuous line of stitching overlapped less than 1/2 inch.		212	

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:39Z
Check the source to verify that this is the currentversion before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	6. Not specified color of thread or various shades of thread used on outside of jacket.	116		
	b. Gage of stitching:			
	1. Beyond range of gage specified or varies from gage specified more than 1/16 inch when no range is specified.			310
	2. Irregular, i.e., unevenly gaged or corresponding stitchings not uniformly gaged, affecting appearance (to be scored only when the condition exists on a major portion of a seam).		213	
	3. Edge or raised stitching too close to edge, resulting in damage to cloth.	117		
	c. Open seams (broken, missing, or skipped stitches, except on top, raised or edge stitching, not resulting in an open seam):			
	1. On outside of jacket except hand felling:			
	- not more than 1/8 inch.			311
	- more than 1/8 inch but not more than 1/2 inch.		214	
	- more than 1/2 inch.	118		
	2. Inside of coat (except hand or machine felling):			
	- not more than 1/4 inch.			312
	- more than 1/4 inch.		215	
	3. Hand or machine felling:			
	- not more than 3/8 inch.			313
	- more than 3/8 inch.		216	
	d. Stitches skipped, missing, or broken on top, edge or raised stitching not resulting in an			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	open seam: - 1/4 inch or more but not more than 1/2 inch.			314
	- more than 1/2 inch.		217	
	e. Raw edges (classified as such when they occur at places where an edge is required to be turned under. Raw edges not securely caught in the stitching shall be classified as an open seam): 1. On outside: - less than 1/8 inch.			315
	- 1/8 inch or more but not more than 3/8 inch		218	
	- more than 3/8 inch.	119		
	2. On inside: - 1/8 inch or more but not more than 3/8 inch.			316
	- more than 3/8 inch.		219	
	f. Runoffs: 1. Joining seams - when resulting in an open seam use "open seam" classification. 2. Top, edge or raised stitching when not resulting in an open seam: - 1/4 inch or more but not more than 1/2 inch.			317
	- more than 1/2 inch.		220	
	g. Seam or stitch type: Not type specified.		221	
	h. Stitch tension: 1. Loose tension, resulting in a loose seam.	120		
	2. Loose tension on edge or raised stitching, resulting in loosely exposed bobbin thread or top thread.		222	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	3. Tight tension (stitches break when normal strain is applied to seam or stitching), classify as open seam.			

Note: Puckering is evidence of tight tension. When puckering is evident, the seam shall be tested by exerting pull in the lengthwise direction of the seam or stitching.

	i. Stitches per inch (to be scored only if the condition exists on a major portion of seam): 1. Less than the minimum specified: a. Except on label: 1 or 2 stitches.			318
	3 stitches.		223	
	4 or more stitches.	121		
	b. On label: 1 or more stitches on label.			319
Shaded parts	a. Any outside part (except undercollar parts and underply of shoulder strap) shaded.	122		
	b. Undercollar parts or underply of shoulder strap badly shaded.			320
	c. Any lining parts badly shaded except parts cut from ends.		224	
	d. Sleeve lining parts or pairs of sleeve linings badly shaded.		225	
	e. Underply of shield(s) badly shaded.			321
Pressing	a. Burned or scorched.	123		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Pressing cont'd)	b. Poorly pressed (unless otherwise indicated.)		226	
	c. Pressing impressions not removed on major portion of coat, affecting appearance.			322
	d. Edges bulky, i.e., not pressed solid.			323
	e. Body lining not smoothly pressed.			324
	f. Collar not creased across center back or crease extending less than 1-1/2 inches.			325
	g. Inside of armhole(s) not pressed solid in the lower part or not creased at edge of armhole seam allowance.		227	
	h. Armhole(s) not blocked or poorly blocked, affecting appearance.		228	
	i. Sleeve(s) creased.		229	
	j. One or both lapels creased.			326

4.5.3.2 Detailed defects. Detailed defects shall be classified as follows:

Alignment of buttons	a. Corresponding buttons unevenly spaced from bottom or front edges of the jacket by more than 1/4 inch.		230	
	b. Buttons out of vertical alignment by more than 1/4 inch.		231	
Fronts	a. Length of fronts from top of lapel to finished bottom of jacket uneven in length by: - more than 1/8 inch, but not			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Fronts (cont'd)	more than 1/4 inch.		232	
	- more than 1/4 inch.	124		
	b. Top (step) of lapels measuring:			
	- less then 1-1/2 inches or more than 1-3/4 inches.		233	
	- uneven in length by more than 1/4 inch.		234	
	c. Facing:			
	- twisted, short, or tight, causing lapel corner to curl out.	125		
	- full or puckered on lapel.	126		
	d. Front part exposed on lapel edge or facing exposed on front edge below lapel, affecting appearance.		235	
	e. Lapel or bottom corner not forced out, or edge along top or front of lapel or along front or bottom (for width of facing) edges of jacket not forced out so that the seamline is at the edge, affecting appearance.		236	
	f. Bottom corners poorly shaped or not of uniform shape.	127		
	g. Lapel, front or bottom (for width of facing) edges irregular or bulky, affecting appearance.		237	
	h. Front or lapel edges stretched, affecting appearance.		238	
	i. Tape set on tightly causing puckering on front, affecting appearance.		239	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Fronts (cont'd)	j. Front (below lapel): 1. Twisted, short or tight causing bottom corner to curl out.	128		
	2. Full or puckered.	129		
	k. Felling stitches of tape to interlining along front edge, or tacking stitches of seam allowance at back edge of facing to interlining, visible on outside below lapel.		240	
	l. Buttons not sewn through all plies.		241	
	m. Bridle tape extending onto the lapel side of the roll (break) line, or not held tight, causing the roll (break) line to bulge outward when jacket is worn.		242	
	n. Edge stitching along step and edge of lapel, and front edge below lapel omitted.		243	
Collar	a. Short, causing fronts or back to pucker at outer edge of collar; or bottom of lapel roll below the top button.	130		
	b. Long, not fitting the neck closely; or bulging at the gorge seam or along the outer edge of the collar; or bottom of lapel more than 3 inches above the top button.	131		
	c. Set of collar causing collar to twist, or fronts or back to be distorted.	132		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar (cont'd)	d. Collar off center at front ends or undercollar at center back by more the 1/4 inch with shoulder seams matched.		244	
	e. Topcollar full, puckered or bulging on undercollar; or interlining full, pleated or twisted.	133		
	f. Topcollar twisted on undercollar.		245	
	g. Topcollar tight causing corners of collar to curl or undercollar to bulge.		246	
	h. Topcollar tight at joining to gorge seam, causing fullness on lapels.	134		
	i. Tacking of topcollar (gorge) seam to neck of jacket front or neck outlet of jacket across back to interlining and undercollar omitted or insecure.		247	
	j. Ornamentation not centered on topcollar.		248	

Note: For additional defects applicable to ornamentation on finished collar, see MIL-O-82112.

	k. Undercollar neck edge tight across front or back causing fullness or pleats on outside of front or back, affecting appearance.		249	
	l. Tacking at one or both neck ends of collar to jacket fronts omitted or insecure.		250	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar (cont'd)	m. Row of stitching along breakline or top (outer) or side (end) edges through undercollar and interlining omitted.		251	
	n. Breakline (undercollar stand) at the vertical center less than 1 inch or more than 1-1/4 inches from the neck edge of the undercollar.		252	
	o. Interlining tight or twisted, causing puckers on undercollar.		253	
	p. Collar edge crooked or undercollar edge exposed along the edge, affecting appearance.		254	
	q. Ends of collar measuring: - less than 1-1/2 inches or more than 1-3/4 inches.		255	
	- uneven in length by more than 1/4 inch.		256	
	r. Diameter of eyelet opening less than 1/8 inch or more than 3/16 inch.			327
	s. Edge of eyelet opening less than 7/8 inch or more than 1-1/8 inches from outer (upper) or side (end) edges of collar.		257	
	t. Eyelets on ends of collar unequally spaced from outer (upper) or side (end) edges of collar by more than 1/4 inch.		258	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine		Defects	Classification Major	Minor A	Minor B
Collar (cont'd)	u.	Purling of eyelets not on topcollar side of collar or purling at edge of eyelet opening.			328
Collar and lapel shapes	a.	Not uniform, i.e., left or right side (ends) of collar and top edge (step) of lapel varying in length by 1/4 inch or more.		259	
	b.	Pointed ends poorly shaped or not of uniform shape or size.	135		
	c.	Lapels poorly shaped or not of uniform shape or size.	136		
Gorge seam	a.	Not straight, affecting appearance.		260	
Shoulders	a.	Improperly joined or set, causing shoulders, front or back to twist or be distorted, affecting appearance.	137		
	b.	Shoulder seam not held short when pressed, i.e., not curving slightly forward at the neck end.		261	
Shoulder pads	a.	Misplaced, not serving intended purpose, i.e., too far back or too far forward.		262	
	b.	Not securely tacked to jacket front interlining or armhole seam.		263	
Shoulder straps	a.	Back edges of straps uneven distance from shoulder seamline at armhole by more than 1/4 inch.		264	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Shoulder straps (cont'd)	b. Shoulder seamline exposed beyond back edge of one or both shoulder straps.	138		
	d. Rounded (neck) ends of straps uneven distance from finished lower (neck) edge of undercollar by more than 1/4 inch.		265	
	e. Width of shoulder strap at armhole seamline: 1-3/4 ± 1/8 - Any varience is a major defect.	139		
	f. Width of shoulder strap across collar end in line with the eyelet: 1-3/8 ± 1/8 - Any varience is a major defect.	140		
	g. Button or strap misplaced so that the strap will not lie flat, causing bulge or twist on strap, affecting appearance.	141		
	h. Shoulder strap eyelet:			
	1. Edge of eyelet opening positioned from rounded end of strap less than 5/8 inch or more than 3/4 inch.		266	
	2. Not centered by 1/8 inch or more.			329
	3. Diameter of opening less than 1/8 inch or more than 3/16 inch.			330
	4. Purling of eyelet on underside of shoulder strap or at edge of eyelet opening.			331
Armholes	a. Badly stretched, affecting appearance.	142		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Armholes (cont'd)	b. Taped too tightly, causing pucker or pleat at armhole seamline on jacket front or back, affecting appearance.	143		
	c. Crooked seamline clearly noticeable, affecting appearance.			332
	d. Tape stitching exposed and visible on outside surface of jacket, affecting appearance.			333
	e. Sleevehead pads not completely tacked to armhole seam allowance or misplaced, not serving intended purpose.		267	
Sleeves	a. Sleeve fullness misplaced or concentrated in one area, affecting appearance.	144		
	b. Sleeve tight, i.e., front or back of sleeve not having a roll effect at armhole, affecting appearance.	145		
	c. Sleeve too far front, i.e., front of sleeve less than 2 inches back of front seam at bottom edge of jacket.	146		
	d. Sleeve too far back i.e., front of sleeve more than 4 inches back of front seam at bottom edge of jacket.	147		
	e. Sleeves not hanging alike, i.e., fronts of sleeves uneven distance by more than 1 inch from front seam at bottom edge of jacket.		268	
	f. Lower part of top sleeve tight causing bulge, break or twist in sleeve at lower			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	front near armhole, affecting appearance.	148		
	g. Front seams in sleeves at armhole uneven distance from side seam in jacket by more than 1/4 inch.		269	
	h. Back seams in sleeves at armhole uneven distance from side seam in jacket more than 1/2 inch.		270	
	i. Sleeve bottom edge uneven by more than 1/4 inch.			334
	j. Sleeve lining twisted, tight, or short causing bulge or twist on outside of sleeve.	149		
	k. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			335
	l. Blindstitching at top edge of sleeve turnup omitted or incomplete; or blindstitches exposed on outside of sleeve.		271	
	m. Bottom of sleeve lining less than 1 inch or more than 1-1/4 inches from finished bottom edge of sleeve.			336
	n. Sleeve lining seamlines out of alignment by more than 3/4 inch with corresponding seamline at armhole or bottom of sleeves.			337
	o. Tacking of topsleeve lining seam allowances to the corresponding sleeve seal allowance omitted, insecure, or incomplete; tacking of forearm seam allowance			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	extending from less than 2 inches or more than 4 inches below armhole; tacking of backarm seam allowance extending from less than 3 inches or more than 5 inches below armhole; or tacking of forearm or backarm seam allowance extending from less than 2 inches or more than 3 inches above top of reinforcement at bottom of sleeve.			338
	p. Sleeve patch:			
	1. Not centered on the top sleeve or one patch farther forward or back from the patch on the other sleeve by more than 1/4 inch.		272	
	2. Bottom edge above or below finished bottom edge of sleeve by more than 1/8 inch.		273	
	3. Set on crooked, i.e., not parallel to bottom of sleeve by more than 1/8 inch.		274	
Body	a. Lining or interlining tight, short, or twisted, causing fullness or distortion of outside of jacket.	150		
	b. Lining too long, i.e., exposed below bottom of jacket.		275	
	c. Front interlining too full, causing jacket front to have a wavy appearance.	151		

Note: For additional defects applicable to sleeve patch, see MIL-O-82112.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Body (cont'd)	d. Bottom edge irregular or uneven, affecting appearance.			339
	e. Felling stitches or top of hem turnup tight, causing puckering on outside of jacket.		276	
	f. Felling stitches conspicuous on outside of jacket, i.e., more than two yarns of outside fabric caught in felling stitches.		277	
Labels	a. Identification: 1. Missing, incorrect or illegible.		278	
	2. Misplaced, i.e., on right front lining; or front end extending onto the facing; or bottom edge less than 2-1/2 inches or more than 4 inches above finished bottom edge of jacket.			340
	3. Not stitched on one or more sides or stitching through printing.			341
	b. Size: 1. Missing, incorrect or illegible.	152		
	2. Misplaced, i.e., not centered on back neck of lining by more than 1 inch.		279	
	3. Top edge not securely caught to neck edge of jacket.		280	
Hanger	a. Omitted or ends not securely caught to neck edge of jacket.		281	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Hanger (cont'd)	b. Misplaced, i.e., not centered on back neck of lining by more than 1 inch.			342
	c. Ends of hanger spread apart less then 1-1/2 inches or more than 2 inches.			343
Front facings	a. Fullness of facings between buttons (stitches attaching) or between buttons and front edge.			344
	b. Tacking of seam allowance on back edge of facing to interlining: 1. Omitted, incomplete or insecure.		282	
	2. Extending from less than 2 inches or more than 3 inches below shoulder; or extending from less than 1 inch or more than 3 inches above finished bottom of jacket.			345
	c. Lower back edge of facing not turned under; or felling to hem turnup below corner of lining omitted or insecure.			346
	d. Felling along front or bottom edge of lower front corner of lining to hem turnup omitted or insecure.			347
Bottom edge	a. Felling at top of bottom hem turnup omitted or incomplete.		283	
Body lining	a. One or both shoulder pleats or center back pleat omitted.		284	
	b. Outside fold of shoulder pleat not toward the armhole.		285	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Body lining (cont'd)	c. Center back pleat less than 1/2 inch in depth.			348
	d. Bottom folded edge of lining more than 3/4 inch from finished bottom edge of jacket.			349
	e. Blindstitching less than 1/4 inch or more than 3/8 inch above bottom folded edge of lining; or the stitches caught through the top ply of the bellows pleat at the bottom of the lining.			350
	f. Excessive fullness on front or back lining, resulting in wrinkles pressed in as pleats.			351
	g. Side seams in lining not aligned with corresponding side seams in jacket by more than 3/8 inch; or lining twisted, not effecting smoothness on outside of jacket.			352
	h. Facing-lining seam on one or both fronts or side seams not pressed toward the back; or underarm bust dart not pressed toward the armhole.			353
	i. Underarm darts in lining uneven in length by more than 1/2 inch; or end(s) of dart(s) ending in an unsightly bulge.			354
	j. Seams joining back to side back not pressed flat toward the center back.			355

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Body lining (cont'd)	k. One or more seams in lining not pressed flat (pleated along seamline).			356
	l. Felling edge of sleeve lining at lower armhole not backstitched; or backstitched from less than 1 inch or more than 2 inches in front of the forearm sleeve lining seam to less than 1/2 inch in front or more than 1/2 inch back of the lining side seamline.			357
Shields	a. Edges not forced out so that the seamline is at the edge of the shield by more than 1/6 inch.			358
	b. Edge of shield crooked or both shields not uniform in shape or size.			359
	c. Not centered with side seam by more than 1/2 inch.			360
	d. Less than 2-1/4 inches or more than 2-3/4 inches in depth at the vertical center below the felled armhole edge of the sleeve lining.			361

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.5.3.3 Finished measurements. Any measurement deviating from the nominal dimension and tolerance specified in table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5.4 Examination of packaging. An examination shall be made to determine that packaging, packing and marking requirements of section 5 of this specification are complied with. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container, fully prepared for delivery, with the exception that it need not be sealed. Shipping containers fully prepared for delivery shall be examined for the defects of closure listed below. The lot size shall be the number of shipping containers in the end item inspection.

Examine	Defects
Marking (exterior & interior)	Omitted; incorrect; illegible; or of improper size, location, sequence, or method of application.
Materials	Any component damaged or otherwise defective, affecting serviceability.
Workmanship	Inadequate application of components, such as incomplete closure of container flaps, loose strapping, or inadequate stapling. Bulging or distortion of containers.
Content	Improper number of jackets per intermediate container. One intermediate package from each container in the sample shall be examined. Improper number of intermediate packages per container.

5. PACKAGING

5.1 Packaging. Packaging shall be commercial.

5.1.1 Commercial. Jackets shall be packaged to afford adequate protection against physical damage during shipment from the contractor to the first receiving activity. The package and quantity per package shall be the same as that normally used by the contractor for retail distribution.

5.2 Packing. Packing shall be commercial.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

5.3 Marking. In addition to any special marking required by the contract or order, shipping containers shall be marked in accordance with MIL-STD-129.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The jacket described herein is intended to be worn by female officer's of the U.S. Marine Corps.

6.2 Acquisition requirements. Acquisition documents must specify the following:

a. Title, number and date of this specification.

b. Sizes required (1.2).

c. Whether first article is required (3.2).

d. Number of jackets in first article (see 4.4).

e. Acceptance criteria (see 6.5)

6.3 Standard samples and shade samples. For information regarding the availability of samples of the jacket and the standard shades specified, address inquiry to procuring activity issuing the Invitation for Bids (see 3.1, 3.3.1, and 3.3).

6.4 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a pre-production sample. The contracting officer should specify the appropriate type of first article and the number of units to be furnished. The contracting officer should also include specific instructions in acquisition documents regarding arrangements for selection, inspection, and approval of the first article.

6.5 Acceptance criteria. The acceptance criteria below are recommended for use. The acceptance criteria as specified in the contract or purchase order shall be binding. Unless otherwise specified, the following acceptance criteria are in accordance with MIL-STD-105.

6.6 Figures. Figures are furnished for information purposes only. To the extent of any inconsistencies between the written specification and the figure, the written specification shall govern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

6.7 Subject (key word) listing.

Black
Evening
Jacket
Ornamented

6.8 Changes from previous issue. Asterisks are not used in this revision to identify changes with respect to the previous issue, due to extensive changes.

Preparing Activity:
Navy - MC
Project No. 8410-N750

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.


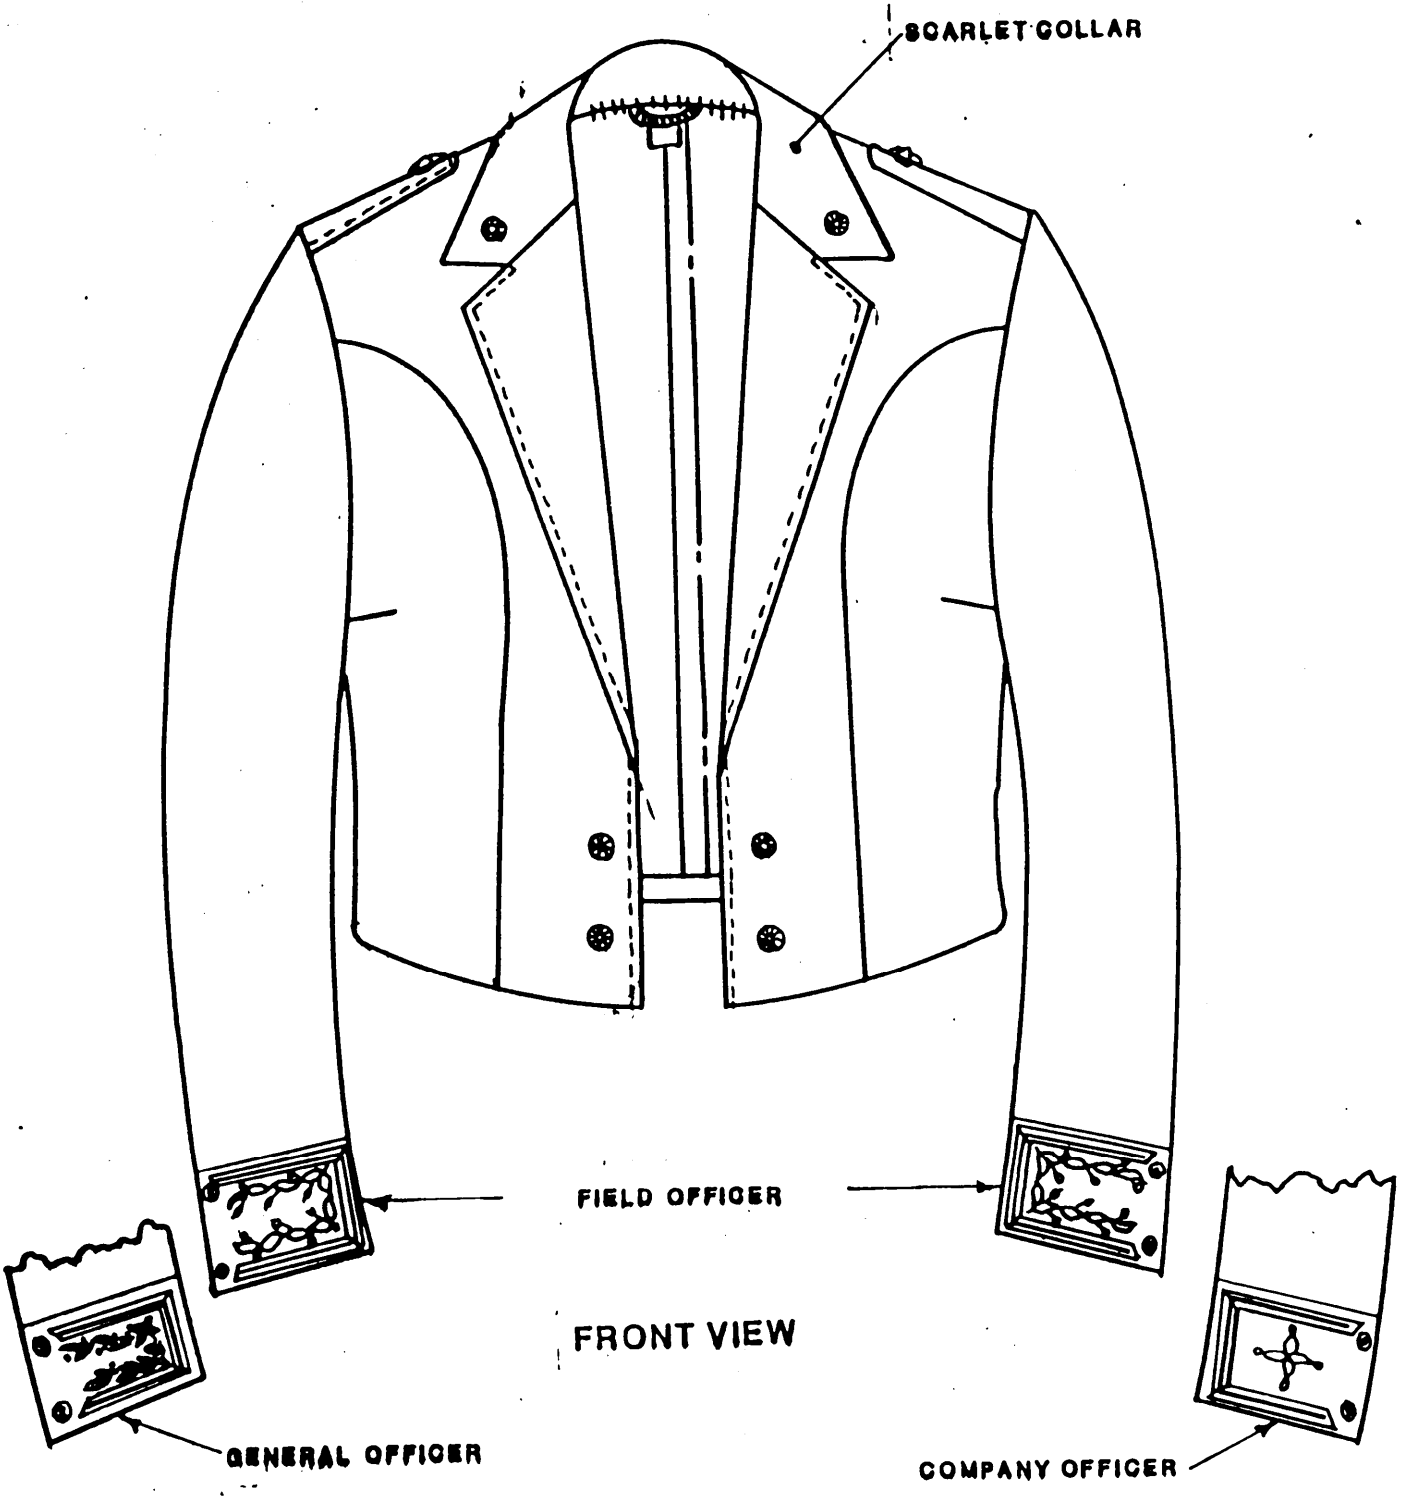


FIGURE 1: JACKET WOMANS, EVENING DRESS OFFICERS


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

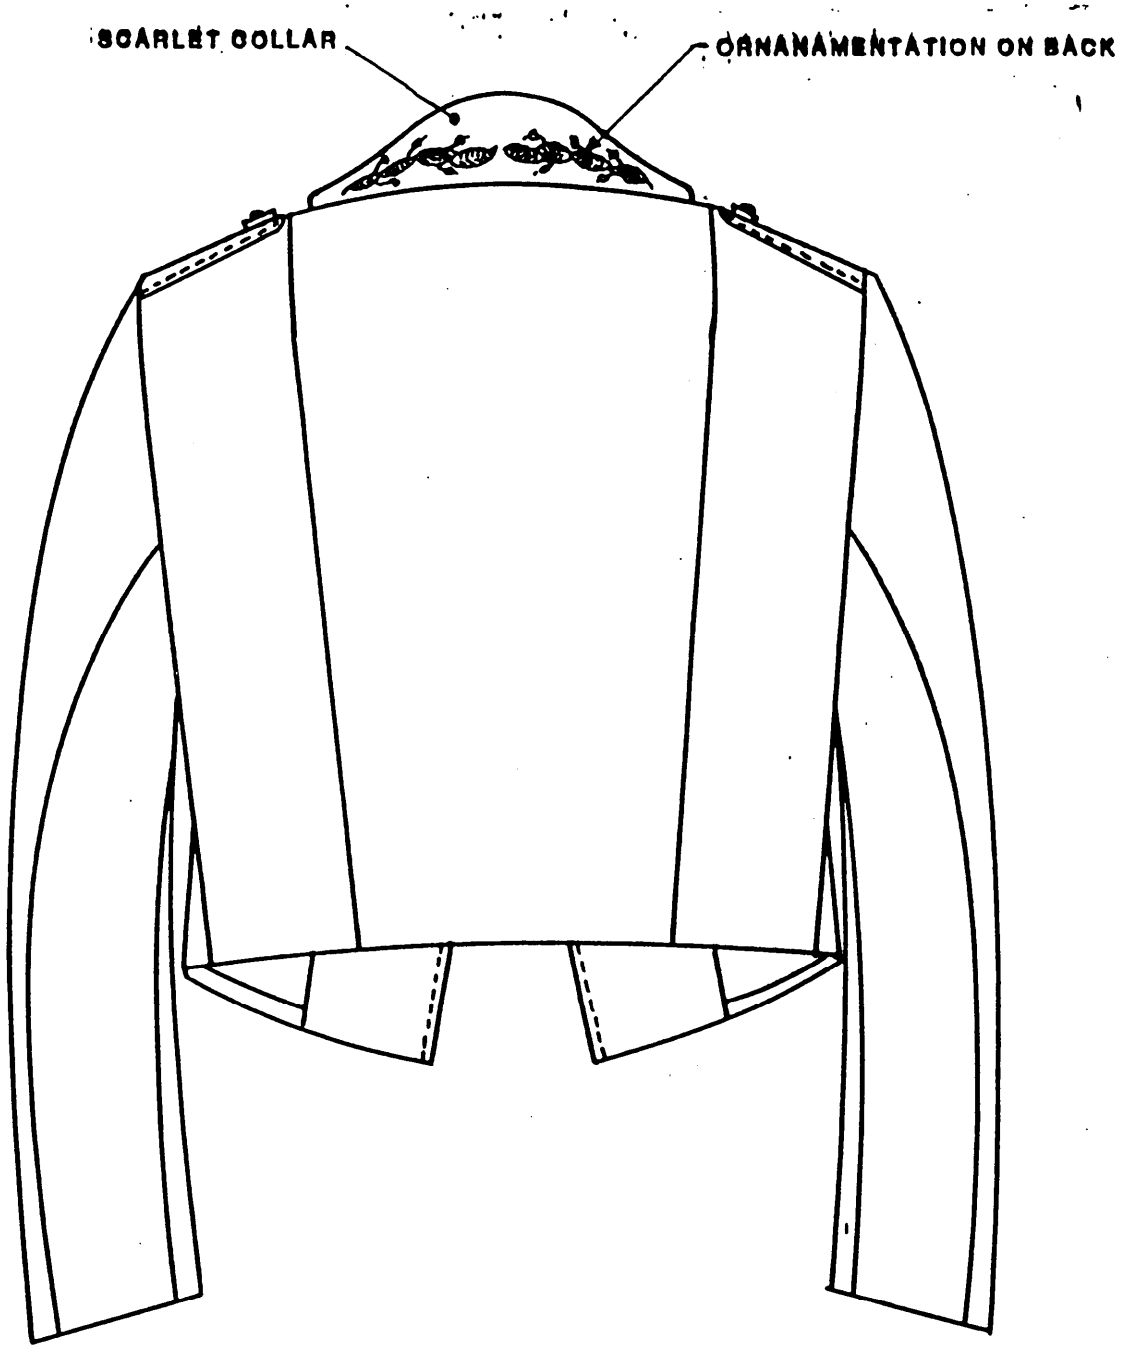

BACK VIEW

FIGURE 2: JACKET, WOMANS: EVENING DRESS, OFFICERS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

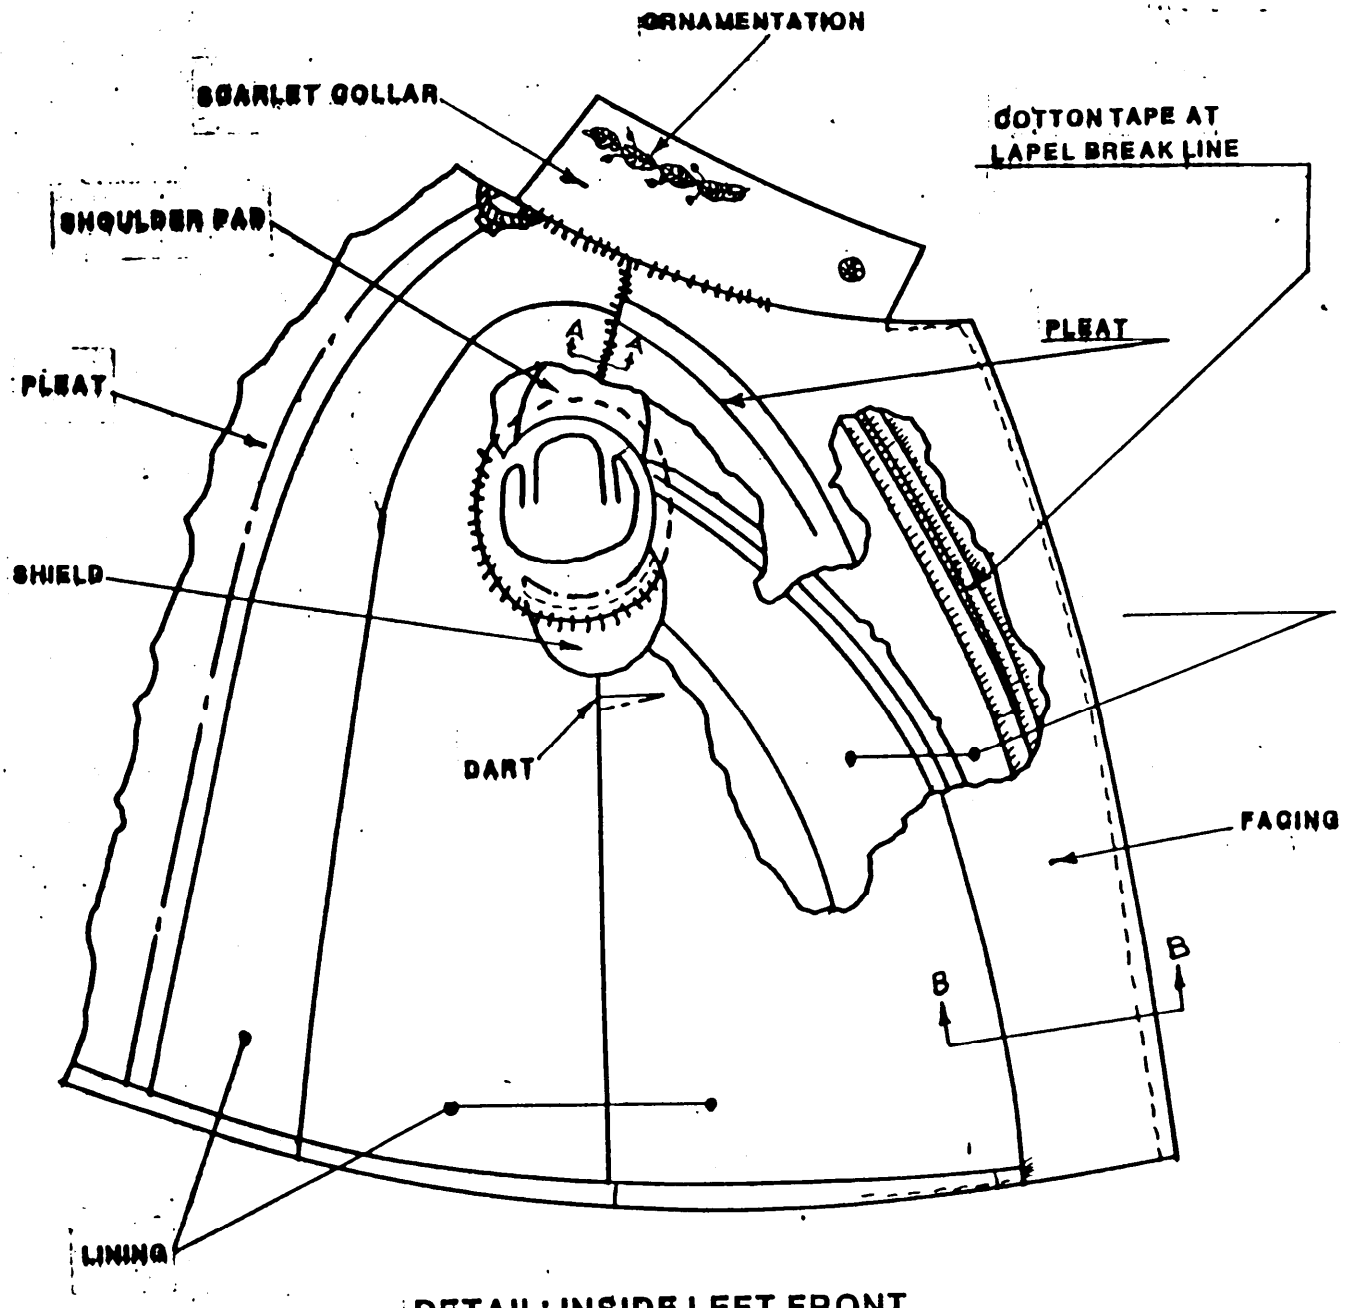

DETAIL: INSIDE LEFT FRONT

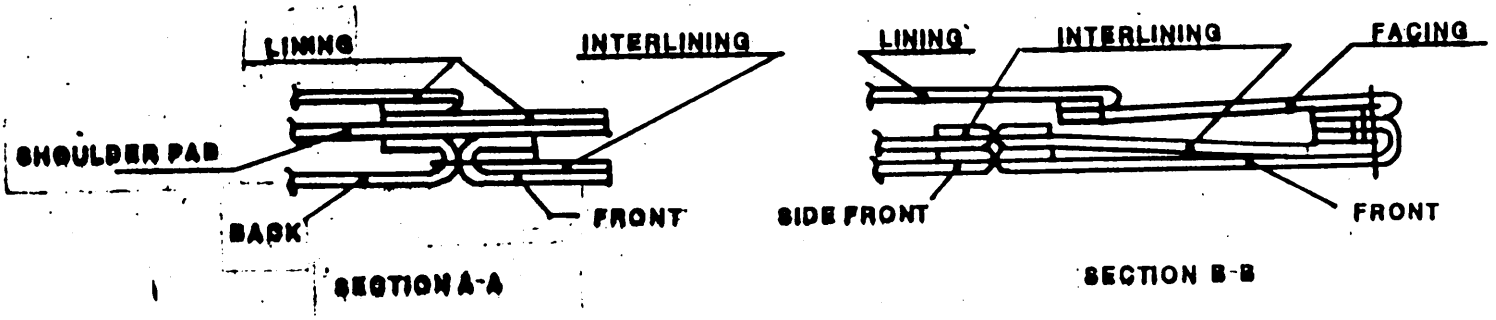


FIGURE 3: JACKET, WOMANS: EVENINGDRESS, OFFICERS

Source: https://assist.dla.mil Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	1. DOCUMENT NUMBER	2. DOCUMENT DATE (YYMMDD)
	MIL-J-82122C(MC)	20 September 1994

3. DOCUMENT TITLE

JACKET'S, WOMAN'S: EVENING DRESS (OFFICER'S)

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a. NAME	b. TELEPHONE (Include Area Code)	
COMMANDER	(1) Commercial 703-640-4584	(2) AUTOVON 278-4584
c. ADDRESS (Include Zip Code) PROGRAM SUPPORT DIRECTORATE, (PSE-C/S) MARCORSYSCOM, 2033 BARNETT AVE SUITE 315 QUANTICO VA 22134-5010	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT: Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

DD Form 1426, OCT 89 Previous editions are obsolete. 198-290

Source: https://assist.dla.mil -- Downloaded: 2026-0-26104:39Z
Check the source to verify that this is the current version before use.