MIL-C-82145A(MC)
2 August 1973
SUPERSEDING
MIL-C-82145(MC)
21 March 1967

MILITARY SPECIFICATION

COAT, MAN'S: SPECIAL FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN'S

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

*1.1 Scope. This specification covers requirements for a musician's scarlet wool special full dress coat.

*1.2 Classification. The coat shall be of one type in the following sizes as specified (see 6.2):

Schedule of sizes

(Short, Regular, Long, Extra Long)

34
35
36
37
38
39
40
41
42
44
46

1.3 Individual orders. When the coat is custom tailored to an individual order, this specification shall govern, except that the detail requirements of Section 3, Table I may be modified to the extent necessary for good custom tailoring practice.

2. APPLICABLE DOCUMENTS

*2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of the specification to the extent specified herein.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

V-T-276	- Thread, Cotton.
V-T-280	- Thread, Cotton Gimp, Buttonhole.
V-T-301	- Thread, Silk.
DDD-L-20	- Label; For Clothing, Equipage And Tentage (General Use).
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached, or Dyed).

MILITARY

MIL-C-326	- Cloth, Silesia, Cotton.
MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill, Rayon.
MIL-B-3461	- Buttons, Insignia, Metal, Uniform and Cap.
MIL-P-15064	- Pad, Shoulder and Sleeve-head.
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/wool.
MIL-C-41820	- Cloth, Gabardine, Polyester and Rayon.
MIL-C-43718	- Cloth, Twill, Polyester and Cotton.
MIL-C-82114	- Coat Front For Coats, Musicians.
MIL-C-82252	- Cloth, Broadcloth, Wool, and Wool Synthetic.

STANDARDS

FEDERAL

FED-STD-151	- Metal, Test Methods.
FED-STD-191	- Textile Test Methods.
FED-STD-751	- Stitch, Seam, And Stitching.

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	- Marking for Shipment and Storage.

(Copies of specifications and standards required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

*2.2 Other publications. The following document forms a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

3. REQUIREMENTS

3.1 Samples. Samples are furnished solely for guidance and information to the supplier (see 6.3). Variation from the specification may appear in the sample, in which case the specification shall govern.

*3.2 First article. Unless otherwise specified (see 6.2), before production is commenced, the first article consisting of the number of finished coats specified by the procuring activity (see 6.2) shall be submitted, or made available, to the contracting officer or his authorized representative for approval. The approval of the first article authorizes commencement of production, but does not relieve the supplier of responsibility for compliance with all provisions of this specification. The first article shall be manufactured by the supplier in the same facilities to be used for the manufacture of the production items.

3.3 Materials.

*3.3.1 Basic material. The basic material shall be cloth, wool, tropical, scarlet shade 2502 (see 6.3), 10.5 ounce conforming to type I, class 1 of MIL-C-21115.

*3.3.2 Collar, shoulder straps and cuff material. The material for the collar, shoulder straps and cuffs shall be cloth, polyester/wool blend, black shade 2607 (see 6.3), conforming to type III, class 1 of MIL-C-21115.

*3.3.3 Lining. The material for lining the coat and collar and for making the underarm shields, coat hanger and straps to secure the lining to the bottom edge of coat shall be cloth, rayon twill, scarlet shade 2506 (see 6.3), conforming to class 1 of MIL-C-368.

*3.3.4 Silesia or polyester and cotton. The stays for armhole and shoulder seams, the binding for the neck edge of the coat front interlining and the collar interlining shall be cut from cloth, cotton silesia, 4.5 ounce, conforming to type I of MIL-C-326 or polyester and cotton conforming to type I of MIL-C-43718. The silesia or polyester and cotton shall be khaki shade 3707. The requirements for nonfibrous material and seam efficiency shall not apply.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

*3.3.5 Collar interlining. The material for interlining the collar shall be cloth, cotton buckram, double texture, laminated, starch finish, natural color, conforming to the following when tested as specified in Section 4, Table III.

*3.3.5.1 Cotton buckram. The buckram shall be made of cotton of suitable staple length and grade to meet the requirements of this specification. The cotton shall be thoroughly cleaned, carded, drawn and evenly spun.

*3.3.5.2 Weave. The weave of the single plies of the cloth shall be four harness; 2 up and 2 down herringbone twill, 20 ends right and 20 ends left.

*3.3.5.3 Texture. The cloth shall each have a minimum thread count per inch of 50 in the warp and 20 in the filling.

*3.3.5.4 Laminated cloth. The two plies of the cloth shall be thoroughly adhered together with a synthetic resin type laminating material which shall not cause any objectionable odor in the finished cloth. The laminated cloth shall show no evidence of delamination after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests as specified in Section 4, Table III.

*3.3.5.4.1 Finish. The laminated cloth shall have a starch finish. The original stiffness of the finished cloth, and the stiffness of the cloth after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests shall conform to the following when tested as specified in Section 4, Table III.

Stiffness, inch-pound:	Minimum	Maximum
- original	0.60	0.95
- after accelerated aging	0.70	0.95
- after wet (dry) cleaning	0.50	0.85
- after perspiration	0.50	0.85

*3.3.5.4.2 Weight. The weight of the finished laminated cloth shall be 21 to 23 ounces per square yard (see Section 4, Table III).

*3.3.5.4.3 Breaking strength. The breaking strength of the finished laminated cloth shall be 100 pounds minimum in the warp direction and 80 pounds minimum in the filling direction, when tested as specified in Section 4, Table III. After being subjected to the accelerated aging test, the breaking strength of the cloth shall be not less than the original breaking strength when tested as specified in Section 4, Table III.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*3.3.6 Coat fronts. The coat fronts shall conform to class 1 of MIL-C-82114.

*3.3.7 Shoulder pads. The shoulder pads shall conform to type I, class 2, of MIL-P-15064.

*3.3.8 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

*3.3.9 Stay tape. The stay tape for the armholes shall be cotton, unbleached, 1/4 inch wide conforming to type III, class 1 of DDD-T-86, except the requirement for nonfibrous material shall not apply.

*3.3.10 Piping. The material for piping the shoulder straps, collar, sleeve cuffs, front and bottom edges of coat shall be cloth, gabardine, polyester and rayon, white shade 3042 (see 6.3), conforming to type I of MIL-C-41820.

3.3.11 Collar tab. The material for collar tab shall be cloth, wool broadcloth, blue shade 2307 (see 6.3), conforming to type I, class 2, of MIL-C-82252.

3.3.12 Thread.

3.3.12.1 Silk thread. The silk thread shall conform to V-T-301, except the requirement for extractable material shall not apply. The thread for machine sewing shall conform to type I, size A, for bartacks and all outside seaming and stitching; size 0 for machine felling; and sizes B and F for buttonhole needle and bobbin thread respectively. The thread for hand sewing shall conform to type III, class 3, size C, 2-ply.

3.3.12.2 Cotton thread. The cotton thread shall conform to V-T-276, type IC2, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching; type IA1, soft finish, ticket No. 70, 2-ply for serging and overedge stitching; type IB3, glazed finish, ticket No. 24, 4-ply for sewing on buttons and machine tacking armholes. The thread for tacking sleeve lining, hand tacking facing to interlining and basting shall be a good commercial grade.

*3.3.12.3 Color and colorfastness. The thread for the scarlet material shall be scarlet shade W, Cable No. 66040, and the thread for the dark blue material shall be black, except cotton thread for basting and machine tacking armholes, which may be white; and the thread for overedge stitching of the piping at bottom edge of coat shall be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning, and in addition, the silk thread shall show good fastness to light.

*3.3.13 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of V-T-280. The color of the gimp shall be scarlet shade W, Cable No. 66040 and shall show good fastness to wet (dry) cleaning.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

*3.3.14 Buttons.

*3.3.14.1 Insignia buttons. The insignia buttons shall be metal, gold plated, enlisted design, 27-line for shoulders, and cuffs and 40-line for fronts, conforming to type I, style 3, class A, subclass 2 of MIL-B-3461.

3.3.14.1.1 Ring toggles. Ring toggles for securing the 27-line insignia buttons to sleeve cuffs and shoulders shall conform to MIL-B-3461.

*3.3.15 Hooks and eyes. The hooks and eyes for closing the collar shall be brass, black enameled finish, size No. 16 commercial type. All surfaces and edges of the hooks and eyes shall be clean, smooth, free from burrs, tool marks, sharp edges, and roughness. The hook and eye shall be thoroughly and completely lacquered with the best available quality of black japanned lacquer. The dry lacquer film shall be continuous, level, adherent, free from lint, dust, or other foreign inclusions that may affect appearance or serviceability, and shall withstand the test for tackiness specified in Section 4, Table III.

*3.3.16 Labels. Each coat shall have a combination personal-clothing identification label and a size label as follows. The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

*3.3.16.1 Combination personal-clothing identification label. The combination personal-clothing identification label shall conform to type I, classes 1 and 10 (combined) of DDD-L-20 except all printing and the space between the lines of printing shall be minimum 10 point (approximately 1/8 inch). The content and format shall be as follows:

NAME _____
SERVICE NO. _____
COLLAR SIZE _____
NOMENCLATURE (item description)
_____
CONTRACT NO. _____ DATE _____
NAME OF CONTRACTOR _____
WOOL PRODUCTS ACT INFORMATION
_____

*3.3.16.2 Size label. The size label shall conform to type I, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L, or XL for Short, Regular, Long and Extra Long, as shown by the following example:

40 R
Stock number

The stock number may be omitted from the size label but when omitted, it shall be incorporated in the identification label.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*3.4 Design. The coat shall be the U. S. Marine Corps design shown on Figures 1 through 5, a seven-button, single-breasted formfitting, fully-lined coat, having a one-piece front, waist and chest darts, a three-piece back without a center vent, sleeve cuffs, shoulder straps with buttons and a stand-up collar with hooks and eyes for front closure. The top and bottom edges of collar, front and bottom edges of coat, the top edges of sleeve cuffs and the edges of shoulder straps shall be piped.

*3.5 Patterns. Standard patterns will be furnished to the supplier by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the supplier's working patterns. The supplier's working pattern shall be identical to the standard patterns. The standard patterns shall provide 3/4-inch allowance for side seams and 3/8-inch allowance for all other seams except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

*3.5.1 List of pattern parts. Coats shall be cut from materials specified herein in accordance with the pattern parts indicated below:

Item	Pattern nomenclature: Material: Basic material; cloth, wool tropical (scarlet)	No. of cut parts
1.	Front	2
2.	Front facing, right	1
3.	Front facing, left	1
4.	Side back	2
5.	Center back	1
6.	Top sleeve	2
7.	Under sleeve	2
	Material: Cloth, polyester/wool (black)	
8.	Collar	1
9.	Shoulder straps	2
10.	Cuffs	2
	Material: Cloth, wool, broadcloth	
11.	Collar tab	1
	Material: Cloth, rayon lining	
12.	Front	2
13.	Side back	2
14.	Center back	2
15.	Top sleeve	2
16.	Under sleeve	2
17.	Collar lining	1
18.	Underarm shield	4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature: Material: Silesia or polyester and cotton	No. of cut parts
19.	Collar underply	1
	Material: Cloth, cotton, buckram	
20.	Collar interlining	1
	Markers	
21.	Cuff and button marker	

3.6 Construction.

*3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I.

3.6.1.1 Operations. The supplier is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1.2 Stitches, seams, and stitching. The stitch, seam and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch, as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.2.1 Thread breaks and ends of seams. The end of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitching shall be back-tacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

3.6.1.3 Shade marking. The component parts of the coat cut from one piece of basic and lining materials, including the sleeve lining and underarm shields when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

(1) Corrosive metal fastening devices.
(2) Sew-on shade tickets.
(3) Adhesive type tickets which show discoloration and the adhesive mass which adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 20260-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
1.	Cutting. a. Cut the coats in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction indicated by directional lines on the patterns. c. Cut all scarlet wool parts from one piece of the basic material. d. Cut the body and collar lining and the top ply of the underarm shields from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve lining are cut from ends, the shade of the sleeve lining shall match. Cut the strips for coat hanger and lining securing straps 1-1/8 inches wide. e. Cut the wool material for the sleeve cuffs, shoulder straps, and outer ply of collar from the material specified in 3.3.2. f. Cut the collar tab from dark blue material specified in 3.3.11. g. Cut silesia or polyester and cotton stays for armhole and shoulder seams on the bias 3/4 inch wide and 4 ±1/4 inches long. Cut silesia or polyester and cotton for binding the neck edge of the coat front interlining on the bias, 3/4 inch wide and approximately 5 inches long. Cut silesia or polyester and cotton for interlining collar on the straight in accordance with pattern furnished.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
1.	Cutting. (cont'd) h. Cut the cotton buckram for interlining the collar on the straight in accordance with pattern furnished. i. Cut the piping material (see 3.3.10) for piping the front and bottom edges of coat, edges of shoulder straps, collar, and sleeve cuffs on the straight. The piping shall be cut 5/8 to 3/4 inch wide for shoulder straps, collar and cuffs and 1 inch wide for fronts and bottom edges of coat.					
2.	Replacement of damaged parts. a. Replace at time of cutting all parts of coat containing holes or seriously weakening defects, such as smashes, multiple floats loose or weakening slubs, etc., expected to develop into holes, shade bars and dye streaks or unsightly slubs etc., affecting appearance. b. Replace any part damaged during the manufacturing process by needle chews which may develop into holes, scissor or knife cut, tears, holes, mends or burns in the material affecting appearance.					
3.	Shade marking. a. Mark or ticket (see 3.6.1.3) all component parts cut from one piece of basic and lining materials, and pairs of sleeve linings when cut from ends, to insure uniform shade and size throughout the coat.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
3.	Shade markings. (cont'd)					
	b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					
4.	Make coat hanger and lining securing straps.					
	Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8-inch-wide straps of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	12-16	A	A
	b. Cut the coat hanger 3-3/4 ±1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ±1/4 inches long.					
5.	Make underarm shields.					
	Finished appearance. The shields shall finish smooth and flat without puckers, pleats, gathers or other distortions.					
	a. Position the two plies of material for the underarm shields with edges even. Seam the two plies together along the curved side and bottom edges 3/8 inch from the edges.	301	SSa-1	12-16	A	A
	b. Turn the shield right side out, working out the seamed edges completely.					
	c. Press the shields smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
6.	Make shoulder straps. Finished appearance. The shoulder straps shall be uniform in appearance and shall finish smooth and flat, without twists, gathers, puckers, pleats, or other distortions. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the shoulder strap. a. The shoulder straps shall be made of one ply of the material specified in 3.3.2, piped with a 5/8-to 3/4-inch-wide strip of the piping material specified in 3.3.10. b. Position the strip of piping material on the outside of the shoulder strap with edges even and stitch together 1/8 to 3/16 inch on both sides and collar end of shoulder strap.	301	BSm-1 (a)		A (silk)	A
	c. Turn back the piping, working the folded edge of piping 1/8 inch beyond edge of shoulder strap. Topstitch the shoulder strap to the piping 3/16 inch from folded edge of piping. d. Press the shoulder straps smooth and flat with a heated pressing iron or pressing machine.	301	BSm-1 (b)	10-14	A (silk)	A
7.	Make cuffs. Finished appearance. The cuffs shall be uniform in appearance, shall finish smooth and flat without twists, gathers, pleats, puckers, or other distortions. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the sleeve cuff.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
7.	Make cuffs. (cont'd)					
	a. The cuffs shall be made of one ply of the material specified in 3.3.9, piped with a 5/8-to 3/4-inch-wide strip of the piping material specified in 3.3.10.					
	b. Position the strip of piping material on the outside sleeve cuff with edges even and stitch together 1/8 to 3/16 inch from the upper curved and pointed edge of cuff.	301	BSm-1 (a)	10-14	A (silk)	A
	c. Turn back the cuff and piping, working the folded edge of the piping 1/8 inch beyond edge of cuff. Topstitch the cuff to the piping 3/16 inch from folded edge of piping.	301	BSm-1 (b)	10-14	A (silk)	A
	d. Press the cuffs smooth and flat with a heated pressing iron or pressing machine.					
8.	Stitch and press dart in under-sleeves.					
	a. Fold the under sleeve, matching the cut edges of the sleeve dart. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole and taper the line of stitching to zero at the lower folded edges.	301	SSa-1 (cut edges) OSf-1 (folded edge)	12-16	A	A
	b. Spread open the cut edges of the dart, turn the folded edge flat against the body of the sleeve and press the entire dart smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
9.	Seam sleeves at forearm. Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly. a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of under sleeve and with the notches in the lower forearm edge of top and under sleeves matching. Seam top and under sleeves together 3/8 inch from forearm edge of top sleeve, forming a tapered outlet on the under sleeve. b. Spread open the seam and press flat with a heated pressing iron.	301	SSbd-1 to SSa-1	12-16	A	A
10.	Join cuff to sleeves. Finished appearance. The cuff shall be uniformly stitched to the sleeve without twists, gathers, puckers, pleats or raw edges. On the finished coat, the length of the cuff, including the piping, shall measure 3-1/4 ±1/8 inches at the front and back creased edges, and 6 ±1/4 inches at the point. In the finished coat (after pressing) the point of the cuff shall be centered between the lower forearm creased edge and the creased backarm seam of sleeve. a. Mark the sleeves in accordance with the sleeve cuff marker for positioning of the cuffs, with notch on the cuff marker matching the forearm seam line and bottom edge of marker in line with the bottom raw edge of sleeve.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
10.	Join cuff to sleeves. (cont'd)					
	b. Position the piped edge of cuff at the mark and stitch cuff to sleeve along the piped edge. The line of stitching shall be adjacent to the stitching of the cuff piped edge.	301	LSa-1	10-14	A (silk)	A
11.	Seam sleeves at backarm.					
	Finished appearance. The backarm seams shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Join the top and under sleeves at the backarm with a 3/8-inch seam, catching the ends of the cuff in the stitching.	301	SSa-1	12-16	A	A
	b. Spread open the sleeve and cuff seams and press smooth and flat with a heated pressing iron.					
12.	Insert insignia buttons.					
	a. Mark each cuff for location of three insignia buttons in accordance with button marker.					
	b. Punch a hole through cuff and sleeve at each mark for attaching of insignia buttons.					
	c. Insert the shanks of the 27-line insignia buttons through the punched holes and attach ring toggles on each button shank.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
13.	Baste and tack cuff to sleeve.					
	a. Turn the bottom of the cuff to the inside against the bottom edge of sleeve in accordance with notches, and baste along the turned edge of the cuff.	301 or Hand				
	b. Tack the raw edge of cuffs to the body of sleeves with blindstitching. The blindstitching shall not be exposed on, or caught to, the outside of the cuff.	301	EFc-1 (b)	4-6	A	A
14.	Stitch and press dart in under sleeve linings.					
	a. Fold the under sleeve lining, matching the cut edges of the under sleeve dart. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole and taper the line of stitching to zero at the lower folded edge.	301	SSa-1 (cut edges) OSf-1 (folded edge)	12-16	A	A
	b. Turn the cut edges of the dart toward the forearm edge and press the entire dart smooth and flat with a heated pressing iron.					
15.	Seam sleeve lining at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the lining at lower forearm edge of top and under sleeve linings even. Seam the top and under sleeve lining together 3/8 inch from the forearm edge of topsleeve lining, forming a tapered outlet on the under sleeve lining.	301	SSbd-1 to SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
16.	Seam sleeve lining at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Join the top and under-sleeve linings at the backarm with a 3/8-inch seam.	301	SSa-1	12-16	A	A
17.	Assemble sleeve and sleeve lining.					
	Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers, or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of the lining extending approximately 1 inch beyond the armhole edge of the sleeve.					
	b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the sleeve, commencing at the top edge of the cuff and extending to approximately 6 inches from armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand		4-6 1-2	A	A
	c. Pull sleeve through sleeve lining.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
18.	Fell sleeve lining turnup.					
	Finished appearance. The sleeve lining shall not be short, tight or twisted at bottom of sleeves.					
	a. Turn under the bottom edge of the sleeve lining to finish 1 to 1-1/4 inches above the finished end of sleeve, and baste to turnup of sleeve. (This basting operation is optional. Operation 18.b may be performed without the prior basting of sleeve lining to turnup of sleeve.)	Hand or Machine		4-6		
	b. Fell the folded edge of sleeve lining to the turnup of cuff with blindstitching.	Hand or 301	EFc-1 (b)	8-10 6-8	C (silk) O (silk)	O
19.	Press sleeve.					
	a. Turn the sleeve right side out and assemble in pairs. Press the lower half of sleeves smooth and flat, creasing at the forearm and backarm. The backarm crease shall be on the backarm seam. Remove basting at lower end of cuffs.					
20.	Assemble collar interlining .					
	a. The collar interlining assembly shall consist of one ply of cotton buckram and one ply of cotton silesia or polyester and cotton.					
	b. Position the silesia or polyester and cotton and cotton buckram interlining for collar with all edges even and seam together 1/8 to 3/16 inch from edges.	301	SSa-1 (each edge)	12-16		

Source: https://assist.dla.mil -- Downloaded: 20260-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
21.	Pipe outer ply of collar.					
	Finished appearance. The piping shall extend at upper, lower and side edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers or pleats.					
	a. The outer ply of the collar shall consist of one piece of the material specified in 3.3.2, piped with a 5/8-to 3/4-inch-wide strip of the piping material specified in 3.3.10.					
	b. Seam a 5/8-to 3/4-inch-wide strip of piping to outer ply 1/8 inch from all edges, leaving a 3/4-to 1-inch extension on each end of piping at lower edge of collar. The extension ends of piping shall be approximately 3 inches from the pointed end of collar.	301		12-16	A (silk)	A
	c. Join extensions together as close as possible to outer ply.	301	SSa-1	12-16	A (silk)	A
	d. Trim the excess extension piping to 1/4 inch from the seamed edge. Spread open joining of extension and stitch to collar along seam joining piping to outer ply.	301		12-16	A (silk)	A
	e. Turn back the piping and outer ply, uniformly working the folded edge of the piping 1/8 inch beyond the edge of collar. Topsitch the outer ply uniformly 3/16 inch from the folded edge of piping.	301		12-16	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
22.	Assemble collar. Finished appearance. The collar shall be assembled without twists, gathers,puckers or pleats.					
	a. Position the interlining assembly on the inside of the outer ply under the unattached edge of piping. Tack all the raw edges of piping to the silesia or polyester and cotton interlining, making the outer ply form a smooth and snug fit.	Hand		2-3	C (silk)	
	b. Press the collar smooth and flat with a heated pressing iron or pressing machine.					
	c. Lap the upper piped edge of collar over the top raw edge of collar lining approximately 1/2 inch, with lining face up. Stitch collar to the lining from end to end along the piped edge adjacent to the stitching line of the collar piped edge. The lining shall extend not less than 1/2 inch from each end of collar.	301	LSa-1	12-16	A (silk)	A
	d. Turn collar lining at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine.					
23.	Fold and stitch dart in front lining. Finished appearance. The darts shall finish without gathers, puckers, or pleats. The stitching shall be 3/8 inch from the folded edge at the center.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE L MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
23.	Fold and stitch dart in front lining. (cont'd)					
	a. Fold the front lining and stitch waist darts in accordance with marks as indicated on the pattern, tapering the upper and lower ends to a flat point, and securely tacking the points.	301	OSf-1	12-16	A	A
24.	Sew on identification label.					
	Finished appearance. The identification label shall be positioned so that in the finished coat, the label shall be midway between front and back edge of the right facing and with the bottom edge of the label approximately 4 inches from the bottom finished edge of coat.					
	a. Sew the identification label to the outside of the right facing with a single row of stitches 1/16 to 1/8 inch from each edge.	301	SSa-1 (each edge)	12-16	A	A
25.	Join front lining to wool facing.					
	Finished appearance. The lining shall be carefully joined to the facing so that in the finished coat the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material or other distortions.					
	a. Position the lining on the wool facing and join the front edge of the lining to the back edge of the facing with a 3/8-inch seam from top edge of facing to approximately 1-1/4 inches from bottom edge.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
26.	Assemble side back lining. Finished appearance. The side back lining shall be carefully joined without gathers, puckers, or pleats. The seams shall start and finish evenly.					
	a. Position and join the left and right side back linings to the respective center back lining with a 3/8-inch seam.	301	SSa-1	12-16	A	A
27.	Join side backs and front linings. Finished appearance. The side back and front lining shall be carefully joined without gathers, puckers, or pleats. The seams shall start and finish evenly.					
	a. Position and join the front and side back linings at the sides with a 3/4-inch seam.	301	SSa-1	12-16	A	A
28.	Overedge stitch the lining and facing seams.					
	a. Overedge stitch together the raw edges of the facing-lining seam, side seams and the side backs' seam allowance.	503 or 504		6-8 6-8	70/2 70/2	70/2 70/2
29.	Press lining seams and waist darts with a heated pressing iron or pressing machine. a. Turn the edge of facing-lining seam, the side seams and side back seams toward the back and press smooth and flat. b. Turn the waist darts toward the side seam and press smooth and flat.					

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
30.	Assemble fronts. Finished appearance. The chest and waist darts shall finish without gathers, puckers, or pleats. The stitching for the waist darts shall be 3/8 inch from the folded edge at the center.					
	a. Fold the fronts, matching the notches of the chest darts. Stitch the entire length of the darts from the notches at the upper end and taper the line of stitching to zero at the lower end.	301	SSa-1 (cut edges) OSf-1 (folded edge)	12-16	A	A
	b. Fold fronts and stitch waist dart in accordance with marks as indicated on the pattern, tapering the upper and lower ends to a flat point and securely tacking the points.	301	OSf-1	12-16	A	A
31.	Press darts on fronts with a heated pressing iron. a. Turn the folded edge of the chest dart toward the armhole and press smooth and flat. b. Turn the folded edge of the waist dart towards side seam and press smooth and flat.					
32.	Join side backs and center back. Finished appearance. The sides and center back shall be joined without gathers, puckers, or pleats. The seams shall start and finish evenly.					
	a. Position and join the left and right side backs with notches matching to the respective center back with a 3/8-inch seam.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
33.	Join fronts and back.					
	Finished appearance. The fronts and back shall be joined without gathers, puckers, or pleats. The seams shall start and finish evenly.					
	a. Position and join fronts to the back at the sides with a 3/4-inch seam.	301	SSa-1	12-16	A	A
34.	Press side and back seams.					
	a. Spread open side and back seams and press smooth and flat with a heated pressing iron.					
35.	Overedge stitch fronts and back.					
	a. Overedge stitch all raw edges of the joining seams for fronts and back.	503	EFd-1	6-8	70/2	70/2
		or 504	EFd-1	6-8	70/2	70/2
36.	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The reinforcement stays shall be sewn to the armhole and shoulder edges of the front without gathers, puckers, or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide stays to the underside of the front at the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from the neck and armholes respectively. The strip for the upper front edge of armholes shall be positioned approximately 1/2 inch from the shoulder.	301	SSaa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
37.	Tape armholes. a. Sew the cotton tape to the armholes starting with one end approximately 1 inch above the notch in the fronts and continuing along the lower and back edge of the armhole to approximately 1/2 inch from shoulder edge. b. The tape shall be stitched with slight tension along the lower front edge of the armhole and shall be held taut while stitching along the back edge.	301	SSaa-1	12-16	A	A
38.	Press shoulder blades and armhole tapes. a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or a suitable type pressing machine.					
39.	Mark and dress left front. a. Mark and shape the left front edge from the top notch to the bottom edge of front. b. The mark line shall be 1 inch from the upper front edge to 1-1/8 inches at the waistline. Continue on the straight line from waistline to the notch at the bottom edge. NOTE: The dressing and shaping shall be performed in the sewing room. c. Where necessary, trim any frayed edges along the right front and bottom.					
40.	Stitch piping to coat. Finished appearance. The piping shall be uniformly stitched to					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
40.	Stitch piping to coat. (cont'd)					
	the coat without twists, gathers, puckers, or pleats. The piping shall extend from the collar notch at top edge of the right front along the bottom and up to the collar notch at top edge of the left front.					
	a. Position the 1-inch-wide piping of the material specified in 3.3.10 to the outside of the left and right front, with edge even with top front and bottom edges of coat. Stitch piping to coat 1/8 inch from edges.	301		12-16	A	A (silk)
	b. Turn the piping to the inside, working out the folded edge of piping uniformly, 1/8 inch beyond the edges of the coat.					
	c. Topstitch the coat to the piped edges of the coat uniformly 3/16 inch from the folded edge of the piping.	301		12-16	A	A (silk)
	d. Notch out the excess piping material at the top and bottom front corners to eliminate bulkiness. Trim the inner edge of piping on the left front only from the upper front down to approximately 1 to 1-1/2 inches below waistline so that the piping will not interfere with front buttonholes.					
	e. Serge stitch the raw edge of the piping at the bottom edge of the coat only.	503	EFd-1	6-8	70/2	70/2
		or 504	EFd-1	6-8	70/2	70/2
	f. Press the piped edges of coat smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
41.	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste the interlining and fronts together from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom edge of the front.	Hand or 301	Hopper			
	b. Baste along the shoulder, allowing room for setting the shoulder pad, working the fullness towards the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulder to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of fronts.	Hand or 301	Hopper			
42.	Trim coat front interlining.					
	a. Trim the top edge of coat interlining even with the top edge of fronts from the point of shoulder to the collar notch.					
	b. Notch the top edge of the interlining in line with the collar notch.					
	c. Remove stitches joining the front edge of silesia or polyester and cotton to coat front interlining approximately 1/2 inch back from front and top edge of fronts.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
42.	Trim coat front interlining (cont'd).					
	d. Turn the fronts inside out and trim the interlining only, approximately 1/4 inch back from the front and top edge of fronts.					
	e. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					
43.	Bind front edge and gorge of interlining.					
	a. Fold silesia or polyester and cotton back and over the top and front raw edge of the interlining. Stitch along the top and front edge with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the upper turned under portion in the stitching.	301	EFa-3	8-12	A	A
44.	Bind top neck edge of interlining.					
	Finished appearance. The silesia or polyester and cotton binding shall be uniformly stitched along the gorge edge of the coat front interlining from the collar notch to the shoulder point.					
	a. Lap the 3/4-inch-wide binding on the outside of the coat front interlining from the collar notch to the shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	8-12	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
44.	Bind top neck edge of interlining. (cont'd)					
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301			A	A
45.	Fell piping to coat front interlining.					
	a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	101				
	b. Fell the upper front and lower inner edge of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A C (silk)	A
	c. Pull and remove basting stitches from piping.					
	d. Press the left and right fronts on a suitable type heated pressing machine, with the chest to conform to the shape of the body.					
46.	Join facing to fronts.					
	a. Position the left and right fronts to the respective front facing (face to face), with the waistline notch of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark the facing along the top front edges of coat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
46.	Join facing to fronts. (cont'd)					
	b. Lap the front edge of the right and left fronts respectively on the outside of the facing at the marks and join the front and facing together as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to bottom edge of coat front edge only.	301	LSa-1	12-16	A (silk)	A
	c. Trim excess facing material where necessary.					
47.	Baste front edges.					
	a. Turn the facing-lining assemblies to the inside of fronts, completely working out the corners.					
	b. Baste along the front edge of the left and right fronts, working the facing back from the folded edge of piping.	101				
48.	Baste facing (second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 301	Hopper			
	b. Turn under and baste the top edge of the facing to the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
48.	Baste facing (second time). (cont'd)					
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of facings approximately 1-1/4 inches from the lower edge of facing.	Hand or 301	Hopper			
	d. Turn under the bottom edge of the facing at the mark and baste along the folded edge.	Hand or 301	Hopper			
49.	Tack facing interlining.					
	a. Tack the right and left facing-lining seam allowance to the respective coat front interlining from approximately 2-1/2 inches from bottom edge of coat to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6		
50.	Baste front linings to coat.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat, and baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
	b. Baste the front lining to the coat, starting at the lower end of the chest pleat, continuing along lower edge of armhole approximately 2 inches from the edge, and ending at the side seam. Match side seams of coat and lining and	Hand or 301	Hopper			

05753

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
50.	Baste front linings to coat. (cont'd)					
	continue basting as close as possible to the side seam and then across the bottom towards the front approximately 4 inches from piped bottom edge of coat.					
51.	Join lining at center-back.					
	Finished appearance. The lining shall be carefully joined at center back without gathers, puckers, or pleats. The seam shall start and finish evenly. The folded edge of the center pleat, on the outside of the lining, shall be towards the left side. The center back seam of the lining shall be between the fold.					
	a. Position the back parts of lining and join together at the center with 3/8-inch seam.	301	SSa-1	12-16	A	A
52.	Baste back lining to coat.					
	a. Fold the back lining, forming approximately a 1-inch-wide pleat at the center back. Baste the back lining to the coat along the center pleat from the top end to approximately 4 inches from bottom finished edge of coat.	Hand or 301	Hopper			
	b. Baste back lining to coat starting at side seam and continuing approximately 3 inches from the armhole and shoulder edges.	Hand or 301	Hopper			
53.	Hem bottom edge of lining.					
	Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
53.	Hem bottom edge of lining. (cont'd)					
	or pleats. The hem shall be 3/4 ±1/8 inch wide. The lining securing straps shall be positioned on the side seam allowance of the lining with one edge even with the serged edge.					
	a. Hem the bottom edge of body lining with the raw edge turned under and with one end of the securing straps positioned and caught in the stitching 1/16 inch from the upper folded edge of hem.	301	EFb-1	12-16	A	A
54.	Tack the lining securing straps to bottom of coat.					
	Finished appearance. The lining securing straps when tacked to the bottom edge of coat shall not cause twists or other distortions to either the coat or the lining. The end of the securing straps shall finish between the piping at bottom edge of coat and the side seam allowance. In the finished coat, the lining shall not be visible below the bottom edge of coat.					
	a. Position and securely tack the free end of the securing straps to the piping at the bottom edge of coat through the side seam allowance.	301			A	A
	b. Position the bottom edge of the lining so that in the finished coat, the lining shall not be visible below the bottom edge of coat. Fold the lining securing straps across the width and stitch approximately 1/4 inch from the folded end in order to hold the lining in position.	301	OSf-1		A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
55.	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of coat, starting at the bottom edge of the lining and continuing along the back and bottom edges of facing to the front edge of coat.	Hand		8-10	C (silk)	
	b. Fell the folded edge of the facings to the piping along the top edge from collar notch to front edge of coat.	Hand		8-10	C (silk)	
56.	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim back lining even at the neck.					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck.					
57.	Baste shoulder pad to coat.					
	a. Insert shoulder pads between interlining and chest padding of coat fronts. Securely tack the pad to the interlining and chest padding only.	Hand or 301	Hopper			
58.	Seam shoulders.					
	Finished appearance. The shoulder seam shall finish without a distorted appearance.					
	a. Join the back to the fronts at the shoulder with a 3/8-inch seam, working in the fullness on the backs in accordance with good manufacturing practice.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
58.	Seam shoulders. (cont'd) b. Spread open the shoulder seam and press flat, holding the shoulder short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
59.	Set shoulder straps. Finished appearance. The shoulder straps shall be uniformly stitched to the coat without twists, puckers, pleats or other distortion. On the finished coat, the straps, including the piping, shall be 2-1/2 ±1/8 inches wide at the armhole seam and shall taper to 1-3/4 ±1/8 inches at the center of the insignia button. a. Position the shoulder straps with the back edge 3/8 to 1/2 inch to the back of the shoulder seam at the armhole and with the rounded end of the straps, on the finished coat, to be 1/4 to 3/8 inch from lower edge of collar.					
	b. Seam shoulder strap to the coat at the front and back edges and around the collar end as close as possible to, but not on top of, the stitching for the piping. Trim the shoulder strap even with the armhole, where necessary.	301	SSa-1	12-16	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
60.	Attach shoulder strap buttons. a. Mark location for attaching a 27-line insignia button, with ring toggle, to each shoulder strap. b. Punch a hole at mark through shoulder strap and fronts only, insert shank of insignia button through hole and attach ring toggle. In the finished coat, the center of the insignia button shall be 3/4 to 7/8 inch from rounded end of shoulder strap.					
61.	Baste shoulder. a. Position the front lining and coat front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn coat on the inside.	Hand or 301	Hopper			
62.	Baste back lining and facing-lining assembly at shoulders. a. Turn under and lap the shoulder edge of back lining on the facing-lining assembly. Baste lining to coat along the folded edge of the back lining with the top end of the chest pleat caught in the basting.	Hand				
63.	Seam neckline with size label and coat hanger. Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label shall be positioned between the ends of the coat hanger and the ends					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
63.	Seam neckline with size label and coat hanger. (cont'd)					
	of the coat hanger shall be positioned so that in the finished coat, the hanger opening shall be 2 to 2-1/2 inches long when measured on the outer edge and along the lower edge of collar lining.					
	a. Join facings and back lining to coat at the neckline, from collar notch to collar notch, with a 1/4-inch seam and with the upper edge of the size label and the ends of the hanger positioned and caught in the stitching at the inside center back.	301	SSa-1	12-16	A	A
64.	Make buttonholes.					
	Finished appearance. The buttonholes shall be cut-first type, well made and well worked over gimp to fit 40-line insignia buttons. The stitching of the buttonhole shall be securely caught in the basic material. The gimp and thread shall be pulled through to the underside of the coat. The purling of the buttonhole shall be on the outside of the fronts. The inside edge of the eyelet end of the buttonholes shall be 5/8 inch from the front piped edge of coat.					
	a. Mark the left front for the location of seven buttonholes. The marks for the top and bottom buttonholes shall be in accordance with the patterns. The marks for the remaining five buttonholes shall be evenly spaced.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
64.	Make buttonholes. (cont'd)					
	b. Make one horizontal eyelet-end square-bar type buttonhole, cut 1-1/8 inches long, at each of the marks.	Button-hole		60 per button-hole (not including bartack)	B (silk)	F
	c. Securely bartack the end of each buttonhole, catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bartack		21 per bartack	A (silk)	A
65.	Set collar with lining.					
	Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar.					
	a. Mark the neckline on the outside 1/2 inch from collar notch up to the shoulder seam and gradually to within 1-1/4 to 1-3/8 inches at the center back for proper position of collar.					
	b. Position the collar with the lower edge lapped on the outside top edge of the coat at the mark.					
	c. Seam the collar from end to end, to the coat, as close as possible to,but not on top of, the stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining.	301	LSa-1	12-16	A (silk)	A
66.	Set sleeves.					
	Finished appearance. The arm-hole sleeve seam shall finish without twists, gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
66.	Set sleeves. (cont'd) a. Position sleeve on outside of coat at the armholes, with backarm seam of sleeve matching the side back seam and with notch in top sleeve and front matching. b. Join the sleeve to the coat with a 3/8-inch seam, distributing the fullness in accordance with good manufacturing practice and catching the end of the shoulder strap in the stitching. c. Notch armhole seam allowance on back and front adjacent to each side of shoulder strap. d. Press the entire armhole smooth and flat with a heated pressing iron to remove fullness, exercising care not to stretch the armhole. Spread open upper part of the armhole-sleeve seam (except at the shoulder strap area) from backarm seam of sleeve to approximately midway between shoulder seam and notch at front edge of armhole and press smooth and flat with a heated pressing iron. e. Fold the excess material at armhole pit up to the line of stitching of the armhole sleeve seam, forming a hinge effect. The fold shall extend from the armhole notch to approximately 4 inches from the backarm seam. f. Press the fold smooth and flat with a heated pressing iron.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
67.	Baste linings at armhole and shoulder.					
	a. Baste back and front linings to the coat around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing the fullness evenly. Turn the coat on the outside.	Hand or 301	Hopper			
68.	Baste armhole.					
	a. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of the sleeve to the notch in the fronts.	Hand or 301	Hopper			
69.	Set underarm shields.					
	a. Baste or tack underarm shields at the base of armhole.	301 or Hand				
70.	Stitch sleeve head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					
	a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam and with the one end of the pad matching the notch in the fronts.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
70.	Stitch sleeve head pads and linings at armhole. (cont'd)					
	b. Stitch the sleeve head pad to the sleeve from end to end, throught the armhole-sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.	301	SSa-1	4-6	24/4	24/4
71.	Tack underarm shields to lining.					
	Finished appearance. The tacking for the underarm shields shall finish approximately 1/2 inch from the seamed edges.					
	a. Tack the underside of the underarm shields to body lining along the side and bottom edges.	Hand		4-6	C (silk)	
72.	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (silk)	
7.	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve lining matching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
73.	Fell sleeve lining at armhole. (cont'd)					
	b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge approximately 1-1/2 inches in front of the forearm seam to the side seam line.					
	OR					
	c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operation 73.b above.	301	SSa-1	12-16	A	A
	OR					
	d. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling.	Machine simulated		8-10	C (silk)	
	NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
74.	Sew hooks and eyes to collar.					
	Finished appearance. The hooks shall be positioned on the collar so that in the finished coat the top and bottom hooks shall be approximately 1/4 inch from top and bottom edges respectively of collar and the remaining hook shall be midway between top and bottom hooks. The eyes shall be positioned to engage the hooks, effecting a flat smooth closure at front of collar without misalignment or gapping.					
	a. Position and securely sew three hooks to the right end and three eyes to the left end of the collar.	Hand		16 per hook & eye	C (silk double thread)	
75.	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (silk)	
	b. Turn under and fell the lower edge of the collar lining to the coat from end to end, catching the turned under portion in the felling.	Hand		8-10	C (silk)	
	c. Turn under and position the folded edge of the lining under the hook and over the eye. Fell the folded edge of lining to ends of collar up to the stitching joining lining to the collar.	Hand		8-10	C (silk)	
	d. Position the collar tab on the inside of collar at the left end with the rounded end of tab extending approximately 3/4 inch beyond the front end of collar. Fell top, back and bottom raw edges of tab to collar lining. Stitch and backstitch the front end of tab approximately 1/4 to 3/8 inches from the eye.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
76.	Clean coat. a. Pull any basting thread, trim and remove any loose ends of thread. Remove any spots, stains and tickets without injury to the material. b. Buttonholes at front closure shall be examined for exposure of coat front interlining cloth. The exposed interlining shall be colored with a reddish indelible ink.					
77.	Press coat. a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. c. Press the entire collar smooth and flat. d. Press the fronts on a body machine, shrinking and properly shaping the chest. e. Press the sides, working the fullness towards the back. f. Press the back smooth and flat, removing all fullness. g. Press the sleeves smooth and flat, without injury to the buttons on the ornamental					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
77.	Press coat. (cont'd) sleeve cuffs, creasing at the backarm and forearm seam. The backarm crease shall be on the backarm seam. The forearm and backarm crease shall extend uniformly from the bottom end of sleeve to a point approximately 4 inches below the base of armhole. h. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine and press the shoulder strap flat. i. Press the armholes solid from the inside, creasing the armholes at the front and creasing the excess material at the armpit. The armpit and back of the armhole shall be held short while pressing. j. Block the armholes on a pressing buck, shrinking the top sleeves. k. Press lower edge of coat smooth, flat and even. l. Press body lining throughout, removing all wrinkles and creases. Press the lining pleats smooth and flat. m. Remove all gloss marks. n. Remove any wrinkles and creases missed by previous press operations.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
78.	Mark for buttons on right front. a. Mark the location for sewing seven 40-line insignia buttons to the right front of the coat to properly engage with the buttonhole of the left front. The mark for top button shall be in line with right front end of collar and remaining buttons shall be in vertical alignment with top mark.					
79.	Sew on buttons. a. Sew one 40-line insignia button at each of the marks on the right front through all plies. b. The insignia buttons on the front shall be sewn with the head of the eagle upright.	Hand		8 per button, double thread	24/4	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II - Finished measurements 1/

Size	Breast 2/	Back Length 3/	Sleeve Length 4/
		Short	
	inches	inches	inches
34	35	28-3/4	18-1/2
35	36	28-7/8	18-1/2
36	37	29	18-1/2
37	38	29-1/8	18-1/2
38	39	29-1/4	18-1/2
39	40	29-3/8	18-1/2
40	41	29-1/2	18-1/2
41	42	29-5/8	18-1/2
42	43	29-3/4	18-1/2
44	45	30	18-1/2
46	47	30-1/4	18-1/2
		Regular	
	inches	inches	inches
34	35	29-3/4	19-1/2
35	36	29-7/8	19-1/2
36	37	30	19-1/2
37	38	30-1/8	19-1/2
38	39	30-1/4	19-1/2
39	40	30-3/8	19-1/2
40	41	30-1/2	19-1/2
41	42	30-5/8	19-1/2
42	43	30-3/4	19-1/2
44	45	31	19-1/2
46	47	31-1/4	19-1/2
		Long	
	inches	inches	inches
34	35	30-3/4	20-1/2
35	36	30-7/8	20-1/2
36	37	31	20-1/2
37	38	31-1/8	20-1/2
38	39	31-1/4	20-1/2
39	40	31-3/8	20-1/2
40	41	31-1/2	20-1/2
41	42	31-5/8	20-1/2
42	43	31-3/4	20-1/2
44	45	32	20-1/2
46	47	32-1/4	20-1/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table II - Finished measurements 1/

Size	Breast 2/	Back Length 3/	Sleeve Length 4/
		Extra Short	
	inches	inches	inches
34	35	32-1/4	21-1/2
35	36	32-3/8	21-1/2
36	37	32-1/2	21-1/2
37	38	32-5/8	21-1/2
38	39	32-3/4	21-1/2
39	40	32-7/8	21-1/2
40	41	33	21-1/2
41	42	33-1/8	21-1/2
42	43	33-1/4	21-1/2
44	45	33-1/2	21-1/2
46	47	33-3/4	21-1/2

1/ Tolerance on all measurements: ±3/8 inch.
2/ Breast measurement taken with coat buttoned, from folded edge to folded edge in line with pit of armhole; multiply by 2.
3/ Back length measurement taken along center back from 3/4 inches above the lower edge of collar to piped bottom edge of coat.
4/ Sleeve length measurement taken along forearm seam from pit of armhole to bottom edge of sleeve.

*3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the levels set by the applicable acceptable quality levels (AQL's).

4. QUALITY ASSURANCE PROVISIONS

*4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

*4.1.1 Certificate of compliance. Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

*4.2 Inspection. Inspection shall be in accordance with the provisions set forth in MIL-STD-105, except where otherwise indicated herein.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

*4.2.1 First article inspection. When first article is required, inspection shall be performed on a completely fabricated coat for conformance to all provisions of this specification.

*4.2.2 Component and material inspection. In accordance with 4.1 above, components and materials shall be tested in accordance with all the requirements of referenced specifications, figures and standards unless otherwise excluded, amended, modified or qualified in this specification or applicable purchase document. In addition to testing provisions contained in subsidiary specifications, figures and standards, testing shall be performed on components listed in Table III for characteristics noted. Wherever applicable, tests shall be conducted in accordance with FED-STD-191. When the "Results reported as" columns are not indicated, they shall be reported as required by the referenced test method. All test reports shall contain individual values utilized in expressing the final results.

*4.2.2.1 Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following. The lot shall be unacceptable if one or more sample units fail to meet any test requirements specified herein.

Lot Size	Sample Size
800 or less	2
801 to 22,000 inclusive	3
22,000 and over	5

The unit for expressing lot sizes and sample unit for testing each component shall be in accordance with applicable subsidiary specifications and as follows:

Component	Lot sizes expressed as:	Sample unit for testing
Cloth, Cotton Buckram (collar interlining)	yards	2 yards full width
Hook and eye	100 each	2 each, hook and eye

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. Para.	Test method	No. Det. per S/Unit	Results reported as
Cloth, Cotton, Buckram (collar interlining)	Material identification	3.3.5.1	1200 1/	1	Pass or fail
	Weave (single ply)	3.3.5.2	Visual	1	Pass or fail
	Yarn count				
	- warp	3.3.5.3	5050	3	Avg. of the 3 det.
	- filling	3.3.5.3	5050	3	in each direction to the nearest whole no.
	Laminated cloth- Resistance to:				
	- wet-dry cleaning	3.3.5.4	5622 2/	1	no
	- accelerated aging	3.3.5.4	5850 3/	1	evidence of
	- perspiration	3.3.5.4	5680 4/	1	delamination
	Stiffness, inch-lb:				
	- original	3.3.5.4.1	5202 5/	10	nearest 0.01 lb.
	- after wet-dry cleaning	3.3.5.4.1	5622 2/ & 5202 5/	10	
	- after accelerated aging	3.3.5.4.1	5850 3/ & 5202 5/	10	
	- after perspiration	3.3.5.4.1	5680 4/ & 5202 5/	10	
	Weight	3.3.5.4.2	5041		
	Breaking Strength: Original -				
	Warp	3.3.5.4.3	5100		
	filling	3.3.5.4.3	5100		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III- Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. Det. per S/Unit	Results reported as:
	After Accelerated Aging -				
	Warp	3.3.5.4.3	5100 & 5850 3/		
	filling	3.3.5.4.3	5100 & 5850 3/		
Cloth, Cotton, Buckram (collar interlining)	Weight-oz. per sq. yd. (laminated cloth)	3.3.5.4.2	5041	5	Avg. of the 5 det. to nearest 0.1 oz
	Breaking strength (lbs.) (laminated cloth)				
	- warp direction	3.3.4.4.3	5100	5	Avg. of 5. det. in each direction to the nearest 1.0 lb.
	- filling direction	3.3.4.4.3	5100	5	
Hook and Eye	Material identification 1/	3.3.15	Std.	1	Pass or fail
	Finish	3.3.15	FED-STD-151	1	Pass or fail
	Finish	3.3.15	4.3	1	Pass or fail

1/ Certificate of compliance.
2/ Except the material shall be subject to three complete wet cleaning cycles.
3/ Except the aging process shall be limited to 5 hours at a temperature of 100°C.
4/ Except the material shall be immersed in the specified solution for 20 minutes and then air dried.
5/ Except that a moment weight of 1 pound shall be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*4.2.2.2 In-process inspection. Inspection shall be performed during manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

*4.2.3 Examination of end item. The end item shall be examined for defects listed in 4.2.3.2 through 4.2.3.5. The sample unit shall be one coat.

*4.2.3.1 Classification of defects. All defects shall be classified as indicated below, except those with an asterisk (*) in classification column, which shall be classified as follows:

Major defect - When seriously affecting appearance or serviceability.
Minor A defect - When affecting appearance or serviceability but not seriously.

*4.2.3.2 General defects. General defects shall be classified as follows:

Examine	Defect	Classification Major (*)	Minor A	Minor B
Buttonholes	a. One or more omitted, added or wrong type.	X		
	b. Not corresponding to size of button:			
	- too small,not permitting button to enter buttonhole.	X		
	- too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		X	
	c. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	X		
	d. Bartack missing or loose on:			
	- one buttonhole.		X	
	- two or more buttonholes.	X		
	e. Bartack misplaced not serving intended purpose on:			
	- two or more buttonholes		X	
	- one buttonhole.			X

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	f. One or more broken stitches in: - one buttonhole. - two or more buttonholes.	 X	 X	
	g. More than two skipped stitches in: - one buttonhole. - two or more buttonholes.		 X	 X
	h. Ragged edges, affecting appearance or exposed interlining not colored with reddish indelible ink.			X
	i. Any uncut buttonhole.		X	
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		X	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified: - one or two stitches. - three or more stitches.		 X	X
	l. One or more buttonholes finished with purling on the underside.	X		
Buttons or ring toggles	a. One missing, loose, defective or improper size or type.		X	
	b. Two or more missing, loose, defective or improper size or type.	X		
	c. One or more buttons sewn with the head of the eagle in other than upright position.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
NOTE: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; unsound soldering; scratches; dents; blemishes, or imbedded foreign matter; loose shanks, or are poorly plated or badly shaded.				
Cleanness	a. One or more spots or stains of a permanent nature, clearly noticeable:			
	- on the outside.	X		
	- on the inside.		X	
	b. One or more removable spots or stains clearly noticeable.			
	- on the outside.		X	
	- on the inside.			X
	c. Thread ends not trimmed throughout garment, or one or more bastings not removed, or two or more shade tickets not removed.			X
Components and assembly	Any component part or required operation omitted (unless otherwise classified herein).	*		
Cutting	a. Any component part of basic wool material not cut in accordance with directional lines on patterns, in accordance with specification requirements.	X		
	b. Piping material cut on the bias.		X	
	c. Any lining part not cut in accordance with directional lines on patterns, or in accordance with specification requirements.		X	
Hook and eyes	a. One hook or eye omitted.		X	

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	(*) Minor A	Minor B
	b. Two or more hooks and eyes omitted.	X		
	c. Not specified type or size.		X	
	d. Hook or eye not securely tacked to ends of collar.		X	
	e. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hooks and eyes are fastened.		X	
Material defects and damages	a. Any weakening defect, such as smash, multiple float, and loose slub.		*	
	b. Any hole.		*	
	c. Shade bar, unsightly slub, etc., affecting appearance.			
	- on outside.		*	
	- on inside.			X
	d. Scissors or knife cut, tear, mend, or burn.		*	
	e. Needle chews that may develop into a hole.		*	

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows:

Material defect	- no defect
Workmanship damages	- Minor B defect

Pressing	a. Burned or scorched.		*	
	b. Pressing omitted entire garment.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	c. Armhole stretched.	*		
	d. Poorly pressed (unless otherwise indicated.			X
	e. Basting or pressing impressions not removed on major portion of coat.		X	
	f. Gloss not removed on major portion of coat.			X
	g. Armholes not blocked or poorly blocked, affecting appearance.		X	
	h. Edges bukly, i.e., not pressed solid, affecting appearance.		X	
	i. Inside of armhole not creased as required.		X	
	j. Sleeve not creased at front or backarm seam.		X	
	k. Linings not pressed smooth.		X	
	l. Armhole seam not pressed open across top as required.		X	
Seams and stitching	a. Accuracy of seaming: 1. Any seam twisted, puckered, or pleated, affecting appearance.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	2. Part of garment caught in any unrelated operation or stitching.	*		
	3. Unsightly hand felling or blindstitching exposed on outside of coat, affecting appearance.		X	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required			X
	5. Wrong color of thread or two shades of thread used on outside of coat, affecting appearance.	*		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular, i.e., unevenly gaged, or various stitchings not uniform, affecting appearance.		X	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			X
	c. Open seams:			
	1. On outside:			
	- up to 1/4 inch inclusive.			X
	- more than 1/4 inch but not more than 1/2 inch.		X	
	- more than 1/2 inch.	X		
	2. On inside.			
	- more than 1/2 inch (except felling).		X	
	- up to 1/2 inch inclusive (except machine felling).			X
	- up to 1 inch inclusive (machine felling).			X
	- more than 1 inch (machine felling).		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Major (*)	Minor A	Minor B
NOTE: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.				
	d. Raw edges:			
	1. On outside:			
	- up to 1/8 inch inclusive.			X
	- more than 1/8 inch but not more than 1/4 inch.		X	
	- more than 1/4 inch.	X		
	2. On inside:			
	- more than 1/8 inch but not more than 1/4 inch.			X
	- more than 1/4 inch.		X	
NOTE: Raw edges shall be classified as such when they occur at places where an edge is required, to be turned under. Raw edges not caught in stitching shall be classified as an open seam.				
	e. Run-offs (see classification of open seams).			
	f. Stitch tension:			
	1. Loose tension resulting in loose seam.	X		
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		X	
	3. Tight tension (stitches break when normal strain is applied).	X		
NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting pull in lengthwise direction of seam.				
	g. Stitches per inch (excluding labels).			
	Less than minimum specified:			
	- one or two stitches			X
	- three stitches.		X	
	- four or more stitches.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
NOTE: To be scored only if condition exists on major portion of seam.				
	h. Stitch and seam type: Wrong stitch or seam type.		X	
	i. Stitching skipped or broken (on edge or raised stitching when seam is seamed, turned and stitched).			
	- 1/4 inch or more but not more than 1/2 inch.			X
	- more than 1/2 inch.		X	
Shaded parts	a. Any outside part shaded.	*		
	b. Any lining part badly shaded except sleeve lining.		X	
	c. Sleeve lining parts badly shaded, or parts not matching each other.			X

*4.2.3.3 Detailed defects (outside of coat.) Detailed defects on outside of coat with coat buttoned on form shall be classified as follows:

Examine	Defect	Classification Major (*)	Minor A	Minor B
Collar (construction and setting)	a. Interlining omitted.	X		
	b. Interlining tight or twisted, causing puckers on collar, affecting appearance.		X	
	c. Tight at joining to front or back, causing puckers or pleats at neck or coat, affecting appearance.	*		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	d. Piping irregular, affecting appearance.		X	
	e. Collar ends overlapping when fastened.		X	
	f. Collar ends spread open more than 3/8 inch when fastened.		X	
	g. Front finished ends of collar uneven in width by 3/16 inch or more.		X	
Alignment of front buttons and buttonholes	Not aligned, causing a noticeable bulge or twist on fronts when buttoned, affecting appearance.		X	
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by:			
	- more than 1/8 inch but not more than 1/4 inch.		X	
	- more than 1/4 inch.	X		
	b. Left front at corner longer than right front by:			
	- more than 1/4 inch but not more than 3/8 inch.			X
	- more than 3/8 inch.		X	
	c. Right front at corner exposed beyond bottom edge of left front by more than 1/8 inch.		X	
Shoulder (construction)	Improperly joined or set, causing shoulders or back to twist.	*		

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Shoulder pads	a. Not completely caught in armhole tacking.		X	
	b. Misplaced,not serving intended purpose, i.e., too far back or too far forward.		X	
	c. One or both pads omitted.		X	
Shoulder straps	a. Misplaced, i.e., one strap further forward or back from position of other loop, affecting appearance.		X	
	b. Strap stitched to coat too full or twisted, affecting appearance.		X	
	c. Poorly shaped.			X
	d. Shoulder seam exposed beyond back edge of shoulder strap (except rounded end).		X	
	e. Width of shoulder strap at armhole seam (including piping):			
	- less than 2-1/4 inches but not less than 2-1/8 inches.			X
	- more than 2-1/2 inches but not more than 2-5/8 inches.			X
	- less than 2-1/8 inches or more than 2-5/8 inches.		X	
	f. Width of shoulder strap across center of insignia button (including piping):			
	- less than 1-5/8 inches but not less than 1-1/2 inches.			X
	- more than 1-7/8 inches but not more than 2 inches.			X
	- less than 1-1/2 inches or more than 2 inches.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	g. Rounded end of shoulder strap positioned less than 1/4 inch or more than 3/8 inch from collar edge.			X
	h. Piping irregular in width, affecting appearance.		X	
	i. Buttons not uniformly set from collar edge by more than 1/4 inch.		X	
	j. Center of buttons less than 3/4 inch or more than 7/8 inch from rounded end of strap (including piping).			X
Armholes (construction)	a. Badly stretched, affecting appearance.	*		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	*		
	c. Crooked seam, affecting appearance.		X	
	d. Tape stitching exposed and visible on outside surface.			X
	e. Sleeve head pads not completely tacked to armholes, or misplaced, not serving intended purpose.		X	
	f. One or both sleeve head pads omitted.		X	
Sleeves	a. Setting and hang: 1. Sleeve fullness misplaced, affecting appearance.		X	
	2. Backarm seam of sleeve not matching side back seam by: - more than 1/4 inch but not more than 1/2 inch		X	
	- more than 1/2 inch.	X		

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	3. Hang of sleeves on the same coat in opposite direction by more than 2 inches.		X	
	4. Sleeve tight in armhole, i.e., roll effect not present.		X	
	b. Sleeve lining:			
	1. Twisted, tight, or short, causing bulge, twist, or puckering on outside of sleeves.	*		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			X
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of sleeves.			X
	c. Construction of sleeves:			
	1. Tacking on bottom turnup to body of sleeve omitted or insecure.		X	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			X
	3. Tacking on one or both sleeve lining seams to sleeve seams omitted, or insecure.			X
	4. Bottom edge of sleeve lining turnup.			
	- less than 1 inch or more than 1-1/4 inches up from bottom edge of sleeve.			X

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	d. Sleeve cuffs:			
	1. Piping irregular, affecting appearance.		X	
	2. Top edge of top sleeve part poorly shaped, affecting appearance.		X	
	3. Height of pointed end on both sleeves varying in length by more than 1/4 inch.		X	
	4. Sleeve puckered at joining of cuff, affecting appearance.		X	
	5. Cuff puckered or twisted at joining to sleeve,affecting appearance.		X	
	6. Ends of cuff staggered at backarm seam by:			
	- 1/8 inch or more but not more than 1/4 inch.			X
	- more than 1/4 inch.		X	
	7. Height of cuff at point on top sleeve including piping:			
	- less than 5-3/4 inches but not less than 5-1/2 inches or more than 6-1/4 inches but not more than 6-1/2 inches.			X
	- less than 5-1/2 inches or more than 6-1/2 inches.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	8. Height of cuff at backarm or front creased edges including piping:			
	- less than 3 inches but not less than 2-3/4 inches or more than 3-1/2 inches but more than 3-3/4 inches.			X
	- less than 2-3/4 inches or more than 3-3/4 inches.		X	
	9. Point of cuff not centered between the lower forearm creased edge and the creased backarm seam of sleeves by more than 1/4 inch.		X	
	10. Position of buttons on sleeve cuffs:			
	- horizontal alignment of buttons on one sleeve cuff not uniform with other sleeve cuff by more than 1/4 inch.			X
	- buttons on one or both sleeve cuffs out of vertical alignment by more than 1/8 inch.			X
Body (outside)	a. Fitting of body linings: Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	*		
	b. Fitting of front interlining:			
	1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	*		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	2. Too full, causing coat front to have a wavy appearance.	*		
	c. Chest and waist darts			
	1. One or more darts not properly tapered causing puckers or pleats at one or more ends, affecting appearance.		X	
	2. Cut edges of chest dart pressed toward front of coat.			X
	3. Folded edge of waist dart pressed towards front of coat.			X
Front and bottom edges	a. Front edges stretched, affecting appearance.		X	
	b. Piping set on tight, causing puckering on front, affecting appearance.		X	
	c. Front or bottom piping irregular, affecting appearance.		X	
	d. Bottom edge stretched, puckered, or uneven, affecting appearance.			X
	e. Bottom corner of left front poorly shaped, affecting appearance.		X	
	f. Left front rolling outward below bottom button.	*		
	g. Front edge irregular, affecting appearance.		X	
	h. Piping tight on bottom edge, causing puckering on outside of coat, affecting appearance.		X	
	i. Left front not dressed as specified.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Front facings	Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.	*		
Back side panel seams	Curved panel seam on back of coat stretched or distorted, affecting appearance.		X	
Front buttonholes	a. Position from front edge including piping to inside edge of eyelet:			
	- less than 1/2 inch but not less than 3/8 inch or more than 3/4 inch but not more than 7/8 inch.			X
	- less than 3/8 inch or more than 7/8 inch.		X	
	b. More than 1/4 inch from equal spacing.		X	
	c. Unevenly spaced from front edge by more than 3/16 inch.		X	
Front buttons (position and stitching)	a. Top button not in vertical alignment with right end of collar by more than 1/8 inch.		X	
	b. Any front button out of vertical alignment by 1/4 inch or more.		X	
	c. Stitching not caught through front interlining on one or more buttons.	X		
	d. Stitching caught through front interlining but not through facing:			
	- one button.			X
	- two or more buttons.		X	

*4.2.3.4 Detailed defects (inside of coat). Detailed defects on inside of coat shall be classified as follows:

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Labels	a. Any required label missing, incorrect, illegible, or size lable not securely caught in stitching.		X	
	b. Identification label not stitched on four sides.			X
	c. Bottom edge of identification label less than 3 inches or more than 5 inches from bottom edge of coat.			X
Hanger	a. Hanger omitted or ends not securely stitched.		X	
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along edge of collar lining.			X
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.			X
Front facings	a. Fullness or pleats on facings between buttons, buttonholes, or between front edge and buttons or buttonholes.			X
	b. Tacking on back edge to one or both interlinings: - omitted.		X	
	- insecure or incomplete for a distance of more than 4-1/2 inches below shoulder seam, or more than 4 inches above bottom edge of coat.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	c. Felling at bottom edge of front facing or back edge of facing omitted or insecure on one or both facings.		X	
	d. Felling at top edge of facing omitted or insecure on one or both facings.		X	
Body lining	a. Excessive puckering or pleated.			X
	b. Twisted, not affecting smoothness on outside of coat.		X	
	c. One or both chest pleats on shoulders omitted.		X	
	d. Folded edge of one or both chest pleats facing front edge of coat.			X
	e. Pleat omitted at center of back lining.		X	
	f. Pleat less than 1/2 inch in depth at center of back lining.			X
	g. Bottom hem less than 5/8 inch or more than 7/8 inch.			X
	h. One or both lining securing straps at bottom of coat omitted or insecure.		X	
	i. Position of one or both lining securing straps more than 1 inch from side seam.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	j. One or both lining securing straps not folded and stitched.			X
	k. Lining too long, i.e., exposed beyond bottom edge of coat.		X	
Serging	Serging omitted on one or more seams where required.		X	
Collar extension tab	a. Omitted.		X	
	b. Extending less than 1/2 inch or more than 1 inch from left end of collar.			X
	c. Insecurely felled or felling not on four sides.			

*4.2.3.5 Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

*4.2.3.6 Inspection levels and AQL's. Inspection levels and AQL's expressed in defects per 100 units (DHU) shall be as follows:

4.2.3.2 through 4.2.3.4

Inspection Level III of MIL-STD-105

AQL's	Major	1.5 DHU
	Major and Minor A (combined)	10.0 DHU
	Total Major, Minor A and Minor B (combined)	15.0 DHU

4.2.3.5

Inspection Level S-3 of MIL-STD-105

One class 4.0 DHU

*4.2.4 Examination of preparation for delivery requirements. An examination shall be made to determine compliance with packaging, packing and marking requirements of Section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the inspection lot. The inspection lot shall be S-2 and the AQL shall be 2.5 DHU.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect
Marking (exterior and interior)	Omitted; incorrect; illegible; of improper size, location, sequence or method of application.
Materials	Any component missing. Any component damaged, affecting serviceability.
Workmanship	Inadequate application of components, such as incomplete closure of case liners, container flaps, loose strapping, inadequate stapling. Bulging or distortion of containers.
Content	Number of coats per shipping container is more or less than required.

*4.3 Test for tackiness. At room temperature (60^0 to 80^0F) press a piece of tissue paper against the lacquered surface for 30 seconds,using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

5. PREPARATION FOR DELIVERY

*5.1 Packaging and packing. Unless otherwise specified (see 6.2), the coats shall be packaged in accordance with good commercial practice and packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight Classification Rules or regulations of other carriers applicable to the mode of transportation.

5.2 Marking. In addition to any special marking required by the contract or order, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES

*6.1 Intended use. The coat described herein is intended for wear by enlisted male personnel of the U.S. Marine Corps band.

*6.2 Ordering data. Purchasers should exercise any desired options offered herein, and procurement documents should specify the following:

*6.2.1 Procurement requirements.

(a) Title, number, and date of this specification.
(b) Size required (see 1.2).
(c) Whether first article is required (see 3.2).
(d) Number of coats in first article (see 3.2).
(e) When coats shall not be packaged and packed in accordance with commercial practice (see 5.1).

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

*6.2.2 Contract data requirements. Data conforming to Data Item Description DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902, DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on a DD Form 1423 included in the contract.

6.3 Samples and shade samples. For information regarding the availability of samples of the coat and of the standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

*6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).

*6.5 Marginal notations. The margins of this specification are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

Preparing Activity:
Navy - MC
Project No. 8405-N534

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

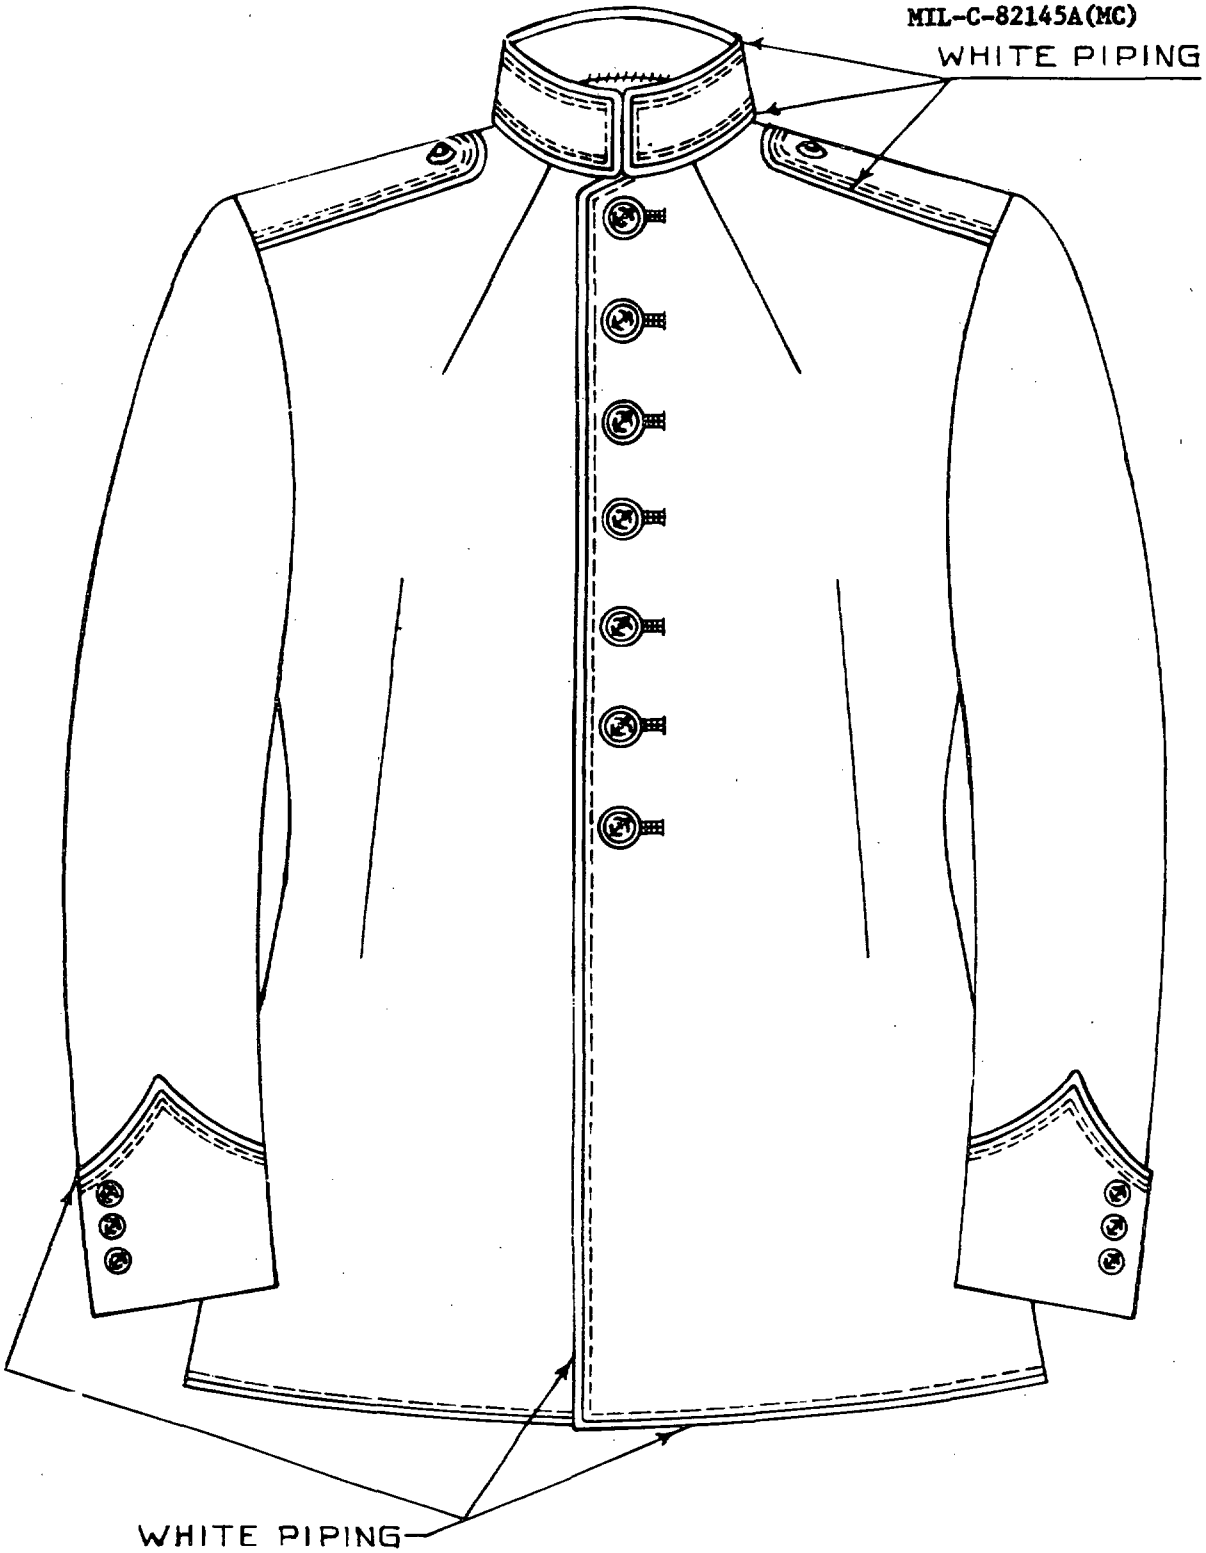


FIGURE 1. COAT, MAN'S: SPECIAL FULL DRESS; SCARLET; U.S. MARINE BAND; MUSICIANS

M.C.S.A.
826: R.G.F.
2 Aug '73

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

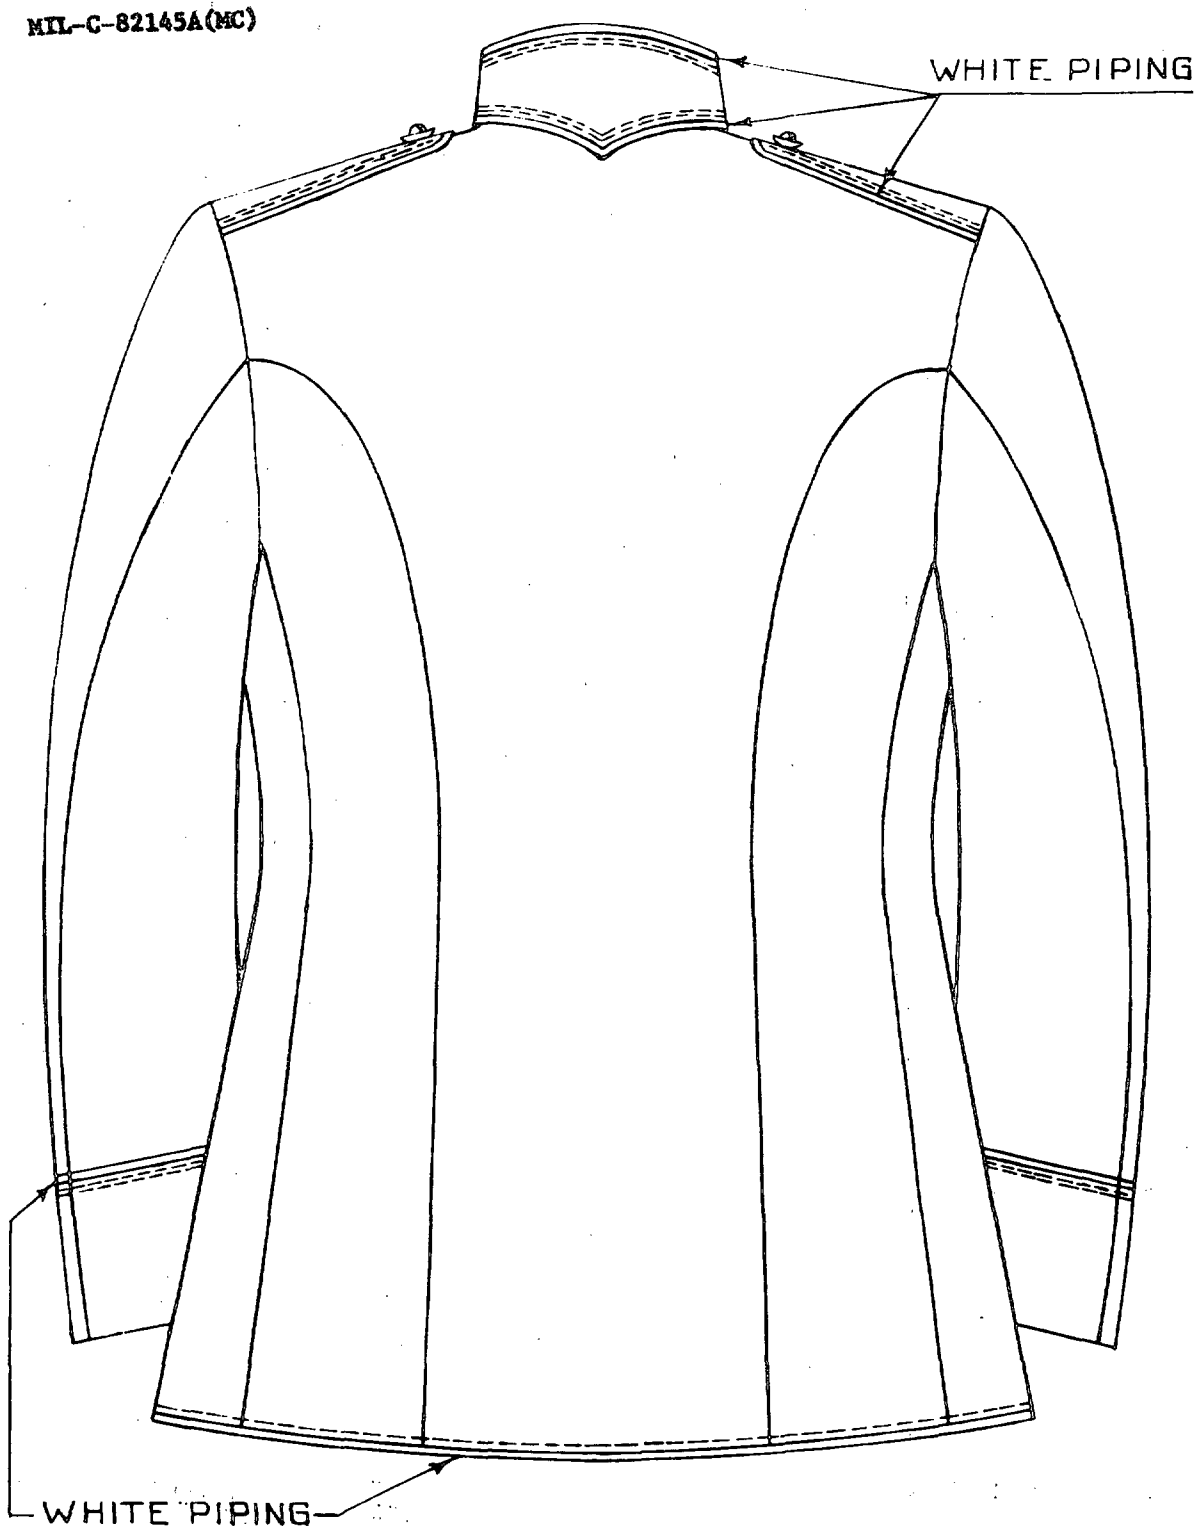


FIGURE 2. COAT, MAN'S: SPECIAL FULL DRESS; SCARLET; U.S. MARINE BAND; MUSICIANS

M.C.S.A.
826:R.G.F.
2 Aug '73

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.


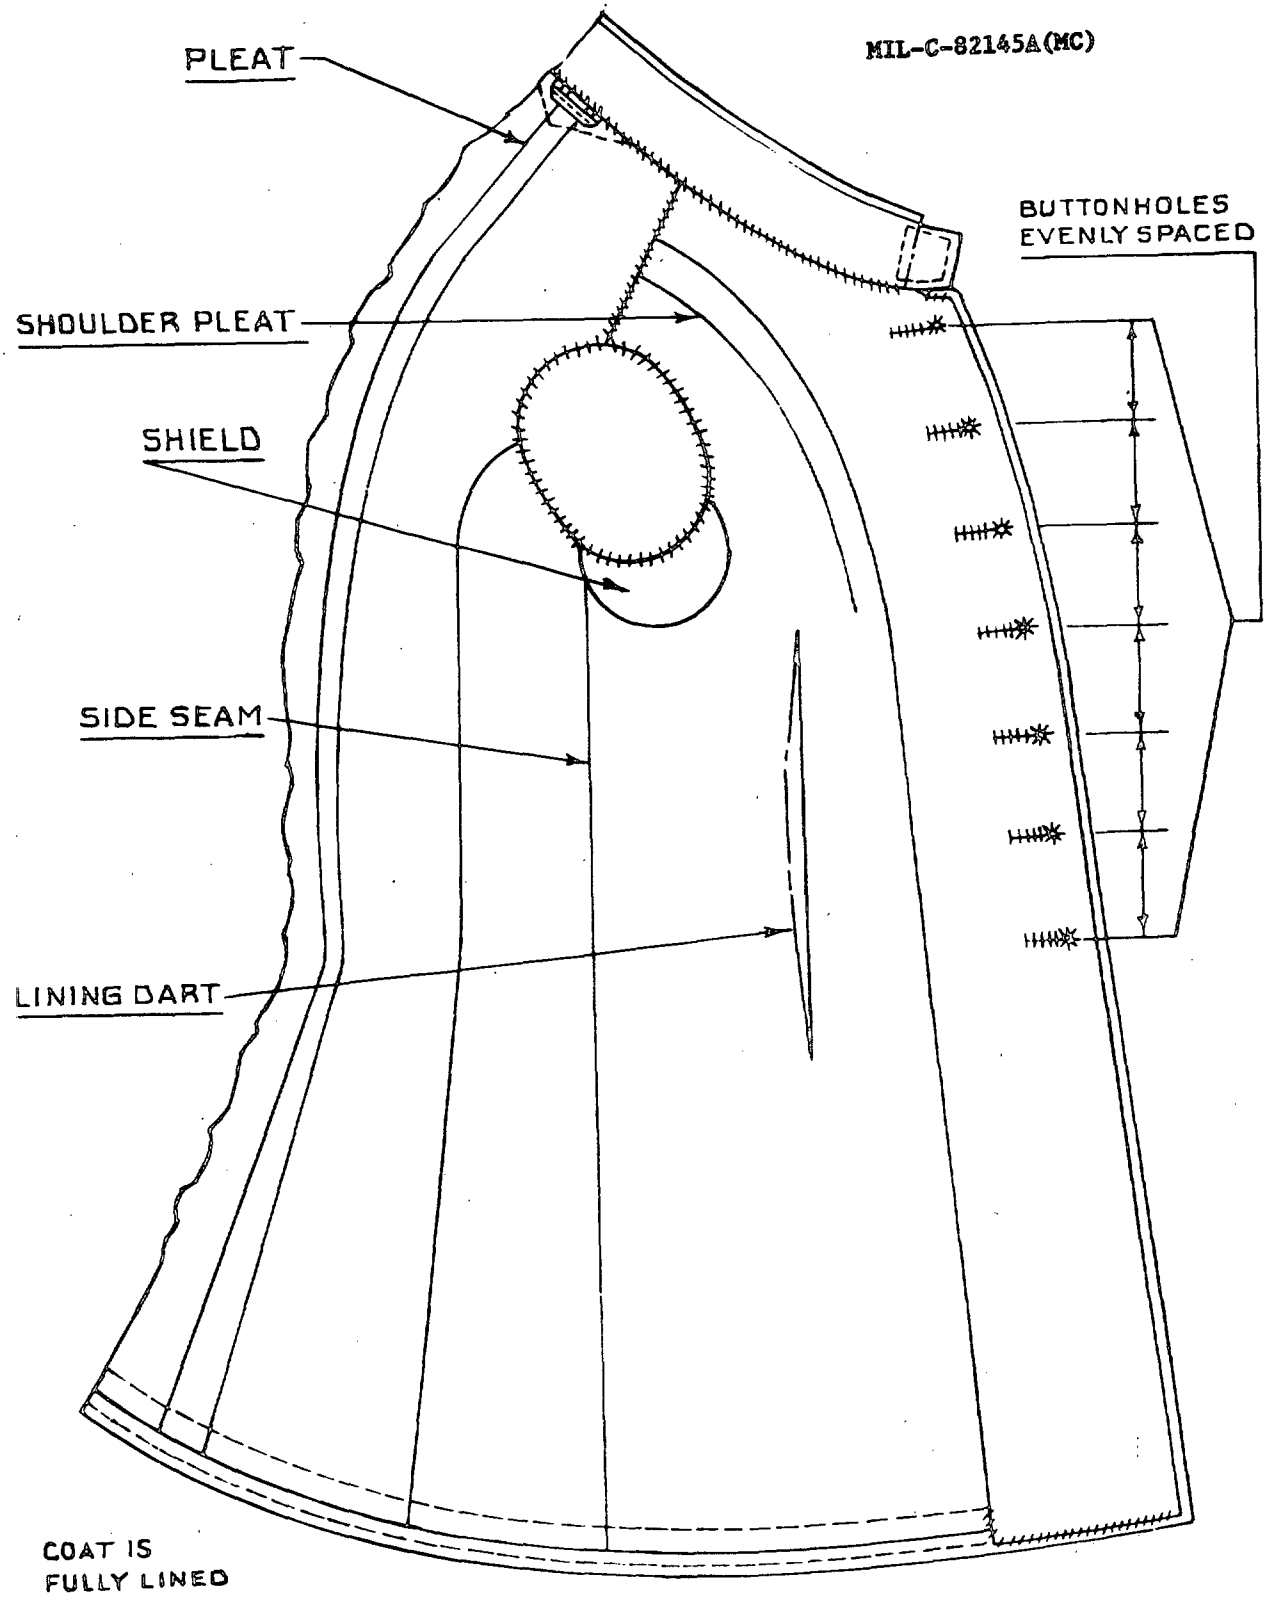


FIGURE 3. COAT, MAN'S. SPECIAL FULL DRESS: SCARLET; U.S. MARINE BAND; MUSICIANS

M.C.S.A. 826: R.G.F. 2 Aug '73

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

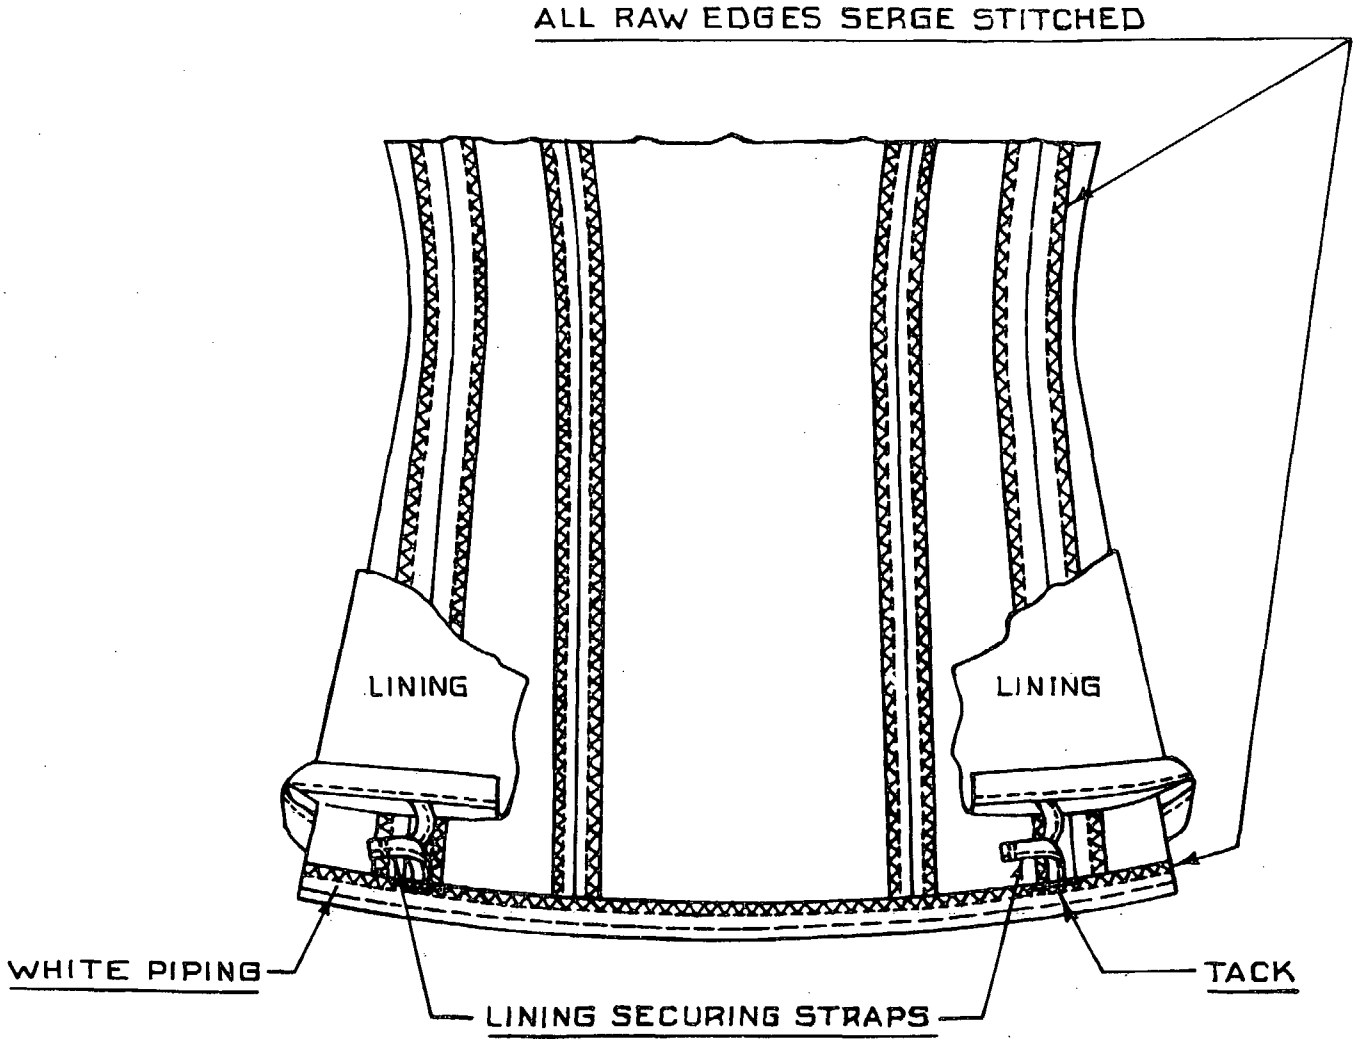


BACK INSIDE — CUT THROUGH VIEW

FIGURE 4. COAT, MAN'S: SPECIAL FULL DRESS: SCARLET; U.S. MARINE BAND; MUSICIANS

M.C.S.A.
826:R.G.F.
2 Aug '73

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

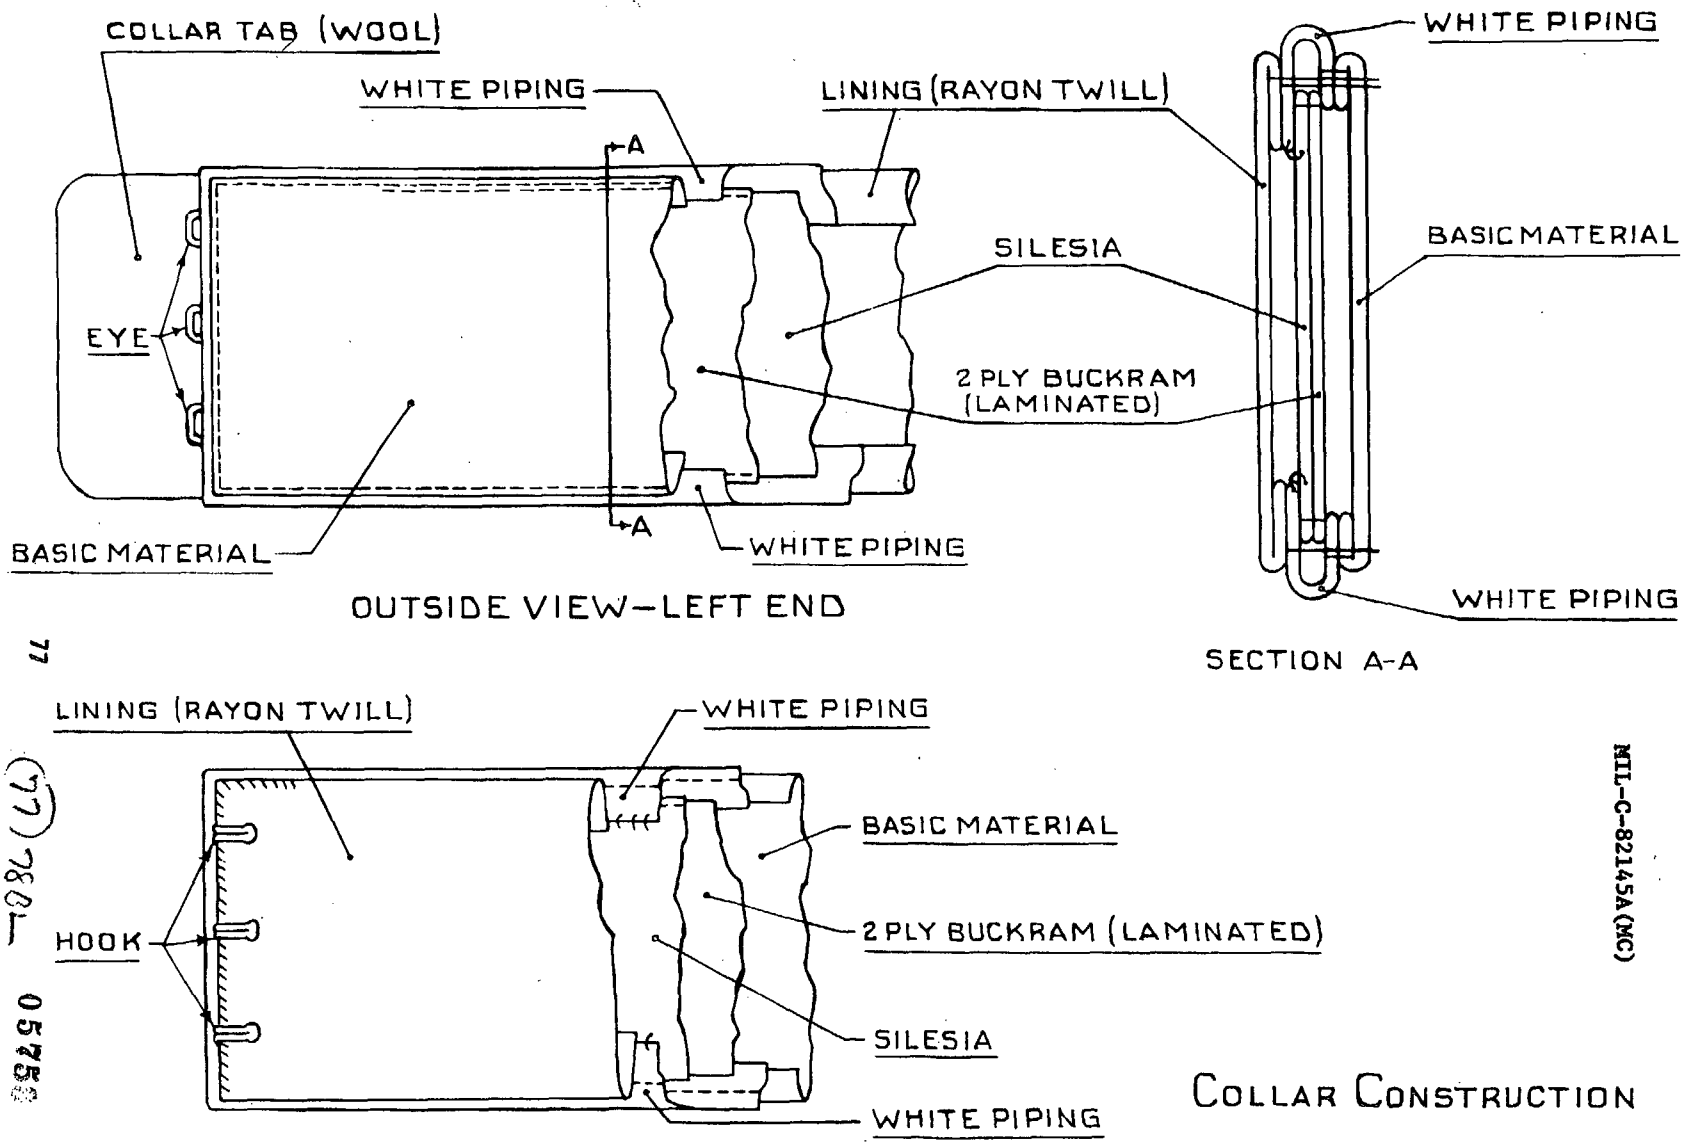

77

(77) 7086

05725

MIL-C-82145A(MC)

COLLAR CONSTRUCTION

FIGURE 5. COAT, MAN'S: SPECIAL FULL DRESS; SCARLET: U.S. MARINE BAND; MUSICIANS

M.C.S.A. 826: R.G.F. 2 Aug '73

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?
   A. GIVE PARAGRAPH NUMBER AND WORDING.

   B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

   ☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

S/N 0102-014-1802

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID
DoD-317



OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

Commanding General (826)
Marine Corps Supply Activity
1100 South Broad Street
Philadelphia, Pennsylvania 19146

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.