INCH-POUND

MIL-C-82145B(MC)
9 June 1995
SUPERSEDING
MIL-C-82145A(MC)
2 August 1973

MILITARY SPECIFICATION

COAT, MAN'S: SPECIAL FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN'S

This specification is approved for use by the U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE.

1.1 Scope. This specification covers requirements for a musician's scarlet, wool, special full dress coat.

1.2 Classification. The coat shall be of one type in the following sizes, as specified (see 6.2):

Schedule of sizes

(Short, Regular, Long, Extra Long)

34 35 36 37 38 39 40 41 42 44 46

1.3 Individual orders. When the coat is custom tailored to an individual order, this specification shall govern, except that the detailed requirements of Section 3, Table I, may be modified to the extent necessary for good custom tailoring practice.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation (see 6.2).

SPECIFICATIONS

FEDERAL

A-A-50186	- Cloth, Cotton, Buckram
A-A-50196	- Thread, Silk
A-A-50198	- Thread, Gimp, Cotton Buttonhole
A-A-50199	- Thread, Polyester Core, Cotton or Polyester Covered
A-A-52071	- Tape, Textile, Cotton, General Purpose, (Unbleached, Bleached or Dyed)
A-A-52094	- Thread, Cotton
A-A-52106	- Cloth, Twill or Plain Weave, Polyester or Polyester Blend
DDD-L-20	- Labels for Clothing, Equipage and Tentage (General Use)

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill Rayon
MIL-B-3461	- Buttons, Insignia, Metal, Uniform and Cap
MIL-P-15064	- Pads, Shoulder and Sleeve Head
MIL-L-17507	- Lace, Ornamental
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/Wool
MIL-C-29405	- Cloth, Broadcloth: Wool and Wool/Nylon
MIL-C-41820	- Cloth, Gabardine, Polyester and Rayon
MIL-C-82114	- Coat Front for Coats, Musicians

STANDARDS

FEDERAL

FED-STD-151	- Metals: Test Methods
FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams, and Stitching

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-105 - Sampling Procedures and Tables For Inspection By Attributes
MIL-STD-129 - Marking For Shipment and Storage

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19120-5094.)

2.2 Non-Government publications. The following documents form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation (see 6.2).

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense Standard Shades for Sewing Threads

(Applications for copies should be addressed to the Color Association of the United States, 409 W. 44th Street, New York, NY 10016-0927.)

AMERICAN SOCIETY FOR TESTING AND MATERIALS

ASTM D 3951 - Standard Practice for Commercial Packaging

(Applications for copies should be addressed to American Society for Testing and Material, 1916 Race Street, Philadelphia, PA 19103.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless specific exemption has been obtained.

3. REQUIREMENTS

3.1 Guide samples. Guide samples are furnished solely for guidance and information to the contractor (see 6.4). Variation from the specification may appear in the sample, in which case, the specification shall govern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.2 First article. When specified (see 6.2), contractor shall furnish sample unit(s) for first article inspection and approval (see 4.3 and 6.4).

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, wool, tropical, scarlet shade 2502 (see 6.3), 10.5 ounce conforming to type I class 1 of MIL-C-21115.

3.3.2 Collar, shoulder straps and cuff material. The material for the collar, shoulder straps and cuffs shall be cloth, polyester/wool blend, black shade 2607 (see 6.3) conforming to type III, class 1 of MIL-C-21115.

3.3.3 Lining. The material for lining the coat and collar and for making the coat hanger and straps to secure the lining to the bottom edge of coat shall be cloth, rayon twill, scarlet 2506 (see 6.3), conforming to class 1, of MIL-C-368.

3.3.4 Cloth, twill or plain weave. The stays for the armhole and shoulder seams, the binding for the neck edge of the coat front interlining and the collar interlining shall be cut from cloth, twill or plain weave polyester, natural color, conforming to class 1 of A-A-52106.

3.3.5 Collar interlining. The material for interlining the collar shall be cloth, cotton buckram, double texture, laminated, starch finish, natural color, conforming to type IV of A-A-50186. The weight of the laminated cloth shall be 21 to 23 ounces per square yard.

3.3.5.1 Plastic. The plastic strip used in the collar interlining shall be clear, plastic pattern stock, 0.020 inches thick. It shall be cut using the cotton buckram pattern.

3.3.6 Coat fronts. The coat fronts shall conform to class 1 of MIL-C-82114.

3.3.7 Shoulder pads. The shoulder pads shall conform to the requirements of type I, class 2, of MIL-P-15064.

3.3.8 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.9 Stay tape. The stay tape for the armholes shall be cotton, unbleached, 1/4 inch wide, conforming to type II, class 1 of A-A-52071, except the requirement for non-fibrous material shall not apply.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.10 Piping. The material for piping the shoulder straps, lower edge of collar, sleeve cuffs, front and bottom edges of the coat shall be cloth, gabardine, polyester and rayon, white shade 3042 (see 6.3), conforming to type I, class 2, of MIL-C-41820.

3.3.10.1 Vinyl piping. The white vinyl piping for the upper edge of the collar shall be tubular with 7/16 inch welt and serrated edges. One acceptable product is sold by the Pearl Binding Corporation of Philadelphia, PA.

3.3.11 Collar tab. The material for collar tab shall be cloth, wool broadcloth, blue shade 2307 (see 6.3), conforming to type I, of MIL-C-29405.

3.3.12 Thread.

3.3.12.1 Silk thread. The silk thread shall conform to A-A-50196 except the requirement for extractable material shall not apply. The thread for machine sewing shall conform to type I, size A, for bartacks and all outside seaming and stitching; size 0 for machine felling; and sizes B and F for buttonhole needle and bobbin thread respectively. The thread for hand sewing shall conform to type III, class 3, size C, 2-ply.

3.3.12.2 Cotton thread. The cotton thread shall conform to A-A-52094, type III, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching; type I, soft finish, ticket No. 70, 2-ply for serging and overedge stitching; type II, glazed finish, ticket No. 24, 4-ply for sewing on buttons and machine tacking armholes. The thread for tacking sleeve lining, hand tacking facing to interlining and basting shall be a good commercial grade. As an alternate to the cotton thread, a polyester core, cotton or polyester covered thread conforming to A-A-50199, ticket No. 50, 2 ply or ticket No. 70, 2 ply may be used.

3.3.12.3 Color and colorfastness. The thread for the scarlet material shall be scarlet shade W, cable no. 66040, and the thread for the dark blue material shall black, except cotton thread for basting and machine tacking armholes, which may be white; and the thread for overedge stitching of the piping at bottom edge of coat shall be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning, and in addition, the silk thread shall show good fastness to light.

3.3.13 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be scarlet, shade W, cable No. 66040, and shall show good fastness to wet (dry) cleaning.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.14 Buttons.

3.3.14.1 Insignia buttons. The insignia buttons shall be metal, gold plated, enlisted design, 27-line for shoulders and cuffs and 40-line for fronts, conforming to type I, style 3, class A, sub-class 1 of MIL-B-3461.

3.3.14.2 Ring toggles. Ring toggles for securing the 27-line buttons to sleeve cuffs and shoulders shall conform to MIL-B-3461.

3.3.15 Collar closure hook and eye. The hook and eye for closing the collar shall be brass, black, japanned finish or black chemical finish, conforming to MIL-F-495, followed by a clear lacquer coating and conform to the requirements of Figure 6.

3.3.16 Labels. Each coat shall have a combined identification/instruction label and a size label conforming to DDD-L-20. The coats are intended to be wet (dry) cleaned and the label shall show fastness to wet (dry) cleaning.

3.3.16.1 Combination identification/instruction label. The combination identification/instruction label shall conform to type V, classes 2 and 14 (combined) of DDD-L-20, except all printing and the space between lines of printing shall be a minimum of 10 point (approximately 1/8 inch). The content and format shall be as follows:

COLLAR SIZE_____
NOMENCLATURE_____
CONTRACT NO._____
NAME OF CONTRACTOR _____
WOOL PRODUCTS ACT INFORMATION_____

3.3.16.2 Size label. The size label shall conform to type V, class 2, of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S (short), R (regular), L (long), or XL (extra long), as shown by the following example:

40 R

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.4 Design. The coat shall be the U.S. Marine Corps design shown on Figures 1 through 5, a seven-button, single breasted, formfitting, fully lined coat having a one-piece front, waist and chest darts, a three piece back without a center vent, sleeve cuffs, shoulder straps with buttons and a stand up collar with a hook and eye front closure. The top and bottom edges of collar, front and bottom edges of coat, the top edges of sleeve cuffs and the edges of shoulder straps shall be piped.

3.5 Patterns. Standard patterns shall be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard patterns. The standard patterns shall provide a 3/4 inch allowance for side seams and the seam joining the skirt to the center back, and a 3/8 inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

3.5.1 List of pattern parts. Coats shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

Item	Pattern nomenclature	No. of cut parts
	Material basic: Cloth, wool, tropical (scarlet)	
1.	Front	2
2.	Front facing, right	1
3.	Front facing, left	1
4.	Side back	2
5.	Center back	1
6.	Top sleeve	2
7.	Under sleeve	2
	Cloth, polyester/wool (black)	
8.	Collar	1
9.	Shoulder straps	2
10.	Cuffs	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature	No. of Cut parts
	Cloth, rayon lining	
11.	Front	2
12.	Side back	2
13.	Center back	2
14.	Top sleeve	2
15.	Under sleeve	2
16.	Collar lining	1
17.	Underarm shields	2
	Cloth, Twill or plain weave, polyester or polyester blend	
18.	Collar underply	1
	Cloth, cotton, buckram	
19.	Collar interlining	1
	Mylar Plastic	
20.	Collar interlining	-
	Marker	
21.	Cuff and button marker	-

3.6 Construction.

3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I.

3.6.1.1 Operations. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1.2 Stitches, seams, and stitchings. The stitch, seam, and stitching types specified in table I shall conform to FED-STD-751. The number of stitches per inch as specified in table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.6.1.2.1 Tacking and backstitching. Ends of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

3.6.1.3 Shade marking. The component parts shall be cut from one piece of the applicable wool materials and lining material, including pairs of sleeve linings and underarm shields when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

a. Corrosive metal fastening devices.
b. Sew-on shade tickets.
c. Adhesive type tickets which show discoloration and the adhesive mass which adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. a. Cut coats in strict accordance with the patterns furnished by the Government. b. Cut all materials in the direction of the warp as indicated by the directional lines on the patterns. c. Cut all scarlet wool parts of the coat from one piece of the basic material. Underarm shields may be cut from ends. d. Cut the body and collar linings, from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the lining shall match. Cut the strips for the coat hanger and lining securing straps 1-1/8 inches wide. e. Cut the wool material for the sleeve cuffs, shoulder straps, and outer ply of collar from the material specified in 3.3.2. f. Cut the collar tab from the material specified in 3.3.4. -or-					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) g. Collar lining may be extended to take the place of the collar tab. h. Cut the twill or plain weave polyester and polyester blend stays for armhole and shoulder seams on the bias 3/4 inch wide and 4-1/4 inches long. Cut the polyester for binding the neck edge of coat front interlining on the bias, 3/4 inch wide and approximately 5 inches long. Cut the polyester for interlining collar on the straight in accordance with pattern furnished. i. Cut the cotton buckram and plastic strip for interlining the collar on the straight in accordance with the pattern furnished. j. Cut the piping material (see 3.3.10) for piping the front and bottom edges of coat, edges of shoulder straps, collar, and sleeve cuffs on the straight. The piping shall be cut 5/8 to 3/4 inch wide for shoulder straps, collar and cuffs and 1 inch wide for fronts and bottom edges of coat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
2	Replacement of damaged parts. a. Replace at time of cutting all parts of coat containing holes or seriously weakening defects, such as smashes, multiple floats loose or weakening slubs, etc., expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc., affecting appearance. b. Replace any part damaged during the manufacturing process by needle chews which may develop into holes, scissor or knife cut, tears, holes, mends or burns in the material affecting appearance.					
3	Shade marking. a. Mark or ticket (see 3.6.1.3) all component parts cut from one piece of basic lining materials, and pairs of sleeve linings when cut from ends, to insure uniform shade and size throughout the coat. b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
4	Make coat hanger and lining securing straps. Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8 inch wide straps of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	12-16	A	A
	b. Cut the coat hanger 3-3/4 ± 1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ± 1/4 inches long.					
5	Make underarm shields. Finished appearance. The shields shall finish smooth and flat without puckers, pleats, gathers or other distortions.					
	a. Position the two plies of the material for the underarm shields with edges even. Seam the two plies together along the curved side and bottom edges 3/8 inch from the edges.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
5	Make underarm shields. (cont'd) b. Turn the shield right side out, working out completely the seamed edges. c. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
6	Make shoulder straps. Finished appearance. The shoulder straps shall be uniform in appearance and shall finish smooth and flat, without twists, gathers, puckers, pleats or other distortions. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the shoulder strap. a. The shoulder straps shall be made of one ply of the material specified in 3.3.2, piped with a 5/8 to 3/4 inch wide strip of the piping material specified in 3.3.10.					
	b. Position the strip of piping material on the outside of the shoulder strap with edges even and stitch together 1/8 to 3/16 inch on both sides and collar end of shoulder strap.	301	BSm-1 (a)	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Make shoulder straps. (cont'd)					
	c. Turn back the piping, working the folded edge of piping 1/8 inch beyond edge of shoulder strap. Topstitch the shoulder strap to the piping 3/16 inch from folded edge of piping.	301	BSm-1 (b)	10-14	A (Silk)	A
	d. Press the shoulder straps smooth and flat with a heated pressing iron or pressing machine.					
7	Make cuffs.					
	Finished appearance. The cuffs shall be uniform in appearance, shall finish smooth and flat without twists, gathers, pleats, puckers or other distortions. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the sleeve cuff.					
	a. The cuffs shall be made of one ply of the material specified in 3.3.2, piped with a 5/8 to 3/4 inch wide strip of the piping material specified in 3.3.10.					
	b. Position the strip of piping material on the outside sleeve cuff with edges even and stitch together 1/8 to 3/16 inch	301	BSm-1 (a)	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Make cuffs. (cont'd)					
	from the upper curved and pointed edge of cuff.					
	c. Turn back the cuff and piping, working the folded edge of the piping 1/8 inch beyond edge of cuff. Topstitch the cuff to the piping 3/16 inch from folded edge of piping.	301	BSm-1 (b)	10-14	A (Silk)	A
	d. Press the cuffs smooth and flat with a heated pressing iron or pressing machine.					
8	Stitch and press dart in undersleeves.					
	a. Fold the under sleeve matching the cut edges of the sleeve dart. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole and and taper the line of stitching to zero at the lower folded edges.	301	SSa-1 (cut edges) OSf-1 (folded edges)	12-16	A	A
	b. Spread open the cut edges of the dart, turn the folded edge flat against the body of the sleeve and press flat the entire dart smooth and flat with a heated pressing iron.					
9	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Seam sleeves at forearm. (cont'd) twists, gathers, puckers or pleats and shall start and finish evenly. a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of under sleeve and with the notches in the lower forearm edge of top and under sleeves matching. Seam top and under sleeves together 3/8 inch from forearm edge of top sleeve, forming a tapered outlet on the under sleeve. b. Spread open the seam and press flat with a heated pressing iron.	301	SSbd-1 to SSa-1	12-16	A	A
10	Join cuff to sleeve. Finished appearance. The cuff shall be uniformly stitched to the sleeve without twists, gathers, puckers, pleats or raw edges. On the finished coat, the length of the cuff, including the piping, shall measure 3-1/4 ± 1/8 inches at the front and back creased edges, and 6 ± 1/4 inches at the point. In the finished coat (after pressing) the point of the cuff shall be centered between the lower forearm					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Join cuff to sleeve. (cont'd)					
	creased edge and the creased backarm seam of sleeve.					
	a. Mark the sleeves in accordance with the sleeve cuff marker for positioning of the cuffs, with notch on the cuff marker matching the forearm seam line and bottom edge of marker in line with the bottom raw edge of sleeve.					
	b. Position the piped edge of cuff at the mark and stitch cuff to sleeve along the piped edge. The line of stitching shall be adjacent to the stitching of the cuff piped edge.	301	LSa-1	10-14	A (Silk)	A
11	Seam sleeve as backarm.					
	Finished appearance. The backarm seams shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeves at the backarm with a 3/8 inch seam, catching the ends of the cuff in the stitching.	301	SSa-1	12-16	A	A
	b. Spread open the sleeve and cuff seams and press smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12	Insert insignia buttons.					
	a. Mark each cuff for location of three insignia buttons in accordance with button marker.					
	b. Punch a hole through cuff and sleeve at each mark for attaching of insignia buttons.					
	c. Insert the shanks of the 27-line insignia buttons through the punched holes and attach ring toggles in each button shank.					
13	Baste and tack cuff to sleeve.					
	a. Turn the bottom of the cuff to the inside against the bottom edge of sleeve in accordance with notches, and bast along the turned edge of the cuff.	301 or Hand				
	b. Tack the raw edge of cuffs to the body of the sleeves with blindstitching. The blindstitching shall not be exposed on, or caught to, the outside of the cuff.	301	EFc-1 (b)	4-6	A	A
14	Stitch and press dart in under sleeve linings.					
	a. Fold the under sleeve lining, matching the cut edges of the under sleeve	301	SSa-1 (cut edges)	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
14	Stitch and press dart in under sleeve linings. (cont'd)					
	dart. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole and taper the line of stitching to zero at the lower folded edge.		OSf-1 (folded edge)			
	b. Turn the cut edges of the dart toward the forearm edge and press the entire dart smooth and flat with a heated pressing iron.					
15	Seam sleeve lining at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the lining at lower forearm edge of top and under sleeve linings even. Seam the top and under sleeve lining together 3/8 inch from the forearm edge of top sleeve lining, forming a tapered outlet on the under sleeve lining.	301	SSbd-1 to SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
16	Seam sleeve lining at backarm. Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve linings at the backarm with a 3/8 inch seam.	301	SSa-1	12-16	A	A
17	Assemble sleeve and sleeve lining. Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of the lining extending approximately 1 inch beyond the armhole edge of sleeve.					
	b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the sleeve, commencing at the top edge of the cuff and extending to approximately 6 inches from armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand		4-6 1-2	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
17	Assemble sleeve and sleeve lining. (cont'd)					
	c. Pull sleeve through sleeve lining.					
18	Fell sleeve lining turnup.					
	Finished appearance. The sleeve lining shall not be short, tight or twisted at bottom of sleeves.					
	a. Turn under the bottom edge of the sleeve lining to finish 1 to 1-1/4 inches above the finished end of sleeve, and baste to turnup of sleeve. (This basting operation is optional. Operation 18.b may be performed without the prior basting of sleeve lining to turnup of sleeve.)	Hand or Machine		4-6		
	b. Fell the folded edge of sleeve lining to the turnup of cuff with blindstitching.	Hand or 301	EFc-1 (b)	8-10 6-8	C (Silk) O | O (Silk)	
19	Press sleeve.					
	a. Turn the sleeve right side out and assemble in pairs. Press the lower half of sleeves smooth and flat, creasing at the forearm and backarm. The backarm crease shall be on the backarm seam. Remove basting at lower end of cuffs.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Assemble collar interlining. a. The collar interlining assembly shall consist of one ply of laminated cotton buckram, and one ply of twill or plain weave polyester and one ply of mylar plastic.					
	b. Seam the plastic, polyester and buckram together 1/8 to 3/16 inch from all edges and trim the polyester even with the edges of the buckram. The polyester cloth shall be positioned on the inside and the plastic (mylar) on the outside.	301	SSa-1	12-16	A	A
21	Pipe outer ply of collar. Finished appearance. The piping shall extend at upper, lower and side edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers or pleats. a. The outer ply of the collar shall consist of one piece of the material specified in 3.3.2, piped with a 5/8 to 3/4 inch wide strip of the piping material specified in 3.3.10 and 3.3.10.1.					
	b. Seam a 5/8 to 3/4 inch wide strip of piping to outer ply 1/8 inch from	301	SSa-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
21	Pipe outer ply of collar. (cont'd)					
	bottom and side edges, leaving a 3/4 to 1 inch extension on each end of piping at lower edge of collar. The extension edge of piping shall be approximately 3 inches from the pointed end of collar. Seam the vinyl piping to the upper collar edge with collar abutted against cord edge and stitching 1/16 inch from edge of collar.					
	c. Join extensions together as close as possible to outer ply.	301	SSa-1	12-16	A (Silk)	A
	d. Trim the excess extension piping to 1/4 inch from the open seamed edge. Spread open joining of extension and stitch to collar along seam joining piping to outer ply.	301	SSa-1	12-16	A (Silk)	A
	e. Turn back the piping and outer ply, uniformly working the folded edge of the piping 1/8 inch beyond the edge of collar. Topstitch the outer ply uniformly 3/16 inch from the folded edge of piping.	301	SSa-1	12-16	A (Silk)	A
22	Assemble collar and lining extension tab.					
	Finished appearance. The collar shall be assembled without twists, gathers,					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22	Assemble collar and lining extension tab. (cont'd) puckers or pleats. a. Position the interlining assembly on the inside of the outer ply under the unattached edge of piping. Tack all the raw edges of piping to the polyester interlining, making the outer ply form a smooth and snug fit. b. Press the collar smooth and flat with a heated pressing iron or pressing machine. c. Lap the upper piped edge of collar over the top raw edge of collar lining approximately 1/2 inch, with lining face up. Stitch collar to the lining from end to end along the piped edge adjacent to the stitching line of the collar piped edge. The lining shall extend approximately 1/2 inch beyond the right end of the collar and approximately 2-1/2 inches beyond the left end of the collar for lining extension tab. d. Turn collar lining at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing	Hand 301	LSa-1	2-3 12-16	C (Silk) A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22	Assemble collar and lining extension tab. (cont'd)					
	machine.					
	e. Turn back the left end of the collar lining 1-1/2 inches, face to face, and stitch along the top and bottom edges from the fold to the back raw edge of lining, to face side of lining, forcing out the corners. Stitch collar lining extension tab 1/16 inch from top, front and bottom edges and continue the stitching at the back of tab to top row forming approximately 1 X 1-3/8 inch box stitch.	301	SSc-1 (top and bottom edges) OSf-1 (front edge) SSa-1 (back edge)	10-14	A	A
23	Fold and stitch dart in front lining.					
	Finished appearance. The darts shall finish without gathers, puckers or pleats. The stitching shall be 3/8 inch from the folded edge at the center.					
	a. Fold the front lining and stitch waist darts in accordance with marks as indicated on the pattern, tapering the upper and lower ends to a flat point, and securely tacking the points.	301	OSf-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24	Sew on identification label. Finished appearance. The identification label shall be positioned so that in the finished coat, the label shall be midway between front and back edge of the right facing and with the bottom edge of the label approximately 4 inches from the bottom finished edge of the coat.					
	a. Sew the identification label to the outside of the right facing with a single row of stitches 1/16 to 1/8 inch from each edge.	301	SSa-1 (each edge)	12-16	A	A
25	Join front lining to wool facing. Finished appearance. The lining shall be carefully joined to the facing so that in the finished coat the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material or other distortions.					
	a. Position the lining on the wool facing and join the front edge of the lining to the back edge of the facing with a 3/8 inch seam from top edge of facing to approximately 1-1/4 inches from bottom edge.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
26	Assemble side back lining.					
	Finished appearance. The side back lining shall be carefully joined without gathers, puckers or pleats. The seams shall start and finish evenly.					
	a. Position and join the left and right side back linings to the respective center back lining with a 3/8 inch seam.	301	SSa-1	12-16	A	A
27	Join side backs and front linings.					
	Finished appearance. The side back and front lining shall be carefully joined without gathers, puckers or pleats. The seams shall start and finish evenly.					
	a. Position and join the front and side back linings at the sides with a 3/4 inch seam.	301	SSa-1	12-16	A	A
28	Overedge stitch the lining and facing seams.					
	a. Overedge stitch together the raw edges of the facing-lining seam, side seams and the side backs seam allowance.	503 or 504	EFd-1	6-8 6-8	70/2 70/2	70/2 70/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
29	Press lining seams and waist darts with a heated pressing iron or pressing machine.					
	a. Turn the edge of facing-lining seam, the side seams and side back seams toward the back and press smooth and flat.					
	b. Turn the waist darts toward the side seam and press smooth and flat.					
30	Assemble fronts.					
	Finished appearance. The chest and waist darts shall finish without gathers, puckers or pleats. The stitching for the waist darts shall be 3/8 inch from the folded edge at the center.					
	a. Fold the fronts, matching the notches of the chest darts. Stitch the entire length of the darts from the notches at the upper end and taper the line of stitching to zero at the lower end.	301	SSa-1 (cut edges) OSf-1 (folded edge)	12-16	A	A
	b. Fold fronts and stitch waist dart in accordance with marks as indicated on the pattern, tapering the upper and lower ends to a flat point and securely tacking the points.	301	OSf-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31	Press darts on fronts with a heated pressing iron.					
	a. Turn the folded edge of the chest darts toward the armhole and press smooth and flat.					
	b. Turn the folded edge of the waist dart towards side seam and press smooth and flat.					
32	Join side backs and center back.					
	Finished appearance. The sides and center back shall be joined without gathers, puckers or pleats. The seams shall start and finish evenly.					
	a. Position and join the left and right side backs with notches matching to the respective center back with a 3/8 inch seam.	301	SSa-1	12-16	A	A
33	Join fronts and back.					
	Finished appearance. The fronts and back shall be joined without gathers, puckers or pleats. The seams shall start and finish evenly.					
	a. Position and join fronts to the back at the sides with a 3/4 inch seam.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34	Press side and back seams.					
	a. Spread open side and back seams and press smooth and flat with a heated pressing iron.					
35	Overedge stitch fronts and back.					
	a. Overedge stitch all raw edges of the joining seams for fronts and back.	503	EFd-1	6-8	70/2	70/2
		or 504	EFd-1	6-8	70/2	70/2
36	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The reinforcement stays shall be sewn to the armhole and shoulder edges of the front without gathers, puckers or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4 inch wide stays to the underside of the front at the shoulder edge and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from the neck and armholes respectively. The strip for the upper front edge of the armholes shall be	301	SSaa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36	Seam reinforcement stay to armhole and shoulder. (cont'd) positioned approximately 1/2 inch from the shoulder.					
37	Tape armholes.					
	a. Sew the cotton tape to the armholes starting with one end approximately 1 inch above the notch on the fronts and continuing along the lower and back edge of the armholes to approximately 1/2 inch from shoulder edge.	301	SSaa-1	12-16	A	A
	b. The tape shall be stitched with slight tension along the lower front edge of the armhole and shall be held taut while stitching along the back edge.					
38	Press shoulder blades and armhole tapes.					
	a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or a suitable type pressing machine.					
39	Mark and dress left front.					
	a. Mark and shape the left front edge from the top notch to the bottom edge of front.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39	Mark and dress left front. (cont'd) b. The mark line shall be 1 inch from the upper front edge to 1-1/8 inches at the waistline. Continue on the straight line from waistline to the notch at the bottom edge. NOTE: The dressing and shaping shall be performed in the sewing room. c. Where necessary, trim any frayed edges along the right front and bottom.					
40	Stitch piping to coat. Finished appearance. The piping shall be uniformly stitched to the coat without twists, puckers or pleats. The piping shall extend from the collar notch at top edge of the right front along the bottom and up to the collar notch at top edge of the left front. a. Position the 1 inch wide piping of the material specified in 3.3.10 to the outside of the left and right front, with edge even with top front and bottom edges of coat. Stitch piping to coat 1/8 inch from edges.	301	SSa-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40	Stitch piping to coat. (cont'd)					
	b. Turn the piping to the inside, working out the folded edge of piping uniformly, 1/8 inch beyond the edges of the coat.					
	c. Topstitch the coat to the piped edges of the coat uniformly 3/16 inch from the folded edge of the piping.	301	SSa-1	12-16	A (Silk)	A
	d. Notch out the excess piping material at the top and bottom front corners to eliminate bulkiness. Trim the inner edge of piping on the left front only from the upper front down to approximately 1 to 1/2 inches below waistline so that the piping will not interfere with front buttonholes.					
	e. Serge stitch the raw edge of the piping at the bottom edge of the coat only.	503 or 504	EFd-1 / EFd-1	6-8 / 6-8	70/2 / 70/2	70/2 / 70/2
	f. Press the piped edges of coat smooth and flat with a heated pressing iron or pressing machine.					
41	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste the interlining and fronts	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Interline fronts. (cont'd)					
	together from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom edge of the front.					
	b. Baste along the shoulder, allowing room for setting the shoulder pad, working the fullness towards the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulder to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of fronts.	Hand or 301	Hopper			
42	Trim coat front interlining.					
	a. Trim the top edge of coat interlining even with the top edge of fronts from the point of shoulder to the collar notch.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
42	Trim coat front interlining. (cont'd) b. Notch the top edge of the interlining in line with the collar notch. c. Remove stitches joining the front edge of polyester to coat front interlining approximately 1/2 inch back from front and top edge of fronts. d. Turn the fronts inside out and trim the interlining only, approximately 1/4 inch back from the front and top edge of fronts. e. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					
43	Bind front edge and gorge of interlining. a. Fold the polyester back and over the top and front raw edge of the interlining. Stitch along the top and front edge with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the upper turned under portion in the stitching.	301	EFa-3	8-12	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
44	Bind top neck edge of interlining.					
	Finished appearance. The polyester binding shall be uniformly stitched along the gorge edge of the coat front interlining from the collar notch to the shoulder point.					
	a. Lap the 3/4 inch wide binding on the outside of the coat front interlining from the collar notch to the shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	8-12	A	A
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301	SSa-1	8-12	A	A
45	Fell piping to coat front interlining.					
	a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	101				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
45	Fell piping to coat front interlining. (cont'd)					
	b. Fell the upper front and lower inner edge of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A C (Silk)	A
	c. Pull and remove basting stitches from piping.					
	d. Press the left and right fronts on a suitable type heated pressing machine, with the chest portion to conform to the shape of the body.					
46	Join facing to fronts.					
	a. Position the left and right fronts to the respective front facing (face to face), with the waistline notch of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark the facing along the top front edges of coat.					
	b. Lap the front edge of the right and left fronts respectively on the outside of the facing at the marks and join the front and facing together as close as possible to, but not on top of, the stitching joining the	301	LSa-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
46	Join facing to fronts. (cont'd) piping to the front. The stitching shall extend from the top to the bottom edge of coat front edge only. c. Trim excess facing material where necessary.					
47	Baste front edges. a. Turn the facing-lining assemblies to the inside of fronts, completely working out the corners.					
	b. Baste along the front edge of the left and right fronts, working the facing back from the folded edge of piping.	101				
48	Basting facing (second time). a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 301	Hopper			
	b. Turn under and baste the top edge of the facing to the fronts from the collar notch to the front edge, catching the	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
48	Basting facing (second time). (cont'd)					
	turned under portion of the facing in the basting.					
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of facings approximately 1-1/4 inches from the lower edge of facing.	Hand or 301	Hopper			
	d. Turn under the bottom edge of the facing at the mark and baste along the folded edge.	Hand or 301	Hopper			
49	Tack facing interlining.					
	a. Tack the right and left facing-lining seam allowance to the respective coat front interlining from approximately 2-1/2 inches from bottom edge of coat to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6		
50	Baste front linings to coat.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat, and baste along the	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
50	Baste front linings to coat. (cont'd) entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole. b. Baste the front lining to the coat, starting at the lower end of the chest pleat, continuing along lower edge of armhole approximately 2 inches from the edge, and ending at the side seam. Match side seams of coat and lining and continue basting as close as possible to the side seam and then across the bottom towards the front approximately 4 inches from piped bottom edge of coat.	Hand or 301	Hopper			
51	Join lining at center back. Finished appearance. The lining shall be carefully joined at center back without gathers, puckers or pleats. The seam shall start and finish evenly. The folded edge of the center pleat, on the outside of the lining, shall be towards the left side. The center back seam of the lining shall be between the fold.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
51	Join lining at center back. (cont'd)					
	a. Position the back parts of lining and join together at the center with a 3/8 inch seam.	301	SSa-1	12-16	A	A
52	Baste back lining to coat.					
	a. Fold the back lining, forming an approximately 1 inch wide pleat at the center back. Baste the back lining to the coat along the center pleat from the top end to approximately 4 inches from bottom finished edge of coat.	Hand or 301	Hopper			
	b. Baste back lining to coat starting at side seam and continuing approximately 3 inches from the armhole and shoulder edges.	Hand or 301	Hopper			
53	Hem bottom edge of lining.					
	Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The hem shall be 3/4 ± 1/8 inch wide. The lining securing straps shall be positioned on the side seam allowance of the lining with one edge even with the serged edge.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
53	Hem bottom edge of lining.					
	a. Hem the bottom edge of body lining with the raw edge turned under and with one end of the securing straps positioned and caught in the stitching 1/16 inch from the upper folded edge of hem.	301	EFb-1	12-16	A	A
54	Tack the lining securing straps to bottom of coat.					
	Finished appearance. The lining securing straps when tacked to the bottom edge of coat shall not cause twists or other distortions to either the coat or the lining. The end of the securing straps shall finish between the piping at bottom edge of coat and the side seam allowance. In the finished coat, the lining shall not be visible below the bottom edge of coat.					
	a. Position and securely tack the free end of the securing straps to the piping at the bottom edge of coat through the side seam allowance.	301	SSa-1	8-10	A	A
	b. Position the bottom edge of the lining so that in the finished coat, the opening shall not be visible below the bottom edge of coat. Fold the lining securing straps across the width and	301	OSf-1	6-10	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
54	Tack the lining securing straps to bottom of coat. (cont'd) stitch approximately 1/4 inch from the folded end in order to hold the lining in position.					
55	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of coat, starting at the bottom edge of the lining and continuing along the back and bottom edges of facing to the front edge of coat.	Hand		8-10	C (Silk)	
	b. Fell the folded edge of the facings to the piping along the top edge from collar notch to front edge of coat.	Hand		8-10	C (Silk)	
56	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front interlining at the armhole.					
	b. Trim back lining even at the neck.					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
57	Baste shoulder pad to coat.					
	a. Insert shoulder pads between interlining and chest padding of coat fronts. Securely tack the pad to the interlining and chest padding only.	Hand or 301	Hopper			
58	Seam shoulders.					
	Finished appearance. The shoulder seam shall finish without a distorted appearance.					
	a. Join the back to the fronts at the shoulder with a 3/8 inch seam, working in the fullness on the backs in accordance with good manufacturing practice.	301	SSa-1	12-16	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulder short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
59	Set shoulder straps.					
	Finished appearance. The shoulder straps shall be uniformly stitched to the coat without twists, puckers, pleats or other					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
59	Set shoulder straps. (cont'd) distortion. On the finished coat, the straps, including the piping, shall be 2-1/2 ± 1/8 inches wide at the armhole seam and shall taper to 1-3/4 ± 1/8 inches at the center of the insignia button. a. Position the shoulder straps with the back edge 3/8 to 1/2 inch to the back of the shoulder seam at the armhole and with the rounded end of the straps, on the finished coat, to be 1/4 to 3/8 inch from lower edge of collar.					
	b. Seam shoulder strap to the coat at the front and back edges and around the collar end as close as possible to, but not on top of, the stitching for the piping. Trim the shoulder strap even with the armhole, where necessary.	301	SSa-1	12-16	A (Silk)	A
60	Attach shoulder strap buttons. a. Mark location for attaching a 27-line insignia button, with ring toggle, to each shoulder strap.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
60	Attach shoulder strap buttons. (cont'd)					
	b. Punch a hole at mark through shoulder strap and fronts only, insert shank of insignia button through hole and attach ring toggle. In the finished coat, the center of the insignia button shall be 3/4 to 7/8 inch from rounded end of shoulder strap.					
61	Baste shoulder.					
	a. Position the front lining and coat front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn coat on the inside.	Hand or 301	Hopper			
62	Baste back lining and facing-lining assembly at shoulders.					
	a. Turn under and lap the shoulder edge of back lining on the facing-lining assembly. Baste lining to coat along the folded edge of the back lining with the top end of the chest pleat caught in the basting.	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
63	Seam neckline with a size label and coat hanger. Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label shall be positioned between the ends of the coat hanger and the ends of the coat hanger shall be positioned so that in the finished coat, the hanger opening shall be 2 to 2-1/2 inches long when measured on the outer edge and along the lower edge of the collar lining.					
	a. Join facings and back lining to coat at the neckline, from collar notch to collar notch, with a 1/4 inch seam and with the upper edge of the size label and the ends of the hanger positioned and caught in the stitching at the inside center back.	301	SSa-1	12-16	A	A
64	Make buttonholes. Finished appearance. The buttonholes shall be cut-first type, well made and well worked over gimp to fit 40-line insignia buttons. The stitching of the buttonhole shall be securely caught in the basic material. The gimp and thread shall be pulled through to the underside					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
64	Make buttonholes. (cont'd) of the coat. The purling of the buttonhole shall be on the outside of the fronts. The inside edge of the eyelet end of the buttonholes shall be 5/8 inch from the front piped edge of the coat. a. Mark the left front for the location of seven buttonholes. The marks for the top and bottom buttonholes shall be in accordance with the patterns. The marks for the remaining five buttonholes shall be evenly spaced.					
	b. Make one horizontal eyelet-end square-bar type buttonhole, cut 1-1/4 inches long, at each of the marks.	Buttonhole		60 per button-hole (not including bartack)	B (Silk)	F
	c. Securely bartack the end of each buttonhole, catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bartack		21 per bartack	A (Silk)	A
65	Set collar with lining. Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
65	Set collar with lining. (cont'd)					
	a. Mark the neckline on the outside 1/2 inch from collar notch up to the shoulder seam and gradually to within 1-1/4 to 1-3/8 inches at the center back for proper position of collar.					
	b. Position the collar with the lower edge lapped on the outside top edge of the coat at the mark.					
	c. Seam the collar from end to end, to the coat, as close as possible to, but not on top of, the stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining.	301	LSa-1	12-16	A (Silk)	A
66	Set sleeves.					
	Finished appearance. The armhole sleeve seam shall finish without twists, gathers, puckers or pleats.					
	a. Position sleeve on outside of coat at the armholes, with backarm seam of sleeve matching the side back seam and with notch in top sleeve and front matching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
66	Set sleeves. (cont'd)					
	b. Join the sleeve to the coat with a 3/8 inch seam, distributing the fullness in accordance with good manufacturing practice and catching the end of the shoulder strap in the stitching.	301	SSa-1	12-16	A	A
	c. Notch armhole seam allowance on back and front adjacent to each side of shoulder strap.					
	d. Press the entire armhole smooth and flat with a heated pressing iron to remove fullness, exercising care not to stretch the armhole. Spread open the upper part of the armhole sleeve seam (except at the shoulder strap area) from backarm seam of sleeve to approximately midway between shoulder seam and notch at front edge of armhole and press smooth and flat with a heated pressing iron.					
	e. Fold the excess material at armhole pit up to the line of stitching of the armhole sleeve seam, forming a hinge effect. The fold shall extend from the armhole notch to approximately 4 inches from the backarm seam.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
66	Set sleeves. (cont'd)					
	f. Press the fold smooth and flat with a heated pressing iron.					
67	Baste linings at armhole and shoulder.					
	a. Baste back and front linings to the coat around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing the fullness evenly. Turn the coat on the outside.	Hand or 301	Hopper			
68	Baste armhole.					
	a. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of the sleeve to the notch in the fronts.	Hand or 301	Hopper			
69	Set underarm shields.					
	a. Baste or tack underarm shields at the base of armhole.	Hand or 301				
70	Stitch sleeve head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
70	Stitch sleeve head pads and linings at armhole. (cont'd)					
	a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam and with the one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole-sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.	301	SSa-1	4-6	24/4	24/4
71	Tack underarm shields to lining.					
	Finished appearance. The tacking for the underarm shields shall finish approximately 1/2 inch from the seamed edges.					
	a. Tack the underside of the underarm shields to body lining along the side and bottom edges.	Hand		4-6	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
72	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (Silk)	
73	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve lining matching.					
	b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge approximately 1-1/2 inches in front of the forearm seam to the side seam line.	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
73	Fell sleeve lining at armhole.					
	-or-					
	c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operation 73.b above.	301	SSa-1	12-16	A	A
	-or-					
	d. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling. NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.	Machine		8-10	C (Silk)	
74	Sew hook and eye to collar. Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at the front of collar without misalignment.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
74	Sew hook and eye to collar. (cont'd)					
	a. Position and securely sew the hook to the right end and the eye to the left end of the collar. The hook and eye shall be positioned with their front edges even with the respective front ends of the collar and securely sewn to the collar at the top and bottom edge of the hook and eye. The stitching on each side shall not be more than 3/8 inch from the front end of the collar through the individual holes at the rear of the hook and eye.	Hand		16 per hook 16 per eye	C (Silk)	
75	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (Silk)	
	b. Turn under and fell the lower edge of the collar lining to the coat from end to end, catching the turned under portion in the felling.	Hand		8-10	C (Silk)	
	c. Turn under and position the folded edge of the lining under the hook and over the eye. Fell the folded edge of lining to ends of collar up to the stitching joining lining to the collar.	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
75	Finish collar. (cont'd)					
	d. Position the collar tab on the inside of collar at the left end with the rounded end of tab extending approximately 3/4 inch beyond the front end of collar. Fell top, back and bottom raw edges of tab to collar lining. Stitch and backstitch the front end of tab approximately 1/4 to 3/8 inches from the eye.	Hand		8-10	C (Silk)	
76	Clean coat.					
	a. Pull any basting thread, trim and remove any loose ends of thread. Remove any spots, stains and tickets without injury to the material.					
	b. Buttonholes at front closure shall be examined for exposure of coat front interlining cloth. The exposed interlining shall be colored with a reddish indelible ink.					
77	Press coat.					
	a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
77	Press coat. (cont'd) b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. c. Press the entire collar smooth and flat. d. Press the fronts on a body machine, shrinking and properly shaping the chest. e. Press the sides, working the fullness towards the back. f. Press the back smooth and flat, removing all fullness. g. Press the sleeves smooth and flat, without injury to the buttons on the ornamental sleeve cuffs, creasing at the backarm and forearm seam. The backarm crease shall be on the backarm seam. The forearm and backarm crease shall extend uniformly from the bottom end of sleeve to a point approximately 4 inches below the base of armhole.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
77	Press coat. (cont'd) h. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine and press the shoulder strap flat. i. Press the armholes solid from the inside, creasing the armholes at the front and creasing the excess material at the armpit. The armpit and back of the armhole shall be held short while pressing. j. Block the armholes on a pressing buck, shrinking the top sleeves. k. Press lower edge of coat smooth, flat and even. l. Press body lining throughout, removing all wrinkles and creases. Press the lining pleats smooth and flat. m. Remove all gloss marks. n. Remove any wrinkles and creases missed by previous press operations.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
78	Mark for buttons on right front. (cont'd) a. Mark the location for sewing seven 40-line insignia buttons to the right front of the coat to properly engage with the buttonhole of the left front. The mark for top button shall be in line with right front end of collar and remaining buttons shall be in vertical alignment with top mark.					
79	Sew on buttons. a. Sew one 40-line insignia button at each of the marks on the right front through all plies. b. The insignia buttons on the front shall be sewn with the head of the eagle upright.	Hand		8 per button, (double thread)	24/4	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II. Coat measurements. 1/

Size	Breast 2/	Back length 3/	Sleeve length 4/
		Short	
	inches	inches	inches
34	35	28-3/4	18-1/2
35	36	28-7/8	18-1/2
36	37	29	18-1/2
37	38	29-1/8	18-1/2
38	39	29-1/4	18-1/2
39	40	29-3/8	18-1/2
40	41	29-1/2	18-1/2
41	42	29-5/8	18-1/2
42	43	29-3/4	18-1/2
44	45	30	18-1/2
46	47	30-1/4	18-1/2
		Regular	
	inches	inches	inches
34	35	29-3/4	19-1/2
35	36	29-7/8	19-1/2
36	37	30	19-1/2
37	38	30-1/8	19-1/2
38	39	30-1/4	19-1/2
39	40	30-3/8	19-1/2
40	41	30-1/2	19-1/2
41	42	30-5/8	19-1/2
42	43	30-3/4	19-1/2
44	45	31	19-1/2
46	47	31-1/4	19-1/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table II. Coat measurements. 1/ Continued.

Size	Breast 2/	Back length 3/	Sleeve length 4/
		Long	
	inches	inches	inches
34	35	30-3/4	20-1/2
35	36	30-7/8	20-1/2
36	37	31	20-1/2
37	38	31-1/8	20-1/2
38	39	31-1/4	20-1/2
39	40	31-3/8	20-1/2
40	41	31-1/2	20-1/2
41	42	31-5/8	20-1/2
42	43	31-3/4	20-1/2
44	45	32	20-1/2
46	47	32-1/4	20-1/2
		Extra Long	
	inches	inches	inches
34	35	32-1/4	21-1/2
35	36	32-3/8	21-1/2
36	37	32-1/2	21-1/2
37	38	32-5/8	21-1/2
38	39	32-3/4	21-1/2
39	40	32-7/8	21-1/2
40	41	33	21-1/2
41	42	33-1/8	21-1/2
42	43	33-1/4	21-1/2
44	45	33-1/2	21-1/2
46	47	33-3/4	21-1/2

1/ Tolerance for all measurements shall be ± 3/8 inch.

2/ Breast measurement shall be taken with coat buttoned, from folded edge to folded edge, in line with the pit of the armhole; multiply by 2.

3/ Back length measurement shall be taken along the center back from 3/4 inches above the lower edge of the collar to piped bottom edge of the coat.

4/ Sleeve length measurement shall be taken along the forearm seam from the pit of the armhole to the bottom edge of the sleeve.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified, in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure that supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements; however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.4)

b. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in Table III.

4.4 First article inspection. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.5.2.1 through 4.5.2.5. The presence of any defect or failure to pass any test shall be cause for rejection of the first article. The number of units to be inspected shall be specified by the contracting officer (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.5 Quality conformance inspection.

4.5.1 Component and material inspection. In accordance with 4.1 above, components and materials shall be tested in accordance with all the requirements of the referenced specifications, figures, and standards, unless otherwise excluded, amended, modified, or qualified in this specification, or applicable purchase order. In addition to the testing provisions contained in subsidiary specifications, figures, and standards, testing shall be performed on the components listed in Table III for the characteristics noted.

4.5.1.1 Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following (the lot shall be unacceptable if one or more sample units fail to meet any test requirement specified herein):

Lot size (lot unit)	Sample size (sample unit)
800 or less	2
801 through 22,000	3
22,001 and over	5

The unit for expressing lot sizes and sample units for testing each component shall be in accordance with applicable subsidiary specifications and as follows:

Component for testing	Lot sizes expressed as:	Sample unit
Hook and eye	100 each	2 each

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. Det. Per S/Unit	Results reported as:
Hook and Eye	Material identification 1/	3.3.16	Std Comm'l	1	Pass or fail
	Finish		Std Comm'l	1	Pass or fail
	Finish		4.3.3	1	Pass or fail

1/ Certificate of compliance.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.5.1.2 In process inspection. Inspections shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.2 Examination of the end item. The end item shall be examined for the defects listed in 4.5.2.2 through 4.5.2.5 The sample unit shall be one completely fabricated coat.

4.5.2.1 Classification of defects. All defects shall be classified as indicated below, except those numbered 1 through 99 in the classification column, which shall be classified as follows:

Major defect - When seriously affecting appearance or serviceability.

Minor A defect - When not seriously affecting appearance or serviceability.

4.5.2.2 General defects. General defects shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes	a. One or more omitted, added or wrong type.	101		
	b. Not corresponding to size of button:			
	- too small, not permitting button to enter buttonhole.	102		
	- too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		201	
	c. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	103		
	d. Bartack missing or loose on:			
	- one buttonhole.		202	
	- two or more buttonholes.	104		
	e. Bartack misplaced, not serving intended purpose on:			
	- two or more buttonholes.		203	
	- one buttonhole.			301

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes (cont'd)	f. One or more broken stitches in:			
	- one buttonhole.	105		
	- two or more buttonholes.		204	
	g. More than 2 skipped stitches in:			
	- one buttonhole.			302
	- two or more buttonholes.		205	
	h. Ragged edges, affecting appearance; or exposed interlining not colored with reddish indelible ink as specified.			303
	i. Any uncut buttonhole.		206	
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		207	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified:			
	- one or two stitches.			304
	- three or more stitches.		208	
	l. One or more buttonholes finished with purling on the underside.	106		
Buttons or ring toggles	a. One button or ring toggle missing, loose, defective, or improper size or type.		209	
	b. Two or more buttons or ring toggles missing, loose, defective, or of improper size or type.	107		
	c. One or more buttons attached with the head of the eagle in other than an upright position.			305

NOTE: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; unsound soldering; scratches; dents; blemishes, or imbedded foreign matter; loose shanks; or are poorly plated or badly shaded.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Cleanness	a. One or more spots or stains of a permanent nature clearly noticeable:			
	- on the outside.	108		
	- on the inside.		210	
	b. One or more removable spots or stains clearly noticeable:			
	- on the outside.		211	
	- on the inside.			306
	c. Thread ends not trimmed throughout garment, one or more bastings not removed, or two or more shade tickets not removed.			307
Components and assembly	a. Any component part or required operation omitted (unless otherwise classified herein).	1		
Cutting	a. Any component part of basic wool material not cut in accordance with the directional lines on patterns; or in accordance with specification requirements.	109		
	b. Piping material cut on the bias.		212	
	c. Any lining part not cut in accordance with the directional lines on the patterns; or in accordance with specification requirements.		213	
Hook and eye	a. Not specified type or size.		214	
	b. Hook or eye not securely tacked to the ends of the collar.		215	
	c. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hooks and eyes are fastened.		216	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Material defects and damages	a. Any weakening defect such as smash, multiple float, or loose slub.	2		
	b. Any hole.	3		
	c. Shade bar, unsightly slub, etc., affecting appearance:			
	- on outside.	4		
	- on inside.		217	
	d. Scissors or knife cut, tear, mend, or burn.	5		
	e. Needle chews that may develop into a hole.	6		

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have a negligible affect on serviceability are to be classified as follows:

Material defect - No defect

Workmanship damages - Minor B defect

Pressing	a. Burned or scorched.	7		
	b. Pressing of the entire garment omitted.		218	
	c. Armhole stretched.	8		
	d. Poorly pressed (unless otherwise indicated).			308
	e. Basting or pressing impressions not removed on a major portion of the coat.		219	
	f. Gloss not removed on a major portion of the coat.			309
	g. Armholes not blocked or poorly blocked, affecting appearance.		220	
	h. Edges bulky; i.e., not pressed solid, affecting appearance.		221	
	i. Inside of armhole not creased as required.		222	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Pressing (cont'd)	j. Sleeve not creased at the front or backarm seam.		223	
	k. Wrinkles or pressing impressions not removed from under pocket flap, side, or center back seam allowance.		224	
	l. Linings not pressed smooth.		225	
	m. Armhole seam not pressed open across the top as required.		226	
Seams and stitching	a. Accuracy of seaming:			
	1. Any seam twisted, puckered, or pleated, affecting appearance.	110		
	2. Part of the garment caught in any unrelated operation or stitching.	9		
	3. Unsightly hand felling or blindstitching exposed on the outside of the coat, affecting appearance.		227	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.			310
	5. Wrong color of thread or two shades of thread used on outside of coat, affecting appearance.	10		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular; i.e., unevenly gaged; or various stitchings not uniform, affecting appearance.		228	
	2. Beyond range of width specified or varies by more than 1/16 inch when no range is specified.			311
	c. Open seams:			
	1. On outside:			
	- up to 1/4 inch inclusive.			312
	- more than 1/4 inch but not more than 1/2 inch.		229	
	- more than 1/2 inch.	111		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	2. On inside:			
	- up to 1/2 inch inclusive (except machine felling).		230	
	- more than 1/2 inch (except machine felling).			313
	- up to 1 inch inclusive (machine felling).			314
	- more than 1 inch (machine felling).		231	

NOTE: One or more broken stitches, or two or more continuous, skipped, or runoff stitches shall constitute an open seam.

d. Raw edges:			
1. On outside:			
- up to 1/8 inch inclusive.			315
- more than 1/8 inch but not more than 1/4 inch.		232	
- more than 1/4 inch.	112		
2. On inside:			
- more than 1/8 inch but not more than 1/4 inch.			316
- more than 1/4 inch.		233	

NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.

e. Runoffs (see classification of open seams).			
f. Stitch tension:			
1. Loose tension resulting in a loose seam.	113		
2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		234	
3. Tight tension (stitches break when normal strain is applied).	114		

NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test the seam by exerting pull in lengthwise direction of seam.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	g. Stitches per inch (excluding labels) less than minimum specified:			
	- one or two stitches.			317
	- three stitches.		235	
	- four or more stitches.	115		
	h. Wrong stitch or seam type.		236	
	i. Stitching skipped or broken (on edge or raised stitching when seam is seamed, turned and stitched).		237	
	- 1/4 inch or more, but not more than 1/2 inch.			318
	- more than 1/2 inch.		238	
Shaded parts	a. Any outside part shaded.	11		
	b. Any lining part badly shaded except sleeve lining.		239	
	c. Sleeve lining parts badly shaded, or parts not matching each other.			319

NOTE: To be scored only if the condition exists on a major portion of seam.

4.5.2.3 Detailed defects (outside of coat). Detailed defects on the outside of coat, with coat buttoned on a form or spread out on a table, shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Collar (construction and setting)	a. Interlining omitted.	116		
	b. Interlining tight or twisted, causing puckers on the collar, affecting appearance.		240	
	c. Tight at joining to front or back, causing puckers or pleats at the neck of the coat, affecting appearance.	12		
	d. Piping irregular, affecting appearance.		241	
	e. Collar ends overlapping when fastened.		242	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar (construction and setting)	f. Collar ends spread open more than 3/8 inch when fastened.		243	
	g. Front finished ends of the collar uneven in width by 3/16 inch or more.		244	
Alignment of front buttons and buttonholes	a. Not aligned, causing a noticeable bulge or twist on the fronts when buttoned, affecting appearance.		245	
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by:			
	- more than 1/8 inch but not more than 1/4 inch.		246	
	- more than 1/4 inch.	117		
	b. Left front at corner longer than right front by:			
	- more than 1/4 inch but not more than 3/8 inch.			320
	- more than 3/8 inch.		247	
	c. Right front at corner exposed beyond the bottom edge of the left front by more than 1/8 inch.		248	
Shoulder (construction)	a. Improperly joined or set, causing the shoulders or back to twist.	13		
Shoulder pads	a. Not completely caught in the armhole tacking.		249	
	b. Misplaced or not serving intended purpose; i.e., too far back or too far forward.		250	
	c. One or both pads omitted.		251	
Shoulder straps	a. Misplaced, i.e., one strap further forward or back from position of other loop, affecting appearance.		252	
	b. Strap stitched to coat too full or twisted, affecting appearance.		253	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Shoulder straps (cont'd)	c. Poorly shaped.			321
	d. Shoulder seam exposed beyond back edge of shoulder strap (except rounded end).		254	
	e. Width of shoulder strap at armhole seam (including piping):			
	- less than 2-1/4 inches but not less than 2-1/8 inches.			322
	- more than 2-1/2 inches but not more than 2-5/8 inches.			323
	- less than 2-1/8 inches or more than 2-5/8 inches.		255	
	f. Width of shoulder strap across center of insignia button (including piping):			
	- less than 1-5/8 inches but not less than 1-1/2 inches.			324
	- more than 1-7/8 inches but not more than 2 inches.			325
	- less than 1-1/2 inches or more than 2 inches.		256	
	g. Rounded end of shoulder strap positioned less than 1/4 inch or more than 3/8 inch from collar edge.			326
	h. Piping irregular in width, affecting appearance.		257	
	i. Buttons not uniformly set from collar edge by more than 1/4 inch.		258	
	j. Center of buttons less than 3/4 inch or more than 7/8 inch from rounded end of strap (including piping).			327
Armholes (construction)	a. Badly stretched, affecting appearance.	14		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	15		
	c. Crooked seam, affecting appearance.		259	
	d. Tape stitching exposed and visible on outside surface.			328

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Armholes (construction) (cont'd)	e. Sleeve head pads not completely tacked to armholes; or misplaced, not serving intended purpose.		260	
	f. One or both sleeve head pads omitted.		261	
Sleeves	a. Setting and hang:			
	1. Sleeve fullness misplaced, affecting appearance.		262	
	2. Backarm seam of the sleeve not matching side back seam by:			
	- more than 1/4 inch but not more than 1/2 inch.		263	
	- more than 1/2 inch.	118		
	3. Hang of sleeves on the same coat in opposite direction by more than 2 inches.		264	
	4. Sleeve tight in armhole (roll effect not present).		265	
	b. Sleeve lining:			
	1. Twisted, tight, or short, causing bulge, twists, or puckering on outside of sleeves.	16		
	2. Sleeve lining too long, causing lining to sag at the bottom more than 1/2 inch.			329
	3. Sleeve lining seams out of alignment by more than 3/4 inch with sleeve seams at armholes or at bottom of sleeves.			330
	c. Construction of sleeves:			
	1. Tacking on bottom turnup to body of sleeve omitted or insecure.		266	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			331
	3. Tacking on 1 or both sleeve lining seams to sleeve seams omitted; or insecure.			332

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from the bottom edge of sleeve.			333
	d. Sleeve cuffs:			
	1. Piping irregular, affecting appearance.		267	
	2. Top edge of top sleeve part poorly shaped, affecting appearance.		268	
	3. Height of pointed end on both sleeves varying in length by more than 1/4 inch.		269	
	4. Sleeve puckered at joining of cuff, affecting appearance.		270	
	5. Cuff puckered or twisted at joining to sleeve affecting appearance.		271	
	6. Ends of cuff staggered at backarm seam by:			
	- 1/8 inch or more but not more than 1/4 inch.			334
	- more than 1/4 inch.		272	
	7. Height of cuff at point on top sleeve including piping:			
	- less than 5-3/4 inches but not less than 5-1/2 inches or more than 6-1/4 inches but not more than 6-1/2 inches.			335
	- less than 5-1/2 inches or more than 6-1/2 inches.		273	
	8. Height of cuff at backarm or front creased edges including piping:			
	- less than 3 inches but not less than 2-3/4 inches or more than 3-1/2 inches but not more than 3-3/4 inches.			336
	- less than 2-3/4 inches or more than 3-3/4 inches.		274	
	9. Point of cuff not centered between the lower forearm creased edge and the creased backarm seam of sleeves by			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	more than 1/4 inch.		275	
	10. Position of buttons on sleeve cuffs: - horizontal alignment of buttons on one sleeve cuff not uniform with other sleeve cuff by more than 1/4 inch.			337
	- buttons on one or both sleeve cuffs out of vertical alignment by more than 1/8 inch.			338
Body (outside)	a. Fitting of body linings tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	17		
	b. Fitting of front interlining: 1. Tight, short, or twisted, causing fullness or twist on the outside of the coat, affecting appearance.	18		
	2. Too full, causing coat front to have a wavy appearance.	19		
	c. Chest and waist darts: 1. One or more darts not properly tapered, causing puckers or pleats at one or more ends, affecting appearance.		276	
	2. Cut edges of chest dart pressed toward front of coat.			339
	3. Folded edge of waist dart pressed toward front of coat.			340
Front and bottom edges	a. Front edge stretched, affecting appearance.		277	
	b. Piping set on tight, causing puckering on front, affecting appearance.		278	
	c. Front or bottom piping irregular, affecting appearance.		279	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Front and bottom edges (cont'd)	d. Bottom edge stretched, puckered, or uneven, affecting appearance.			341
	e. Bottom corner of left front poorly shaped, affecting appearance.		280	
	f. Left front rolling outward below bottom button.	20		
	g. Front edge irregular, affecting appearance.		281	
	h. Piping tight on bottom edge, causing puckering on outside of coat, affecting appearance.		282	
	i. Left front not dressed as specified.	119		
Front facings	a. Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.	21		
Back side panel seams	a. Curved panel seam on back of coats stretched or distorted, affecting appearance.		283	
Front buttonholes	a. Position from front edge, including piping, to inside edge of eyelets: - less than 1/2 inch but not less than 3/8 inch or more than 3/4 inch but not more than 7/8 inch.			342
	- less than 3/8 inch or more than 7/8 inch.		284	
	b. More than 1/4 inch from equal spacing.		285	
	c. Unevenly spaced from front edge by more than 3/16 inch.		286	
Front buttons (position and stitching)	a. Top button not in vertical alignment with right end of the collar by more than 1/8 inch.		287	
	b. Any front button out of vertical alignment by 1/4 inch or more.		288	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Front buttons (position and stitching)	c. Stitching not caught through front interlining on one or more buttons.			
	d. Stitching caught through front interlining but not through facing:			
	- one button			343
	- two or more buttons.		289	

4.5.2.4 Detailed defects (inside of coat). Detailed defects on the inside of the coat shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Labels	a. Any required label missing, incorrect, or illegible; or size label not securely caught in stitching.		290	
	b. Identification label not stitched on 4 sides.			344
	c. Bottom edge of identification label less than 3 inches, or more than 5 inches, from bottom edge of coat.			345
Hanger	a. Hanger omitted or ends not securely stitched.		291	
	b. Less than 1-7/8 inches or more than 2-1/8 inches long, measured along edge of collar lining.			346
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.			347
Front facings	a. Fullness or pleats on facings between buttons or buttonholes; or between front edge and buttons or buttonholes.			348
	b. Tacking on back edge to one or both interlinings:			
	- omitted.		292	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Front facings (cont'd)	- insecure or incomplete for a distance of more than 4-1/2 inches below the shoulder seam; or more than 4 inches above the bottom edge of coat.			349
	c. Felling at bottom edge of front or back edge of facing omitted or insecure on one or both facings.		293	
	d. Felling at top edge of facing omitted or insecure on one or both facings.		294	
Body lining	a. Excessive puckering or pleated.			350
	b. Twisted, not affecting smoothness on outside of coat.		295	
	c. One or both chest pleats on shoulders omitted.		296	
	d. Folded edge of one or both chest pleats facing front edge of coat.			351
	e. Pleat omitted at center of back lining.		297	
	f. Pleat less than 1/2 inch in depth at the center of the back lining.			352
	g. Bottom hem less than 5/8 inch or more than 7/8 inch.			353
	h. One or both lining securing straps at the bottom of the coat omitted or insecure.		298	
	i. Position of one or both lining securing straps more than 1 inch from side seam.			354
	j. One or both lining securing straps not folded and stitched.			355
	k. Lining too long; i.e., exposed beyond bottom edge of coat.		299	
Serging	a. Serging omitted on one or more seams where required.		201a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar extension tab	a. Omitted.		202a	
	b. Extending less than 1/2 inch or more than 1 inch from left end of collar.			356
	c. Insecurely felled; or felling not on four sides.			357

4.5.2.5 Finished measurements. Any measurement deviating from the nominal dimensions and tolerances specified in table II shall be classified as a size measurement defect. Sleeve length uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5.3 Examination of preparation for delivery requirements. An examination shall be made to determine compliance with packaging, packing, and marking requirements of section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container, fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery.

Examine	Defect
Marking (exterior and interior)	Omitted; incorrect; illegible; or improper size, location, sequence, or method of application.
Materials	Any component missing or damaged.
Workmanship	Inadequate application of components such as incomplete closure of case liners, container flaps, loose strapping, or inadequate stapling. Bulging or distortion of containers.
Content	Number of coats per container is more or less than required.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.6 Tests. Tests shall be in accordance with the following.

4.6.1 Metal composition. Chemical composition shall be determined in accordance with test method III of FED-STD-151.

4.6.2 Test for tackiness. At room temperature (60° F to 80° F) press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall be free when pressure is released.

5. PACKAGING.

5.1 Preservation. Unless otherwise specified, the coats shall be preserved in accordance with ASTM D 3951.

5.2 Packing. Coats preserved in accordance with 5.1 shall be packed in accordance with ASTM D 3951.

5.3 Marking. In addition to any special marking required by the contract or purchase order, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES.

(This section contains information of a general or explanatory nature that may helpful but is not mandatory.)

6.1 Intended use. The coats described herein are intended for wear by enlisted male personnel of the U.S. Marine Corps Band.

6.2. Acquisition requirements. Acquisition documents shall specify the following:

a. Title, number, and date of this specification.
b. Issue of DODISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.1).
c. Sizes required (see 1.2).
d. Whether first article is required (see 3.2).
e. Number of coats in first article (see 3.2).

6.3 Samples and shade samples. For information regarding availability of sample coats and of the standard shades specified (see 3.1 and 3.3), address inquiry to the procuring activity issuing the invitation for bids.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

6.4 First article. First article examination, test approval shall be as specified by the contracting offi (see 3.2).

6.5 Changes from previous issue. Marginal notatior used in this revision to identify changes with respect previous issue due to the extensiveness of the changes

6.6 Subject term (key word) listing.

Men's
Musician

Preparing
Navy
Project No

. and
.cer

is are not
. to the
.

Activity:
- MC
). 8405-N283

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

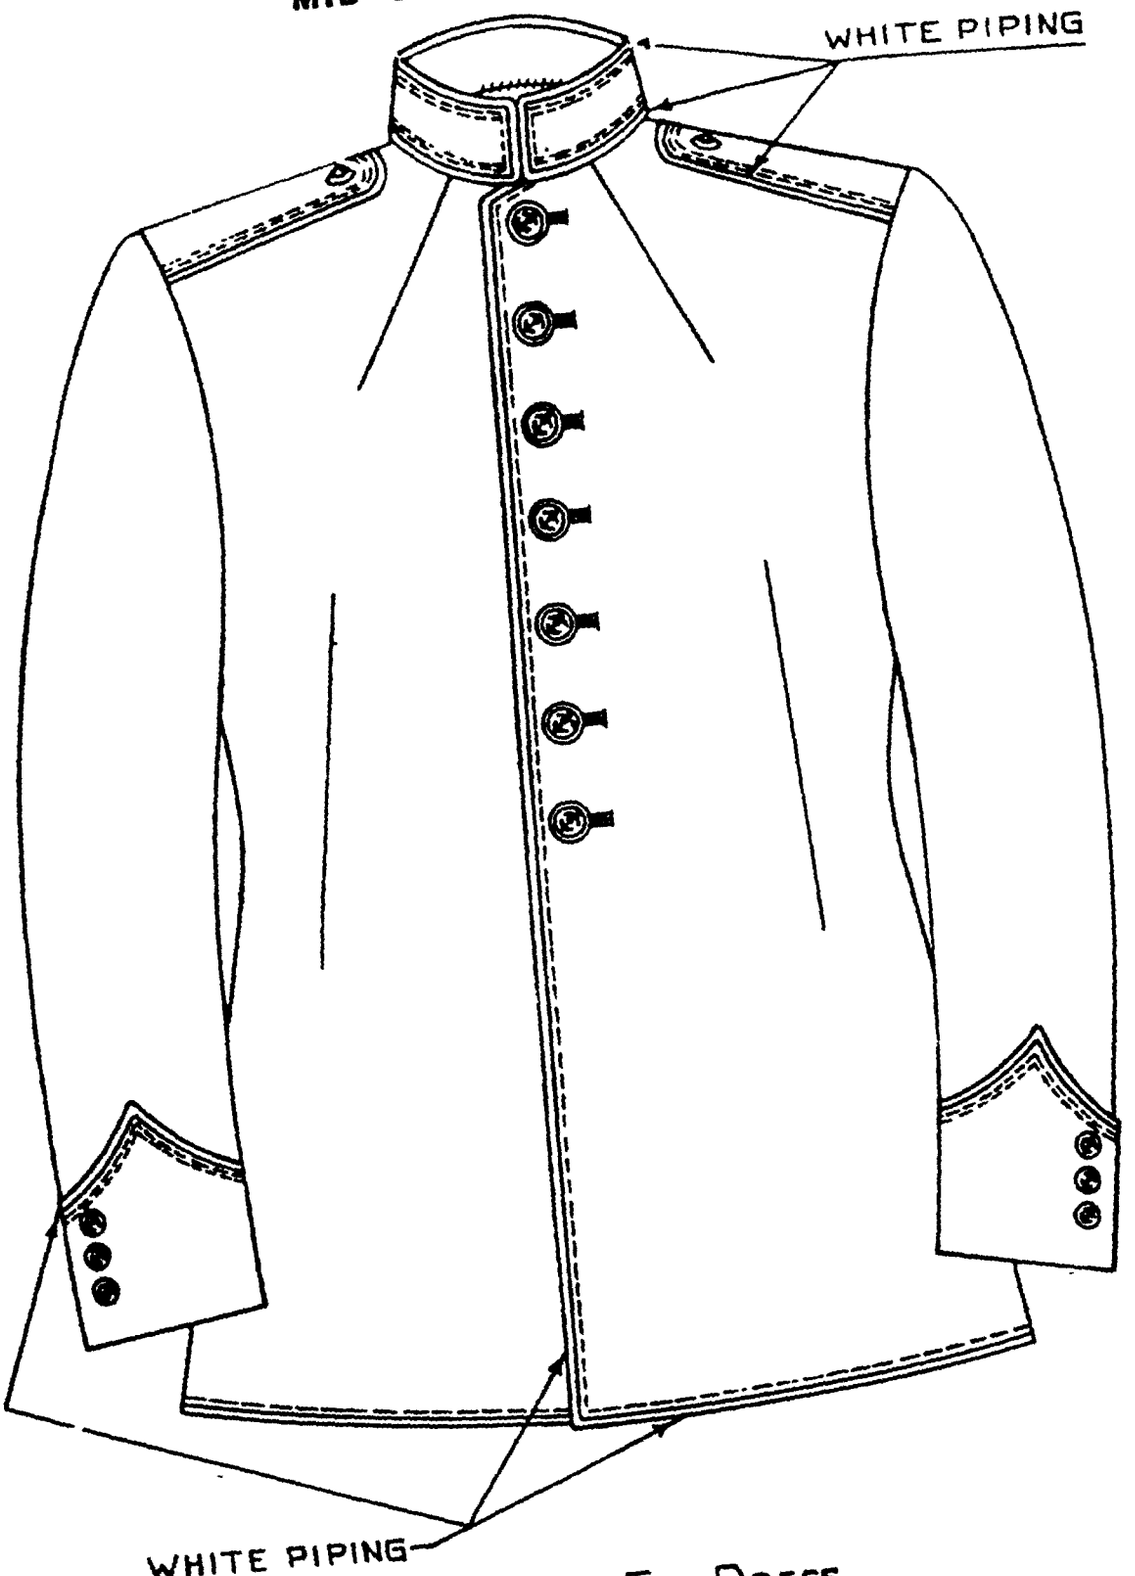


FIGURE 1. COAT, MAN'S: SPECIAL FULL DRESS, SCARLET; U.S. MARINE BAND; MUSICIANS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

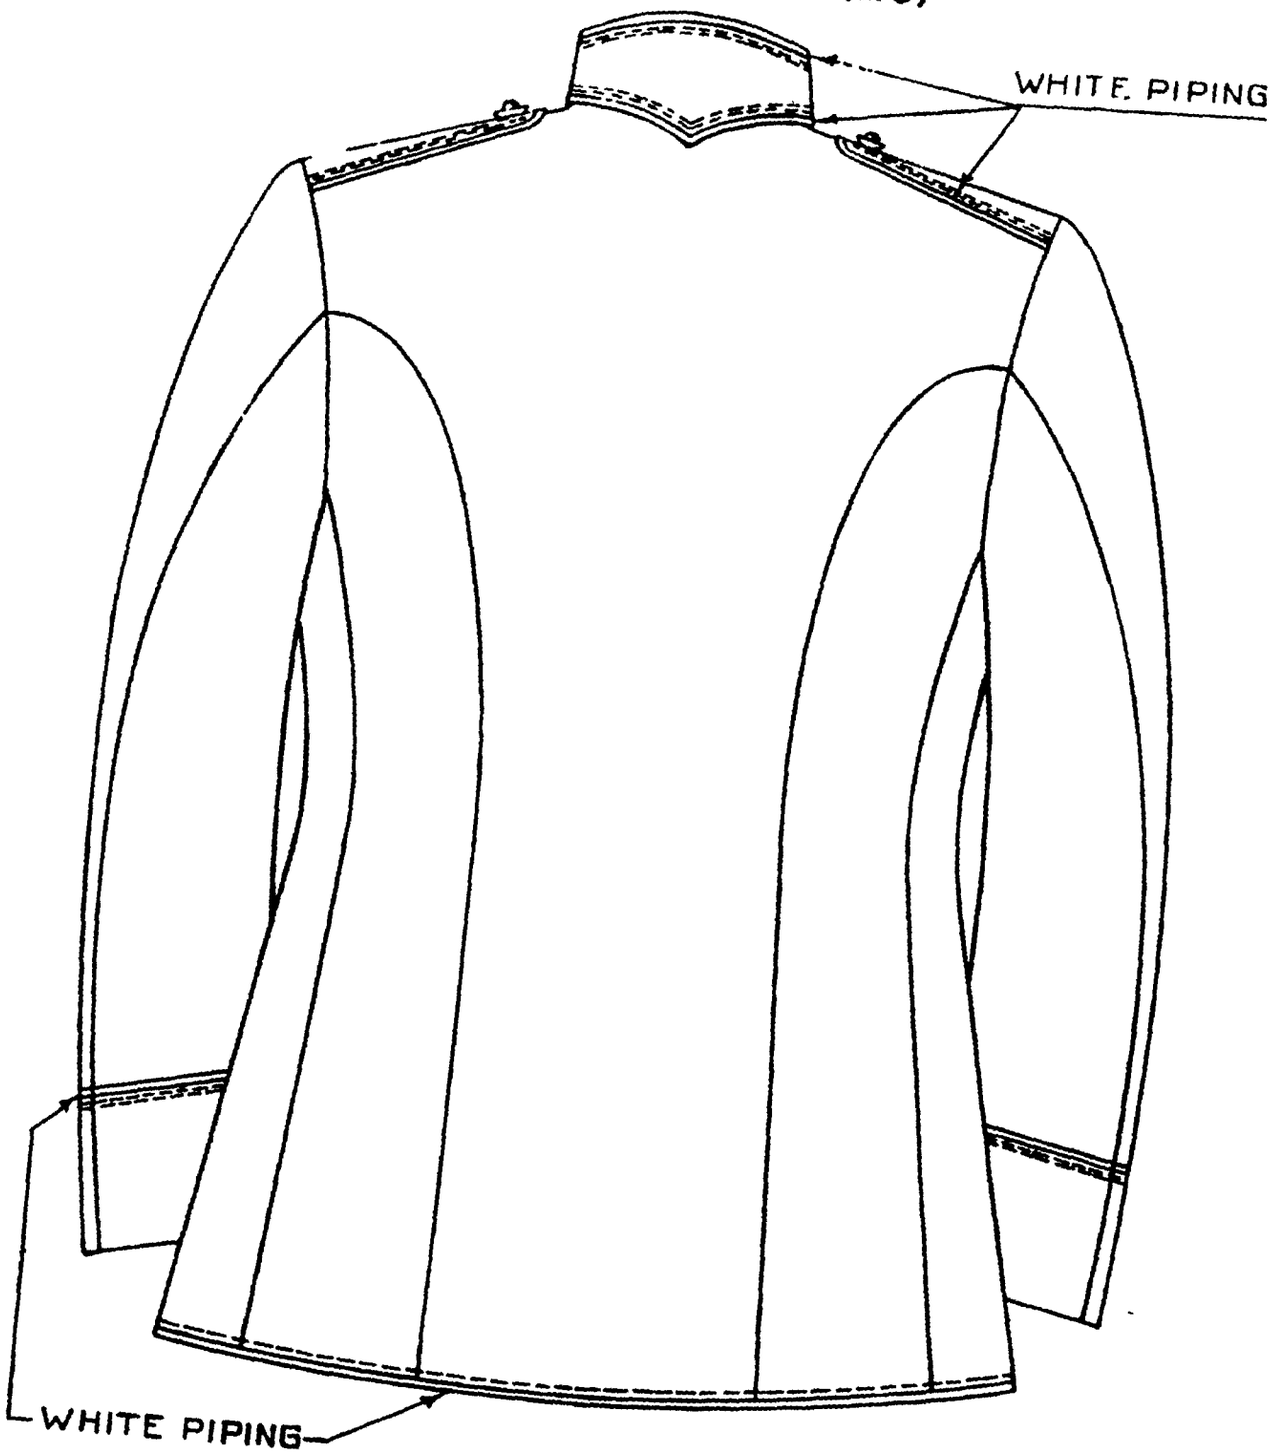


FIGURE 2. COAT, MAN'S: SPECIAL FULL DRESS; SCARLET; U.S. MARINE BAND; MUSICIANS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

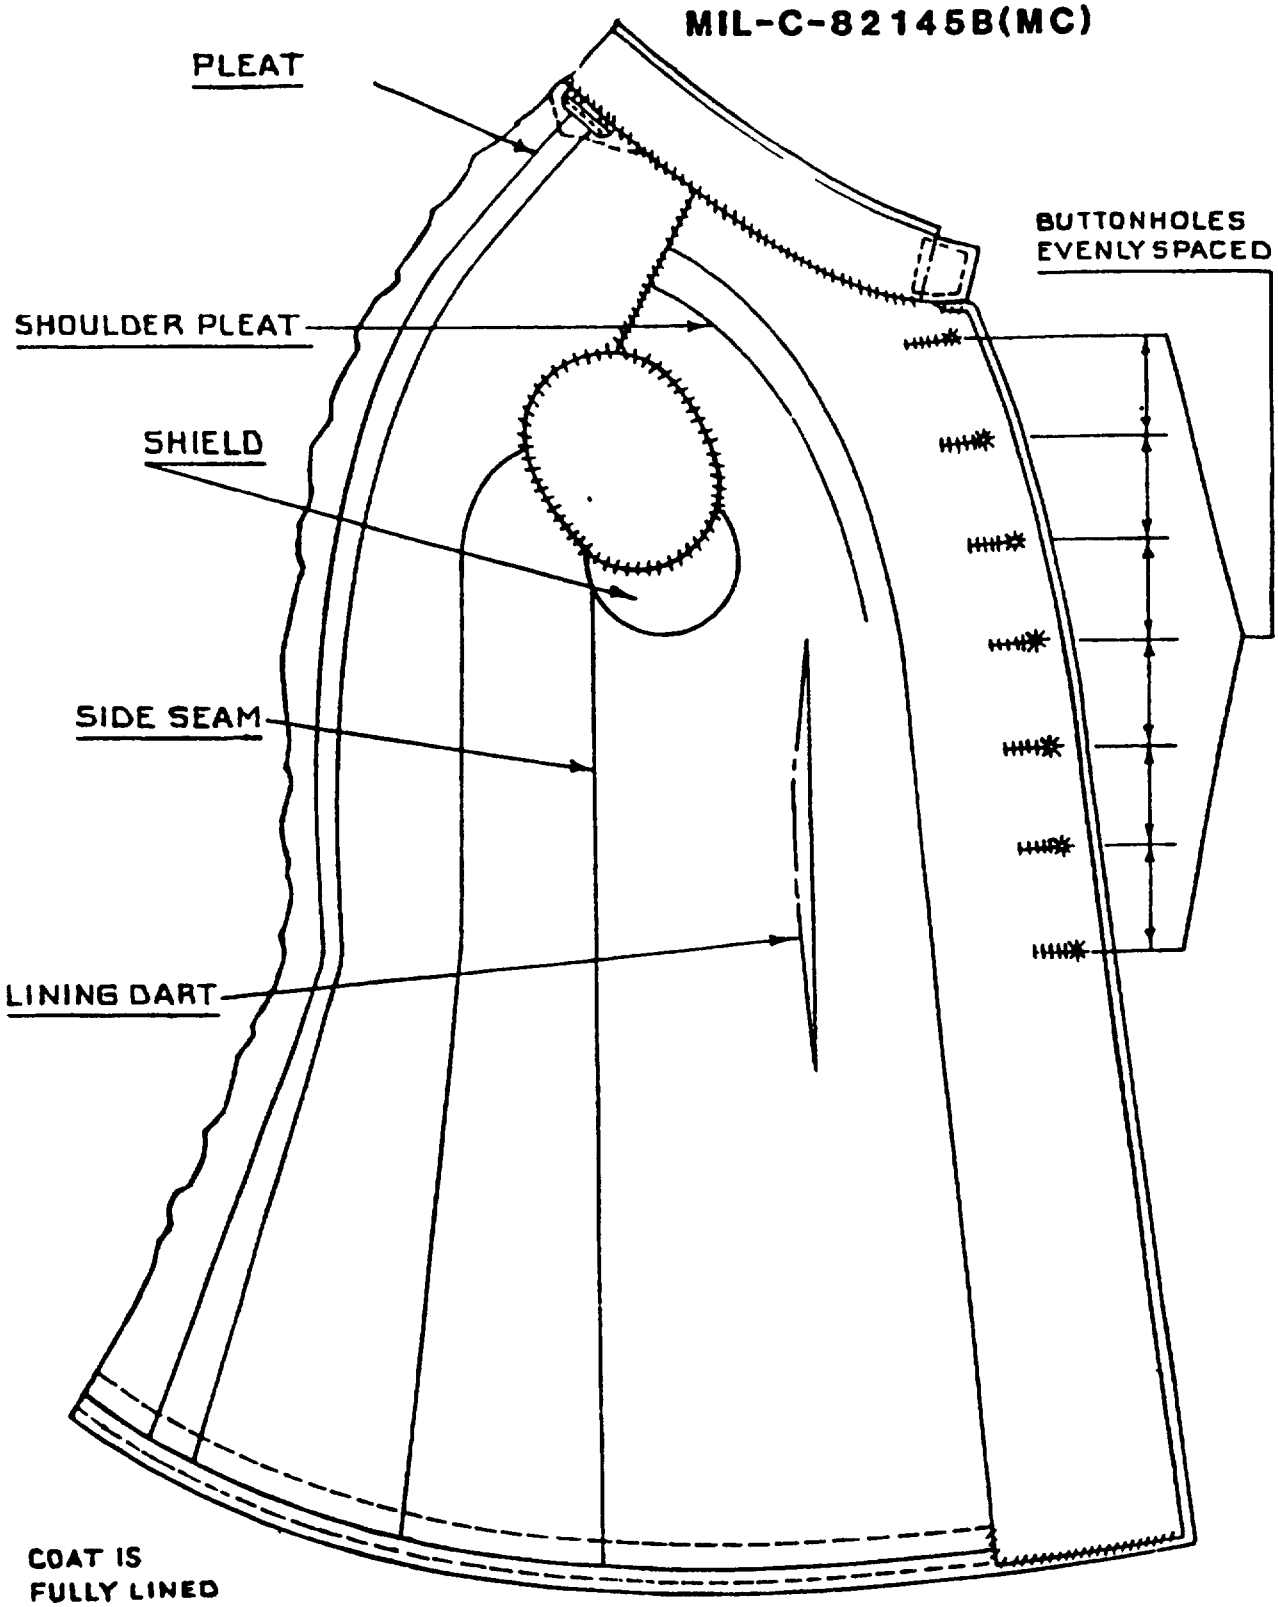


FIGURE 3. COAT, MAN'S. SPECIAL FULL DRESS: SCARLET; U.S. MARINE BAND; MUSICIANS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

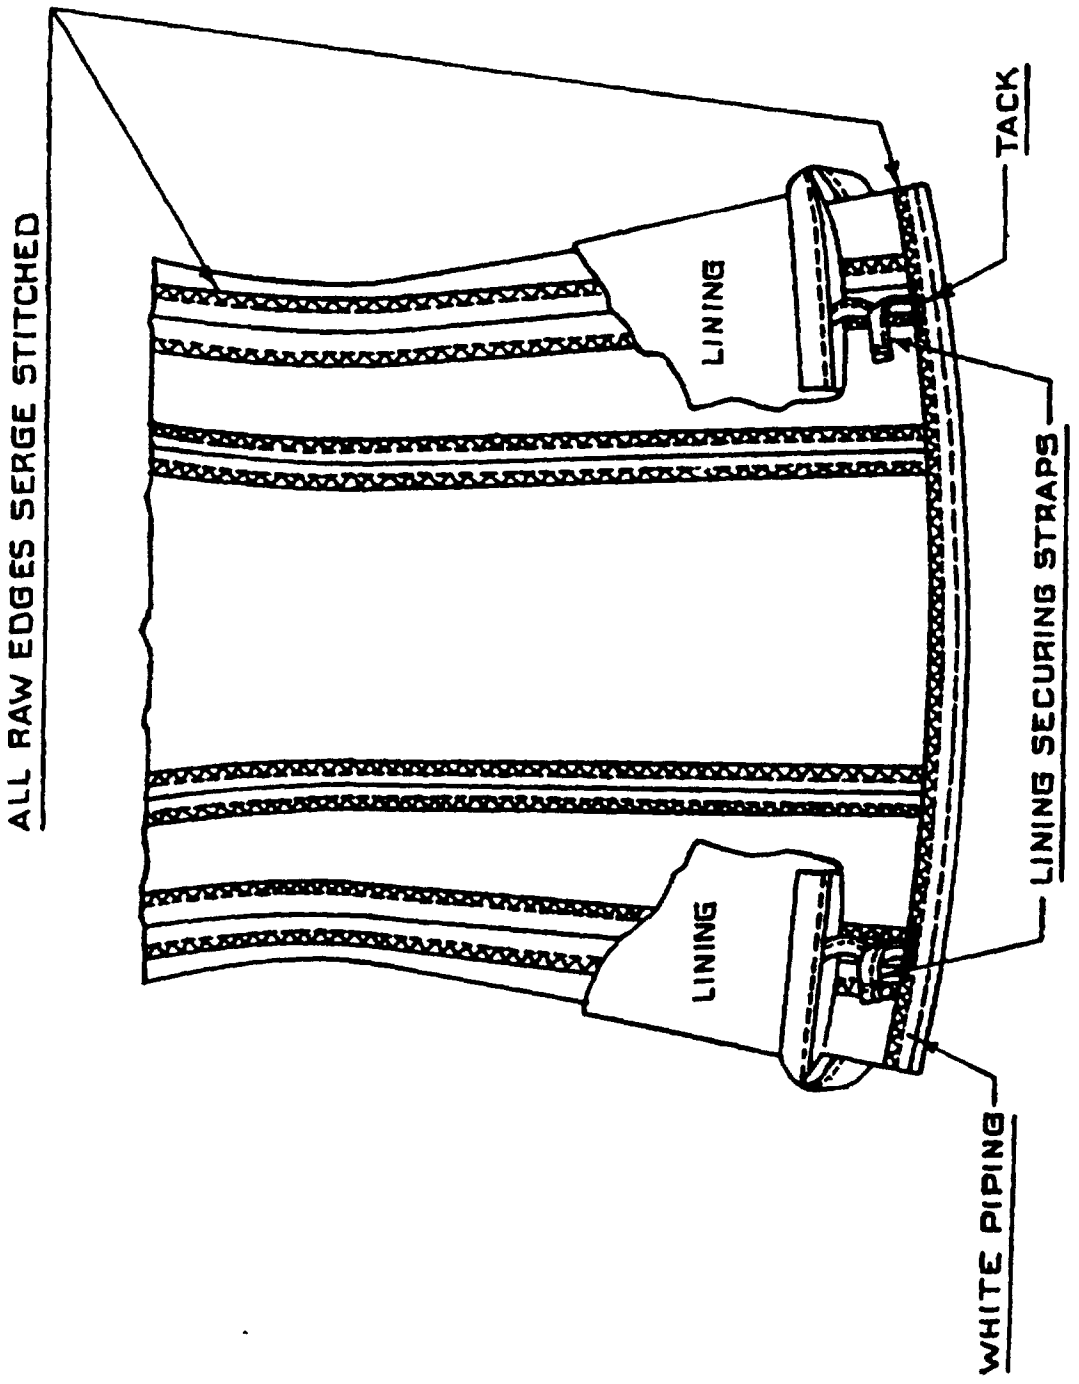


FIGURE 4. COAT, MAN'S: SPECIAL FULL DRESS: SCARLET; U.S. MARINE BAND; MUSICIANS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

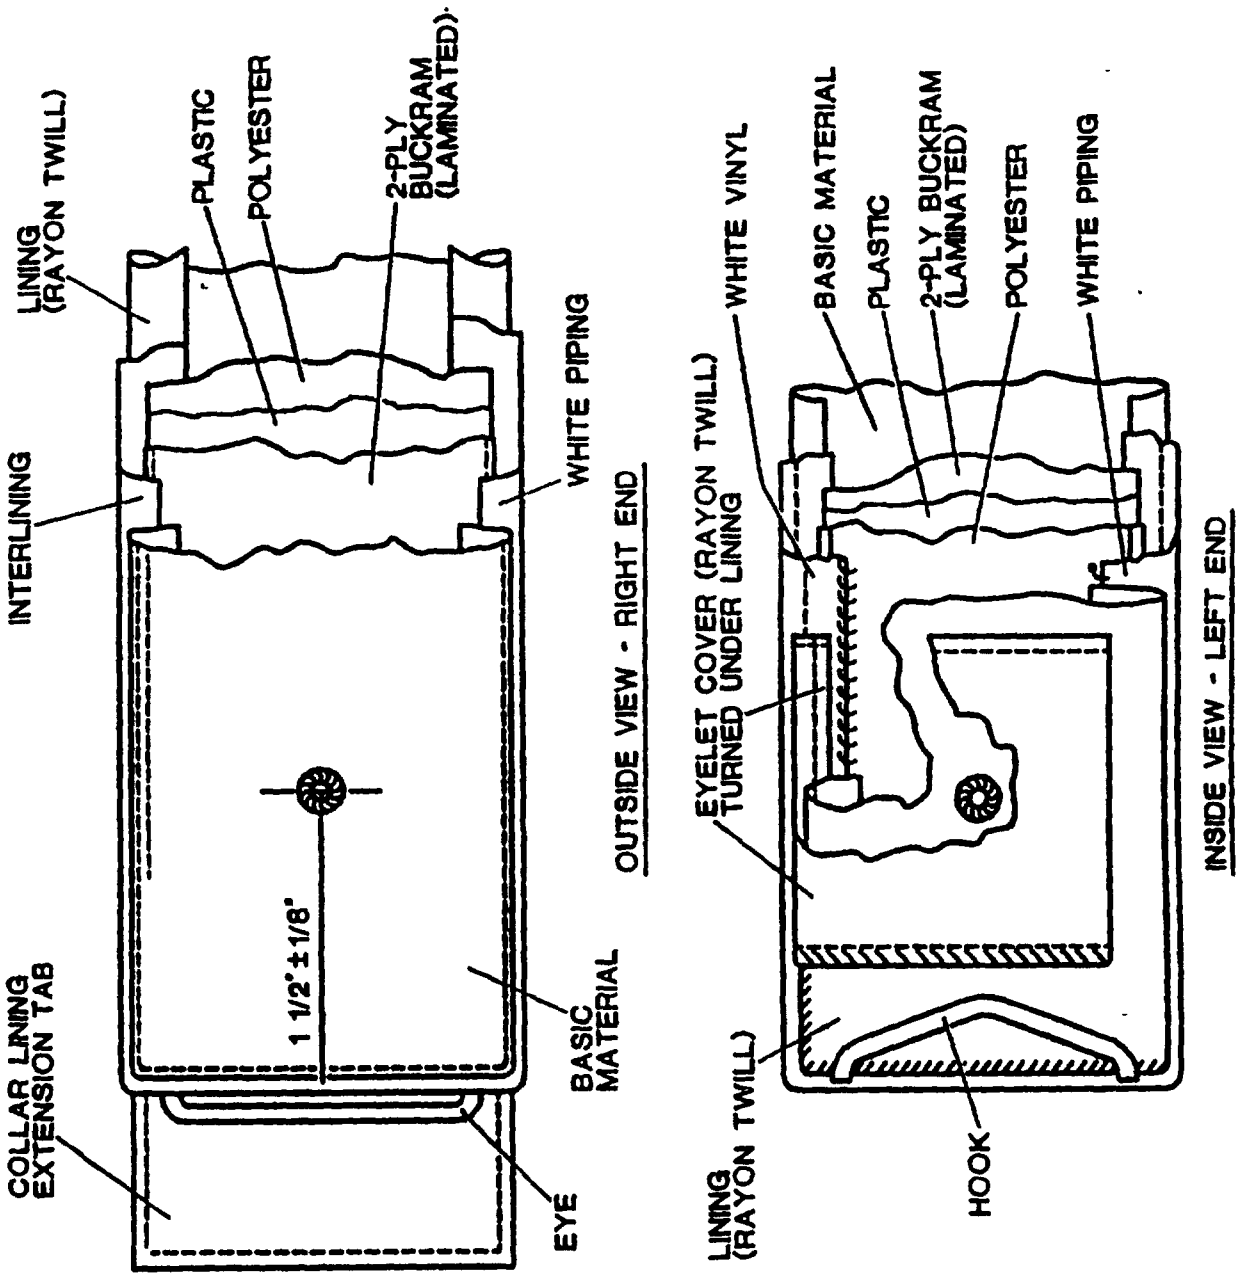


FIG.5. COAT, MAN'S: SPECIAL FULL DRESS, SCARLET, U. S. MARINE BAND, MUSICIAN'S

//AGW_71/PALMER/6-CLOTHING/COLLAR-1.G4 True Size 42 x 51 picas = 7 0" x 8.5"
7 MAR 1995 09:29 Plot Scale Factor 1.00
Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

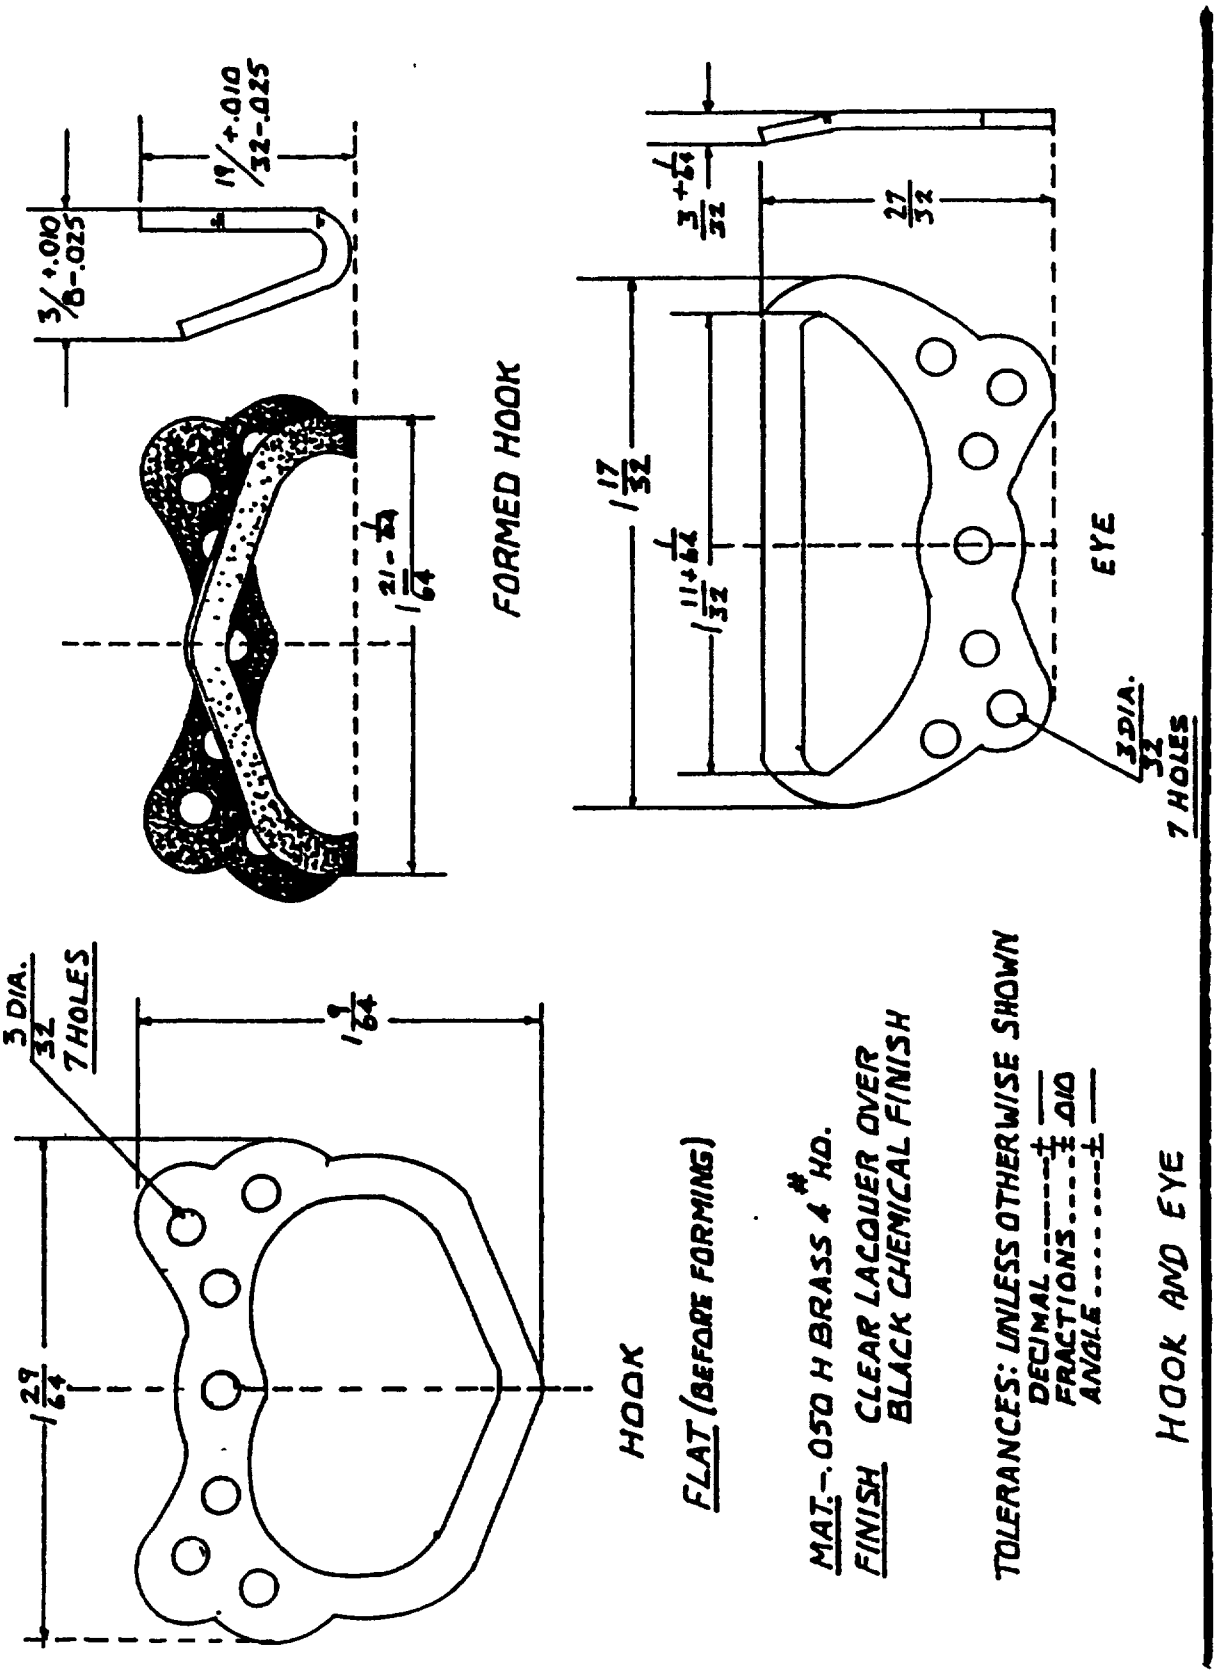


Fig 6: Coat Man's Special Full Dress, Scarlet, US Marine Band Musician

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

The preparing activity must complete blocks 1, 2, 3, and 8 In block 1, both the document number and revision letter should be given

2 The submitter of this form must complete blocks 4, 5, 6, and 7

3 The preparing activity must provide a reply within 30 days from receipt of the form

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements

I RECOMMEND A CHANGE:	1 DOCUMENT NUMBER	2 DOCUMENT DATE (YYMMDD)
	MIL-C-82145B(MC)	9 June 1995

3. DOCUMENT TITLE

COAT, MAN'S: SPECIAL FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN'S

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible Attach extra sheets as needed)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8 PREPARING ACTIVITY

a NAME	b TELEPHONE (Include Area Code) (1) Commercial	(2) AUTOVON
COMMANDER	(703)784-4584	278-4584
c ADDRESS (Include Zip Code) PROGRAM SUPPORT DIRECTORATE (PSE-C/S) MARCORSYSCOM, 2033 BARNETT AVE SUITE 315 QUANTICO VA 22134-5010	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.