MIL-C-82149A(MC)
31 August 1973
SUPERSEDING
MIL-C-82149(MC)
10 May 1967

MILITARY SPECIFICATION

COAT, MAN'S: FULL DRESS, SCARLET, U. S. MARINE BAND, MUSICIAN

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

*1.1 Scope. **This specification covers requirements for** musicians' scarlet wool full dress coats.

*1.2 Classification. The coats **shall be of one type in the following sizes as specified (see 6.2):**

Schedule of sizes

(Short, regular, Long, Extra Long)

34
35
36
37
38
39
40
41
42
44
46

1.3 Individual orders. **When the coat is custom tailored to an individual order, this specification shall govern, except that the detail requirements of Section 3, Table I, may be modified to the extent necessary for good custom tailoring practices.**

2. APPLICABLE DOCUMENTS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of the specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

V-T-276	- Thread, Cotton.
V-T-280	- Thread, Cotton Gimp, Buttonhole.
V-T-301	- Thread, Silk.
DDD-L-20	- Label; For Clothing, Equipage, And Tentage (General Use).
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached, or Dyed).

MILITARY

MIL-C-326	- Cloth, Silesia, Cotton.
MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill Rayon.
MIL-B-3461	- Buttons, Insignia, Metal, Uniform And Cap.
MIL-P-15064	- Pad, Shoulder and Sleeve-head.
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/wool.
MIL-C-41820	- Cloth, Gabardine, Polyester And Rayon.
MIL-C-43718	- Cloth, Twill, Polyester And Cotton.
MIL-C-82114	- Coat Front For Coats, Musicians.
MIL-C-82252	- Cloth, Broadcloth, Wool, and Wool Synthetic.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

STANDARDS

FEDERAL

FED-STD-151	- Metal, Test Methods.
FED-STD-191	- Textile Test Methods.
FED-STD-751	- Stitch, Seam, And Stitching.

MILITARY

MIL-STD-105	- Sampling Procedures And Tables For Inspection By Attributes.
MIL-STD-129	- Marking For Shipment And Storage.

(Copies of specifications and standards required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

*2.2 Other publications. The following document forms a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

3. REQUIREMENTS

3.1 Samples. Samples are furnished solely for guidance and information to the supplier (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

*3.2 First article approval. Unless otherwise specified (see 6.2), before production is commenced, a first article consisting of the number of finished coats specified by the procuring activity (see 6.2) shall be submitted or made available to the contracting officer or his authorized representative for approval. The approval of the first article authorizes the commencement of production, but does not relieve the supplier of responsibility for compliance with all provisions of this specification. The first article shall be manufactured by the supplier in the same facilities to be used for the manufacture of the production items.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

3.3 Materials.

*3.3.1 Basic material. The basic material shall be cloth, wool, tropical, scarlet shade 2502 (see 6.3), 10.5 ounce conforming to type I, class 1 of MIL-C-21115.

*3.3.2 Collar and sleeve cuff material. The material for the collar and cuffs shall be cloth, polyester/wool blend, black shade 2607 (see 6.3), conforming to type III, class 1 of MIL-C-21115.

*3.3.3 Lining. The material for lining the coats and collar and for making the collar eyelet covers, underarm shields, the coat hanger and straps to secure the lining to the bottom edge of coat shall be cloth, rayon twill, scarlet shade 2506 (see 6.3), conforming to class 1 of MIL-C-368.

*3.3.4 Collar tab. The material for the collar tab shall be cloth, wool broadcloth, blue shade 2307 (see 6.3), conforming to type I, class 2, of MIL-C-82252.

*3.3.5 Piping. The material for piping shall be cloth, gabardine, polyester and rayon, white shade 3042 (see 6.3), conforming to type I of MIL-C-41820, cut 5/8 to 3/4 inch wide for piping the collar and ornamental sleeve cuff and 1 inch wide for piping the front and bottom edges of coat and seams joining the center back to the skirt of the coat.

*3.3.6 Silesia or polyester and cotton. The stays for armhole and shoulder seams, the binding for the neck edge of the coat front interlining and the collar interlining shall be cut from cloth, cotton, silesia, 4.5 ounce conforming to type I of MIL-C-326 or polyester and cotton conforming to MIL-C-43718. The silesia or polyester and cotton shall be khaki shade 3707. The requirements for nonfibrous material and seam efficiency shall not apply.

*3.3.7 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram, double texture, laminated, starch finish, natural color, conforming to the following when tested as specified in Section 4, Table III.

*3.3.7.1 Cotton buckram. The buckram shall be made of cotton of suitable staple length and grade to meet the requirements of this specification, thoroughly cleaned, well carded, drawn and evenly spun.

3.3.7.2 Weave. The weave of the single plies of the cloth shall be four harness; 2 up and 2 down herringbone twill, 20 ends right and 20 ends left.

3.3.7.3 Texture. The two plies of the cloth shall each have a minimum thread count per inch of 50 in the warp and 20 in the filling.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*3.3.7.4 Laminated cloth. The two plies of the cloth shall be thoroughly adhered together with a synthetic resin type laminating material which shall not cause any objectionable odor in the finished cloth. The laminated cloth shall show no evidence of delamination after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests as specified in Section 4, Table III.

*3.3.7.4.1 Finish. The laminated cloth shall have a starch finish. The original stiffness of the finished cloth, and the stiffness of the cloth after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests shall conform to the following when tested as specified in Section 4, Table III.

Stiffness, inch-pound:	Minimum	Maximum
-original	0.60	0.95
-after accelerated aging	0.70	0.95
-after wet (dry) cleaning	0.50	0.85
-after perspiration	0.50	0.85

*3.3.7.4.2 Weight. The weight of the finished laminated cloth shall be 21 to 23 ounces per square yard (see Section 4, Table III).

*3.3.7.4.3 Breaking strength. The breaking strength of the finished laminated cloth shall be 100 pounds minimum in the warp direction and 80 pounds minimum in the filling direction, when tested as specified in Section 4, Table III. After being subjected to the accelerated aging test, the breaking strength of the cloth shall be not less than the original breaking strength when tested as specified in Section 4, Table III.

3.3.8 Reinforcement discs. The reinforcement discs for buttons secured to the back skirt seam, with ring toggle, shall be punched from the cloth, cotton, buckram specified in 3.3.7. The reinforcement discs shall be 7/8 inch in diameter with a 1/8-inch diameter hole at the center.

*3.3.9 Coat fronts. The coat fronts shall conform to class 1 of MIL-C-82114.

*3.3.10 Shoulder pads. The shoulder pads shall conform to the requirements of type I, class 2,of MIL-P-15064.

3.3.11 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.12 Stay tape. The stay tape for the armholes and waist seam shall be cotton, 1/4-inch-wide, conforming to type III, class 1,of DDD-T-86, except the requirement for nonfibrous material shall not apply.

3.3.13 Thread.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

*3.3.13.1 Silk thread. The silk thread shall conform to V-T-301 as follows, except the requirements for extractable matter shall not apply:

Use	Type	Class	Ticket No.	Ply
Bartacks and all outside seaming and stitching.	I		A	
Machine felling.			O	
Making buttonholes in coat	I		B and F	3
Hand felling; and hand sewing	III	3	C	2

*3.3.13.2 Cotton, thread. The cotton thread shall conform to V-T-276 as follows:

Use	Type	Ticket No.	Ply
All inside seaming and stitching.	IC2	A	3
Serging and overedge stitching.	IA3	70	2
Machine tacking armholes and sewing on buttons	IB3	24	4

The thread for basting shall be good commercial grade cotton.

*3.3.13.3 Color and colorfastness. All thread shall be scarlet shade W, cable No. 66040, except: the silk thread for stitching collar, cuffs and braid, which shall be black; the cotton thread for basting and machine tacking armhole, which may be white; and the cotton thread for overedge stitching the piping at bottom edge of coat shall be white. The colored threads shall show the following colorfastness when tested as specified in the applicable thread specification:

Thread	Color	Wet (dry) Cleaning	Light
Cotton	Scarlet	Good	--
Silk	Scarlet	Fair	Fair
Silk	Black	Good	Good

*3.3.14 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of V-T-280. The color of the gimp shall be scarlet shade W, cable No. 66040 and shall show good fastness to wet (dry) cleaning.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

3.3.15 Ornamental braid. The ornamental braid for the front of the coats shall be mohair, black, tubular, 3/8 ±1/16 inch wide conforming to the following:

Weave	Plain
Weight per gross yards, ounce (minimum)	35
Picks per inch (minimum)	9
Total carriers (minimum)	16
Ends per carriers (minimum)	6
Breaking strength, pounds (minimum)	105
Shrinkage:	
-length, percent (maximum)	2.0
-width, inches	Not less than the original width
Colorfastness to:	
-wet (dry) cleaning	Good
-light	Good

*3.3.16 Buttons.

*3.3.16.1 Insignia buttons. The insignia buttons shall be metal, gold plated, enlisted design, 27-line and 40-line conforming to type I, style 3, class A, subclass 2, of MIL-B-3461.

3.3.16.2 Ring toggles. Ring toggles for securing buttons to fronts, back and sleeves shall conform to MIL-B-3461.

*3.3.17 Hooks and eyes. The hooks and eyes for closing the collar shall be brass, black enameled finish, size No. 16, commercial type. All surfaces and edges of the hooks and eyes shall be clean, smooth, free from burrs, tool marks, sharp edges, and roughness. The hook and eye shall be thoroughly and completely lacquered with the best available quality of black japanned lacquer. The dry lacquer film shall be continuous, level, adherent, free from lint, dust, or other foreign inclusions that may affect appearance or serviceability, and shall withstand the test for tackiness specified in 4.3.1.2.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

*3.3.18 Strap eye and strap loop attachment. The strap eye and strap loop for attaching epaulets to shoulder of coat shall be brass, consisting of 70 ± 1 percent copper and the remainder zinc when tested as specified in Section 4, Table III. The strap loop and the base of the strap eye shall have a thickness of 0.042 ±0.003 inch. The diameter of wire for making the strap eye shall be 0.063 ±0.003 inch. The wire shall be brazed to the base of the strap eye. The finished design and dimensions of the attachments shall conform to the following and as shown in Figure 1. All surfaces and edges of attachments shall be clean, smooth, free from burrs, tool marks, sharp edges and roughness. All visible surfaces shall be highly polished and completely lacquered with a clear, synthetic lacquer. The dry lacquer film shall be continuous, level, adherent, free from lint, dust or other foreign inclusions that may affect appearance or serviceability and shall withstand the liver of sulphur and tackiness tests when tested as specified in Section 4, Table III. All apertures of the finished lacquered attachments shall be completely open and free of any lacquer film.

*3.3.19 Labels. Each coat shall have a combination personal-clothing identification label and a size label as follows: The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

*3.3.19.1 Combination personal-clothing identification label. The combination personal-clothing identification label shall conform to type I, classes 1 and 10 (combined), of DDD-L-20 except all printing and the space between the lines of printing shall be minimum 10 point (approximately 1/8 inch). The content and format shall be as follows:

NAME _____

SERVICE NO._____

COLLAR SIZE_____

NOMENCLATURE (item description)

_____

CONTRACT NO._____DATE_____

NAME OF CONTRACTOR_____

WOOL PRODUCTS ACT INFORMATION

_____

*3.3.19.2 Size label. The size label shall conform to type I, class 2 of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letter S, R, L, or XL for Short, Regular, Long and Extra Long, as shown by the following example:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

40R
Stock number

The stock number may be omitted from the size label, but when omitted, it shall be incorporated in the identification label.

*3.4 Design. The coat shall be the U.S. Marine Corps design shown on Figures 2 through 4, a semiformfitting, single-breasted fully-lined coat with 14 gold plated insignia buttons on the right front and 7 on the left front, having upper fronts with black braid, skirt type lower body parts with waist darts, a waist seam, a three-piece back with 2 gold plated insignia buttons at the waist, ornamental sleeve cuffs with gold plated insignia buttons, a standup collar with hooks and eyes for front closure and worked eyelets, and metal attachments on each shoulder for epaulets. The edges of the collar, the front and bottom edges of coat, the seam joining the skirt to the center back, and the top edge of the ornamental sleeve cuff shall be piped with white cloth.

*3.5 Patterns. Standard patterns will be furnished to the supplier by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the supplier's working patterns. The supplier's working patterns shall be identical to the standard pattern. The standard pattern shall provide 3/4-inch allowance for side seams and for seam joining the skirt to the center back and 3/8-inch allowance for all other seams except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

*3.5.1 List of pattern parts. The coats shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

Item	Pattern nomenclature	No. of cut parts
	Material basic; cloth, wool tropical	
1.	Front, upper	2
2.	Skirt (lower)	2
3.	Side (front)	2
4.	Side back	2
5.	Center back	1
6.	Top sleeve	2
7.	Under sleeve	2
8.	Front facing, right	1
9.	Front facing, left	1
	Cloth, wool-polyester	
10.	Collar, outerply	1
11.	Sleeve cuff	2
	Cloth, wool broadcloth	
12.	Collar, tab	1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature Material; Cloth, rayon lining	No. of cut parts
13.	Front, upper	2
14.	Skirt, (lower)	2
15.	Side back	2
16.	Center back	2
17.	Top sleeve	2
18.	Under sleeve	2
19.	Collar lining	1
20.	Collar eyelet cover	2
21.	Underarm shield	4
	Cloth, cotton, buckram	
22.	Collar interlining	1
	Silesia or polyester and cotton	
23.	Collar interlining	1
	Marker	
24.	Cuff and button marker	

3.6 Construction.

*3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I.

*3.6.1.1 Operations. The supplier is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1.2 Stitches, seams, and stitchings. The stitch, seam,and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching and serging shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

*3.6.1.2.1 Thread breaks and ends of seams. The end of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitchings shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

*3.6.1.3 Shade marking. The component parts of each coat cut from one piece of the wool and lining material, including pairs of sleeve linings and underarm shields when not cut from ends, shall be shade marked to insure uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.

(b) Sew-on shade tickets.

(c) Adhesive-type tickets which show discoloration and the use of an adhesive mass which adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
1.	Cutting. a. Cut coats in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction of the warp as indicated by the directional lines on the patterns. c. Cut all scarlet wool parts of the coat from one piece of the basic material. d. Cut the body and collar linings, collar eyelet covers and top ply of underarm shields from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the sleeve lining shall match. Cut the strips for the coat hanger and for the lining securing straps 1-1/8 inches wide. e. Cut the wool material for the sleeve cuffs and outer ply of collar from one piece of the material specified in 3.3.2. f. Cut the collar tab from the material specified in 3.3.4. g. Cut silesia or polyester and cotton stays for armhole and shoulder seams on the bias 3/4 inch wide and 4 ±1/4 inches long. Cut silesia or polyester and cotton for collar interlining in accordance with the patterns furnished. Cut the silesia or					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
1.	Cutting (cont'd) polyester and cotton for binding the neck edge of the coat front interlining on the bias, 3/4 inch wide and approximately 5 inches long. h. Cut the cotton buckram for interlining the collar on the straight in accordance with the pattern furnished. i. Cut the piping material (see 3.3.5) for piping the front and bottom edges of coats, edges of collar, top edge of ornamental sleeve cuffs and the seam joining the skirt to the center back on the straight. The piping shall be cut 5/8 to 3/4 inch wide for collar, and ornamental sleeve cuffs, and 1 inch wide for bottom and front edges of coat and the seam joining the skirt to the center back. j. Punch the reinforcement discs for buttons secured to the skirt back seam from cloth, cotton, buckram. The reinforcement discs shall have a 7/8 inch diameter hole at the center.					
2.	Replacement of damaged parts. a. Replace at time of cutting any part of coat containing holes, seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc., affecting appearance.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
2.	Replacement of damaged parts. (cont'd)					
	b. Replace any part damaged during the manufacturing process by needle chews which may develop into holes, scissor or knife cuts, tears, holes, mends or burns in the material, affecting appearance.					
3.	Shade marking.					
	a. Mark or ticket all component parts (see 3.6.1.3) cut from one piece of the basic material. Mark or ticket all component parts cut from one piece of rayon lining material and the pairs of sleeve linings when cut from ends.					
	b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					
4.	Make coat hanger and lining securing straps.					
	Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8-inch-wide strip of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	12-16	A	A
	b. Cut the coat hanger 3-3/4 ±1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ±1/4 inches long.					

Source: https://assist.dla.mil -- Downloaded: 20261O-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
5.	Make collar eyelet covers. Finished appearance. The collar eyelet covers shall finish 1-3/4 ±1/8 inches wide.					
	a. Turn under the side edges of the collar eyelet covers and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1 (each side edge)	12-16	A	A
	b. Fold each cover in half across the width and seam 1/16 inch from the folded side edges.	301		12-16	A	A
6.	Make underarm shields. Finished appearance. The shields shall finish smooth and flat without puckers, pleats, gathers or other distortions.					
	a. Position the two plies of material for the underarm shields with edges even. Seam the two plies together along the curved side and bottom edges 3/8 inch from the edges.	301	SSa-1	12-16	A	A
	b. Turn the shield right side out, working out the seamed edges completely.					
	c. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
7.	Make cuffs. Finished appearance. The cuffs shall be uniform in appearance, shall finish smooth and flat, without twists, gathers, pleats, puckers or other distortions.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
7.	Make cuffs. (cont'd) The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the sleeve cuff. a. The cuffs shall be made of one ply of material specified in 3.3.2., piped with material specified in 3.3.5.					
	b. Position the strip of piping material on the outside of sleeve cuff and stitch together 1/8 inch from the upper curved and pointed edge of cuff.	301	BSm-1 (a)	10-14	A (silk)	A
	c. Turn back the cuff and piping, working the folded edge of the piping 1/8 inch beyond edge of cuff. Top stitch the cuff to the piping 3/16 inch from folded edge of piping.	301	BSm-2 (b)	10-14	A (silk)	A
	d. Press the cuffs smooth and flat with a heated pressing iron or pressing machine.					
8.	Stitch and press dart in under sleeves.					
	a. Fold the under sleeve, matching the cut edges of the darts. Stitch the entire length of the dart 1/4 inch from the cut edges of the armhole and taper the line of stitching to zero at the lower folded edges.	301	SSa-1 (OSf-1 folded-edge)	12-16	A	A
	b. Spread open the cut edges of the dart, turn the lower folded edge flat against the body of the under sleeve and press the entire dart smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
9.	Seam sleeves at forearm. Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly. a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of under sleeve and with the notches in the lower forearm edge of top and under sleeve matching. Seam top and under sleeve together 3/8 inch from forearm edge of top sleeve, forming a tapered outlet on the under sleeve. b. Spread open the seam and press flat with a heated pressing iron.	301	SSbd-1 to SSa-1	12-16	A	A
10.	Join cuffs to sleeve. Finished appearance. The cuff shall be uniformly stitched to the sleeve without twists, gathers, puckers or raw edges. On the finished coat, the length of the cuffs, including the piping, shall measure 3-1/4 ±1/8 inches at the front and back creased edges, and 6 ±1/8 inches at the point. In the finished coat (after pressing) the point of the cuff shall be centered between the lower forearm creased edge and the creased backarm seam of sleeve. a. Mark the sleeves in accordance with the sleeve cuff marker for positioning of the cuffs, with notch on the cuff					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
10.	Join cuffs to sleeve. (cont'd)					
	marker matching the forearm seam line and bottom edge of marker in line with the bottom raw edge of sleeve.					
	b. Position the piped edge of cuff at the mark and stitch cuff to sleeve along the piped edge. The line of stitching shall be adjacent to the stitching of the cuff piped edge.	301	LSa-1	10-14	A (silk)	A
11.	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without distortions and shall start and finish evenly.					
	a. Join the top and under sleeves together at the backarm with a 3/8-inch seam, catching the ends of the cuff in the seam.	301	SSa-1	12-16	A (silk)	A
	b. Spread open the sleeve and cuff seams and press smooth and flat with a heated pressing iron.					
12.	Insert insignia buttons.					
	a. Mark each cuff for location of three insignia buttons in accordance with button marker.					
	b. Punch a hole through cuff and sleeve at each mark for attaching of insignia buttons.					
	c. Insert the shanks of the 27-line insignia buttons through the punched holes and attach ring toggles on each button shank.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
13.	Baste and tack cuff to sleeve:					
	a. Turn the bottom of the cuff to the inside against the bottom edge of sleeve in accordance with notches, and baste along the turned edge of the cuff.	301 or Hand				
	b. Tack the raw edge of cuff to the body of sleeves with blindstitching. The blind-stitching shall not be exposed on, or caught to, the outside of the cuff.	301	EFe-1 (b)	4-6	A	A
14.	Stitch and press dart in under sleeve lining.					
	a. Fold the under sleeve lining, matching the cut edges of the under sleeve dart. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole and taper the line of stitching to zero at the lower folded edge.	301	SSa-1 (cut edges OSf-1 folded edge)	12-16	A	A
	b. Turn the cut edges of the dart toward the forearm edge and press the entire dart smooth and flat with a heated pressing iron.					
15.	Seam sleeve lining at forearm.					
	Finished appearance. The fore-arm seam shall finish smooth and flat without puckers, twists, gathers or pleats and shall start and finish evenly.					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the notches in lower forearm edge of top and under sleeve linings matching.	301	SSbd-1 or SSa-1	12-16	A	A

Source: https://assist.dla.mil Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
15.	Seam sleeve lining at forearm. (cont'd) Seam the top and under sleeve lining together 3/8 inch from the forearm edge of topsleeve lining, forming a tapered outlet on the under sleeve lining.					
16.	Seam sleeve lining at backarm. Finished appearance. The backarm seam shall finish smooth and flat, without twists, gathers, puckers or pleats and shall start and finish evenly. a. Join the top and under sleeve linings at the backarm with a 3/8-inch seam.	301	SSa-1	12-16	A	A
17.	Assemble sleeve and sleeve lining. Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers or pleats. a. Position the sleeve lining on the sleeve with upper edge of the lining extending approximately 1 inch beyond the armhole edge of the sleeve. b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the sleeve, commencing at the top edge of the cuff and extending to approximately 6 inches from the armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand		4-6 1-2	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
18.	Fell sleeve lining turnup.					
	Finished appearance. The sleeve lining shall not be short, tight or twisted at bottom of sleeves.					
	a. Turn under the bottom edge of the sleeve lining to finish 1 to 1-1/4 inches above the finished end of sleeve, and baste to turnup of cuff, or the sleeve lining may be felled to bottom sleeve without basting.	101 or Hand				
	b. Fell the folded edge of sleeve lining to the turnup of the cuff with blindstitching.	Hand or 301	EFc-1 (b)	8-10 6-8	C (silk) O (silk)	0
19.	Press sleeves.					
	Turn the sleeves right side out and assemble in pairs. Remove basting at lower end of the cuffs and press the lower half of sleeves smooth and flat, creasing at the forearm and backarm. The backarm crease shall be on the backarm seam.					
20.	Assemble collar interlining.					
	a. The collar interlining assembly shall consist of one ply of buckram and one ply of cotton silesia or polyester and cotton.					
	b. Position the silesia or polyester and cotton and buckram interlinings for the collar with all edges even and seam together 1/8 to 3/16 inch from the edges.	301	SSa-1 (each edge)	12-16	A	A

Source: https://assist.dla.mil Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
21.	Pipe outer ply of collar.					
	Finished appearance. The piping shall extend at upper, lower and side edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers or pleats.					
	a. The outerply of the collar shall be made of one ply of material specified in 3.3.2, piped with material specified in 3.3.5.					
	b. Seam a 5/8-to 3/4-inch-wide strip of piping to outer ply 1/8 inch from all edges leaving a 3/4-to 1-inch extension on each end of piping at lower edge of collar. The extension ends of piping shall be approximately 3 inches from the pointed end of collar.	301	SSaa-1	12-16	A (silk)	A
	c. Join extensions together as close as possible to the outer ply.	301	SSa-1	12-16	A (white)	A
	d. Trim the extension piping to 1/4 inch from the seamed edge. Spread open joining of extension and stitch to collar along seam joining piping to outer ply.	301		12-16	A (silk)	A
	e. Turn back the piping and outer ply, uniformly working the folded edge of the piping beyond the edges. Topstitch the outer ply uniformly 3/16 inch from the folded edge of piping.	301		12-16	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
22.	Assemble collar. Finished appearance. The collar shall be assembled without twists, gathers, puckers or pleats.					
	a. Position the interlining assembly on the inside of the outer ply under the unattached edge of piping. Tack all the raw edges of piping to the silesia or polyester and cotton interlining, making the outer ply form a smooth and snug fit.	Hand		2-3	C (silk)	
	b. Press the collar smooth and flat with a heated pressing iron or pressing machine.					
	c. Position an eyelet cover on the under side at each end of the collar, with one edge of the cover 3/4 to 7/8 inch from the front end, and the bottom raw edge of the eyelet cover 1/2 to 5/8 inch from the upper piped edge. Stitch collar to cover along the piped edge adjacent to the stitching line of the collar piped edge.	301	LSa-1	10-14	A (silk)	A
	d. Lap the upper piped edge of collar over the top raw edge of collar lining approximately 1/2 inch with lining face up. Stitch collar to the lining and eyelet cover along the piped edge adjacent to the stitching line of the collar piped edge. The stitching shall extend from center to center of eyelet covers. The collar lining shall extend not less than 1/2 inch from each end of collar.	301	SSa-1	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
22.	Assemble collar.(cont'd)					
	e. Turn collar lining and eyelet cover at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine.					
	f. Make one eyelet through all plies at each end of the collar midway between the top and bottom edges and 1-1/2 ±1/8 inches from finished ends. The eyelets shall be well worked with the purling on the outside of the collar and shall finish a 1/8-inch diameter opening.	Eyelet		22 per eyelet	A	A (silk)
23.	Assemble body lining.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					
	a. The body lining shall consist of an upper front, a side back panel, a center back panel, and a skirt.					
	b. Fold the upper front, matching the cut edges of the dart. Seam the waist dart with a 3/8-inch seam at the lower end of the waist dart, tapering to zero at the upper end.	301	SSa-1	12-16	A	A
	c. Fold the underarm dart and seam with a 3/8-inch seam at the center, tapering to zero at the upper and lower ends.	301	OSf-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
23.	Assemble body lining. (cont'd)					
	d. Position the side back panel and fronts with edges even and with notches matching. Seam together at the side seam with a 3/4-inch seam.	301	SSa-1	12-16	A	A
	e. Position center back to the respective side backs with edges even and notches matching. Join together with 3/8-inch seam.	301	SSa-1	10-14	A	A
	f. Overedge stitch together the waist dart, side seam, and side back seam. The overedge stitching shall be securely caught in the fabric.	503-504		6-10	70/2	70/2
24.	Join upper body lining assembly to skirt.					
	a. Fold the skirt lining in accordance with notches on the pattern to form a 3/4-inch pleat at the waist line. Stitch across the pleat 1/8 to 3/16 inch from raw edge.	301	SSa-1	10-14	A	A
	b. Press the pleat smooth and flat at the top end and tapering to a flat point at the lower end. The pleat shall extend approximately 5 to 5-1/2 inches in length.					
	c. Position the upper assembly to the skirt (face to face), with all edges even and join together at the waist with a 3/8-inch seam. The seam allowance for the waist darts, underarm darts, side and side back seams shall face toward the front.	301	SSa-1	10-14	A	A
	d. Overedge stitch the entire waist seam allowance with all joining seams caught in the stitching.	503-504		6-10	70/2	70/2

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN No.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
24.	Join upper body lining assembly to skirt. (cont'd)					
	e. Press all seams and darts smooth and flat. The waist seam shall be pressed toward the bottom and the remaining seams and darts towards the front.					
25.	Seam wool facing to lining assembly.					
	Finished appearance. The lining shall be carefully aligned and seamed to the facing so that in the finished coat, the lining shall lie smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.					
	a. Position the lining on the wool facing with the top edges even.					
	b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from the top edge of the facing to approximately 1-1/4 inches from the bottom edge.	301	SSa-1	12-16	A	A
26.	Serge or overedge stitch facing-lining assembly.					
	Finished appearance. The overedge stitching shall be securely caught in the fabric.					
	a. Overedge stitch together the facing-lining seam allowance. The overedge stitching shall be securely caught in the fabric.	503-504		6-10	70/2	70/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
27.	Sew on identification label					
	Finished appearance. The identification label shall be positioned so that in the finished coat, the label shall be midway between front and back edge of the right facing, with the bottom edge of label approximately 4 inches from the bottom finished edge of coat.					
	a. Sew the identification label to the outside of the right facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge)	12-16	A	A
28.	Make outer assembly.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					
	a. The assembly shall consist of upper front, side front, side back, center back and lower skirt.					
	b. Fold the upper fronts, matching the cut edges of the waist dart, and stitch the entire length of the dart 3/8 inch from the cut edges at the lower end and tapering to a point at the upper end.	301	SSa-1	12-16	A	A
	c. Position the upper front and side panel with edges even, and join together with a 3/8-inch seam.	301	SSa-1	12-16	A	A
	d. Position the side back and side front with edges even and notches matching. Seam together at the side with 3/4-inch seam.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 20261O-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
28.	Make outer assembly. (cont'd)					
	e. Fold the skirt dart in accordance with notches on patterns and stitch the length of the dart. The dart shall taper from 3/4 inch at the top to zero at the lower end. Dart shall finish approximately 5-1/4 to 5-1/2 inches long.	301	OSf-1	12-16	A	A
	f. Press skirt dart flat on dart seam without turning dart either to the right or left.					
	g. Spread open the waist dart and the underarm and side seam and press flat with a heated pressing iron.					
	h. Overedge stitch the waist dart, underarm dart and side seam.	503-504		6-10	70/2	70/2
	i. Position the upper assemblies and the skirt with fronts and edges even and with the back edge of the side back positioned 3/8 inch from the back edge of skirt as indicated by the notch at the top of the waist of the skirt. Join together at the waist with a 3/8-inch seam and with the 1/4-inch-wide stay tape positioned on the upper assembly 1/4 inch from the upper edge and caught in the stitching.	301	SSa-1	12-16	A	A
	j. The tape shall be sewn with the normal tension, not loose or tight, and shall extend from the side back seam to not more than 3 inches from the front edge of the fronts. Spread open the waist seam and press flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
28.	Make outer assembly. (cont'd)					
	k. Overedge stitch the entire waist seam allowance from end to end.					
	l. Press and shape the fronts on a suitable type heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest.					
29.	Pipe skirt (see Figure 5).					
	Finished appearance. The finished piping shall be of uniform width, without twists, puckers, pleats or distortion. Piping shall extend along the back edge of skirt.					
	a. Fold 1-inch piping in half lengthwise. Seam piping 1/8 inch from folded edge.	301	OSf-1	12-16	A	A
	b. Serge or overedge stitch the raw edges of the piping together.	503		6-10	70/2	70/2
		or 504		6-10	70/2	70/2
	c. Mark along back edge of skirt for the positioning of the piping. The mark line shall be 7/8 inch from the back edge and shall extend from the top to bottom of the skirt.					
	d. Position the folded edge of piping on the mark line, and stitch piping to skirt 3/16 to 1/4 from the folded edge of piping. Piping shall finish with a minimum 1/2 inch excess at the top end to give a neat finish. In the finished coat, the folded edge of piping shall extend 1/8 inch beyond the seam.	301		10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
30.	Join center back to side back and skirt. Finished appearance. The backparts seams shall start and finish evenly and shall be smooth without gathers, pleats or puckers.					
	a. Position and join the left and right assemblies to the center backpart with a 3/8-inch seam down to the waistseam and with a 3/4-inch seam from the waistseam to the bottom of coat.	301	SSa-1 (above waist-seam) LSaj-1 (below waist seam)	12-16	A	A
	b. Spread open the side backseam from armholes to the waistseam, and press smooth and flat. Press skirt back seams from waistseam to bottom of coat smooth and flat with edge of each seam toward the center back. Pressing shall be done with a heated pressing iron or pressing machine.					
31.	Seam reinforcement stay to shoulder and armhole. Finished appearance. The reinforcement stays shall be sewn to the armhole and shoulder edge of the front without gathers, puckers or pleats. The top end of the armhole stay and lower end of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide stays to the underside of the front along the shoulder edges and upper front edge of the armhole respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from neck and armholes respectively.	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
31.	Seam reinforcement stay to shoulder and armhole (cont'd)					
	The strip for the upper edge of armholes shall be positioned approximately 1/2 inch from the shoulder.					
32.	Mark and dress left front.					
	a. Mark and shape the left front edge of coat, from the top notch to the waistseam. The mark line shall be 1 inch from the upper front edge to 1-1/8 inch at the waistseam. Continue on the straight line, from the waist seam to the notch at the bottom of the skirt.					
	NOTE: The dressing and shaping of the left front shall be performed in the sewing room.					
33.	Tape armholes.					
	a. Sew the cotton tape to the armhole starting with one end approximately 1 inch above the notch in the fronts and continuing along the lower and back edge of the armhole to approximately 1/2 inch from shoulder edge.	301	SSaa-1	12-16	A	A
	b. The tape shall be stitched with slight tension along the lower front edges of the armholes and shall be held taut while stitching along the back edge.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
34.	Press shoulder blades and armhole tapes.					
	a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or suitable type pressing machine.					
35.	Stitch piping to coat.					
	Finished appearance. The piping shall be uniformly stitched to the coat without twists, puckers or pleats. The piping shall extend from the collar notch at top edge of the right front to the collar notch at top edge of the left front.					
	a. Position the 1-inch-wide strip of piping material on the outside of left and right front, with one edge even with top, front and bottom edges of coat. Stitch piping to coat 1/8 inch from edge. The piping shall extend from the collar notch at the top, along the left and right front and the bottom edge of the coat.	301	SSa-1	10-14	A	A
	b. Turn the piping to the inside working out the folded edge of piping 1/8 inch beyond edges of coat. Topstitch coat to the piping 3/16 inch from the folded edge of piping, catching the turned under portion of the piping in the stitching.	301	SSe-2 (b)	10-14	A	A (silk)
	c. Notch out the excess piping material at the top and bottom front corners to eliminate bulkness. Trim the					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
35.	Stitch piping to coat. (cont'd)					
	inner edge of piping on the left front only from the upper front down to approximately 1 to 1-1/2 inches below waistseam, so that the piping will not interfere with front buttonholes.					
	d. Serge stitch the raw edge of the piping at the bottom edge of coat.					
36.	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste the interlining and fronts together from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom edge of the front.	301 or Hand	Hopper			
	b. Baste along the shoulder, allowing room for setting the shoulder pad, working the fullness toward the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulders to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of fronts.	301 or Hand	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
37.	Trim coat front interlining. a. Trim the top edge of coat interlining even with the top edge of fronts from the point of shoulder to the collar notch. b. Notch the top edge of the interlining in line with the collar notch. c. Remove stitches joining front edge of silesia or polyester and cotton to coat front interlining, approximately 1/2 inch back from front and top edge of fronts. d. Turn the coat inside out and trim the interlining only, approximately 1/4 inch back from the front and top edge of fronts. e. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					
38.	Bind front edge and gorge of interlining. Fold silesia or polyester and cotton back and over the top and front raw edge of the interlining. Stitch along the top and front edge with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the turned-under portion in the stitching.	301	EFa-3	8-10	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
39.	Bind top neck edge of interlining.					
	Finished appearance. The silesia or polyester and cotton binding shall be uniformly stitched along the gorge of the coat front interlining from the collar notch to the shoulder point.					
	a. Lap the 3/4-inch-wide strip of binding on the outside of the coat front interlining from the collar notch to shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	8-10	A	A
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301		12-16	A	A
40.	Fell piping to coat front interlining.					
	a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	101				
	b. Fell the upper front and and lower edge of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A C (silk)	A
	c. Pull and remove basting stitches from piping.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
40.	Fell piping to coat front interlining. (cont'd) d. Press the left and right fronts, respectively on a suitable type heated pressing machine with the chest to conform to the shape of the body.					
41.	Mark fronts for positioning the braid and buttonholes (see Figure 6). a. Mark the location of seven buttonholes on the outside of the left front, as shown on Figure 6. The top buttonhole (line A) shall be positioned 1 inch below the upper piped edge and 5/8 inch from the front piped edge. The lower buttonhole (line B) shall be on the waistseam and 5/8 inch from front piped edge. The remaining five buttonhole marks shall be evenly spaced. b. Extend each buttonhole line towards the back and armhole edge. (Line B shall be 1 inch shorter than line A). The length of the top and bottom line is determined by the position of the harp on the second line from the top which shall be approximately 1-7/8 from the armhole edge to the center of the harp. Measure the second line from the front edge of buttonhole line to the center of the harp. Transfer the same measurement to the bottom line less 1 inch. Draw a straight line from the bottom line through center of the harp up to the top line, establishing line A-C and B-D as shown on Figure 6.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currenversion before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
41.	Mark fronts for positioning the braid and buttonholes (see Figure 6). (cont'd) c. Bisect the top line A-C and bottom line B-D and connect the bisecting points with a straight line E-F. d. Position left front of coat on right front, face to face with the collar notches even and the left front edge 1 inch back of the right front edge at collar notch and waistseam and armhole edge even. e. Trace the seven lines on the right front to coincide with the lines on the left front; the lines on the right front shall extend 3/4 to 1 inch from the front piped edge. The vertical lines on the right front shall be identical to lines C-D-E-F on the left front. f. Draw a circle 7/8 +0 -1/32 inch in diameter on each side of the seven horizontal lines, centered to bisect line E-F and with the edge of each circle touching the horizontal line forming a figure 8 design as shown on Figure 6. g. Position the center of the harp pattern at the line C-D, with the upper edge of the pattern positioned at the bottom side of each horizontal line. Mark the harp in accordance with the pattern marker. The bottom edge of the harp must be not less than 1/2 inch from the line beneath.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
42.	Baste braid (see Figure 7).					
	a. Baste braid by hand along each side of the horizontal line and around the circle figure 8 design and around the harp. The braid shall begin and end at the harp with both ends of the braid secured and tacked under the horizontal braid. On the left front the braid shall be basted around the buttonhole line and the outer edge of the braid shall finish approximately 1/4 to 3/8 from the piped front edge.					
	b. Begin with cut end of braid even with straight line at top of harp. Baste the braid along its forward edge down the center of harp to the forward edge of harp center. Continue up the backarm along the back edge of harp to the straight line at top using the same edge of the braid.	Hand		2-6	C (silk) Black	
	c. Baste the bottom edge of braid along the straight line to the circle, follow circle back to straight line and continue to end of straight line.	Hand		2-6	C (silk) Black	
43.	Tack braid.					
	a. Securely tack all unattached edges of braid to provide a smooth, secure and flat surface of stitching.	Hand		2-6	C (silk) Black	
	b. Tack inside edges of braid circles to coat, forming an inner hole approximately 1/4 inch in diameter	Hand		2-6	C (silk) Black	
	c. Tack loops at button edge of coat together to the coat to finish secure and flat.	Hand		2-6	C (silk) Black	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
44.	Stitch braid (see Figure 7).					
	Finished appearance. All stitching shall be done 1/16 inch from all edges whenever possible. All stitching shall be uniform. All stitching shall be performed with one continuous thread whenever possible. Stitching across braid strands shall be done only as prescribed or when absolutely necessary. All edges of the braid shall be securely attached to the coat at all points. The braid and the stitching shall present a smooth, neat, uniform appearance. The braid on the left front only shall be unstitched for approximately 3 inches from front end of the buttonhole loop braid.					
	a, Stitch braid through fronts and interlining on both sides of the braid 1/16 inch from edge. The line of stitching shall start and finish at the harp as shown on Figure 7.	301	SSa-1	10-14	A	A (silk)
	b. Braid may be stitched without basting, provided the requirements previously mentioned are maintained.	301		12-16	A	A (silk)
	c. Hand stitch the inner edges of horizontal braid together on both fronts from harp ends to end of buttonhole opening on left front and from harp ends to front end of braid on right front.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
45.	Join facing to fronts.					
	a. Position the left and right fronts to the respective front facing (face to face), with the waistline notch of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark along the top front edges of facing.					
	b. Lap the front edge of the right and left fronts, respectively on the outside of the facing at the marks and join the fronts to facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to bottom edge of coat front edge only.	301	LSa-1	12-16	A	A
	c. Trim excess facing material where necessary.					
46.	Baste front edges.					
	a. Turn the facing-lining assemblies to the inside of fronts, completely working out the corners.					
	b. Baste along the front edge of left and right fronts, working the facing back from the folded edge of piping.	101				
47.	Baste facing (second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the coat, holding the lower corner of	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
47.	Baste facing (second time). (cont'd).					
	the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.					
	b. Turn under and baste the top edge of the facing even with the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	Hand or 301	Hopper			
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of facings to approximately 1-1/4 inches from the lower edge of facing.	Hand or 301	Hopper			
	d. Turn under the bottom edge of facing at the mark and baste along the folded edge.	Hand or 301	Hopper			
48.	Tack facing to interlining.					
	a. Tack the right and left facing-lining seam allowance to the respective coat front interlining from approximately 2-1/2 inches from bottom edge of coat to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
49.	Baste front linings to coat.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat, and baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
	b. Baste the front lining to the coat, starting at the lower end of the chest pleat, continuing along lower edge of armhole approximately 2 inches from the edge and ending at the side seam. Match side seams of coat and lining and continue basting as close as possible to the side seam and then across the bottom towards the front approximately 4 inches from piped bottom edge of coat.	Hand or 301	Hopper			
50.	Join lining at center back.					
	Finished appearance. The lining shall be carefully joined at center back without gathers, puckers or pleats. The seam shall start and finish evenly. The folded edge of the center pleat, on the outside of the lining, shall be towards the left side. The center back seam of the lining shall be between the fold.					
	a. Position the back parts of lining and join together at the center with a 3/8-inch seam.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
51.	Baste back lining to coat.					
	a. Fold the back lining, forming approximately a 1-inch-wide pleat at the center back. Baste the back lining to the coat along the center pleat from the top end to approximately 4 inches from the bottom finished edge of coat.	Hand or 301	Hopper			
	b. Baste back lining to coat starting at side seam and continuing approximately 3 inches from the armhole and shoulder edges.	Hand or 301	Hopper			
52.	Hem bottom edge of lining.					
	Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The hem shall be 3/4 ±1/8 inch wide. The lining securing straps shall be positioned on the back in line with back seam of coat.					
	a. Hem the bottom edge of body lining with the raw edge turned under and with one end of the securing straps positioned and caught in the stitching 1/16 inch from the upper folded edge of hem.	301	EFb-1	12-16	A	A
53.	Tack the lining securing straps to bottom of coat.					
	Finished appearance. The lining securing straps when tacked to the bottom edge of coat shall not cause twists or other distortions to either the coat or the lining. The end of the securing straps shall finish between the piping at bottom edge of coat and the skirt seam allowance. In the finished coat, the lining shall not be visible below the bottom					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
53.	Tack the lining securing straps to bottom of coat. (cont'd)					
	edge of coat.					
	a. Position and securely tack the free end of the securing straps to the piping at the bottom edge of coat through the skirt seam allowance.	301			A	A
	b. Position the bottom edge of the lining so that in the finished coat, the lining shall not be visible below the bottom edge of coat. Fold the lining securing straps across the width and stitch approximately 1/4 inch from the folded end in order to hold the lining in position.	301	OSf-1		A	A
54.	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the back lining even with the neck.					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck.					
55.	Make eyelets in fronts.					
	Finished appearance. The eyelets shall be worked with the purling on the outside of the coat, and shall finish with a 1/8-inch diameter opening. All stitches shall be securely caught in the fabric.					

Source: https://assist.dla.mil -- Downloaded: 20260-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
55.	Make eyelets in fronts.(cont'd)					
	a. Mark location for eyelets on the right and left front for removable buttons. The mark for the eyelet shall be between the braid strands at the top end of each harp.					
	b. Make an eyelet at each of the marks through all plies.	Eyelet		22 per eyelet	A	A
56.	Make buttonholes.					
	Finished appearance. The buttonholes shall be clean cut, well made, well worked over gimp to fit 40-line insignia buttons. The gimp and thread shall be pulled through to the outside of the front. The purling of the buttonholes shall be on the facing side. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of coat. The buttonholes shall be cut-first type.					
	a. Remove the basting on the unstitched portion of the braid.					
	b. Make a horizontal eyelet-end square bar type buttonhole cut 1-1/8 inches long at each of the marks.	Button-hole		60 stitches per buttonhole	B	F (silk)
	c. Securely bartack the end of each buttonhole catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bar-tack		21 per bartack	A	A (silk)
	d. Rebaste the unstitched portion of the braid around the buttonholes and complete that portion of the stitching through all plies (see Figure 7).					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
57.	Press front of coat. Finished appearance. Fronts shall finish smooth and flat without distortion, with all edges uniformly worked out. a. Press the front of coat and braid smooth and flat with a suitable pressing machine, removing the fullness.					
58.	Baste shoulder pad to coat. a. Insert shoulder pads between interlining and chest padding of coat fronts. Securely tack the pad to the interlining and chest padding only.	Hand or 301	Hopper			
59.	Seam shoulders. Finished appearance. The shoulder seam shall finish without a distorted appearance. a. Join the back to the fronts at the shoulders with a 3/8-inch seam, working in the fullness on the back in accordance with good manufacturing practice. b. Spread open the shoulder seam and press flat, holding the shoulders short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
59.	Seam shoulders. (cont'd)					
	c. Position the front lining and coat front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn the coat on the inside.	Hand or 301	Hopper			
60.	Baste back lining and facing-lining assembly at shoulders.					
	a. Turn under and lap the shoulder edge of the back lining on the facing-lining assembly. Baste lining along the folded edge of the back lining with the top end of the chest pleat caught in the basting.	Hand				
61.	Seam neckline with size label and coat hanger.					
	Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label shall be positioned between the ends of the coat hanger and the ends of the coat hanger shall be positioned so that in the finished coat, the hanger opening shall be 2 ±1/8 inches long when measured along the lower edge of collar lining.					
	a. Join facings and back lining to coat at the neckline from collar notch to collar notch, with a 1/4-inch seam and with the upper edge of the size label and the ends of the hanger positioned and caught in the stitching at the inside center back.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
61.	Seam neckline with size label and coat hanger. (cont'd)					
	B. Press the neckline of the coat smooth and flat with a heated pressing iron or pressing machine.					
62.	Set collar with lining.					
	Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar.					
	a. Mark the neckline on the outside 3/8 inch from collar notch up to the shoulder seam and gradually to within 1-1/4 to 1-3/8 inches at the center back for position of collar.					
	b. Position the collar with the lower edge lapped on the outside top edges of the coat at the mark.					
	c. Seam the collar from end to end, to the coat, as close as possible to, but not on top of, the stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining.	301	LSa-1	12-16	A (silk)	A
63.	Set sleeves.					
	Finished appearance. The armhole-sleeve seam shall finish without twists, gathers, puckers or pleats.					
	a. Position sleeves on outside of coat at the armholes, with backarm seam of sleeve matching the side back seam, and with notch in top sleeve and front matching.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
63.	Set sleeves. (cont'd)					
	b. Join the sleeve to the coat with a 3/8-inch seam, distributing the fullness in accordance with good manufacturing practice.	301	SSa-1	12-16		A
	c. Press the entire armhole smooth and flat with a heated pressing iron, exercising care not to stretch the armhole. Spread open upper part of the armhole-sleeve seam from the backarm seam of the sleeve to approximately midway between shoulder seam and notch at front edge of armhole and press smooth and flat with a heated pressing iron.					
	d. Fold the excess material at armhole pit up to the line of stitching of the armhole sleeve seam, forming a hinge effect. The fold shall extend from the armhole notch to approximately 4 inches from the backarm seam.					
	e. Press the fold smooth and flat with a heated pressing iron.					
64.	Baste armhole.					
	a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing fullness evenly. Turn coat on the outside.	Hand or 301	Hopper			
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of sleeves to the front notch of coat.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
65.	Set underarm shields to coat .					
	a. Position the underarm shield on the lining side of coat with the raw edges even with lower edge of armhole.					
	b. Baste the underarm shields to the coat along the vertical center and top, side and bottom edges.	Hand or 301	Hopper			
66.	Stitch sleeve head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					
	a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam, and with the one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole-sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.	301	SSa-1	4-6	24/4	24/4
	c. The underarm shield may be basted to the armhole prior to stitching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
67.	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (silk)	
68.	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve and sleeve lining matching.					
	b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge from backarm seam of sleeve to the front edge of the shield.	Hand		8-10	C (silk)	
	OR					
	c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operations 68a. above.	301	SSa-1	12-16	A	A
	OR					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
68.	Fell sleeve lining at armhole. (Cont'd).					
	d. Machine stitch the lower edge of the sleeve lining, at the armhole on the inside from forearm seam to backarm seam and stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling.	Machine		8-10	C (silk)	
	NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.					
69.	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of the coat starting at the bottom edge of the lining and continuing along the back and bottom edges of facing to the front edge of coat.	Hand		8-10	C (silk)	
	b. Fell the folded edge of the facings to the piping along the top edge from collar notch to front edge of coat.	Hand		8-10	C (silk)	
70.	Sew hooks and eyes to collar (see Figure 8).					
	Finished appearance. The hooks shall be positioned on the collar so that in the finished coat the top and bottom hooks shall be approximately 1/4 inch from top and bottom edges respectively of collar, and the remaining hook shall be midway between top and bottom hooks. The eyes shall be positioned to engage the hooks, effecting a flat, smooth closure at front of collar without misalignment or gapping.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
70.	Sew hooks and eyes to collar (see Figure 8).(Cont'd)					
	a. Position and securely sew 3 hooks to the right end and 3 eyes to the left end of the collar.	Hand		16 per hook	C (silk) (double thread)	
71.	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (silk)	
	b. Turn under the end and top edge of the lining at the right and left end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge of the end to the stitching joining the lining to the collar.	Hand		8-10	C (silk)	
	c. Turn under and fell the lower edge of the collar lining to the coat from end to end, catching the turned-under portion of the lining at the right and left end in the felling.	Hand		8-10	C (silk)	
	d. The lower edge of the collar lining may be basted to coat prior to felling.	Hand		8-10	C (silk)	
	e. Position the collar tab on the inside of collar at the left and with the collar tab extending approximately 3/4 inch beyond the front end of collar. Fell top, back and bottom raw edge of tab to collar lining, and stitch and back stitch the front end of tab approximately 1/4 to 3/8 inch from the eye.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
72.	Clean coat. a. Pull all basting thread, trim and remove any loose ends of thread, and remove any spots, stains and tickets without injury to the material. b. Buttonholes at front closure shall be examined for exposure of coat front interlining cloth. The exposed interlining shall be colored with a reddish indelible ink.					
73.	Press coat. a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. c. Press the entire collar smooth and flat. d. Press the upper front on a body machine, shrinking and properly shaping the chest. e. Press the lower fronts smooth and flat. f. Press the sides, working the fullness towards the back. g. Press the back smooth and flat, removing all fullness.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
73.	Press coat. (cont'd) h. Press the sleeves smooth and flat, creasing at the backarm and forearm without injury of the buttons on the ornamental sleeve cuffs. The backarm crease shall be on the backarm seam. The forearm and backarm crease shall extend uniformly to a point 3 to 3-1/2 inches below the base of the armholes. i. Block the shoulders to remove fullness and press shoulders smooth on a shoulder shaping machine. j. Press the armholes solid from the inside, creasing the armholes at the front, back and armpit. The armpit and the back of the armhole shall be held short while pressing. k. Block the armholes on a pressing buck, shrinking the top sleeves. l. Press lower edge of coat smooth, flat and even. Remove all impressions on the side and center back seam allowances. Press linings throughout, removing all wrinkles and creases. Press the front and back lining pleats smooth and flat. Remove all gloss marks.					
74.	Mark for buttons. a. Mark the location for sewing seven 40-line insignia buttons to the right front, to properly engage with buttonholes of the left front.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
75.	Attach and sew on buttons. Finished appearance. The buttons shall be aligned with the buttonholes to secure a smooth and complete closure without bulging or misalignment. a. Punch a hole for a button on each back seam at the skirt seam. Insert the shank of a 40-line insignia button and secure with a reinforcement disc and ring toggle. b. Attach 40-line insignia buttons to each front by inserting the shank of the buttons through the eyelets and securing by ring toggles. c. Sew one 40-line insignia button at each of the marks on the right front through all plies.	Hand		8 wraps (double thread)	24/4	
	d. The insignia buttons on the front shall be sewn with the head of the eagle upright.					
76.	Set attachments for epaulet (see Figure 1). Finished appearance. The attachments shall be securely attached without causing distortion to the shoulder. Positioning and orientation of attachments for epaulets on the shoulder and with each other shall be as specified in Figure 1. a. Position one end of the long metal loop (strap loop) approximately 3/8 inch beyond shoulder seam and approximately 1-1/4 inches from the armhole seam. The loop shall be parallel with the armhole seam. Tack both ends of the loop through the punch holes to the coat with scarlet thread.	Hand		6 (minimum)	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
76.	Set attachments for epaulet. (cont'd)					
	b. Position the oval loop (strap eye) approximately 4-3/4 inches from the armhole seam and approximately 3/8 inch in front of the shoulder seam. Tack around the oval loop through the punch holes with scarlet thread.	Hand		6 (minimum)	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II - Coat measurements 1/

Size	Breast 2/	Back length 3/	Sleeve length 4/
		Short	
	inches	inches	inches
34	35	28-3/4	17-1/2
35	36	28-7/8	17-1/2
36	37	29	17-1/2
37	38	29-1/8	17-1/2
38	39	29-1/4	17-1/2
39	40	29-3/8	17-1/2
40	41	29-1/2	17-1/2
41	42	29-5/8	17-1/2
42	43	29-3/4	17-1/2
44	45	30	17-1/2
46	47	30-1/4	17-1/2
		Regular	
	inches	inches	inches
34	35	29-3/4	18-1/2
35	36	29-7/8	18-1/2
36	37	30	18-1/2
37	38	30-1/8	18-1/2
38	39	30-1/4	18-1/2
39	40	30-3/8	18-1/2
40	41	30-1/2	18-1/2
41	42	30-5/8	18-1/2
42	43	30-3/4	18-1/2
44	45	31	18-1/2
46	47	31-1/4	18-1/2
		Long	
	inches	inches	inches
34	35	30-3/4	19-1/2
35	36	30-7/8	19-1/2
36	37	31	19-1/2
37	38	31-1/8	19-1/2
38	39	31-1/4	19-1/2
39	40	31-3/8	19-1/2
40	41	31-1/2	19-1/2
41	42	31-5/8	19-1/2
42	43	31-3/4	19-1/2
44	45	32	19-1/2
46	47	32-1/4	19-1/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table II - Coat measurements 1/
(cont'd)

Extra Long

Size	Breast 2/	Back length 3/	Sleeve length 4/
	inches	inches	inches
34	35	32-1/4	20-1/2
35	36	32-3/8	20-1/2
36	37	32-1/2	20-1/2
37	38	32-5/8	20-1/2
38	39	32-3/4	20-1/2
39	40	32-7/8	20-1/2
40	41	33	20-1/2
41	42	33-1/8	20-1/2
42	43	33-1/4	20-1/2
44	45	33-1/2	20-1/2
46	47	33-3/4	20-1/2

1/ Tolerance on all measurements ± 3/8 inch.

2/ Breast measurement taken with coat buttoned, from folded edge to folded edge in line with pit of armhole; multiply by 2.

3/ Back length measurement taken along center back seam from lower edge of collar to bottom edge of coat.

4/ Sleeve length measurement taken along forearm seam from pit of armhole to bottom edge of sleeve.

*3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the levels set by the applicable acceptable quality levels (AQL's).

3. QUALITY ASSURANCE PROVISIONS

*4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

*4.1.1 Certificate of compliance. Where certificate of compliance is submitted, the Government reserves the right to check test such items to determine the validity of the certification.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

*4.2 Inspection. Inspection shall be in accordance with the provisions set forth in MIL-STD-105, except where otherwise indicated herein.

*4.2.1 First article inspection. When first article is required, inspection shall be performed on a completely fabricated coat for conformance to all provisions of this specification.

*4.2.2 Component and material inspection. In accordance with 4.1 above, components and materials shall be tested in accordance with all the requirements of referenced specifications, figures and standards unless otherwise excluded, amended, modified or qualified in this specification or applicable purchase document. In addition to testing provisions contained in subsidiary specifications, figures and standards, testing shall be performed on components listed in Table III for characteristics noted. Wherever applicable, tests shall be conducted in accordance with FED-STD-191. When the "Results reported as" columns are not indicated, they shall be reported as required by the referenced test method. All test reports shall contain individual values utilized in expressing the final results.

*4.2.2.1 Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following. The lot shall be unacceptable if one or more sample units fail to meet any test requirement specified herein.

Lot Size	Sample Size
800 or less	2
801 to 22,000 inclusive	3
22,001 and over	5

The unit for expressing lot sizes and sample unit for testing each component shall be in accordance with applicable subsidiary specifications and as follows:

Component	Lot sizes expressed as:	Sample unit for testing
Cloth, Cotton Buckram (collar interlining)	yards	2 yards full width
Hook and eye	100 each	2 each, hook and eye
Strap eye	100 each	2 each
Strap loop	100 each	2 each
Ornamental braid	yards	5 yards

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test methods

Components	Characteristics	Rqmt. para.	Test method	No. Det. per S/U	Results reported as:
Cloth, Cotton, Buckram, (collar interlining)	Material identification 1/	3.3.7.1	1200	1	Pass or Fail
	Weave (single ply)	3.3.7.2	Visual	1	Pass or Fail
	Texture-threads per inch (single ply) -warp -filling	3.3.7.3	5050		
	Resistance to: -wet (dry) cleaning (laminated cloth)	3.3.7.4	5622 2/		
	-accelerated aging (laminated cloth)	3.3.7.4	5850 3/		
	perspiration	3.3.7.4	5680 4/		
	Stiffness, inch-lb. -original	3.3.7.4.1	5202 5/		
	-after wet (dry) cleaning	3.3.7.4.1	5622 2/ 5202		
	-after accelerated aging	3.3.7.4.1	5850 3/ 5202	10	
	-after perspiration	3.3.7.4.1	5680 4/ 5202	10	
	Weight oz. per sq. yd. Breaking strength (min) (lbs) (laminated cloth) -warp direction -filling direction	3.3.7.4.2 3.3.7.4.3	5041 5100		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test methods

Components	Characteristics	Rqmt. para.	Test methods	No. Det. per S/U	Results reported as:
Ornamental braid	Weave	3.3.15	Visual	1	Pass or Fail
	Wt., oz.	3.3.15.	5041		
	gross yards	3.3.15	4.3.2	1	To nearest 0.1 oz.
	Texture (picks & ends)	3.3.15	Visual	5	Avg. of 5 det. to nearest whole no.
	No. of Carriers	3.3.15	Visual	1	To nearest no.
	Shrinkage 6/	3.3.15	5558		
	Breaking strength 7/	3.3.15	5100		
	Colorfastness to:				
	-wet (dry) cleaning	3.3.15	5622		
	-light	3.3.15	5660		
Hook and Eye	Material identification 1/	3.3.17	Std Comm'l	1	Pass or fail
	Finish	3.3.17	4.3.1.2	1	Pass or fail
Attachment for epaulets	Material identification 1/	3.3.18	FED-STD-151	1	Pass or fail

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test methods (Cont'd)

Components	Characteristics	Rqmt. para.	Test methods	No. Det. per S/U	Results reported as:
	Design	3.3.18		1	Pass or fail
	Measurements	3.3.18			Pass or fail
	Finish	3.3.18	4.3.1		Pass or fail

1/ Accept on certificate of compliance.
2/ Except that the colorfastness shall be evaluated after three wet cleaning cycles.
3/ Except that the aging exposure shall be limited to 5 hours at a temperature of 100°C.
4/ Except that the material shall be immersed in the specified solutions for 20 minutes and air-dried.
5/ Except that a moment weight of 1 pound shall be used.
6/ Except that the width of the test specimen shall be the full width of the braid.
7/ Breaking strength shall be determined on the full width of the braid and the jaw dimensions shall be greater than the width of the braid.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*4.2.2.2 In-process inspection. Inspection shall be performed during manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

*4.2.3 Examination of end item. The end item shall be examined for defects listed in 4.2.3.2 through 4.2.3.4. The sample unit shall be one coat.

*4.2.3.1 Classification of defects. All defects shall be classified as indicated below, except those with an asterisk (*) in classification column, which shall be classified as follows:

Major defect - When seriously affecting appearance or serviceability

Minor A defect - When affecting appearance or serviceability but not seriously.

*4.2.3.2 General defects. General defects shall be classified as follows:

Examine	Defect	Classification Major	(*) Minor A	Minor B
Buttonholes (construction)	a. One or more omitted or added.	X		
	b. Wrong type or uncut.		X	
	c. Not corresponding to size of button (front): -too small, not permitting button to enter buttonhole.	X		
	-too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		X	
	d. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	X		
	e. Bartack missing or loose on: -one buttonhole.		X	
	-two or more buttonholes.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	(*) Minor A	Minor B
	f. Bartack misplaced, not serving intended purpose on:			
	-one buttonhole.			X
	-two or more buttonholes.		X	
	g. One or more broken stitches in:			
	-one buttonhole.		X	
	-two or more buttonholes.	X		
	h. More than 2 skipped stitches in:			
	-one buttonhole.			X
	-two or more buttonholes.		X	
	i. Ragged edges, affecting appearance or exposed interlining not colored with reddish indelible ink.			X
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		X	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified:			
	-one or two stitches.			X
	-three or more stitches.		X	
	l. One or more buttonholes finished with purling on the outside of fronts.	X		
Buttons or ring toggles	a. Missing, loose, broken or defective:			
	-1 button or ring toggle.		X	
	-2 or more buttons or 2 or more ring toggles.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*) A	Minor B
	b. Not specified type, size, color or finish.	X	
	c. One or more buttons on right front sewn with the head of the eagle in other than upright position.		X

NOTE: Buttons shall be considered defective if they have sharp, rough or cracked edges; scratches; blemishes or imbedded foreign matter on face side of button, loose shanks; or badly shaded.

Cleanness	a. One or more removable spots or stains clearly noticeable, outside of coat.	X	
	b. One or more removable spots or stains clearly noticeable, inside of coat.		X
	c. One or more spots or stains of an obvious permanent nature.	*	
	d. Thread ends not trimmed, loose thread ends, 2 or more shade markings, or bastings not removed throughout garment (to be scored when the condition exists on major portion of coat).		X
Components and assembly	a. Any defective component or defect of assembly (not herein classified).	*	
	b. Any component part or required operation omitted (not herein classified).	*	
Cutting	a. Any component part of basic wool material not cut in accordance with directional lines on patterns, or in accordance with specification requirements.	X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	b. Cloth gabardine (white) for piping cut on the bias.		X	
	c. Any lining part not cut in accordance with directional lines on patterns.		X	
Eyelets (construction)	a. One or more omitted or added.	X		
	b. Wrong type.		X	
	c. Eyelet not securely caught on fabric, causing stitching to pull away from fabric.	X		
	d. Diameter of inside opening less than 1/8 inch or more than 1/4 inch.			X
	e. One or more eyelets uncut.		X	
	f. One or more broken stitches in: -one eyelet. -two or more eyelets.		 X	 X
	g. More than two skipped stitches in one or more eyelets.		X	
Hooks and eyes	a. One hook or eye omitted.		X	
	b. Two or more hooks or eyes omitted.	X		
	c. Not specified type or size.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	d. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hooks and eyes are fastened.		X	
	e. Hook or eye not securely tacked to ends of collar.		X	
	f. Hooks or eyes misplaced, i.e., hooks positioned on left end and eyes positioned on right end of collar.		X	
Material defects and damages	a. Any weakening defect such as smash, multiple float, loose slub, etc., that may develop into a hole.	*		
	b. Any hole (including drill holes).	*		
	c. Shade bar, unsightly slubs, etc: -on outside. -on inside.	 *		 X
	d. Needle chews which may develop into a hole.	*		
	e. Scissors or knife cuts, tear, mend or burn.	*		

Note: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows:

Material defect.	No defect
Workmanship damages.	Minor B defect

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	(*)	Minor A	Minor B
Ornamental braid	a. Not specified, type, size or color.	X			
	b. One or more omitted.	X			
Pressing	a. Burned or scorched.		*		
	b. Pressing omitted (entire garment).			X	
	c. Poorly pressed (unless otherwise classified).			X	
	d. Armhole stretched, affecting appearance.			X	
	e. Basting or pressing impressions not removed on major portion of coat.				X
	f. Gloss not removed throughout coat, affecting appearance.				X
	g. Armholes not blocked or blocked poorly.			X	
	h. Inside of armholes not pressed solid.			X	
	i. Edges bulky, i.e., not pressed solid, affecting appearance.				X
	j. Sleeves not creased as required on forearm and backarm seams.				X
	k. Armhole-sleeve seam not pressed open from backarm seam of sleeve and across top as specified.			X	
	l. Linings not pressed smooth.				X

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Seams and stitchings	a. Accuracy of seaming:			
	1. Any seam twisted, puckered or pleated, affecting appearance.		X	
	2. Part of garment caught in any unrelated operation or stitching.	*		
	3. Unsightly hand felling or blindstitching exposed on outside of coat, affecting appearance.		X	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.			X
	5. Wrong color of thread used on outside of coat, affecting appearance.	*		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular, i.e., unevenly gaged, or various stitchings not uniform, affecting appearance		X	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			X
	c. Open seams:			
	1. On outside:			
	-up to 1/4 inch inclusive			X
	-more than 1/4 inch but not more than 1/2 inch.		X	
	-more than 1/2 inch.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	(*) Minor A	Minor B
	2. On inside: -more than 1/2 inch (except machine felling).		X	
	-up to 1/2 inch inclusive (except machine felling).			X
	-up to 1 inch inclusive (machine felling).			X
	-more than 1 inch (machine felling).		X	

Note: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.

	d. Raw edges:			
	1. On outside:			
	-up to 1/8 inch inclusive.			X
	-more than 1/8 inch but not more than 1/4 inch.		X	
	-more than 1/4 inch.	X		
	2. On inside:			
	-more than 1/8 inch but not more than 1/4 inch.			X
	-more than 1/4 inch.		X	

Note: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.

	e. Run-offs (see classification of open seams).			
	f. Stitch tension:			
	1. Loose tension resulting in loose seam.	X		
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		X	

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	(*) A	Minor B
	3. Tight tension (stitches break when normal strain is applied).	X		

Note: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting pull in lengthwise direction of seam.

	g. Stitches per inch (excluding labels).			
	1. Less than minimum specified:			
	-one or two stitches.			X
	-three stitches.		X	
	-four or more stitches.	X		

Note: To be scored only if condition exists on major portion of seam.

	h. Stitch and seam type:			
	1. Wrong stitch or seam type.		X	
	i. Stitching skipped or broken (on edge, or raised stitching when seam is seamed, turned and stitched):			
	-1/4 inch or more but not more than 1/2 inch.			X
	-more than 1/2 inch.		X	
Shaded parts	a. On outside			
	1. Any shaded part (except ornamental braid).		*	
	2. Any ornamental braid shaded, affecting appearance.		X	
	b. On inside:			
	1. Any lining part badly shaded (except sleeve lining).		X	
	2. Any sleeve lining part badly shaded or pairs not matching each other.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	(*) Minor A	B
Strap eyes and strap loops	a. Missing, loose, or defective:			
	-one or both strap eyes.	X		
	-one or both strap loops.	X		
	b. Not specified type, size, color or finish.		X	

4.2.3.3 Detailed defects (coat buttoned on form or spread out on a table). Detailed defects with coat buttoned on form or spread out on a table shall be classified as follows:

Examine	Defect	Classification Major	(*) Minor A	B
Collar (construction & setting)	a. Interlining omitted (buckram or silesia).	X		
	b. Interlining (buckram or silesia) tight or twisted, causing puckers on collar, affecting appearance.		X	
	c. Tight at joining to front or back, causing puckers or pleats at neck of coat, affecting appearance.		*	
	d. Piping irregular, affecting appearance.		X	
	e. Collar ends overlapping when fastened.		X	
	f. Collar ends spread open more than 3/8 inch when fastened.		X	
	g. Center of eyelets from finished ends of collar:			
	-less than 1-3/8 inches but not less than 1-1/4 inches.			X
	-more than 1-5/8 inches but not more than 1-3/4 inches.			X
	-less than 1-1/4 inches or more than 1-3/4 inches.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	(*) Minor A	Minor B
	h. One or both eyelets off-center with top and bottom edges of collar by more than 1/4 inch.			X
	i. Front finished ends of collar uneven in width by 3/16 inch or more.		X	
Alignment of front buttons and buttons	a. Not aligned, causing a noticeable bulge or twist on fronts when buttoned, affecting appearance.		X	
	b. Horizontal alignment of toggle attached buttons with sewn buttons on right front:			
	1. One or more rows out of alignment by more than 1/2 inch but not more than 1 inch.		X	
	2. One or more rows out of alignment by more than 1 inch.	X		
Ornamental braid (position, construction and setting)	a. One or more rows out of horizontal alignment by more than 1/2 inch.		X	
	b. One or more rows of braid not formed with either a figure 8 or a harp.	X		
	c. Diameter of figure 8 circle less than 27/32 inch or more than 7/8 inch.			X
	d. Back edge of second harp from the top less than 3/8 inch from finished armhole seam.		X	
	e. One or more inner circles forming figure 8 less than 1/8 inch in diameter.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	(*) Minor A	Minor B
	f. One or more rows of braid not stitched through interlining.			X
	g. Stitching of braid not started or ending at bottom of harp where the front and back cross.			X
	h. Stitching of braid not uniform, affecting appearance.		X	
	i. Ends of stitching not securely tacked on one or more braids		X	
	j. One or more braids not lying smooth, i.e., puckered, twisted, pleated or having excessive fullness, affecting appearance.		*	
	k. Braid not pressed smooth and flat.			X
	l. One or more harps not formed in accordance with Figure 7.		X	
	m. Braid loop around one or more buttonholes not properly positioned, restricting use of buttonhole for buttoning.		X	
	n. Inner edges of horizontal braid not adjacent to one another, i.e., spaced more than 1/16 inch apart on one or more braids.		X	
	o. Front edge of one or more braids on left front positioned less than 1/4 inch from piping joining seam.			X
	p. Front edge of braid out of vertical alignment with left front edge of coat by 1/8 inch or more.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major	(*) Minor A	B
	q. One or more horizontal braids not hand felled together at inner edges for full length of straight portion except at openings for buttonholes.		X	
Attachments for epaulet (position and secure sewing)	a. Bar (strap loop) attachment less than 1-1/4 inch or more than 1-3/8 inches from armhole seam at shoulder seam.			X
	b. Bar (strap loop) attachment tapering down from shoulder less than 1-3/16 or more than 1-5/16 inches from armhole seam.			X
	c. Back end of bar (strap loop) attachment less than 3/8 inch at back of shoulder seam or less than 1-3/8 inches in front of shoulder seam.			X
	d. Bar (strap loop) attachment on one shoulder not uniform with position of bar on other shoulder by 1/4 inch or more.		X	
	e. Strap eye (round attachment) less than 4-3/4 inches or more than 4-7/8 inches from armhole seam.			X
	f. Back edge of oval strap eye (round attachment) less than 3/8 inch forward of shoulder seam.			X
	g. Strap eye (round attachment) on one shoulder not uniform with position of strap eye on other shoulder by 1/4 inch or more.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major	(*)	Minor A]	B
	h. One or both strap eyes or bars (strap loop) not securely stitched to coat.			X	
	i. Thread used for attaching strap eyes or bars (strap loop) to one or both shoulders not matching color of basic fabric, affecting appearance.				X
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by: -more than 1/8 inch but not more than 1/4 inch.			X	
	-more than 1/4 inch.	X			
	b. Left front at corner longer than right front by: -more than 1/4 inch but not more than 3/8 inch.				X
	-more than 3/8 inch.			X	
	c. Right front at corner exposed beyond bottom edge of left front by more than 1/8 inch.			X	
Shoulder (construction)	a. Improperly joined or set, causing shoulder or back to twist.		*		
Shoulder pads	a. Not completely caught in armhole tacking.			X	
	b. Misplaced, not serving intended purpose, i.e., too far back or too far forward.			X	
	c. One or both pads omitted.			X	
Armholes (construction)	a. Badly stretched, affecting appearance.		*		

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	b. Taped too tight, causing puckering.		*	
	c. Crooked seam, affecting appearance.		X	
	d. Tape stitching exposed and visible on outside surface.			X
	e. Sleeve head pads not completely tacked to armholes or misplaced, not serving intended purpose.		X	
	f. One or both sleeve head pads omitted.		X	
Sleeves	a. Setting and hang:			
	1. Sleeve fullness misplaced, affecting appearance.		X	
	2. Backarm seam of sleeve not matching side back seam by:			
	-more than 1/4 inch but not more than 1/2 inch.		X	
	-more than 1/2 inch.	X		
	3. Hang of sleeves on the same coat in opposite direction by more than 2 inches.			X
	4. Sleeve tight in armhole, i.e., roll effect not present.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	b. Sleeve lining:			
	1. Twisted, tight, or short, causing bulge, twist, or puckering on outside of sleeves	*		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			X
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of sleeve.			X
	c. Construction of sleeves:			
	1. Tacking on bottom turnup to body of sleeve omitted or insecure.		X	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			X
	3. Tacking on 1 or both sleeve lining seams to sleeve seams omitted, or insecure.			X
	4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from bottom edge of sleeve.			X
	5. Cut dart on wool under-sleeve omitted.		X	
	6. One or both wool sleeve darts not pressed open, smooth and flat.			X

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	d. Sleeve cuffs:			
	1. Piping irregular, affecting appearance.		X	
	2. Top edge on top sleeve part poorly shaped, affecting appearance.		X	
	3. Height of pointed end on both sleeves varying in length by more than 1/4 inch.		X	
	4. Sleeve puckered at joining of cuff, affecting appearance.		X	
	5. Cuff puckered or twisted at joining to sleeve, affecting appearance.		X	
	6. Ends of cuff staggered at backarm seam:			
	-1/8 inch or more but not more than 1/4 inch.			X
	-more than 1/4 inch.		X	
	7. Height of cuff at point on top sleeve including piping:			
	-less than 5-3/4 inches but not less than 5-1/2 inches or more than 6-1/4 inches but not more than 6-1/2 inches.			X
	-less than 5-1/2 inches or more than 6-1/2 inches.		X	
	8. Height of cuff at backarm or front creased edges including piping.			
	-less than 3 inches but not less than 2-3/4 inches or more than 3-1/2 inches but not more than 3-3/4 inches.			X
	-less than 2-3/4 inches or more than 3-3/4 inches.		X	
	9. Point of cuff not centered between the lower forearm creased edge and the creased backarm seam of sleeves by more than 1/4 inch.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Position of buttons on sleeve cuffs.	a. Horizontal alignment of buttons on one sleeve cuff not uniform with other sleeve cuff by more than 1/4 inch.			X
	b. Buttons on one or both sleeve cuffs out of vertical alignment by more than 1/8 inch.			X
Body (outside)	a. Fitting of body linings: 1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	*		
	b. Fitting of front interlining: 1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	*		
	2. Too full, causing coat front to have a wavy appearance.	*		
Waist seam	a. Seam not pressed open.		X	
	b. Seam stretched, affecting appearance.		X	
	c. Tape set on tight, causing puckering on waist seam, affecting appearance.		X	
Lower skirt dart	a. One or both darts cut and sewn type in lieu of folded seam type.			X
	b. End on one or both darts not properly tapered, causing puckering at end of dart, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	c. Length of one or both darts less than 5 inches or more than 5-1/2 inches long.			X
	d. One or both folded darts not pressed flat as specified.			X
Upper front, side body and side back panel seams	a. One or more joining seams not spread open and pressed flat.		X	
	b. Curved side back panel seam stretched or distorted, affecting appearance.		X	
Center back and skirt	a. Joined seams below waist seam not pressed flat and towards the center of back.		X	
	b. Piping at back edge of skirt set on tight, causing puckering on back, affecting appearance.		X	
	c. Folded edge of piping extending less than 1/8 inch beyond the seam on back.		X	
	d. Buttons on each back seam at the skirt seam: -out of horizontal alignment by 1/4 inch or more.		X	
	-one or both reinforcement disc omitted.			X
Front and bottom edges	a. Front edges stretched, affecting appearance.		X	
	b. Piping set on tight, causing puckering on front, affecting appearance.		X	
	c. Front or bottom piping irregular, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	d. Bottom edge stretched, puckered or uneven, affecting appearance.			X
	e. Bottom corner of left front poorly shaped, affecting appearance.		X	
	f. Left front rolling outward below bottom button.	*		
	g. Front edge irregular, affecting appearance.		X	
	h. Piping tight on bottom edge, causing puckering on outside of coat, affecting appearance.		X	
	i. Left front not dressed as specified.		X	
Front facings	a. Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.	*		
Front buttonholes (position)	a. Position from front edge including piped edge: -less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch.			X
	-less than 1/2 inch or more than 7/8 inch.		X	
	b. More than 1/4 inch from equal spacing.		X	
	c. Bottom buttonhole above or below waist seam.		X	
	d. Unevenly spaced from front edge by more than 3/16 inch.		X	
	e. Top buttonhole less than 7/8 inch or more than 1-1/8 inches from top edge of piping (collar notch).		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Front buttons (position and secure sewing)	a. Out of vertical alignment by 1/4 inch or more.		X	
	b. Center of one or more buttons positioned from right front edge:			
	-less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch.			X
	-less than 1/2 inch or more than 7/8 inch.		X	
	c. Button stitching not caught through interlining canvas front on 1 or more buttons.	X		
	d. Button stitching caught through interlining (canvas front) but not facing:			
	-on 1 button			X
	-on 2 or more buttons		X	
Labels	a. Any required label missing, incorrect, illegible or size label not securely caught in stitching.	X		
	b. Identification label not stitched on 4 sides.		X	
	c. Bottom edge of identification label less than 3 inches or more than 5 inches from bottom finished edge of coat.			X
	d. Identification label not stitched to outside of right facing.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Hanger	a. Hanger omitted or ends not securely stitched.	X		
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along the lower edge of collar lining.		X	
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.		X	
	d. Finished width less than 1/4 inch or more than 3/8 inch wide.			X
Front facings	a. Fullness or pleats on facings between buttons, buttonholes, or between front edge and buttons or buttonholes.			X
	b. Tacking on back edge to 1 or both interlinings: -omitted.		X	
	-insecure or incomplete for a distance of more than 4-1/2 inches below shoulder seams, or more than 4 inches above bottom edge of coat.			X
	c. Felling at bottom edge of front facing or back edge of facing omitted or insecure on one or both facings.		X	
	d. Felling along folded edge of one or both facings at collar notch omitted or insecure.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Body linings	a. Excessive puckering or pleated.			X
	b. Twisted, not affecting smoothness on outside of coat.			X
	c. One or both chest pleats on shoulders omitted.		X	
	d. Folded edge of 1 or both chest pleats facing front edge of coat.			X
	e. Pleat omitted at center of back lining.		X	
	f. Pleat less than 1/2 inch in depth at center of back lining.			X
	g. Bottom hem less than 5/8 inch or more than 7/8 inch wide.			X
	h. Lining too long, i.e., exposed beyond bottom edge of coat.		X	
Lining (securing straps)	a. One or both omitted or insecure.		X	
	b. Less than 1/4 inch or more than 3/8 inch wide.			X
	c. One or both positioned more than 1 inch from back seams.			X
	d. End of one or both straps not fastened between the piping at bottom edge of coat and skirt seam allowance.			X
	e. One or both not folded and stitched across width.			X
	f. One or both not properly attached to lining hem of coat, causing twist or distortion to either the lining or coat.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	g. One or both exposed beyond bottom edge of coat.		X	
Serge or overedge stitching	a. Basic material: -omitted on one or more raw edges for cut darts and seams where specified.		X	
	b. Piping the skirt: -omitted on raw edges of one or both folded pipings.		X	
	c. Lining joined seams: -omitted on one or more seams where specified.		X	
Waist seams	a. Tape on one or both seams omitted.		X	
Underarm shields	a. One or both omitted.		X	
	b. Not two-piece lining construction.		X	
	c. Tacking on one or both shields along side or bottom edge to body lining omitted or insecure.			X
	d. Top edge not caught in armhole tacking or stitching when tacked by hand.			X
	e. Puckered, pleated, or twisted.			X
	f. One or both shields misplaced, not serving intended purpose.			X
Inside of armhole	a. Backstitching at armpit of armhole from backarm seam of sleeve to front edge of shield omitted.			X

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Collar extension tab	a. Omitted		X	
	b. Extending less than 1/2 inch or more than 1 inch beyond end of collar.			X
	c. Felling omitted or insecure at top, back, front or bottom edges.		X	
	d. Box stitching omitted.		X	
Collar lining and eyelet covers	a. Ends of collar lining not securely tacked.		X	
	b. One or both eyelet covers omitted.		X	
	c. One or both eyelet covers not covering eyelet.		X	
	d. Width of collar eyelet less than 1-5/8 inches or more than 1-7/8 inches.			X
	e. Felling on front edge and along lower corner of 1 or both eyelet covers omitted.		X	
	f. Felling along lower corner of one or both eyelet covers extending for a distance of more than 3/4 inch.			X
	g. Top or bottom hook positioned less than 1/4 inch from top or bottom edges respectively of collar.			X
	h. Remaining hook not positioned midway between top and bottom hook.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*4.2.3.4 Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

*4.2.3.5 Inspection levels and AQL's. Inspection levels and AQL's expressed in defects per 100 units (DHU) shall be as follows:

4.2.3.2 through 4.2.3.3

Inspection Level III of MIL-STD-105

AQL's	Major	1.5 DHU
	Major and Minor A (combined)	10.0 DHU
	Total Major, Minor A and Minor B (combined)	40.0 DHU

4.2.3.4

Inspection Level S-3 of MIL-STD-105

One class	4.0 DHU

*4.2.3 Examination of preparation for delivery requirements. An examination shall be made to determine compliance with packaging, packing and marking requirements of Section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully prepared for delivery with the exception that it need not be sealed. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the end item inspection lot. The inspection level shall be S-2 and the AQL shall be 2.5 DHU.

Examine	Defect
Marking (exterior and interior)	Omitted, incorrect, illegible, of improper size, location, sequence, or method of application.
Materials	Any component missing or damaged.
Workmanship	Inadequate application of components, such as incomplete closure of case liners, container flaps, loose strapping, inadequate stapling. Bulging or distortion of containers.
Content	Number of coats per container is more or less than required.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*4.3 Tests.

*4.3.1 Lacquer tests.

*4.3.1.1 Liver of sulfur. The samples to be tested shall be immersed in a 2 percent by weight chemically pure liver of sulfur (potassium sulphide) water solution, at a temperature of 100° to 110°F, for not less than 3 minutes. The samples shall then be removed and rinsed in warm, then cold, then hot water, after which they shall be wiped gently in an absorbent cellulose material or whirled to remove residual moisture, and allowed to air dry at room temperature for a period of 1 hour. There shall be no change in the appearance of the lacquered surfaces except for a slight overall yellowing and not more than 3 dark spots, each not exceeding 1/32 inch largest dimension.

*4.3.1.2 Tackiness. At room temperature (60° to 80°F) press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

4.3.2 Weight of braid per gross yards. Weigh 6 yards of braid in a relaxed condition on a balance or scale accurate to ±0.25 percent. Convert to ounces and multiply by 24 to obtain the weight of 144 yards.

5. PREPARATION FOR DELIVERY

*5.1 Packaging and packing. Unless otherwise specified (see 6.2), the coats shall be packaged in accordance with good commercial practice and packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight Classification Rules or regulations of other carriers applicable to the mode of transportation.

5.2 Markings. In addition to any special marking required by the contract or order, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES

6.1 Intended use. The coats described herein are intended for wear by enlisted male personnel of the U.S. Marine Corps Band .

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*6.2 Ordering data. Purchasers should exercise any desired options offered herein, and procurement documents should specify the following:

*6.2.1 Procurement requirements.

(a) Title, number and date of this specification
(b) Sizes required (see 1.2)
(c) Whether first article is required (see 3.2)
(d) Number of coats in first article (see 3.2)
(e) When coats shall not be packaged and packed in accordance with commercial practice (see 5.1).

*6.2.2 Contract data requirements. Data conforming to Data Item Descriptions DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902, DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on a DD Form 1423 included in the contract.


6.3 Samples and shade samples. For information regarding availability of sample coats and standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

*6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).'


*6.5 Marginal notations. The margins of this specification are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship of the last previous issue.

Preparing activity:
Navy - MC
Project No. 8405-N533


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

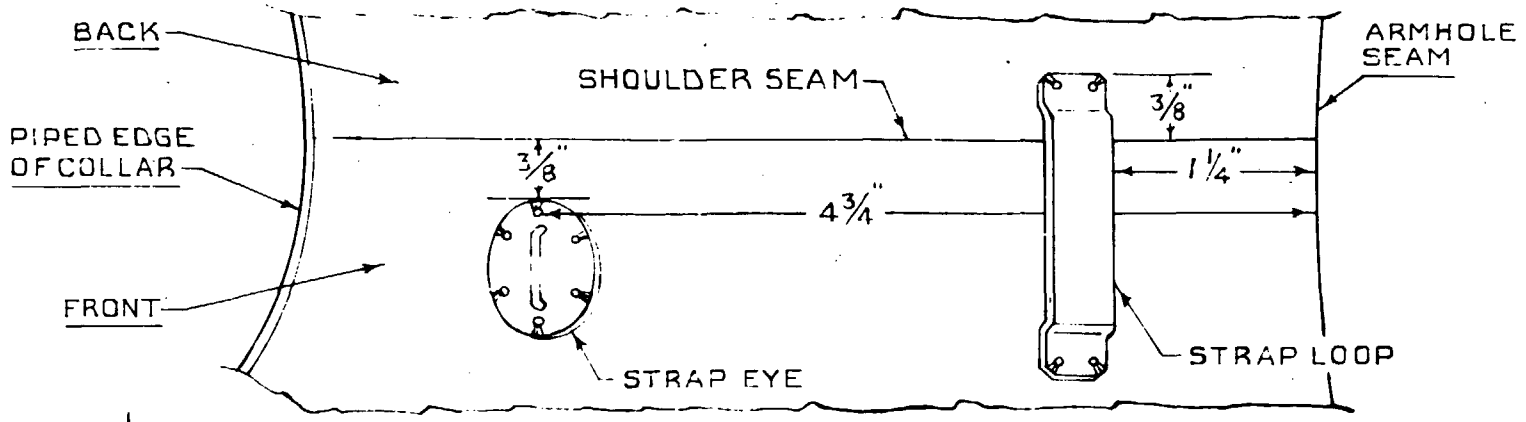


LOCATION FOR EPAULET ATTACHMENTS

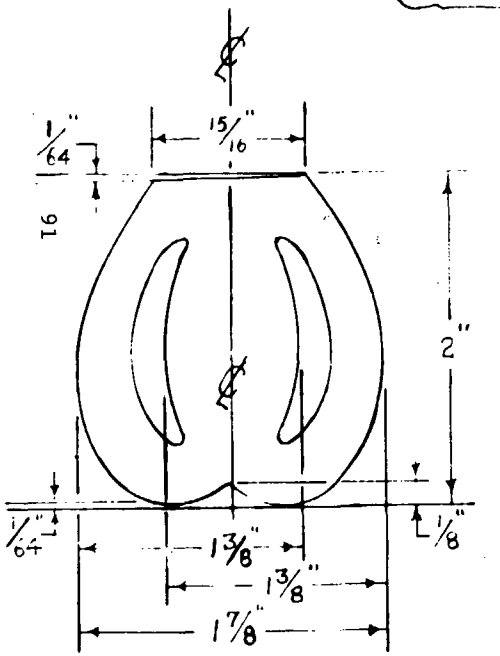

HARP

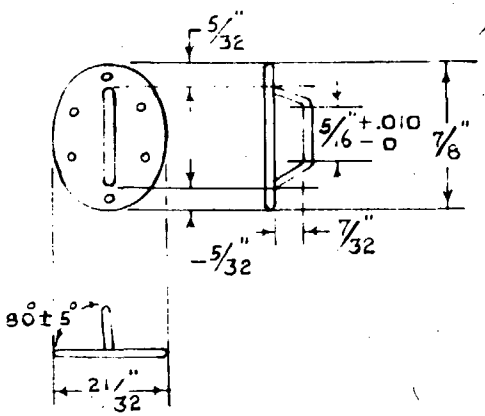

STRAP EYE

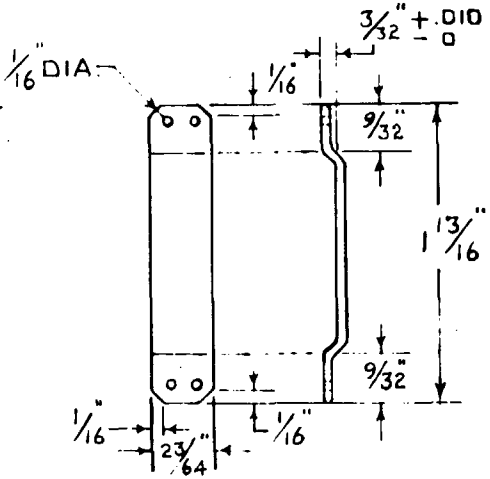

STRAP LOOP

TOLERANCES ON STRAP EYE AND STRAP LOOP UNLESS OTHERWISE SHOWN:— ± .010

MIL-C-82149A(MC)

Figure 1. Coat, Man's; Full Dress; Scarlet, U. S. Marine Band; Musician

M.C.S.A. 826:R.G.F. 31 Aug '73

Source: https://assist.dla.mil -- Downloaded: 20261O-26T04:39Z
Check the source to verify that this is the current version before use.

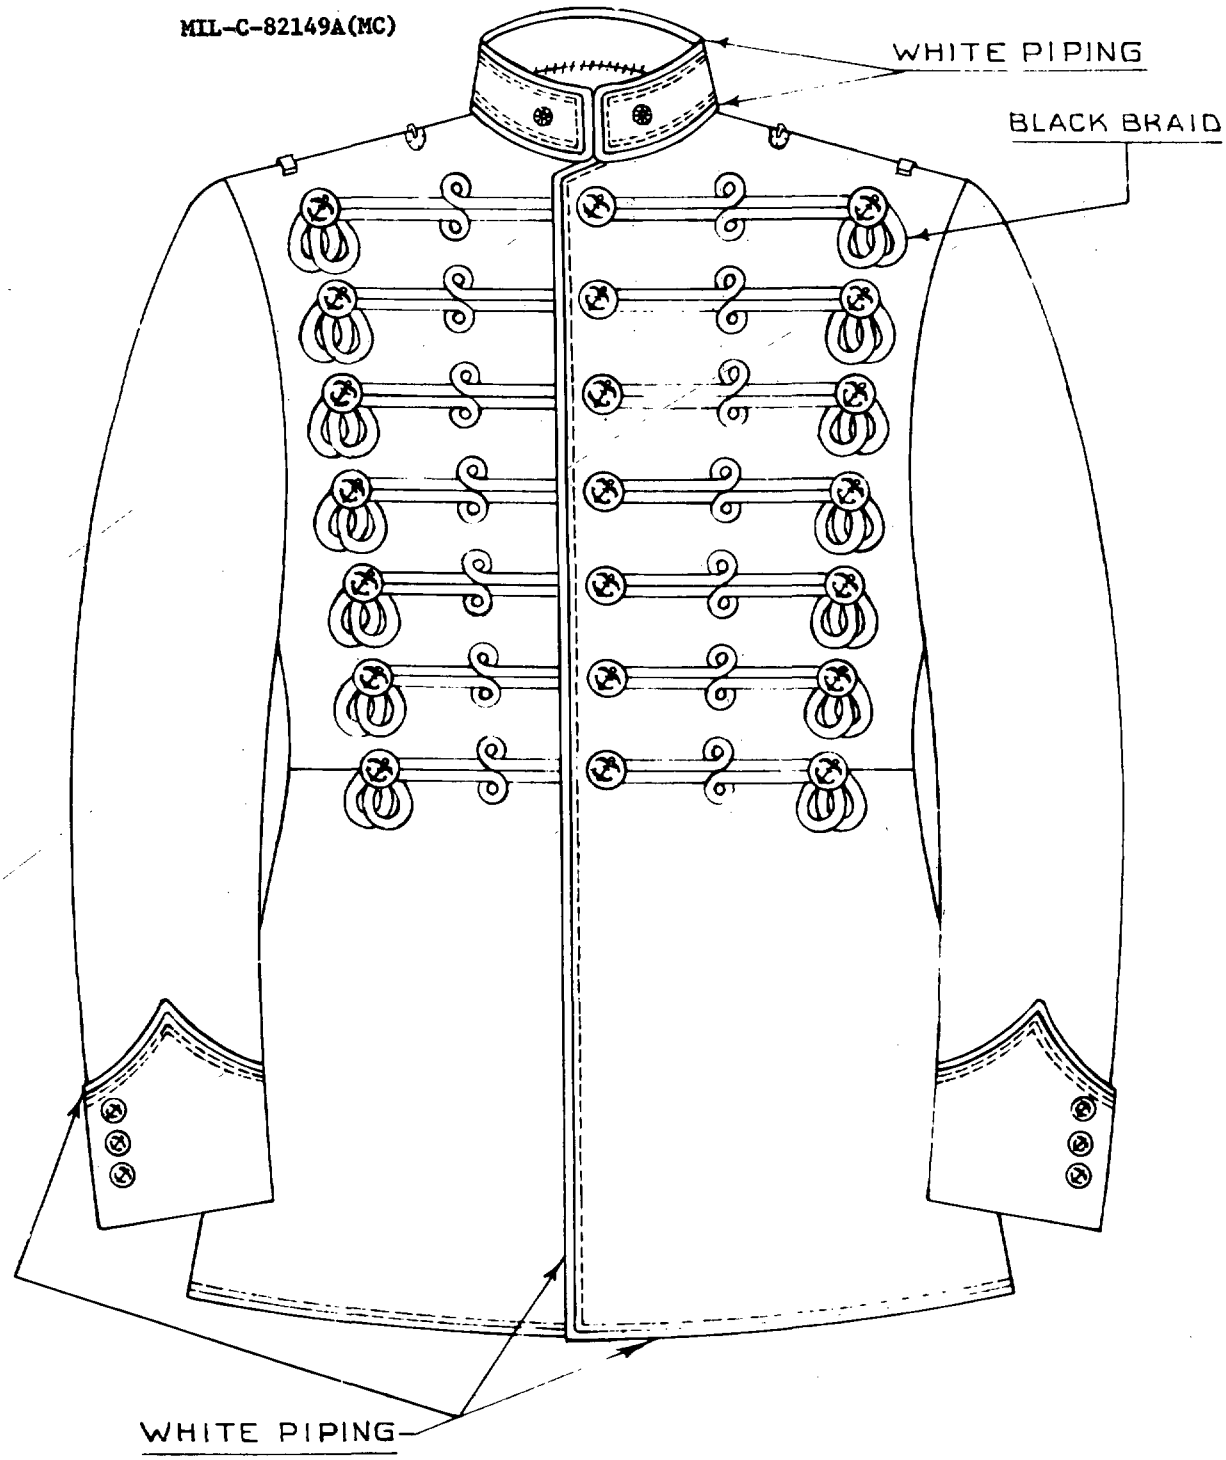


Figure 2. Coat, Man's; Full Dress; Scarlet, U. S. Marine Band; Musician

M.C.S.A.
826: R.G.F.
31 Aug '73

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

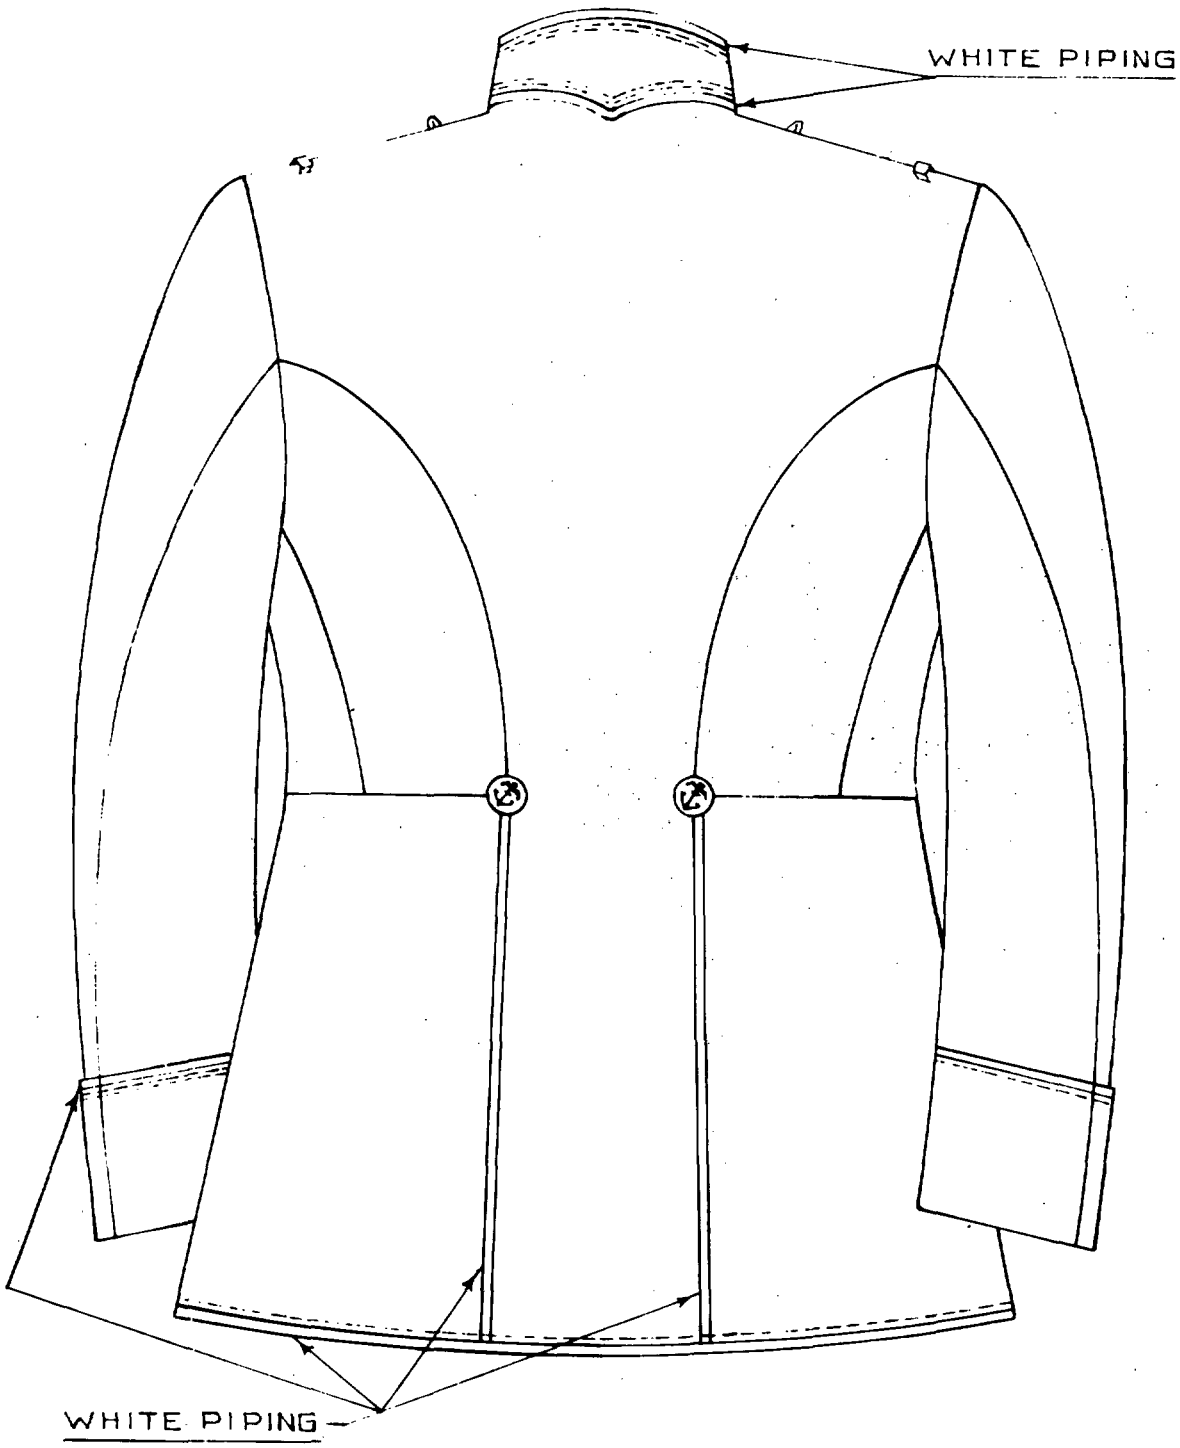


Figure 3. Coat, Man's; Full Dress, Scarlet, U. S. Marine Band; Musician

M.C.S.A.
826:R.G.F.
31 Aug '73

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

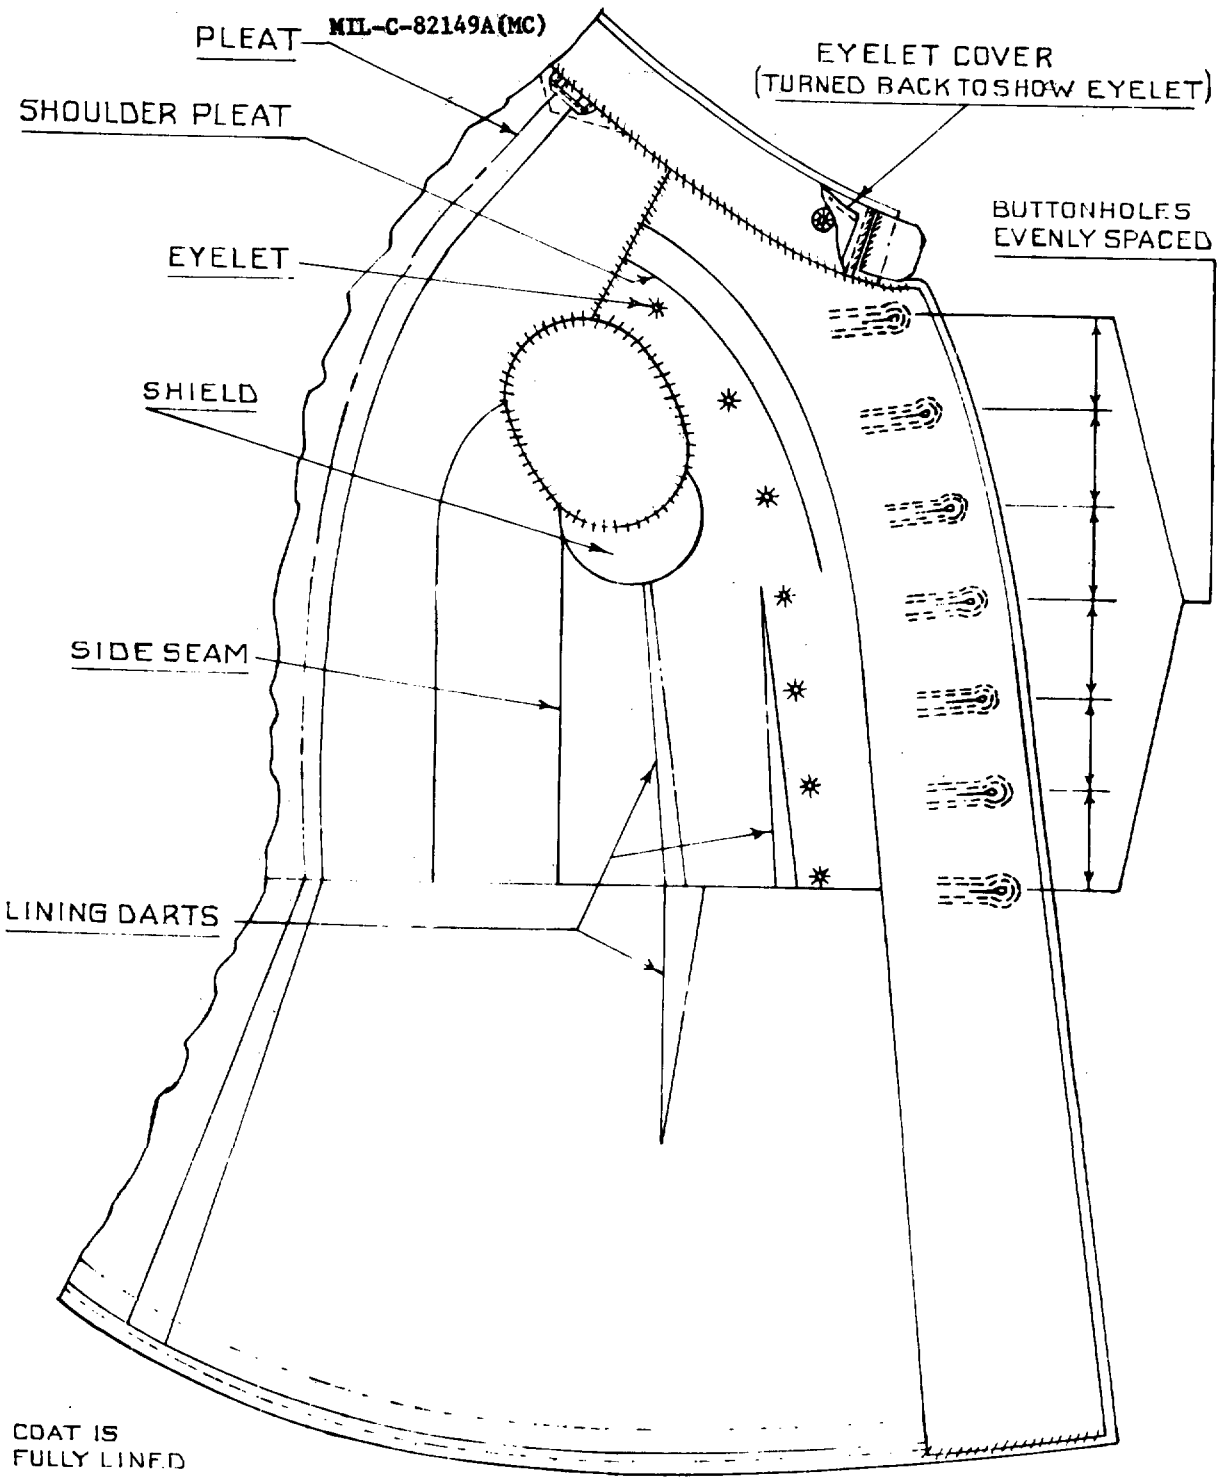


Figure 4. Coat, Man's; Full Dress; Scarlet, U.S. Marine Band; Musician

M.C.S.A. 826:R.G.F. 31 Aug '73

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.


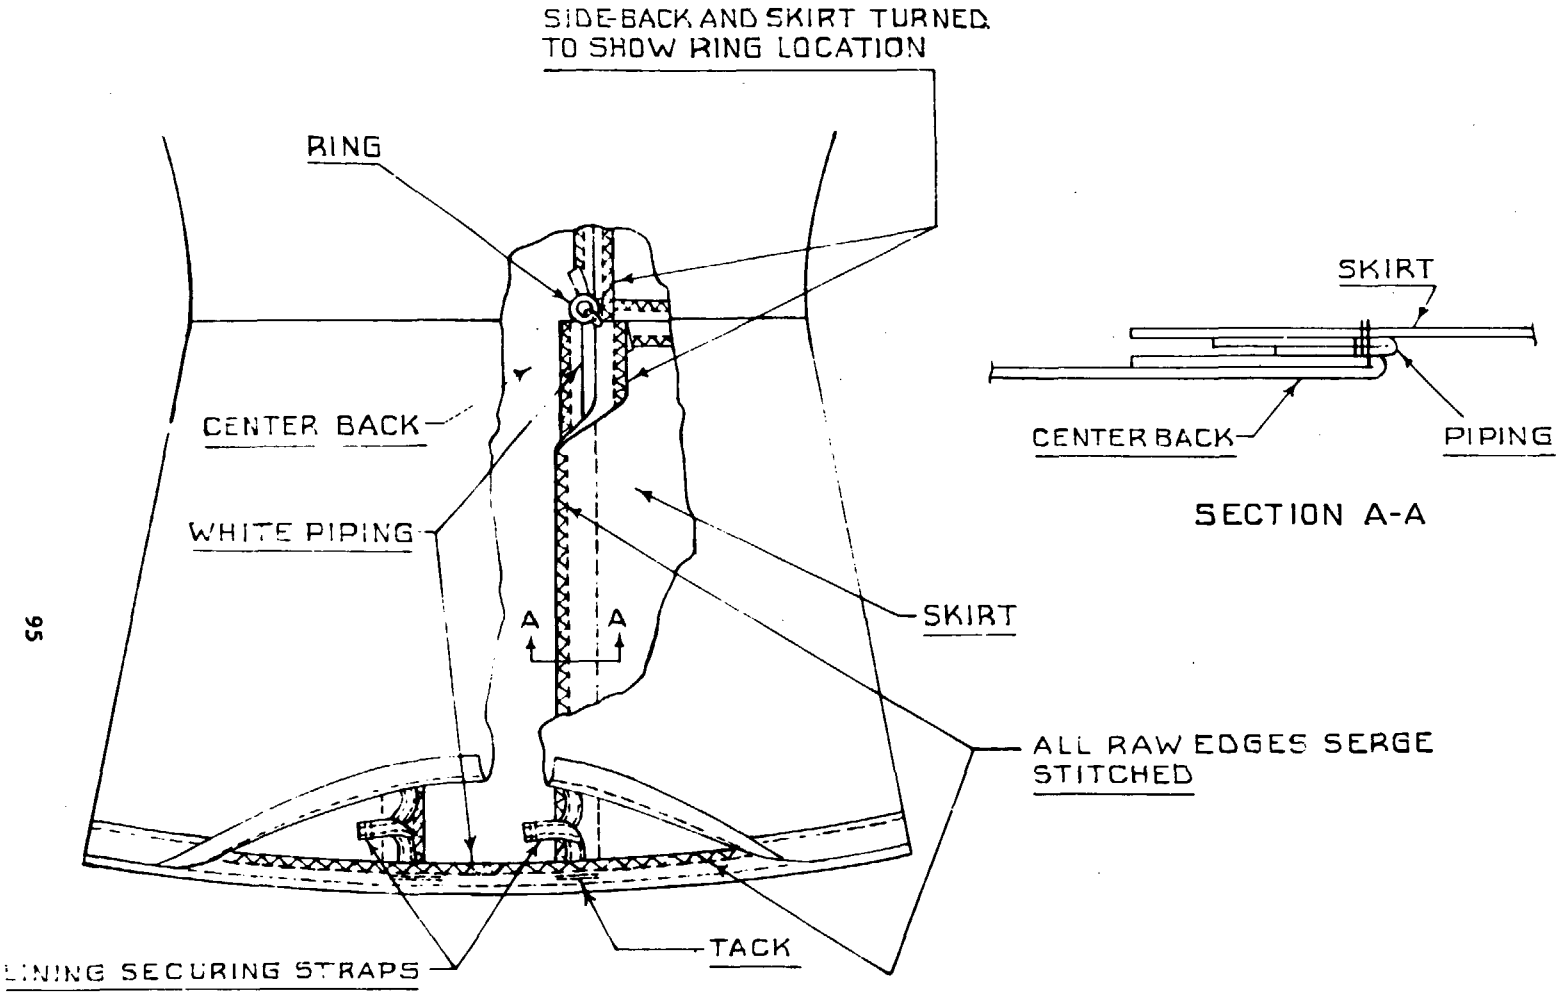


Figure 5. Coat, Man's; Full Dress; Scarlet, U. S. Marine Band; Musician

M.C.S.A. 826:R.G.F. 31 Aug '73

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

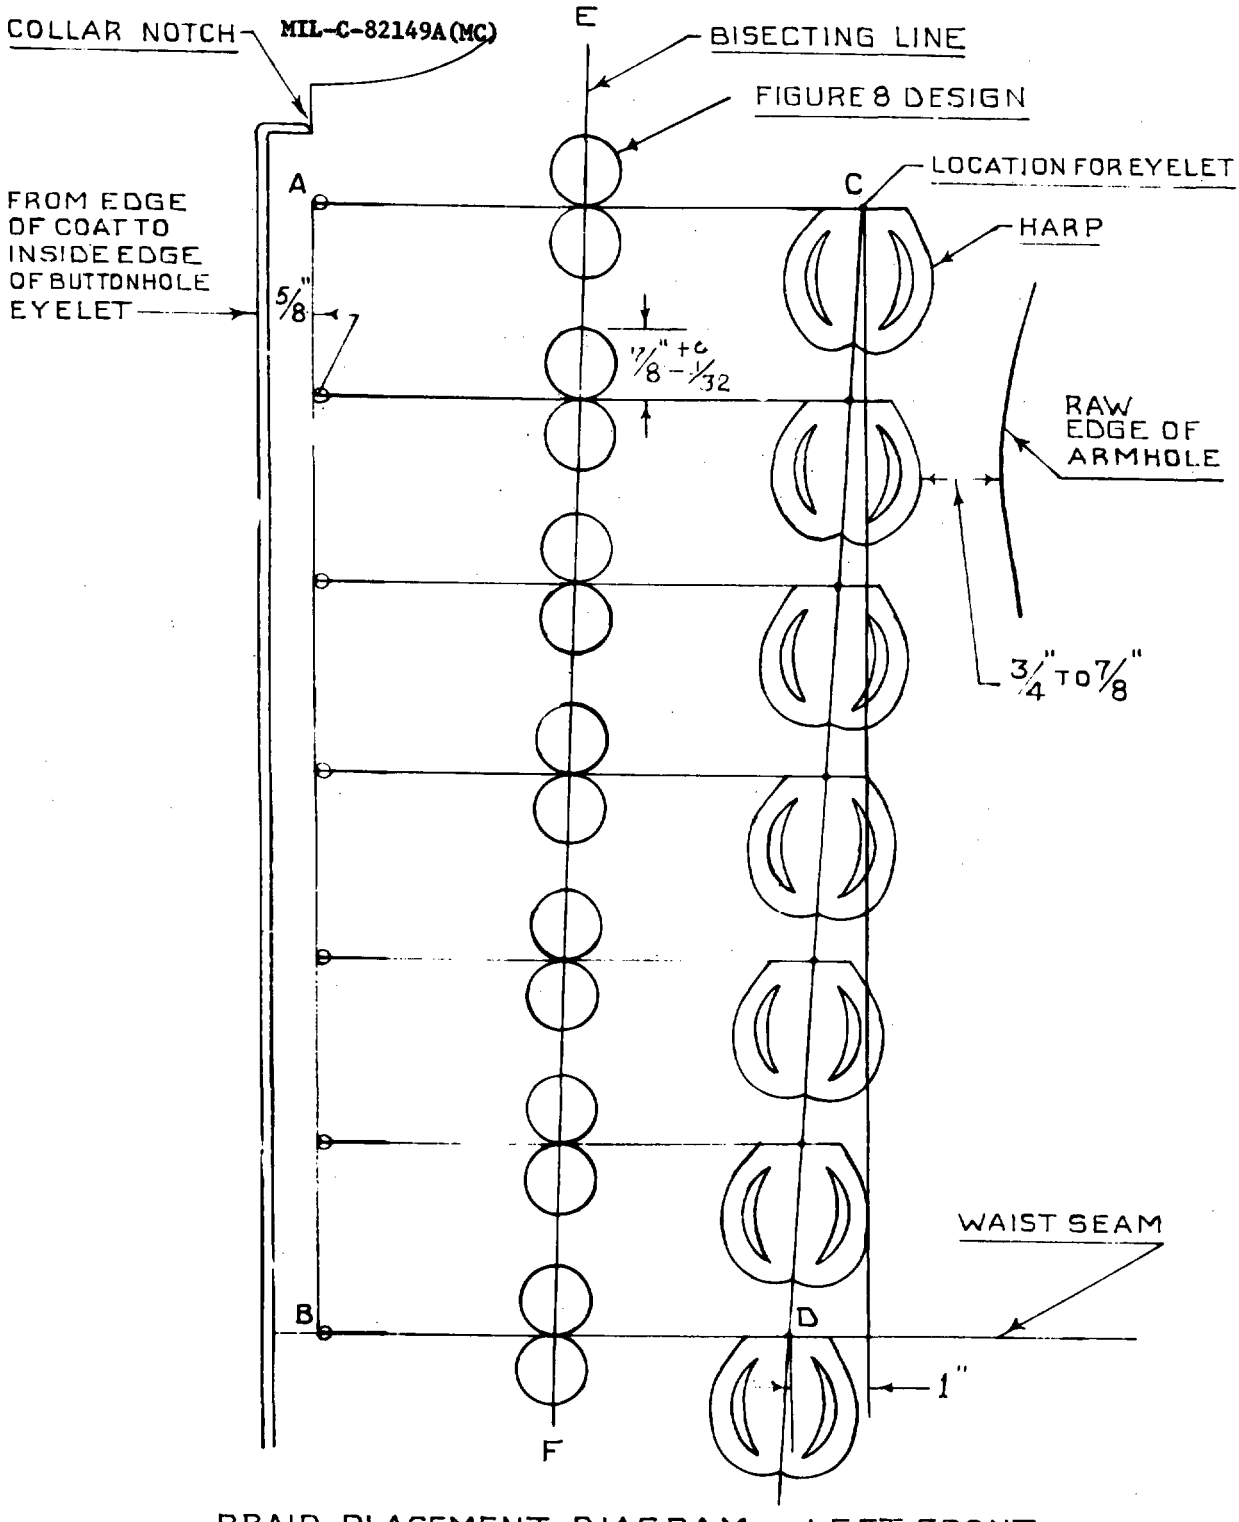

BRAID PLACEMENT DIAGRAM — LEFT FRONT

Figure 6. Coat, Man's; Full Dress; Scarlet, U. S. Marine Band; Musician

M.C.S.A. 826 R.G.F. 31Aug '73

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

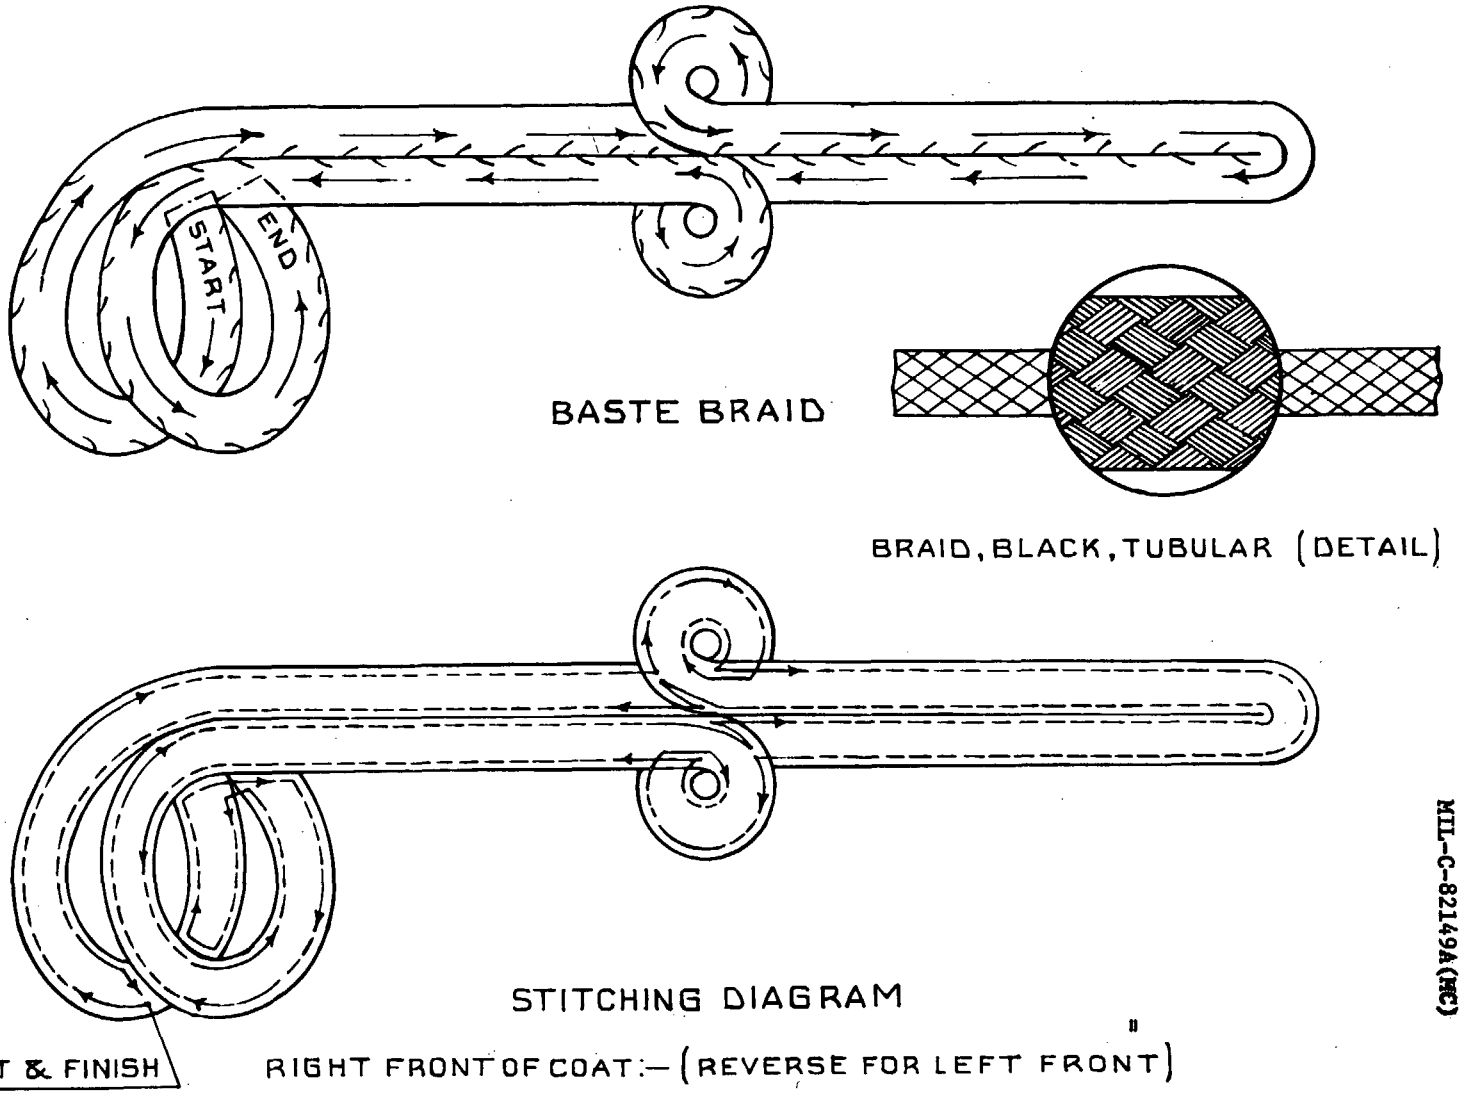


Figure 7. Coat, Man's; Full Dress; Scarlet, U. S. Marine Band; Musician

M.C.S.A. 826:R.G.F. 31 Aug '73

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

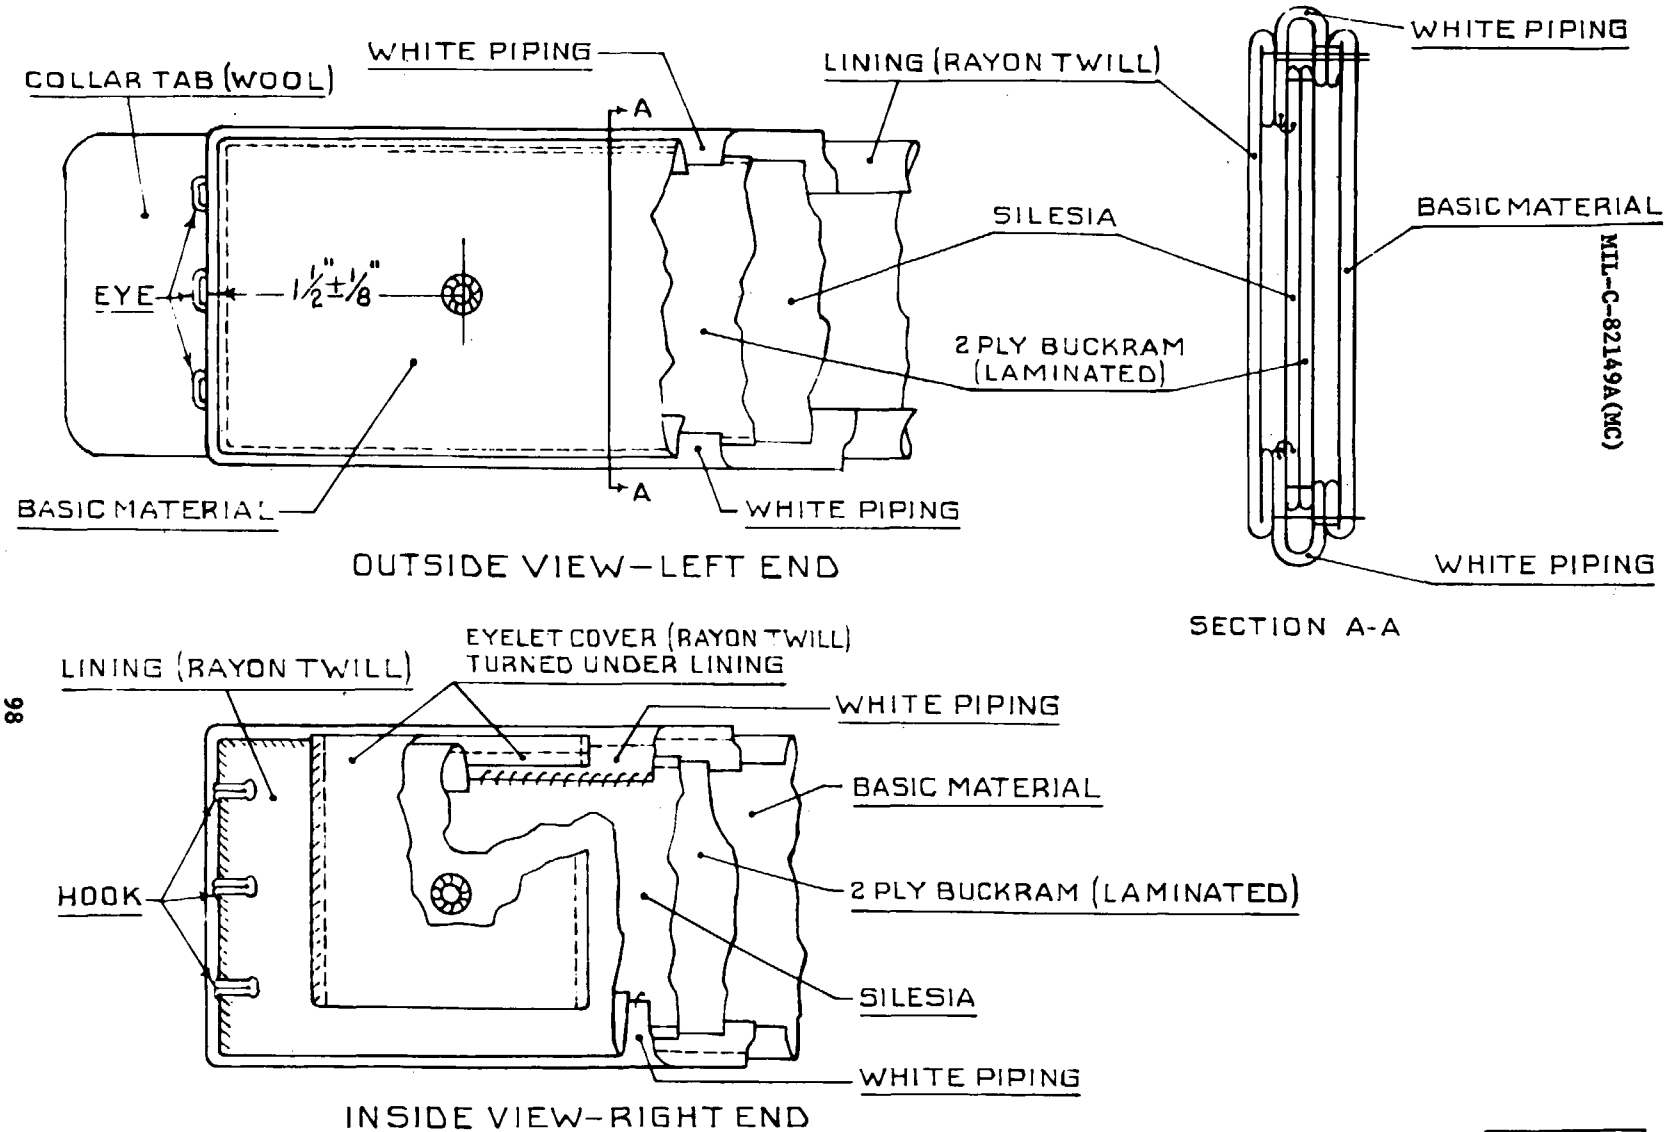


Figure 8. Coat, Man's; Full Dress; Scarlet, U. S. Marine Band; Musician

M.C.S.A. 826 R.G.F. 31 Aug '73

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?
   A. GIVE PARAGRAPH NUMBER AND WORDING.

   B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

   ☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

S/N 0102-014-1802

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID

U.S.MAIL

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

DoD-317

Commanding General (826)
Marine Corps Supply Activity
1100 South Broad Street
Philadelphia, Pennsylvania 19146

FOLD

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.