INCH-POUND

MIL-C-82149B(MC)
9 June 1995
SUPERSEDING
MIL-C-82149A(MC)
31 August 1973

MILITARY SPECIFICATION

COAT, MAN'S: FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN'S

This specification is approved for use by the U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE.

1.1 Scope. This specification covers requirements for a musician's scarlet, wool, full dress coat.

1.2 Classification. The coat shall be of one type in the following sizes, as specified (see 6.2):

Schedule of sizes

(Short, Regular, Long, Extra Long)

34 35 36 37 38 39 40 41 42 44 46

1.3 Individual orders. When the coat is custom tailored to an individual order, this specification shall govern, except that the detailed requirements of Section 3, Table I, may be modified to the extent necessary for good custom tailoring practice.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation (see 6.2).

SPECIFICATIONS

FEDERAL

A-A-50186	- Cloth, Cotton, Buckram
A-A-50196	- Thread, Silk
A-A-50198	- Thread, Gimp, Cotton Buttonhole
A-A-50199	- Thread, Polyester Core, Cotton or Polyester Covered
A-A-52071	- Tape, Textile, Cotton, General Purpose, (Unbleached, Bleached or Dyed)
A-A-52094	- Thread, Cotton
A-A-52106	- Cloth, Twill or Plain Weave, Polyester or Polyester Blend
DDD-L-20	- Labels for Clothing, Equipage and Tentage (General Use)

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill Rayon
MIL-B-3461	- Buttons, Insignia, Metal, Uniform and Cap
MIL-P-15064	- Pads, Shoulder and Sleeve Head
MIL-E-20652	- Eyelets, Metallic and Eyelets Washers (General Specification For)
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/Wool
MIL-C-29405	- Cloth, Broadcloth, Wool and Wool Nylon
MIL-C-41820	- Cloth, Gabardine, Polyester and Rayon
MIL-C-82114	- Coat Front for Coats, Musicians

STANDARDS

FEDERAL

FED-STD-151	- Metals: Test Methods
FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams, and Stitching

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-105 - Sampling Procedures and Tables For Inspection By Attributes
MIL-STD-129 - Marking For Shipment and Storage

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19120-5094.)

2.2 Non-Government publications. The following documents form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation (see 6.2).

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense Standard Shades for Sewing Threads

(Applications for copies should be addressed to the Color Association of the United States, 409 W. 44th Street, New York, NY 10016-0927.)

AMERICAN SOCIETY FOR TESTING AND MATERIALS

ASTM D 3951 - Standard Practice for Commercial Packaging

(Applications for copies should be addressed to American Society for Testing and Material, 1916 Race Street, Philadelphia, PA 19103-1187.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless specific exemption has been obtained.

3. REQUIREMENTS

3.1 Guide samples. Guide samples are furnished solely for guidance and information to the contractor (see 6.4). Variation from the specification may appear in the sample, in which case, the specification shall govern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.2 First article. When specified (see 6.2), contractor shall furnish sample unit(s) for first article inspection and approval (see 4.3 and 6.4).

3.3 Materials.

3.3.1 Basic material. The basic material shall be cloth, wool, tropical, scarlet shade 2502 (see 6.3), 10.5 ounce conforming to type I class 1 of MIL-C-21115.

3.3.2 Collar, and sleeve cuff material. The material for the collar and cuffs shall be cloth, polyester/wool blend, black shade 2607 (see 6.3) conforming to type III, class 1 of MIL-C-21115.

3.3.3 Lining. The material for lining the coat and collar and for making the collar eyelet covers, underarm shields, the coat hanger and straps to secure the lining to the bottom edge of coat shall be cloth, rayon twill, scarlet shade 2506 (see 6.3), conforming to class 1, of MIL-C-368.

3.3.4 Collar tab. The material for collar tab shall be cloth, wool broadcloth, blue shade 2307 (see 6.3), conforming to type I, of MIL-C-29405.

3.3.5 Piping. The material for piping shall be cloth, gabardine, polyester and rayon, white shade 3042 (see 6.3), conforming to type I, of MIL-C-41820, cut 5/8 to 3/4 inch wide for piping the collar and ornamental sleeve cuff and 1 inch wide for piping the front and bottom edges of the coat and seams joining the center back to the skirt of the coat.

3.3.5.1 Vinyl piping. The white vinyl piping for the upper edge of the collar shall be tubular with 7/16 inch welt and serrated edges. One acceptable product is sold by the Pearl Binding Corporation of Philadelphia, PA.

3.3.6 Cloth, twill or plain weave. The stays for the armhole and shoulder seams, the binding for the neck edge of the coat front interlining and the collar interlining shall be cut from cloth, twill or plain weave polyester, natural color, conforming to class 1 of A-A-52106. The cloth shall be khaki shade 3707.

3.3.7 Collar interlining. The material for interlining the collar shall be cloth, cotton buckram, double texture, laminated, starched finish, natural color, conforming to type IV of A-A-50186. The weight of the laminated cloth shall be 21 to 23 ounces per square yard.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.8 Plastic. The plastic strip used in the collar interlining shall be clear, plastic pattern stock, 0.020 inches thick. It shall be cut using the cotton buckram pattern.

3.3.8.1 Plastic interlining. The plastic interlining must withstand wet (dry) cleaning. It must not melt or become distorted under wet (dry) cleaning or pressing.

3.3.9 Reinforcement discs. The reinforcement discs for buttons secured to the back skirt seam, with ring and toggle, shall be punched from the cloth, cotton, buckram specified 3.3.7. The reinforcement discs shall be 7/8 inch in diameter with a 1/8 inch diameter hole at the center.

3.3.10 Coat fronts. The coat fronts shall conform to class 1 of MIL-C-82114.

3.3.11 Shoulder pads. The shoulder pads shall conform to the requirements of type I, class 2, of MIL-P-15064.

3.3.12 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.13 Stay tape. The stay tape for the armholes and waist seam shall be cotton, 1/4 inch wide, conforming to type III, class 1 of A-A-52071, except the requirement for nonfibrous material shall not apply.

3.3.14 Thread.

3.3.14.1 Silk thread. The silk thread shall conform to A-A-50196 except the requirement for extractable material shall not apply. The thread for machine sewing shall conform to type I, size A, for bartacks and all outside seaming and stitching; size 0 for machine felling; and sizes B and F for buttonhole needle and bobbin thread respectively. The thread for hand sewing shall conform to type III, class 3, size C, 2-ply.

3.3.14.2 Cotton thread. The cotton thread shall conform to A-A-52094, type III, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching; type I, soft finish, ticket No. 70, 2-ply for serging and overedge stitching; type II, glazed finish, ticket No. 24, 4-ply for sewing on buttons and machine tacking armholes. The thread for tacking sleeve lining, hand tacking facing to interlining and basting shall be a good commercial grade. As an alternate to the cotton thread, a polyester core, cotton or polyester covered thread conforming to A-A-50199, ticket No. 50, 2 ply or ticket No. 70, 2 ply may be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.14.3 Color and colorfastness. All thread shall be scarlet shade W, cable no. 66040, except: the silk thread for stitching the collar, cuffs and braid, which shall be black; the cotton thread for basting and machine tacking armholes, which may be white; and the thread for overedge stitching of the piping at bottom edge of coat shall be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning, and in addition, the silk thread shall show good fastness to light.

3.3.15 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be scarlet, shade W, cable No. 66040, and shall show good fastness to wet (dry) cleaning.

3.3.16 Ornamental braid. The ornamental braid for the front of the coat shall be mohair, black, tubular, 3/8 ± 1/16 inch wide conforming to the following:

Weave	Plain
Weight per gross yards, ounce (minimum)	35
Picks per inch (minimum)	9
Total carriers (minimum)	16
Ends per carriers (minimum)	6
Breaking strength, pounds (minimum)	105
Shrinkage:	
- length, percent (maximum)	2.0
- width, inches	Not less than the original width
Colorfastness to:	
- wet (dry) cleaning	Good
- light	Good

3.3.17 Buttons.

3.3.17.1 Insignia buttons. The insignia buttons shall be metal, gold plated, enlisted design, 27-line and 40-line conforming to type I, style 3, class A, subclass 1 of MIL-B-3461.

3.3.17.2 Ring toggles. Ring toggles for securing buttons to fronts, back and sleeves shall conform to MIL-B-3461.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.18 Collar closure hook and eye. The hook and eye for closing the collar shall be brass, black, japanned finish or black chemical finish, followed by a clear lacquer coating and conform to the requirements of Figure 9.

3.3.18.1 Eyelets. The eyelets for the collar shall be brass, rolled flange type, with the barrel scored 6 to 8 scores. The eyelets shall conform to MIL-E-20652, sheet 1A-BE108 and be enameled in a black shade.

3.3.19 Labels. Each coat shall have a combined identification/instruction label and a size label conforming to DDD-L-20. The coats are intended to be wet (dry) cleaned and the label shall show fastness to wet (dry) cleaning.

3.3.19.1 Combination identification/instruction label. The combination identification/instruction label shall conform to type VI, classes 1 and 3 (combined) of DDD-L-20, except all printing and the space between lines of printing shall be a minimum of 10 point (approximately 1/8 inch). The content and format shall be as follows:

NOMENCLATURE_____
CONTRACT NO._____
NAME OF CONTRACTOR _____
WOOL PRODUCTS ACT INFORMATION_____
DRY CLEAN ONLY

3.3.19.2 Size label. The size label shall conform to type VI, class 2, of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S (short), R (regular), L (long), or XL (extra long), as shown by the following example:

40 R

3.4 Design. The coat shall be the U.S. Marine Corps design shown in Figures 1 through 4, a semiformfitting, single-breasted fully lined coat with 12 gold plated insignia buttons on the right front and 6 on the left front, having upper fronts, with black braid, skirt type lower body parts with waist darts, a waist seam, a three-piece back with 2 gold plated insignia buttons at the waist, ornamental sleeve cuffs with gold plated insignia buttons, a stand up collar with a hook and eye front closure, metal eyelets and two cloth loops on each shoulder for attaching the epaulets. The lower edges and ends of the collar, the front and bottom edges of coat, the seam joining the skirt to the center back and the top edge of the ornamental sleeve cuff shall be piped with white cloth. The upper edge of the collar shall be piped with white vinyl cord.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.5 Patterns. Standard patterns shall be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard patterns. The standard patterns shall provide a 3/4 inch allowance for side seams and the seam joining the skirt to the center back, and a 3/8 inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

3.5.1 List of pattern parts. Coats shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

Item	Pattern nomenclature	No. of cut parts
	Material basic; Cloth, wool, tropical	
1.	Front, upper	2
2.	Skirt (lower)	2
3.	Side (front)	2
4.	Side back	2
5.	Center back	1
6.	Top sleeve	2
7.	Under sleeve	2
8.	Front facing, right	1
9.	Front facing, left	1
	Cloth, wool/polyester	
10.	Collar, outer ply	1
11.	Sleeve cuff	2
	Cloth, wool broadcloth	
12.	Collar, tab	1
	Cloth, rayon lining	
13,	Front, upper	2
14.	Skirt, (lower)	2
15.	Side back	2
16.	Center back	2
17.	Top sleeve	2
18.	Under sleeve	2
19.	Collar lining	1
20.	Collar eyelet cover	2
21.	Underarm shield	4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature	No. of cut parts
	Cloth, cotton, buckram	
22.	Collar interlining	1
	Mylar plastic	
23.	Collar interlining	-
	Marker	
24.	Cuff and button marker	-

3.6 Construction.

3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I.

3.6.1.1 Operations. The contractor is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1.2 Stitches, seams, and stitchings. The stitch, seam, and stitching types specified in table I shall conform to FED-STD-751. The number of stitches per inch as specified in table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.2.1 Tacking and backstitching. Ends of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.6.1.3 Shade marking. The component parts shall be cut from one piece of the applicable wool materials and lining material, including pairs of sleeve linings and underarm shields when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

a. Corrosive metal fastening devices.
b. Sew-on shade tickets.
c. Adhesive type tickets which show discoloration and the adhesive mass which adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. a. Cut coats in strict accordance with the patterns furnished by the Government. b. Cut all materials in the direction of the warp as indicated by the directional lines on the patterns. c. Cut all scarlet wool parts of the coat from one piece of the basic material. d. Cut the body and collar linings, collar eyelet covers and top ply of underarm shields from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the lining shall match. Cut the strips for the coat hanger and lining securing straps 1-1/8 inches wide. e. Cut the wool material for the sleeve cuffs, and outer ply of collar from the material specified in 3.3.2. f. Cut the collar tab from the material specified in 3.3.4.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) g. Cut the twill or plain weave polyester and polyester blend stays for armhole and shoulder seams on the bias 3/4 inch wide and 4 ± 1/4 inches long. Cut the polyester for binding the neck edge of coat front interlining on the bias, 3/4 inch wide and approximately 5 inches long. Cut the polyester for interlining collar on the straight in accordance with pattern furnished. h. Cut the cotton buckram and plastic strip for interlining the collar on the straight in accordance with the pattern furnished. i. Cut the piping material (see 3.3.5) for piping the front and bottom edges of coat, edges of collar, top edge of ornamental sleeve cuffs and the seam joining the skirt to the center back on the straight. The piping shall be cut 5/8 to 3/4 inch wide for collar and ornamental sleeve cuffs and 1 inch wide for fronts and bottom edges of coat and seam joining the skirt to the center back.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) j. Punch the reinforcement discs for buttons secured to the skirt back seam from cloth, cotton, buckram. The reinforcement discs shall have a 7/8 inch diameter hole at the center.					
2	Replacement of damaged parts. a. Replace at time of cutting all parts of coat containing holes or seriously weakening defects, such as smashes, multiple floats loose or weakening slubs, etc., expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc., affecting appearance. b. Replace any part damaged during the manufacturing process by needle chews which may develop into holes, scissor or knife cut, tears, holes, mends or burns in the material affecting appearance.					
3	Shade marking. a. Mark or ticket (see 3.6.1.3) all component parts cut from one piece of basic lining materials, and pairs of					

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SRAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
3	Shade marking. (cont'd)					
	sleeve linings when cut from ends, to insure uniform shade and size throughout the coat.					
	b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					
4	Make coat hanger and lining securing straps.					
	Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8 inch wide straps of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	12-16	A	A
	b. Cut the coat hanger 3-3/4 ± 1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ± 1/4 inches long.					
5	Make collar eyelet covers.					
	Finished appearance. The collar eyelet covers shall finish 1-3/4 ± 1/8 inches wide.					

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
5	Make collar eyelet covers. (cont'd)					
	a. Turn under the side edges of the collar eyelet covers and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1 (each side edge)	12-16	A	A
	b. Fold each cover in half across the width and seam 1/16 inch from the folded side edges.	301	SSa-1	12-16	A	A
6	Make underarm shields.					
	Finished appearance. The shields shall finish smooth and flat without puckers, pleats, gathers or other distortions.					
	a. Position the two plies of the material for the underarm shields with edges even. Seam the two plies together along the curved side and bottom edges 3/8 inch from the edges.	301	SSa-1	12-16	A	A
	b. Turn the shield right side out, working out completely the seamed edges.					
	c. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
7	Make cuffs.					
	Finished appearance. The					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
7	Make cuffs. (cont'd) cuffs shall be uniform in appearance, shall finish smooth and flat without twists, gathers, pleats, puckers or other distortions. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the sleeve cuff. a. The cuffs shall be made of one ply of the material specified in 3.3.2, piped with material specified in 3.3.5.					
	b. Position the strip of piping material on the outside sleeve cuff with edges even and stitch together 1/8 inch from the upper curved and pointed edge of cuff.	301	BSm-1 (a)	10-14	A (Silk)	A
	c. Turn back the cuff and piping, working the folded edge of the piping 1/8 inch beyond edge of cuff. Topstitch the cuff to the piping 3/16 inch from folded edge of piping.	301	BSm-1 (b)	10-14	A (Silk)	A
	d. Press the cuffs smooth and flat with a heated pressing iron or pressing machine.					
8	Stitch and press dart in undersleeves. a. Fold the under sleeve matching the cut edges of	301	SSa-1 OSf-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8	Stitch and press dart in undersleeves. (cont'd)					
	the darts. Stitch the entire length of the dart 1/4 inch from the cut edges of the armhole and and taper the line of stitching to zero at the lower folded edges.		(folded edge)			
	b. Spread open the cut edges of the dart, turn the lower folded edge flat against the body of the under sleeve and press the entire dart smooth and flat with a heated pressing iron.					
9	Seam sleeves at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of under sleeve and with the notches in the lower forearm edge of top and under sleeves matching. Seam top and under sleeves together 3/8 inch from forearm edge of top sleeve, forming a tapered outlet on the under sleeve.	301	SSbd-1 to SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Seam sleeves at forearm. (cont'd) b. Spread open the seam and press flat with a heated pressing iron.					
10	Join cuff to sleeve. Finished appearance. The cuff shall be uniformly stitched to the sleeve without twists, gathers, puckers, pleats or raw edges. On the finished coat, the length of the cuff, including the piping, shall measure 3-1/4 ± 1/8 inches at the front and back creased edges, and 6 ± 1/4 inches at the point. In the finished coat (after pressing) the point of the cuff shall be centered between the lower forearm creased edge and the creased backarm seam of sleeve. a. Mark the sleeves in accordance with the sleeve cuff marker for positioning of the cuffs, with notch on the cuff marker matching the forearm seam line and bottom edge of marker in line with the bottom raw edge of sleeve. b. Position the piped edge of cuff at the mark and stitch cuff to sleeve along the piped edge. The	301	LSa-1	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Join cuff to sleeve. (cont'd) line of stitching shall be adjacent to the stitching of the cuff piped edge.					
11	Seam sleeve at backarm. Finished appearance. The backarm seams shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeves together at the backarm with a 3/8 inch seam, catching the ends of the cuff in the seam.	301	SSa-1	12-16	A (Silk)	A
	b. Spread open the sleeve and cuff seams and press smooth and flat with a heated pressing iron.					
12	Insert insignia buttons. a. Mark each cuff for location of three insignia buttons in accordance with button marker.					
	b. Punch a hole through cuff and sleeve at each mark for attaching of insignia buttons.					
	c. Insert the shanks of the 27-line insignia buttons through the punched holes and attach ring toggles in each button shank.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Baste and tack cuff to sleeve.					
	a. Turn the bottom of the cuff to the inside against the bottom edge of sleeve in accordance with notches, and bast along the turned edge of the cuff.	301 or Hand				
	b. Tack the raw edge of cuffs to the body of the sleeves with blindstitching. The blindstitching shall not be exposed on, or caught to, the outside of the cuff.	301	EFe-1 (b)	4-6	A	A
14	Stitch and press dart in under sleeve linings.					
	a. Fold the under sleeve lining, matching the cut edges of the under sleeve dart. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole and taper the line of stitching to zero at the lower folded edge.	301	SSa-1 (cut edges) OSf-1 (folded edge)	12-16	A	A
	b. Turn the cut edges of the dart toward the forearm edge and press the entire dart smooth and flat with a heated pressing iron.					
15	Seam sleeve lining at forearm.					
	Finished appearance. The forearm seam shall finish					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
15	Seam sleeve lining at forearm. (cont'd)					
	smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the notches in lower forearm edge of top and under sleeve linings matching. Seam the top and under sleeve lining together 3/8 inch from the forearm edge of top sleeve lining, forming a tapered outlet on the under sleeve lining.	301	SSbd-1 to SSa-1	12-16	A	A
16	Seam sleeve lining at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve linings at the backarm with a 3/8 inch seam.	301	SSa-1	12-16	A	A
17	Assemble sleeve and sleeve lining.					
	Finished appearance. The lining shall be seamed to					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
17	Assemble sleeve and sleeve lining. (cont'd)					
	the sleeve without twists, gathers, puckers or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of the lining extending approximately 1 inch beyond the armhole edge of the sleeve.					
	b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the sleeve, commencing at the top edge of the cuff and extending to approximately 6 inches from armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand		4-6 1-2	A	A
18	Fell sleeve lining turnup.					
	Finished appearance. The sleeve lining shall not be short, tight or twisted at bottom of sleeves.					
	a. Turn under the bottom edge of the sleeve lining to finish 1 to 1-1/4 inches above the finished end of sleeve, and baste to turnup of cuff, or the sleeve lining my be felled to bottom of sleeve without basting.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18	Fell sleeve lining turnup. (cont'd)					
	b. Fell the folded edge of sleeve lining to the turnup of the cuff with blindstitching.	Hand or 301	EFc-1 (b)	8-10 6-8	C (Silk) O (Silk)	O
19	Press sleeves.					
	a. Turn the sleeves right side out and assemble in pairs. Press the lower half of sleeves smooth and flat, creasing at the forearm and backarm. The backarm crease shall be on the backarm seam. Remove basting at lower end of cuffs.					
20	Assemble collar interlining.					
	a. The collar interlining assembly shall consist of one ply of laminated cotton buckram, and one ply of twill or plain weave polyester and one ply of mylar plastic.					
	b. Seam the plastic, polyester and buckram together 1/8 to 3/16 inch from all edges and trim the polyester even with the edges of the buckram. The polyester cloth shall be positioned on the inside and the plastic (mylar) on the outside.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
21	Pipe outer ply of collar. Finished appearance. The piping shall extend at upper, lower and side edges of the outer ply and shall be uniformly stitched without twists, gathers, puckers or pleats. a. The outer ply of the collar shall consist of one piece of the material specified in 3.3.2, piped with material specified in 3.3.5 and 3.3.5.1.					
	b. Seam a 5/8 to 3/4 inch wide strip of piping to outer ply 1/8 inch from bottom and side edges, leaving a 3/4 to 1 inch extension on each end of piping at lower edge of collar. The extension ends of piping shall be approximately 3 inches from the pointed end of collar. Seam the vinyl piping to the upper collar edge with collar abutted against cord edge.	301	SSaa-1	12-16	A (Silk)	A
	c. Join extensions together as close as possible to outer ply.	301	SSa-1	12-16	A (White)	A
	d. Trim the extension piping to 1/4 inch from the seamed edge. Spread open joining of extension and stitch to collar along seam joining piping to outer ply.	301	SSa-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
21	Pipe outer ply of collar. (cont'd)					
	e. Turn back the piping and outer ply, uniformly working the folded edge of the piping beyond the edges. Topstitch the outer ply uniformly 3/16 inch from the folded edge of piping.	301		12-16	A (Silk)	A
22	Assemble collar.					
	Finished appearance. The collar shall be assembled without twists, gathers, puckers or pleats.					
	a. Position the interlining assembly on the inside of the outer ply under the unattached edge of piping. Tack all the raw edges of piping to the silesia or polyester and cotton interlining, making the outer ply form a smooth and snug fit.	Hand		2-3	C (Silk)	
	b. Press the collar smooth and flat with a heated pressing iron or pressing machine.					
	c. Position an eyelet cover on the underside at each end of the collar, with one edge of the cover 3/4 to 7/8 inch from the front end, and the bottom raw edge of the eyelet cover 1/2 to 5/8 inch from the upper piped edge. Stitch collar to cover	301	LSa-1	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22	Assemble collar. (cont'd) along the piped edge adjacent to the stitching line of the collar piped edge. d. Lap the upper piped edge of collar over the top raw edge of collar lining approximately 1/2 inch with lining face up. Stitch collar to the lining and eyelet cover along the piped edge adjacent to the stitching line of the collar piped edge. The stitching shall extend from center to center of eyelet covers. The collar lining shall extend not less than 1/2 inch from each end of collar. e. Turn collar lining and eyelet cover at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine. f. Attach metal eyelets on each end of collar midway between the top and bottom edges and 1-1/2 ± 1/8 inch from finished ends.	301	SSa-1	10-14	A (Silk)	A
23	Assemble body lining. Finished appearance. All darts and joining seams shall finish smooth and flat without pleats,					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
23	Assemble body lining. (cont'd) puckers or gathers. The seams shall start and finish evenly. a. The body lining shall consist of an upper front, a side back panel, a center back panel and a skirt.					
	b. Fold the upper front, matching the cut edges of the dart. Seam the waist dart with a 3/8 inch seam at the lower end of the waist dart, tapering to zero at the upper end.	301	SSa-1	12-16	A	A
	c. Fold the underarm dart and seam with a 3/8 inch seam at the center, tapering to zero at the upper and lower ends.	301	OSf-1	12-16	A	A
	d. Position the side back panel and fronts with edges even and with notches matching. Seam together at the side seam with a 3/4 inch seam.	301	SSa-1	12-16	A	A
	e. Position center back to the respective side backs with edges even and notches matching. Join together with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	f. Overedge stitch together the waist dart, side seam and back side seam. The overedge	503-504	EFd-1	6-10	70/2	70/2

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
23	Assemble body lining. (cont'd) stitching shall be securely caught in the fabric.					
24	Join upper body lining assembly to skirt.					
	a. Fold the skirt lining in accordance with notches on the pattern to form a 3/4 inch pleat at the waist line. Stitch across the pleat 1/8 to 3/16 inch from raw edge.	301	SSa-1	10-14	A	A
	b. Press the pleat smooth and flat at the top end and tapering to a flat point at the lower end. The pleat shall extend approximately 5 to 5-1/2 inches in length.					
	c. Position the upper assembly to the skirt (face to face), with all edges even and join together at the waist with a 3/8 inch seam. The seam allowance for the waist darts, underarm darts, side and side back seams shall face toward the front.	301	SSa-1	10-14	A	A
	d. Overedge stitch the entire waist seam allowance with all joining seams caught in the stitching.	503-504	EFd-1	6-10	70/2	70/2

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24	Join upper body lining assembly to skirt. (cont'd) e. Press all seams and darts smooth and flat. The waist seam shall be pressed toward the bottom and the remaining seams and darts towards the front.					
25	Seam wool facing to lining assembly. Finished appearance. The lining shall be carefully aligned and seamed to the facing so that in the finished coat, the lining shall lie smooth and flat along the facing without creases, bulges, overlapping of excess material or other defect or distortion. a. Position the lining on the wool facing with the top edges even. b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from the top edge of the facing to approximately 1-1/4 inches from the bottom edge.	301	SSa-1	12-16	A	A
26	Serge or overedge stitch facing-lining assembly. Finished appearance. The					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
26	Serge or overedge stitch facing-lining assembly. (cont'd)					
	overedge stitching shall be securely caught in the fabric.					
	a. Overedge stitch together the facing-lining seam allowance. The overedge stitching shall be securely caught in the fabric.	503-504	EFd-1	6-10	70/2	70/2
27	Sew on identification label.					
	Finished appearance. The identification label shall be positioned so that in the finished coat, the label shall be midway between front and back edge of the right facing and with the bottom edge of the label approximately 4 inches from the bottom finished edge of the coat.					
	a. Sew the identification label to the outside of the right facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge)	12-16	A	A
28	Make outer assembly.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					

Source: https://assist.dla.mil -- Downloaded: 20261O-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28	Make outer assembly. (cont'd)					
	a. The assembly shall consist of upper front, side front, side back, center back and lower skirt.					
	b. Fold the upper fronts, matching the cut edges of the waist dart, and stitch the entire length of the dart 3/8 inch from the cut edges at the lower end and tapering to a point at the upper end.	301	SSa-1	12-16	A	A
	c. Position the upper front and side panel with edges even, and join together with a 3/8 inch seam.	301	SSa-1	12-16	A	A
	d. Position the side back and side front with edges even and notches matching. Seam together at the side with 3/4 inch seam.	301	SSa-1	12-16	A	A
	e. Fold the skirt dart in accordance with notches on patterns and stitch the length of the dart. The dart shall taper from 3/4 inch at the top to zero at the lower end. Dart shall finish approximately 5-1/4 to 5-1/2 inches long.	301	OSf-1	12-16	A	A
	f. Press skirt dart flat on dart seam without turning dart either to the right or left.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28	Make outer assembly. (cont'd)					
	g. Spread open the waist dart and the underarm and side seam and press flat with a heated pressing iron.					
	h. Overedge stitch the waist dart, underarm dart and side seam.	503-504	EFd-1	6-10	70/2	70/2
	i. Position the upper assemblies and the skirt with fronts and edges even and with the back edge of the side back positioned 3/8 inch from the back edge of skirt as indicated by the notch at the top of the waist of the skirt. Join together at the waist with a 3/8 inch seam and with the 1/4 inch wide stay tape positioned on the upper assembly 1/4 inch from the upper edge and caught in the stitching.	301	SSa-1	12-16	A	A
	j. The tape shall be sewn with the normal tension, not loose or tight, and shall extend from the side back seam to not more than 3 inches from the front edge of the fronts. Spread open the waist seam and press flat with a heated pressing iron.					
	k. Overedge stitch the entire waist seam allowance from end to end.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28	Make outer assembly. (cont'd)					
	1. Press and shape the fronts on a suitable type heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest.					
29	Pipe skirt (See Figure 5).					
	Finished appearance. The finished piping shall be of uniform width, without twists, puckers, pleats or distortion. Piping shall extend along the back edge of skirt.					
	a. Fold 1 inch piping in half lengthwise. Seam piping 1/8 inch from folded edge.	301	OSf-1	12-16	A	A
	b. Serge or overedge stitch the raw edges of the piping together.	503 or 504	EFd-1	6-10 6-10	70/2 70/2	70/2 70/2
	c. Mark along back edge of skirt for the positioning of the piping. The mark line shall be 7/8 inch from the back edge and shall extend from the top to bottom of the skirt.					
	d. Position the folded edge of piping on the mark line, and stitch piping to skirt 3/16 to 1/4 from the folded edge of piping. Piping shall finish with a minimum 1/2 inch excess at	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
29	Pipe skirt (See Figure 5). (cont'd) the top end to give a neat finish. In the finished coat, the folded edge of piping shall extend 1/8 inch beyond the seam.					
30	Join center back to side back and skirt. Finished appearance. The backparts seams shall start and finish evenly and shall be smooth without gathers, puckers or pleats.					
	a. Position and join the left and right assemblies to the center backpart with a 3/8 inch seam down to the waistseam and with a 3/4 inch seam from the waistseam to the bottom of the coat.	301	SSa-1 (above waistseam) LSaj-1 (below waistseam)	12-16	A	A
	b. Spread open the side back seam from armholes to the waistseam, and press smooth and flat. Press skirt back seams from waistseam to bottom of coat smooth and flat with edge of each seam toward the center back. Pressing shall be done with a heated pressing iron or pressing machine.					
31	Seam reinforcement stay to armhole and shoulder. Finished appearance. The					

Source: https://assist.dla.mil -- Downloaded: 20261O-26T04:39Z
Check the source to verify that this is the currenversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
31	Seam reinforcement stay to armhole and shoulder. (cont'd)					
	reinforcement stays shall be sewn to the armhole and shoulder edges of the front without gathers, puckers or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4 inch wide stays to the underside of the front along the shoulder edges and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from the neck and armholes respectively. The strip for the upper edge of the armholes shall be positioned approximately 1/2 inch from the shoulder.	301	SSaa-1	10-14	A	A
32	Mark and dress left front.					
	a. Mark and shape the left front edge of coat, from the top notch to the waistseam.					
	b. The mark line shall be 1 inch from the upper front edge to 1-1/8 inches at the waistseam.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
32	Mark and dress left front. (cont'd) Continue on the straight line, from waistseam to the notch at the bottom of the skirt. NOTE: The dressing and shaping of the left front shall be performed in the sewing room.					
33	Tape armholes. a. Sew the cotton tape to the armholes starting with one end approximately 1 inch above the notch on the fronts and continuing along the lower and back edge of the armholes to approximately 1/2 inch from shoulder edge. b. The tape shall be stitched with slight tension along the lower front edge of the armhole and shall be held taut while stitching along the back edge.	301	SSaa-1	12-16	A	A
34	Press shoulder blades and armhole tapes. a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or a suitable type pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35	Stitch piping to coat. Finished appearance. The piping shall be uniformly stitched to the coat without twists, puckers or pleats. The piping shall extend from the collar notch at top edge of the right front to the collar notch at top edge of the left front.					
	a. Position the 1 inch wide strip of piping material on the outside of the left and right front, with one edge even with top, front and bottom edges of coat. Stitch piping to coat 1/8 inch from edge. The piping shall extend from the collar notch at the top, along the left and right front and the bottom edge of the coat.	301	SSa-1	10-14	A	A
	b. Turn the piping to the inside, working out the folded edge of piping 1/8 inch beyond edges of coat. Topstitch coat to the piping 3/16 inch from the folded edge of piping, catching the turned under portion of the piping in the stitching.	301	SSe-2 (b)	10-14	A (Silk)	A
	c. Notch out the excess piping material at the top and bottom front corners to eliminate bulkiness. Trim the inner edge of piping on the left front					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
35	Stitch piping to coat. (cont'd)					
	only from the upper front down to approximately 1 to 1-1/2 inches below waistseam, so that the piping will not interfere with front buttonholes.					
	d. Serge stitch the raw edge of the piping at the bottom edge of the coat.	503 or 504	EFd-1	6-10	70/2	70/2
36	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste the interlining and fronts together from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom edge of the front.	Hand or 301	Hopper			
	b. Baste along the shoulder, allowing room for setting the shoulder pad, working the fullness towards the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulder	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36	Interline fronts. (cont'd) to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of fronts.					
37	Trim coat front interlining. a. Trim the top edge of coat interlining even with the top edge of fronts from the point of shoulder to the collar notch. b. Notch the top edge of the interlining in line with the collar notch. c. Remove stitches joining the front edge of polyester to coat front interlining approximately 1/2 inch back from front and top edge of fronts. d. Turn the coat inside out and trim the interlining only, approximately 1/4 inch back from the front and top edge of fronts. e. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
38	Bind front edge and gorge of interlining.					
	a. Fold the polyester back and over the top and front raw edge of the interlining. Stitch along the top and front edge with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the turned under portion in the stitching.	301	EFa-3	8-10	A	A
39	Bind top neck edge of interlining.					
	Finished appearance. The polyester binding shall be uniformly stitched along the gorge of the coat front interlining from the collar notch to the shoulder point.					
	a. Lap the 3/4 inch wide strip of binding on the outside of the coat front interlining from the collar notch to shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	8-10	A	A
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39	Bind top neck edge of interlining. (cont'd)					
	of stitches 1/8 inch from the raw edge of the binding.					
40	Fell piping to coat front interlining.					
	a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	101				
	b. Fell the upper front and lower inner edge of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A C (Silk)	A
	c. Pull and remove basting stitches from piping.					
	d. Press the left and right fronts on a suitable type heated pressing machine, with the chest portion to conform to the shape of the body.					
41	Mark fronts for positioning the braid and buttonholes (see Figure 6).					
	a. Mark the location of six buttonholes on the outside of the left front, as shown on Figure 6. The top buttonhole (line A) shall be positioned 1 inch					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Mark fronts for positioning the braid and buttonholes (see Figure 6). (cont'd) below the upper piped edge and 5/8 inch from the front piped edge. The lower buttonhole (line B) shall be on the waistseam and 5/8 inch from front piped edge. The remaining four buttonhole marks shall be evenly spaced. b. Extend each buttonhole line towards the back and armhole edge. (Line B shall be 1 inch shorter than line A). The length of the top and bottom line is determined by the position of the harp on the second line from the top which shall be approximately 1-7/8 from the armhole edge to the center of the harp. Measure the second line from the front edge of buttonhole line to the center of the harp. Transfer the same measurement to the bottom line less 1 inch. Draw a straight line from the bottom line through the center of the harp up to the top line, establishing line A-C and B-D as shown on Figure 6. c. Bisect the top line A-C and bottom line B-D and connect the bisecting					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Mark fronts for positioning the braid and buttonholes (see Figure 6). (cont'd) points with a straight line E-F. d. Position left front of coat on right front, face to face with the collar notches even and the left front edge 1 inch back of the right front edge at collar notch and waistseam and armhole edge even. e. Trace the six lines on the right front to coincide with the lines on the left front; the lines on the right front shall extend 3/4 to 1 inch from the front piped edge. The vertical lines on the right front shall be identical to lines C-D-E-F on the left front. f. Draw a circle 7/8 ± 0-1/32 inch in diameter on each side of the six horizontal lines, centered to bisect line E-F and with the edge of each circle touching the horizontal line forming a figure 8 design as shown on Figure 6. g. Position the center of the harp pattern at the line C-D, with the upper edge of the pattern positioned at the bottom					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Mark fronts for positioning the braid and buttonholes (see Figure 6). (cont'd) side of each horizontal line. Mark the harp in accordance with the pattern marker. The bottom edge of the harp must be not less than 1/2 inch from the line beneath.					
42	Baste braid (see Figure 7). a. Baste braid by hand along each side of the horizontal line and around the circle figure 8 design and around the harp. The braid shall begin and end at the harp with both ends of the braid secured and tacked under the horizontal braid. On the left front the braid shall be basted around the buttonhole line and the outer edge of the braid shall finish approximately 1/4 to 3/8 from the piped front edge.					
	b. Begin with cut end of braid even with straight line at top of harp. Baste the braid along its forward edge down the center of harp to the forward edge of harp center. Continue up the backarm along the back edge of harp to the	Hand		2-6	C (Silk) (Black)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
42	Baste braid (see Figure 7). (cont'd)					
	straight line at top using the same edge of the braid.					
	c. Baste the bottom edge of braid along the straight line to the circle, follow circle back to straight line and continue to end of straight line.	Hand		2-6	C (Silk) (Black)	
43	Tack braid.					
	a. Securely tack all unattached edges of braid to provide a smooth, secure and flat surface of stitching.	Hand		2-6	C (Silk) (Black)	
	b. Tack inside edges of braid circles to coat, forming an inner hole approximately 1/4 inch in diameter.	Hand		2-6	C (Silk) (Black)	
	c. Tack loops at button edge of coat together to the coat to finish secure and flat.	Hand		2-6	C (Silk) (Black)	
44	Stitch braid (see Figure 7).					
	Finished appearance. All stitching shall be done 1/16 inch from all edges whenever possible. All stitching shall be uniform. All stitching shall be performed with one continuous thread					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
44	Stitch braid (see Figure 7). (cont'd)					
	whenever possible. Stitching across braid strands shall be done only as prescribed or when absolutely necessary. All edges of the braid shall be securely attached to the coat at all points. The braid and the stitching shall present a smooth, neat, uniform appearance. The braid on the left front only shall be unstitched for approximately 3 inches from front end of the buttonhole loop braid.					
	a. Stitch braid through fronts and interlining on both sides of the braid 1/16 inch from edge. The line of stitching shall start and finish at the harp as shown on Figure 7.	301	SSa-1	10-14	A (Silk)	A
	b. Braid may be stitched without basting, provided the requirements previously mentioned are maintained.	301	SSa-1	12-16	A (Silk)	A
	c. Hand stitch the inner edges of horizontal braid together on both fronts from harp ends to end of buttonhole opening on left front and from harp ends to front end of braid on right front.	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
45	Join facing to fronts. a. Position the left and right fronts to the respective front facing (face to face), with the waistline notch of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark along the top front edges of facing.					
	b. Lap the front edge of the right and left fronts respectively on the outside of the facing at the marks and join the fronts to facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to the bottom edge of coat front edge only.	301	LSa-1	12-16	A (Silk)	A
	c. Trim excess facing material where necessary.					
46	Baste front edges. a. Turn the facing-lining assemblies to the inside of fronts, completely working out the corners.					
	b. Baste along the front edge of the left and right fronts, working the facing back from the folded edge of piping.	101				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
47	Baste facing (second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 301	Hopper			
	b. Turn under and baste the top edge of the facing even with the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	Hand or 301	Hopper			
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of facings approximately 1-1/4 inches from the lower edge of facing.	Hand or 301	Hopper			
	d. Turn under the bottom edge of the facing at the mark and baste along the folded edge.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
48	Tack facing to interlining.					
	a. Tack the right and left facing-lining seam allowance to the respective coat front interlining from approximately 2-1/2 inches from bottom edge of coat to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6		
49	Baste front linings to coat.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat, and baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
	b. Baste the front lining to the coat, starting at the lower end of the chest pleat, continuing along lower edge of armhole approximately 2 inches from the edge, and ending at the side seam. Match side seams of coat and lining and continue basting as close as possible to the side seam and then across the bottom towards the front approximately 4 inches from piped bottom edge of coat.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
50	Join lining at center back. Finished appearance. The lining shall be carefully joined at center back without gathers, puckers or pleats. The seam shall start and finish evenly. The folded edge of the center pleat, on the outside of the lining, shall be towards the left side. The center back seam of the lining shall be between the fold.					
	a. Position the back parts of lining and join together at the center with a 3/8 inch seam.	301	SSa-1	12-16	A	A
51	Baste back lining to coat. a. Fold the back lining, forming approximately a 1 inch wide pleat at the center back. Baste the back lining to the coat along the center pleat from the top end to approximately 4 inches from bottom finished edge of coat.	Hand or 301	Hopper			
	b. Baste back lining to coat starting at side seam and continuing approximately 3 inches from the armhole and shoulder edges.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
52	Hem bottom edge of lining. Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The hem shall be 3/4 ± 1/8 inch wide. The lining securing straps shall be positioned on the back in line with back seam of coat.					
	a. Hem the bottom edge of body lining with the raw edge turned under and with one end of the securing straps positioned and caught in the stitching 1/16 inch from the upper folded edge of hem.	301	EFb-1	12-16	A	A
53	Tack the lining securing straps to bottom of coat. Finished appearance. The lining securing straps when tacked to the bottom edge of coat shall not cause twists or other distortions to either the coat or the lining. The end of the securing straps shall finish between the piping at bottom edge of coat and the skirt seam allowance. In the finished coat, the lining shall not be visible below the bottom edge of coat.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
53	Tack the lining securing straps to bottom of coat. (cont'd)					
	a. Position and securely tack the free end of the securing straps to the piping at the bottom edge of coat through the skirt seam allowance.	301	SSa-1	8-10	A	A
	b. Position the bottom edge of the lining so that in the finished coat, the lining shall not be visible below the bottom edge of coat. Fold the lining securing straps across the width and stitch approximately 1/4 inch from the folded end in order to hold the lining in position.	301	OSf-1	8-10	A	A
54	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the back lining even with the neck.					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
55	Make eyelets in fronts. Finished appearance. The eyelets shall be worked with the purling on the outside of the coat, and shall finish with a 1/8 inch diameter opening. All stitches shall be securely caught in the fabric. a. Mark location for eyelets on the right and left front for removable buttons. The mark for the eyelet shall be between the braid strands at the top end of each harp. b. Make an eyelet at each of the marks through all plies.	Eyelet		22 per eyelet	A	A
56	Make buttonholes. Finished appearance. The buttonholes shall be clean cut, well made, well worked over gimp to fit 40-line insignia buttons. The gimp and thread shall be pulled through to the outside of the front. The purling of the buttonholes shall be on the facing side. The inside edge of the eyelet end of the buttonholes shall be 5/8 inch from the front edge of the coat. The buttonholes shall be cut-first type.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
56	Make buttonholes. (cont'd)					
	a. Remove the basting on the unstitched portion of the braid.					
	b. Make a horizontal eyelet-end square-bar type buttonhole, cut 1-1/4 inches long, at each of the marks.	Buttonhole		60 stitches per buttonhole	B (Silk)	F
	c. Securely bartack the end of each buttonhole, catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bartack		21 per bartack	A (Silk)	A
	d. Rebaste the unstitched portion of the braid around the buttonholes and complete that portion of the stitching through all plies (see Figure 7).	Hand				
57	Press front of coat.					
	Finished appearance. Fronts shall finish smooth and flat without distortion, with all edges uniformly worked out.					
	a. Press the front of coat and braid smooth and flat with a suitable pressing machine, removing the fullness.					
58	Baste shoulder pad to coat.					
	a. Insert shoulder pads	Hand				

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
58	Baste shoulder pad to coat. (cont'd)					
	between interlining and chest padding of coat fronts. Securely tack the pad to the interlining and chest padding only.	or 301	Hopper			
59	Set shoulder loops (see Figure 5).					
	Finished appearance. The shoulder loops shall be securely stitched without causing distortion to the shoulder. The loops shall finish 3/4 inch wide and 1 inch long.					
	a. Position the raw edge of one loop on the front of the coat at the shoulder edge, 1-1/4 inches from the raw edge of neck gorge and stitch loop to coat 1/8 inch from raw edges. The outside edge of the second loop shall be positioned 3-3/4 inches from the outside edge of the first loop and at the shoulder edge. Stitch loop to coat 1/8 inch from the raw edges.	301	SSa-1	10-14	A	A
60	Seam shoulders.					
	Finished appearance. The shoulder seam shall finish without a distorted appearance.					
	a. Join the back to the fronts at the shoulder	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
60	Seam shoulders. (cont'd)					
	with a 3/8 inch seam, working in the fullness on the backs in accordance with good manufacturing practice.					
	b. Spread open the shoulder seam and press flat, holding the shoulder short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
	c. Position the front lining and coat front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn the coat on the inside.	Hand or 301	Hopper			
61	Set shoulder loops to coat back.					
	a. The front end of loop shall be stitched 5/8 inch in front of the shoulder seam and aligned with each other.	301	EFb-1	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
61	Set shoulder loops to coat back. (cont'd)					
	b. Fold loop back, turn under the back end of the loop and stitch the loop to the coat only 1/16 inch from the turned-under edge catching the turned-under portion in the stitching.	301	EFb-1	10-14	A (Silk)	A
62	Baste back lining and facing-lining assembly at shoulders.					
	a. Turn under and lap the shoulder edge of back lining on the facing-lining assembly. Baste lining along the folded edge of the back lining with the top end of the chest pleat caught in the basting.	Hand				
63	Seam neckline with a size label and coat hanger.					
	Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label shall be positioned between the ends of the coat hanger and the ends of the coat hanger shall be positioned so that in the finished coat, the hanger opening shall be 2 ± 1/8 inches long when measured along the lower edge of the collar lining.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
63	Seam neckline with a size label and coat hanger. (cont'd)					
	a. Join facings and back lining to coat at the neckline, from collar notch to collar notch, with a 1/4 inch seam and with the upper edge of the size label and the ends of the hanger positioned and caught in the stitching at the inside center back.	301	SSa-1	12-16	A	A
	b. Press the neckline of the coat smooth and flat with a heated pressing iron or pressing machine.					
64	Set collar with lining.					
	Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar.					
	a. Mark the neckline on the outside 3/8 inch from collar notch up to the shoulder seam and gradually to within 1-1/4 to 1-3/8 inches at the center back for proper position of the collar.					
	b. Position the collar with the lower edge lapped on the outside top edges of the coat at the mark.					
	c. Seam the collar from end to end, to the coat, as close as possible to, but not on top of, the	301	LSa-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
64	Set collar with lining. (cont'd) stitching for the piping at the lower edge of the collar. The stitching shall not be through the collar lining.					
65	Set sleeves. Finished appearance. The armhole-sleeve seam shall finish without twists, gathers, puckers or pleats. a. Position sleeves on outside of coat at the armholes, with backarm seam of sleeve matching the side back seam and with notch in top sleeve and front matching.					
	b. Join the sleeve to the coat with a 3/8 inch seam, distributing the fullness in accordance with good manufacturing practice.	301	SSa-1	12-16		A
	c. Press the entire armhole smooth and flat with a heated pressing iron to remove fullness, exercising care not to stretch the armhole. Spread open the upper part of the armhole-sleeve seam from the backarm seam of the sleeve to approximately midway between shoulder seam and notch at front edge of armhole and press smooth					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
65	Set sleeves. (cont'd) and flat with a heated pressing iron. d. Fold the excess material at armhole pit up to the line of stitching of the armhole sleeve seam, forming a hinge effect. The fold shall extend from the armhole notch to approximately 4 inches from the backarm seam. e. Press the fold smooth and flat with a heated pressing iron.					
66	Baste armhole. a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing fullness evenly. Turn coat on the outside.	Hand or 301	Hopper			
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of sleeves to the front notch of coat.	Hand or 301	Hopper			
67	Set underarm shields to coat. a. Position the underarm shield on the lining side					

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
67	Set underarm shields to coat. (cont'd) of coat with the raw edges even with lower edge of armhole. b. Baste the underarm shields to the coat along the vertical center and top, side and bottom edges.	Hand or 301	Hopper			
68	Stitch sleeve head pads and linings at armhole. Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole. a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam and with the one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole-sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of	301	SSa-1	4-6	24/4	24/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
68	Stitch sleeve head pads and linings at armhole. (cont'd)					
	the armhole, catching the underarm shields in the stitching and trimming away the excess material.					
	c. The underarm shield may be basted to the armhole prior to stitching.	Hand				
69	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (Silk)	
70	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve and sleeve lining matching.					
	b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole,	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
70	Fell sleeve lining at armhole. (cont'd)					
	placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge from backarm seam of sleeve to the front edge of the shield.					
	-or-					
	c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operations 68a. above.	301	SSa-1	12-16	A	A
	-or-					
	d. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling.	Machine		8-10	C (Silk)	
	NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
71	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of coat, starting at the bottom edge of the lining and continuing along the back and bottom edges of facing to the front edge of coat.	Hand		8-10	C (Silk)	
	b. Fell the folded edge of the facings to the piping along the top edge from collar notch to front edge of coat.	Hand		8-10	C (Silk)	
72	Sew hook and eye to collar.					
	Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at the front of collar without misalignment.					
	a. Position and securely sew the hook to the right end and the eye to the left end of the collar. The hook and eye shall be positioned with their front edges even with the respective front ends of the collar and securely sewn to the collar at the top and bottom edge of the hook and eye. The stitching on each side shall not be more than 3/8 inch from the front end of the collar through the	Hand		16 per hook 16 per eye	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
72	Sew hook and eye to collar. (cont'd)					
	individual holes at the rear of the hook and eye.					
73	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (Silk)	
	b. Turn under the end and top edge of the lining at the right and left end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge of the end to the stitching joining the lining to the collar.	Hand		8-10	C (Silk)	
	c. Turn under and fell the lower edge of the collar lining to the coat from end to end, catching the turned-under portion of the lining at the right and left end in the felling.	Hand		8-10	C (Silk)	
	d. The lower edge of the collar lining may be basted to coat prior to felling.	Hand		8-10	C (Silk)	
	e. Position the collar tab on the inside of collar at the left end with the collar tab extending approximately	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
73	Finish collar. (cont'd) 3/4 inch beyond the front end of collar. Fell top, back and bottom raw edge of tab to collar lining. Stitch and backstitch the front end of tab approximately 1/4 to 3/8 inches from the eye.					
74	Clean coat. a. Pull any basting thread, trim and remove any loose ends of thread. Remove any spots, stains and tickets without injury to the material. b. Buttonholes at front closure shall be examined for exposure of coat front interlining cloth. The exposed interlining shall be colored with a reddish indelible ink.					
75	Press coat. a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
75	Press coat. (cont'd) towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. c. Press the entire collar smooth and flat. d. Press the upper front on a body machine, shrinking and properly shaping the chest. e. Press the lower fronts smooth and flat. f. Press the sides, working the fullness towards the back. g. Press the back smooth and flat, removing all fullness. h. Press the sleeves smooth and flat, without injury to the buttons on the ornamental sleeve cuffs, creasing at the backarm and forearm seam. The backarm crease shall be on the backarm seam. The forearm and backarm crease shall extend uniformly to a point 3 to 3-1/2 inches below the base of the armholes. i. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
75	Press coat. (cont'd) machine. j. Press the armholes solid from the inside, creasing the armholes at the front, back and armpit. The armpit and back of the armhole shall be held short while pressing. k. Block the armholes on a pressing buck, shrinking the top sleeves. l. Press lower edge of coat smooth, flat and even. Remove all impressions on the side and center back seam allowances. Press linings throughout, removing all wrinkles and creases. Press the front and back lining pleats smooth and flat. Remove all gloss marks.					
76	Mark for buttons on right front. a. Mark the location for sewing six 40-line insignia buttons to the right front of the coat to properly engage with the buttonholes on the left front.					
77	Attach and sew on buttons. Finished appearance. The buttons shall be aligned					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
77	Attach and sew on buttons. (cont'd) with the buttonholes to secure a smooth and complete closure without bulging or misalignment. a. Punch a hole for a button on each back seam at the skirt seam. Insert the shank of a 40-line insignia button and secure with a reinforcement disc and ring toggle. b. Attach 40-line insignia buttons to each front by inserting the shank of the buttons through the eyelets and securing by ring toggles. c. Sew one 40-line insignia button at each of the marks on the right front through all plies. d. The insignia buttons on the front shall be sewn with the head of the eagle upright.	Hand		8 wraps (double thread)	24/4	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II. Coat measurements. 1/

Size	Breast 2/	Back length 3/	Sleeve length 4/
		Short	
	inches	inches	inches
34	35	28-3/4	17-1/2
35	36	28-7/8	17-1/2
36	37	29	17-1/2
37	38	29-1/8	17-1/2
38	39	29-1/4	17-1/2
39	40	29-3/8	17-1/2
40	41	29-1/2	17-1/2
41	42	29-5/8	17-1/2
42	43	29-3/4	17-1/2
44	45	30	17-1/2
46	47	30-1/4	17-1/2
		Regular	
	inches	inches	inches
34	35	29-3/4	18-1/2
35	36	29-7/8	18-1/2
36	37	30	18-1/2
37	38	30-1/8	18-1/2
38	39	30-1/4	18-1/2
39	40	30-3/8	18-1/2
40	41	30-1/2	18-1/2
41	42	30-5/8	18-1/2
42	43	30-3/4	18-1/2
44	45	31	18-1/2
46	47	31-1/4	18-1/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table II. Coat measurements. 1/ Continued.

Size	Breast 2/	Back length 3/	Sleeve length 4/
		Long	
	inches	inches	inches
34	35	30-3/4	19-1/2
35	36	30-7/8	19-1/2
36	37	31	19-1/2
37	38	31-1/8	19-1/2
38	39	31-1/4	19-1/2
39	40	31-3/8	19-1/2
40	41	31-1/2	19-1/2
41	42	31-5/8	19-1/2
42	43	31-3/4	19-1/2
44	45	32	19-1/2
46	47	32-1/4	19-1/2
		Extra Long	
	inches	inches	inches
34	35	32-1/4	20-1/2
35	36	32-3/8	20-1/2
36	37	32-1/2	20-1/2
37	38	32-5/8	20-1/2
38	39	32-3/4	20-1/2
39	40	32-7/8	20-1/2
40	41	33	20-1/2
41	42	33-1/8	20-1/2
42	43	33-1/4	20-1/2
44	45	33-1/2	20-1/2
46	47	33-3/4	20-1/2

1/ Tolerance for all measurements shall be ± 3/8 inch.

2/ Breast measurement shall be taken with coat buttoned, from folded edge to folded edge, in line with the pit of the armhole; multiply by 2.

3/ Back length measurement shall be taken along the center back seam from lower edge of the collar to bottom edge of the coat.

4/ Sleeve length measurement shall be taken along the forearm seam from the pit of the armhole to the bottom edge of the sleeve.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified, in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure that supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements; however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.4)

b. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in Table III.

4.4 First article inspection. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.5.2.1 through 4.5.2.5. The presence of any defect or failure to pass any test shall be cause for rejection of the first article. The number of units to be inspected shall be specified by the contracting officer (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.5 Quality conformance inspection.

4.5.1 Component and material inspection. In accordance with 4.1 above, components and materials shall be tested in accordance with all the requirements of the referenced specifications, figures, and standards, unless otherwise excluded, amended, modified, or qualified in this specification, or applicable purchase order. In addition to the testing provisions contained in subsidiary specifications, figures, and standards, testing shall be performed on the components listed in Table III for the characteristics noted.

4.5.1.1 Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following (the lot shall be unacceptable if one or more sample units fail to meet any test requirement specified herein):

Lot size (lot unit)	Sample size (sample unit)
800 or less	2
801 through 22,000	3
22,001 and over	5

The unit for expressing lot sizes and sample units for testing each component shall be in accordance with applicable subsidiary specifications and as follows:

Component	Lot sizes expressed as:	Sample unit for testing
Hook and eye	100 each	2 each, hook and eye
Ornamental braid	yards	5 yards

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. Det. Per S/Unit	Results reported as:
Ornamental Braid	Weave	3.3.15	Visual	1	Pass or fail
	Weight, ounces	3.3.15	5041		
	gross yards	3.3.15	4.3.2	1	To nearest 0.1 oz.
	Texture (picks and ends)	3.3.15	Visual	5	Average of 5 det. to nearest whole number
	No. of Carriers	3.3.15	Visual	1	To nearest number
	Shrinkage 2/	3.3.15	5558		
	Breaking strength 3/	3.3.15	5100		
	Colorfastness to:				
	- (wet) dry cleaning	3.3.15	5622		
	- light	3.3.15	5660		
Hook and Eye	Material identification 1/	3.3.17	Std Comm'l	1	Pass or fail
	Finish	3.3.17	4.3.1.2	1	Pass or fail

1/ Certificate of compliance.

2/ Except that the width of the test specimen shall be the full width of the braid.

3/ Breaking strength shall be determined on the full width of the braid and the jaw dimensions shall be greater than the width of the braid.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.5.1.2 In process inspection. Inspections shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.2 Examination of the end item. The end item shall be examined for the defects listed in 4.5.2.2 through 4.5.2.5 The sample unit shall be one completely fabricated coat.

4.5.2.1 Classification of defects. All defects shall be classified as indicated below, except those numbered 1 through 99 in the classification column, which shall be classified as follows:

Major defect - When seriously affecting appearance or serviceability.

Minor A defect - When not seriously affecting appearance or serviceability.

4.5.2.2 General defects. General defects shall be classified as follows:

Examine	Defects	Classification		
		Major	Minor A	Minor B
Buttonholes (construction)	a. One or more omitted, added or wrong type.	101		
	b. Not corresponding to size of button (front):			
	- too small, not permitting button to enter buttonhole.	102		
	- too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		201	
	c. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	103		
	d. Bartack missing or loose on:			
	- one buttonhole.		202	
	- two or more buttonholes.	104		
	e. Bartack misplaced, not serving intended purpose on:			
	- one buttonhole.			301
	- two or more buttonholes.		203	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes (construction)	f. One or more broken stitches in:			
	- one buttonhole.	105		
	- two or more buttonholes.		204	
	g. More than 2 skipped stitches in:			
	- one buttonhole.			302
	- two or more buttonholes.		205	
	h. Ragged edges, affecting appearance; or exposed interlining not colored with reddish indelible ink as specified.			303
	i. Any uncut buttonhole.		206	
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		207	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified:			
	- one or two stitches.			304
	- three or more stitches.		208	
	l. One or more buttonholes finished with purling on the outside of fronts.	106		
Buttons or ring toggles	a. One button or ring toggle missing, loose, defective, or improper size ,type, color or finish.		209	
	b. Two or more buttons or ring toggles missing, loose, defective, or of improper size or type.	107		
	c. One or more buttons attached with the head of the eagle in other than an upright position.			305

NOTE: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; unsound soldering; scratches; dents, blemishes, or imbedded foreign matter; loose shanks; or are poorly plated or badly shaded.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Cleanness	a. One or more spots or stains of a permanent nature clearly noticeable:			
	- on the outside.	108		
	- on the inside.		210	
	b. One or more removable spots or stains clearly noticeable:			
	- on the outside.		211	
	- on the inside.			306
	c. Thread ends not trimmed throughout garment, one or more bastings not removed, or two or more shade tickets not removed.			307
Components and assembly	a. Any component part or required operation omitted (unless otherwise classified herein).	1		
Cutting	a. Any component part of basic wool material not cut in accordance with the directional lines on patterns; or in accordance with specification requirements.	109		
	b. Cloth gabardine (white) for piping cut on the bias.		212	
	c. Any lining part not cut in accordance with the directional lines on the patterns; or in accordance with specification requirements.		213	
Eyelets (construction)	a. One or more omitted or added.	110		
	b. Wrong type.		214	
	c. Eyelet not securely caught on fabric, causing stitching to pull away from fabric.	111		
	d. Diameter of inside opening less than 1/8 inch or more than 1/4 inch.			308
	e. One or more eyelets uncut.		215	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Eyelets (construction)	f. One or more broken stitches in:			
	- one eyelet.			309
	- two or more eyelets.		216	
	g. More than two skipped stitches in one or more eyelets.		217	
Hook and eye	a. Not specified type or size.		218	
	b. Hook or eye not securely tacked to the ends of the collar.		219	
	c. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hooks and eyes are fastened.		220	
Material defects and damages	a. Any weakening defect such as smash, multiple float, or loose slub.	2		
	b. Any hole.	3		
	c. Shade bar, unsightly slub, etc., affecting appearance:			
	- on outside.	4		
	- on inside.		221	
	d. Scissors or knife cut, tear, mend, or burn.	5		
	e. Needle chews that may develop into a hole.	6		

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have negligible affects on serviceability are to be classified as follows:

Material defect - No defect
Workmanship damages - Minor B defect

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Ornamental braid	a. Not specified type, size or color.	112		
	b. One or more omitted.	113		
Pressing	a. Burned or scorched.	7		
	b. Pressing of the entire garment omitted.		222	
	c. Armhole stretched.	8		
	d. Poorly pressed (unless otherwise indicated).			310
	e. Basting or pressing impressions not removed on a major portion of the coat.		223	
	f. Gloss not removed on a major portion of the coat.			311
	g. Armholes not blocked or poorly blocked, affecting appearance.		224	
	h. Edges bulky; i.e., not pressed solid, affecting appearance.		225	
	i. Inside of armhole not creased as required.		226	
	j. Sleeve not creased at the front or backarm seam.		227	
	k. Wrinkles or pressing impressions not removed from under pocket flap, side, or center back seam allowance.		228	
	l. Linings not pressed smooth.		229	
	m. Armhole seam not pressed open across the top as required.		230	
Seams and stitching	a. Accuracy of seaming:			
	1. Any seam twisted, puckered, or pleated, affecting appearance.	114		
	2. Part of the garment caught in any unrelated operation or stitching.	9		
	3. Unsightly hand felling or blindstitching exposed on the outside of the coat, affecting appearance.		231	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.			312
	5. Wrong color of thread or two shades of thread used on outside of coat, affecting appearance.	10		
	b. Gage of stitching (edge or raised stitching):			
	1. Irregular; i.e., unevenly gaged; or various stitchings not uniform, affecting appearance.		232	
	2. Beyond range of width specified or varies by more than 1/16 inch when no range is specified.			313
	c. Open seams:			
	1. On outside:			
	- up to 1/4 inch inclusive.			314
	- more than 1/4 inch but not more than 1/2 inch.		233	
	- more than 1/2 inch.	115		
	2. On inside:			
	- up to 1/2 inch inclusive (except machine felling).		234	
	- more than 1/2 inch (except machine felling).			315
	- up to 1 inch inclusive (machine felling).			316
	- more than 1 inch (machine felling).		235	

NOTE: One or more broken stitches, or two or more continuous, skipped, or runoff stitches shall constitute an open seam.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	d. Raw edges:			
	1. On outside:			
	- up to 1/8 inch inclusive.			317

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	- more than 1/8 inch but not more than 1/4 inch.		236	
	- more than 1/4 inch.	116		
	2. On inside:			
	- more than 1/8 inch but not more than 1/4 inch.			318
	- more than 1/4 inch.		237	

NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	e. Runoffs (see classification of open seams).			
	f. Stitch tension:			
	1. Loose tension resulting in a loose seam.	117		
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		238	
	3. Tight tension (stitches break when normal strain is applied).	118		

NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test the seam by exerting pull in lengthwise direction of seam.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	g. Stitches per inch (excluding labels) less than minimum specified:			
	- one or two stitches.			319
	- three stitches.		239	
	- four or more stitches.	119		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

NOTE: To be scored only if the condition exists on a major portion of seam.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	h. Wrong stitch or seam type.		240	
	i. Stitching skipped or broken (on edge or raised stitching when seam is seamed, turned and stitched).		241	
	- 1/4 inch or more, but not more than 1/2 inch.			320
	- more than 1/2 inch.		242	
Shaded parts	a. Any outside part shaded.	11		
	b. Any lining part badly shaded except sleeve lining.		243	
	c. Sleeve lining parts badly shaded, or parts not matching each other.			321
Strap eyes and strap loops	a. Missing, loose, or defective:			
	- one or both strap eyes.	120		
	- one or both strap loops.	121		

4.5.2.3 Detailed defects (outside of coat). Detailed defects on the outside of coat, with coat buttoned on a form or spread out on a table, shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Collar (construction and setting)	a. Interlining omitted.	122		
	b. Interlining tight or twisted, causing puckers on the collar, affecting appearance.		244	
	c. Tight at joining to front or back, causing puckers or pleats at the neck of the coat, affecting appearance.	12		
	d. Piping irregular, affecting appearance.		245	
	e. Collar ends overlapping when fastened.		246	
	f. Collar ends spread open more than 3/8 inch when fastened.		247	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar (construction and setting)	g. Center of eyelets from finished ends of collar: - less than 1-3/8 inches but not less than 1-1/4 inches.			322
	- more than 1-5/8 inches but not more than 1-3/4 inches.			323
	- less than 1-1/4 inches or more than 1-3/4 inches.		248	
	h. One or both eyelets off-center with top and bottom edges of collar by more than 1/4 inch.			324
	i. Front finished ends of the collar uneven in width by 3/16 inch or more.		249	
Alignment of front buttons and buttonholes	a. Not aligned, causing a noticeable bulge or twist on the fronts when buttoned, affecting appearance.		250	
	b. Horizontal alignment of toggle attached buttons with sewn buttons on right front: 1. One or more rows out of alignment by more than 1/2 inch but not more than 1 inch.		251	
	2. One or more rows out of alignment by more than 1 inch.	123		
Ornamental braid (position, construction and setting)	a. One or more rows out of horizontal alignment by more than 1/2 inch.		252	
	b. One or more rows of braid not formed with either a figure 8 or a harp.	124		
	c. Diameter of figure 8 circle less than 27/32 inch or more than 7/8 inch.			325
	d. Back edge of second harp from the top less than 3/8 inch from finished armhole seam.		253	
	e. One or more inner circles forming figure 8 less than 1/8 inch in diameter.		254	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Ornamental braid (position, construction and setting) (cont'd)	f. One or more rows of braid not stitched through interlining.			326
	g. Stitching of braid not started or ending at bottom of harp where the front and back cross.			327
	h. Stitching of braid not uniform, affecting appearance.		255	
	i. Ends of stitching not securely tacked on one or more braids.		256	
	j. One or more braids not lying smooth, i.e., puckered, twisted, pleated or having excessive fullness, affecting appearance.	*		
	k. Braid not pressed smooth and flat.			328
	l. One or more harps not formed in accordance with Figure 7.		257	
	m. Braid loop around one or more buttonholes not properly positioned, restricting use of buttonhole for buttoning.		258	
	n. Inner edges of horizontal braid not adjacent to one another, i.e., spaced more than 1/16 inch apart on one or more braids.		259	
	o. Front edge of one or more braids on left front positioned less than 1/4 inch from piping joining seam.			329
	p. Front edge of braid out of vertical alignment with left front edge of coat by 1/8 inch or more.		260	
	q. One or more braids not hand felled together at inner edges for full length of straight portion except at openings for buttonholes.		261	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Shoulder loops for epaulet (position and secure sewing)	a. Strap loop attachment less than 1-1/4 inch or more than 1-3/8 inches from armhole seam at shoulder seam.		262	
	b. Strap loop attachment tapering down from shoulder less than 1-3/16 or more than 1-5/16 inches from armhole seam.			330
	c. Back end of strap loop attachment less than 3/8 inch at back of shoulder seam or less than 1-3/8 inches in front of shoulder seam.			331
	d. Strap loop attachment on one shoulder not uniform with position of loop on other shoulder by 1/4 inch or more.		263	
	e. Loop less than 4-3/4 inches or more than 4-7/8 inches from armhole seam.			332
	f. Back edge of loop less than 3/8 inch forward of shoulder seam.			333
	g. Loop on one one shoulder not uniform with position of loop on other shoulder by 1/4 inch or more.		264	
	h. One or both loops not securely stitched to coat.		265	
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by:			
	- more than 1/8 inch but not more than 1/4 inch.		266	
	- more than 1/4 inch.	125		
	b. Left front at corner longer than right front by:			
	- more than 1/4 inch but not more than 3/8 inch.			334
	- more than 3/8 inch.		267	
	c. Right front at corner exposed beyond the bottom edge of the left front by more than 1/8 inch.		268	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Shoulder (construction)	a. Improperly joined or set, causing the shoulders or back to twist.	13		
Shoulder pads	a. Not completely caught in the armhole tacking.		269	
	b. Misplaced or not serving intended purpose; i.e., too far back or too far forward.		270	
	c. One or both pads omitted.		271	
Armholes (construction)	a. Badly stretched, affecting appearance.	14		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	15		
	c. Crooked seam, affecting appearance.		272	
	d. Tape stitching exposed and visible on outside surface.			335
	e. Sleeve head pads not completely tacked to armholes; or misplaced, not serving intended purpose.		273	
	f. One or both sleeve head pads omitted.		274	
Sleeves	a. Setting and hang: 1. Sleeve fullness misplaced, affecting appearance.		275	
	2. Backarm seam of the sleeve not matching side back seam by: - more than 1/4 inch but not more than 1/2 inch.		276	
	- more than 1/2 inch.	126		
	3. Hang of sleeves on the same coat in opposite direction by more than 2 inches.		277	
	4. Sleeve tight in armhole (roll effect not present).		278	
	b. Sleeve lining: 1. Twisted, tight, or short, causing bulge, twists, or puckering on outside of			

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	sleeves.	16		
	2. Sleeve lining too long, causing lining to sag at the bottom more than 1/2 inch.			336
	3. Sleeve lining seams out of alignment by more than 3/4 inch with sleeve seams at armholes or at bottom of sleeves.			337
	c. Construction of sleeves:			
	1. Tacking on bottom turnup to body of sleeve omitted or insecure.		279	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			338
	3. Tacking on 1 or both sleeve lining seams to sleeve seams omitted; or insecure.			339
	4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from the bottom edge of sleeve.			340
	5. Cut dart on wool undersleeve omitted.		280	
	6. One or both wool sleeve darts not pressed open, smooth and flat.			341
	d. Sleeve cuffs:			
	1. Piping irregular, affecting appearance.		281	
	2. Top edge of top sleeve part poorly shaped, affecting appearance.		282	
	3. Height of pointed end on both sleeves varying in length by more than 1/4 inch.		283	
	4. Sleeve puckered at joining of cuff, affecting appearance.		284	
	5. Cuff puckered or twisted at joining to sleeve affecting appearance.		285	
	6. Ends of cuff staggered at backarm seam by:			

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	- 1/8 inch or more but not more than 1/4 inch.			342
	- more than 1/4 inch.		286	
	7. Height of cuff at point on top sleeve including piping:			
	- less than 5-3/4 inches but not less than 5-1/2 inches or more than 6-1/4 inches but not more than 6-1/2 inches.			343
	- less than 5-1/2 inches or more than 6-1/2 inches.		287	
	8. Height of cuff at backarm or front creased edges including piping:			
	- less than 3 inches but not less than 2-3/4 inches or more than 3-1/2 inches but not more than 3-3/4 inches.			344
	- less than 2-3/4 inches or more than 3-3/4 inches.		288	
	9. Point of cuff not centered between the lower forearm creased edge and the creased backarm seam of sleeves by more than 1/4 inch.		289	
Position of buttons on sleeve cuffs	a. Horizontal alignment of buttons on one sleeve cuff not uniform with other sleeve cuff by more than 1/4 inch.			345
	b. Buttons on one or both sleeve cuffs out of vertical alignment by more than 1/8 inch.			346
Body (outside)	a. Fitting of body linings tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	17		
	b. Fitting of front interlining: 1. Tight, short, or twisted, causing fullness or twist on the outside of the coat, affecting appearance.	18		

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Body (outside) (cont'd)	2. Too full, causing coat front to have a wavy appearance.	19		
Waist seam	a. Seam not pressed open.		290	
	b. Seam stretched, affecting appearance.		291	
	c. Tape set on tight, causing puckering on waist seam, affecting appearance.		292	
Lower skirt dart	a. One or both darts cut and sewn type in lieu of folded seam type.			347
	b. End on one or both darts not properly tapered, causing puckering at end of dart, affecting appearance.		293	
	c. Length of one or both darts less than 5 inches or more than 5-1/2 inches long.			348
	d. One or both folded darts not pressed flat as specified.			349
Upper front, side body and side back panel seams	a. One or more joining seams not spread open and pressed flat.		294	
	b. Curved side back panel seam stretched or distorted, affecting appearance.		295	
Center back and skirt	a. Joined seams below waist seam not pressed flat and towards the center of back.		296	
	b. Piping at back edge of skirt set on tight, causing puckering on back, affecting appearance.		297	
	c. Folded edge of piping extending less than 1/8 inch beyond the seam on back.		298	
	d. Buttons on each back seam at the skirt seam: - out of horizontal alignment by 1/4 inch or more.		299	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Center back and skirt (cont'd)	- one or both reinforcement disc omitted.			350
Front and bottom edges	a. Front edge stretched, affecting appearance.		201a	
	b. Piping set on tight, causing puckering on front, affecting appearance.		202a	
	c. Front or bottom piping irregular, affecting appearance.		203a	
	d. Bottom edge stretched, puckered, or uneven, affecting appearance.			351
	e. Bottom corner of left front poorly shaped, affecting appearance.		204a	
	f. Left front rolling outward below bottom button.	20		
	g. Front edge irregular, affecting appearance.		205a	
	h. Piping tight on bottom edge, causing puckering on outside of coat, affecting appearance.		206a	
	i. Left front not dressed as specified.	127		
Front facings	a. Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.	21		
Front buttonholes (position)	a. Position from front edge, including piped edge: - less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch.			352
	- less than 1/2 inch or more than 7/8 inch.		207a	
	b. More than 1/4 inch from equal spacing.		208a	
	c. Bottom buttonhole above or below waist seam.		209a	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Front buttonholes (position)	d. Unevenly spaced from front edge by more than 3/16 inch.		210a	
	e. Top buttonhole less than 7/8 inch or more than 1-1/8 inches from top edge of piping (collar notch).		211a	
Front buttons (position and secure sewing)	a. out of vertical alignment by 1/4 inch or more.		212a	
	b. Center of one or more buttons positioned from right front edge:			
	- less than 5/8 inch but not less than 1/2 inch or more than 3/4 inch but not more than 7/8 inch.			353
	- less than 1/2 inch or more than 7/8 inch.		213a	
	c. Button stitching not caught through interlining canvas front on 1 or more buttons.	128		
	d. Button stitching caught through interlining (canvas front) but not facing:			
	- on 1 button.			354
	- on 2 or more buttons.		214a	

4.5.2.4 Detailed defects (inside of coat). Detailed defects on the inside of the coat shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Labels	a. Any required label missing, incorrect, or illegible; or size label not securely caught in stitching.		215a	
	b. Identification label not stitched on 4 sides.			355
	c. Bottom edge of identification label less than 3 inches, or more than 5 inches, from bottom edge of coat.			356

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Labels (cont'd)	d. Identification label not stitched to outside of right facing.			357
Hanger	a. Hanger omitted or ends not securely stitched.		216a	
	b. Less than 1-7/8 inches or more than 2-1/8 inches long, measured along the lower edge of collar lining.			358
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.			359
Front facings	a. Fullness or pleats on facings between buttons or buttonholes; or between front edge and buttons or buttonholes.			360
	b. Tacking on back edge to one or both interlinings: - omitted.		217a	
	- insecure or incomplete for a distance of more than 4-1/2 inches below the shoulder seam; or more than 4 inches above the bottom edge of coat.			361
	c. Felling at bottom edge of front or back edge of facing omitted or insecure on one or both facings.		218a	
	d. Felling along folded edge of one or both facings at collar notch omitted or insecure.		219a	
Body linings	a. Excessive puckering or pleated.			362
	b. Twisted, not affecting smoothness on outside of coat.		220a	
	c. One or both chest pleats on shoulders omitted.		221a	
	d. Folded edge of one or both chest pleats facing front edge of coat.			363

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Body linings (cont'd)	e. Pleat omitted at center of back lining.		222a	
	f. Pleat less than 1/2 inch in depth at the center of the back lining.			364
	g. Bottom hem less than 5/8 inch or more than 7/8 inch.			365
	h. Lining too long; i.e., exposed beyond bottom edge of coat.		223a	
Lining (securing straps)	a. One or both omitted or insecure.		224a	
	b. Less than 1/4 inch or more than 3/8 inches wide.			366
	c. One or both positioned more than 1 inch from back seams.			367
	d. End of one or both straps not fastened between the piping at bottom edge of coat and skirt seam allowance.			368
	e. One or both not folded and stitched across width.			369
	f. One or both not properly attached to lining hem of coat, causing twist or distortion to either the lining or coat.		225a	
	g. One or both exposed beyond bottom edge of coat.		226a	
Serge or overedge stitching	a. Basic material: - omitted on one or more raw edges for cut darts and seams where specified.		227a	
	b. Piping the skirt: - omitted on raw edges of one or both folded pipings.		228a	
	c. Lining joined seams: - omitted on one or more seams where specified.		229a	
Waist seams	a. Tape on one or both seams omitted.		230a	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Underarm shields	a. One or both omitted.		231a	
	b. Not two-piece lining construction.		232a	
	c. Tacking on one or both shields along side or bottom edge to body lining omitted or insecure.			370
	d. Top edge not caught in armhole tacking or stitching when tacked by hand.			371
	e. Puckered, pleated, or twisted.			372
	f. One or both shields misplaced, not serving intended purpose.			373
Inside of armhole	a. Backstitching at armpit of armhole from backarm seam of sleeve to front edge of shield omitted.			374
Collar extension tab	a. Omitted.		233a	
	b. Extending less than 1/2 inch or more than 1 inch from left end of collar.			375
	c. Insecurely felled; or felling not on four sides.			376
	d. Box stitching omitted.		234a	
Collar lining and eyelet covers	a. Ends of collar lining not securely tacked.		235a	
	b. One or both eyelet covers omitted.		236a	
	c. One or both eyelet covers not covering eyelet.		237a	
	d. Width of collar eyelet less than 1-5/8 inches or more than 1-7/8 inches.			377
	e. Felling on front edge and along lower corner of 1 or both eyelet covers omitted.		238a	
	f. Felling along lower corner of one or both eyelet covers extending for a distance of more than 3/4 inch.			378

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar lining and eyelet covers (cont'd)	g. Top or bottom hook positioned less than 1/4 inch from top or bottom edges respectively of collar.			379
	h. Remaining hook not positioned midway between top and bottom hook.			380

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

4.5.2.5 Finished measurements. Any measurement deviating from the nominal dimensions and tolerances specified in table II shall be classified as a size measurement defect. Sleeve length uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5.3 Examination of preparation for delivery requirements. An examination shall be made to determine compliance with packaging, packing, and marking requirements of section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container, fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery.

Examine	Defect
Marking (exterior and interior)	Omitted; incorrect; illegible; or improper size, location, sequence, or method of application.
Materials	Any component missing or damaged.
Workmanship	Inadequate application of components such as incomplete closure of case liners, container flaps, loose strapping, or inadequate stapling. Bulging or distortion of containers.
Content	Number of coats per container is more or less than required.

4.6 Tests. Tests shall be in accordance with the following.

4.6.1 Lacquer tests.

4.6.1.1 Liver of sulfur. The samples to be tested shall be immersed in a 2 percent by weight chemically pure liver of sulfur (potassium sulphide) water solution, at a temperature of 100° to 110° F, for not less than 3 minutes. The samples shall then be removed and rinsed in warm, then cold, then hot water, after which they shall be wiped gently in an absorbent cellulose material or whirled to remove residual moisture, and allowed to air dry at room temperature for a period of 1 hour. There shall be no change in the appearance of the lacquered surfaces except for a slight overall yellowing and not more than 3 dark spots, each not exceeding 1/32 inch largest dimension.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

4.6.1.2 Test for tackiness. At room temperature (60° F to 80° F) press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall be free when pressure is released.

4.6.1.3 Weight of braid per gross yards. Weigh 6 yards of braid in a relaxed condition on a balance or scale accurate to ± 0.25 percent. Convert to ounces and multiply by 24 to obtain the weight of 144 yards.

5. PACKAGING.

5.1 Preservation. Unless otherwise specified, the coats shall be preserved in accordance with ASTM D 3951.

5.2 Packing. Coats preserved in accordance with 5.1 shall be packed in accordance with ASTM D 3951.

5.3 Marking. In addition to any special marking required by the contract or purchase order, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES.

(This section contains information of a general or explanatory nature that may helpful but is not mandatory.)

6.1 Intended use. The coats described herein are intended for wear by enlisted male personnel of the U.S. Marine Corps Band.

6.2. Acquisition requirements. Acquisition documents shall specify the following:

a. Title, number, and date of this specification.
b. Issue of DODISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.1).
c. Sizes required (see 1.2).
d. Whether first article is required (see 3.2).
e. Number of coats in first article (see 3.2).

6.3 Samples and shade samples. For information regarding availability of sample coats and of the standard shades specified (see 3.1 and 3.3), address inquiry to the procuring activity issuing the invitation for bids.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).

6.5 Changes from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

6.6 Subject term (key word) listing.

Man's
Musician's

Preparing Activity:
Navy - MC
Project No. 8405-N284

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

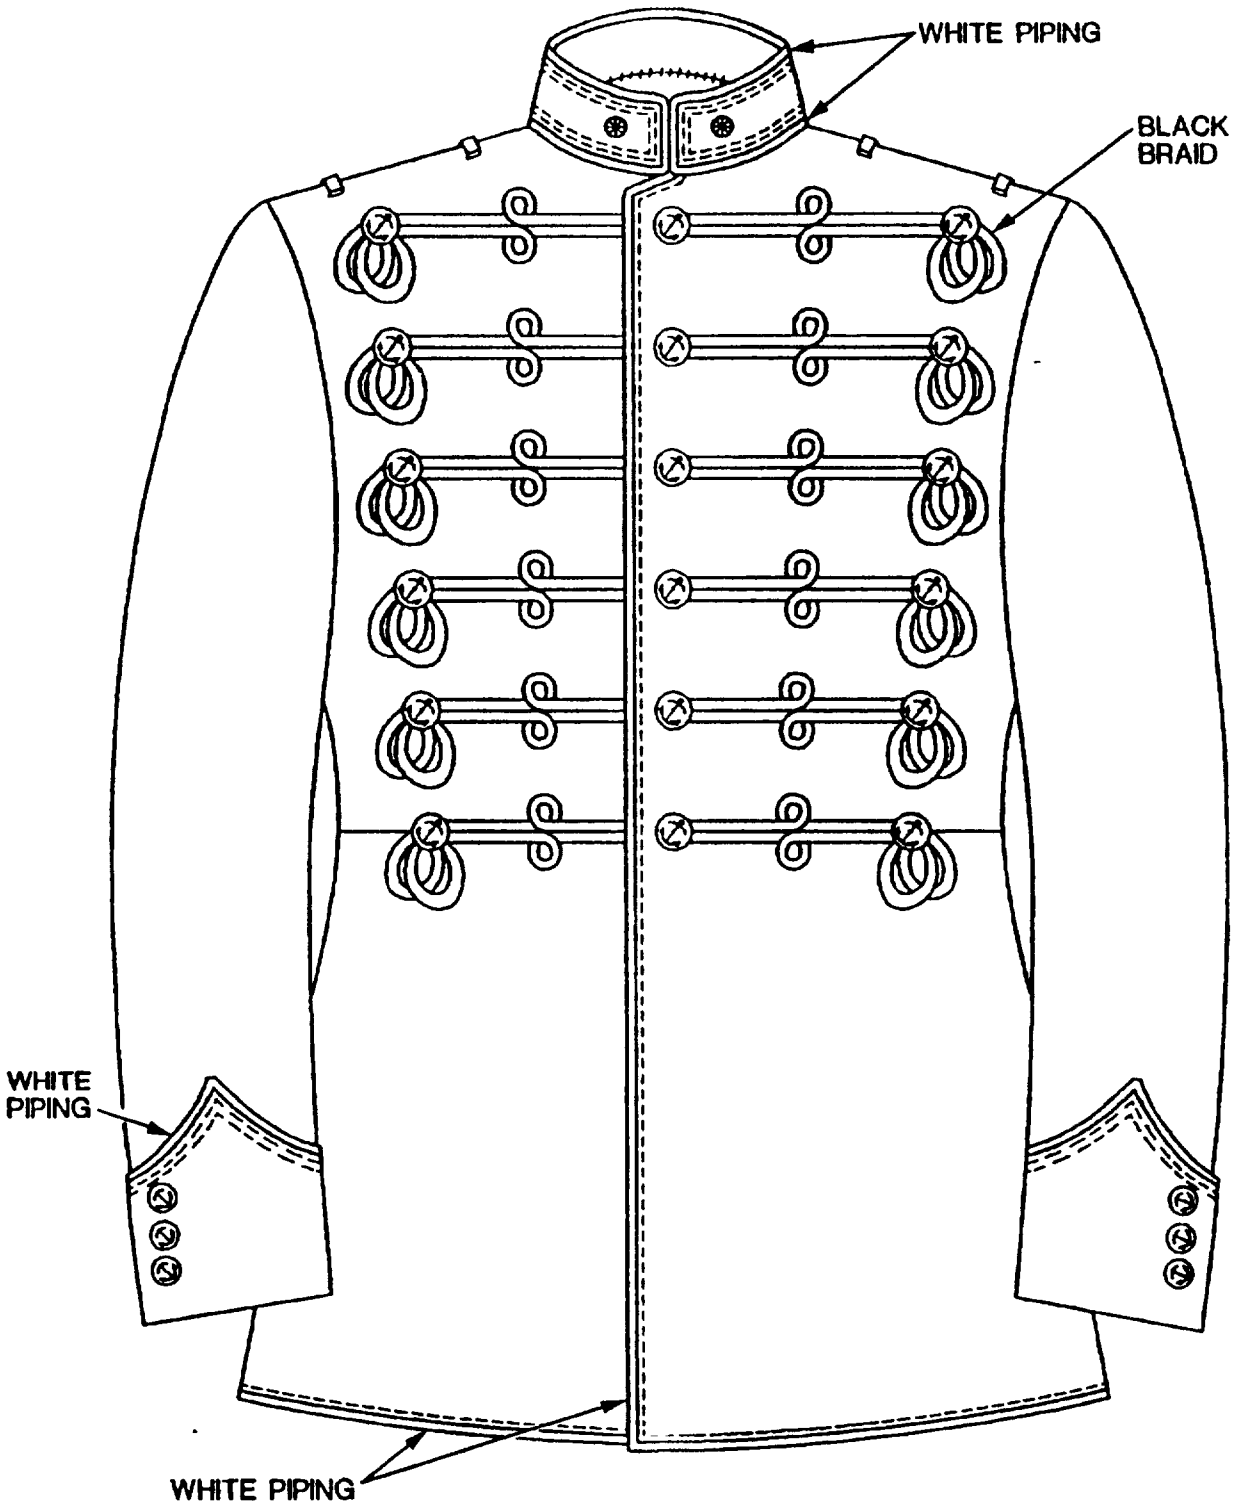


FIGURE 1. COAT, MAN'S: FULL DRESS: SCARLET, U. S. MARINE BAND, MUSICIAN

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

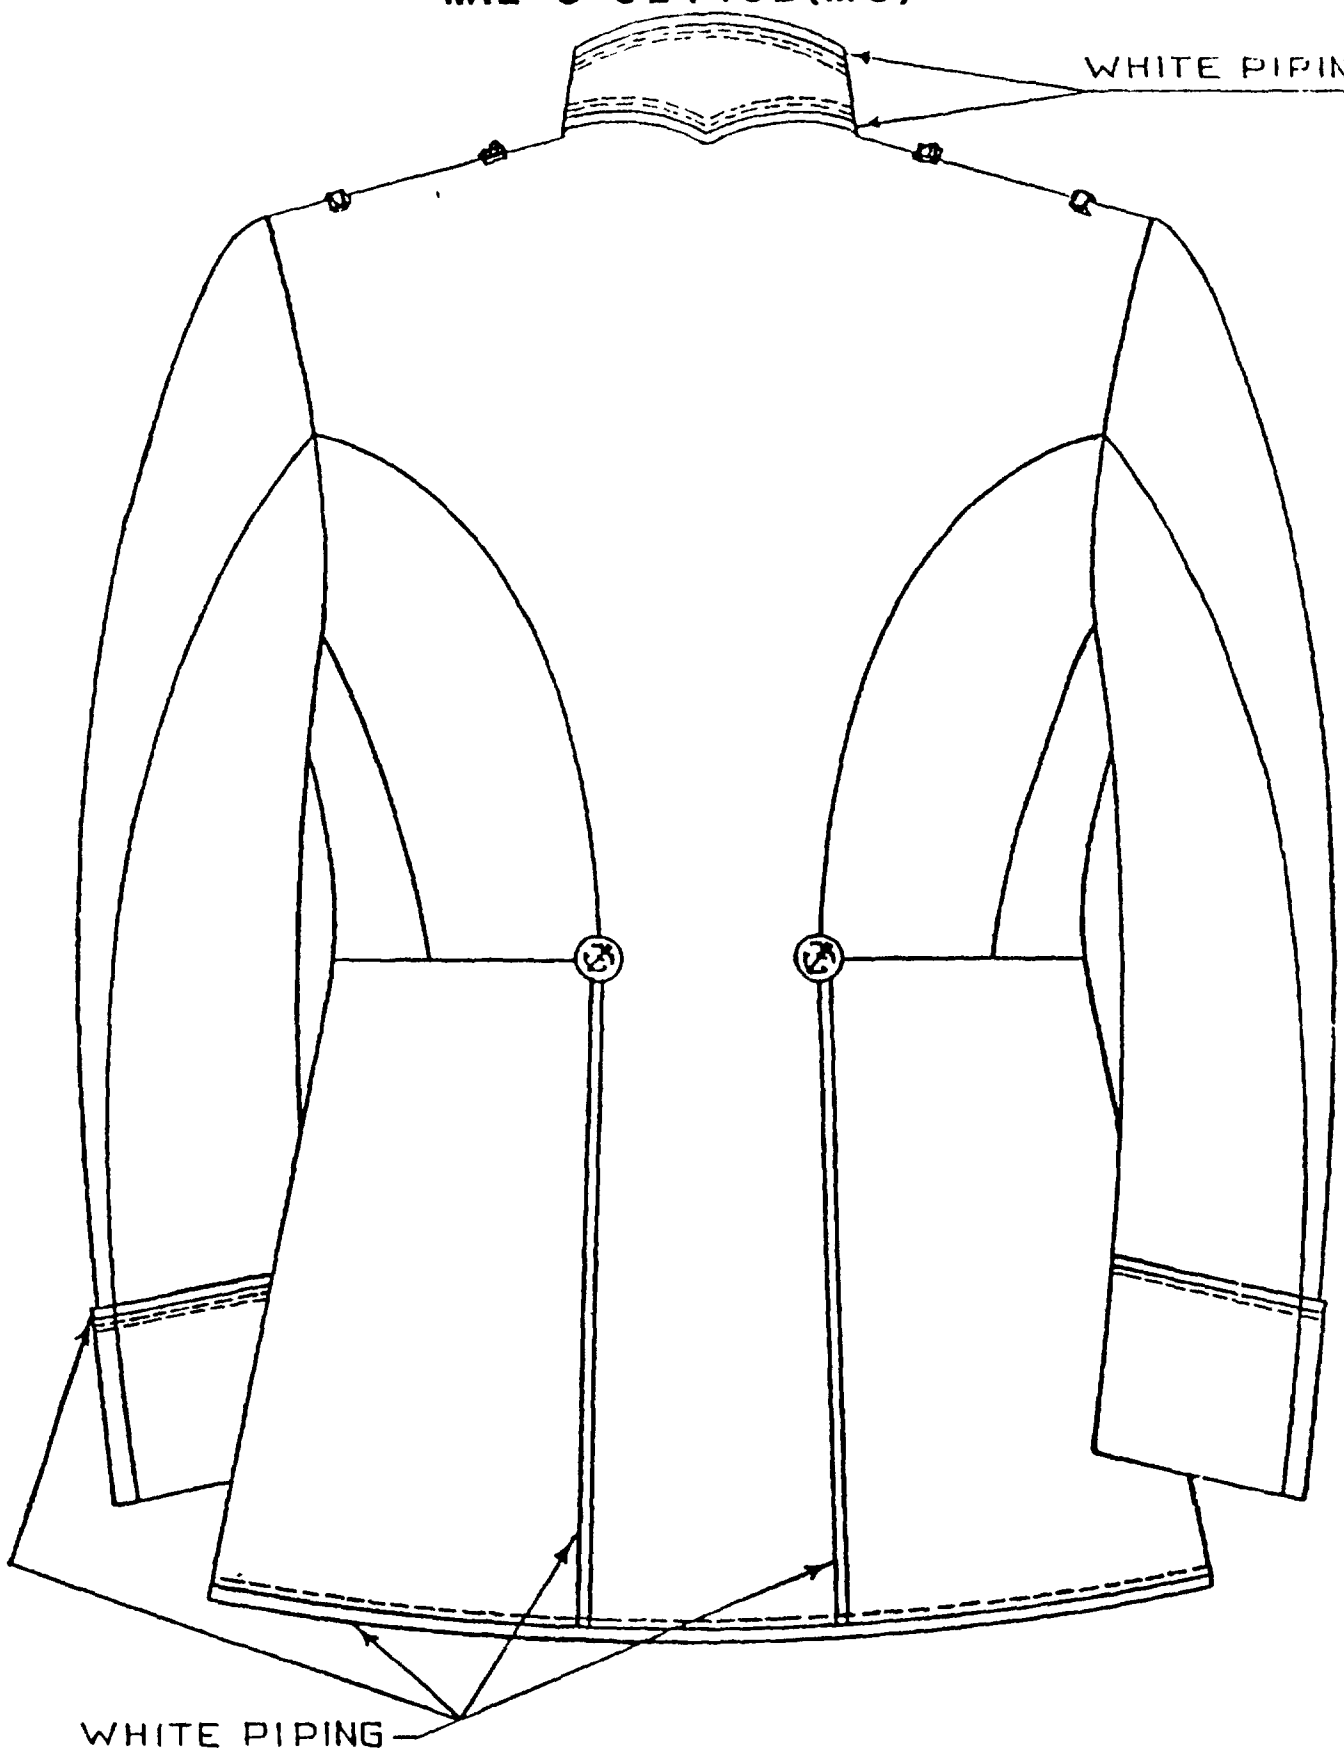


FIG. 2. COAT, MAN'S; FULL DRESS, SCARLET.
U.S. MARINE BAND; MUSICIAN

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.


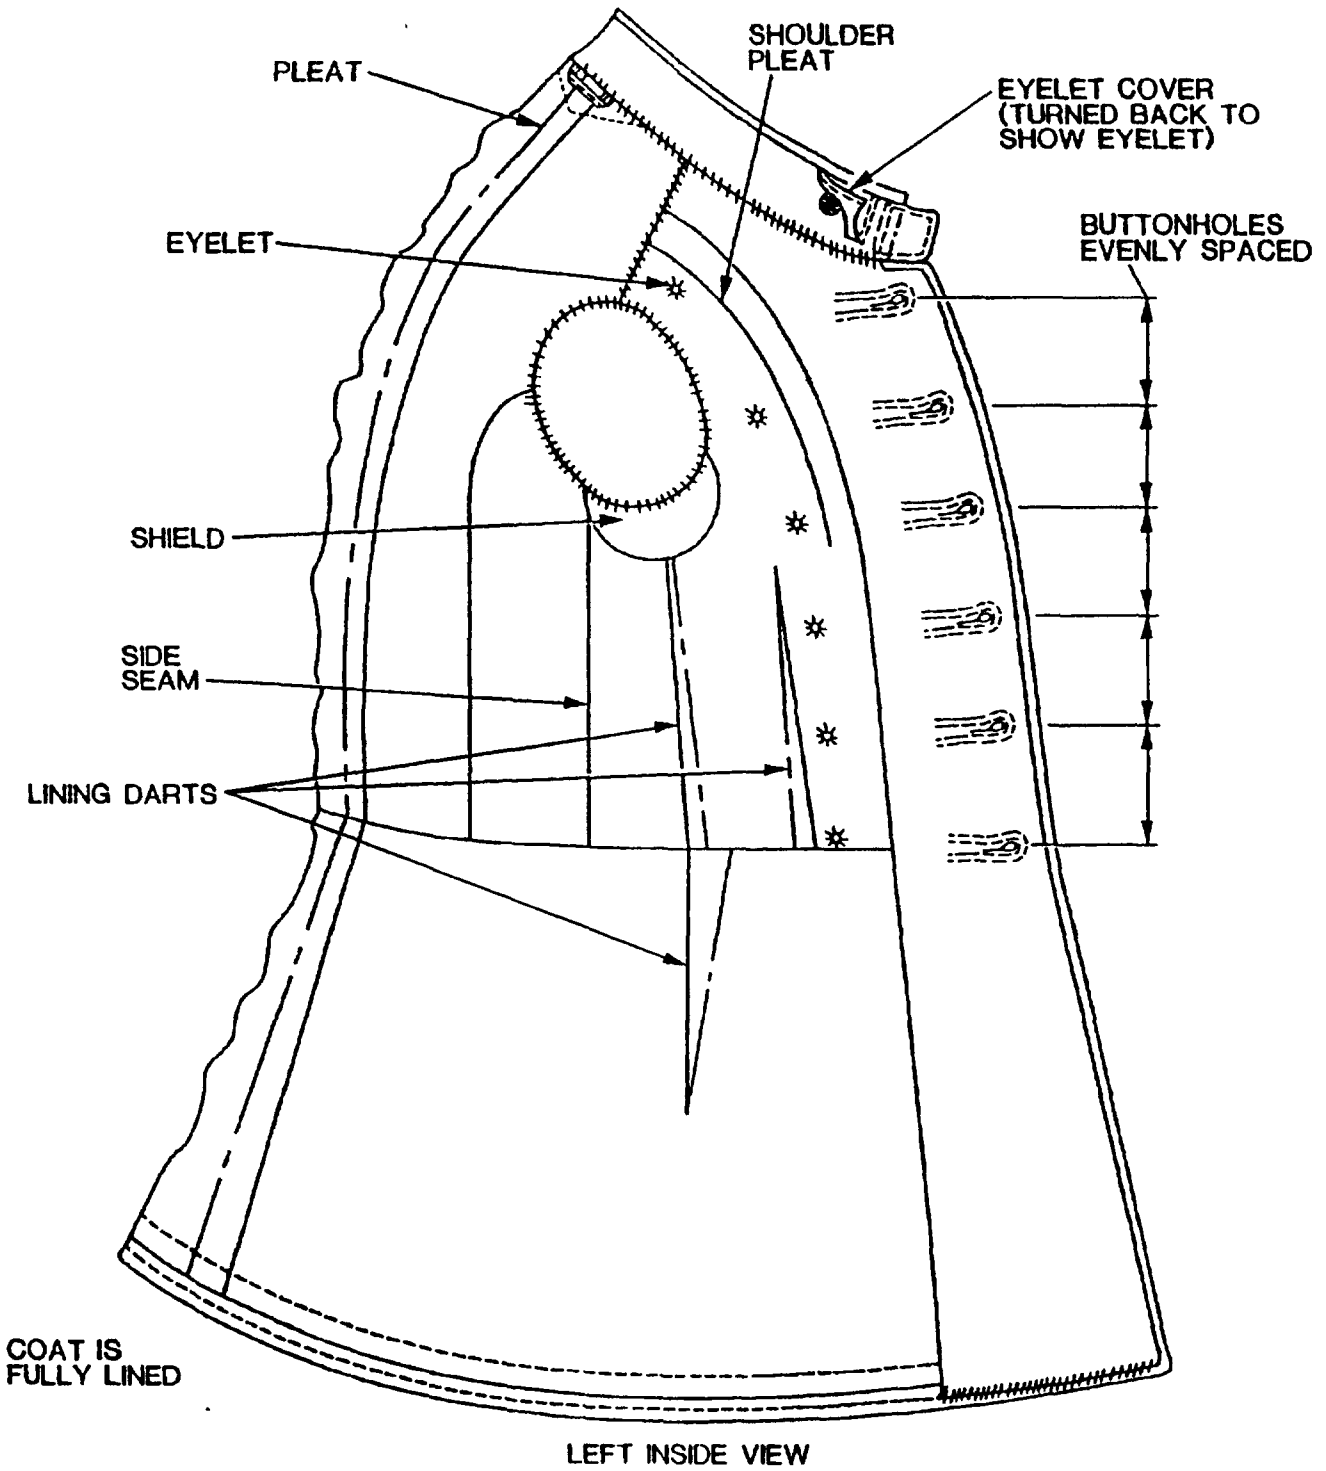


FIGURE 3. COAT, MAN'S: FULL DRESS, SCARLET, U. S. MARINE BAND; MUSICIAN


Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

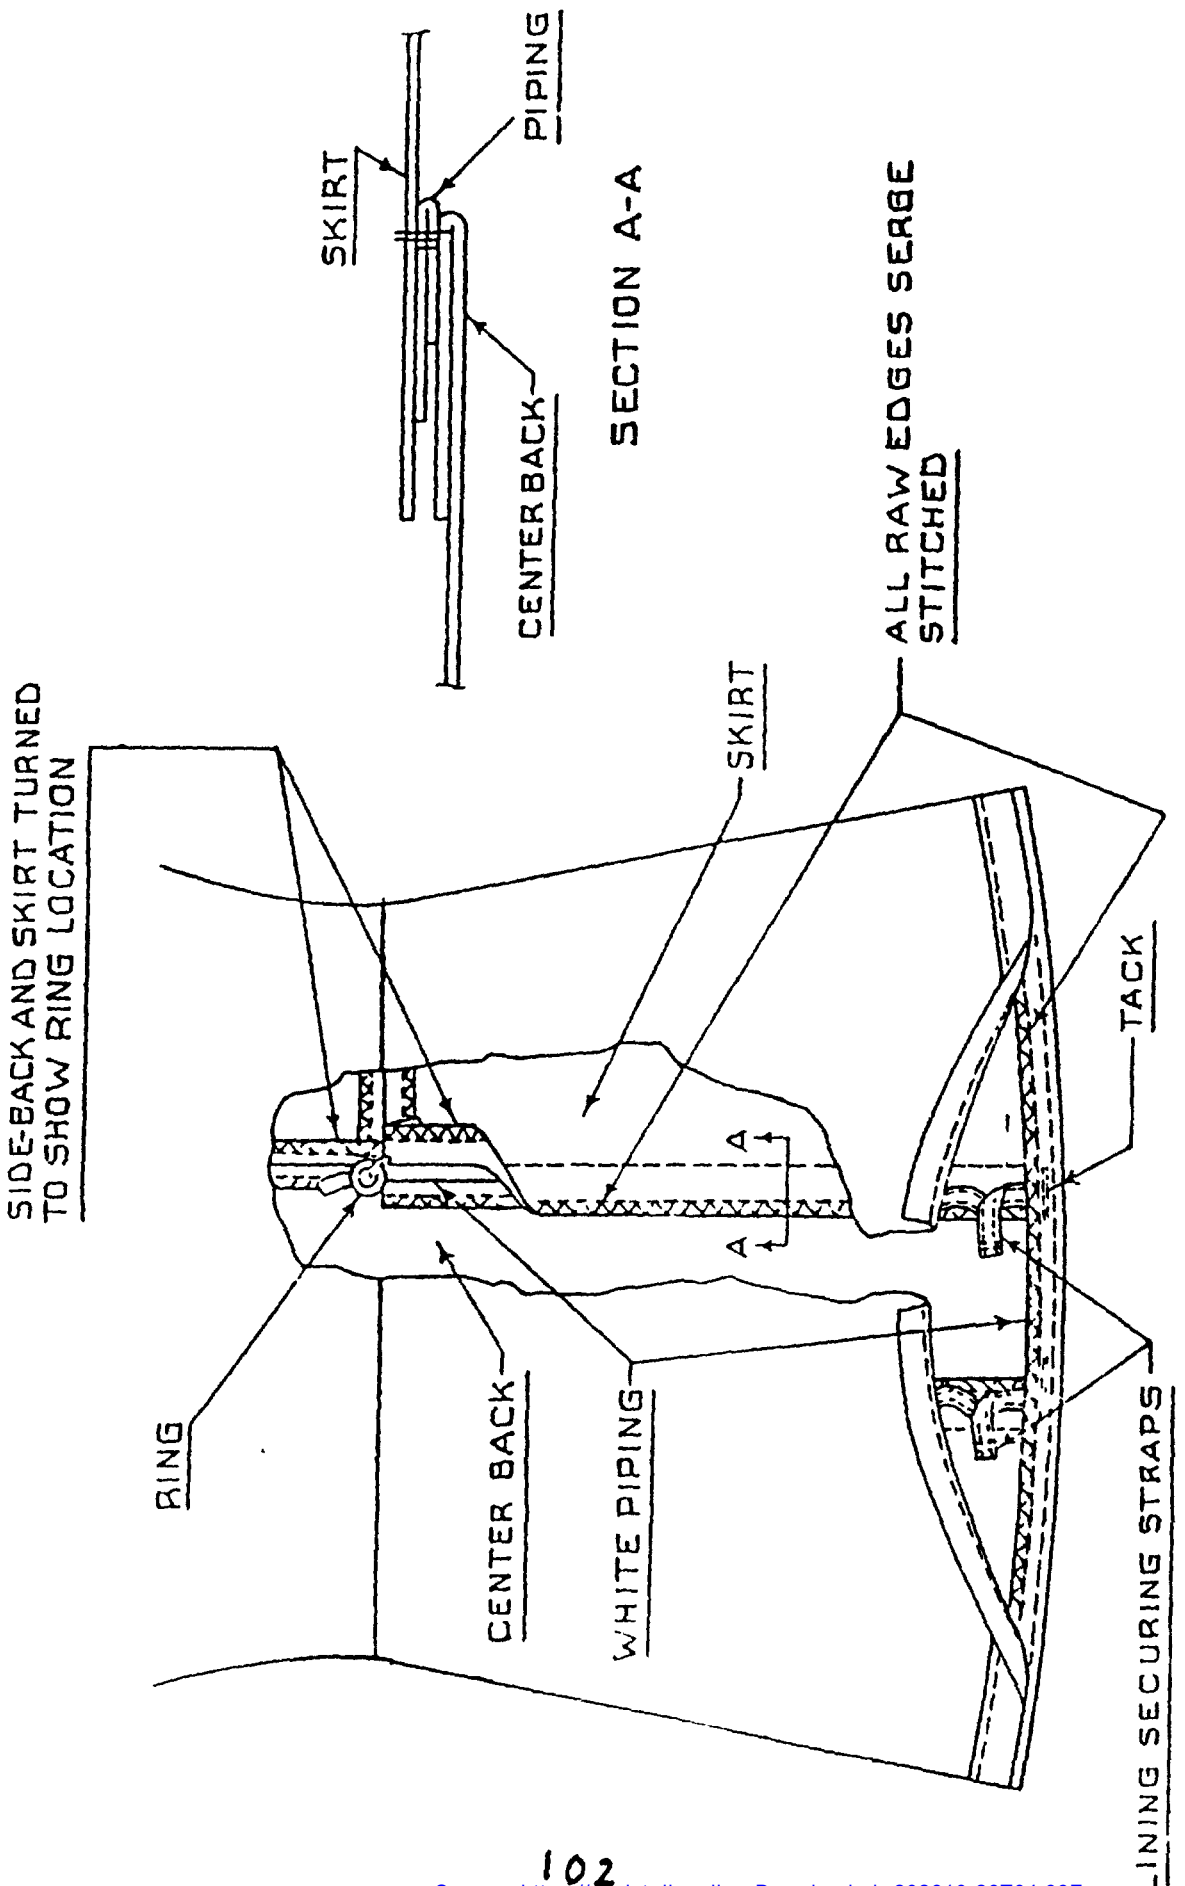

BACK INSIDE — CUT THROUGH VIEW

FIG. 4. COAT, MAN'S; FULL DRESS; SCARLET, U.S. MARINE BAND; MUSICIAN


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

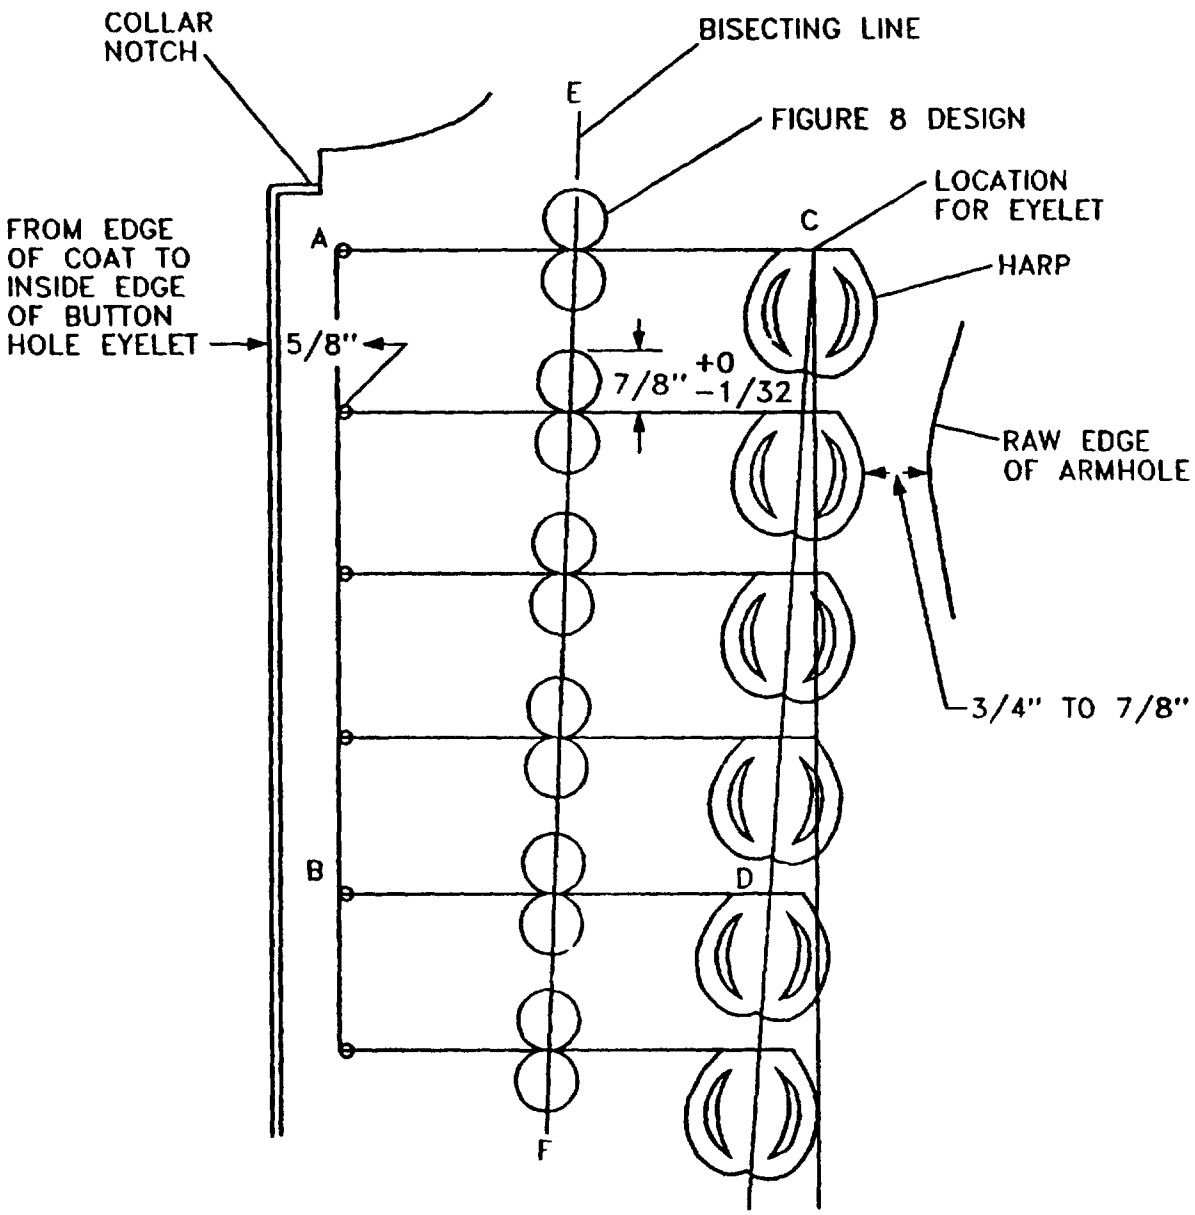


BRAID PLACEMENT DIAGRAM – LEFT FRONT

FIGURE 5. COAT, MAN'S: FULL DRESS: SCARLET, U. S. MARINE BAND: MUSICIAN


Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

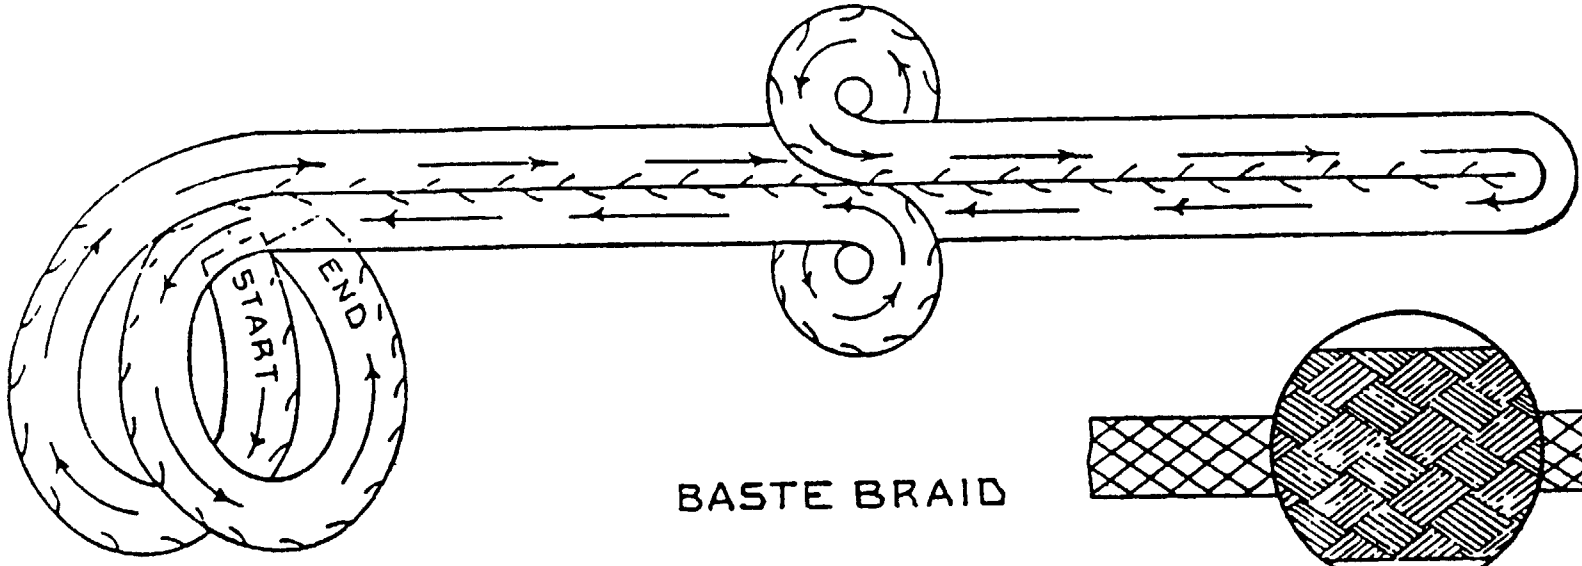

BASTE BRAID

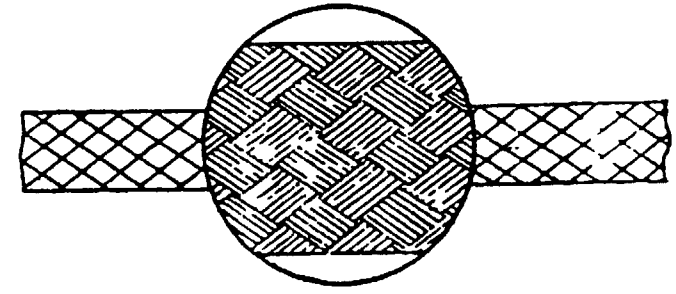

BRAID, BLACK, TUBULAR (DETAIL)

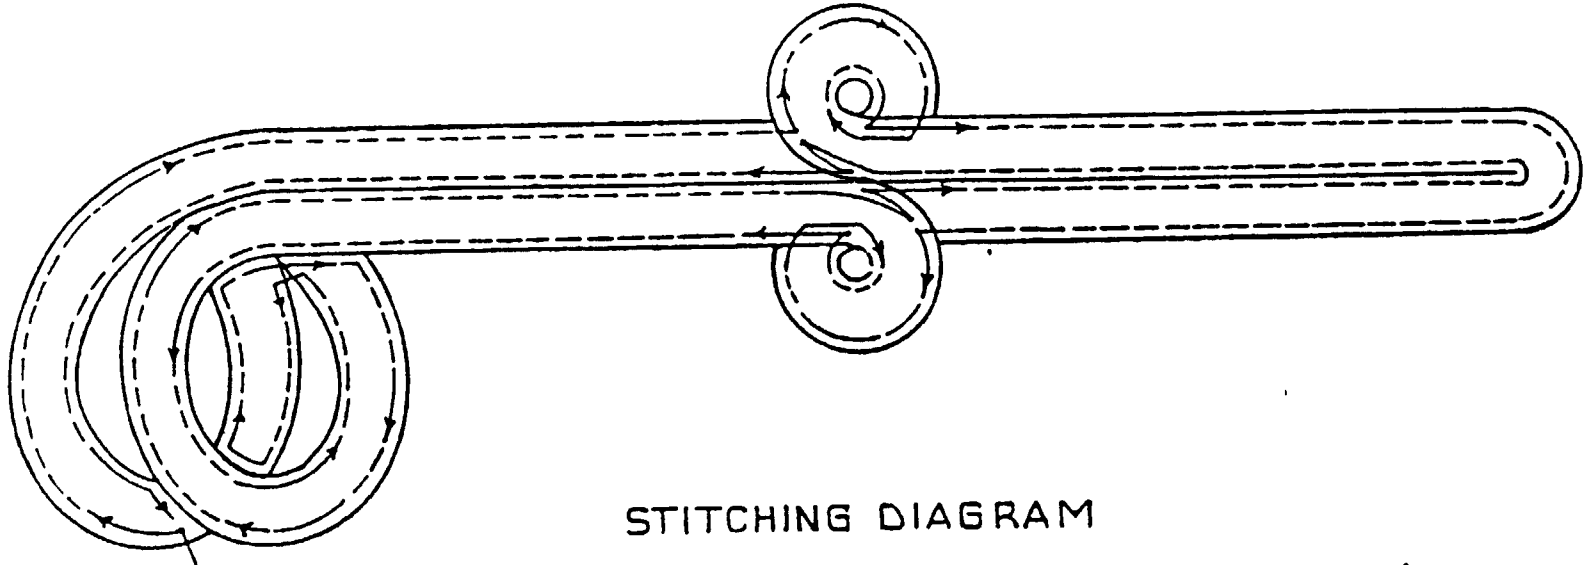

STITCHING DIAGRAM

RIGHT FRONT OF COAT:—(REVERSE FOR LEFT FRONT)

FIG. 6. COAT, MAN'S, FULL DRESS; SCARLET, U.S. MARINE BAND; MUSICIAN

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.



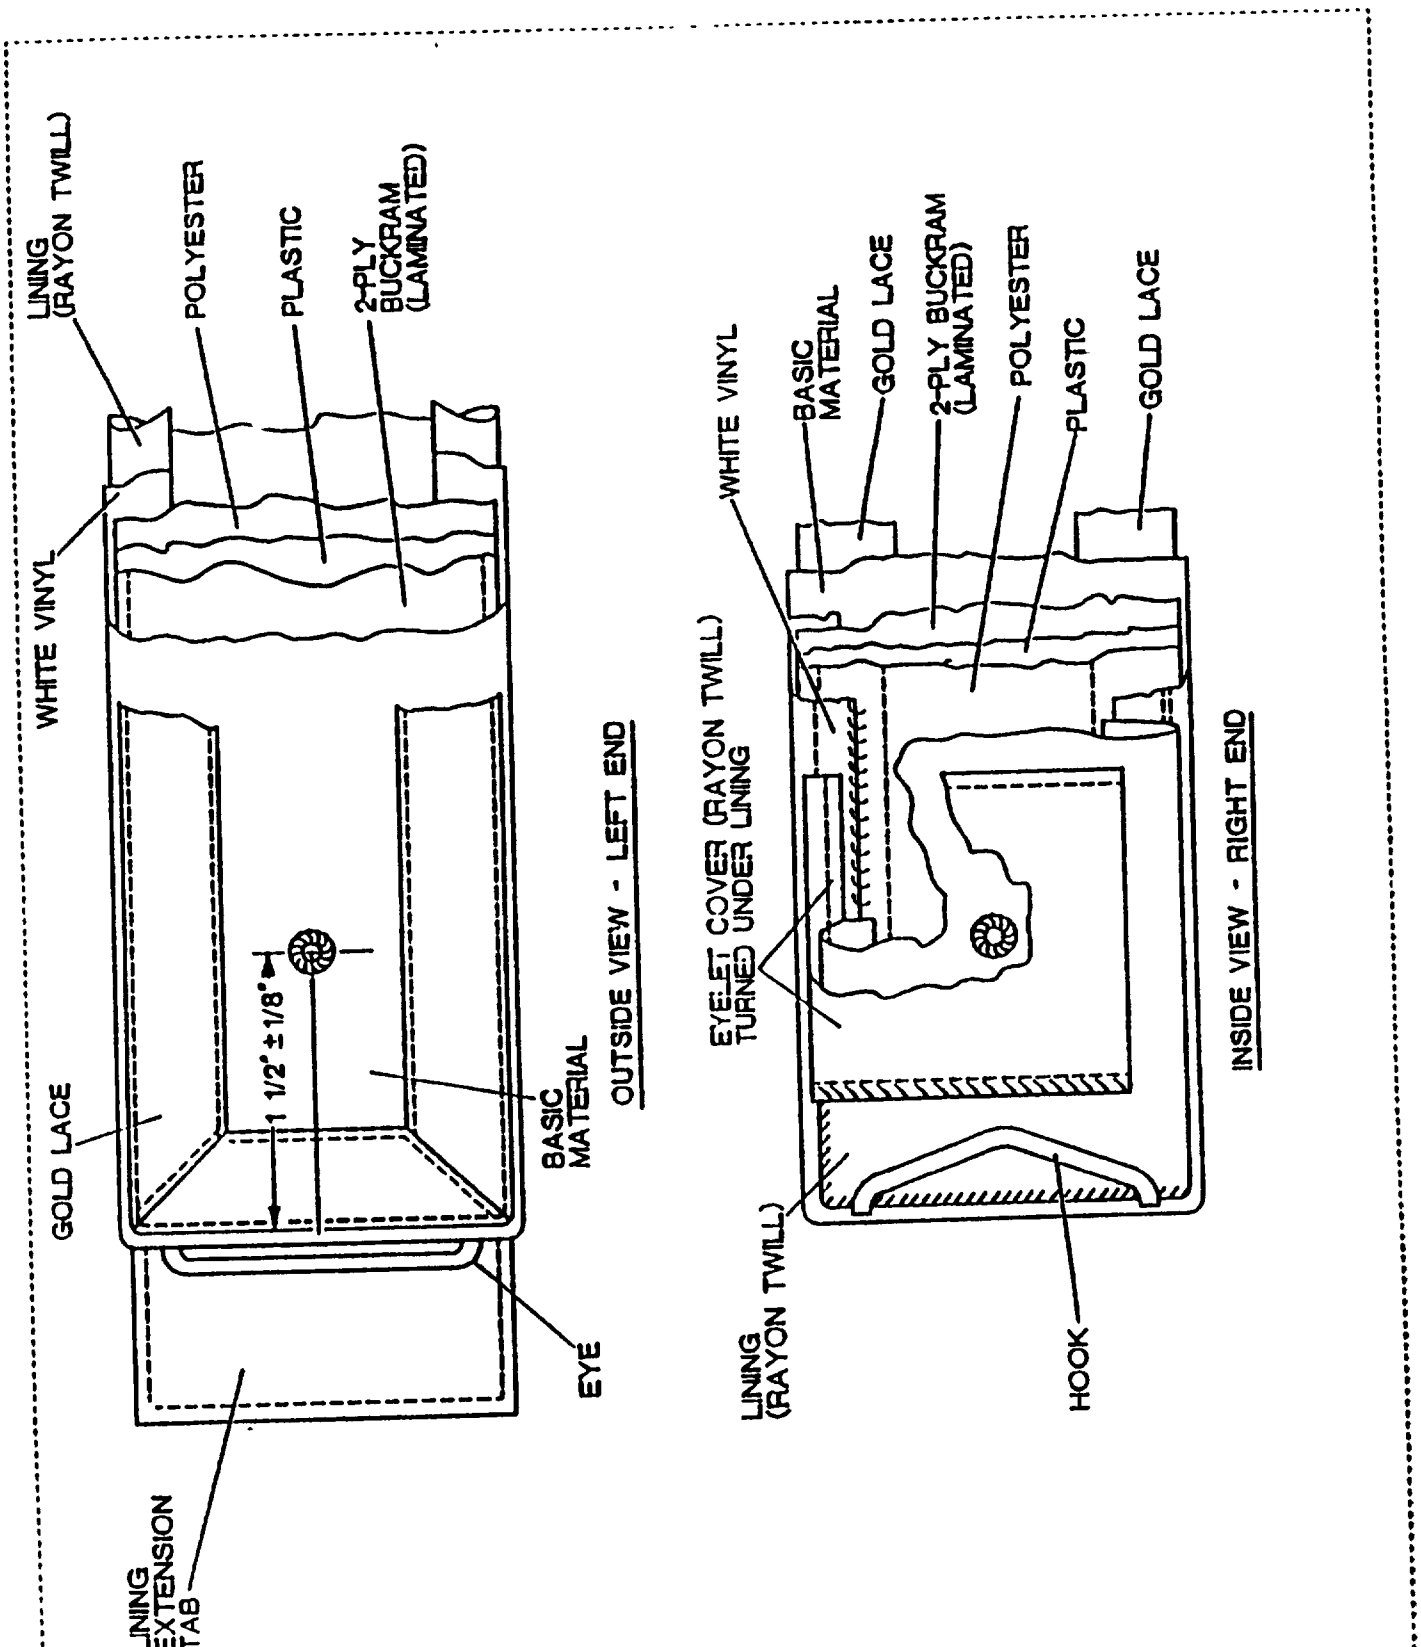


FIG.7. COAT, MAN:S: FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN:S

Source: https://assist.dla.mil - Downloaded: 2024-05-04T04:36Z
Check the source to verify that this is the current version before use.

True Size: 42 x 51 picas = 7 0" x 8 5"

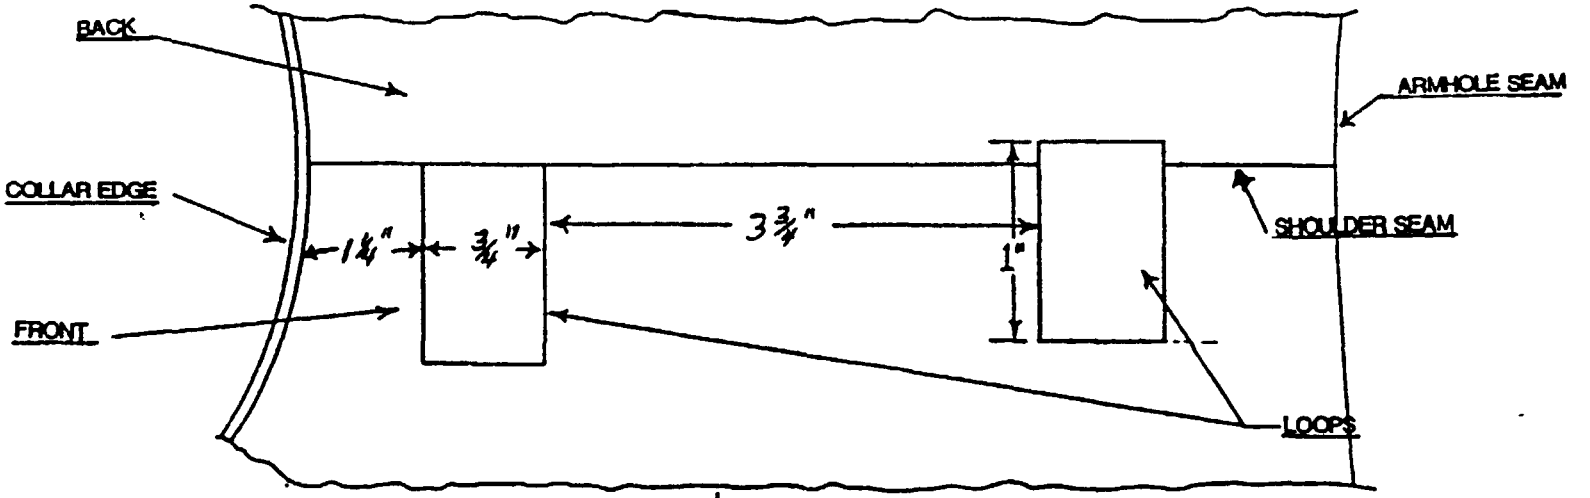

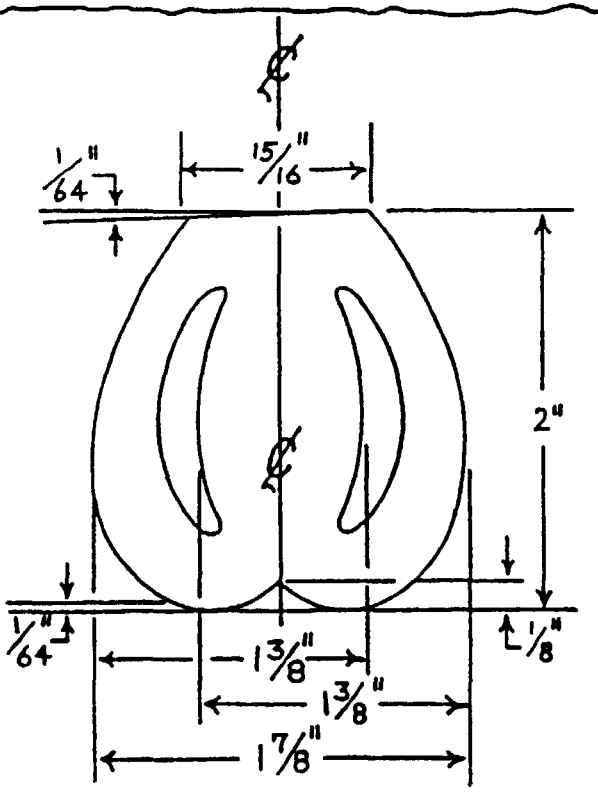

HARP

FIG. 8 COAT, MAN'S: FULL DRESS, SCARLET, U. S. MARINE BAND, MUSICIAN'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

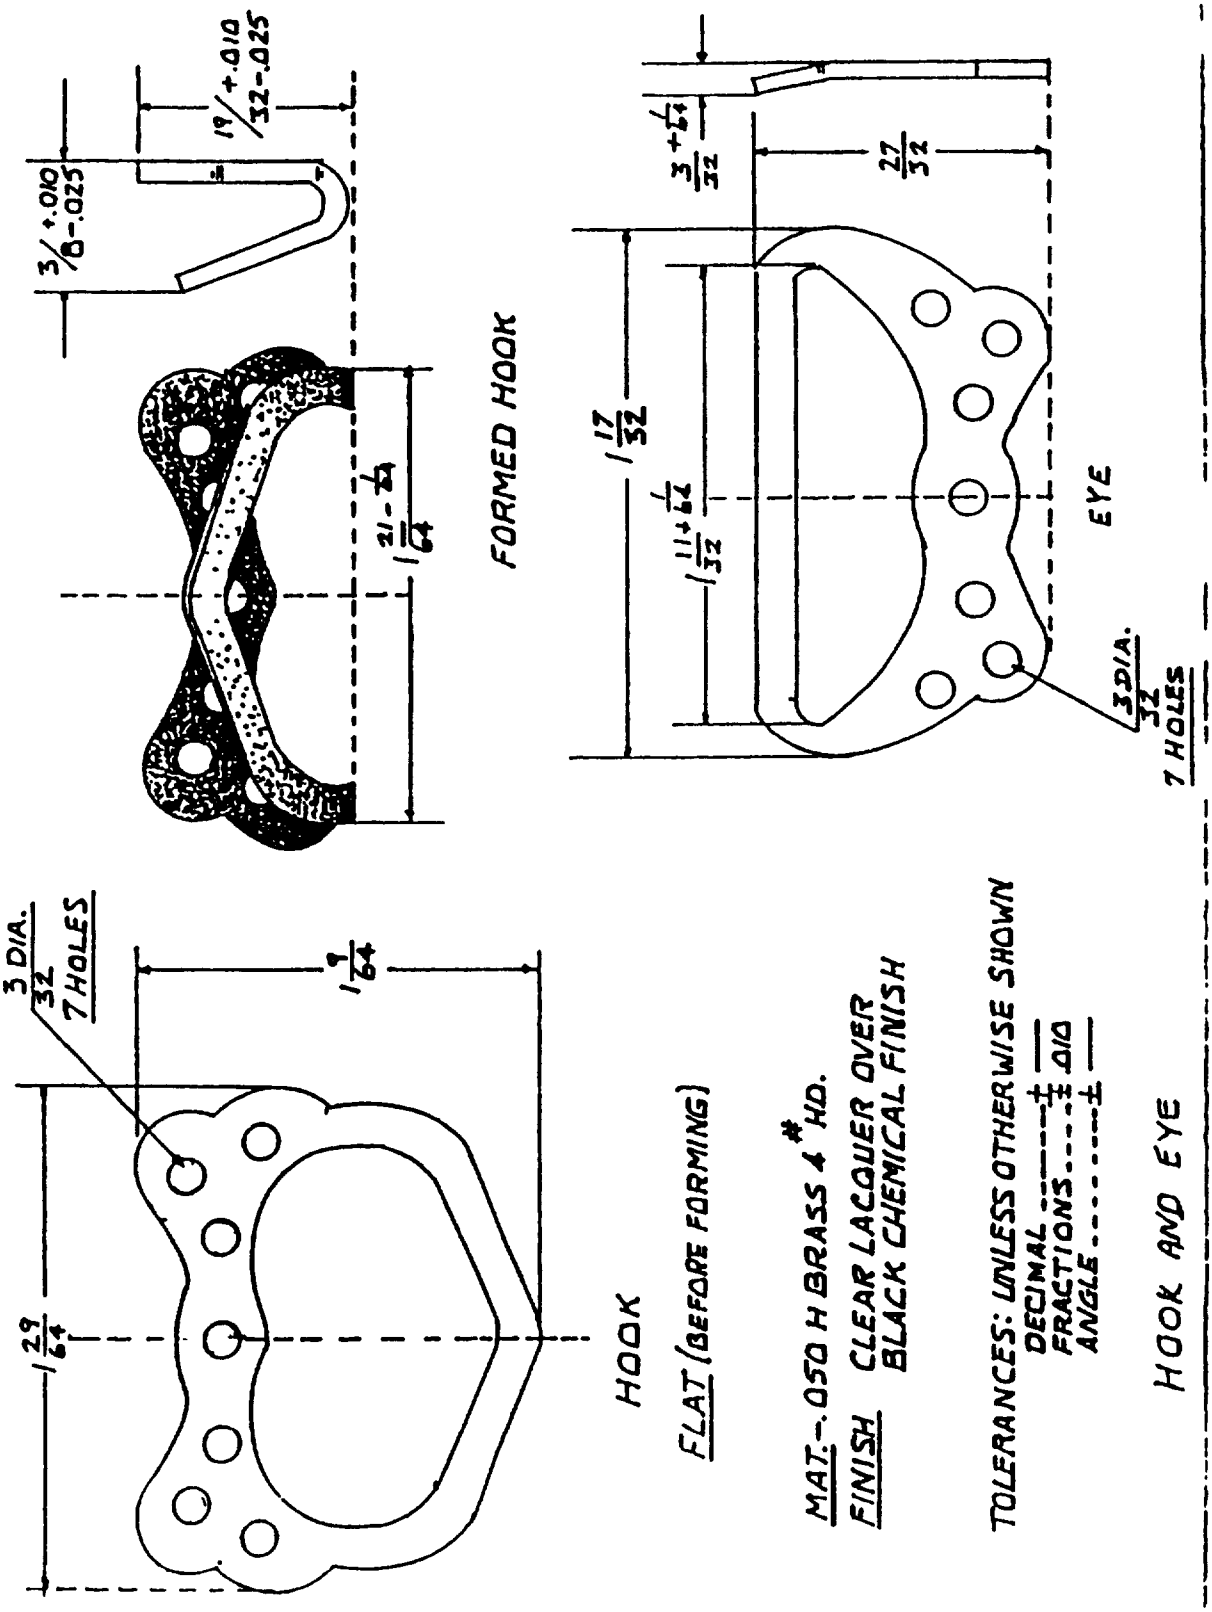


FIG. 9 COAT, MAN'S: FULL DRESS, SCARLET, U. S. MARINE BAND, MUSICIAN'S

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1 The preparing activity must complete blocks 1, 2, 3, and 8 In block 1, both the document number and revision letter should be given

2 The submitter of this form must complete blocks 4, 5, 6, and 7

3 The preparing activity must provide a reply within 30 days from receipt of the form

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements

I RECOMMEND A CHANGE:	1 DOCUMENT NUMBER MIL-C-82149B(MC)	2. DOCUMENT DATE (YYMMDD) 950609

3 DOCUMENT TITLE
COAT, MAN'S: FULL DRESS, SCARLET, U.S. MARINE BAND, MUSICIAN'S

4. NATURE OF CHANGE (Identify paragraph number and include proposed rewrite, if possible Attach extra sheets as needed)

5 REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8 PREPARING ACTIVITY

NAME COMMANDER	b TELEPHONE (Include Area Code) (1) Commercial (703)784-4584	(2) AUTOVON 278-4584
c ADDRESS (Include Zip Code) PROGRAM SUPPORT DIRECTORATE, PSE-C/S MARCORSYSCOM, 2033 BARNETT AVE, SUITE 315 QUANTICO VA 22134-5010	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T04:39Z
Check the source to verify that this is the current version before use.