MIL-C-82168A(MC)
26 April 1974
SUPERSEDING
MIL-C-82168(MC)
17 October 1967

MILITARY SPECIFICATION
COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE.

1.1 Scope. This specification covers requirements for drum major scarlet wool summer and winter full dress coats.

*1.2 Classification. The coats shall be of one type in the following classes and sizes, as specified (see 6.2):

Class 1: Coat, Full Dress, Summer, Wool, Tropical; Scarlet 2502
Class 2: Coat, Full Dress, Winter, Wool, Broadcloth; Scarlet 2501

Schedule of sizes
(Short, Regular, Long, Extra Long)

34
35
36
37
38
39
40
41
42
44
46

1.3 Individual orders. When the coat is custom tailored to an individual order, this specification shall govern, except that the detailed requirements of Section 3, Table 1, may be modified to the extent necessary for good custom tailoring practice.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on the date of invitation for bids or request for proposal, form a part of the specification to the extent specified herein.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

R-N-91	- Napthalene, Technical.
V-T-276	- Thread, Cotton.
V-T-280	- Thread, Cotton Gimp, Buttonhole.
V-T-301	- Thread Silk.
DDD-L-20	- Labels For Clothing, Equipage And Tentage (General Use).
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached Or Dyed).

MILITARY

MIL-C-326	- Cloth, Silesia, Cotton.
MIL-C-368	- Cloth, Satin, Rayon And Cloth, Twill, Rayon.
MIL-B-3461	- Buttons, Insignia, Metal, Uniform And Cap.
MIL-P-15064	- Pads, Shoulder And Sleeve Head.
MIL-C-16375	- Cloth, Wigan, Cotton.
MIL-L-17507	- Lace, Gold.
MIL-C-21115	- Cloth, Tropical Wool Polyester/Wool.
MIL-C-41820	- Cloth, Gabardine, Polyester And Rayon.
MIL-C-43718	- Cloth, Twill, Polyester And Cotton.
MIL-C-82114	- Coat Front For Coats, Musicians.
MIL-C-82252	- Cloth, Broadcloth, Wool And Wool Synthetic.

STANDARDS

FEDERAL

FED-STD-151	- Metals, Test Methods.
FED-STD-191	- Textile Test Methods.
FED-STD-751	- Stitch, Seam And Stitching.

MILITARY

MIL-STD-105	- Sampling Procedures And Tables For Inspection By Attributes.
MIL-STD-129	- Marking For Shipment And Storage.

(Copies of specifications and standards required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

*2.2 Other publications. The following document forms a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

UNIFORM CLASSIFICATION COMMITTEE, AGENT
Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

3. REQUIREMENTS

3.1 Samples. Samples are furnished solely for guidance and information to the supplier (see 6.3). Variation from the specification may appear in the sample, in which case the specification shall govern.

*3.2 First article approval. Unless otherwise specified (see 6.2), before production is commenced, a first article consisting of the number of finished coats specified by the procuring activity (see 6.2) shall be submitted or made available to the contracting officer or his authorized representative for approval. The approval of the first article authorizes the commencement of production, but does not relieve the supplier of responsibility for compliance with all provisions of this specification. The first article shall be manufactured by the supplier in the same facilities to be used for the manufacture of the production items.

3.3 Materials.

*3.3.1 Basic material. The basic material for each class coat shall be as follows:

(a) Class 1 - Cloth, wool tropical, scarlet shade 2502 (see 6.3), 10.5 ounce, conforming to type I, class 1 of MIL-C-21115.
(b) Class 2 - Cloth, wool broadcloth, scarlet shade 2501 (see 6.3), 16.5 ounce, conforming to type I, class 4 of MIL-C-82252.

3.3.2 Lining. The material for lining the coats and collar; for making the underarm shields, collar eyelet cover and coat hanger; and for making straps to secure the lining to the bottom edge of coat, shall be cloth, rayon twill, scarlet 2506 (see 6.3), conforming to class 1, of MIL-C-368.

*3.3.3 Silesia or polyester and cotton. The stays for the armhole and shoulder seams and for stitching to the collar interlining, and for binding the neck edge of coat front interlining shall be cloth, cotton silesia, khaki 3703, 4.5 ounce, conforming to type 1 of MIL-C-326 or polyester and cotton conforming to MIL-C-43718. The requirement for nonfibrous material and seam efficiency shall not apply.

3.3.4 Collar interlining. The material for interlining the collar shall be cloth cotton, buckram, double texture, laminated, starch finish, natural color, conforming to the following when tested as specified in Section 4, Table III.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.4.1 Collar buckram. The buckram shall be made of cotton of suitable staple length and grade to meet the requirements of this specification. It shall be thoroughly cleaned, well carded, drawn and evenly spun.

3.3.4.2 Weave. The weave of the single plies of the cloth shall be four harness, 2 up and 2 down herringbone twill, 20 ends right and 20 ends left.

3.3.4.3 Texture. The two plies of the cloth shall each have a minimum thread count, per inch, of 50 in the warp and 20 in the filling.

3.3.4.4 Laminated cloth. The two plies of the cloth shall be thoroughly adhered together with a synthetic resin type laminating material which shall not cause any objectionable odor in the finished cloth. The laminated cloth shall show no evidence of delamination after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests as specified in Section 4, Table III.

3.3.4.4.1 Finish. The cloth shall have a starch finish. The original stiffness of the finished cloth, and the stiffness of the cloth after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests shall conform to the following when tested as specified in Section 4, Table III.

Stiffness, inch-pound:	Minimum	Maximum
- original	0.60	0.95
- after accelerated aging	0.70	0.95
- after wet (dry) cleaning	0.50	0.85
- after perspiration	0.50	0.85

3.3.4.4.2 Weight. The weight of the finished laminated cloth shall be 21 to 23 ounces per square yard when tested as specified in Section 4, Table III.

3.3.4.4.3 Breaking strength. The breaking strength of the finished laminated cloth shall be 100 pounds minimum in warp direction and 80 pounds minimum in the filling direction, when tested as specified in Section 4, Table III. After being subjected to the accelerated aging test, the breaking strength of the cloth shall be not less than the original breaking strength when tested as specified in Section 4, Table III.

3.3.5 Reinforcement discs. The reinforcement discs for buttons secured to the back skirt seam, with ring toggle, shall be punched from cloth, cotton, buckram specified in 3.3.4.1. The reinforcement discs shall be 7/8 inch in diameter with a 1/8-inch-diameter hole at the center.

3.3.6 Coat fronts. The coat fronts shall conform to class 1 of MIL-C-82114 for class 1 coats and class 2 of MIL-C-82114 for class 2 coats.

3.3.7 Shoulder pads. The shoulder pads shall conform to the requirements of type I, class 2, of MIL-P-15064.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.8 Sleevehead pads. The sleevehead pads shall conform to type IV of MIL-P-15064.

3.3.9 Stay tape. The stay tape for the armholes and waist seams shall be cotton, 1/4 inch wide, conforming to type III, class 1, of DDD-T-86, except the requirement for nonfibrous material shall not apply.

3.3.10 Piping. The following materials shall be cut 1-1/8 inches wide for piping the front and bottom edges of coat and the seams joining the center back to the skirt of the coats:

(a) Class 1 coat. Cloth, gabardine, polyester, rayon, white 3042 (see 6.3), 6.0 ounce conforming to type I, class 1, of MIL-C-41820.
(b) Class 2 coat. Cloth, wool, broadcloth, 16.5 ounce, conforming to type I, class 4, of MIL-C-82252, except the color shall be white (see 6.3).

3.3.11 Wigan. The material for reinforcing the bottom edge of sleeves and sleeve ornament shall be cloth, cotton, wigan, 2.5 ounces, conforming to type I of MIL-C-16375.

3.3.12 Thread.

*3.3.12.1 Silk thread. The silk thread shall conform to V-T-301 as follows, except the requirements for extractable matter shall not apply:

Use	Type	Class	Ticket No.	Ply
Bartacks and all outside seaming and stitching.	I		A	
Machine felling.			O	
Making buttonholes in coat.	I		B and F	3
Hand felling and hand sewing.	III,	3	C	2

*3.3.12.2 Cotton thread. The cotton thread shall conform to V-T-276 as follows:

Use	Type	Ticket No.	Ply
All inside seaming and stitching.	1C2	A	3
Serging and overedge stitching.	1A1	70	2
Machine tacking armholes and sewing on buttons.	1B3	24	4

The thread for basting shall be good commercial grade cotton.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.12.3 Color and colorfastness. All thread shall be scarlet, shade W, cable no. 66040, except the silk thread for stitching on the braid shall be yellow, the cotton thread for basting and machine tacking armholes may be white, and the cotton thread for overedge stitching the piping at bottom edge of class 1 coats shall be white. The colored threads shall show the following colorfastness when tested as specified in the applicable thread specification.

Thread	Color	Wet (Dry) Cleaning	Light
Cotton	Scarlet	Fair	Fair
Silk	Scarlet	Fair	Fair
Silk	Yellow	Good	Good

3.3.13 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of V-T-280. The color of the gimp shall be scarlet, shade W, cable No. 66040, and shall show good fastness to wet (dry) cleaning.

3.3.14 Insignia button and ring toggle.

3.3.14.1 Insignia buttons. The insignia buttons shall be metal, gold plated, enlisted design, 40-line conforming to type I, style 4, class A, sub-class 2 of MIL-B-3461.

3.3.14.2 Ring toggles. Ring toggles for securing buttons to fronts and backs shall conform to MIL-B-3461.

3.3.15 Ornamental braid.

3.3.15.1 Front and sleeve braid. The braid for the front and the sleeves shall conform to the following when tested as specified in Section 4, Table III:

Cover:	
- material (covering)	Metal thread
- color of wire	Light gold
- metal wire (under coating)	Silver and copper
- plating material	Gold
- winding thread	2 ply white or yellow cotton thread
Core (stuffer)	
- material	Cotton thread (soft)
- number of threads (min)	7
- ply of thread (min)	2
- color	Gold
Weave	Plain (braided)
Number of carriers (min)	12
Ends/carrier	varies from 6 to 8 (total 79)
Shape	Tubular
Width (in.) (min)	3/8 + 1/16
Weight/Linear yard (grains)	154.5

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

Metal content (%)	
- gold (min)	0.3
- silver (min)	0.6
- copper	Remainder (traces of nickel and zinc)

Fastness to:	
- water	Good
- dry cleaning	Good

*3.3.15.2 Collar gold lace. The gold lace for the collar shall conform to type II, class 1, style A of MIL-L-17507.

3.3.16 Collar closure hooks and eyes. The hooks and eyes for closing the collar shall be brass, black enameled finish, size No. 16, commercial type (see Section 4, Table III). All surfaces and edges of the hooks and eyes shall be clean, smooth, free from burrs, tool marks, sharp edges, and roughness. The hooks and eyes shall be thoroughly and completely lacquered with the best available quality of black japanned lacquer. The dry lacquer film shall be continuous, level, adherent, free from lint, dust, or other foreign inclusions that may affect appearance or serviceability, and shall withstand the test for tackiness specified in Section 4, Table III.

*3.3.17 Labels. Each coat shall have a combined personal-clothing identification label and a size label conforming to DDD-L-20. The coats are intended to be dry cleaned and the label shall show fastness to dry cleaning.

*3.3.17.1 Combination personal-clothing identification label. The combination personal-clothing identification label shall conform to type I, classes 1 and 10 (combined) of DDD-L-20 except all printing and the space between lines of printing shall be minimum 10 point (approximately 1/8 inch). The content and format shall be as follows:

NAME _____

SERVICE NO. _____

COLLAR SIZE _____

NOMENCLATURE (ITEM DESCRIPTION) _____

CONTRACT NO. _____ DATE _____

NAME OF CONTRACTOR _____

WOOL PRODUCTS ACT INFORMATION _____

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*3.3.17.2 Size label. The size label shall conform to type I, class 2, of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L, or XL for Short, Regular, Long and Extra Long, as shown by the following example:

40 R
Stock number

The stock number may be incorporated in the identification label instead of in the size label.

3.4 Design. The coat shall be the U.S. Marine Corps design shown on Figures 1 through 3. The coat shall be a semiformfitting, single breasted, fully-lined coat with 14 gold plated insignia buttons on the right front and 7 on the left front, having upper fronts with gold braid, skirt type lower body parts with waist darts; a waist seam, a three piece back with two gold plated insignia buttons at the waist, ornamental sleeve braid; a stand-up collar with hooks and eyes for front closure and worked eyelets. The front and bottom edges of coat, and the seam joining the skirt to the center back, shall be piped with the white cloth applicable for each class coat.

3.5 Patterns. Standard patterns will be furnished to the supplier by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the supplier's working patterns. The supplier's working patterns shall be identical to the standard pattern. The standard patterns shall provide 3/4-inch allowance for side seams and seam joining the skirt to the center back, and 3/8-inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

*3.5.1 List of pattern parts. Coats shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

Item	Pattern nomenclature: Material basic: Cloth, wool, tropical or Cloth, wool, broadcloth	No. of cut parts
1.	Front, upper	2
2.	Skirt (lower body part)	2
3.	Side body (front)	2
4.	Front facing, right	1
5.	Front facing, left	1
6.	Center back	1
7.	Side back	2
8.	Top sleeve	2
9.	Under sleeve	2
10.	Collar	1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature: Cloth, rayon lining	No. of cut parts
11.	Front, upper	2
12.	Top sleeve	2
13.	Under sleeve	2
14.	Skirt (lower body lining)	2
15.	Underarm shield	4
16.	Center back	2
17.	Side, back	2
18.	Collar lining	1
19.	Collar eyelet cover	2
	Silesia or Polyester and cotton	
20.	Collar interlining	1
	Cloth, cotton, buckram	
21.	Collar interlining	1
	Cloth, cotton, wigan	
22.	Sleeve and ornamental reinforcement	2
	Marker	
23.	Sleeve braid	

3.6 Construction.

3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I.

3.6.1.1 Operations. The supplier is not required to follow the exact sequence of the operations as listed in Table I, but all operations specified shall be used to manufacture the coats.

3.6.1.2 Stitches, seams, and stitchings. The stitch, seam and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.2.1 Tacking and backstitching. Ends of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

3.6.1.3 Shade marking. The component parts of each class coat cut from one piece of the applicable wool materials and lining material, including pairs of sleeve linings and underarm shields when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices.
(b) Sew-on shade tickets.
(c) Adhesive type tickets which show discoloration and the adhesive mass which adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
1.	Cutting. a. Cut coats in strict accordance with patterns furnished by the Government. b. Cut all materials in the direction of the warp as indicated by directional lines on the patterns. c. Cut all scarlet wool parts of the coat from one piece of the applicable material (see 3.3.1) for each class coat. d. Cut the body and collar linings, the collar eyelet covers and the top ply of the underarm shields, from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the lining shall match. Cut the strips for coat hanger and lining securing straps 1-1/8 inches wide. e. Cut cotton silesia or polyester and cotton stays for armhole and shoulder seams on the bias 3/4 inch wide and 4 ±1/4 inches long. Cut cotton silesia or polyester and cotton for binding the neck edge of the coat from interlining on the bias, 3/4 inch wide and approximately 5 inches long. Cut the silesia or polyester and cotton for collar interlining in accordance with pattern furnished. f. Cut wigan for sleeve bottom and sleeve ornament on the bias in accordance with pattern.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
1.	Cutting. (cont'd) g. Cut the cotton buckram for interlining the collar on the straight in accordance with the patterns furnished. h. Cut the applicable material (see 3.3.10) for piping the front and bottom edges of coats, and the seam joining the skirt to the center back, on the straight. The piping shall be cut 1-1/8 inches wide. i. Punch the reinforcement disc for buttons secured to the skirt back seam from cloth, cotton, buckram. The reinforcement disc shall be 7/8 inch diameter with a 1/8-inch-diameter hole at the center.					
2.	Replacement of damaged parts. a. At time of cutting, replace any part of coat containing holes, seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, etc. expected to develop into holes, shade bars and dye streaks or unsightly slubs, etc., affecting appearance. b. Replace any part damaged during manufacturing process by needle chews which may develop into holes, scissors or knife cuts, tears, holes, mends or burns in the material, affecting appearance.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
3.	Shade marking.					
	a. Mark or ticket all component parts (see 3.6.1.3) cut from one piece of the applicable wool materials (see 3.3.1) for each class coat. Mark or ticket all component parts cut from one piece of rayon lining material and the pairs of sleeve linings when cut from ends.					
	b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					
4.	Make coat hanger and lining securing straps.					
	Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8-inch-wide strip of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	12-16	A	A
	b. Cut the coat hanger 3-3/4 ±1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ±1/4 inches long.					
5.	Make collar eyelet covers.					
	Finished appearance. The collar eyelet covers shall finish 1-3/4 ±1/8 inches wide.					
	a. Turn under the side edges of the collar eyelet cover and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1 (each side edge)	12-16	A	A
	b. Fold each cover in half across the width and seam 1/16 inch from the folded side edges.	301		12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
6.	Make collar. Finished appearance. The completed collar shall finish smooth and flat without distortion. Edges shall be uniformly even.					
	a. The collar shall be made of one ply of basic material, lining, silesia or polyester and cotton and cotton buckram.					
	b. Seam the silesia or polyester and cotton and cotton buckram together 1/8 to 3/16 inch from all edges and trim silesia or polyester and cotton even with the edges of the buckram.	301	SSa-1	12-16	A	A
	c. Lap the upper edge of the silesia or polyester and cotton side of the interlining approximately 1/2 inch to the upper edge of outer ply and seam together 1/4 inch from the raw edge of interlining. The outer ply shall extend not less than 3/4 inch at each end.	301	LSa-1	12-16	A	A
	d. Smoothly fold the outer ply over lower and upper edges of the interlining. Tack the outer ply folded to inside at lower edges of silesia or polyester and cotton from end to end. Stitching shall not pass through outer ply of collar.	Hand		2-3		
	e. Fold ends of outer ply, to the inside of interlining and tack to silesia or polyester and cotton with overcast stitching, turning under the upper and lower edges sufficiently so as not to be visible in the finished collar.	Hand		2-3		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
7.	Attach collar eyelet covers.					
	a. Mark the inside of the collar for positioning the collar eyelet covers. Trim and remove all loose ends of thread.					
	b. Lap the raw edge of the collar eyelet covers 1/2 to 5/8 inch on the inside of the collar at the top edge, with the front edge of the cover positioned at the mark. Seam the cover to the collar 1/4 inch from the raw edge of the cover. In the finished coat, the collar eyelet covers shall be centered over the eyelet in the collar.	301	LSa-1	12-16	A	A
8.	Baste gold lace to collar. (See Figure 4).					
	a. Baste lace to collar with the outer edges of lace 1/8 inch from all edges. Baste lace on both edges with top and bottom strands of lace folded over the end strands. Beginnings and ends of lace shall be at a corner.	Hand		2-6		
	b. Baste down folded edge of turned corners of lace to lace along end of collar.	Hand		2-6		
	c. Position and baste ends of lace at the corner in such a way that the lace shall seem continuous without a break.	Hand		2-6		
9.	Stitch gold lace to collar.					
	Finished appearance. The finished lace shall be smooth, flat, firmly attached, uniformly positioned and uniformly stitched. Raw edges and loose threads shall not be visible.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
9.	Stitch gold lace to collar. (cont'd)					
	a. Stitch lace to collar 1/16 inch from both edges of lace and along the folded edges at corners. Lace may be stitched without basting provided the proper appearance and neatness requirements are maintained.	301	SSaa-2 (strands) OSe-1 (corners)	12-16	A (silk)	A
	b. Press collar smooth and flat, shrinking where necessary.					
10.	Stitch lining to collar.					
	Finished appearance. Stitches attaching lining to collar shall be uniform and a minimum of 1/16 inch from the edge of collar.					
	a. Lap the upper edge of the collar over the top raw edge of collar lining, approximately 1/2 inch, with the lining facing up. Stitch collar to lining and eyelet cover along the upper edge adjacent to the stitching line of the collar braid. The stitching shall extend from center to center of eyelet covers.	301		12-16	A (silk)	A
	b. Turn collar lining and eyelet covers at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine.					
11.	Make collar extension tab.					
	Finished appearance. The collar extension tab shall finish smooth and flat without twists, puckers, pleats or distortions. The stitching shall be uniform gage.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
11.	Make collar extension tab. (cont'd)					
	a. Turn the top and bottom edges and the end of the collar lining at the left end of the collar to the outside of the lining and baste the turned portion along the top, front and bottom edges to the body of the lining, forming the collar extension tab.	Hand				
	b. Stitch the collar extension tab 1/16 inch from the top, front and bottom edges and continue the stitching at the back of tab to top row, forming a 1-1/8-inch-wide box stitch. The finished tab shall extend 3/4 to 7/8 inch beyond the finished front edge of the collar.	301	SSe-1 (top and bottom) OSf-1 (front edge) SSa-1 (back edge)	12-16	A (silk)	A
	c. Make one eyelet through all plies at each end of the collar, midway between the top and bottom edges 1-1/2 ±1/8 inch from the finished ends. The eyelets shall be well worked with the purling on the outside of the collar and the opening shall finish 1/8 inch in diameter.					
12.	Stitch and press dart in under sleeves.					
	a. Fold the under sleeve, matching the cut edges of the sleeve darts. Stitch the entire length of the dart 1/4 inch from the cut edges of the armhole, tapering the line of stitching to zero at the lower folded edges.	301	SSa-1 (cut edge) OSf-1 (folded edge)	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
12.	Stitch and press dart in under sleeves. (cont'd)					
	b. Spread open the cut edges of the dart, turn the lower folded edge flat against the body of the under sleeve and press the entire dart smooth and flat with a heated pressing iron.					
13.	Seam sleeve at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of under sleeve and with the notches in the lower forearm edge of top and under sleeve matching. Seam top and under sleeve together 3/8 inch from forearm edge of top sleeve, forming a tapered outlet on the under sleeve.	301	SSbd-1 to SSa-1	12-16	A	A
	b. Spread open the seam and press flat with a heated pressing iron.					
	c. Mark sleeve end for turn-up. Mark the sleeves for positioning the braid with pattern marker.					
14.	Baste wigan reinforcement to sleeve.					
	Finished appearance. The wigan shall be positioned and attached to provide reinforcement and body to end of sleeve and sleeve ornament without causing distortions of the sleeve end.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
14.	Baste wigan reinforcement to sleeve. (cont'd)					
	a. Position the sleeve on the wigan with marks and notches matching as indicated by pattern.					
	b. Tack the left and right sleeves to the reinforcement piece along the forearm seam allowance of the top and under sleeve seam allowance respectively.	Hand or 101 or 301				
	c. Baste sleeve and reinforcement piece together at the mark for the bottom turnup.	Hand or 101				
	d. The reinforcement piece shall extend across the entire width of the sleeve and under all braid.					
15.	Attach braid to sleeve. (See Figure 5).					
	Finished appearance. The design formed by the braid shall be symmetrical, and firmly and uniformly attached.					
	a. Baste braid to sleeve, following the markings and flow indicated.	Hand				
	b. Stitch braid to sleeve. Stitches shall be 1/16 inch from each edge, and shall not cross the braid strands. Stitching points 1 to 6 (see Figure 5) are optional and the directional arrows may be reversed. The braid may be stitched without basting provided the requirements are met.	301	SSa-2	12-16	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
16.	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without distortions and shall start and finish evenly.					
	a. Join the top and under sleeve together at the backarm with a 3/8-inch-seam, catching the ends of the wigan reinforcement piece and the braid in the stitching.	301	SSa-1	12-16	A	A
	b. Spread open seam and press smooth and flat with a heated pressing iron.					
17.	Tack sleeve turnup to reinforcement.					
	a. Turn up the bottom edge of sleeve and baste.	Hand or 101				
	b. Tack the raw edge of the turned under portion to the reinforcement wigan piece with blindstitching.	301 or	EFc-1 (b)	4-6	A	A
		Hand or		4-6		
		103	EFc-1 (b)	4-6	A	
18.	Stitch and press dart in under sleeve lining.					
	a. Fold the under sleeve lining, matching the cut edges of the under sleeve darts. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole, tapering the line of stitching to zero at the lower folded edge.	301	SSa-1 (cut edges) OSf-1 (folded edges)	12-16	A	A
	b. Turn the cut edges of the dart toward the forearm edge and press the entire dart smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
19.	Seam sleeve linings at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats, and shall start and finish evenly.					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the notches in lower forearm edge of top and under sleeve linings matching. Seam the top and under sleeve lining together 3/8 inch from the forearm edge of top sleeve lining, forming a tapered outlet on the under sleeve lining.	301	SSbd-1 to SSa-1	12-16	A	A
20.	Seam sleeve lining at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve linings at the backarm with a 3/8-inch seam.	301	SSa-1	12-16	A	A
21.	Assemble sleeve and sleeve lining.					
	Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of the lining extending 1 inch beyond the armhole edge of the sleeve.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
21.	Assemble sleeve and sleeve lining. (cont'd)					
	b. Tack sleeve lining to the forearm and backarm seam allowance, respectively, of the top sleeve, commencing at the top edge of wigan reinforcement piece and extending to approximately 6 inches from armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand	SSa-1	4-6 1-2	A	A
	c. Turn the sleeve linings right side out.					
22.	Fell turnup of sleeve lining.					
	Finished appearance. The sleeve lining shall not be short, or tight, or twisted at bottom of sleeves.					
	a. Turn under the bottom edge of sleeve lining, to finish 1 to 1-1/4 inches above the finished end of the sleeve, and baste to the turnup of sleeve, or, the sleeve lining may be felled to the bottom of sleeves without basting.	Hand or 101				
	b. Fell the folded edge of sleeve lining to the turnup of the sleeve with blind-stitching	301 or Hand	EFc-1 (b)	6-8 8-10	O (silk) C (silk)	O
23.	Press sleeves.					
	a. Turn the sleeves right side out and assemble in pairs. Remove basting at lower end of the sleeve and press the lower half of sleeves smooth and flat, creasing at the forearm and backarm. The backarm crease shall be on the backarm seam.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
24.	Make underarm shields. Finished appearance. The shields shall finish smooth and flat without puckers, pleats, gathers or other distortions.					
	a. Position the two plies of material for the underarm shields with edges even. Seam the two plies together along the curved side and bottom edges 3/8 inch from the edges.	301	SSa-1	12-16	A	A
	b. Turn the shield right side out, working out completely the seamed edges.					
	c. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
25.	Assemble body lining. Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers, or gathers. The seams shall start and finish evenly.					
	a. Each lining assembly shall consist of an upper front, a side back panel, a center back panel and a skirt.					
	b. Fold the upper fronts, matching notches. Seam the waist dart with a 3/8-inch seam at the lower end of the waist dart, tapering to zero at the upper end.	301	SSa-1 (cut edge) (folded edge)	12-16	A	A
	c. Fold underarm dart in front and seam with a 3/8-inch seam at the center, tapering to zero at the upper and lower ends.	301	OSf-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
25.	Assemble body lining. (cont'd)					
	d. Position the side back panel and fronts with edges even and notches matching. Seam together at the side with 3/4-inch seam.	301	SSa-1	12-16	A	A
	e. Position center back panel and side back panel with edges even and notches matching. Join together with a 3/8-inch seam.	301	SSa-1	12-16	A	A
	f. Overedge stitch together the side seams and the side back seams.	503 or 504		6-10 6-10	70/2 70/2	70/2 70/2
	g. Fold skirt darts in accordance with notches, and press the length of the darts flat, forming a tapered point at the lower end. The darts shall finish approximately 5 to 5-1/2 inches long.					
	h. Position edges of the body lining and skirt lining, with fronts even, and join together at the waist with a 3/8-inch seam, catching the darts in the stitching.	301	SSa-1	10-14	A	A
	i. Overedge stitch the entire waist seam allowance with all joining seams caught in the stitching.	503 or 504		6-10	70/2	70/2
	j. Press all seams and darts smooth and flat. The waist seam shall be pressed toward the bottom and the remaining seams and darts toward the front.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
26.	Seam wool facing to lining assembly.					
	Finished appearance. The lining shall be carefully aligned and seamed to the facing so that in the finished coat, the lining shall lie smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.					
	a. Position the lining on the wool facing with the top edges even.					
	b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from the top edge of the facing to approximately 1-1/4 inches from the bottom edge.	301	SSa-1	12-16	A	A
	c. Overedge stitch together the facing lining seam allowance. The overedge stitching shall be securely caught in the fabric.	503 or 504		6-10	70/2	70/2
27.	Sew on identification label.					
	Finished appearance. The identification label shall be positioned so that in the finished coat, the label shall be midway between front and back edge of the right facing, with the bottom edge of label approximately 4 inches from the bottom finished edge of coat.					
	a. Sew the identification label to the outside of the right facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge)	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
28.	Make outer assembly.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					
	a. Each outer assembly shall consist of upper front, side body (front), side back and lower (skirt).					
	b. Fold the upper fronts, matching the cut edges of the waist dart and stitch the entire length of the dart 3/8 inch from the cut edges at the lower end and tapering to a point at the upper end.	301	SSa-1	12-16	A	A
	c. Position the upper front and side body panel with edges even, and join together with a 3/8-inch seam	301	SSa-1	12-16	A	A
	d. Position the side back and side body with edges even and notches matching. Seam together at the side with a 3/4-inch seam.	301	SSa-1	12-16	A	A
	e. Spread open the waist dart and the underarm and side seams and press flat with a heated pressing iron.					
	f. Overedge stitch the waist dart, underarm dart and side seam of class 1 coat only.	503 or 504		6-10	70/2	70/2
	g. Fold the skirt dart in accordance with notches on patterns and stitch the length of the dart. The dart shall taper from 3/4 inch at the top to zero at the lower end. Dart shall finish approximately 5-1/4 to 5-1/2 inches long.	301	OSf-1	12-16	A	A
	h. Press skirt dart on dart seam without turning dart					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
28.	Make outer assembly. (cont'd) either to the right or left. i. Position the upper assembly and the skirt with fronts and edges even and with the back edge of the side back positioned 3/8 inch from the back edge of skirt as indicated by the notch at the top of the waist of the skirt. Join together at the waist with a 3/8-inch seam and with the 1/4-inch stay tape positioned on the upper assembly 1/4 inch from the upper edge and caught in the stitching.	301	SSa-1	12-16	A	A
	j. The tape shall be sewn with normal tension, not loose or tight, and shall extend from the side back seam to not more than 3 inches from the front edge of the fronts. Spread open the waist seam and press flat with a heated pressing iron.					
	k. Overedge stitch the entire waist seam allowance from end to end on the class 1 coat only.					
	l. Press and shape the fronts on a suitable type heated pressing machine, shrinking the fronts to eliminate the excess fullness of the chest.					
29.	Pipe skirt. (See Figure 6). Finished appearance. The finished piping shall be of uniform width, without twists, puckers, pleats or distortion. Piping shall extend along the back edge of skirt.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
29.	Pipe skirt, (See Figure 6). (cont'd)					
	a. Fold 1-1/8-inch-wide piping in half lengthwise. Seam piping 1/8 inch from folded edge.	301	OSf-1	12-16	A	A
	b. Serge or overedge stitch the raw edges of the piping together on class I coat only.	503 or 504		6-10 6-10	70/2 70/2	70/2 70/2
	c. Mark along back edge of skirt for the positioning of the piping. The mark line shall be 7/8 inch from the back edge and shall extend from the top to bottom of the skirt.					
	d. Position the folded edge of piping on the mark line and stitch piping to skirt 3/16 to 1/4 inch from the folded edge of piping. Piping shall finish with a minimum 1/2-inch excess at the top end to give a neat finish. In the finished coat, the folded edge of piping shall extend 1/8 inch beyond the seam.	301		10-14	A	A
30.	Join center back to side back and skirt.					
	Finished appearance. The back seams shall start and finish evenly and shall be smooth without gathers, pleats or puckers.					
	a. Position and join the left and right assemblies to the center back with a 3/8-inch seam down to the waistseam and with a 3/4-inch seam from the waistseam to the bottom of coat.	301	SSa-1 (above waistseam) LSaj-1 (below waistseam)	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
30.	Join center back to side back and skirt. (cont'd)					
	b. Spread open the back seams from armholes to the waistseams, and press smooth and flat. Press skirt back seams from waistseam to bottom of coat smooth and flat with edges of each seam toward the center back. Pressing shall be done with a heated pressing iron or pressing machine.					
	c. Overedge stitch the raw edges of the back seams on class I coat only.	503		6-10	70/2	70/2
		or 504		6-10	70/2	70/2
31.	Seam reinforcement stay to shoulder and armhole.					
	Finished appearance. The reinforcement stays shall be sewn to the armhole and shoulder edge of the front without gathers, puckers or pleats. The top end of the armhole stay and lower end of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide stays to the underside of the front along the shoulder edges and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from the neck and armhole respectively. The strip for the upper edge of armhole shall be positioned approximately 1/2 inch from the shoulder.	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
32.	Mark and dress left front. a. Mark and shape the left front edge of coat, from the top notch to the waist seams. The mark line shall be 1 inch from the upper front edge to 1-1/8 inches at the waist seam. Continue on the straight line, from the waist seam to the notch at the bottom of the skirt. NOTE: The dressing and shaping of the left front shall be performed in the sewing room.					
33.	Tape armholes. a. Sew the cotton tape to the armhole starting with one end from approximately 1 inch above the notch in the fronts and continuing along the lower and back edge of the armhole to approximately 1/2 inch from shoulder edge. b. The tape shall be stitched with slight tension along the lower front edges of the armholes and shall be held taut while stitching along the back edge.	301	SSaa-1	12-16	A	A
34.	Press shoulder blades and armhole tapes. a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or suitable type pressing machine.					
35.	Stitch piping to coat. Finished appearance. The piping shall be uniformly stitched to the coat without twists, puckers or pleats. The piping shall extend from the collar notch at top edge of the right					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
35.	Stitch piping to coat. (cont'd)					
	front to the collar notch at top edge of the left front.					
	a. Position the 1-1/8-inch-wide strip of piping material on the outside of left and right front, with one edge even with top, front and bottom edges of coat. Stitch piping to coat 1/8 inch from edge. The piping shall extend from the collar notch at the top, along the left and right front and the bottom edge of the coat.	301	SSa-1	10-14	A	A
	b. Turn the piping to the inside, working out the folded edge of piping 1/8 inch beyond edges of coat. Topstitch coat to the piping 3/16 inch from the folded edge of piping, catching the turned under portion of the piping in the stitching.	301	SSa-2 (b)	10-14	A (silk)	A
	c. Notch out the excess piping material at the top and bottom front corners to eliminate bulkiness. Trim the inner edge of piping on the left front only from the upper front down to approximately 1 to 1-1/2 inches below waist seam, so that the piping will not interfere with front buttonholes.					
	d. Serge stitch the raw edge of the piping at the bottom edge of class I coat only.	503 or 504	EFd-1 EFd-1	6-8 6-8	70/2 70/2	70/2 70/2
36.	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlining and baste the interlining and fronts together from approximately 3-1/2 inches down from the shoulder edge to approxi-	301 or Hand	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
36.	Interline fronts. (cont'd) mately 2 inches from the bottom edge of the front. b. Baste along the shoulder, allowing room for setting the shoulder pad and working the fullness toward the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining, across the waist dart, to approximately 2 inches from the bottom edge of fronts. Baste along the top edge from the basting stitches for the shoulders to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge of the bottom edge of fronts.	301 or Hand	Hopper			
37.	Trim coat front interlining. a. Trim the top edge of coat front interlining even with the top edge of fronts from the point of shoulder to the collar notch. b. Notch the top edge of the interlining in line with the collar notch. c. Remove stitches joining front edge of silesia or polyester and cotton to coat front interlining, approximately 1/2 inch back from front and top edge of fronts. d. Turn the coat inside out and trim the interlining only approximately 1/4 inch back from the front and top edge of fronts.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
37.	Trim coat front interlining. (cont'd)					
	e. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					
38.	Bind front edge and gorge of interlining.					
	Fold silesia or polyester and cotton back and over the top and front raw edge of the interlining. Stitch along the top and front edge with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the turned-under portion in the stitching.	301	EFa-3	8-12	A	A
39.	Bind top neck edge of interlining.					
	Finished appearance. The silesia or polyester and cotton binding shall be uniformly stitched along the gorge of the coat front interlining from the collar notch to the shoulder point.					
	a. Lap the 3/4-inch-wide strip of binding on the outside of the coat front interlining, from the collar notch to shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	8-10	A	A
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301		12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS k

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
40.	Fell piping to coat front interlining.					
	a. Place the inner edge of piping on the outside of the interlining at the top, front and bottom edges. Baste piping to interlining through the fronts.	101				
	b. Fell the upper front and lower inner edge of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A C (silk)	A
	c. Pull and remove basting stitches from piping.					
	d. Press the left and right fronts, respectively, on a suitable type heated pressing machine, with the chest to conform to the shape of the body.					
41.	Mark fronts for positioning the braid and buttonholes (See Figure 7).					
	a. Mark the location of seven buttonholes on the outside of the left front, as shown on Figure 7. The top buttonhole (line A) shall be positioned 1 inch below the upper piped edge and 5/8 inch from the front piped edge. The lower buttonhole (line B) shall be on the waistseam and 5/8 inch from front piped edge. The remaining five button hole marks shall be evenly spaced.					
	b. Extend each buttonhole line towards the back and armhole edge. Line B shall be 1 inch shorter than line A. The length of the top and bottom line is determined by the position of the harp on the second line from the top which shall be					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
41.	Mark fronts for positioning the braid and buttonholes (See Figure 7). (cont'd)					
	approximately 1-7/8 inches from the armhole edge to the center of the harp. Measure the second line from the front edge of buttonhole line to the center of the harp. Transfer the same measurement to the bottom line less 1 inch. Draw a straight line from the bottom line through center of the harp up to the top line, establishing line A-C and B-D as shown on Figure 7					
	c. Bisect the top line A-C and bottom line B-D and connect the bisecting points with a straight line E-F.					
	d. Position left front of coat on right front, face to face with the collar notches even and the left front edge 1 inch back of the right front edge at collar notch and waistseam and armhole edge even.					
	e. Trace the seven lines on the right front to coincide with the lines on the left front; the lines on the right front shall extend 3/4 to 1 inch from the front piped edge. The vertical lines on the right front shall be identical to the lines C-D-E-F on the left front.					
	f. Draw a circle 7/8 + 0 -1/32 inch in diameter on each side of seven horizontal lines, and center it to the bisect line E-F, and with the edge of					

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
41.	Mark fronts for positioning the braid and buttonholes (See Figure 7). (cont'd)					
	each circle touching the horizontal line forming a figure 8 design as shown on Figure 7.					
	g. Position the center of the harp pattern at line C-D, with the upper edge of the pattern positioned at the bottom side of each horizontal line. Mark the harp in accordance with the pattern marker. The bottom edge of the harp must be not less than 1/2 inch from the line beneath.					
42.	Baste braid (See Figure 8).					
	a. Baste braid by hand along each side of the horizontal lines and around the circle figure 8 design and around the harp. The braid shall begin and end at the harp with both ends of the braid secured and tacked under the horizontal braid. On the left front, the braid shall be basted around the buttonhole line and the outer edge of the braid shall finish approximately 1/4 to 3/8 inch from the piped front edge.					
	b. Begin with cut end of braid even with straight line at top of harp. Baste the braid along its forward edge, down the center of harp to the forward edge of harp center. Continue up the backarm along the back edge of harp to the straight line at top, using the same edge of the braid.	Hand		2-6	C (silk) Gold	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
42.	Baste braid (See Figure 8). (cont'd)					
	c. Baste the bottom edge of braid along the straight line to the circle, follow circle back to straight line and continue to end of straight line.	Hand				
43.	Tack braid.					
	a. Securely tack all unattached edges of braid to provide a smooth, secure and flat surface of stitching.	Hand		2-6	C (silk) Gold	
	b. Tack inside edges of braid circles to coat, forming a inner hole approximately 1/4 inch in diameter.	Hand		2-6	C (silk) Gold	
	c. Tack loops at button edge of coat together to the coat to finish secure and flat.	Hand		2-6	C (silk) Gold	
44.	Stitch braid (See Figure 6).					
	Finished appearance. All stitching shall be done 1/16 inch from all edges whenever possible. All stitching shall be uniform. All stitching shall be performed with one continuous thread whenever possible. Stitching across braid strands shall be done only as prescribed or when absolutely necessary. All edges of the braid shall be securely attached to the coat at all points. The braid and the stitching shall present a smooth, neat, uniform appearance. The braid on the left front only shall be unstitched for approximately 3 inches from front end of the buttonhole loop braid.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
44.	Stitch braid (See Figure 6). (cont'd)					
	a. Stitch braid through fronts and interlining on both sides of the braid 1/16 inch from edge. The line of stitching shall start and finish at the harp as shown on Figure 6.	301	SSa-1	10-14	A (silk) Gold	A
	b. Braid may be stitched without basting, provided the requirements previously mentioned are maintained.					
	c. Hand stitch the inner edges of horizontal braid together on both fronts from harp ends to end of buttonhole opening on left front and from harp ends to front end of braid on right front.	Hand		8-10	C (silk) Gold	
45.	Join facing to fronts.					
	a. Position the left and right fronts to the respective front facing (face to face), with the waistline seam of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark along the top, front and bottom edges of facing.					
	b. Lap the front edge of the right and left fronts, respectively, on the outside of the facing at the marks and join the front to facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to bottom edge of coat front edge only.	301	LSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
45.	Join facing to fronts . (cont'd)					
	c. Trim excess facing material where necessary.					
46.	Baste front edges.					
	a. Turn the facing-lining assemblies to the inside of fronts, completely working out the corners.					
	b. Baste along the front edge of left and right fronts, working the facing back from the folded edge of piping.	101				
47.	Baste facing (second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 301	Hopper			
	b. Turn under and baste the top edge of the facing even with the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	Hand or 301	Hopper			
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of facings to approximately 1-1/4 inches from the lower edge of facing.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
47.	Baste facing (second time) (cont'd)					
	d. Turn under the bottom edge of facing at the mark and baste along the folded edge.	Hand or 301	Hopper			
48.	Tack facing to interlining.					
	a. Tack the right and left facing-lining seam allowance to the respective coat front interlining from approximately 2-1/2 inches from bottom edge of coat to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6		
49.	Baste front linings to coat.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat, and baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
	b. Baste the front lining to the coat, starting at the lower end of chest pleat, continuing along lower edge of armhole approximately 2 inches from the edge and ending at the side seam. Match side seams of coat and lining and continue basting as close as possible to the side seam and then across the bottom approximately 4 inches from piped bottom edge of coat.	Hand or 301	Hopper			
50.	Join lining at center back.					
	Finished appearance. The lining shall be carefully joined at center back without gathers, puckers or pleats. The seams shall start and finish evenly. The folded edge of the center pleat, on the outside of the lining, shall be towards the					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
50.	Join lining at center back. (cont'd)					
	left side. The center back seam of the lining shall be between the fold.					
	a. Position the back parts of lining and join together at the center with a 3/8-inch seam.	301	SSa-1	12-16	A	A
51.	Baste back lining to coat.					
	a. Fold the back lining, forming approximately a 1-inch-wide pleat at the center back. Baste the back lining to the coat along the center pleat from the top end to approximately 4 inches from the bottom finished edge of coat.	Hand or 301	Hopper			
	b. Baste back lining to coat, starting at side seam and continuing approximately 3 inches from the armhole and shoulder edges.	Hand or 301	Hopper			
52.	Hem bottom edge of lining.					
	Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The hem shall be 3/4 ±1/8 inch wide. The lining securing straps shall be positioned on the back in line with back seam of coat.					
	a. Hem the bottom edge of body lining with the raw edge turned under and with one end of the securing straps positioned and caught in the stitching 1/16 inch from the upper folded edge of hem.	301	EFb-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
53.	Tack the lining securing straps to bottom of coat.					
	Finished appearance. The lining securing straps, when tacked to the bottom edge of coat, shall not cause twists or other distortions to either the coat or the lining. The ends of the securing straps shall finish between the piping at bottom edge of coat and the skirt seam allowance. In the finished coat, the lining shall not be visible below the bottom edge of coat.					
	a. Position and securely tack the free end of the securing straps to the piping at the bottom edge of coat through the skirt seam allowance.	301			A	A
	b. Position the bottom edge of the lining so that in the finished coat the lining shall not be visible below the bottom edge of coat. Fold the lining securing straps across the width and stitch approximately 1/4 inch from the folded end in order to hold the lining in position.	301	OSf-1		A	A
54.	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the back lining even with the neck.					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
55.	Make eyelets in fronts. Finished appearance. The eyelets shall be worked with the purling on the outside of the coat, and shall finish with a 1/8-inch diameter opening. All stitches shall be securely caught in the fabric. a. Mark location of eyelets in right and left fronts for removable buttons on line C-D connecting the back of the button and buttonhole lines (see Figure 7). In the finished coat, the eyelet shall be positioned between the braid strands and opposite the center of the end of the beginning of the braid. b. Make an eyelet at each of the marks through all plies.	Eyelet		22 stitches per eyelet	A	A (silk)
56.	Make buttonholes. Finished appearance. The buttonholes shall be clean cut, well made and well worked over gimp to fit 40-line insignia buttons. The gimp and thread shall be pulled through to the outside of the front. The purling of the buttonhole shall be on the facing side. The inside of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of coat. The buttonholes shall be cut-first type. a. Remove the basting on the unstitched portion of the braid.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
56.	Make buttonholes. (cont'd)					
	b. Make a horizontal eyelet-end square-bar type buttonhole cut 1-1/4 inches long at each of the marks.	Button hole		60 per button-hole (not including bartack)	B (silk)	F
	c. Securely bartack the end of each buttonhole, catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bar-tack		21 per (bartack)	A (silk)	A
	d. Rebaste the unstitched portion of the braid and complete that portion of the stitching thru all plies (see Figure 8).					
57.	Press front of coat.					
	Finished appearance. Fronts shall finish smooth and flat without distortion and with all edges uniformly worked out.					
	a. Press the front of coat and braid smooth and flat with a suitable pressing machine, removing the fullness.					
58.	Baste shoulder pad to coat.					
	a. Insert shoulder pads between interlining and chest padding of coat fronts. Securely tack the pad to the interlining and chest padding only.	Hand or 301	Hopper			
59.	Seam shoulders.					
	Finished appearance. The shoulder seam shall finish without a distorted appearance.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
59.	Seam shoulders. (cont'd)					
	a. Join the back to the fronts at the shoulders with a 3/8-inch seam, working in the fullness on the back in accordance with good manufacturing practice.	301	SSa-1	12-16	A	A
	b. Spread open the shoulder seam and press flat holding the shoulders short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
	c. Position the front lining and coat front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn the coat on the inside.	Hand or 301	Hopper			
60.	Baste back lining and facing-lining assembly at shoulders.					
	a. Turn under and lap the shoulder edge of the back lining on the facing-lining assembly. Baste lining along the folded edge of the back lining with the top end of the chest pleat caught in the basting.	Hand				
61.	Seam neckline with size label and coat hanger.					
	Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
61.	Seam neckline with size label and coat hanger. (cont'd)					
	shall be positioned between the ends of the coat hanger, and the ends of the coat hanger shall be positioned so that in the finished coat the hanger opening shall be 2-1/4 inches long when measured on the outer edge and along the lower edge of collar lining.					
	a. Join facings and back lining to coat at the neckline from collar notch to collar notch, with a 1/4-inch seam and with the upper edge of the size label and the ends of the hanger positioned and caught in the stitching at the inside center back.	301	SSa-1	12-16	A	A
	b. Press the neckline of the coat smooth and flat with a heated pressing iron or pressing machine.					
62.	Set collar with lining.					
	Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar.					
	a. Mark the neckline on the outside 3/8 to 1/2 inch from top edge for position of collar.					
	b. Position the collar with the lower edge lapped on the outside top edge of the coat at the mark.					
	c. Seam the collar, from end to end, to the coat as close as possible to the lower edge of the collar. The stitching shall not be through the lining.	301	LSa-1	12-16	A	A (silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
63.	Set sleeves. Finished appearance. The armhole-sleeve seam shall finish without twists, gathers, puckers or pleats. a. Position sleeves on outside of coat at the armholes, with backarm seam of sleeve matching the side back seam, and with notch in top sleeve and front matching. b. Join the sleeve to the coat with a 3/8-inch seam, distributing the fullness in accordance with good manufacturing practice. c. Press the entire armhole smooth and flat with a heated pressing iron, exercising care not to stretch the armhole. Spread open upper part of the armhole-sleeve seam from the backarm seam of the sleeve to approximately midway between shoulder seam and notch at front edge of armhole and press smooth and flat with a heated pressing iron. d. Fold the excess material at armhole pit up to the line of stitching of the armhole sleeve seam, forming a hinge effect. The fold shall extend from the armhole notch to approximately 4 inches from the backarm seam. e. Press the fold smooth and flat with a heated pressing iron.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
64.	Baste armhole.					
	a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing fullness evenly. Turn coat on the outside.	Hand or 301	Hopper			
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of sleeves to the front notch of coat.	Hand or 301	Hopper			
65.	Stitch sleeve head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					
	a. Position the sleeve head pad on the sleeve with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole-sleeve seam, and with the one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole-sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.	301	SSa-1	4-6	24/4	24/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
65.	Stitch sleeve head pads and linings at armhole. (cont'd)					
	c. The underarm shield may be basted to the armhole prior to stitching.					
66.	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (silk)	
67.	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve and sleeve lining matching.					
	b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge approximately 1-1/2 inches in front of the forearm seam to the side seam line.	Hand		8-10	C (silk)	
	OR					
	c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operations 67.b.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026l0-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
67.	Fell sleeve lining at armhole. (cont'd)					
	OR					
	d. Machine stitch the lower edge of the sleeve lining, at the armhole on the inside from forearm seam to backarm seam and stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling.	Machine		8-10	C (silk)	
	NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.					
68.	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of the coat, starting at the bottom edge of the lining and continuing along the back and bottom edges of facing to the front edge of coat.	Hand		8-10	C (silk)	
	b. Fell the folded edge of the facings to the piping along the top edge from collar notch to front edge of coat.	Hand		8-10	C (silk)	
69.	Sew hooks and eyes to collar. (See Figure 9).					
	Finished appearance. The hooks shall be positioned on the collar so that in the finished coat the top and bottom hooks shall be approximately 1/4 inch from top and bottom edges respectively of collar, and the remaining hook shall be midway between top and bottom hooks. The eyes shall be positioned to engage the hooks, effecting a flat, smooth closure at front of collar without misalignment or gapping.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
69.	Sew hooks and eyes to collar. (See Figure 9) (cont'd)					
	a. Position and securely sew three hooks to the right end and three eyes to the left end of the collar.	Hand		16 per hook	C (silk) (double) thread)	
70.	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (silk)	
	b. Turn under the end and top edge of the lining at the right end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge to the end of the stitching joining the lining to the collar.	Hand		8-10	C (silk)	
	c. Turn under and fell the lower edge of the collar lining to the coat from end to end, catching the turned under portion of the lining at the right end in the felling. The lower edge of the collar lining may be basted to coat prior to felling.	Hand		8-10	C (silk)	
	d. Fell the collar extension tab to the left end of the collar and continue along the folded top edge to the end of the stitching joining the lining to the collar.	Hand		8-10	C (silk)	
	e. Turn the collar eyelet covers to the inside of the collar and fell the front edge, from top to bottom edge. Continue the felling along the bottom edge for a distance of 1/2 inch from front edge.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
71.	Clean coat. a. Pull all basting thread and trim and remove any loose ends of thread. Remove any spots, stains and tickets without injury to the material. b. Buttonholes at front closure shall be examined for exposure of coat front interlining cloth. The exposed interlining shall be colored with a reddish indelible ink.					
72.	Press coat. a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good commercial practices. b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. c. Press the entire collar smooth and flat. d. Press the upper fronts on a body machine, shrinking in and properly shaping the chest. e. Press the lower fronts smooth and flat. f. Press the sides, working the fullness towards the back. g. Press the back smooth and flat, removing all fullness.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
72.	Press coat. (cont'd) h. Press the sleeves smooth and flat, creasing at the back-arm and forearm seam. The back-arm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 3 to 3-1/2 inches below the base of the armhole. i. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine. j. Press the armholes solid from the inside creasing the armholes at the front, and creasing the excess material at the armpit. The armpit and back of the armhole shall be held short while pressing. k. Block the armholes on a pressing buck, shrinking in the top sleeves. l. Press lower edge of coat smooth, flat and even. m. Press body lining throughout, removing all wrinkles and creases. Press the lining pleats smooth and flat. n. Remove all gloss marks. o. Remove any wrinkles and creases missed by previous pressing operations.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
73.	Mark for buttons. a. Mark the location for sewing seven 40-line insignia buttons to the right front to properly engage with the buttonholes in the left front. The mark for top button shall be in line with right end of collar and the remaining buttons shall be vertical alignment with top mark.					
74.	Attach and sew on buttons. Finished appearance. The buttons shall be aligned with the buttonholes to secure a smooth and complete closure without bulging or misalignment. a. Punch a hole for a button on each back seam at the skirt seam. Insert the shank of a 40-line insignia button and secure with a reinforcement disc and ring toggle. b. Sew a 40-line button on right front at each mark, through all plies. The buttons shall be centered 5/8 inch from front edge. c. Insert a 40-line button through each eyelet on the fronts and secure with a ring toggle. NOTE: All buttons shall be attached with the anchor in the upright position. Hand or machine sewn buttons shall be tightly wrapped not less than four times around to form a 1/8 to 3/16 inch shank.	101 or 301 or Hand		20-24 per button 14-16 per button 4 per button double thread	24/4 24/4 or 16/4	24/4 24/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II - Coat measurements 1/

Size	Breast 2/	Back length 3/	Sleeve length 4/
		Short	
	inches	inches	inches
34	35	29-3/4	17-1/2
35	36	29-7/8	17-1/2
36	37	30	17-1/2
37	38	30-1/8	17-1/2
38	39	30-1/4	17-1/2
39	40	30-3/8	17-1/2
40	41	30-1/2	17-1/2
41	42	30-5/8	17-1/2
42	43	30-3/4	17-1/2
44	45	31	17-1/2
46	47	31-1/4	17-1/2
		Regular	
	inches	inches	inches
34	35	30-3/4	18-1/2
35	36	30-7/8	18-1/2
36	37	31	18-1/2
37	38	31-1/8	18-1/2
38	39	31-1/4	18-1/2
39	40	31-3/8	18-1/2
40	41	31-1/2	18-1/2
41	42	31-5/8	18-1/2
42	43	31-3/4	18-1/2
44	45	32	18-1/2
46	47	32-1/4	18-1/2
		Long	
	inches	inches	inches
34	35	31-3/4	19-1/2
35	36	31-7/8	19-1/2
36	37	32	19-1/2
37	38	32-1/8	19-1/2
38	39	32-1/4	19-1/2
39	40	32-3/8	19-1/2
40	41	32-1/2	19-1/2
41	42	32-5/8	19-1/2
42	43	32-3/4	19-1/2
44	45	33	19-1/2
46	47	33-1/4	19-1/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table II - Coat measurements 1/

Size	Breast 2/	Back length 3/	Sleeve length 4/
		Extra Long	
	inches	inches	inches
34	35	33-1/4	20-1/2
35	36	33-3/8	20-1/2
36	37	33-1/2	20-1/2
37	38	33-5/8	20-1/2
38	39	33-3/4	20-1/2
39	40	33-7/8	20-1/2
40	41	34	20-1/2
41	42	34-1/8	20-1/2
42	43	34-1/4	20-1/2
44	45	34-1/2	20-1/2
46	47	34-3/4	20-1/2

1/ Tolerance for all measurements ±3/8 inch.

2/ Breast measurement taken with coat buttoned, from folded edge to folded edge in line with pit of armhole; multiply by 2.

3/ Back length measurement shall be taken along center back from lower edge of collar to piped bottom edge of coat.

4/ Sleeve length measurement shall be taken along forearm seam from pit of armhole to bottom edge of sleeve.

*3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the levels set by the applicable acceptable quality levels (AQL).

4. QUALITY ASSURANCE PROVISIONS

*4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified, in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*4.1.1 Certificate of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certificate.

*4.2 Inspection. Inspection shall be in accordance with the provisions set forth in MIL-STD-105, except where otherwise indicated herein.

*4.2.1 First article inspection. When first article is required, inspection shall be performed on a completely fabricated coat for conformance to all provisions of this specifications.

*4.2.2 Component and material inspection. In accordance with 4.1 above, components and materials shall be tested in accordance with all the requirements of referenced specifications, figures and standards unless otherwise excluded, amended, modified or qualified in this specification or applicable purchase document. In addition to testing provisions contained in subsidiary specifications, figures and standards, testing shall be performed on components listed in Table III for characteristics noted. All test reports shall contain the individual value utilized in expressing the final results.

*4.2.2.1 Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following. The lot shall be unacceptable if one or more sample units fail to meet any test requirement specified herein.

Lot size (lot unit)	Sample size (sample unit)
800 or less	2
801 thru 22,000	3
22,001 and over	5

The unit for expressing lot sizes and sample units for testing each component shall be in accordance with applicable subsidiary specifications and as follows:

Component	Lot sizes expressed as:	Sample unit for testing
Padding for Collar	Yards	1/4 yard full width
Cloth, cotton, buckram (for collar)	Yards	2 yard full width

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. Det. per S/Unit	Results reported as:
Cloth, cotton, buckram (collar interlining)	Material identification 1/	3.3.4.1	1200	1	Pass or fail
	Weave (single ply)	3.3.4.2	Visual	1	Pass or fail
	Texture-threads per inch (single ply)	3.3.4.3	5050		
	- warp			3	Avg. of the 3 det. in each direction to the nearest whole no.
	- filling			3	
	Resistance to: - wet (dry) cleaning	3.3.4.4	5622	1	Good, fair, or poor
	(Laminated cloth) - accelerated aging	3.3.4.4	4.3.2.2		Pass or fail
	(Laminated cloth) - perspiration	3.3.4.4	4.3.2.3		Good, fair, or poor
	(Laminated cloth) Stiffness, inch-lb - original	3.3.4.4.1	5202	10	Nearest 0.001 lb.
	- after wet (dry) cleaning	3.3.4.4.1	4.3.2.1	10	Nearest 0.001
	- after accelerated aging	3.3.4.4.1	4.3.2.2	10	
	- after perspiration	3.3.4.4.1	4.3.2.3	10	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt, Para,	Test Method	No. Det. per S/Unit	Results reported as:
	Weight-oz. per sq. yd.	3.3.4.4.2	5041	5	Avg. of the 5 det. to nearest 0.1 oz.
	Breaking strength (lbs) (Laminated cloth)	3.3.4.4.3	5100		Avg. of the 5 det. on each direction to the nearest 1.0 lb.
	- warp direction			5	
	- filling direction			5	
Braid, Gold	Cover thread Material Identification 1/	3.3.15.1	1200	1	Pass or fail
	- color		Visual	1	Pass or fail
	- ply		Visual	1	Pass or fail
	Over wire	3.3.15.1			
	- metal undercoat		Std	1	Pass or fail
	- metal plating		Comm'l	1	Pass or fail
	Core (stuffer)	3.3.15.1			
	- material ident. 1/		1200	1	Pass or fail
	- number of threads		Visual	1	Pass or fail
	- ply of threads		Visual	1	Pass or fail
	- color	3.3.15.1	Visual	1	Pass or fail
	Weave	3.3.15.1	Visual	1	Pass or fail
	No. of carriers	3.3.15.1	Visual	1	Pass or fail
	ends/carriers	3.3.15.1	Visual	1	Pass or fail

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. Det. per S/Unit	Results reported as:
	Shape	3.3.15.1	Visual	1	Pass or fail
	Width (in.)	3.3.15.1	5020	1	Pass or fail
	Metal content (%) - gold - silver - alloy	3.3.15.1	4.3.4	2	To nearest 0.1%
	Fastness to:	3.3.15.1			
	- water		5630	1	Good, fair, or poor
	- dry cleaning		5620	1	Good, fair, or poor
Hook & Eye	Material ident. 1/	3.3.16	Std Comm'l	1	Pass or fail
	Finish		Std Comm'l	1	Pass or fail
	Finish		4.3.3	1	Pass or fail

1/ Accept a certificate of compliance for this requirements.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

*4.2.2.2 In process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.2.3 Examination of end item. The end item shall be examined for defects listed in 4.2.3.2 through 4.2.3.5.

4.2.3.1 Classification of defects. All defects shall be classified as indicated below, except those with an asterisk (*) in classification column, which shall be classified as follows:

Major defect - When seriously affecting appearance or serviceability.

Major A defect - When affecting appearance or serviceability but not seriously.

4.2.3.2 General defects. General defects shall be classified as follows:

Examine	Defect	Classification Major	(*)	Minor A	Minor B
Buttonholes (construction)	a. One or more omitted, added or wrong type.	X			
	b. Not corresponding to size of button:				
	- too small, not permitting button to enter buttonhole.	X			
	- too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).			X	
	c. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	X			
	d. Bartack missing or loose on:				
	- one buttonhole.			X	
	- two or more buttonholes.	X			
	e. Bartack misplaced, not serving intended purpose on:				
	- two or more buttonholes.			X	
	- one buttonhole.				X
	f. One or more broken stitches in:				
	- one buttonhole.			X	
	- two or more buttonholes.	X			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	g. More than 2 skipped stitches in: - one buttonhole.			X
	- two or more buttonholes.		X	
	h. Ragged edges, affecting appearance, or exposed interlining not colored with reddish indelible ink as specified.			X
	i. Any uncut buttonhole.		X	
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		X	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified: - one or two stitches.			X
	- three or more stitches.		X	
	l. One or more buttonholes finished with purling on the underside	X		
Button or ring toggles	a. One missing, loose, defective or improper size or type.		X	
	b. Two or more missing, loose, defective or improper size or type.	X		
	c. One or more buttons sewn with the head of the eagle in other than upright position.			X

NOTE: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; unsound soldering; scratches; dents; blemishes, or imbedded foreign matter; loose shanks; or are poorly plated or badly shaded.

Cleanness	a. One or more spots or stains of a permanent nature clearly noticeable: - on the outside	X		
	- on the inside		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	b. One or more removable spots or stains clearly noticeable:			
	- on the outside.		X	
	- on the inside.			X
	c. Thread ends not trimmed throughout garment, or one or more bastings not removed, or two or more shade tickets not removed.			X
Components and assembly	Any component part or required operation omitted (unless otherwise classified herein).	*		
Cutting	a. Any component part of basic wool material not cut in accordance with directional lines on patterns, on in accordance with specification requirements.	X		
	b. Piping material cut on the bias.		X	
	c. Any lining part not cut in accordance with directional lines on patterns, or in accordance with specification requirements.		X	
Hooks and eyes	a. One hook or eye omitted.		X	
	b. Two or more hooks or eyes omitted.	X		
	c. Not specified type or size.		X	
	d. Hook or eye not securely tacked to ends of collar.		X	
	e. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hooks and eyes are fastened.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Material defects and damages	a. Any weakening defect such as smash, multiple float or loose slub.	*		
	b. Any hole.	*		
	c. Shade bar, unsightly slub, etc., affecting appearance:			
	- on outside.	*		
	- on inside.		X	
	d. Scissors or knife cut, tear, mend, or burn.	*		
	e. Needle chews that may develop into a hole.	*		

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows:

Material defect.	- No defect
Workmanship damages.	- Minor B defect

Pressing	a. Burned or scorched.	*		
	b. Pressing omitted entire garment.		X	
	c. Armhole stretched.	*		
	d. Poorly pressed (unless otherwise indicated).			X
	e. Basting or pressing impressions not removed on major portion of coat.		X	
	f. Gloss not removed on major portion of coat.			X
	g. Armholes not blocked or poorly blocked, affecting appearance.		X	
	h. Edges bulky, i.e., not pressed solid, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	i. Inside of armhole not creased as required.		X	
	j. Sleeve not creased at front or backarm seam.		X	
	k. Wrinkles or pressing impressions not removed under pocket flap, side, or center back seam allowance.		X	
	l. Linings not pressed smooth.		X	
	m. Armhole seam not pressed open across top as required.		X	
Seams and stitching	a. Accuracy of seaming: 1. Any seam twisted, puckered, or pleated, affecting appearance.	X		
	2. Part of garment caught in any unrelated operation or stitching.	*		
	3. Unsightly hand-felling or blindstitching exposed on outside of coat, affecting appearance.		X	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required			X
	5. Wrong color of thread or two shades of thread used on outside of coat, affecting appearance.	*		
	b. Gage of stitching (edge or raised stitching): 1. Irregular, i.e., unevenly gaged, or various stitchings not uniform, affecting appearance.		X	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	c. Open seams:			
	1. On outside:			
	- up to 1/4 inch inclusive.			X
	- more than 1/4 inch but not more than 1/2 inch.		X	
	- more than 1/2 inch.	X		
	2. On inside:			
	- more than 1/2 inch (except machine felling).		X	
	- up to 1/2 inch inclusive (except machine felling).			X
	- up to 1 inch inclusive (machine felling).			X
	- more than 1 inch (machine felling).		X	

NOTE: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.

	d. Raw edges			
	1. On outside:			
	- up to 1/8 inch inclusive.			X
	- more than 1/8 inch but not more than 1/4 inch.		X	
	- more than 1/4 inch.	X		
	2. On inside:			
	- more than 1/8 inch but not more than 1/4 inch.			X
	- more than 1/4 inch.		X	

NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.

	e. Run-offs (see classification of open seams).			
	f. Stitch tension:			
	1. Loose tension resulting in loose seam.	X		
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		X	
	3. Tight tension (stitches break when normal strain is applied).	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting pull in lengthwise direction of seam.			
	g. Stitches per inch (excluding labels). Less than minimum specified:			
	- one or two stitches.			X
	- three stitches.		X	
	- four or more stitches.	X		
	NOTE: To be scored only if condition exists on major portion of seam.			
	h. Wrong stitch or seam type.		X	
	i. Stitching skipped or broken (on edge or raised stitching when seam is seamed, turned and stitched).		X	
	- 1/4 inch or more but not more than 1/2 inch.			X
	- more than 1/2 inch.		X	
Shaded parts	a. Any outside part shaded.	*		
	b. Any lining part badly shaded except sleeve lining.		X	
	c. Sleeve lining parts badly shaded, or parts not matching each other.			X

4.2.3.3 Detailed defects (outside of coat). Detailed defects on outside of coat with coat buttoned on form or spread out on table shall be classified as follows:

Examine	Defect	Classification Major (*)	Minor A	Minor B
Collar (construction and setting)	a. Interlining omitted.	X		
	b. Interlining tight or twisted, causing puckers on collar, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	c. Tight at joining to front or back, causing puckers or pleats at neck or coat, affecting appearance.	*		
	d. Braid irregular, affecting appearance.		X	
	e. Collar ends overlapping when fastened.		X	
	f. Collar ends spread open more than 3/8 inch when fastened.		X	
	g. Front finished ends of collar uneven in width by 3/16 inch or more		X	
Alignment of front buttons and buttonholes	Not aligned, causing a noticeable bulge or twist on fronts when buttoned, affecting appearance.		X	
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by: - more than 1/8 inch but not more than 1/4 inch.		X	
	- more than 1/4 inch.	X		
	b. Left front at corner longer than right front by: - more than 1/4 inch but not more than 3/8 inch.			X
	- more than 3/8 inch.		X	
	c. Right front at corner exposed beyond bottom edge of left front by more than 1/8 inch.		X	
Shoulder (construction)	Improperly joined or set, causing shoulders or back to twist.	*		
Shoulder pads	a. Not completely caught in armhole tacking.		X	
	b. Misplaced, not serving intended purpose, i.e., too far back or too far forward.		X	
	c. One or both pads omitted.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Armholes (construction)	a. Badly stretched, affecting appearance.	*		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	*		
	c. Crooked seam, affecting appearance.		X	
	d. Tape stitching exposed and visible on outside surface.			X
	e. Sleeve head pads not completely tacked to armholes, or misplaced, not serving intended purpose.		X	
	f. One or both sleeve head pads omitted.		X	
Sleeves	a. Setting and hang:			
	1. Sleeve fullness misplaced, affecting appearance		X	
	2. Backarm seam of sleeve not matching side back seam by:			
	- more than 1/4 inch but not more than 1/2 inch.		X	
	- more than 1/2 inch.	X		
	3. Hang of sleeves on the same coat in opposite direction by more than 2 inches.		X	
	4. Sleeve tight in armhole, i.e., roll effect not present.		X	
	b. Sleeve lining:			
	1. Twisted, tight, or short, causing bulge, twists, or puckering on outside of sleeves.	*		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			X
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of sleeves.			X
	c. Construction of sleeves: 1. Tacking on bottom turnup to body of sleeve omitted or insecure.		X	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			X
	3. Tacking on 1 or both sleeve lining seams to sleeve seams omitted, or insecure.			X
	4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from bottom edge of sleeve.			X
Body (outside)	a. Fitting of body linings tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	*		
	b. Fitting of front interlining: 1. Tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	*		
	2. Too full, causing coat front to have a wavy appearance.	*		
	c. Chest and waist darts: 1. One or more darts not properly tapered, causing puckers or pleats at one or more ends, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	2. Cut edges of chest dart pressed toward front of coat.			X
	3. Folded edge of waist dart pressed toward front of coat.			X
Front and bottom edges	a. Front edge stretched, affecting appearance.		X	
	b. Piping set on tight, causing puckering on front, affecting appearance.		X	
	c. Front or bottom piping irregular, affecting appearance.		X	
	d. Bottom edge stretched, puckered, or uneven, affecting appearance.			X
	e. Bottom corner of left front poorly shaped, affecting appearance.		X	
	f. Left front rolling outward below bottom button.	*		
	g. Front edge irregular, affecting appearance.		X	
	h. Piping tight on bottom edge, causing puckering on outside of coat, affecting appearance.		X	
	i. Left front not dressed as specified.	X		
Front facings	Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.	*		
Back side panel seams	Curved panel seam on back of coats stretched or distorted, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Front buttonholes	a. Position from front edge, including piping, to inside edge of eyelets: - less than 1/2 inch but not less than 3/8 inch or more than 3/4 inch but not more than 7/8 inch.			X
	- less than 3/8 inch or more than 7/8 inch.		X	
	b. More than 1/4 inch from equal spacing.		X	
	c. Unevenly spaced from front edge by more than 3/16 inch.		X	
Front buttons (position and stitching)	a. Top button not in vertical alignment with right end of collar by more than 1/8 inch.		X	
	b. Any front button out of vertical alignment by 1/4 inch or more.		X	
	c. Stitching not caught through front interlining on one or more buttons.	X		
	d. Stitching caught through front interlining but not through facing: - one button.			X
	- two or more buttons.		X	
Braid placement on fronts	a. Braid out of horizontal alignment on left and right front, affecting appearance.	X		
	b. Harp edge less than 5/8 inch or more than 1 inch from edge of armhole.	X		
	c. Diameter of figure 8 circle less than 27/32 inch or more than 7/8 inch.			X
	d. One or more inner circles forming figure 8 less than 1/8 inch in diameter.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.2.3.4 Detailed defects (inside of coat). Detailed defects on inside of coat shall be classified as follows:

Examine	Defect	Classification Major (*)	Minor A	Minor B
Labels	a. Any required label missing, incorrect, illegible, or size label not securely caught in stitching.		X	
	b. Identification label not stitched on 4 sides.			X
	c. Bottom edge of identification label less than 3 inches or more than 5 inches from bottom edge of coat.			X
Hanger	a. Hanger omitted or ends not securely stitched.		X	
	b. Less than 1-7/8 inches or more than 2-1/8 inches long, measured along edge of collar lining.			X
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.			X
Front facings	a. Fullness or pleats on facings between buttons, buttonholes, or between front edge and buttons or buttonholes.			X
	b. Tacking on back edge to one or both interlinings: - omitted. - insecure or incomplete for a distance of more than 4-1/2 inches below shoulder seam, or more than 4 inches above bottom edge of coat.		X	X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	c. Felling at bottom edge of front or back edge of facing omitted or insecure on one or both facings.		X	
	d. Felling at top edge of facing omitted or insecure on one or both facings.		X	
Body lining	a. Excessive puckering or pleated.			X
	b. Twisted, not affecting smoothness on outside of coat.		X	
	c. One or both chest pleats on shoulders omitted.		X	
	d. Folded edge of one or both chest pleats facing front edge of coat.			X
	e. Pleat omitted at center of back lining.		X	
	f. Pleat less than 1/2 inch in depth at center of back lining.			X
	g. Bottom hem less than 5/8 inch or more than 7/8 inch.			X
	h. One or both lining securing straps at bottom of coat omitted or insecure.		X	
	i. Position of one or both lining securing straps more than 1 inch from side seam.			X
	j. One or both lining securing straps not folded and stitched.			X
	k. Lining too long, i.e., exposed beyond bottom edge of coat.		X	
Serging	Serging omitted on one or more seams where required.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Collar extension tab	a. Omitted.		X	
	b. Extending less than 1/2 inch or more than 1 inch from left end of collar.			X
	c. Insecurely felled or felling not on four sides.			X

*4.2.3.5 Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve length uneven by 1/2 inch or more shall be classified as a size measurement defect.

*4.2.3.6 Inspection levels and AQL's. Inspection levels and AQL's expressed in defect per 100 units (DHU) shall be as follows:

4.2.3.2 through 4.2.3.4

Inspection level III of MIL-STD-105

AQL's	Major	1.5 DHU
	Major and Minor A (combined)	10.0 DHU
	Total Major, Minor A and Minor B (combined)	40.0 DHU

4.2.3.5

Inspection Level S-3 of MIL-STD-105

One class	4.0 DHU

4.2.4 Examination of preparation for delivery requirements. An examination shall be made to determine compliance with packaging, packing and marking requirements of Section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the inspection lot. The inspection lot shall be S-2 and the AQL shall be 4.0 DHU.

Examine	Defect
Marking (exterior & interior)	Omitted, incorrect, illegible, of improper size, location, sequence, or method of application.
Materials	Any component missing or damaged.
Workmanship	Inadequate application of components such as incomplete closure of case liners, container flaps, loose strappling, inadequate stapling. Bulging or distortion of containers.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect
Content	Number of coats per container is more or less than required.

4.3 Tests. Tests shall be in accordance with the following.

4.3.1 Metal composition. Chemical composition shall be determined in accordance with test method III of FED-STD-151.

4.3.2 Tests for stiffness.

4.3.2.1 After wet (dry) cleaning. Method 5622 of FED-STD-191 shall be used, except the material shall be subjected to three 20-minute test cycles.

4.3.2.2 After accelerated aging. Method 5850 of FED-STD-191 shall be used, except the aging process shall be limited to 5 hours at a temperature of 100°C.

4.3.2.3 After test for perspiration. Method 5680 of FED-STD-191 shall be used, except the material shall be immersed in the specified solution for 20 minutes and then air dried.

4.3.3 Test for tackiness. At room temperature (60° to 80°F) press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall be free when pressure is released.

4.3.4 Quantity of gold and silver. At least two pieces, 1 yard each, shall be assayed for the quantity of gold and silver. Unravel braid to separate enough metal yarn for analysis. Place metal yarn in 70 percent sulfuric acid as many times as may be required to dissolve cotton yarn and to isolate bare metal. The quantities of gold and silver may be determined by standard commercial methods of assay, but in case of dispute, shall be determined in accordance with 4.3.4.1 and 4.3.4.2, respectively.

4.3.4.1 Gold content. Boil 1 gram of alloy (accurately weighed) with 60 milliliters (ml) 1:1 nitric acid (NHO_3) in a 400-ml beaker using a small flame or hot plate. Continue boiling until all metals except the gold are in solution. Dilute to 200 ml with hot water. Filter through a rapid ashless filter paper, and wash several times with hot water. Take the filter paper with the gold (cutting off any excess filter paper), wrap in a 2-inch by 2-inch piece of silver-free lead foil, and roll into a ball. Place the ball in the hollow of a bone ash cupel, and add lead shot around the ball. Place cupel in a muffle furnace for 1 hour at 1,000°C. Remove from the furnace and examine hollow for flakes of gold impurities and discolored gold bead. If any are noticed, add additional lead shot and return cupel to the muffle furnace for 1 hour. Otherwise, cool the gold bead and weigh. The gold content shall be calculated as follows:

$$\text{Gold content} = \frac{W\ (AU) \times 100 = P\ (AU)}{WS}$$

Whereas:

W (AU) = Weight of gold
WS = Weight of sample
P (AU) = Percent of gold

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currenversion before use.

4.3.4.2 Silver content. Dilute the filtrate, from 4.3.4.1 to a 1000-ml volumetric flash, and dilute to the mark. Pipette a 200-ml aliquot from the flask into a 400-ml beaker. Heat to boiling, and add hydrochloric acid (3:100) drop by drop from a pipette until precipitation is complete (1 ml of hydrochloric acid solution precipitate about 0.039 gram of silver). When solution has cooled and precipitate has settled, determine whether precipitation is complete by adding a few drops of the hydrochloric acid (3:100). If solution remains clear, filter on a weighed porcelain Gooch crucible. Wash the precipitate several times with HNO_3 (1:200) and finally with cold water. Protect the silver chloride from the light; dry in an oven for not less than 2 hours, cool and weigh. The silver content shall be calculated as follows:

$$\text{Silver Content} = \frac{W\ (AgCL)\ X\ 752.63\ X\ 5}{WS}$$

Whereas:

W(AgCL) = Weight of silver chloride
WS = Weight of sample minus weight of gold

4.3.4.3 Alloy content. Alloy content is ascertained by difference between gold and silver content.

5. PREPARATION FOR DELIVERY

5.1 Packaging and packing. Unless otherwise specified (see 6.2), the coats shall be packaged in accordance with good commercial practice and packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight Classification Rules or regulations of other carriers applicable to the mode of transportation.

5.2 Marking. In addition to any special marking required by the contract or order, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

5.3 Moth repellency. No less than 8 ounces of naphthalene conforming to class B of R-N-91 shall be uniformly distributed throughout the entire contents of shipping container, except when coats are made of moth repellent treated cloth.

6. NOTES

6.1 Intended use. The coats described herein are intended for wear by enlisted male personnel of the U.S. Marine Corps Band (Drum Major Full Dress).

6.2 Ordering data. Purchasers should exercise any desired options offered herein, and procurement documents should specify the following:

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

*6.2.1 Procurement requirements.

(a) Title, number and date of this specification.
(b) Class and sizes required (see 1.2).
(c) Whether first article is required (see 3.2).
(d) Number of coats in first article (see 3.2).
(e) When coats shall not be packaged and packed in accordance with commercial practice (see 5.1).

*6.2.2 Contract data requirements. Data conforming to Data Item Descriptions DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902, DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on a DD Form 1423 included in the contract.

*6.3 Samples and shade samples. For information regarding availability of sample coats and of the standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

*6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).

*6.5 Marginal notations. The margins of this specification are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assume no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship of the last previous issue.

Preparing activity
Navy - MC
Project No. 8405 N582

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

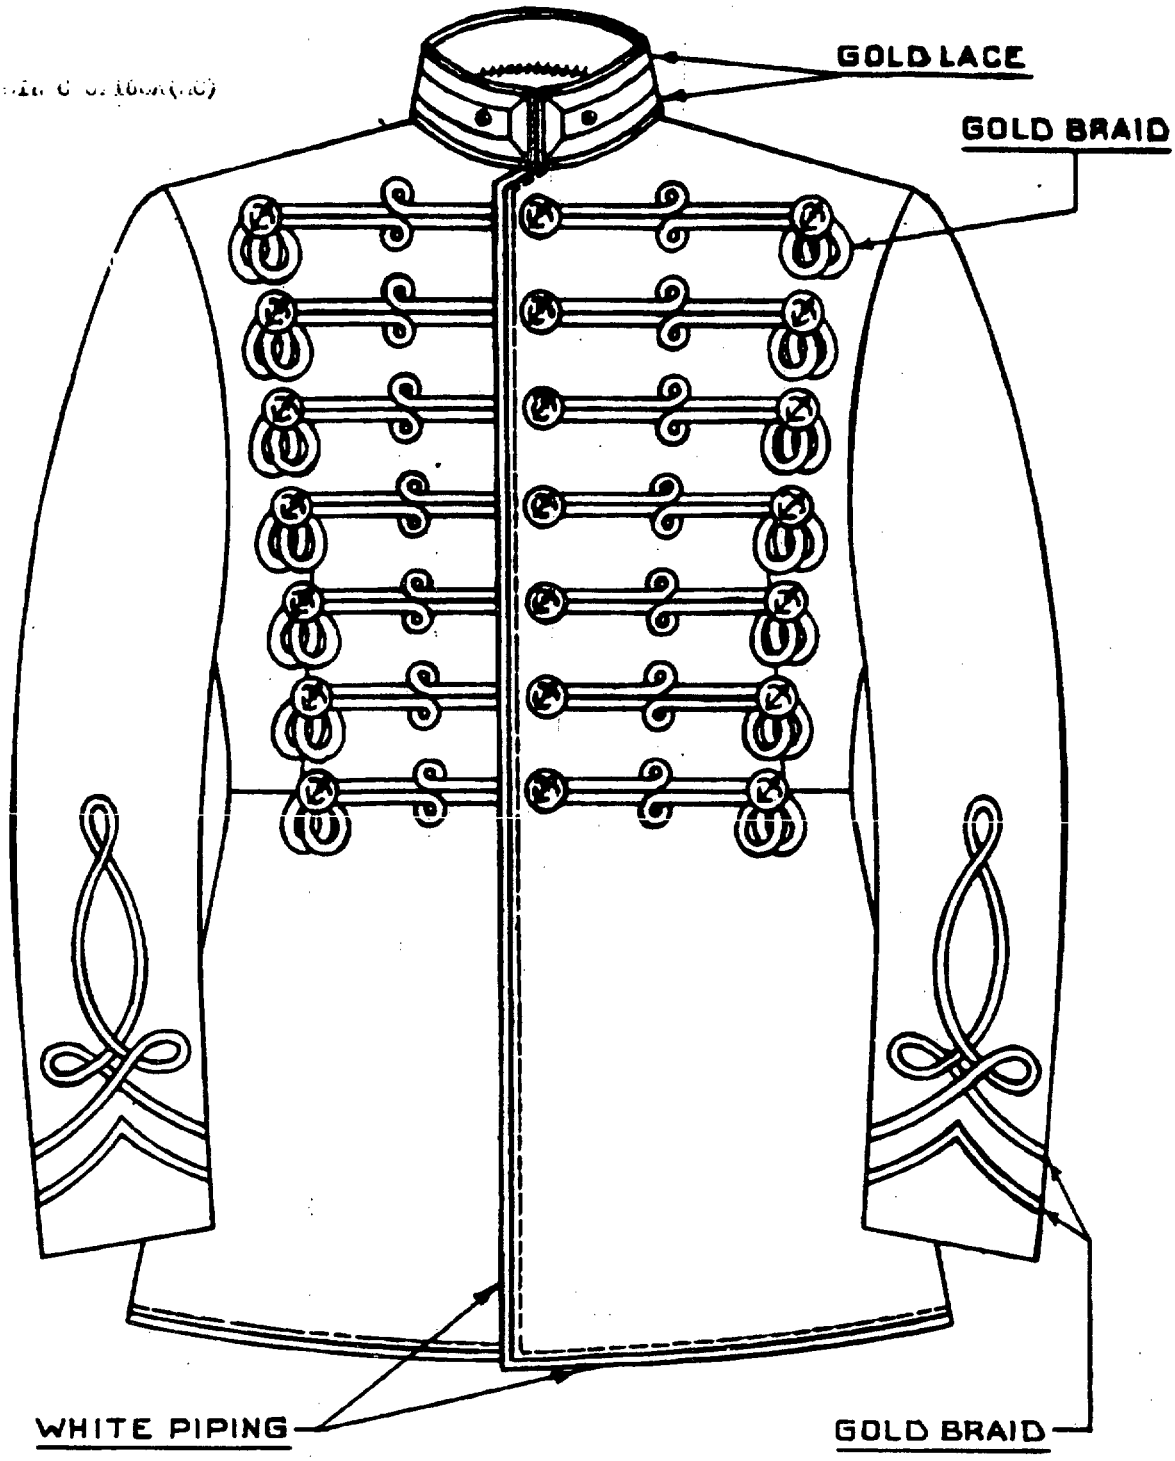


FIG. 1. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND; DRUM MAJOR

M.C.S.A.
826:R.G.F.
26 Apr 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.


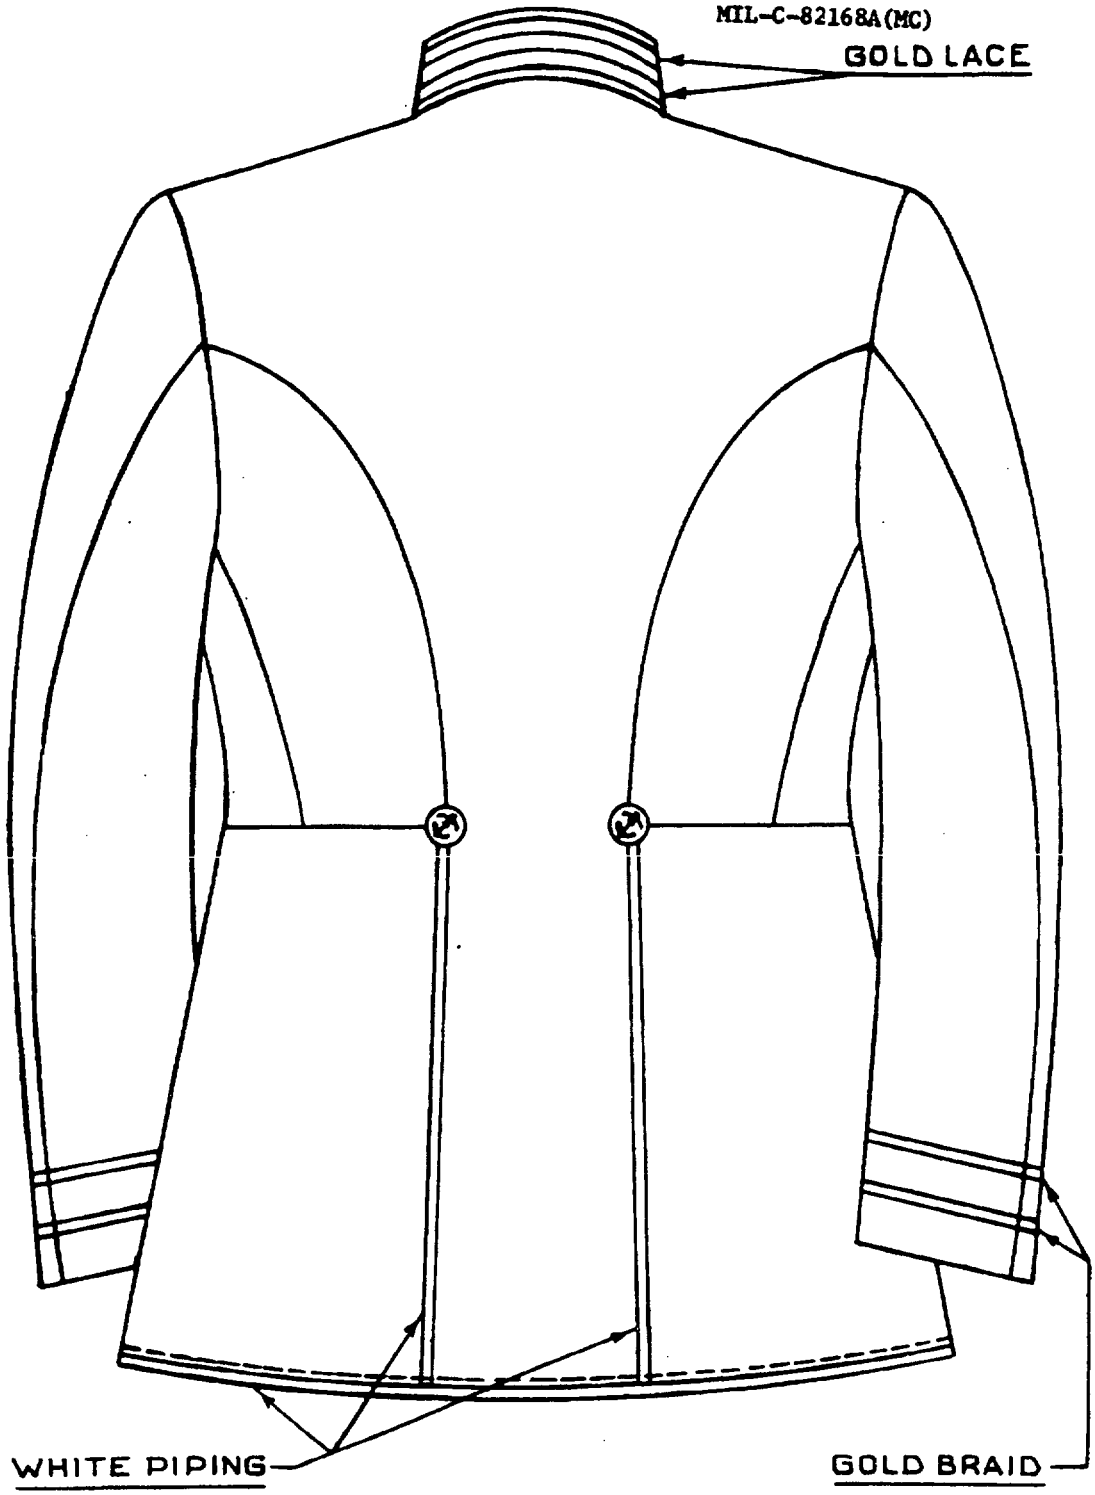


FIG. 2. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

M.C.S.A.
826:R.G.F.
26 Apr 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

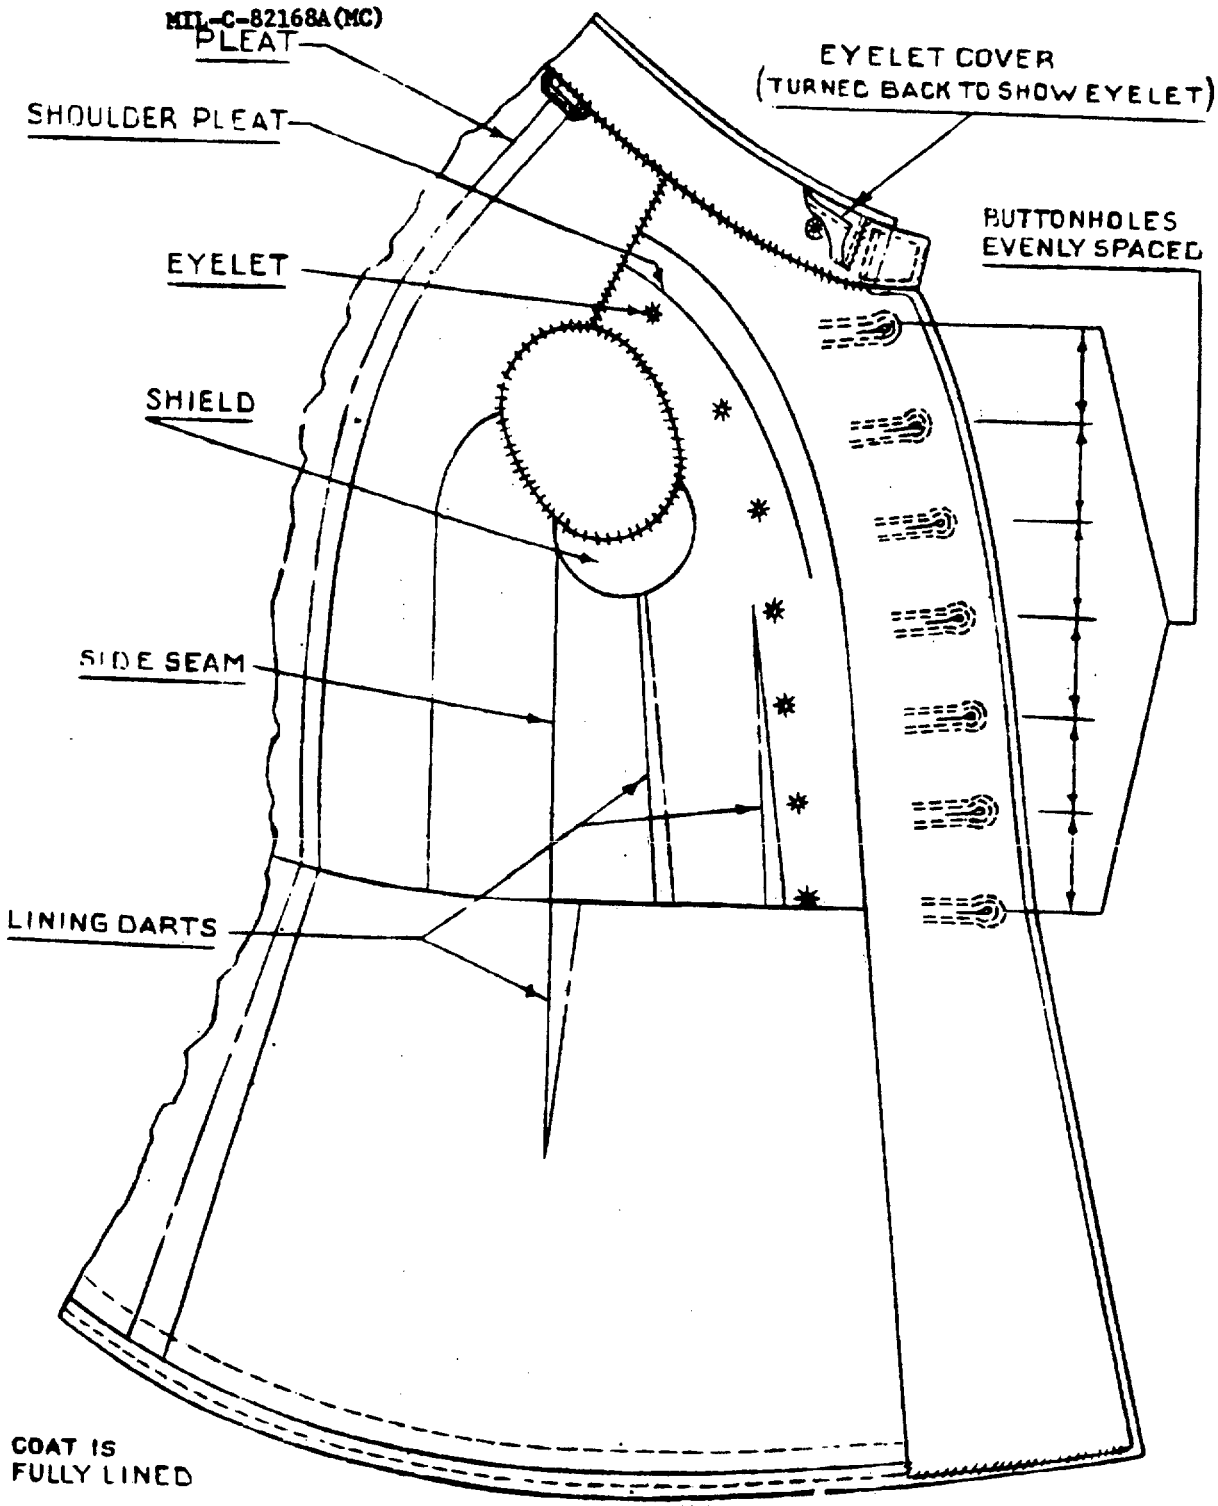


LEFT INSIDE VIEW


FIG. 3. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

M.C.S.A.
826:R.G.F.
26 Apr 74


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

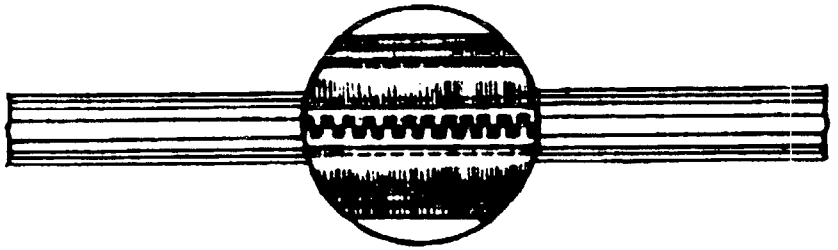

GOLD LACE (DETAIL)

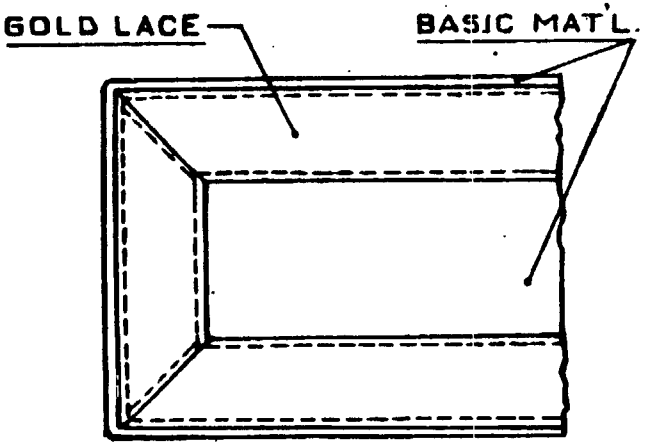

STITCHING DIAGRAM

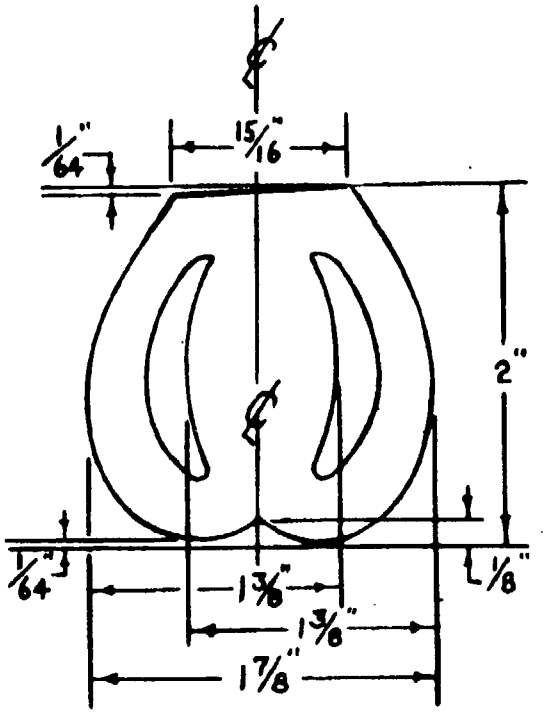


HARP


FIG. 4. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

M.C.S.A. 826: R.G.F. 26 Apr 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

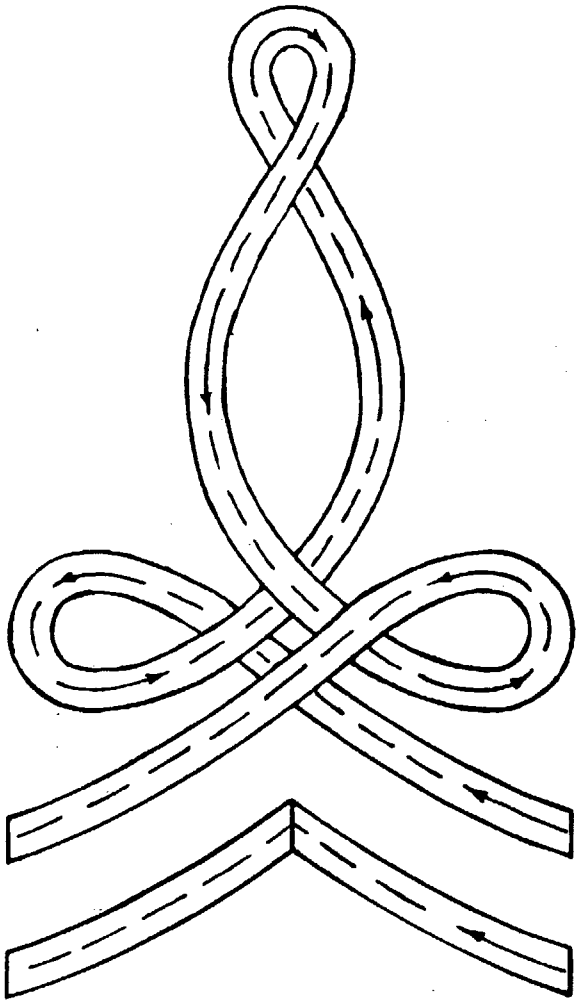

BASTE BRAID

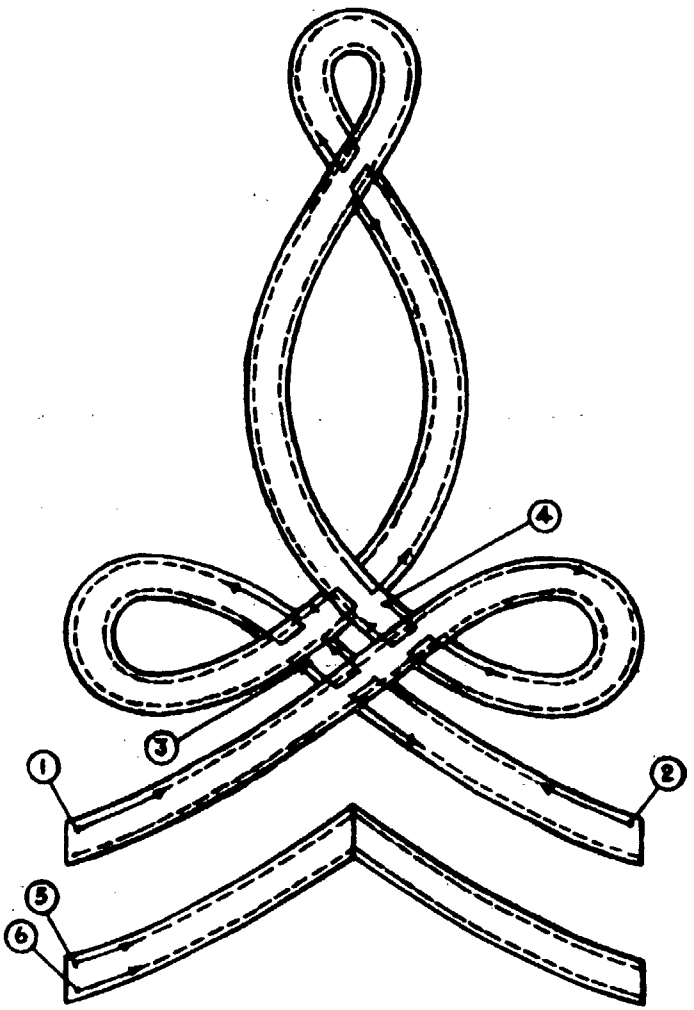


STITCHING DIAGRAM

FIG. 5. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

M.C.B.A.
826: R.G.F.
26 Apr 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

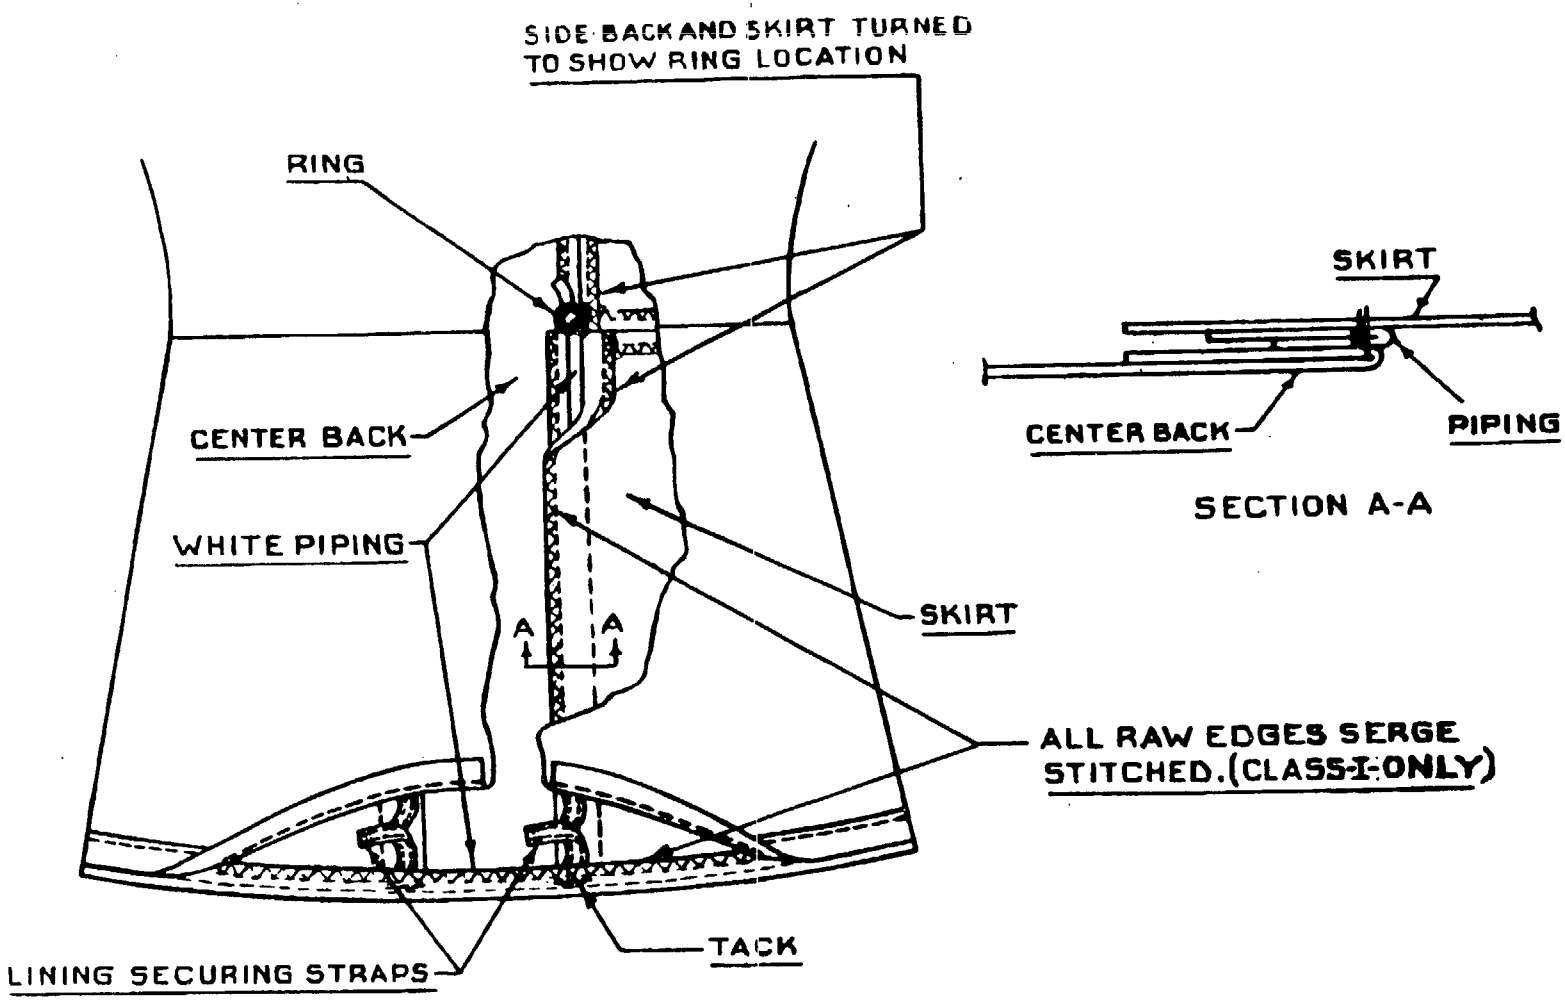


BACK INSIDE — CUT THROUGH VIEW

FIG. 6 COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

M.C.S.A. 826: R&F 26 Apr 74

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

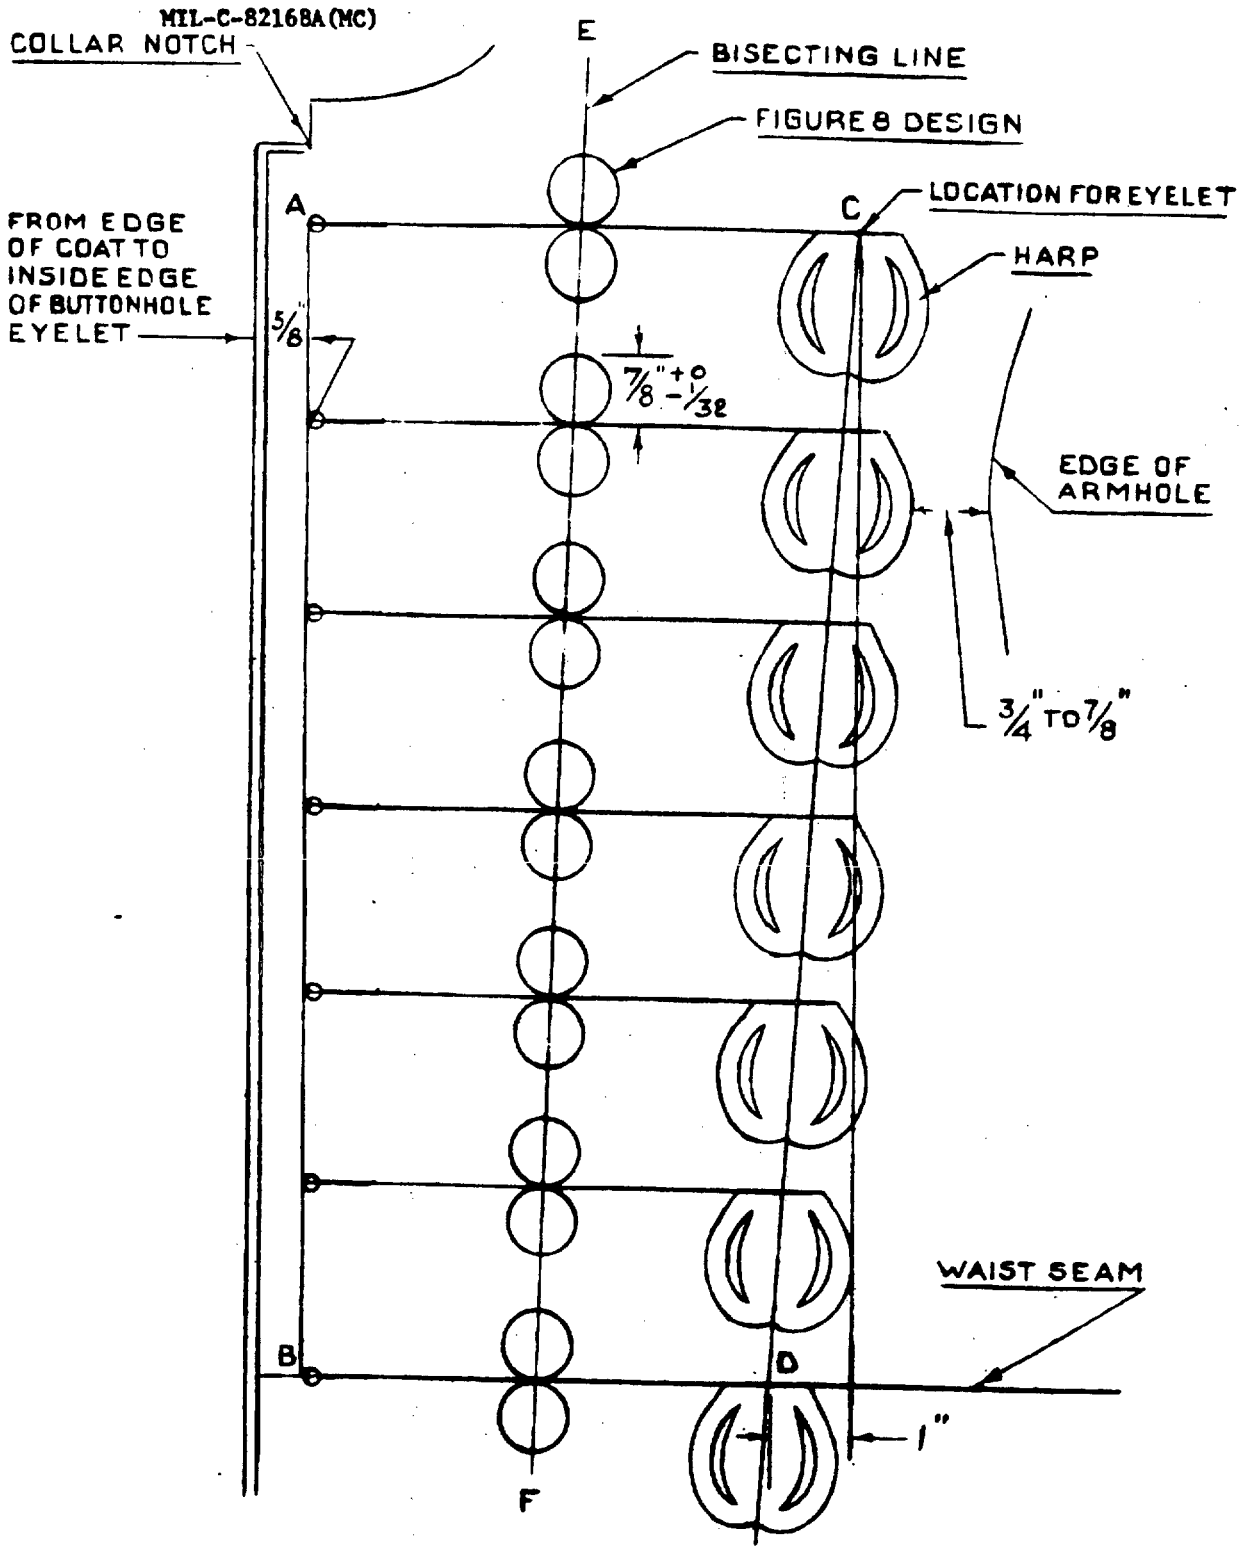


BRAID PLACEMENT DIAGRAM — LEFT FRONT

FIG. 7. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR


M.C.S.A. 826-R&F 26 Apr 74

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

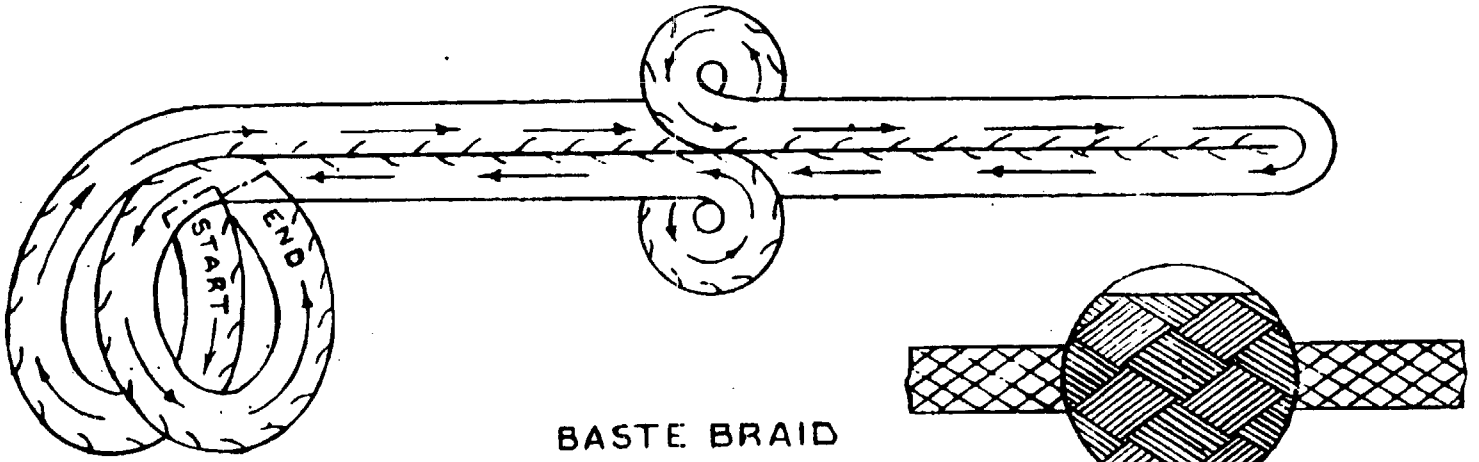

BASTE BRAID

BRAID, GOLD, TUBULAR (DETAIL)

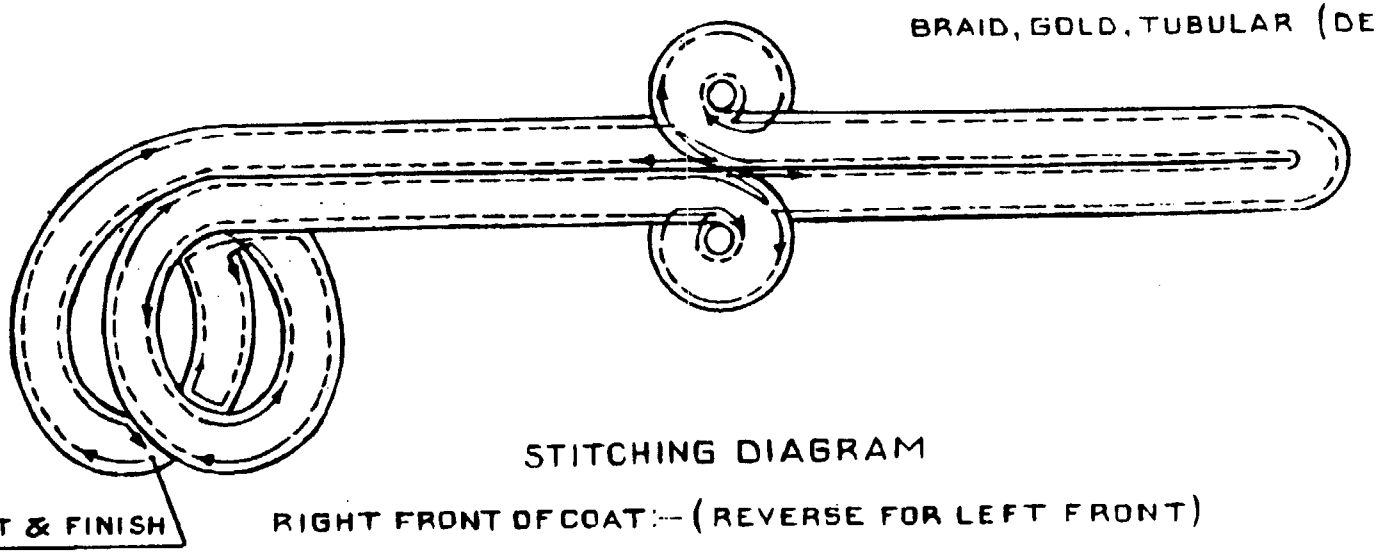

STITCHING DIAGRAM

RIGHT FRONT OF COAT:-- (REVERSE FOR LEFT FRONT)

FIG. 8. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

M.C.S.A. 826 R&F 26 Apr 74

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

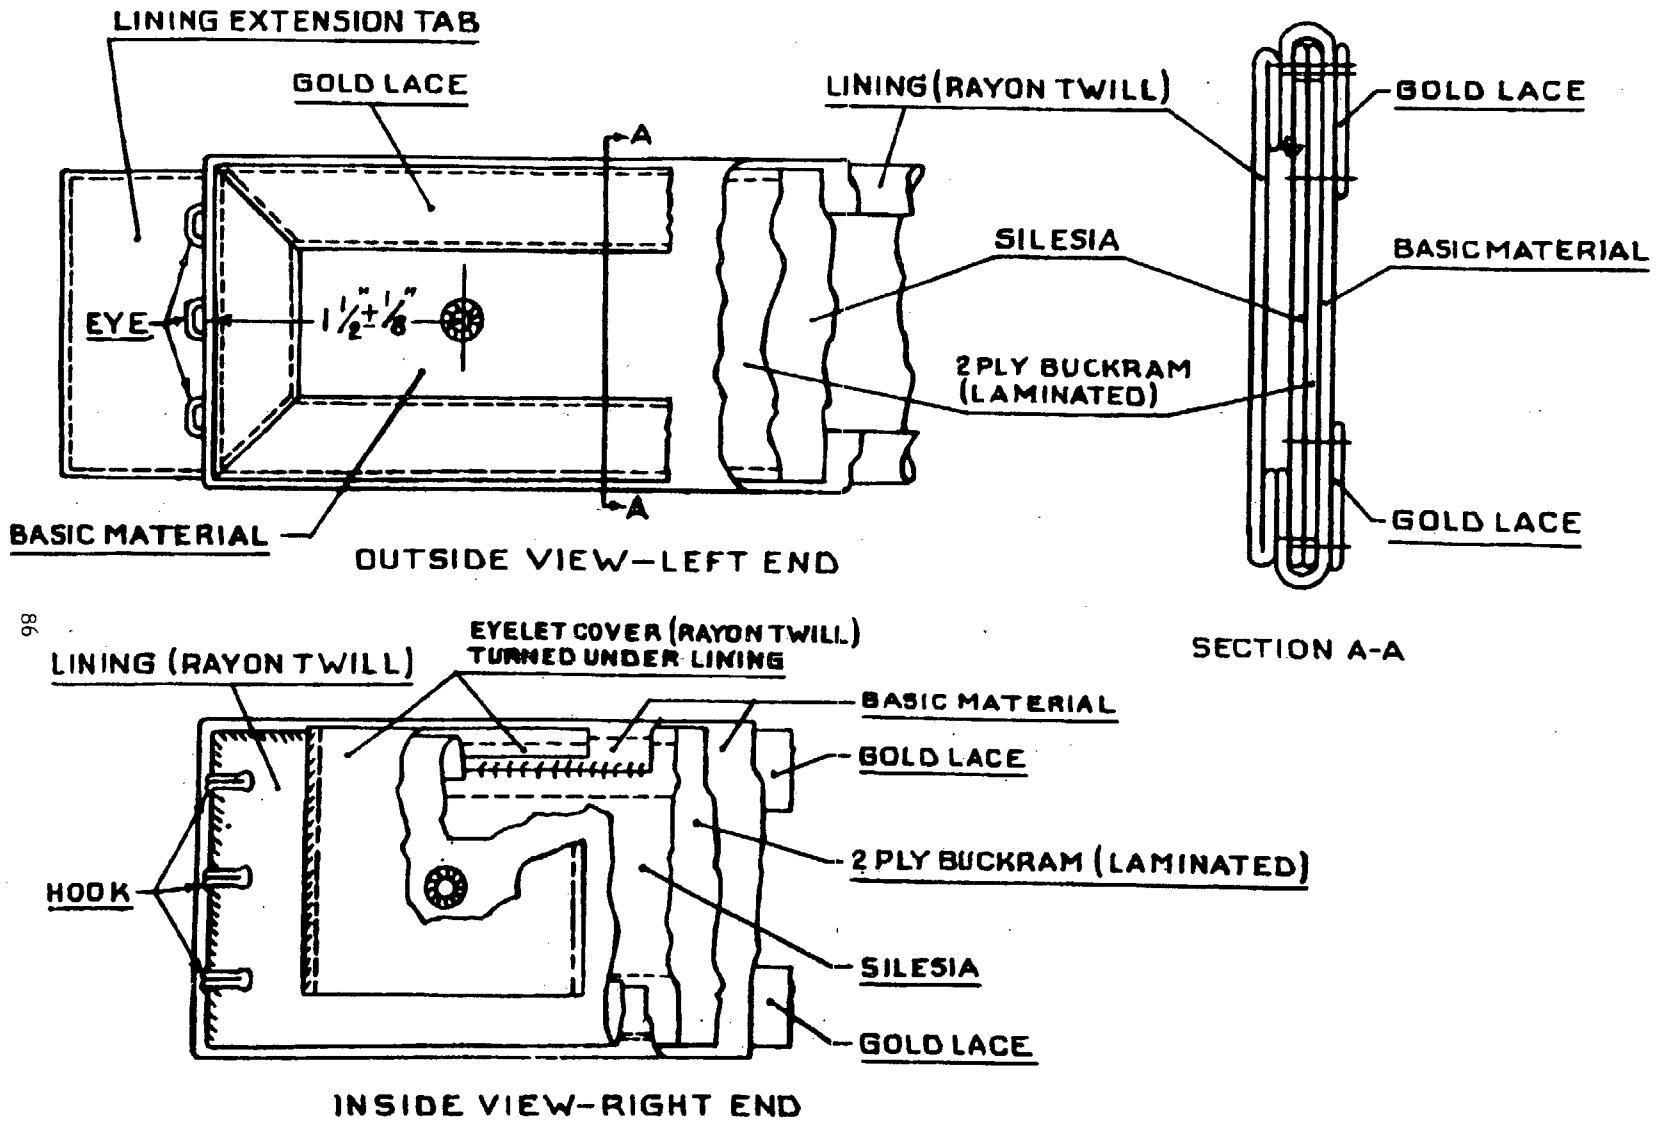


FIG. 9. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

M.C.S.A. 826: R.S.F. 26 Apr 74

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID

DOD-317

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

Commanding General (826)
Marine Corps Supply Activity
1100 South Broad Street
Philadelphia, Pennsylvania 19146

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1426 JAN

REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

S/N 0102-014-1802

GOVERNMENT PRINTING OFFICE: 1972—714-863/3404 2-1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.