INCH-POUND

MIL-C-82168B(MC)
19 June 1995
SUPERSEDING
MIL-C-82168A(MC)
26 April 1974

MILITARY SPECIFICATION

COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET U.S. MARINE BAND, DRUM MAJOR

This specification is approved for use by the U.S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE.

1.1 Scope. This specification covers requirements for drum major, scarlet, wool, summer and winter, full dress coats.

1.2 Classification. The coats shall be of one type in the following class and sizes, as specified (see 6.2):

Class 1: Coat, Full Dress, Summer, Wool, Tropical; Scarlet 2502

Schedule of sizes

(Short, Regular, Long, Extra Long)

34 35 36 37 38 39 40 41 42 44 46

1.3 Individual orders. When the coat is custom tailored to an individual order, this specification shall govern, except that the detailed requirements of section 3, table I, may be modified to the extent necessary for good custom tailoring practice.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commander (PSE-C), Marine Corps Systems Command, Quantico, VA 22134-5010 by using the self addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation (see 6.2).

SPECIFICATIONS

FEDERAL

A-A-50186	- Cloth, Cotton, Buckram
A-A-50196	- Thread, Silk
A-A-50198	- Thread, Gimp, Cotton Buttonhole
A-A-50199	- Thread, Polyester Core, Cotton or Polyester Covered
A-A-52071	- Tape, Textile, Cotton, General Purpose, (Unbleached, Bleached or Dyed)
A-A-52094	- Thread, Cotton
A-A-52097	- Cloth, Wigan, Cotton
A-A-52106	- Cloth, Twill or Plain Weave, Polyester or Polyester Blend
DDD-L-20	- Labels for Clothing, Equipage and Tentage (General Use)

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill Rayon
MIL-B-3461	- Buttons, Insignia, Metal, Uniform and Cap
MIL-P-15064	- Pads, Shoulder and Sleeve Head
MIL-L-17507	- Lace, Ornamental
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/Wool
MIL-C-29405	- Cloth, Broadcloth, Wool and Wool/Nylon
MIL-C-41820	- Cloth, Gabardine, Polyester and Rayon
MIL-C-82114	- Coat Front for Coats, Musicians

STANDARDS

FEDERAL

FED-STD-151	- Metals: Test Methods
FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams, and Stitching

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-105 - Sampling Procedures and Tables For Inspection By Attributes
MIL-STD-129 - Marking For Shipment and Storage

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from the Standardization Documents Order Desk, Building 4D, 700 Robbins Avenue, Philadelphia, PA 19120-5094.)

2.2 Non-Government publications. The following documents form a part of this document to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD adopted are those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issues of the documents cited in the solicitation (see 6.2).

THE COLOR ASSOCIATION OF THE UNITED STATES

Department of Defense Standard Shades for Sewing Threads

(Applications for copies should be addressed to the Color Association of the United States, 409 W. 44th Street, New York, NY 10016-0927.)

AMERICAN SOCIETY FOR TESTING AND MATERIALS

ASTM D 3951 - Standard Practice for Commercial Packaging

(Applications for copies should be addressed to American Society for Testing and Material, 1916 Race Street, Philadelphia, PA 19103.)

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless specific exemption has been obtained.

3. REQUIREMENTS

3.1 Guide samples. Guide samples are furnished solely for guidance and information to the contractor (see 6.4). Variation from the specification may appear in the sample, in which case, the specification shall govern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.2 First article. When specified (see 6.2), contractor shall furnish sample unit(s) for first article inspection and approval (see 4.3 and 6.4).

3.3 Materials.

3.3.1 Basic material. The basic material for the coat shall be as follows:

(a) Class 1 - Cloth, wool, tropical, scarlet shade 2502 (see 6.4), 10.5 ounce, conforming to type I, class 1 of MIL-C-21115.

3.3.2 Lining. The material for lining the coats and collar; for making the underarm shields, collar eyelet cover and coat hanger; and for making the straps to secure the lining to the bottom edge of the coat, shall be cloth, rayon, twill, scarlet 2506 (see 6.3), conforming to class 1, of MIL-C-368.

3.3.3 Cloth, twill or plain weave polyester. The stays for the armhole and shoulder seams and for stitching to the collar interlining, and for binding the neck edge of the coat front interlining shall be cloth, twill or plain weave, natural color, conforming to A-A-52106.

3.3.4 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram, double texture, laminated, starch finish, natural color, conforming to type IV of A-A-50186. The weight of the laminated cloth shall be 21 to 23 ounces per square yard.

3.3.4.1 Plastic. The plastic strip used in the collar interlining shall be clear, plastic pattern stock, 0.020 inch thick. It shall be cut using the cotton buckram pattern.

3.3.5 Reinforcement discs. The reinforcement discs for buttons secured to the back skirt seam with ring toggles, shall be punched from cloth, cotton buckram specified in 3.3.4. The reinforcement discs shall be 7/8 inch in diameter with a 1/8 inch diameter hole at the center.

3.3.6 Coat fronts. The coat fronts shall conform to class 1 of MIL-C-82114.

3.3.7 Shoulder pads. The shoulder pads shall conform to the requirements of type I, class 2, of MIL-P-15064.

3.3.8 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.9 Stay tape. The stay tape for the armholes and waist seams shall be cotton, 1/4 inch wide, conforming to type II, class 1 of A-A-52071, except the requirement for non-fibrous material shall not apply.

3.3.10 Piping. The following materials shall be cut 1-1/8 inches wide for piping the front and bottom edges of the coat and the seams joining the center back to the skirt of the coats:

(a.) Class 1 coat - Cloth, gabardine, polyester and rayon, white 3042 (see 6.4), 6.0 ounce, conforming to type I, class 1, of MIL-C-41820.

3.3.10.1 Vinyl piping. The white vinyl cord for piping the upper edge of the collar shall be tubular with 7/16 inch welt and serrated edges. One acceptable product is sold by the Pearl Binding Corporation of Philadelphia, PA.

3.3.11 Wigan. The material for reinforcing the bottom edge of the sleeves and sleeve ornament shall be cloth, cotton, wigan, 2.5 ounces, conforming to A-A-52097.

3.3.12 Thread.

3.3.12.1 Silk thread. The silk thread shall conform to A-A-50196 as follows, except the requirements for extractable matter shall not apply:

Use	Type	Class	Ticket No.	Ply
Bartacks and all outside seaming and stitching.	I	-	A	-
Machine felling.	-	-	O	-
Making buttonholes in coat.	I	-	B and F	3
Hand felling and hand sewing.	III	3	C	2

3.3.12.2 Cotton thread. The cotton thread shall conform to A-A-52094 as follows:

Use	Type	Ticket No.	Ply
All inside seaming and stitching.	III	A	3
Serging and overedge stitching.	I	70	2
Machine tacking armholes and sewing on buttons.	I	40	3

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

The thread for basting shall be good commercial grade cotton. As an alternate to the cotton thread, a polyester core, cotton or polyester covered thread conforming to A-A-50199, ticket No. 50, 2 ply or ticket No. 70, 2 ply may be used.

3.3.12.3 Color and colorfastness. All thread shall be scarlet, shade W, cable no. 66040, except the silk thread for stitching on the braid shall be yellow; the cotton thread for basting and machine tacking armholes may be white; and the cotton thread for overedge stitching the piping at the bottom edge of class 1 coats shall be white. The colored threads shall show the following colorfastness when tested as specified in the applicable thread specification:

Thread	Color	Wet (Dry) Cleaning	Light
Cotton	Scarlet	Fair	Fair
Silk	Scarlet	Fair	Fair
Silk	Yellow	Good	Good

3.3.13 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be scarlet, shade W, cable No. 66040, and shall show good fastness to wet (dry) cleaning.

3.3.14 Insignia buttons and ring toggles.

3.3.14.1 Insignia buttons. The insignia buttons shall be metal, gold plated, enlisted design, 40-line conforming to type I, style 3, class A, sub-class 1 of MIL-B-3461.

3.3.14.2 Ring toggles. Ring toggles for securing the buttons to the fronts and backs shall conform to MIL-B-3461.

3.3.15 Ornamental braid.

3.3.15.1 Front and sleeve braid. The braid for the front and the sleeves shall conform to the following when tested as specified in section 4, table III:

Cover	
material (covering)	Metal thread
color of wire	Light gold
metal wire (under coating)	Silver and copper
plating material	Gold
winding thread	2 ply white or yellow cotton thread

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Core (stuffer)	
material	Cotton thread (soft)
number of threads	(minimum) 7
ply of thread	(minimum) 2
color	Gold
Weave, plain (braided)	
Number of carriers	(minimum) 12
Ends/carrier	Varies from 6 to 8 (total 79)
Shape	Tubular
Width (inch)	(minimum) 3/8 + 1/16
Weight/Linear yard	(grains) 154.5
Metal content (%)	
gold (minimum)	0.3
silver (minimum)	0.6
copper	Remainder (traces of nickel and zinc)
Fastness to	
water	Good
wet (dry) cleaning	Good

3.3.15.2 Collar gold lace. The gold lace for the collar and the lower stripe of the sleeves shall conform to type II, class 1, style A of MIL-L-17507.

3.3.16 Collar closure hook and eye. The hook and eye for closing the collar shall be brass, black, japanned finish or black chemical finish, followed by a clear lacquer coating and conform to the requirements of Figure 10.

3.3.16.1 Eyelets. The eyelets for the collar shall be brass, rolled flange type, with the barrel scored 6 to 8 scores. The eyelets shall conform to MIL-E-20652, sheet 1A-BE108 and be enameled a black shade.

3.3.17 Labels. Each coat shall have a combined identification/instruction label and a size label conforming to DDD-L-20. The coats are intended to be wet (dry) cleaned and the label shall show fastness to wet (dry) cleaning.

3.3.17.1 Combination identification/instruction label. The combination identification/instruction label shall conform to type VI, classes 1 and 3 (combined) of DDD-L-20, except all printing and the space between lines of printing shall be a minimum of 10 point (approximately 1/8 inch). The content and format shall be as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

NOMENCLATURE_____
CONTRACT NO._____DATE_____
NAME OF CONTRACTOR _____
WOOL PRODUCTS ACT INFORMATION
_____
DRY CLEAN ONLY

3.3.17.2 Size label. The size label shall conform to type VI, class 2, of DDD-L-20. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S (short), R (regular), L (long), or XL (extra long), as shown by the following example:

40 R

3.3.18 Bias Binding. The binding for the underarm shields shall be bias cut of the lining material specified in 3.3.3. The binding shall be 5/8 to 7/8 inch wide. The binding shall have sized edges.

3.4 Design. The coat shall be the U.S. Marine Corps design shown on figures 1 through 3. The coat shall be a semi-formfitting, single breasted, fully lined coat with 14 gold plated insignia buttons on the right front and 7 on the left front. Additionally, it shall have upper fronts with gold braid; skirt type lower body parts; a waist seam; a three piece back with two gold plated insignia buttons at the waist; ornamental sleeve braid; and a stand-up collar with hook and eye for front closure and metal eyelets. The front and bottom edges of the coat, and the seam joining the skirt to the center back, shall be piped with the white cloth applicable as referenced in 3.3.10.

3.5 Patterns. Standard patterns shall be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard patterns. The standard patterns shall provide a 3/4 inch allowance for side seams and the seam joining the skirt to the center back, and a 3/8 inch allowance for all other seams, except as otherwise specified in table I. Standard patterns show size and are marked and notched for proper cutting, placement and assembly of component parts.

3.5.1 List of pattern parts. Coats shall be cut from the materials specified herein in accordance with the pattern parts indicated below:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature	No. of cut parts
	Material basic; Cloth, wool, tropical	
1.	Front, upper	2
2.	Skirt (lower body part) Front	2
3.	Skirt (lower body part) Back	2
4.	Side body (front)	2
5.	Front facing, right	1
6.	Front facing, left	1
7.	Center back	1
8.	Side back	2
9.	Top sleeve	2
10.	Under sleeve	2
11.	Collar	1
12.	Underarm shields	2
	Cloth, rayon lining	
13.	Front, upper	2
14.	Top sleeve	2
15.	Under sleeve	2
16.	Skirt (lower body lining) Front	2
17.	Skirt (lower body lining) Back	2
18.	Center back	2
19.	Side back	2
20.	Collar lining	1
21.	Collar eyelet cover	2
	Cloth, Twill or plain weave, polyester or polyester blend	
22.	Collar interlining	1
	Mylar plastic	
23.	Collar interlining	1
	Cloth, cotton, buckram	
24.	Collar interlining	1
	Cloth, cotton, wigan	
25.	Sleeve and ornamental reinforcement	2
	Marker	
26.	Sleeve braid	-

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.6 Construction.

3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in table I.

3.6.1.1 Operations. The contractor is not required to follow the exact sequence of the operations as listed in table I, but all operations specified shall be used to manufacture the coats.

3.6.1.2 Stitches, seams, and stitchings. The stitch, seam, and stitching types specified in table I shall conform to FED-STD-751. The number of stitches per inch as specified in table I indicates the minimum and maximum number permitted. All overedge stitching shall be done on serging machines with a knife attachment properly set to trim the raveled edge without cutting the material.

3.6.1.2.1 Tacking and backstitching. Ends of all seams and stitching (stitch type 301), except ends of a continuous line of stitching, when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch. The ends of a continuous line of stitching shall be overlapped not less than 1/2 inch. Thread breaks shall be secured back of the break not less than 1/2 inch.

3.6.1.3 Shade marking. The component parts shall be cut from one piece of the applicable wool materials and lining material, including pairs of sleeve linings and underarm shields when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Any method of shade marking may be used except:

a. Corrosive metal fastening devices.
b. Sew-on shade tickets.
c. Adhesive type tickets which show discoloration and the adhesive mass which adheres to the material upon removal of the tickets.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. a. Cut coats in strict accordance with the patterns furnished by the Government. b. Cut all materials in the direction of the warp as indicated by the directional lines on the patterns. c. Cut all scarlet wool parts of the coat from one piece of the applicable material (see 3.3.1). d. Cut the body and collar linings, the collar eyelet covers, and the top ply of the underarm shields, from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the lining shall match. Cut the strips for the coat hanger and lining securing straps 1-1/8 inches wide. e. Cut twill or plain weave polyester or polyester blend stays for the armhole and shoulder seams on the bias 3/4 inch wide and 4 ± 1/4 inches long. Cut the cloth for binding the neck edge of the coat from					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
1	Cutting. (cont'd) interlining, on the bias, 3/4 inch wide and approximately 5 inches long. Cut the cloth for the collar interlining in accordance with the pattern furnished. f. Cut wigan for the sleeve bottom and sleeve ornament on the bias in accordance with the pattern. g. Cut the cotton buckram and plastic strip for interlining the collar on the straight in accordance with the patterns furnished. h. Cut the material (see 3.3.10) for piping the front and bottom edges of the coat, and the seam joining the skirt to the center back, on the straight. The piping shall be cut 1-1/8 inches wide. i. Punch the reinforcement disc for buttons secured to the skirt back seam from cloth, cotton, buckram. The reinforcement disc shall be 7/8 inch in diameter with a 1/8 inch diameter hole at the center.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
2	Replacement of damaged parts. a. At the time of cutting, replace any part of the coat containing holes; seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, etc. expected to develop into holes, shade bars, and dye streaks; or unsightly slubs, etc., affecting appearance. b. Replace any part damaged during manufacturing process by needle chews which may develop into holes, scissors or knife cut, tears, holes, mends, or burns in the material, affecting appearance.					
3	Shade marking. a. Mark or ticket all component parts (see 3.6.1.3) cut from one piece of the wool material. Mark or ticket all component parts cut from one piece of rayon lining material and the pairs of sleeve linings when cut from ends. b. The use of tickets with any metal fastening devices is prohibited on the rayon lining.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
4	Make coat hanger and lining securing straps.					
	Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8 inch wide strip of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	12-16	A	A
	b. Cut the coat hanger 3-3/4 ± 1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ± 1/4 inches long.					
5	Make collar eyelet covers.					
	Finished appearance. The collar eyelet covers shall finish 1-3/4 ± 1/8 inches wide.					
	a. Turn under the side edges of the collar eyelet cover and stitch 1/8 inch from the folded edges, catching the turned under portions in the stitching.	301	EFa-1 (each side edge)	12-16	A	A
	b. Fold each cover in half, across the width and seam 1/16 inch from the folded side edges.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Make collar. Finished appearance. The completed collar shall finish smooth and flat without distortion. Edges shall be uniformly even. a. The collar shall be made of one ply of basic material, lining, twill or plain weave polyester and cotton buckram and one ply of mylar plastic.					
	b. Seam the plastic, polyester and cotton buckram together 1/8 to 3/16 inch from all edges and trim the polyester even with the edges of the buckram. The polyester cloth shall be positioned on the inside and the plastic (mylar) on the outside.	301	SSa-1	12-16	A	A
	c. Lap the upper edge of the polyester side of the interlining approximately 1/2 inch to the upper edge of the outer ply. Seam together 1/4 inch from the raw edge of interlining. The outer ply shall extend not less than 3/4 inch at each end.	301	LSa-1	12-16	A	A
	d. Smoothly fold the outer ply over the lower and upper edges of the interlining. Tack the outer ply, folded to the inside, at the lower edges of the polyester from end	Hand		2-3		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
6	Make collar. (cont'd)					
	to end. Stitching shall not pass through the outer ply of the collar.					
	e. Fold the ends of the outer ply to the inside of the interlining and tack to the polyester with overcast stitching, turning under the upper and lower edges sufficiently, so as not to be visible in the finished collar.	Hand		2-3		
7	Baste gold lace to collar (See Figure 4).					
	a. Baste the lace to the collar with the outer edges of the lace 1/8 inch from all edges. Baste the lace on both edges with the top and bottom strands of lace folded over the end strands. Beginnings and ends of lace shall be at a corner.	Hand		2-6		
	b. Baste down the folded edge of the turned corners of the lace to the lace along the end of the collar.	Hand		2-6		
	c. Position and baste the ends of the lace at the corner in such a way that the lace shall seem continuous without a break.	Hand		2-6		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8	Stitch gold lace to collar and pipe upper edge. Finished appearance. The finished lace shall be smooth, flat, firmly attached, uniformly positioned, and uniformly stitched. Raw edges and loose threads shall not be visible.					
	a. Stitch the lace to the collar, 1/16 inch from both edges of the lace, along the folded edges at the corners. Lace may be stitched without basting, provided the proper appearance and neatness requirements are maintained.	301	SSaa-2 (strands) OSe-1 (corners)	12-16	A	A (Silk)
	b. Press the collar smooth and flat, shrinking where necessary.					
	c. Position the collar on the vinyl cord, with the upper edge of the collar abutted against the cord edge. Stitch collar to the vinyl cord 1/16 inch from the edge of collar. Trim the ends even with the ends of the collar.	301	LSa-1	10-14	A	A (Silk)
	d. Position the eyelet cover on the underside at each end of the collar, with one edge of the cover 3/4 to 7/8 inch from the front end, and the bottom raw edge of the cover 1/2	301	SSa-1	10-14	A	A (Silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
8	Stitch gold lace to collar and pipe upper edge. (cont'd)					
	to 5/8 inch from the upper cord edge. Stitch collar to cover along the cord edge adjacent to the stitching line of the collar.					
	e. Lap the upper cord edge of collar over the top raw edge of collar lining approximately 1/2 inch with the lining face up. Stitch collar to lining and eyelet cover along the cord edge adjacent to the stitching line of the collar. The stitching shall extend not less than 1/2 inch from end of collar.	301	SSa-1	10-14	A (Silk)	A
	f. Turn the collar lining and eyelet cover at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine.					
9	Stitch lining to collar.					
	Finished appearance. Stitches attaching the lining to the collar shall be uniform and a minimum of 1/16 inch from the edge of the collar.					
	a. Lap the upper edge of the collar over the top	301	SSa-1	12-16	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
9	Stitch lining to collar. (cont'd) raw edge of the collar lining, approximately 1/2 inch, with the lining facing up. Stitch the collar to the lining and eyelet cover along the upper edge adjacent to the stitching line of the collar braid. The stitching shall extend from center to center of the eyelet covers. b. Turn collar lining and eyelet covers at the seam to the inside of the collar. Press smooth and flat with a heated pressing iron or pressing machine.					
10	Make collar extension tab. Finished appearance. The collar extension tab shall finish smooth and flat without twists, puckers, pleats, or distortions. The stitching shall be uniform gage. a. Turn the top and bottom edges, and the end of the collar lining at the left end of the collar, to the outside of the lining. Baste the turned portion along the top, front, and bottom edges to the body of the lining, forming the collar extension tab.	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
10	Make collar extension tab. (cont'd)					
	b. Stitch the collar extension tab 1/16 inch from the top, front, and bottom edges. Continue the stitching at the back of the tab to the top row, forming a 1-1/8 inch wide box stitch. The finished tab shall extend 3/4 to 7/8 inch beyond the finished front edge of the collar.	301	SSe-1 (top and bottom) OSf-1 (front edge) SSa-1 (back edge)	12-16	A (Silk)	A
	c. Attach metal eyelets through all plies of the collar, midway between the upper and bottom edge and 1-1/2 ± 1/8 inches from the folded end of collar.					
11	Stitch and press dart in under sleeves.					
	a. Fold the under sleeve, matching the cut edges of the sleeve darts. Stitch the entire length of the dart, 1/4 inch from the cut edges of the armhole, tapering the line of stitching to zero at the lower folded edges.	301	SSa-1 (cut edge) OSf-1 (folded edge)	12-16	A	A
	b. Spread open the cut edges of the dart and turn the lower folded edge flat against the body of the undersleeve. Press the entire dart smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
12	Seam sleeve at forearm. Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Position the top sleeve with the upper forearm edge in line with the notch in the armhole edge of the undersleeve. The notches in the lower forearm edge of the top and under sleeve shall match. Seam the top and undersleeve together, 3/8 inch from forearm edge of top sleeve, forming a tapered outlet on the undersleeve.	301	SSbd-1 to SSa-1	12-16	A	A
	b. Spread open the seam and press flat with a heated pressing iron.					
	c. Mark the sleeve end for turn up. Mark the sleeves for positioning the braid with the pattern marker.					
13	Baste wigan reinforcement to sleeve. Finished appearance. The wigan shall be positioned and attached to provide reinforcement and body to the end of the sleeve and sleeve ornament without causing distortions of the sleeve end.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
13	Baste wigan reinforcement to sleeve. (cont'd)					
	a. Position the sleeve on the wigan with marks and notches matching as indicated by the pattern.					
	b. Tack the left and right sleeves to the reinforcement piece along the forearm seam allowance of the top and undersleeve seam allowance respectively.	Hand or 101 or 301				
	c. Baste the sleeve and reinforcement piece together at the mark for the bottom turnup.	Hand or 101				
	d. The reinforcement piece shall extend across the entire width of the sleeve and under all braid.					
14	Attach braid to sleeve (See Figure 5).					
	Finished appearance. The design formed by the braid and lace shall be symmetrical, and firmly and uniformly attached. The lower stripe on the sleeves shall be from the gold lace specified in 3.3.15.2.					
	a. Baste the braid and lace to the sleeve following the markings and flow indicated.	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
14	Attach braid to sleeve (see Figure 5). (cont'd)					
	b. Stitch the braid and lace to the sleeve. Stitches shall be 1/16 inch from each edge, and shall not cross the braid strands. Stitching points 1 to 6 (see Figure 5) are optional and the directional arrows may be reversed. The braid may be stitched without basting, provided the requirements are met.	301	SSa-2	12-16	A (Silk)	A
15	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat, without distortions, and shall start and finish evenly.					
	a. Join the top and undersleeve together at the backarm with a 3/8 inch seam, catching the ends of the wigan reinforcement piece and the braid in the stitching.	301	SSa-1	12-16	A	A
	b. Spread open the seam and press smooth and flat with a heated pressing iron.					
16	Tack sleeve turnup to reinforcement.					
	a. Turn up the bottom edge of the sleeve and baste.	Hand or 101				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
16	Tack sleeve turnup to reinforcement. (cont'd)					
	b. Tack the raw edge of the turned under portion to the reinforcement wigan piece with blindstitching.	301 or Hand or 103	EFc-1 (b)	4-6 4-6 4-6	A A	A
17	Stitch and press dart in undersleeve lining.					
	a. Fold the undersleeve lining, matching the cut edges of the undersleeve darts. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole, tapering the line of stitching to zero at the lower folded edge.	301	SSa-1 (cut edges) OSf-1 (folded edges)	12-16	A	A
	b. Turn the cut edges of the dart toward the forearm edge and press the entire dart smooth and flat with a heated pressing iron.					
18	Seam sleeve linings at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats, and shall start and finish evenly.					
	a. Position the top sleeve lining with the upper forearm edge in line with the notch in the armhole edge of	301	SSbd-1 to SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
18	Seam sleeve linings at forearm. (cont'd)					
	undersleeve lining. The notches in the lower forearm edge of the top and undersleeve linings shall match. Seam the top and undersleeve lining together, 3/8 inch from the forearm edge of the top sleeve lining, forming a tapered outlet on the undersleeve lining.					
19	Seam sleeve lining at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat, without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Join the top and the undersleeve linings at the backarm with a 3/8 inch seam.	301	SSa-1	12-16	A	A
20	Assemble sleeve and sleeve lining.					
	Finished appearance. The lining shall be seamed to the sleeve without twists, gathers, puckers, or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of the lining extending 1 inch beyond the armhole edge of the sleeve.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
20	Assemble sleeve and sleeve lining. (cont'd.)					
	b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the top sleeve, commencing at the top edge of wigan reinforcement piece and extending to approximately 6 inches from the armhole edge at the backarm and approximately 4-1/2 inches from armhole edge at the forearm.	301 or Hand	SSa-1	4-6 1-2	A	A
	c. Turn the sleeve linings right side out.					
21	Fell turnup of sleeve lining.					
	Finished appearance. The sleeve lining shall not be short, tight, or twisted at the bottom of the sleeves.					
	a. Turn under the bottom edge of the sleeve lining, to finish 1 to 1-1/4 inches above the finished end of the sleeve, and baste to the turnup of sleeve; or the sleeve lining may be felled to the bottom of sleeves without basting.	Hand or 101				
	b. Fell the folded edge of the sleeve lining to the turnup of the sleeve with blindstitching.	301 or Hand	EFc-1 (b)	6-8 8-10	O (Silk) C (Silk)	O

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
22	Press sleeves.					
	a. Turn the sleeves right side out and assemble in pairs. Remove the basting at the lower end of the sleeve and press the lower half of sleeves smooth and flat, creasing at the forearm and backarm. The backarm crease shall be on the backarm seam.					
23	Make underarm shields.					
	Finished appearance. The shields shall finish smooth and flat without puckers, pleats, gathers, or other distortions.					
	a. Position the two plies of the material for the underarm shields with edges even. Seam the two plies together along the curved side and bottom edges 3/8 inch from the edges.	301	SSa-1	12-16	A	A
	b. Turn the shield right side out, working out completely the seamed edges.					
	c. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
24	Assemble body lining.					
	Finished appearance. All darts and joining seams shall finish smooth and					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24	Assemble body lining. (cont'd) flat without pleats, puckers, or gathers. The seams shall start and finish evenly. a. Each lining assembly shall consist of an upper front, a side back panel, a center back panel, and a two piece lower skirt panel.					
	b. Fold the upper fronts, matching the notches. Seam the waist dart with a 3/8 inch seam at the lower end of the waist dart, tapering to zero at the upper end.	301	SSa-1 (cut edge) (folded edge)	12-16	A	A
	c. Fold the underarm dart in front and seam with a 3/8 inch seam at the center, tapering to zero at the upper and lower ends.	301	OSf-1	12-16	A	A
	d. Position the side back panel and fronts with edges even and notches matching. Seam together at the side with 3/4 inch seam.	301	SSa-1	12-16	A	A
	e. Position the center back panel and side back panel with edges even and notches matching. Join together with a 3/8 inch seam.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
24	Assemble body lining. (cont'd)					
	f. Overedge stitch separately the side seams. The side back seams shall be overedge stitched together.	503 or 504	EFd-1	6-10 6-10	70/2 70/2	70/2 70/2
	g. Position the lower front and back skirt panels together at side seams and join with a 3/4 inch seam. This seam to be pressed open and overedge stitched separately.	301	SSa-1	6-10	70/2	70/2
	h. Position edges of the body lining and skirt lining, with fronts even. Join together at the waist with a 3/8 inch seam.	301	SSa-1	10-14	A	A
	i. Overedge stitch the entire waist seam allowance with all joining seams caught in the stitching.	503 or 504	EFd-1	6-10	70/2	70/2
	j. Press all seams smooth and flat. The waist seam shall be pressed toward the bottom and the remaining seams toward the front. The side seams shall be pressed open.					
25	Seam wool facing to lining assembly.					
	Finished appearance. The lining shall be carefully aligned and seamed to the facing so that, in the					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
25	Seam wool facing to lining assembly. (cont'd)					
	finished coat, the lining shall lie smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defects or distortions.					
	a. Position the lining on the wool facing with the top edges even.					
	b. Seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from the top edge of the facing to approximately 1-1/4 inches from the bottom edge.	301	SSa-1	12-16	A	A
	c. Overedge stitch together the facing lining seam allowance. The overedge stitching shall be securely caught in the fabric.	503 or 504	EFd-1	6-10	70/2	70/2
26	Sew on identification/ instruction label.					
	Finished appearance. The label shall be positioned so that in the finished coat, the label shall be midway between the front and back edge of the right facing. The bottom edge of the label shall be approximately 4 inches					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
26	Sew on identification label. (cont'd) from the bottom finished edge of the coat.					
	a. Sew the label to the outside of the right facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge)	12-16	A	A
27	Make outer assembly. Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers, or gathers. The seams shall start and finish evenly.					
	a. Each outer assembly shall consist of an upper front, side body (front), side back, and lower front and back body part (skirt).					
	b. Fold the upper fronts, matching the cut edges of the waist dart. Stitch the entire length of the dart, 3/8 inch from the cut edges at the lower end, and tapering to a point at the upper end.	301	SSa-1	12-16	A	A
	c. Position the upper front and side body panel with edges even. Join together with a 3/8 inch seam.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
27	Make outer assembly. (cont'd)					
	d. Position the side back and side body with edges even and notches matching. Seam together at the side with a 3/4 inch seam.	301	SSa-1	12-16	A	A
	e. Spread open the waist dart and the underarm and side seams. Press flat with a heated pressing iron.					
	f. Overedge stitch the waist dart, underarm seam, and side seam.	503 or 504	EFd-1	6-10	70/2	70/2
	g. Join the lower front and lower back skirt parts at the sides with a 3/4 inch seam.	301	SSa-1	12-16	A	A
	h. Press the seam open and overedge stitch the raw edges of the seam separately.					
	i. Position the upper assembly and the skirt, assembly with edges even. The back edge of the side back shall be positioned 3/8 inch from the back edge of the skirt as indicated by the notch at the top of the waist of the skirt. Join together at the waist with a 3/8 inch seam and with the 1/4 inch stay tape positioned on the upper assembly 1/4 inch from the upper edge and caught in the	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
27	Make outer assembly. (cont'd)					
	stitching.					
	j. The tape shall be sewn with normal tension, not loose or tight. It shall extend from the side back seam to not more than 3 inches from the front edge of the fronts. Spread open the waist seam and press flat with a heated pressing iron.					
	k. Overedge stitch the entire waist seam allowance separately from end to end.	503 or 504	EFd-1	6-10	70/2	70/2
	l. Press and shape the fronts on a suitable type heated pressing machine. Shrink the fronts to eliminate the excess fullness of the chest.					
28	Pipe skirt (See Figure 6).					
	Finished appearance. The finished piping shall be of uniform width, without twists, puckers, pleats, or distortions. The piping shall extend along the back edge of the skirt.					
	a. Fold 1-1/8 inch wide piping in half lengthwise. Seam the piping 1/8 inch from the folded edge.	301	OSf-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
28	Pipe skirt (See Figure 6). (cont'd)					
	b. Serge or overedge stitch the raw edges of the piping together.	503 or 504	EFd-1	6-10 6-10	70/2 70/2	70/2 70/2
	c. Mark along the back edge of the skirt for the positioning of the piping. The mark line shall be 7/8 inch from the back edge and shall extend from the top to the bottom of the skirt.					
	d. Position the folded edge of the piping on the mark line. Stitch the piping to the skirt 3/16 to 1/4 inch from the folded edge of the piping. The piping shall finish with a minimum of 1/2 inch excess at the top end to give a neat finish. In the finished coat, the folded edge of the piping shall extend 1/8 inch beyond the seam.	301	SSa-1	10-14	A	A
29	Join center back to side back and skirt.					
	Finished appearance. The back seams shall start and finish evenly and shall be smooth without gathers, pleats, or puckers.					

Source: https://assist.dla.mil -- Downloaded: 20261O-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
29	Join center back to side back and skirt. (cont'd)					
	a. Position and join the left and right assemblies to the center back with a 3/8 inch seam down to the waistseam, and with a 3/4 inch seam from the waistseam to the bottom of the coat.	301	SSa-1 (above waistseam) LSaj-1 (below waistseam)	12-16	A	A
	b. Spread open the back seams from the armholes to the waistseam and press smooth and flat. Press skirt back seams, from waistseam to the bottom of the coat, smooth and flat with edges of each seam toward the center back. Pressing shall be done with a heated pressing iron or pressing machine.					
	c. Overedge stitch the raw edges of the back seams.	503 or 504	EFd-1	6-8	70/2	70/2
30	Seam reinforcement stay to shoulder and armhole.					
	Finished appearance. The reinforcement stays shall be sewn to the armhole and shoulder edge of the front without gathers, puckers, or pleats. The top end of the armhole stay and lower end of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
30	Seam reinforcement stay to shoulder and armhole. (cont'd)					
	a. Seam the 3/4 inch wide stays to the underside of the front along the shoulder edges and upper front edge of the armhole, respectively, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from the neck and armhole. The strip for the upper edge of the armhole shall be positioned approximately 1/2 inch from the shoulder.	301	SSaa-1	10-14	A	A
31	Mark and dress left front.					
	a. Mark and shape the left front edge of the coat from the top notch to the waist seams. The mark line shall be 1 inch from the upper front edge to 1-1/8 inches at the waist seam. Continue on the straight line from the waist seam to the notch at the bottom of the skirt.					
	NOTE: The dressing and shaping of the left front shall be performed in the sewing room.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
32	Tape armholes. a. Sew the cotton tape to the armhole. Start with one end from approximately 1 inch above the notch in the fronts and continue along the lower and back edge of the armhole to approximately 1/2 inch from shoulder edge. b. The tape shall be stitched with slight tension along the lower front edges of the armholes and shall be held taut while stitching along the back edge.	301	SSaa-1	12-16	A	A
33	Press shoulder blades and armhole tape. a. Press the shoulder blades and the armhole tape smooth and flat with a heated pressing iron or suitable type pressing machine.					
34	Stitch piping to coat. Finished appearance. The piping shall be uniformly stitched to the coat without twists, puckers, or pleats. The piping shall extend from the collar notch at the top edge of the right front to the collar notch at the top edge of the left front.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34	Stitch piping to coat. (cont'd)					
	a. Position the 1-1/8 inch wide strip of piping material on the outside of the left and right front, with one edge even with the top, front, and bottom edges of the coat. Stitch the piping to the coat 1/8 inch from edge. The piping shall extend from the collar notch at the top, along the left and right front, and the bottom edge of the coat.	301	SSa-1	10-14	A	A
	b. Turn the piping to the inside, working out the folded edge of piping 1/8 inch beyond the edges of the coat. Topstitch the coat to the piping, 3/16 inch from the folded edge of the piping, catching the turned under portion of the piping in the stitching.	301	SSe-2 (b)	10-14	A (Silk)	A
	c. Notch out the excess piping material at the top and bottom front corners to eliminate bulkiness. Trim the inner edge of piping on the left front only from the upper front down to approximately 1 to 1-1/2 inches below the waistseam, so that the piping will not interfere with the front buttonholes.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
34	Stitch piping to coat. (cont'd)					
	d. Serge stitch the raw edge of the piping at the bottom edge.	503 or 504	EFd-1 EFd-1	6-8 6-8	70/2 70/2	70/2 70/2
35	Interline fronts.					
	a. Position the left and right fronts on the respective coat front interlinings. Baste the interlinings and fronts together, from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom edge of the front.	301 or Hand	Hopper			
	b. Baste along the shoulder. Allow room for setting the shoulder pad and work the fullness towards the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge. Continue to baste down the back edge of the interlining, across the waist dart, to approximately 2 inches from the bottom edge of the fronts. Baste along the top edge from the basting stitches for the shoulders to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge of the bottom edge of the fronts.	301 or Hand	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
36	Trim coat front interlining. a. Trim the top edge of the coat front interlining even with the top edge of the fronts from the point of the shoulder to the collar notch. b. Notch the top edge of the interlining in line with the collar notch. c. Remove the stitches joining the front edge of polyester to the coat front interlining, approximately 1/2 inch back from the front and top edge of the fronts. d. Turn the coat inside out and trim the interlining approximately 1/4 inch back from the front and top edge of the fronts. e. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from the shoulder at the armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					
37	Bind front edge and gorge of interlining. a. Fold polyester back and over the top and front raw edge of the interlining. Stitch	301	EFa-3	8-12	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
37	Bind front edge and gorge of interlining. (cont'd)					
	along the top and front edge with three rows of stitches, 1/4 inch apart, placing the first row 1/8 inch from the folded front edge and catching the turned under portion in the stitching.					
38	Bind top neck edge of interlining.					
	Finished appearance. The polyester binding shall be uniformly stitched along the gorge of the coat front interlining from the collar notch to the shoulder point.					
	a. Lap the 3/4 inch wide strip of binding on the outside of the coat front interlining, from the collar notch to shoulder point, approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	8-10	A	A
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
39	Fell piping to coat front interlining.					
	a. Place the inner edge of the piping on the outside of the interlining at the top, front, and bottom edges. Baste the piping to the interlining through the fronts.	101				
	b. Fell the upper front and lower inner edge of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A C (Silk)	A
	c. Pull and remove basting stitches from the piping.					
	d. Press the left and right fronts on a suitable type heated pressing machine, with the chest to conform to the shape of the body.					
40	Mark fronts for positioning the braid and buttonholes (See Figure 7).					
	a. Mark the location of seven buttonholes on the outside of the left front, as shown on Figure 7. The top buttonhole (line A) shall be positioned 1 inch below the upper piped edge, and 5/8 inch from the front piped edge. The lower buttonhole (line B) shall be on the waistseam and 5/8 inch from the front piped edge. The					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40	Mark fronts for positioning the braid and buttonholes (See Figure 7). (cont'd) remaining five buttonhole marks shall be evenly spaced. b. Extend each buttonhole line towards the back and armhole edge. Line B shall be 1 inch shorter than line A. The length of the top and bottom line is determined by the position of the harp on the second line from the top which shall be approximately 1-7/8 inches from the armhole edge to the center of the harp. Measure the second line from the front edge of the buttonhole line to the center of the harp. Transfer the same measurement to the bottom line less 1 inch. Draw a straight line from the bottom line through the center of the harp up to the top line, establishing line A-C and B-D as shown on Figure 7. c. Bisect the top line A-C and bottom line B-D and connect the bisecting points with a straight line E-F. d. Position the left front of the coat on the right front, face to face,					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40	Mark fronts for positioning the braid and buttonholes (See Figure 7). (cont'd) with the collar notches even and the left front edge 1 inch back of the right front edge at the collar notch; the waistseam and armhole edges shall be even. e. Trace the seven lines on the right front to coincide with the lines on the left front; the lines on the right front shall extend 3/4 to 1 inch from the front piped edge. The vertical lines on the right front shall be identical to the lines C-D and E-F on the left front. f. Draw a circle 7/8 ± 1/32 inch in diameter on each side of the seven horizontal lines. Center it to bisect line E-F, with the edge of each circle touching the horizontal line forming a figure 8 design as shown on Figure 7. g. Position the center of the harp pattern at line C-D, with the upper edge of the pattern positioned at the bottom side of each horizontal line. Mark the harp in accordance with the pattern marker. The bottom edge of the harp					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
40	Mark fronts for positioning the braid and buttonholes (See Figure 7). (cont'd) must not be less than 1/2 inches from the line beneath.					
41	Baste braid (See Figure 8). a. Baste the braid by hand along each side of the horizontal lines, around the circle figure 8 design, and around the harp. The braid shall begin and end at the harp with both ends of the braid secured and tacked under the horizontal braid. On the left front, the braid shall be basted around the buttonhole line. The outer edge of the braid shall finish approximately 1/4 to 3/8 inch from the piped front edge.					
	b. Begin with the cut end of the braid even with the straight line at the top of harp. Baste the braid along its forward edge, down the center of the harp to the forward edge of the harp center. Continue up the backarm, along the back edge of the harp, to the straight line at the top, using the same edge of the braid.	Hand		2-6	C (Silk) Gold	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
41	Baste braid (See Figure 8). (cont'd)					
	c. Baste the bottom edge of braid along the straight line to the circle. Follow the circle back to the straight line and continue to the end of the straight line.	Hand				
42	Tack braid.					
	a. Securely tack all unattached edges of braid to provide a smooth, secure, and flat surface of stitching.	Hand		2-6	C (Silk) Gold	
	b. Tack inside edges of braid circles to coat, forming an inner hole approximately 1/4 inch in diameter.	Hand		2-6	C (Silk) Gold	
	c. Tack loops at the button edge of the coat together to the coat to finish secure and flat.	Hand		2-6	C (Silk) Gold	
43	Stitch braid (See Figure 6).					
	Finished appearance. All stitching shall be done 1/16 inch from all edges whenever possible. All stitching shall be uniform. All stitching shall be performed with one continuous thread whenever possible. Stitching across braid strands shall be done only					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
43	Stitch braid (See Figure 6). (cont'd) as prescribed or when absolutely necessary. All edges of the braid shall be securely attached to the coat at all points. The braid and the stitching shall present a smooth, neat, and uniform appearance. Only the braid on the left front shall be unstitched for approximately 3 inches from the front end of the buttonhole loop braid.					
	a. Stitch the braid through the fronts and interlining on both sides of the braid 1/16 inch from the edge. The line of stitching shall start and finish at the harp as shown on Figure 6.	301	SSa-1	10-14	A (Silk) Gold	A
	b. Braid may be stitched without basting, provided the requirements previously mentioned are maintained.					
	c. Hand stitch the inner edges of the horizontal braid together on both fronts from the harp ends to the end of the buttonhole opening on the left front and from the harp ends to the front end of the braid on the right front.	Hand		8-10	C (Silk) Gold	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
44	Join facing to fronts. a. Position the left and right fronts to the respective front facings (face to face), with the waistline seam of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of the facing. Mark along the top, front, and bottom edges of the facing.					
	b. Lap the front edge of the right and left fronts on the outside of the facing at the marks. Join the front to the facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend from the top to the bottom edge of the coat front edge only.	301	LSa-1	12-16	A	A
	c. Trim excess facing material where necessary.					
45	Baste front edges. a. Turn the facing-lining assemblies to the inside of the fronts, completely working out the corners.					
	b. Baste along the front edge of the left and right fronts, working the facing back from the folded edge of the piping.	101				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
46	Baste facing (second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front, and bottom edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 301	Hopper			
	b. Turn under and baste the top edge of the facing even with the fronts from the collar notch to the front edge, catching the turned under portion of the facing in the basting.	Hand or 301	Hopper			
	c. Baste the facings to the fronts as close as possible to the facing-lining seam. Place the fullness over the chest and distribute the fullness in the facing in accordance with good commercial practice. The basting shall extend from approximately 3 inches from shoulder edge of the facings to approximately 1-1/4 inches from the lower edge of the facings.	Hand or 301	Hopper			
	d. Turn under the bottom edge of the facing at the mark and baste along the folded edge.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
47	Tack facing to interlining.					
	a. Tack the right and left facing-lining seam allowance to the respective coat front interlinings from approximately 2-1/2 inches from bottom edge of the coat to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6		
48	Baste front linings to coat.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat, and baste along the entire center of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 301	Hopper			
	b. Baste the front lining to the coat. Start at the lower end of the chest pleat, continue along the lower edge of the armhole approximately 2 inches from the edge, and end at the side seam. Match the side seams of the coat and lining. Continue basting as close as possible to the side seam and then across the bottom, approximately 4 inches from the piped bottom edge of the coat.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
49	Join lining at center back. Finished appearance. The lining shall be carefully joined at the center back without gathers, puckers, or pleats. The seams shall start and finish evenly. The folded edge of the center pleat, on the outside of the lining, shall be towards the left side. The center back seam of the lining shall be between the fold.					
	a. Position the back parts of the lining and join together at the center with a 3/8 inch seam.	301	SSa-1	12-16	A	A
50	Baste back lining to coat.					
	a. Fold the back lining, forming approximately a 1 inch wide pleat at the center back. Baste the back lining to the coat along the center pleat from the top end to approximately 4 inches from the bottom finished edge of the coat.	Hand or 301	Hopper			
	b. Baste the back lining to the coat. Start at the side seam and continue approximately 3 inches from the armhole and the shoulder edges.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
51	Hem bottom edge of lining. Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, or pleats. The hem shall be 3/4 ± 1/8 inch wide. The lining securing straps shall be positioned on the back in line with the back seam of the coat.					
	a. Hem the bottom edge of the body lining with the raw edge turned under and with one end of the securing straps positioned and caught in the stitching 1/16 inch from the upper folded edge of the hem.	301	SSa-1	12-16	A	A
52	Tack the lining securing straps to bottom of coat. Finished appearance. The lining securing straps, when tacked to the bottom edge of the coat, shall not cause twists or other distortions to either the coat or the lining. The ends of the securing straps shall finish between the piping at the bottom edge of the coat and the skirt seam allowance. In the finished coat, the lining shall not be visible below the bottom edge of the coat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
52	Track the lining securing straps to bottom of coat. (cont'd)					
	a. Position and securely tack the free end of the securing straps to the piping at the bottom edge of the coat through the skirt seam allowance.	301	SSa-1	6-10	A	A
	b. Position the bottom edge of the lining so that, in the finished coat, the lining shall not be visible below the bottom edge of the coat. Fold the lining securing straps across the width and stitch approximately 1/4 inch from the folded end in order to hold the lining in position.	301	OSf-1	6-10	A	A
53	Trim lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	b. Trim the back lining even with the neck.					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from the shoulder at the armhole edge. Taper the trimming to 3/8 inch at the neck.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
54	Make eyelets in side fronts. Finished appearance. The eyelets shall be worked with the purling on the outside of the coat, and shall finish with a 1/8 inch diameter opening. All stitches shall be securely caught in the fabric. a. Mark the location of the eyelets in the right and left fronts for removable buttons on line C-D, connecting the back of the button and buttonhole lines (see Figure 7). In the finished coat, the eyelet shall be positioned between the braid strands and opposite the center of the end of the beginning of the braid. b. Make an eyelet at each of the marks through all plies.	Eyelet		22 stitches per eyelet	A (Silk)	A
55	Make buttonholes. Finished appearance. The buttonholes shall be clean cut, well made, and well worked over the gimp to fit 40-line insignia buttons. The gimp and thread shall be pulled through to the outside of the front. The purling of the buttonhole shall be on					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
55	Make buttonholes. (cont'd)					
	the facing side. The inside of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of the coat. The buttonholes shall be cut-first type.					
	a. Remove the basting on the unstitched portion of the braid.					
	b. Make a horizontal eyelet-end square-bar type buttonhole cut, 1-1/4 inches long, at each of the marks.	Buttonhole		60 Per Button-hole (not including bartack)	B (Silk)	F
	c. Securely bartack the end of each buttonhole, catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bartack		21 Per bartack	A (Silk)	A
	d. Rebaste the unstitched portion of the braid and complete that portion of the stitching through all plies (See Figure 8).	Hand or 301	Hopper			
56	Press front of coat.					
	Finished appearance. Fronts shall finish smooth and flat without distortion and with all edges uniformly worked out.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
56	Press front of coat. (cont'd)					
	a. Press the front of the coat and braid smooth and flat with a suitable pressing machine, removing the fullness.					
57	Baste shoulder pad to coat.					
	a. Insert the shoulder pads between the interlining and the chest padding of coat fronts. Securely tack the pads to the interlining and chest padding only.	Hand or 301	Hopper			
58	Seam shoulders.					
	Finished appearance. The shoulder seam shall finish without a distorted appearance.					
	a. Join the back to the fronts at the shoulders with a 3/8 inch seam, working in the fullness on the back in accordance with good manufacturing practice.	301	SSa-1	12-16	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulders short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
58	Seam shoulders. (cont'd)					
	heated pressing iron or pressing machine over a suitable block.					
	c. Position the front lining and coat front interlining at the neck, shoulder, and armhole edges of the fronts. Baste all plies together on the outside along the front edge of the armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn the coat on the inside.	Hand or 301	Hopper			
59	Baste back lining and facing-lining assembly at shoulders.					
	a. Turn under and lap the shoulder edge of the back lining on the facing-lining assembly. Baste lining along the folded edge of the back lining with the top end of the chest pleat caught in the basting.	Hand				
60	Seam neckline with size label and coat hanger.					
	Finished appearance. The neckline shall finish smooth and flat, without twists, pleats, or puckers. The size label shall be positioned between the ends of the					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
60	Seam neckline with size label and coat hanger. (cont'd)					
	coat hanger. The ends of the coat hanger shall be positioned so that, in the finished coat, the hanger opening shall be 2-1/4 inches long when measured on the outer edge and along the lower edge of the collar lining.					
	a. Join the facings and back lining to the coat at the neckline, from collar notch to the collar notch, with a 1/4 inch seam. The upper edge of the size label and the ends of the hanger shall be positioned and caught in the stitching at the inside center back.	301	SSa-1	12-16	A	A
	b. Press the neckline of the coat smooth and flat with a heated pressing iron or pressing machine.					
61	Set collar with lining.					
	Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar.					
	a. Mark the neckline on the outside 3/8 to 1/2 inch from the top edge for position of the collar.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
61	Set collar with lining. (cont'd)					
	b. Position the collar with the lower edge lapped on the outside top edge of the coat at the mark.					
	c. Seam the collar, from end to end, to the coat as close as possible to the lower edge of the collar. The stitching shall not be through the lining.	301	LSa-1	12-16	A (Silk)	A
62	Set sleeves.					
	Finished appearance. The armhole sleeve seam shall finish without twists, gathers, puckers, or pleats.					
	a. Position sleeve on the outside of the coat at the armholes. The backarm seam of the sleeve shall match the side back seam. The notch in the top sleeve and the front shall also match.					
	b. Join the sleeve to the coat with a 3/8 inch seam. Distribute the fullness in accordance with good manufacturing practice.	301	SSa-1	12-16	A	A
	c. Press the entire armhole smooth and flat with a heated pressing iron, exercising care not to stretch the armhole. Spread open the upper part					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
62	Set sleeves. (cont'd) of the armhole sleeve seam from the backarm seam of the sleeve to approximately midway between the shoulder seam and notch at the front edge of the armhole. Press smooth and flat with a heated pressing iron. d. Fold the excess material at the armhole pit up to the line of stitching of the armhole sleeve seam, forming a hinge effect. The fold shall extend from the armhole notch to approximately 4 inches from the backarm seam. e. Press the fold smooth and flat with a heated pressing iron.					
63	Baste armhole. a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad, and front lining in place, and distributing fullness evenly. Turn the coat on the outside.	Hand or 301	Hopper			
	b. Baste around the outside of the armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
63	Baste armhole. (cont'd) the sleeve to the front notch of the coat.					
64	Stitch sleeve head pads and linings at armhole. Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole. a. Position the sleeve head pad on the sleeve with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole sleeve seam, and with the one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end, through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shield in the stitching and trimming away the excess material.	301	SSa-1	4-6	24/4	24/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
64	Stitch sleeve head pads and linings at armhole. (cont'd) c. The underarm shield may be basted to the armhole prior to stitching.					
65	Fell back lining and facing-lining assembly at shoulders. a. Fell the back lining and facing-lining assembly together at the shoulders. Place the stitching over the folded edge of the back lining and secure the top end of the chest pleat in the felling.	Hand		8-10	C (Silk)	
66	Fell sleeve lining at armhole. a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve and sleeve lining matching.					
	b. Turn under the armhole edge of the sleeve lining. Lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole. Place the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distribute the	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
66	Fell sleeve lining at armhole. (cont'd)					
	fullness in accordance with good commercial practice. Backstitch the lower armhole edge, approximately 1-1/2 inches in front of the forearm seam, to the side seam line.					
	-or-					
	c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside, from forearm seam to backarm seam. Hand fell the remaining portion as specified in operation 67.b.	301	SSa-1	12-16	A	A
	-or-					
	d. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside, from forearm seam to backarm seam. Stitch the remaining portion of the sleeve lining at the armhole with machine simulated hand felling.	Machine		8-10	C (Silk)	
	NOTE: It is required that the simulated hand felling produced by the machine shall be equal to or better than the hand felling.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
67	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of the coat. Start at the bottom edge of the lining and continue along the back and bottom edges of the facing to the front edge of the coat.	Hand		8-10	C (Silk)	
	b. Fell the folded edge of the facings to the piping, along the top edge, from the collar notch to the front edge of the coat.	Hand		8-10	C (Silk)	
68	Sew hook and eye to collar.					
	Finished appearance. The hook and eye shall be positioned to properly engage each other, effecting a flat, smooth closure at the front of the collar without misalignment.					
	a. Position and securely sew the hook to the right end and the eye to the left end of the collar. The hook and eye shall be positioned with their front edges even with the respective front ends of collar and securely sewn to the collar at the top and bottom edge of the hook and eye. The stitching on each side shall not be more than 3/8 inch from the front end of	Hand		16 per hook 16 per eye	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
68	Sew hook and eye to collar. (cont'd) the collar, through the individual holes at the rear of the hook and eye.					
69	Finish collar.					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (Silk)	
	b. Turn under the end and the top edge of the lining at the right end of the collar. Position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar. Continue felling along the top folded edge to the end of the stitching joining the lining to the collar.	Hand		8-10	C (Silk)	
	c. Turn under and fell the lower edge of the collar lining to the coat, from end to end, catching the turned under portion of the lining at the right end in the felling. The lower edge of the collar lining may be basted to coat prior to felling.	Hand		8-10	C (Silk)	
	d. Fell the collar extension tab to the left end of the collar. Continue along the folded top edge to the end of the stitching joining the lining to the collar.	Hand		8-10	C (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
69	Finish collar. (cont'd)					
	e. Turn the collar eyelet covers to the inside of the collar. Fell the front edge from the top to the bottom edge. Continue the felling along the bottom edge for a distance of 1/2 inch from the front edge.	Hand		8-10	C (Silk)	
70	Clean coat.					
	a. Pull all basting thread and trim and remove any loose ends of thread. Remove any spots, stains, and tickets without injury to the material.					
	b. Buttonholes at the front closure shall be examined for exposure of the coat front interlining cloth. The exposed interlining shall be colored with a reddish indelible ink.					
71	Press coat.					
	a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good commercial practices.					
	b. Press the fronts smooth and flat, straightening and shaping					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
71	Press coat. (cont'd) the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. c. Press the entire collar smooth and flat. d. Press the upper fronts on a body machine, shrinking in and properly shaping the chest. e. Press the lower fronts smooth and flat. f. Press the sides, working the fullness towards the back. g. Press the back smooth and flat, removing all fullness. h. Press the sleeves smooth and flat, creasing at the backarm and forearm seam. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 3 to 3-1/2 inches below the base of the armhole. i. Block the shoulders to remove the fullness and press the shoulders smooth on a shoulder shaping					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
71	Press coat. (cont'd) machine. j. Press the armholes solid from the inside, creasing the armholes at the front and creasing the excess material at the armpit. The armpit and back of the armhole shall be held short while pressing. k. Block the armholes on a pressing buck, shrinking in the top sleeves. l. Press the lower edge of the coat smooth, flat, and even. m. Press the body lining throughout, removing all wrinkles and creases. Press the lining pleats smooth and flat. n. Remove all gloss marks. o. Remove any wrinkles and creases missed by the previous pressing operations.					
72	Mark for button. a. Mark the location for the seven 40-line insignia buttons to the right front to properly engage with the buttonholes in the left front. The mark for the top button shall be in					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	NDL	BOB/ LPR
72	Mark for button. (cont'd) line with right end of the collar and the remaining buttons shall be vertically aligned with the top mark.					
73	Make eyelets for front closure and attach buttons. Finished appearance. The buttons shall be aligned with the buttonholes to secure a smooth and complete closure without bulging or misalignment.					
	a. Make eyelet at each mark for front closure and attach buttons with ring toggles.	Eyelet		22 stitches per eyelet	A (Silk)	A
	b. Cut 1/4 inch vertical opening or eyelet in back side seams. The ends of the opening of the vertical cut, shall be machine or hand tacked. Insert 40-line button with reinforcement disk and ring toggle. NOTE: All buttons shall be attached with the anchor in the upright position.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table II.

Table II. Coat measurements. 1/

Size	Breast 2/	Back length 3/	Sleeve length 4/
		Short	
	inches	inches	inches
34	35	29-3/4	17-1/2
35	36	29-7/8	17-1/2
36	37	30	17-1/2
37	38	30-1/8	17-1/2
38	39	30-1/4	17-1/2
39	40	30-3/8	17-1/2
40	41	30-1/2	17-1/2
41	42	30-5/8	17-1/2
42	43	30-3/4	17-1/2
44	45	31	17-1/2
46	47	31-1/4	17-1/2
		Regular	
	inches	inches	inches
34	35	30-3/4	18-1/2
35	36	30-7/8	18-1/2
36	37	31	18-1/2
37	38	31-1/8	18-1/2
38	39	31-1/4	18-1/2
39	40	31-3/8	18-1/2
40	41	31-1/2	18-1/2
41	42	31-5/8	18-1/2
42	43	31-3/4	18-1/2
44	45	32	18-1/2
46	47	32-1/4	18-1/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table II. Coat measurements. 1/ Continued.

Size	Breast 2/	Back length 3/	Sleeve length 4/
		Long	
	inches	inches	inches
34	35	31-3/4	19-1/2
35	36	31-7/8	19-1/2
36	37	32	19-1/2
37	38	32-1/8	19-1/2
38	39	32-1/4	19-1/2
39	40	32-3/8	19-1/2
40	41	32-1/2	19-1/2
41	42	32-5/8	19-1/2
42	43	32-3/4	19-1/2
44	45	33	19-1/2
46	47	33-1/4	19-1/2
		Extra Long	
	inches	inches	inches
34	35	33-1/4	20-1/2
35	36	33-3/8	20-1/2
36	37	33-1/2	20-1/2
37	38	33-5/8	20-1/2
38	39	33-3/4	20-1/2
39	40	33-7/8	20-1/2
40	41	34	20-1/2
41	42	34-1/8	20-1/2
42	43	34-1/4	20-1/2
44	45	34-1/2	20-1/2
46	47	34-3/4	20-1/2

1/ Tolerance for all measurements shall be ± 3/8 inch.

2/ Breast measurement shall be taken with coat buttoned, from folded edge to folded edge, in line with the pit of the armhole; multiply by 2.

3/ Back length measurement shall be taken along the center back from the lower edge of the collar to the piped bottom edge of the coat.

4/ Sleeve length measurement shall be taken along the forearm seam from the pit of the armhole to the bottom edge of the sleeve.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified, in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure that supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements; however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.4)

b. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in Table III.

4.4 First article inspection. When a first article is required (see 6.2), it shall be examined for the defects specified in 4.5.2.1 through 4.5.2.5. The presence of any defect or failure to pass any test shall be cause for rejection of the first article. The number of units to be inspected shall be specified by the contracting officer (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.5 Quality conformance inspection.

4.5.1 Component and material inspection. In accordance with 4.1 above, components and materials shall be tested in accordance with all the requirements of the referenced specifications, figures, and standards, unless otherwise excluded, amended, modified, or qualified in this specification, or applicable purchase order. In addition to the testing provisions contained in subsidiary specifications, figures, and standards, testing shall be performed on the components listed in Table III for the characteristics noted.

4.5.1.1 Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following (the lot shall be unacceptable if one or more sample units fail to meet any test requirement specified herein):

Lot size (lot unit)	Sample size (sample unit)
800 or less	2
801 through 22,000	3
22,001 and over	5

The unit for expressing lot sizes and sample units for testing each component shall be in accordance with applicable subsidiary specifications and as follows:

Component for testing	Lot sizes expressed as:	Sample unit
Gold braid	yards	1 yard
Hook and eye	100 each	2 each

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. Det. Per S/Unit	Results reported as:
Braid, Gold	Cover thread Material Identification 1/	3.3.15.1	1200	1	Pass or fail
	- color		Visual	1	Pass or fail
	- ply		Visual	1	Pass or fail
	Overwire	3.3.15.1			
	- metal undercoat		Std.	1	Pass or fail
	- metal plating		Comm'l	1	Pass or fail
	Core (stuffer)	3.3.15.1			
	- material identification 1/		1200	1	Pass or fail
	- number of threads	3.3.15.1	Visual	1	Pass or fail
	- ply of threads	3.3.15.1	Visual	1	Pass or fail
	- color	3.3.15.1	Visual	1	Pass or fail
	Weave	3.3.15.1	Visual	1	Pass or fail
	No. of carries	3.3.15.1	Visual	1	Pass or fail
	ends/carriers	3.3.15.1	Visual	1	Pass or fail
	Shape	3.3.15.1	Visual	1	Pass or fail
	Width (in.)	3.3.15.1	5020	1	Pass or fail
	Metal content (%)	3.3.15.1	4.3.4	2	To nearest 0.1%
	- gold				
	- silver				
	- alloy				

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Table III - Test Methods

Components	Characteristics	Rqmt. Para.	Test Method	No. Det. Per S/Unit	Results reported as:
Braid, Gold (cont'd)	Fastness to:	3.3.15.1			
	- water		5630	1	Good, fair or poor
	- wet (dry) cleaning		5620	1	Good, fair or poor
Hook and Eye	Material identification 1/	3.3.16	Std Comm'l	1	Pass or fail
	Finish		Std Comm'l	1	Pass or fail
	Finish		4.3.3	1	Pass or fail

1/ Accept a certificate of compliance for this requirement.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

4.5.1.2 In process inspection. Inspections shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.2 Examination of the end item. The end item shall be examined for the defects listed in 4.5.2.2 through 4.5.2.5 The sample unit shall be one completely fabricated coat.

4.5.2.1 Classification of defects. All defects shall be classified as indicated below, except those numbered 1 through 99 in the classification column, which shall be classified as follows:

Major defect - When seriously affecting appearance or serviceability.

Minor A defect - When not seriously affecting appearance or serviceability.

4.5.2.2 General defects. General defects shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes (construction)	a. One or more omitted, added or wrong type.	101		
	b. Not corresponding to size of button:			
	- too small, not permitting button to enter buttonhole.	102		
	- too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		201	
	c. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	103		
	d. Bartack missing or loose on:			
	- one buttonhole.		202	
	- two or more buttonholes.	104		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Buttonholes (construction) (cont'd)	e. Bartack misplaced, not serving intended purpose on:			
	- two or more buttonholes.		203	
	- one buttonhole.			301
	f. One or more broken stitches in:			
	- one buttonhole.	105		
	- two or more buttonholes.		204	
	g. More than 2 skipped stitches in:			
	- one buttonhole.			302
	- two or more buttonholes.		205	
	h. Ragged edges, affecting appearance; or exposed interlining not colored with reddish indelible ink as specified.			303
	i. Any uncut buttonhole.		206	
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		207	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified:			
	- one or two stitches.			304
	- three or more stitches.		208	
	l. One or more buttonholes finished with purling on the underside.	106		
Buttons or ring toggles	a. One button or ring toggle missing, loose, defective, or improper size or type.		209	
	b. Two or more buttons or ring toggles missing, loose, defective, or of improper size or type.	107		
	c. One or more buttons attached with the head of the eagle in other than an upright position.			305

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
	NOTE: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; unsound soldering; scratches; dents; blemishes, or imbedded foreign matter; loose shanks; or are poorly plated or badly shaded.			
Cleanness	a. One or more spots or stains of a permanent nature clearly noticeable:			
	- on the outside.	108		
	- on the inside.		210	
	b. One or more removable spots or stains clearly noticeable:			
	- on the outside.		211	
	- on the inside.			306
	c. Thread ends not trimmed throughout garment, one or more bastings not removed, or two or more shade tickets not removed.			307
Components and assembly	a. Any component part or required operation omitted (unless otherwise classified herein).	1		
Cutting	a. Any component part of basic wool material not cut in accordance with the directional lines on patterns; or in accordance with specification requirements.	109		
	b. Piping material cut on the bias.		212	
	c. Any lining part not cut in accordance with the directional lines on the patterns; or in accordance with specification requirements.		213	
Hook and eye	a. Not specified type or size.		214	
	b. Hook or eye not securely tacked to the ends of the collar.		215	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Hook and eye (cont'd)	c. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hooks and eyes are fastened.	216		
Material defects and damages	a. Any weakening defect such as smash, multiple float, or loose slub.	2		
	b. Any hole.	3		
	c. Shade bar, unsightly slub, etc., affecting appearance: - on outside.	4		
	- on inside.		217	
	d. Scissors or knife cut, tear, mend, or burn.	5		
	e. Needle chews that may develop into a hole.	6		

NOTE: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or non-weakening conditions which are inconspicuous and have negligible affect on serviceability are to be classified as follows:

Material defect - No defect
Workmanship damages - Minor B defect

Pressing	a. Burned or scorched.	7		
	b. Pressing of the entire garment omitted.		218	
	c. Armhole stretched.	8		
	d. Poorly pressed (unless otherwise indicated).			308
	e. Basting or pressing impressions not removed on a major portion of the coat.		219	
	f. Gloss not removed on a major portion of the coat.			309
	g. Armholes not blocked or poorly blocked, affecting appearance.		220	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Pressing (cont'd)	h. Edges bulky; i.e., not pressed solid, affecting appearance.		221	
	i. Inside of armhole not creased as required.		222	
	j. Sleeve not creased at the front or backarm seam.		223	
	k. Wrinkles or pressing impressions not removed from under pocket flap, side, or center back seam allowance.		224	
	l. Linings not pressed smooth.		225	
	m. Armhole seam not pressed open across the top as required.		226	
Seams and stitching	a. Accuracy of seaming: 1. Any seam twisted, puckered, or pleated, affecting appearance.	110		
	2. Part of the garment caught in any unrelated operation or stitching.	9		
	3. Unsightly hand felling or blindstitching exposed on the outside of the coat, affecting appearance.		227	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.			310
	5. Wrong color of thread or two shades of thread used on outside of coat, affecting appearance.	10		
	b. Gage of stitching (edge or raised stitching): 1. Irregular; i.e., unevenly gaged; or various stitchings not uniform, affecting appearance.		228	
	2. Beyond range of width specified or varies by more than 1/16 inch when no range is specified.			311

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	c. Open seams:			
	1. On outside:			
	- up to 1/4 inch inclusive.			312
	- more than 1/4 inch but not more than 1/2 inch.		229	
	- more than 1/2 inch.	111		
	2. On inside:			
	- up to 1/2 inch inclusive (except machine felling).		230	
	- more than 1/2 inch (except machine felling).			313
	- up to 1 inch inclusive (machine felling).			314
	- more than 1 inch (machine felling).		231	
	NOTE: One or more broken stitches, or two or more continuous, skipped, or runoff stitches shall constitute an open seam.			
	d. Raw edges:			
	1. On outside:			
	- up to 1/8 inch inclusive.			315
	- more than 1/8 inch but not more than 1/4 inch.		232	
	- more than 1/4 inch.	112		
	2. On inside:			
	- more than 1/8 inch but not more than 1/4 inch.			316
	- more than 1/4 inch.		233	
	NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.			
	e. Runoffs (see classification of open seams).			
	f. Stitch tension:			
	1. Loose tension resulting in a loose seam.	113		
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.		234	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Seams and stitching (cont'd)	3. Tight tension (stitches break when normal strain is applied).	114		
	NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test the seam by exerting pull in lengthwise direction of seam.			
	g. Stitches per inch (excluding labels) less than minimum specified: - one or two stitches. - three stitches. - four or more stitches.	115	235	317
	NOTE: To be scored only if the condition exists on a major portion of seam.			
	h. Wrong stitch or seam type.		236	
	i. Stitching skipped or broken (on edge or raised stitching when seam is seamed, turned and stitched). - 1/4 inch or more, but not more than 1/2 inch. - more than 1/2 inch.		237 238	318
Shaded parts	a. Any outside part shaded.	11		
	b. Any lining part badly shaded except sleeve lining.		239	
	c. Sleeve lining parts badly shaded, or parts not matching each other.			319

4.5.2.3 Detailed defects (outside of coat). Detailed defects on the outside of coat, with coat buttoned on a form or spread out on a table, shall be classified as follows:

Collar (construction and setting)	a. Interlining omitted.	116		
	b. Interlining tight or twisted, causing puckers on the collar, affecting appearance.		240	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Collar (construction and setting) (cont'd)	c. Tight at joining to front or back, causing puckers or pleats at the neck of the coat, affecting appearance.	12		
	d. Braid irregular, affecting appearance.		241	
	e. Collar ends overlapping when fastened.		242	
	f. Collar ends spread open more than 3/8 inch when fastened.		243	
	g. Front finished ends of the collar uneven in width by 3/16 inch or more.		244	
Alignment of front buttons and buttonholes	a. Not aligned, causing a noticeable bulge or twist on the fronts when buttoned, affecting appearance.		245	
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by:			
	- more than 1/8 inch but not more than 1/4 inch.		246	
	- more than 1/4 inch.	117		
	b. Left front at corner longer than right front by:			
	- more than 1/4 inch but not more than 3/8 inch.			320
	- more than 3/8 inch.		247	
	c. Right front at corner exposed beyond the bottom edge of the left front by more than 1/8 inch.		248	
Shoulder (construction)	a. Improperly joined or set, causing the shoulders or back to twist.	13		
Shoulder pads	a. Not completely caught in the armhole tacking.		249	
	b. Misplaced or not serving intended purpose; i.e., too far back or too far forward.		250	
	c. One or both pads omitted.		251	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Armholes (construction)	a. Badly stretched, affecting appearance.	14		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	15		
	c. Crooked seam, affecting appearance.		252	
	d. Tape stitching exposed and visible on outside surface.			321
	e. Sleeve head pads not completely tacked to armholes; or misplaced, not serving intended purpose.		253	
	f. One or both sleeve head pads omitted.		254	
Sleeves	a. Setting and hang:			
	1. Sleeve fullness misplaced, affecting appearance.		255	
	2. Backarm seam of the sleeve not matching side back seam by:			
	- more than 1/4 inch but not more than 1/2 inch.		256	
	- more than 1/2 inch.	118		
	3. Hang of sleeves on the same coat in opposite direction by more than 2 inches.		257	
	4. Sleeve tight in armhole (roll effect not present).		258	
	b. Sleeve lining:			
	1. Twisted, tight, or short, causing bulge, twists, or puckering on outside of sleeves.	16		
	2. Sleeve lining too long, causing lining to sag at the bottom more than 1/2 inch.			322
	3. Sleeve lining seams out of alignment by more than 3/4 inch with sleeve seams at armholes or at bottom of sleeves.			323

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Sleeves (cont'd)	c. Construction of sleeves: 1. Tacking on bottom turnup to body of sleeve omitted or insecure.		259	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			324
	3. Tacking on 1 or both sleeve lining seams to sleeve seams omitted; or insecure.			325
	4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from the bottom edge of sleeve.			326
Body (outside)	a. Fitting of body linings tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	17		
	b. Fitting of front interlining: 1. Tight, short, or twisted, causing fullness or twist on the outside of the coat, affecting appearance.	18		
	2. Too full, causing coat front to have a wavy appearance.	19		
	c. Chest and waist darts: 1. One or more darts not properly tapered, causing puckers or pleats at one or more ends, affecting appearance.		260	
	2. Cut edges of chest dart pressed toward front of coat.			327
	3. Folded edge of waist dart pressed toward front of coat.			328
Front and bottom edges	a. Front edge stretched, affecting appearance.		261	
	b. Piping set on tight, causing puckering on front, affecting appearance.		262	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Front and bottom edges (cont'd)	c. Front or bottom piping irregular, affecting appearance.		263	
	d. Bottom edge stretched, puckered, or uneven, affecting appearance.			329
	e. Bottom corner of left front poorly shaped, affecting appearance.		264	
	f. Left front rolling outward below bottom button.	20		
	g. Front edge irregular, affecting appearance.		265	
	h. Piping tight on bottom edge, causing puckering on outside of coat, affecting appearance.		266	
	i. Left front not dressed as specified.	119		
Front facings	a. Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.	21		
Back side panel seams	a. Curved panel seam on back of coats stretched or distorted, affecting appearance.		267	
Front buttonholes	a. Position from front edge, including piping, to inside edge of eyelets: - less than 1/2 inch but not less than 3/8 inch or more than 3/4 inch but not more than 7/8 inch.			330
	- less than 3/8 inch or more than 7/8 inch.		268	
	b. More than 1/4 inch from equal spacing.		269	
	c. Unevenly spaced from front edge by more than 3/16 inch.		270	
Front buttons (position)	a. Top button not in vertical alignment with right end of the collar by more than 1/8 inch.		271	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Front buttons (position) (cont'd)	b. Any front button out of vertical alignment by 1/4 inch or more.		272	
Braid placement on fronts	a. Braid out of horizontal alignment on left and right fronts, affecting appearance.	120		
	b. Harp edge less than 5/8 inch or more than 1 inch from edge of armhole.	121		
	c. Diameter of figure 8 circle less than 27/32 inch or more than 7/8 inch.			331
	d. One or more inner circles forming figure 8 less than 1/8 inch in diameter.		273	

4.5.2.4 Detailed defects (inside of coat). Detailed defects on the inside of the coat shall be classified as follows:

Examine	Defects	Classification Major	Minor A	Minor B
Labels	a. Any required label missing, incorrect, or illegible; or size label not securely caught in stitching.		274	
	b. Identification label not stitched on 4 sides.			332
	c. Bottom edge of identification label less than 3 inches, or more than 5 inches, from bottom edge of coat.			333
Hanger	a. Hanger omitted or ends not securely stitched.		275	
	b. Less than 1-7/8 inches or more than 2-1/8 inches long, measured along edge of collar lining.			334
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.			335

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defects	Classification Major	Minor A	Minor B
Front facings	a. Fullness or pleats on facings between buttons or buttonholes; or between front edge and buttons or buttonholes.			336
	b. Tacking on back edge to one or both interlinings: - omitted.		276	
	- insecure or incomplete for a distance of more than 4-1/2 inches below the shoulder seam; or more than 4 inches above the bottom edge of coat.			337
	c. Felling at bottom edge of front or back edge of facing omitted or insecure on one or both facings.		277	
	d. Felling at top edge of facing omitted or insecure on one or both facings.		278	
Body lining	a. Excessive puckering or pleated.			338
	b. Twisted, not affecting smoothness on outside of coat.		279	
	c. One or both chest pleats on shoulders omitted.		280	
	d. Folded edge of one or both chest pleats facing front edge of coat.			339
	e. Pleat omitted at center of back lining.		281	
	f. Pleat less than 1/2 inch in depth at the center of the back lining.			340
	g. Bottom hem less than 5/8 inch or more than 7/8 inch.			341
	h. One or both lining securing straps at the bottom of the coat omitted or insecure.		282	
	i. Position of one or both lining securing straps more than 1 inch from side seam.			342

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

Examine	Defects	Classification Major	Minor A	Minor B
Body lining (cont'd)	j. One or both lining securing straps not folded and stitched.			343
	k. Lining too long; i.e., exposed beyond bottom edge of coat.		283	
Serging	a. Serging omitted on one or more seams where required.		284	
Collar extension tab	a. Omitted.		285	
	b. Extending less than 1/2 inch or more than 1 inch from left end of collar.			344
	c. Insecurely felled; or felling not on four sides.			345

4.5.2.5 Finished measurements. Any measurement deviating from the nominal dimensions and tolerances specified in table II shall be classified as a size measurement defect. Sleeve length uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5.3 Examination of preparation for delivery requirements. An examination shall be made to determine compliance with packaging, packing, and marking requirements of section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container, fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery.

Examine	Defect
Marking (exterior and interior)	Omitted; incorrect; illegible; or improper size, location, sequence, or method of application.
Materials	Any component missing or damaged.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect
Workmanship	Inadequate application of components such as incomplete closure of case liners, container flaps, loose strapping, or inadequate stapling. Bulging or distortion of containers.
Content	Number of coats per container is more or less than required.

4.6 Tests. Tests shall be in accordance with the following.

4.6.1 Metal composition. Chemical composition shall be determined in accordance with test method III of FED-STD-151.

4.6.2 Test for tackiness. At room temperature (60° F to 80° F) press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall be free when pressure is released.

4.6.3 Quantity of gold and silver. At least two pieces, 1 yard each, shall be assayed for the quantity of gold and silver. Unravel braid to separate enough metal yarn for analysis. Place metal yarn in 70 percent sulfuric acid as many times as may be required to dissolve cotton yarn and to isolate bare metal. The quantities of gold and silver may be determined by standard commercial methods of assay, but in case of dispute, shall be determined in accordance with 4.6.4.1 and 4.6.4.2, respectively.

4.6.3.1 Gold content. Boil 1 gram of alloy (accurately weighed) with 60 milliliters (ml) 1:1 nitric acid ($NH0_3$) in a 400-ml beaker using a small flame or hot plate. Continue boiling until all metals except the gold are in solution. Dilute to 200 ml with hot water. Filter through a rapid ashless filter paper, and wash several times with hot water. Take the filter paper with the gold (cutting off any excess filter paper), wrap it in a 2 inch by 2 inch piece of silver-free lead foil, and roll it into a ball. Place the ball in the hollow of a bone ash cupel, and add lead shot around the ball. Place cupel in a muffle furnace for 1 hour at 1,000° C. Remove from the furnace and examine the hollow for flakes of gold impurities and discolored gold bead. If any are noticed, add additional lead shot and return cupel to the muffle furnace for 1 hour. Otherwise, cool the gold bead and weigh. The gold content shall be calculated as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

$$\text{Gold content} = \frac{W\ (AU)\ X\ 100 = P\ (AU)}{WS}$$

Whereas:
W (AU) = Weight of gold
WS = Weight of sample
P (AU) = Percent of gold

4.6.3.2 Silver content. Dilute the filtrate, from 4.6.4.1, to a 1000-ml volumetric flash, and dilute to the mark. Pipette a 200-ml aliquot from the flask into a 400-ml beaker. Heat to boiling, and add hydrochloric acid (3:100) drop by drop from a pipette until precipitation is complete (1 ml of hydrochloric acid solution precipitates about 0.039 grams of silver). When the solution has cooled and precipitate has settled, determine whether precipitation is complete by adding a few drops of the hydrochloric acid (3:100). If solution remains clear, filter on a weighed porcelain Gooch crucible. Wash the precipitate several times with HNO_3 (1:200) and finally with cold water. Protect the silver chloride from the light; dry in an oven for not less than 2 hours; cool; and weigh. The silver content shall be calculated as follows:

$$\text{Silver content} = \frac{W\ (AgCL)\ X\ 752.63\ X\ 5}{WS}$$

Whereas:
W (AgCL) = Weight of silver chloride
WS = Weight of sample minus weight of gold

4.6.3.3 Alloy content. Alloy content is ascertained by the difference between gold and silver content.

5. PACKAGING.

5.1 Preservation. Unless otherwise specified, the coats shall be preserved in accordance with ASTM D 3951.

5.2 Packing. Coats preserved in accordance with 5.1 shall be packed in accordance with ASTM D 3951.

5.3 Marking. In addition to any special marking required by the contract or purchase order, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES.

(This section contains information of a general or explanatory nature that may helpful but is not mandatory.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

6.1 Intended use. The coats described herein are intended for wear by enlisted male personnel of the U.S. Marine Corps Band (Drum Major Full Dress).

6.2. Acquisition requirements. Acquisition documents shall specify the following:

a. Title, number, and date of this specification.
b. Issue of DODISS to be cited in the solicitation, and if required, the specific issue of individual documents referenced (see 2.1).
c. Sizes required (see 1.2).
d. Whether first article is required (see 3.2).
e. Number of coats in first article (see 3.2).

6.3 Samples and shade samples. For information regarding availability of sample coats and of the standard shades specified (see 3.1 and 3.3), address inquiry to the procuring activity issuing the invitation for bids.

6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).

6.5 Changes from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

6.6 Subject term (key word) listing.

Men's
Musician

Preparing Activity:
Navy - MC
Project No. 8405-N285

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

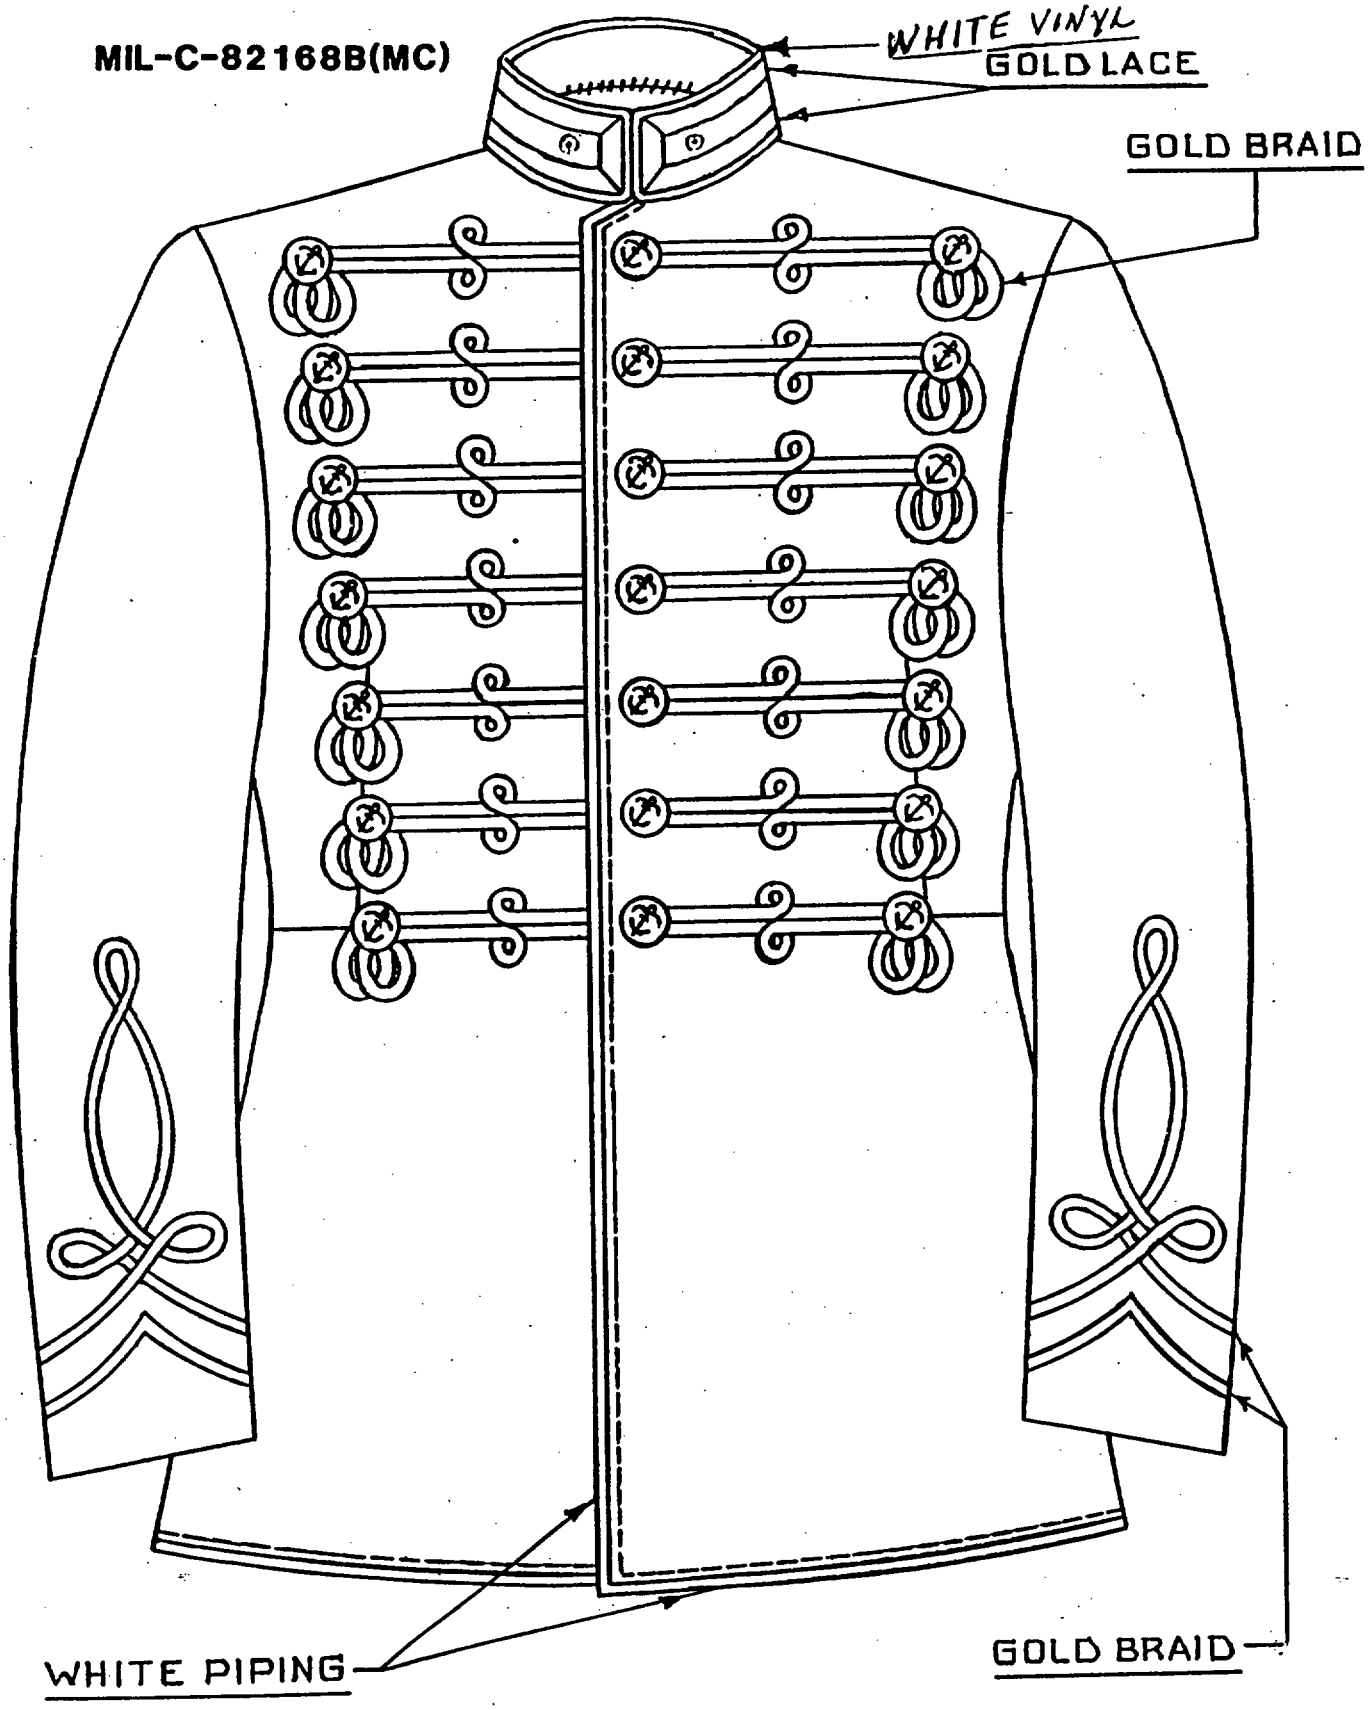


FIG. 1. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND; DRUM MAJOR

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

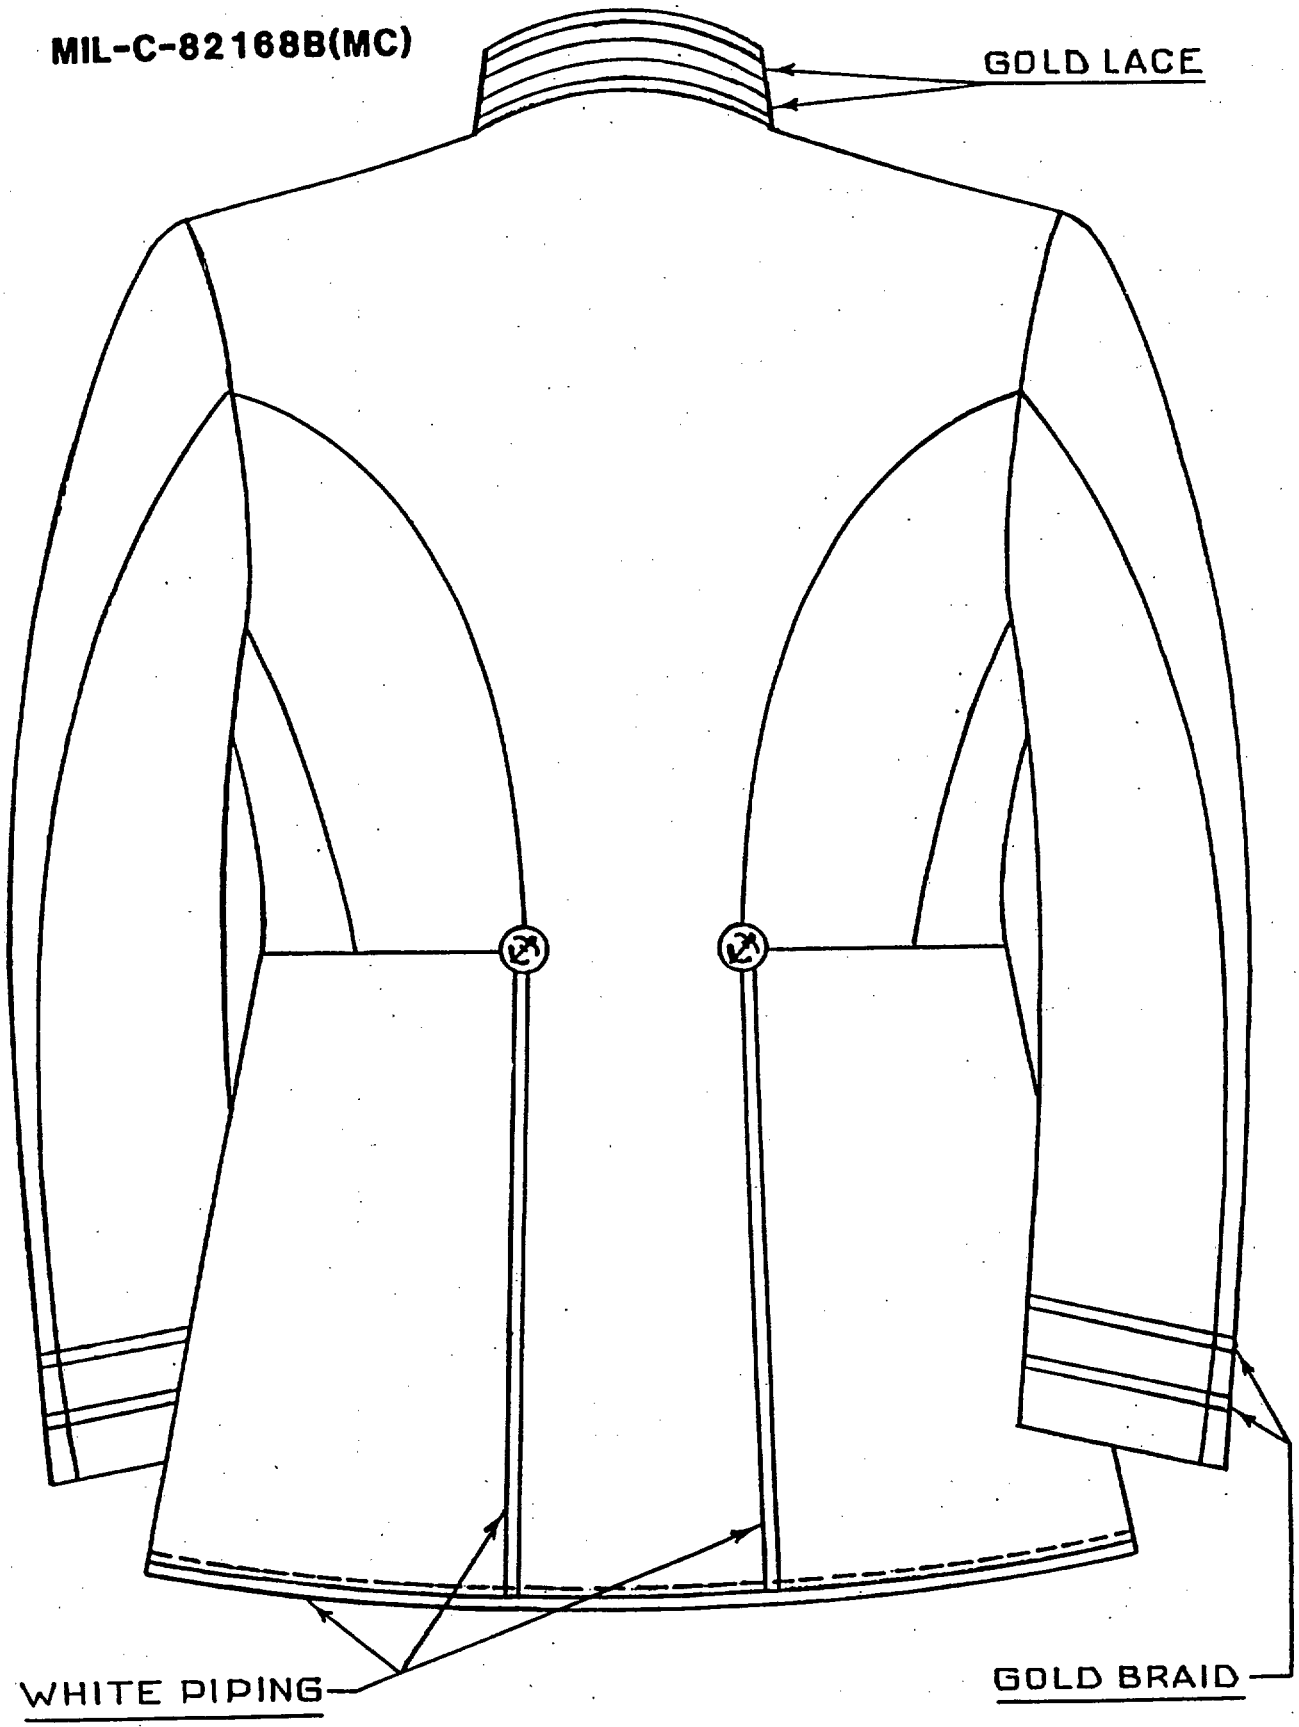


FIG. 2. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND; DRUM MAJOR

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.



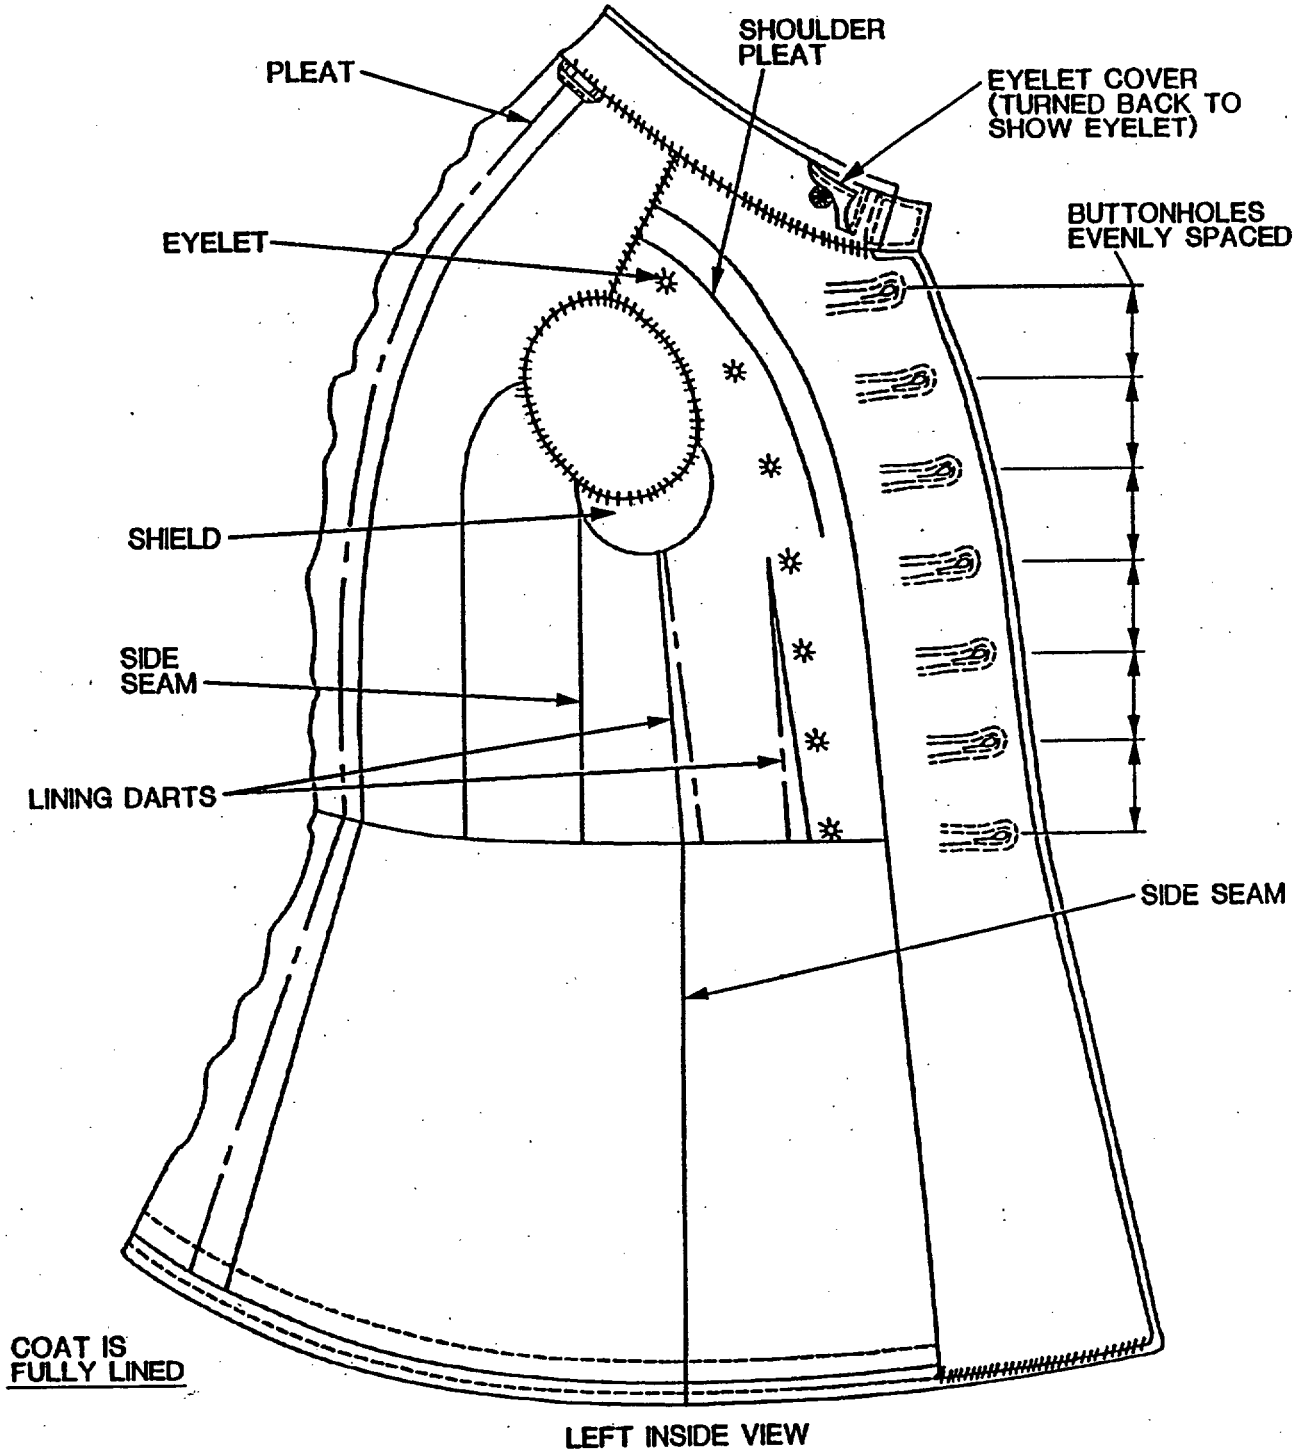


FIGURE 3. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U. S. MARINE BAND; DRUM MAJOR


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

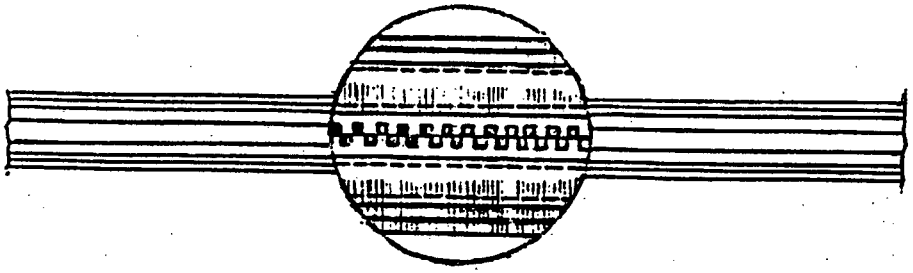

GOLD LACE (DETAIL)

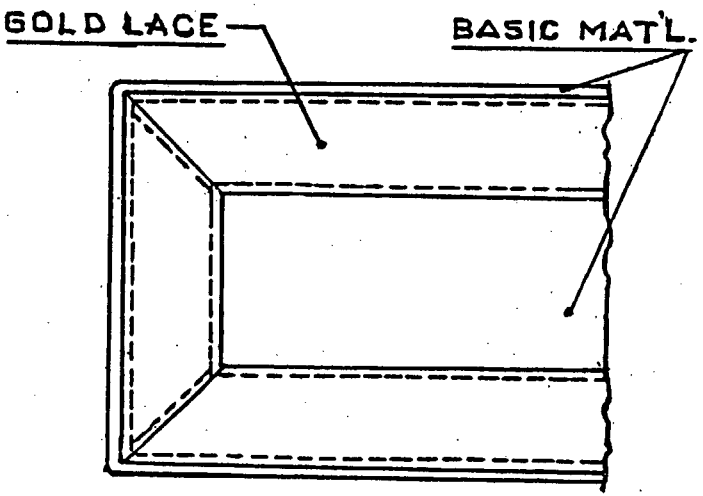


STITCHING DIAGRAM

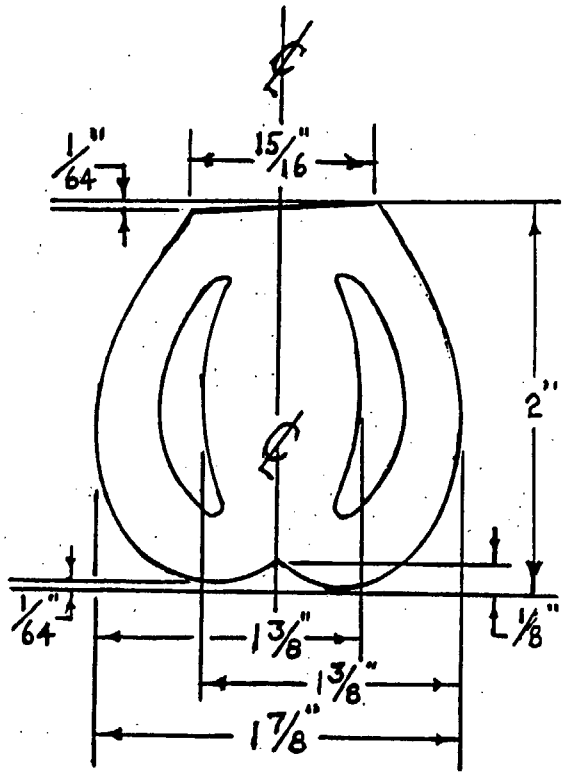


HARP

FIG. 4. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

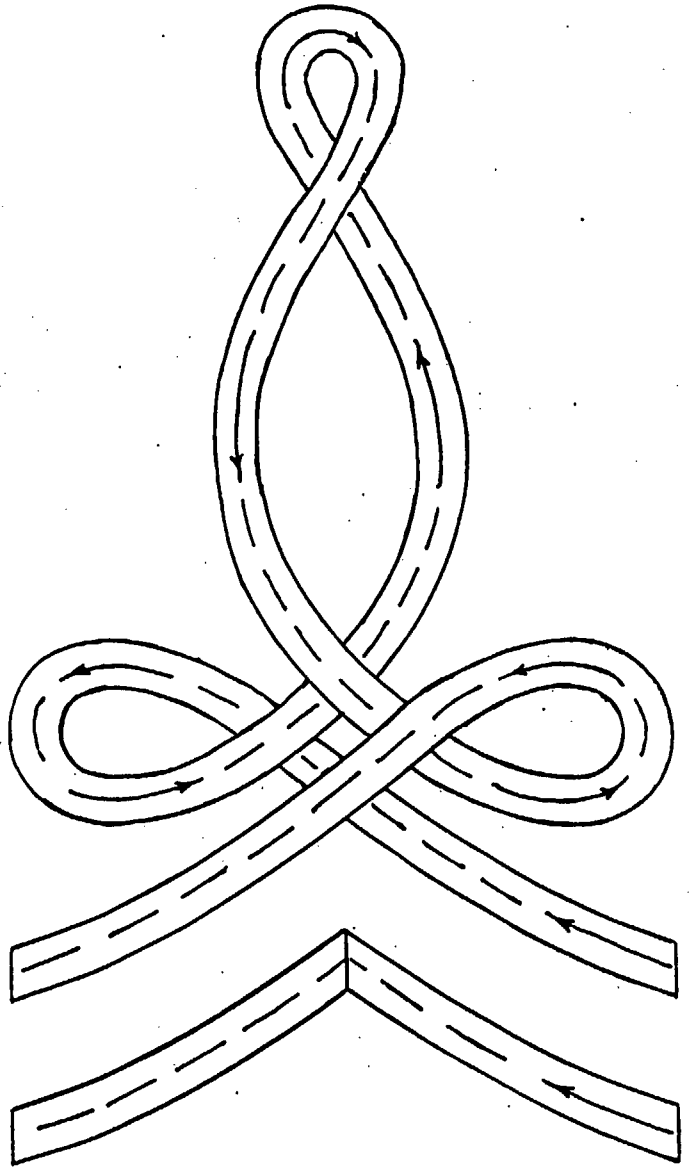


BASTE BRAID

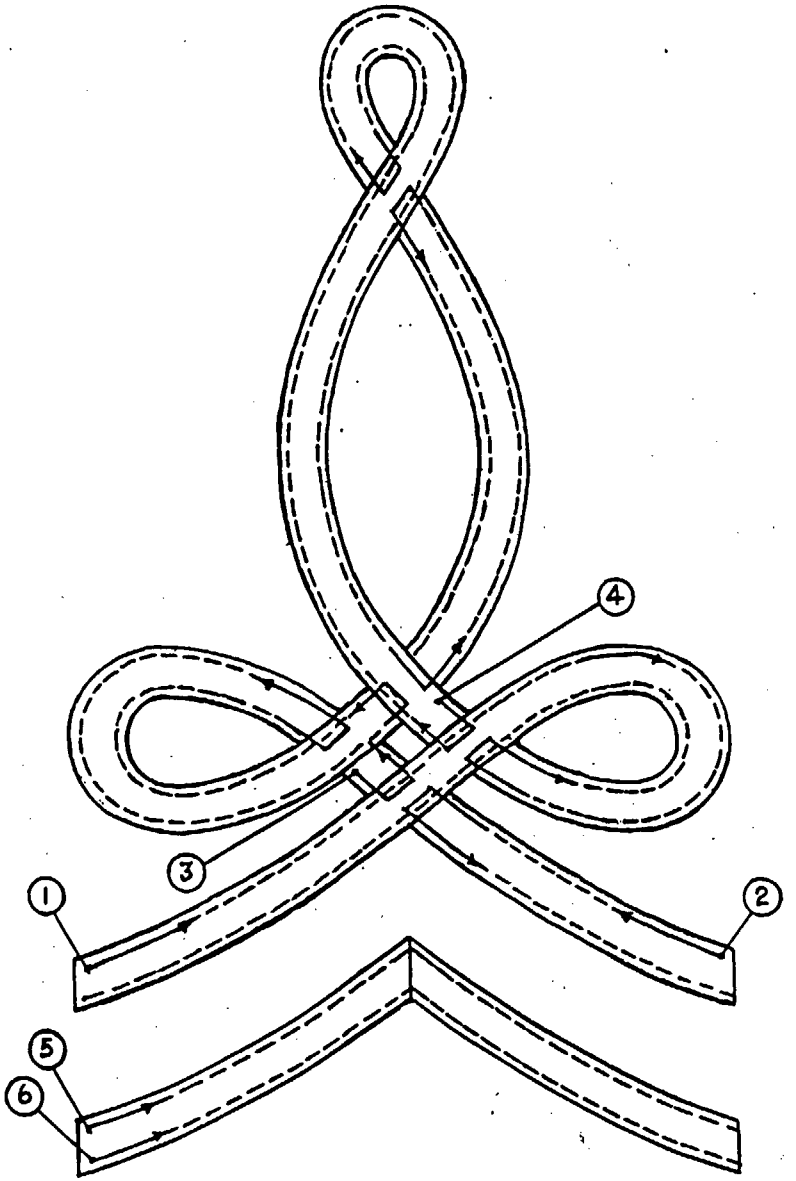

STITCHING DIAGRAM

FIG. 5. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND; DRUM MAJOR


Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

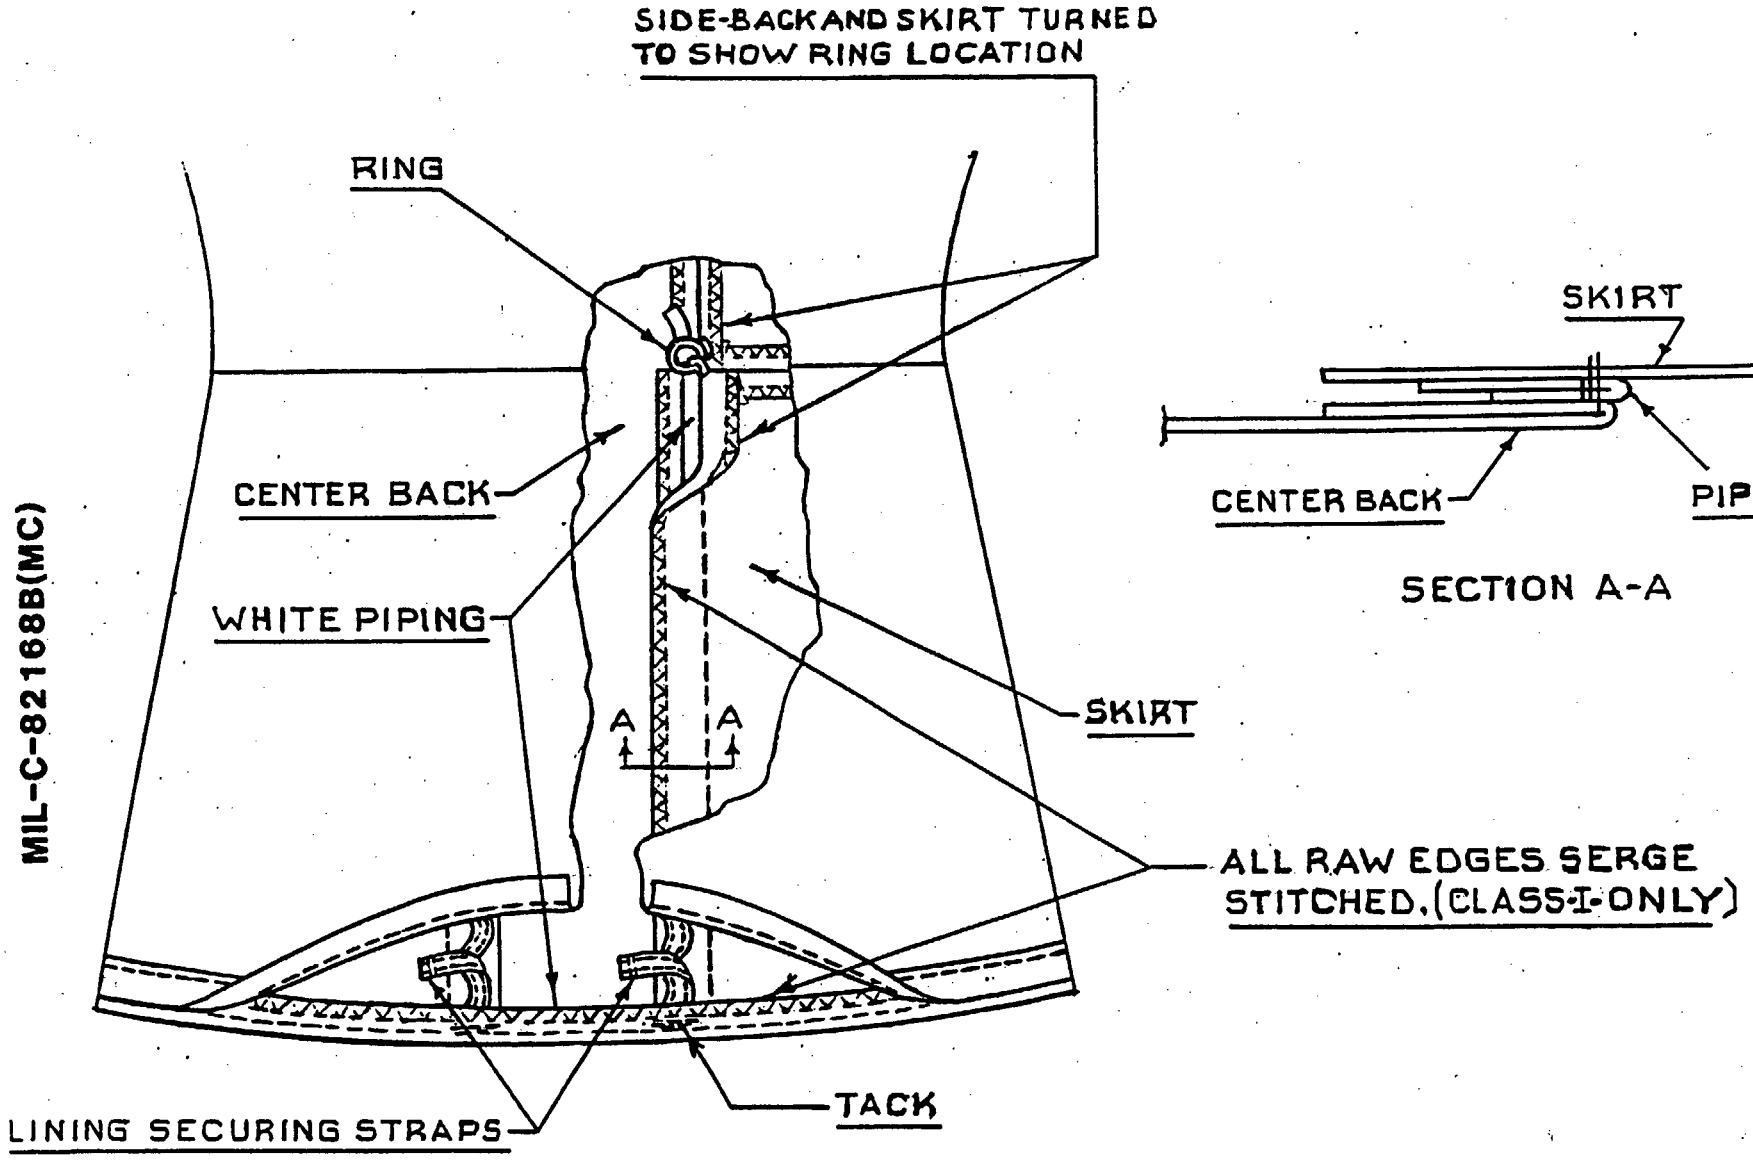

BACK INSIDE — CUT THROUGH VIEW

FIG. 6. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND; DRUM MAJOR


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

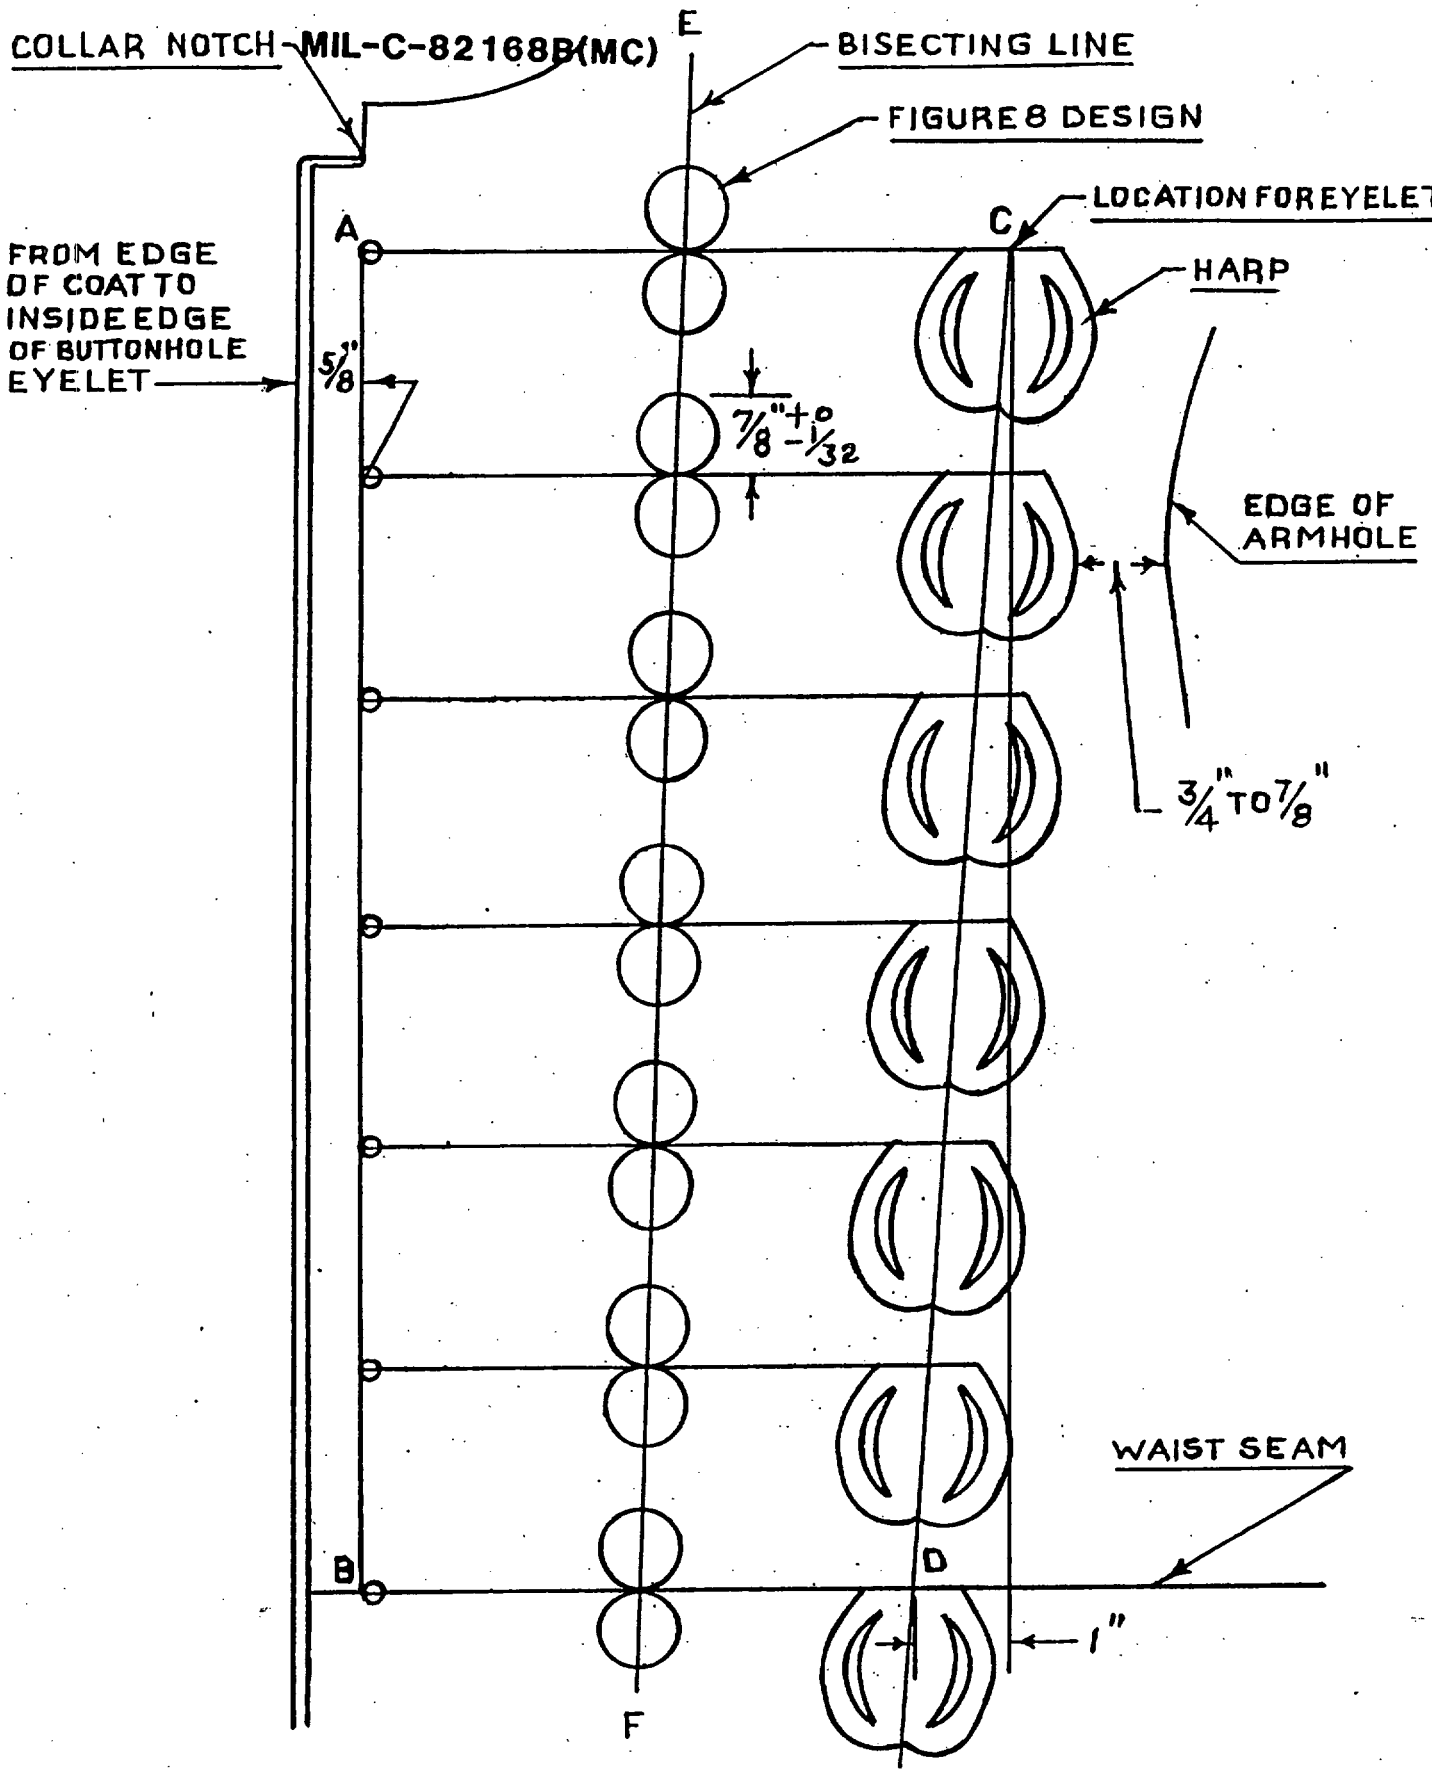


BRAID PLACEMENT DIAGRAM — LEFT FRONT

FIG. 7. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND; DRUM MAJOR


Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

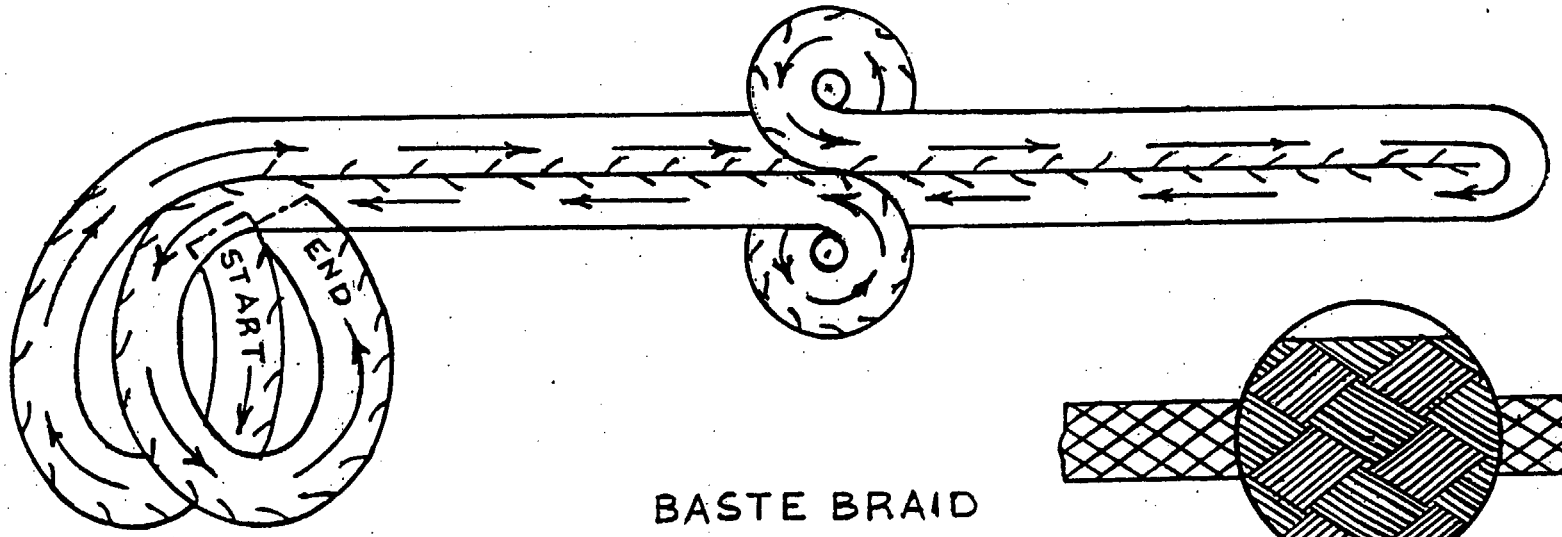

BASTE BRAID

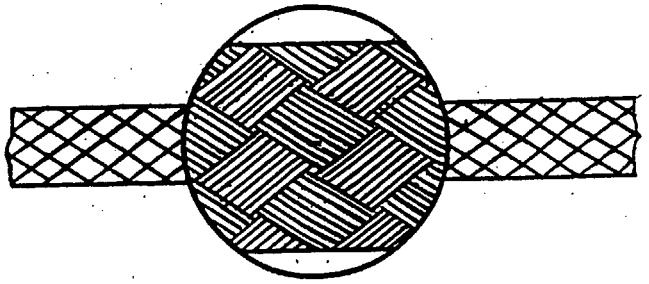

BRAID, GOLD, TUBULAR (DETAIL)

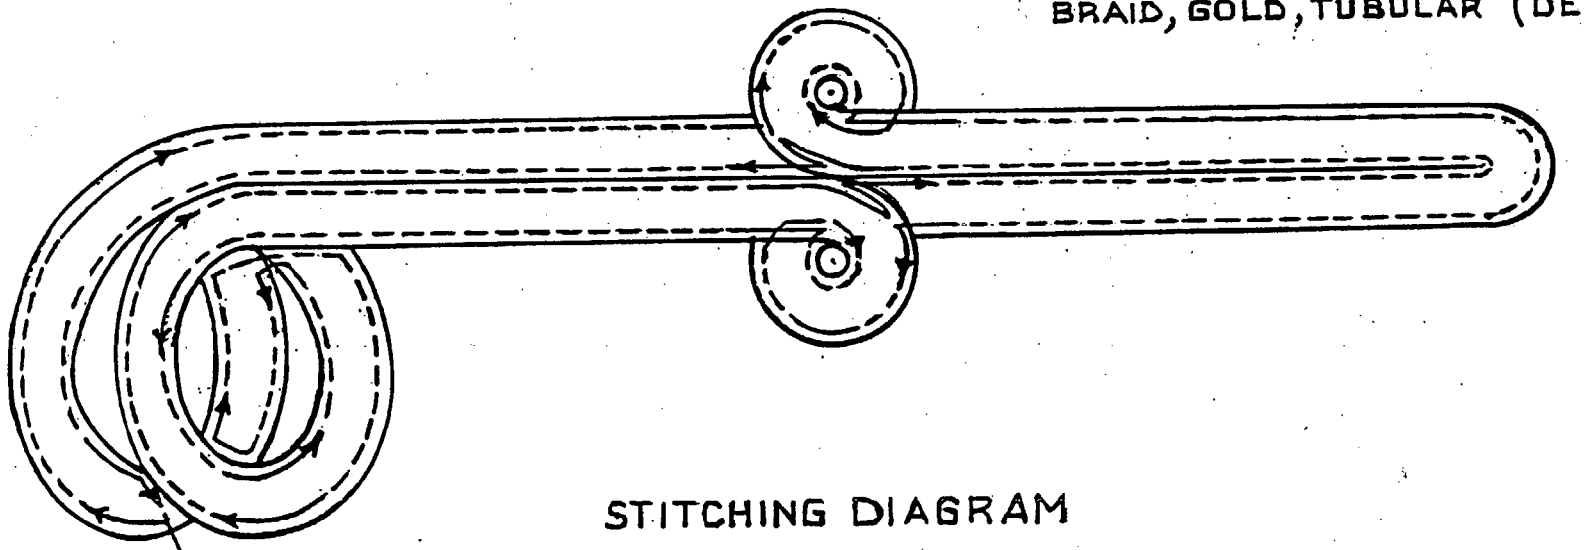


STITCHING DIAGRAM

RIGHT FRONT OF COAT:— (REVERSE FOR LEFT FRONT)

FIG. 8. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U.S. MARINE BAND, DRUM MAJOR

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

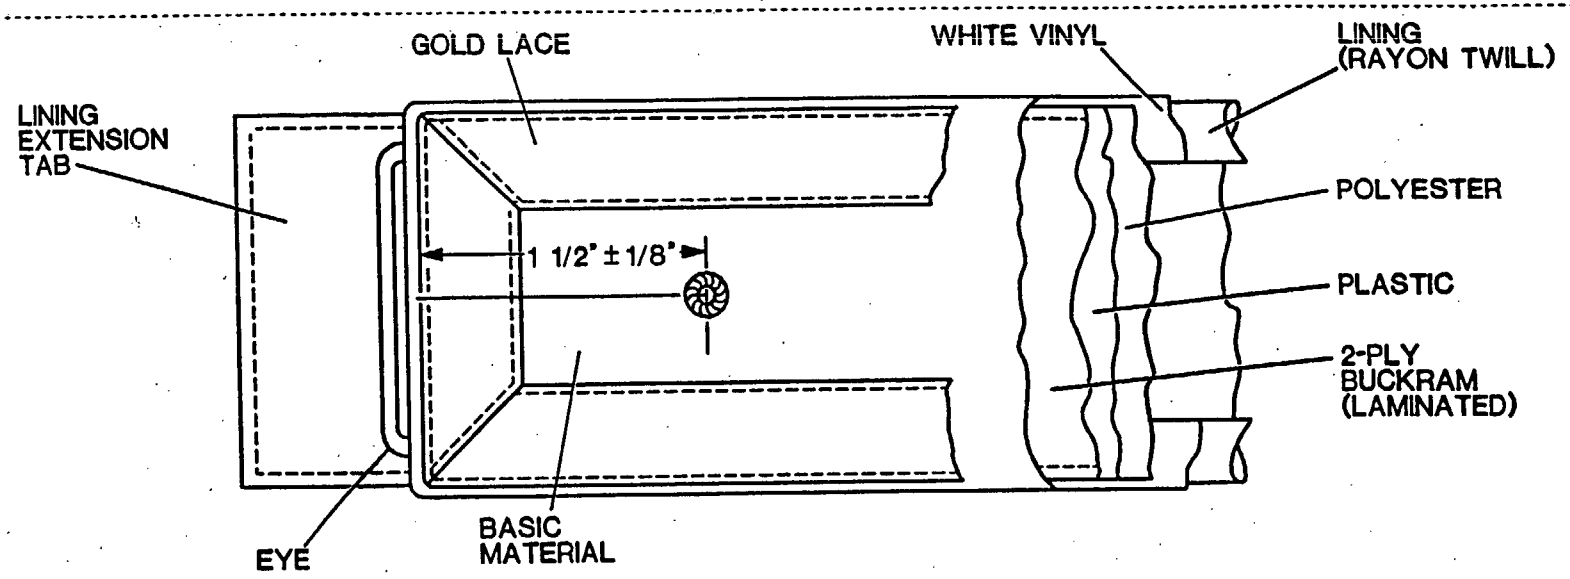

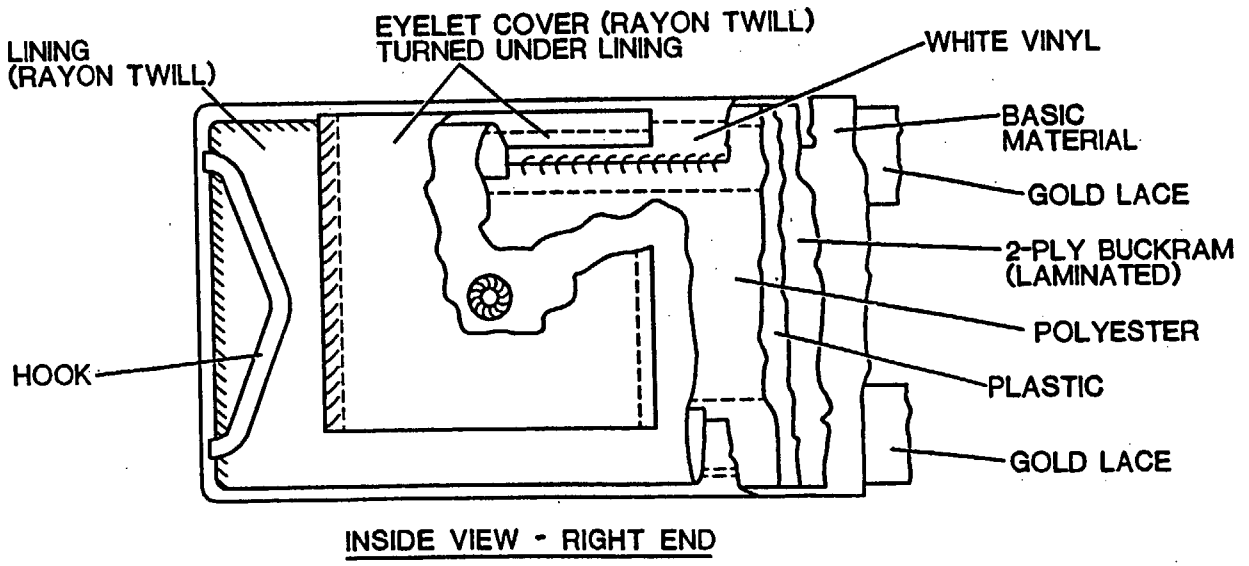


FIGURE 9. COAT, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET, U. S. MARINE BAND; DRUM MAJOR

True Size: 42 x 51 picas = 7.0" x 8.5"
Plot Scale Factor: 1.00

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

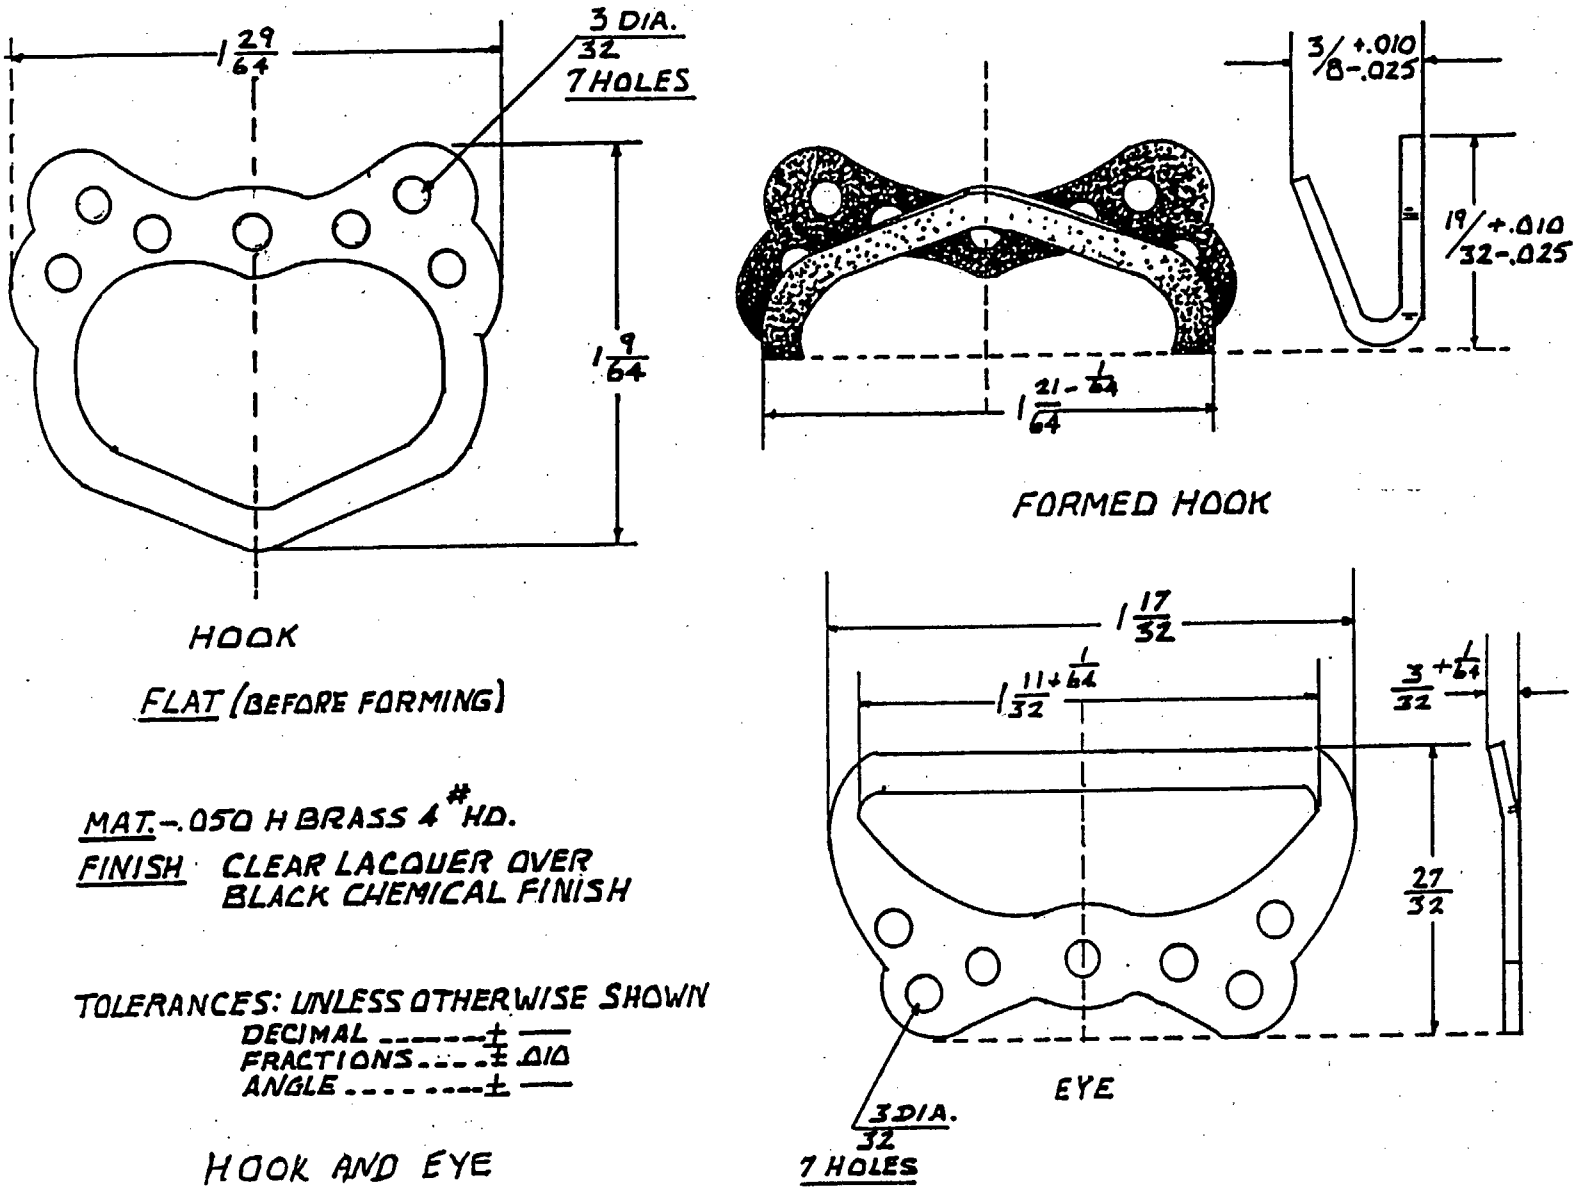


Fig 10' Coat, Man's Full Dress, Summer & Winter, Scarlet

US Marine Band, Drum Major/Director

Source: https://assist.dla.mil - Downloaded: 2026-03-26T04:29Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	1. DOCUMENT NUMBER	2. DOCUMENT DATE (YYMMDD)
	MIL-C-82168(MC)	19 June 1995

3. DOCUMENT TITLE

COAT'S, MAN'S: FULL DRESS, SUMMER AND WINTER, SCARLET U.S. MARINE BAND, DRUM MAJOR

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets as needed.)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a. NAME	b. TELEPHONE (Include Area Code) (1) Commercial	(2) AUTOVON
COMMANDER, ATTN PSE-C/S	(703) 784-4584	278-4584
c. ADDRESS (Include Zip Code) MARCORSYSCOM 2033 BARNETT AVENUE SUITE 315 QUANTICO VA 22134-5010	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT: Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.