MIL-C-82189A(MC)
29 September 1981
SUPERSEDING
MIL-C-82189(MC)
7 August 1968

MILITARY SPECIFICATION

COAT, MAN'S: FULL DRESS, U. S. MARINE BAND, OFFICER'S

This specification is approved for use by U. S. Marine Corps, Department of the Navy, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for U.S. Marine Band officer's full dress coats.

1.2 Classification. The coats shall be of one type in the following classes and sizes, as specified (see 6.2):

Class 1 - Director- Coat, Full Dress, Wool; Black
Class 2 - Assistant Director- Coat, Full Dress, Wool; Scarlet

Schedule of Sizes
(Short, Regular, Long, Extra Long)

34	40
35	41
36	42
37	44
38	46
39	

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to the Commandant of the Marine Corps (LMA-1), Headquarters, U. S. Marine Corps, Washington, D. C. 20380, by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8405

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

2. APPLICABLE DOCUMENTS

2.1 Issue of documents. The following documents of the issue in effect on the date of invitation for bids or request for proposal, form a part of the specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

V-T-276	- Thread, Cotton
V-T-280	- Thread, Gimp, Cotton, Buttonhole
V-T-301	- Thread, Silk
DDD-L-20	- Label; For Clothing, Equipage and Tentage (General Use)
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached or Dyed).

MILITARY

MIL-C-326	- Cloth, Silesia, Cotton
MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-3461	- Buttons, Insignia, Metal, Uniform and Cap
MIL-P-15064	- Pads, Shoulder and Sleeve Head
MIL-C-16375	- Cloth, Wigan, Cotton
MIL-L-17507	- Lace, Ornamental
MIL-E-17568	- Embroidery Materials, Metallic and Synthetic Metallic
MIL-C-21115	- Cloth, Tropical: Wool; Polyester/Wool
MIL-C-29365	- Cloth, Nonwoven: Interlining, Fusible, Nylon and Polyester, Polyamind
MIL-C-82114	- Coat Front; For Coats, Musicians
MIL-O-82194	- Ornamentation: For Jacket, Man's, Evening Dress

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams and Stitchings

MILITARY

MIL-STD-105	- Sampling Procedures And Tablets For Inspection by Attributes
MIL-STD-129	- Marking for Shipment and Storage

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

(Copies of specifications and standards required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

LAWS AND REGULATIONS

U. S. Postal Service Manual

(Copies of the Manual may be obtained from the Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402.)

UNIFORM CLASSIFICATION COMMITTEE

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to the American Trucking Association Inc., Tariff Order Section, 1616 P Street, N.W., Washington D. C. 20036.)

Department of Defense (DOD) Standard Color Card of
Official Standardized Shades for Sewing Threads, 1968

(Copies may be obtained from the Color Association of the United States, Inc., 200 Madison Avenue, New York, New York 10016.)

3. REQUIREMENTS

3.1 Standard samples. Standard samples are furnished solely for guidance and information to the contractor (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

3.2 First article. When specified (see 6.2), the contractor shall furnish sample coats for first article inspection and approval.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3 Materials.

3.3.1 Basic material. The basic material for each class of coat shall be as follows:

3.3.1.1 Class 1. Cloth, wool and polyester tropical, black shade 2607 (see 6.3), 8.5 to 9.5 ounce, conforming to type III of MIL-C-21115.

3.3.1.2 Class 2. Cloth, wool, tropical, scarlet shade 2502 (see 6.3), 10.5 ounce, conforming to type I, class 1 of MIL-C-21115.

3.3.2 Lining. The material for lining the coat and collar and for making eyelet cover, coat hanger and the straps to secure the lining to the bottom edge of coat shall be cloth, rayon twill, black shade 2604 (see 6.3), for class 1 coats and scarlet shade 2506 (see 6.3), for class 2 coats, 3.7 ounce, conforming to class 1 of MIL-C-368.

3.3.2.1 Bias binding. The binding for the armhole shields shall be bias cut out of the lining material specified in 3.3.2. The binding shall be 3/4 inches wide and shall have sized edges.

3.3.3 Piping. The materials for piping the front and botton edges of the coat and the ornamental back patch shall be cut 1-1/8 inches wide and shall conform to the following:

3.3.3.1 Class 1. Cloth, wool, tropical, scarlet shade 2502, 10.5 ounce, conforming to type I, class 1 of MIL-C-21115.

3.3.3.2 Class 2. Cloth, wool and polyester tropical, black shade 2607, 8.5 to 9.5 ounces, conforming to type III of MIL-C-21115.

3.3.4 Silesia. The material for making the stays for the armhole and shoulder seams and the collar interlining shall be black conforming to type I of MIL-C-326.

3.3.5 Front interlining. The interlining for the upper front shall be cloth, nonwoven, interlining, fusible conforming to MIL-C-29365.

3.3.6 Coat fronts. Coat fronts shall conform to class 1 of MIL-C-82114.

3.3.7 Collar interlining. The collar interlining shall be cloth, cotton, buckram, double texture, laminated, starch finish, natural color, conforming to the following when tested as specified in Section 4, Table III.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.7.1 Cotton buckram. The buckram shall be made of corded cotton of suitable staple length and grade, throughly cleaned, well drawn and evenly spun to meet the requirements of this specification.

3.3.7.2 Weave. The weave of the single plies of the cloth shall be four harness, two up two down herringbone twill, 20 ends right and 20 ends left.

3.3.7.3 Texture. The two plies of the cloth shall each have a minimum thread count per inch of 50 in the warp and 20 in the fillings.

3.3.7.4 Laminated cloth. The two plies of the cloth shall be thoroughly adhered together with a synthetic resin type laminating material which shall not cause any objectionable odor in the finished cloth. The laminated cloth shall show no evidence of delamination after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests specified in Section 4, Table III.

3.3.7.4.1 Laminated cloth finish. The cloth shall have a starch finish. The orignial stiffness of the finished cloth, and the stiffness of the cloth after being subjected to the wet (dry) cleaning, accelerated aging, and perspiration tests, shall conform to the following when tested as specified in Section 4, Table III.

Stiffness, inch-pound:	Minimum	Maximum
-original	0.60	0.95
-after accelerated aging	0.70	0.95
-after wet (dry) cleaning	0.50	0.85
-after perspiration	0.50	0.85

3.3.7.4.2 Weight. The weight of the finished laminated cloth shall be 21 to 23 ounces per square yard as specified in Section 4, Table III.

3.3.7.4.3 Breaking strength. The breaking strength of the finished laminated cloth shall be 100 pounds minimum in the warp direction and 8 pounds minimum in the filling direction, when tested as specified in Section 4, Table III. After being subjected to the accelerated aging test, the breaking strength of the cloth shall be not less than the original breaking strength when tested as specified in Section 4, Table III.

3.3.8 Wigan. The material for reinforcing the bottom edge of sleeves shall be cloth, cotton, wigan, 2.5 ounces, conforming to type I of MIL-C-16375.

3.3.9 Stay tape. The stay tape for the armholes and waist seam shall be cotton, 1/4 inch wide, conforming to type III, class 1 of DDD-T-86.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

3.3.10 Sleeve head pad. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.3.11 Shoulder pads. The shoulder pads shall conform to type I, class 2 of MIL-P-15064.

3.3.12 Thread.

3.3.12.1 Silk thread. The silk thread shall conform to V-T-301. The thread for machine sewing shall conform to type I, size A for all outside seaming and stitching; sizes B and F for buttonhole, bobbin and needle thread, respectively, and size 0 for machine felling. The thread for outside hand sewing shall conform to type III, size C, 2 ply.

3.3.12.2 Cotton thread. The cotton thread shall conform to V-T-276, type IC2, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching; type IB3, glazed finish, ticket No. 24, 4-ply for sewing on buttons, and machine tacking the armholes; and type IA3, soft finish, ticket No. 70, 2 ply for serging and overedge stitching. The thread for basting shall be a good commercial grade.

3.3.12.3 Thread color and colorfastness. The thread shall be black for class 1 coats and scarlet shade W, cable No. 66040 for class 2 coats, except the silk thread for stitching the braid shall be yellow and the cotton thread for tacking sleeve lining, hand felling facing to interlining, and basting and machine tacking armholes may be white. (See DOD Standard Color Card of Official Standardized Shades for Sewing Threads, 1968.) The colored threads shall show the following colorfastness when tested as specified in the applicable thread specification:

Thread	Color	Wet (dry) cleaning	Light
Cotton	Scarlet	Fair	-----
Cotton	Black	Good	Good
Silk	Scarlet	Fair	Fair
Silk	Yellow	Good	Good

3.3.13 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of V-T-280. The color of the gimp shall closely match the shade of the basic material and shall show fair fastness to wet (dry) cleaning.

3.3.14 Coat front braid. The gold braid for the coat fronts shall conform to the following when tested as specified in Section 4, Table III.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Cover	
- material (covering)	Metal thread
- color of wire	Light gold
- metal wire (undercoating)	Silver and copper
- plating material	Gold
- winding thread	2 ply bleached white cotton thread
Core (stuffer)	
- material	Cotton thread (soft)
- number of threads	7
- ply of thread	2
- color	gold
Weave	
Number of carriers	12
Ends/carrier	Varies from 6 to 8 (total 79)
Shape	Tubular
Width (in.)	5/16
Weight/linear yd (grains)	154.5
Metal content (%)	
- gold	0.3
- silver	0.6
- copper	Remainder (with traces of nickel and zinc)
Fastness to	
- water	Good
- dry cleaning	Good

3.3.15 Collar braid. The braid for the collar shall conform to type II, class I, style A of MIL-L-17507.

3.3.16 Sleeve ornamentation. The sleeve ornamentation shall conform to type III of MIL-O-82194 except that the embroidery yarns used shall be tarnish-resistant, synthetic, metallic yarn conforming to MIL-E-17568. (See 6.2 for class required)

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.17 Buttons.

3.3.17.1 Insignia buttons. The insignia buttons shall be metal, gold plated, officer design, 27-line and 40 line, regular shank, conforming to type I, style 4, class A, subclass 1 of MIL-B-3461. Thirty (30) buttons are required for each coat including the sleeve ornamentation.

3.3.17.2 Ring toggles. Ring toggles for securing buttons to fronts, sleeve ornamentation and backs shall conform to MIL-B-3461.

3.3.18 Hooks and eyes. The hooks and eyes for closing the collar shall be brass, black enameled finish, No. 16, commercial type. There shall be three hooks and three eyes per coat, conforming to the requirements specified in Section 4, Table III. All surfaces and edges of the hook and eye shall be clean, smooth, free from burrs, tool marks, sharp edges, and roughness. The hook and eye shall be thoroughly and completely lacquered with the best available quality of black japanned lacquer. The dry lacquer film shall be continous, level, adherent, free from lint, dust or other foreign inclusions that may affect appearance or serviceability, and shall withstand the test for tackiness specified in Section 4, Table III.

3.3.19 Labels. Each coat shall have a combination identification/personal label and a size label conforming to DDD-L-20, and the following. The coat is intended to be dry cleaned and the labels shall show fastness to dry cleaning.

3.3.19.1 Combination identification/personal label. The combination identification/personal label shall be type I, classes 1 and 10 (combined) of DDD-L-20 except all printing and the space between the lines of printing shall be minimum 10 points (approximately 1/8 inch). The content and format shall be as follows:

NAME _____
SERVICE NO. _____
COLLAR SIZE _____
NOMENCLATURE _____

CONTRACT NO. _____ DATE _____
NAME OF CONTRACTOR _____
WOOL PRODICTS ACT INFORMATION _____

NOTE: Size of characters for "Name of contractor" shall be minimum 8 points (approximately 3/32 inch).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.3.19.2 Size label. The size label shall be type I, class 2 of DDD-L-20 and shall measure not less than 1-1/2 inches by 1 inch. The label shall consist of the numerical size designation specified in 1.2 followed by the letters S, R, L or XL for Short, Regular, Long and Extra Long, and the stock number as shown by the following example:

$$\frac{40R}{\text{Stock Number}}$$

The stock number may be omitted from the size label, but when omitted, it shall be incorporated in the identification label.

3.4 Design. The coat shall be the U. S. Marine Corps design shown on Figures 1 through 12; a semiformfitting, single breasted, fully lined coat with 12 gold plated insignia buttons on the right front and 6 gold plated insignia buttons on the left front and 6 rows of gold braid on the upper fronts; skirt type lower body parts with waist darts; a waist seam, a three-piece back with 6 gold plated insignia buttons on the ornamental patch at the center back; ornamental sleeve piece with 3 gold plated insignia buttons; a stand-up collar with gold braid and hooks and eyes for front closure and worked eyelets. The front and bottom edges of coat and the center back ornamental patches shall be piped with the applicable piping for each class coat.

3.5 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working patterns. The contractor's working patterns shall be identical to the standard patterns. The standard patterns provide 3/4-inch allowance for side seams and for seams joining skirt to center back; and 3/8-inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size, seam allowance, directional lines for cutting and are marked and notched for proper placement and assembly of component parts.

3.5.1 List of pattern parts. The coat shall be cut from the specified materials in accordance with the number of pattern parts indicated below:

Item	Pattern Nomenclature	No. of Cut Parts
	Material: Basic	
1.	Front (upper)	2
2.	Skirt (lower body part)	2
3.	Side body front	2
4.	Front facing, right	1
5.	Front facing, left	1
6.	Center back	1
7.	Side back	2
8.	Top sleeve	2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Item	Pattern Nomenclature	No. of Cut Parts
	Material: Cloth, Rayon lining (cont'd)	
9.	Under sleeve	2
10.	Collar	1
11.	Ornamental back patches	4
12.	Underarm shields	2
13.	Front, upper	2
14.	Top sleeve	2
15.	Under sleeve	2
16.	Skirt (lower body lining)	2
17.	Center back	2
18.	Side back	2
19.	Collar lining	1
20.	Collar eyelet cover	2
21.	Front eyelet cover	1
	Material: Cloth, Cotton, Silesia	
22.	Collar interlining	1
	Material: Cloth, Cotton, Buckram	
23.	Collar interlining	1
	Material: Cloth, Cotton, Wigan	
24.	Sleeve reinforcement	2
	Material: Cloth, Non Woven, Interlining	
25	Front (fusible)	2
	Marker	
26.	Sleeve ornamentation marker	

3.6 Construction.

3.6.1 Manufacturing requirements. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table 1. The contractor is not required to follow the exact sequence of the operations listed in Table I but all operations specified shall be used to manufacture the coats.

3.6.1.1 Stitches, seams and stitching. The stitch, seam and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted. All overedge or serge stitching shall be done on serging machines with knife attachment properly set to trim the raw edge when overedged without cutting the material.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.6.1.2 Tacking and backstitching. Ends of seams and stitching produced with 301 type stitch, when not caught in other seams and stitchings, shall be securely backtacked not less than 1/2 inch. Thread breaks (all stitch types) shall be secured by stitching back of breaks not less than 1/2 inch.

3.6.2 Shade marking. The component parts of each class coat cut from one piece of the applicable wool materials and lining material, including pairs of sleeve linings and underarm shields when cut from ends, shall be shade marked to insure uniform shade and size throughout the garment. Any method of shade marking may be used except:

1. Corrosive metal fastening devices.
2. Sew-on shade tickets.
3. Adhesive type tickets whose adhesive shows discoloration and whose adhesive mass adheres to the material upon removal of the tickets.
4. Any marking medium which would tend to leave a permanent mark.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
1.	Cutting. a. Cut coats in strict accordance with patterns furnished. b. Cut all materials in the direction indicated by the directional line on the patterns. c. Cut all wool parts from one piece of basic material for each class coat. d. Cut the strips for the shoulder loops from basic material in the warp direction, 2-3/4 inches long and sufficient width so that the finished loops will be 5/8 ± 1/8 inch wide and 3/4 to 1 inch long.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
1.	Cutting. (cont'd) e. Cut the body, collar linings and collar eyelet covers from one piece of rayon lining material. All other rayon lining parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the sleeve linings shall match. Cut the strips for the coat hanger and for the lining securing straps 1-1/8 inches wide. f. Cut cotton silesia stays for armhole and shoulder seams and lower edge of armhole on the bias, 3/4 inch wide and 4 ± 1/4 inches long. g. Cut the applicable material for piping the front and bottom edges of coat and ornamental back patches on the straight warp direction. The piping shall be cut 1-1/8 inches wide for bottom and front edges and 5/8 inch wide for ornamental back patches. h. Cut fusible interlining in accordance with pattern furnished. i. The use of drill holes is prohibited.					
2.	Replacement of damaged parts. a. Replace, at time of cutting, any part containing damages, such as holes or seriously weakening defects, such as smashes, multiple floats, and slubs likely to develop into holes. b. Replace any part damaged during manufacturing process by needle chews which may be expected to develop into a hole, scissors or knife cuts, tears, holes, mends, or burns.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
3.	Shade marking.					
	a. Shade marking (see 3.6.2) shall be for the purpose of insuring proper assembly, uniform shade and size of components for each class coat.					
	b. Mark or ticket all component parts cut from one piece of the applicable wool materials for each class coat. Mark or ticket all component parts cut from one piece of rayon lining material and the pairs of sleeve linings when cut from ends.					
	c. The use of tickets with metal fastening devices is prohibited on the rayon lining.					
4.	Make shoulder loops.					
	Finished appearance. The finished loops shall be uniform in width and length and shall finish 3/4 + 1/8 inch wide and 1 ± 1/8 inches in length.					
	a. Fold the strip for the loops in half lengthwise and seam together 1/4-inch from raw edge.	301	EFp-1	10-14	A	A
	b. Press the seam open, smooth and flat with a heated pressing iron.					
	c. Turn loops right side out, with seamline in center of underside and press smooth and flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
5.	Make coat hanger and lining securing straps.					
	Finished appearance. The coat hanger and lining securing straps shall finish 1/4 to 3/8 inch wide.					
	a. Fold the 1-1/8-inch-wide strip of lining material in half lengthwise. Turn the edges to the inside and seam 1/16 inch from the turned edges.	301	EFp-1	10-14	A	A
	b. Cut the coat hanger 3-3/4 ± 1/4 inches long.					
	c. Cut the lining securing straps 4-1/2 ± 1/4 inches long.					
6.	Make collar eyelet covers.					
	Finished appearance. The collar eyelet covers shall finish 1-3/4 ± 1/8 inches wide.					
	a. Turn under the side edges of the collar eyelet covers and stitch 1/8 inch from the folded edges, catching the turned-under portions in the stitching.	301	EFa-1 (each side edge)	10-14	A	A
	b. Fold each cover in half across the width and seam 1/16 inch from the folded edges.	301	SSc-1	10-14	A	A
7.	Make front eyelet cover.					
	a. Fold front eyelet cover in half lengthwise and stitch across bottom edge with 1/4-inch seam.	301	SSa-1	10-14	A	A
	b. Turn the cover right side out. Press and crease the folded and seamed edges smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
8.	Make armhole shields.					
	Finished appearance. The armhole shields shall be made from one ply of basic material and shall finish without puckers, gathers, or raw edges.					
	a. Bind the rounded edge of shield with bias binding, turning under the outside raw edge of the binding only, and catching the turned under portion in the stitching 1/16 inch from folded edge.	301 or 401	BSb-1	10-14	A	A
	b. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
9.	Make collar.					
	Finished appearance. The collar shall finish smooth and flat without distortion. Edges shall be uniformly even.					
	a. The collar shall be made of one ply of basic material, lining, silesia and cotton buckram.					
	b. Seam the silesia and cotton buckram together 1/8 to 3/16 inch from all edges and trim silesia even with the edges of the buckram.	301	SSa-1	10-14	A	A
	c. Lap the upper edge of the silesia side of the interlining approximately 1/2 inch on the inside of the upper edge of the collar outer ply and seam together 1/4 inch from the raw edge of interlining. The outer ply shall extend not less than 3/4 inch at each end of collar interlining.	301	LSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
9.	Make collar. (cont'd)					
	d. Smoothly fold the outer ply over lower and upper edges of the interlining. Tack the portion of outer ply folded to inside, at the lower edge to silesia. Stitching shall not be through outer ply of collar.	Hand		2-3	C (silk)	
	e. Fold ends of outer ply to inside over ends of interlining, and tack to silesia with overcast stitching, turning under the upper and lower edges sufficiently so as not to be visible in the finished collar.	Hand		2-3	C (silk)	
10.	Baste braid to collar. (See Fig 9)					
	a. Baste braid to collar with the outer edges of braid 1/8 inch from all edges. Baste braid on both edges with top and bottom strands of braid folded over the end strands. The beginning and ends of braid shall be at a corner.	Hand		2-6		
	b. Baste down folded edge of turned corners of braid to braid along end of collar.	Hand		2-6		
	c. Position and baste ends of braid at the corner in such a way that the braid shall seem continuous without a break.	Hand		2-6		
11.	Stitch braid to collar. (See Fig 9)					
	Finished appearance. The finished braid shall be smooth, flat, firmly attached, uniformly positioned and uniformly stitched. Raw edges and loose threads shall not be visible.					
	a. Stitch braid to collar 1/16 inch from both edges of braid and along the folded edges at corners. Braid may be stitched without basting provided the proper appearance and neatness requirements are maintained.	301	SSaa-2 (strands) OSe-1 (corners)	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
11.	Stitch braid to collar. (cont'd) b. Press collar smooth and flat, shrinking where necessary, with a heated pressing iron or pressing machine.					
12.	Attach eyelet cover and collar lining to collar. (See Fig 10) Finished appearance. Stitches attaching lining to collar shall be uniform and a minimum of 1/16-inch from the edge of collar. a. Mark the inside of the collar for positioning the collar eyelet covers. Trim and remove all loose ends of thread.					
	b. Position the eyelet cover and the collar lining respectively on the inside of the upper edge of the collar with lining and eyelet cover facing up. Lap the upper edge of the collar lining and eyelet cover aproximately 1/2 inch. Stitch collar to lining and eyelet cover through all plies and adjacent to the stitch of the gold braid at the upper edge. The line of stitching shall extend from center to center of eyelet covers. The lining shall extend a minimum of 1/2 inch beyond the right end of collar and 2-3/4 inches beyond the left end of collar.	301	LSa-1	10-14	A (silk)	A
	c. Turn collar lining and eyelet covers at the seam to the inside of collar and press smooth and flat with a heated pressing iron or pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
13.	Make eyelet in collar.					
	Finished appearance. Eyelets shall be well worked with the purling on the outside of the collar, and shall finish with a 1/8-inch-diameter opening.					
	a. Turn collar lining at the seam to the inside of the collar and press smooth and flat with a heated pressing iron or pressing machine.					
	b. Make one eyelet through all plies at each end of the collar midway (± 1/16 inch) between the top and bottom edges and 1-3/4 ± 1/8 inches from finished ends. The eyelet cover shall not be caught in the stitching.	Eye-let		20 per eyelet (minimum)	A (silk)	A
14.	Make collar extension tab. (See Fig 10)					
	Finished appearance. The collar extension tab shall extend 3/4 to 7/8 inch beyond the folded edge at the left end of collar.					
	a. Turn the top and bottom edges at the end of the collar lining at the left end of the collar to the inside of the lining and baste the turned portion along the top, front and bottom edges to the body of the lining, forming the collar extension tab.	Hand				
	b. Stitch the collar extension tab 1/16 inch from the top, front and bottom edges and continue the stitching at the back of tab to top row.	301	SSc-1 (top)	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
15.	Stitch and press dart in under sleeves.					
	a. Fold the under sleeve, matching the cut edges of the under sleeve dart. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole and taper the line of stitching to zero at the lower folded edges.	301	SSa-1 (cut edges) OSf-1 (folded edges)	10-14	A	A
	b. Spread open the cut edges of the dart, turn the folded edge flat against the body of the undersleeve and press the entire dart smooth and flat with a heated pressing iron.					
16.	Seam sleeves at forearm					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly.					
	a. Position the top sleeve with upper forearm edge in line with the notch in the armhole edge of under sleeve and with the notches in the lower forearm edge of top and under sleeve matching. Seam the top and undersleeve together 3/8 inch from the forearm edge of top sleeve forming a tapered outlet on the under sleeve.	301	SSa-1	10-14	A	A
	b. Spread open the seam and press flat with a heated pressing iron.					
17.	Baste wigan reinforcement to sleeve.					
	a. Position the sleeve on the wigan reinforcement piece with marks and notches matching.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
	b. Baste sleeve and wigan piece together at the mark for the bottom turnup.	Hand or 101		2-4		
18.	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve at the backarm with a 3/8-inch seam, catching the ends of the wigan reinforcement piece in the stitching.	301	SSa-1	10-14	A	A
	b. Spread open the seam and press smooth and flat with a heated pressing iron.					
19.	Tack sleeve turnup to reinforcement.					
	a. Turn up the bottom edge of sleeve and baste along the folded edge.	Hand or Machine		2-3		
	b. Tack the raw edge of the turned under portion to the reinforcement wigan piece with blindstitching.	103	EFc-1(b)	4-6	A	
		or 301	EFc-1(b)	4-6	A	A
		or Hand		4-6	A	
20.	Stitch and press dart in under sleeve linings.					
	a. Fold the under sleeve lining, matching the cut edge of the under sleeve dart. Stitch the entire length of the dart 1/4 inch from the cut edges at the armhole and taper the line of stitching to zero at the lower folded edge.	301	SSa-1 (cut edge) OSf-1 (folded edge)	10-14	A	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
	b. Turn the cut edges of the dart toward the forearm edge and press the entire dart smooth and flat with a heated pressing iron.					
21.	Stitch sleeve lining at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Position the top sleeve lining with upper forearm edge in line with the notch in the armhole edge of under sleeve lining and with the lining at lower forearm edge of top and under sleeve linings even. Seam the top and under sleeve linings together 3/8 inch from the forearm edge of topsleeve lining, forming a tapered outlet on the under sleeve lining.	301	SSa-1	10-14	A	A
22.	Seam sleeve lining at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers or pleats and shall start and finish evenly.					
	a. Join the top and under sleeve linings at the backarm with a 3/8-inch seam.	301	SSa-1	10-14	A	A
23.	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve linings shall be seamed to the sleeve without twists, gathers, puckers or pleats.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
	a. Position the sleeve lining on the sleeve with the upper edge of the lining extending approximately 1 inch beyond the armhole edge of the sleeve.					
	b. Tack the sleeve lining to the forearm and backarm seam allowance, respectively, of the top sleeve, commencing at the top edge of the wigan reinforcement piece and extending to approximately 6 inches from armhole edge at backarm and approximately 4-1/2 inches from armhole edge at forearm.	301 or Hand		4-6 1-2	A A	A
	c. Turn the sleeve linings right side out.					
24.	Fell turnup of sleeve lining; press sleeves.					
	Finished appearance. The sleeve lining shall not be short, tight or twisted at bottom of sleeves.					
	a. Turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 inches from finished end of sleeve and baste to turnup of sleeve. The bottom sleeve lining may be felled without basting the bottom.	Hand or 301	EFc-1 (b)	8-10 6-8	C (silk) 0 (silk)	0
	b. Fell the folded edge of sleeve lining to the turnup of the sleeve.	Hand or 301	EFc-1(b)	8-10 6-8	C (silk) 0 (silk)	0
	c. Turn the sleeves right side out and assemble in pairs. Press the lower half of sleeves smooth and flat creasing at the forearm and backarm. The backarm crease shall be on the backarm seam.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
25.	Make ornamental back patches. Finished appearance. The ornamental back patch shall be uniform in appearance and shall finish smooth and flat, without twists, gathers, pleats, puckers or other distortions. The piping shall be evenly worked out and shall extend uniformly 1/8 inch beyond the seamed edges of the back patch. a. The ornamental back patch shall be made of two plies of basic material, piped with a 5/8-inch-wide strip of the applicable piping material specified in 3.3.3.1 and 3.3.3.2.					
	b. Turn under one edge of the piping 1/4 inch and seam the turned under portion to the body of the piping 1/8 inch from the folded edge.	301	EFa-1	10-14	A	A
	c. Position the scalloped side and the bottom raw edges of the top ply of patch even with the raw turned under edge of the piping.					
	d. Seam the piping to the scalloped side and the bottom edges of the top ply, 1/8 inch from the edges. Trim and notch piping in accordance with good manufacturing practice in order to prevent pulling, and to eliminate gathers and bulges at the corners.	301	SSe-2(a)	10-14	A (silk)	A
	e. Properly position and seam together the top and under plies of the ornamental back patch through the piping, 1/8 inch from the raw piped edges of the top ply. Trim the the excess material from the under ply where necessary.	301	SSk-1(a) (without cord and top-stitched)	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
25.	Make ornamental back patches. (con't)					
	f. Turn the back patches, working the piping out completely and forming smooth corners and point at the scalloped side edges.					
	g. Top stitch the back patches uniformly 3/16 inch from the folded edge of the piping.	301	SSk-1(b) (without cord and top-stitched)	10-14	A	A
	h. Press ornamental back patches smooth and flat with a heated pressing iron or pressing machine. Assemble back patches in pairs.					
26.	Sew on identification label.					
	Finished appearance. The identification label shall be positioned so that in the finished coat, the label shall be midway between front and back edges of the right facing, with the bottom edge of the label approximately 4 inches from the bottom finished edge of coat.					
	a. Sew the identification label to the outside of the right facing with a single row of stitches 1/16 inch from each edge.	301	SSa-1 (each edge)	10-14	A	A
27.	Assemble body lining.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					
	a. The body lining shall consist of an upper front, a side back panel, a center back panel and skirt.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
27.	Assemble body lining. (con't)					
	b. Fold the upper front lining lengthwise, with notches matching, and stitch front darts in accordance with marks indicated on pattern. The line of stitching for the waist dart shall be 3/8 inch from the folded edge of the dart at the waist, tapering to a flat point at the top end, and shall be securely backtacked.	301	OSf-1	10-14	A	A
	c. Fold underarm dart in front and seam with a 3/8-inch seam at the center, tapering to zero at the upper and lower ends.	301	OSf-1	10-14	A	A
	d. Position the back side panel and fronts with edges even and notches matching. Seam together at the side seam with 3/4-inch seam.	301	SSa-1	10-14	A	A
	e. Position center back panel and side back panel with edges even and notches matching. Join together with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	f. Overedgestitch the side front seam allowance together.	503 or 504	EFd-1	6-10	70/2	70/2
			EFd-1	6-10	70/2	70/2
	g. Overedgestitch the side back seam allowance together.	503 or 504	EFd-1	6-10	70/2	70/2
			EFs-1	6-10	70/2	70/2
	h. Fold the skirt dart in accordance with marks on patterns and press the length of the dart. Lower end of the dart shall taper to a flat point. Dart shall finish approximately 5-1/4 inches long.					

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
27.	Assenble body lining. (cont'd)					
	i. Position the upper and lower parts of assembly with front edges even and join together at the waist with a 3/8-inch seam and with the upper edge of the 3/4-inch fold dart caught in the stitches.	301	SSa-1	10-14	A	A
	j. Overedge stitch the waist seam allowance together.	503 or 504	EFd-1	6-10	70/2	70/2
			EFd-1	6-10	70/2	70/2
28.	Attach front eyelet cover to facing.					
	a. Fold front eyelet cover in half lengthwise right side out. Press the cover smooth and flat with a heated pressing iron or pressing machine.					
	b. Position the eyelet cover on the outside of the left front facing with the top, bottom and front raw edges even. Stitch the cover to the facing 3/16 to 1/4 inch from raw edges.	301	SSa-1	10-14	A	A
29.	Seam wool facing to assembled lining.					
	Finished appearance. The lining shall be carefully and properly aligned and seamed to the facing so that in the finished coat, the lining shall lie smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defect or distortion.					
	a. Properly position the lining on the wool facing with the top edges even.					
	b. Seam the front edge of the lining to the back edge of the facing with	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
29.	Seam wool facing to assembled lining. (cont'd)					
	3/8-inch seam. The stitching shall extend from the top edge of the facing to approximately 1-1/4 inches from botton edges.					
	c. Overedgestitch the facing-lining seam allowance together.	503 or 504	EFd-1	6-10	70/2	70/2
			EFd-1	6-10	70/2	70/2
	- or -					
	d. Join the aforementioned seams by joining the seams and overedge-stitching the raw edges together simultaneously.	515 or 516 or 517	SSa-2	10-14	A (joining stitch) and 70/2 (overedge)	A 70/2
	e. Press all seams and darts smooth and flat. Press the waist seam towards the bottom and all other seams towards the back.					
30.	Make outer assembly.					
	Finished appearance. All darts and joining seams shall finish smooth and flat without pleats, puckers or gathers. The seams shall start and finish evenly.					
	a. The assembly shall consist of an upper front, a side front panel, a side back panel, center back and skirt.					
	b. Position the upper front interlining on the inside of their respective fronts and fuse.					
	c. Overedgestitch the following raw edges of basic material; the waist seam, underarm seam, side seam and side back seam.	503 or 504	EFd-1	6-10	70/2	70/2
			EFd-1	6-10	70/2	70/2

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
30.	Make outer assembly. (cont'd)					
	d. Fold upper front lengthwise with bottom notches matching and stitch front darts in accordance with marks on the pattern. The line of stitching shall be 1/2 inch from the folded edge of the dart at the bottom, tapering to a flat point at the top end of the dart and shall be securely backtacked.	301	OSF-1	10-14	A	A
	e. Properly position the upper front and side panel, with edges even, and join together with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	f. Position the back side panel and front side panel with edges even and notches matching. Seam together at the side seam with 3/4-inch seam.	301	SSa-1	10-14	A	A
	g. Fold the back skirt lengthwise with the upper notches matching and stitch darts in accordance with marks as indicated on the pattern. The line of stitching shall be 3/4 inch from the folded edge of the dart at the top, tapering to a flat point at the bottom end of the dart and shall be securely backtacked.	301	OSf-1	10-14	A	A
	h. Press skirt dart and upper front waist dart flat on dart seam without turning dart either to the right or left. Dart shall be equally distributed between right and left side of dart seam.					
	i. Spread open the underarm and side seam and press flat with a heated pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
30.	Make outer assembly. (cont'd)					
	j. Properly position the upper and lower assemblies with fronts and edges even and join together at the waist with a 3/8-inch seam. The 1/4-inch-wide stay tape shall be positioned on the upper assemblies 1/4 inch from the lower edge and shall be caught in the stitching.	301	SSa-1	10-14	A	A
	k. The tape shall be sewn with normal tension, not loose or tight, and shall extend from the side back seam to not more than 3 inches from the front edge of the front.					
	l. Spread open the waist seam and press flat with a heated pressing iron.					
	m. Press and shape the fronts on a suitable type heated pressing machine from the waist to the top edge, shrinking the fronts to eliminate the excess fullness of the chest.					
31.	Stitch ornamental back patches to skirt.					
	Finished appearance. Patches shall be joined without distortion either to patch or coat.					
	a. Position the patch on back edge of skirt with raw top and back edges even. Join together 3/8 inch from the back raw edge starting 1/2 inch below the top edge of waist line.	301	SSa-1	12-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
32.	Join center back. Finish appearance. The back seam shall start and finish evenly and shall be smooth without gathers, pleats, or puckers.					
	a. Properly position and join the left and right assemblies to the center back with a 3/8-inch seam. The stitching shall extend 3/4 inch below the waist seam.	301	SSa-1 (above waist seam) SSaw-2 (below waist seam)	10-14	A	A
	b. Continue stitching horizontally to within 3/8 inch from the raw edge and from that point stitch vertically the length of the back patch with a 3/8-inch seam. Continue the stitching horizontally towards the front of coat for a distance of 3/8 inch and from that point stitch vertically to bottom edge of coat with a 3/4-inch seam.	301	SSav-2(b) (stitching back tab) SSa-1 (all other seams)	10-14	A	A
	c. Spread open the back seams and press smooth and flat from the armholes to the waist seam. Press back seams from waist seam to bottom of coat smooth and flat with raw edges of each seam toward the side seam. Pressing shall be done with a heated pressing iron or pressing machine.					
33.	Make eyelets in back. (See Fig 5) Finished appearance. The eyelets shall be well worked with the purling on the outside of the back and shall finish with a 1/8-inch-diameter opening. All stitches shall be securely caught in the fabric.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
33.	Make eyelets in back. (cont'd)					
	a. Mark location of eyelets in the ornamental back patches for removable buttons, in accordance with marks on pattern.					
	b. Make an eyelet at each of the marks through ornamental back patches at center back.	Eye let		22 (minimum) per eyelet	A (silk)	A
34.	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The silesia reinforcement stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers or pleats. The top end of the armhole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide silesia stays to the underside of the front edge of the armhole, 1/8 inch from the outer edges. The strip for the shoulders shall be positioned approximately 1/2 inch from the neck and armholes respectively. The strip for the upper edge of armholes shall be positioned approximately 1/2 inch from the shoulder.	301	SSaa-1	10-14	A	A
35.	Shape fronts and trim bottom.					
	a. Mark and shape the front edges of the coat. Dress the left front on a line running from the top notch to the waist seam, 1 inch from waist seam to notch at botton, as indicated on the pattern.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
35.	Shape fronts and trim bottom. (cont'd) b. Mark and shape the lower edge of coat. Trim 1/4 inch from bottom of right front beginning at front edge and tapering to zero approximately 4 inches from dressed front. c. Trim the bottom edge of the coat, matching the length of the right and left parts. Trim the bottom end of the seams. d. In the finished coat, the left front shall overlap the right front 4 ± 1/4 inches at the bottom edge.					
36.	Tape armholes. a. Sew the 1/4-inch-wide tape to the armholes, starting with one end approximately 1 inch above the front notch and continuing along the lower and back edge of the armhole to approximately 1/2 inch from shoulder edge. b. The tape shall be stitched with slight tension along the lower front edges of the armholes and shall be held taut while stitching along the back edge.	301	SSaa-1	10-14	A	A
37.	Press armholes and shoulder blades. a. Press the armhole tapes and the shoulder blades smooth and flat with a heated pressing iron or suitable type pressing machine.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
38.	Stitch piping to coat.					
	Finished appearance. The piping shall be uniformly stitched to the coat without twists, puckers or pleats. The piping shall extend from the collar notch at the top edge of the right front to the collar notch at the top edge of the left front.					
	a. Stitch the 1-1/8-inch-wide piping of the applicable piping material (see 3.3.3) to the outside of the coat with one edge of piping even with the top, front and bottom edges and with the stitching 1/8 inch from the edges.	301	SSa-1	10-14	A	A
	b. Turn the piping to the inside, folding the corners smooth and flat and working the folded edge uniformly 1/8 inch beyond the edges of the coat.					
	c. Topstitch the piped edges of the coat uniformly 3/16 inch from the folded edge of the piping.	301	SSe-2(b)	10-14	A (silk)	A
	d. Serge or overedgestitch the unattached edge of piping along the bottom edge of coat.	503	EFd-1	6-10	70/2	70/2
		or 504	EFd-1	6-10	70/2	70/2
	e. Press piping smooth and flat with a heated pressing iron.					
39.	Mark fronts for positioning the braid and buttonholes. (see Figure 6.)					
	a. Mark the location of six buttonholes on the outside of the left front. The mark for the bottom buttonhole shall be on the waist seam, the mark for the top buttonhole (line A) shall be 1 inch below the top edge of the fronts and the mark for the remaining 4 buttonholes shall be evenly spaced. (see Figure 6.)					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
39.	Mark fronts for postioning the braid and buttonholes. (see Figure 6.) (cont'd) b. Extend each buttonhole line towards the back and armhole edge. (Line B shall be 1 inch shorter than line A.) The length of the top and bottom line is determined by the position of the harp on the second line from the top which shall be approximately 1-7/8 inches from armhole edge to the center of the harp. The second line from the top shall be measured from the front edge of the buttonhole line to the center of the harp. Transfer the same measurement to the bottom line less 1 inch. Draw a straight line from the bottom line mark through center of the harp mark up to the top line, establishing line A - C and B - D as shown on Figure 6. c. Bisect the top line A - C and bottom B - D, and connect the bisecting points with a straight line E - F. d. Position left front of coat on right front, face to face with collar notches even and the left front edge 1 inch back from the right front edge at the collar notch and with waistseam and armhole edges even. e. Trace the six lines on the right front to coincide with the line on the left front. The lines on the right front shall extend approximately 2 to 2-1/4 inches from the front piped edge. The vertical lines on the right front shall be identical to lines C - D - E - F on the left front.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
39.	Mark fronts for positioning the braid and buttonholes. (see Figure 6.) (cont'd)					
	f. Draw a circle 7/8 ± 1/32 inch in diameter on each side of the six horizontal lines, centered to bisect line E - F and with the edge of each circle touching the horizontal line forming a figure 8 design as shown on Figure 6.					
	g. Position the center of the harp pattern on the line C - D, with the upper edge of the pattern positioned at the bottom of each horizontal line. Mark the harp in accordance with the pattern marker. The bottom edge of the harp must be not less than 1/2 inch from the line beneath.					
40.	Baste braid. (see Figure 7.)					
	a. Baste the braid by hand along each side of the horizontal line and around the circle figure 8 design and around the harp. The braid shall begin and end at the harp with both ends of the braid secured and tacked under the horizontal braid. On the left front, the braid shall be basted around the buttonhole line with the outer edge of the braid 1/4 to 3/8 inch from the front piped edge.					
	b. Begin with cut end of braid even with straight line at top of harp. Baste the braid along its forward edge, down the center of harp to the forward edge of harp center. Continue up the back arm along the back edge of harp, to the straight line at top using the same edge of the braid.	Hand		2-6		

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
40.	Baste braid. (see Figure 7.) (cont'd)					
	c. Baste the bottom edge of braid along the straight line to the circle, follow circle back to straight line and continue to end of straight line.	Hand		2-6		
	d. Repeat steps a, b, and c for each marking on fronts.					
41.	Tack braid.					
	a. Securely tack all unattached edges of braid to provide a smooth and flat surface for stitching.	Hand		2-6		
	b. Tack inside edges of braid circles to coat forming an inner hole approximately 1/4 inch in diameter.	Hand		2-6		
	c. Tack loops at button edge of harp together and to coat to finish secure and flat.	Hand		2-6		
42.	Stitch braid. (see Figure 7.)					
	Finished appearance. All stitching shall be done 1/16 inch from all edges whenever possible. All stitching shall be uniform and performed with one continuous thread whenever possible. Stitching across braid strands shall be done only as described or when absolutely necessary. The edges of the braid shall be securely attached to the coat except on the left front where it shall be unstitched for approximately 3 inches from the front end of the buttonhole loop braid. The braid and the stitching shall present a smooth, neat, uniform appearance.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
42.	Stitch braid. (see Figure 7.) (cont'd)					
	a. Stitch braid through fronts and interlining on both sides of the braid 1/16 inch from edge. The line of stitching shall start and finish at the harp as shown on Figure 7.	301	SSat-2	10-14	A (silk)	A
	b. Braid may be stitched without basting, provided the requirements previously mentioned are maintained.	301	SSat-2	10-14	A	A
	c. Hand stitch the inner edges of horizontal braid together on both fronts from harp ends to end of buttonhole opening on the left front and from harp ends to front ends of braid on the right front.	Hand		8-10	C (silk)	
43.	Press front.					
	a. Press the front of coat and braid smooth and flat with a suitable pressing machine, removing the fullness.					
44.	Interline fronts.					
	a. Properly position the left and right fronts on the respective coat front interlinings and baste the interlining and fronts together from approximately 3-1/2 inches down from the shoulder edge to approximately 2 inches from the bottom edge of the fronts.	Hand or 301	Hopper			
	b. Baste along the shoulder, allowing room for setting the shoulder pad and working the fullness in the fronts towards the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining, acrosss the waist dart, to approximately 2 inches from the bottom edge of fronts.	Hand or 301	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
44.	Interline fronts. (cont'd) Baste along the top edge from the basting stitches for the shoulder to approximately 1-1/2 inches from the front edge. Continue to baste approximately 1-1/2 inches from the front edge to the bottom edge of fronts.					
45.	Trim coat front interlining. a. Trim the top edge of coat interlining even with the top edge of fronts (at the gorge) from the point of shoulder to the collar notch. b. Notch the top edge of the interlining in line with the collar notch. c. Remove stitches joining the front edge of silesia to coat front interlining approximately 1/2 inch back from front and top edge of fronts. d. Trim the interlining even with the front and bottom edges of fronts. e. Turn the fronts inside out and trim the interlining to approximately 1/4 inch from the front and top edge of fronts. f. Trim the shoulder edge of the coat front interlining to approximately 3/4 inch from shoulder at armhole edge of fronts and taper the trimming to 3/8 inch at the neck.					
46.	Bind front and top edge of interlining. a. Smoothly fold the silesia over the top and front raw edge of the interlining. Secure the front	301	EFa-3	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
46.	Bind front and top edge of interlining. (cont'd)					
	turned-under portion of the silesia to the body of the interlining with three rows of stitches 1/4 inch apart, placing the first row 1/8 inch from folded front edge and catching the upper turned-under portion in the stitching.					
47.	Bind top edge of interlining.					
	Finished appearance. The cotton silesia binding shall be uniformly stitched to the top edge of the coat front interlining from the collar notch to the shoulder point (at the gorge).					
	a. Lap the 3/4-inch-wide cotton silesia binding on the outside of the coat front interlining from the collar notch to the shoulder point approximately 1/4 inch. Stitch the binding to the interlining 1/8 inch from the raw edge of the binding.	301	LSa-1	10-14	A	A
	b. Smoothly fold the free edge of the binding over the top edge and to the underside of the interlining. Secure the free edge of binding to the interlining with a row of stitches 1/8 inch from the raw edge of the binding.	301	SSe-2 (b)	10-14	A	A
48.	Fell piping to coat front interlining.					
	Finished appearance. The inner edge of piping along the left front and top edge only shall be trimmed from approximately 1 inch below the mark for bottom buttonhole, as indicated by pattern, to the collar notch at upper edge of front.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
48.	Fell piping to coat front interlining. (cont'd)					
	a. Trim the inner edge of the piping on the left front sufficiently so that in the finished coat the piping will not be visible in the front buttonholes.					
	b. Place the inner edge of piping on the outside of the interlining at the top front and bottom edges. Baste piping to interlining through the fronts.	101 or Hand		4-6		
	c. Fell the upper, front and lower inner edges of the piping to the coat front interlining.	301 or Hand	EFc-1	4-6 4-6	A A (silk)	A A
	d. Pull and remove basting stitches from piping.					
	e. Press the felled edges of piping smooth and flat with a heated pressing iron or pressing machine.					
49.	Join facing to fronts.					
	a. Position the left and right fronts to the respective front facing (face to face), with the waist line seam of the front in line with the notch on the facing and with the front piped edge approximately 3/8 inch from the front edge of facing. Mark along the top, front and bottom edge of facing.					
	b. Lap the front edge of the right and left fronts respectively on the outside of the facing at the marks and join the fronts to facing as close as possible to, but not on top of, the stitching joining the piping to the front. The stitching shall extend	301	LSa-1	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
49.	Join facing to fronts. (cont'd)					
	from the top to bottom edge of coat front edge only, catching the eyelet cover in the stitching.					
	c. Trim excess facing material where necessary.					
50.	Baste front edges.					
	a. Turn the facing-lining assemblies to the inside of fronts. Baste along the front edges, working the facing back from the folded edge of the piping.	101 or Hand		4-6		
51.	Baste facing. (Second time).					
	a. Baste the facing to the fronts approximately 1-1/4 inches from the top, front and bottom edges of the coat, holding the lower corner of the coat in such a manner as to cause the lower front edge of the fronts to roll inward towards the back edge of the facing.	Hand or 101	Hopper			
	b. Turn under and baste the top edge of the facing to the fronts from the collar notch to the front edge, catching the turned-under portion of the facing in the basting.	Hand or 101	Hopper			
	c. Baste the facing to the fronts as close as possible to the facing-lining seam, placing the fullness over the chest and distributing the fullness in the facing in accordance with good commercial practice. The	Hand or 101	Hopper			

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
51.	Baste facing. (Second time). (cont'd)					
	basting shall extend from approximately 3 inches from shoulder edge of facing to approximately 1-1/4 inches from the lower edge of facing.					
	d. Turn under and baste the bottom edge of the facing from back edge of facing to front edge.	Hand or 101	Hopper			
52.	Fell facings to interlining.					
	a. Fell the right and left facing-lining seam allowance to the respective coat front interlining from approximately 2-1/2 inches from bottom edge of coat to approximately 3 inches from the shoulder edge.	Hand or 301	SSm-1	4-6 4-6	A A	
53.	Join center back lining seam.					
	Finished appearance. In the finished lining, the waist seam of each half shall meet at the center back seam.					
	a. Join center back lining seam with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	b. Serge or overedgestitch together the raw edges of the center back seam.	503 or 504	EFd-1 EFd-1	6-10 6-10	70/2 70/2	70/2 70/2
	-or-					
	c. Join the center back seam by joining the seam and overedge stitching the raw edges together simultaneously.	515 or 516 or 517 or 518	SSa-2	10-14	A (Joining stitch) and 70/2 (overedge)	A 70/2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
54.	Baste body lining to coat.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat and baste along the entire length of the pleat. The folded edge of the pleat on the outside of the lining shall be towards the armhole.	Hand or 101	Hopper			
	b. Baste the front lining to the coat, starting at the lower end of chest pleat, continuing along the lower edge of armhole, approximately 2 inches from the edge, and ending at the side seam. Match side seams of coat and lining and continue matching as close to the side seam as possible to approximately the center of the front lining.	Hand or 101	Hopper			
	c. Fold the back lining, forming approximately a 1-inch-wide pleat at center back.					
	d. Baste back lining to coat starting at side seam and continue approximately 3 inches from armhole and shoulder edges.	Hand or 101				
	e. Fullness shall be properly distributed throughout the lining. Corresponding edges of darts and seams of lining and coat shall be even.					
55.	Hem bottom edge of lining.					
	Finished appearance. The hem shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers or pleats. The hem shall be 3/4 $\pm$ 1/8 inch wide. The lining securing straps shall be positioned on the back in line with the back seams of coat.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
55.	Hem bottom edge of lining. (cont'd)					
	a. Hem the bottom edge of body lining with the raw edge turned under and with one end of the securing straps properly positioned and caught in the stitching 1/16 inch from the upper folded edge of hem.	301	EFb-1	10-14	A	A
56.	Tack the lining securing straps to bottom of coat.					
	Finished appearance. The lining securing straps, when tacked to the bottom edge of coat, shall not cause twists or other distortions to either the coat or the lining. The end of the securing straps shall finish between the piping at bottom edge of coat and skirt seam allowance. In the finished coat, the lining shall not be visible below the bottom edge of coat.					
	a. Properly position and securely tack the free end of the securing straps to the piping at the bottom edge of coat through the back seam allowance.	301	SSb-1	10-14	A	A
	b. Position the bottom edge of the lining so that in the finished coat, the lining shall not be visible below the bottom edge of coat. Properly fold the lining securing straps across the width and stitch approximately 1/4 inch from the folded end in order to hold the lining in position.	301	OSf-1	10-14	A	A
57.	Trim lining and interlining.					
	a. Trim the excess coat front interlining and the lining at the armhole.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
57.	Trim lining and interlining. (cont'd)					
	b. Trim back lining even at the neck.					
	c. Trim the shoulder edge of the front and back lining to approximately 3/4 inch from shoulder at the armhole edge and taper the trimming to 3/8 inch at the neck.					
58.	Make buttonholes.					
	Finish appearance. The buttonholes shall be clean cut, well made and well worked over gimp to fit 40-line insignia buttons. The gimp and thread shall be pulled through to the outside of the front. The purling of the buttonhole shall be on the facing side. The inside of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of coat. The buttonholes shall be cut-first type.					
	a. Remove the basting on the unstitched portion of the braid.					
	b. Make a horizontal eyelet-end square-bar type buttonhole cut 1-1/8 inches long at each of the marks. The inside edge of the eyelet-end of the buttonhole shall be 5/8 inch from the front edge of the coats.	Buttonhole		54 stitches per buttonhole not including bartack	B (silk)	F
	c. Securely bartack the end of each buttonhole, catching the ends of the gimp and thread in the bartack. Trim the ends of the gimp and thread.	Bartack		21 per bartack	A (silk)	A
	d. Rebaste the unstitched portion of the braid and complete that portion of the stitching through all plies.	301	SSav-2	10-14	A (silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
59.	Make eyelets in fronts. Finished appearance. The eyelets shall be well worked with the purling on the outside of the coat, and shall finish with a 1/8-inch-diameter opening. All stitches shall be securely caught in the fabric. a. Mark the location of eyelets on the right and left front for removable buttons. The mark for the eyelet shall be between the braid strands at the top end of each loop. b. Mark the right front for the location of 6 eyelets to properly engage with the buttonholes in the left front. The mark for the top eyelet shall be in line with the right end of the collar, and the remaining eyelets shall be in vertical alignment with top mark and equal distance from the front edge of coat.					
60.	Press front of coat. Finished appearance. Fronts shall finish smooth and flat without distortion, with all edges uniformly worked out. a. Press the front of coat and braid smooth and flat with a suitable pressing machine, removing the fullness. b. Pull and remove all basting threads and shade tickets from fronts.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
61.	Baste shoulder pad to coat.					
	a. Insert shoulder pads between interlining and chest padding of coat fronts. Securely tack the pad to the interlining and chest padding only.	Hand or 101	Hopper			
62.	Set shoulder loops to jacket front. (See Fig 8)					
	Finished appearance. The shoulder loops shall be securely stitched without causing distortion to the shoulder. The loops shall finish 3/4 inch wide and 1 inch long.					
	a. Position the raw edge of one loop on the front of the coat at the shoulder edge, 1 1/4 inches from the raw edge of neck gorge and stitch loop to coat 1/8 inch from raw edge. The outside edge of the second loop shall be positioned 3-3/4 inches from the outside edge of the first loop at the shoulder edge. Stitch loop to coat 1/8 inch from the raw edge.	301	EFb-1	10-14	A (silk)	A
63.	Seam shoulders.					
	Finished appearance. The shoulder seam shall finish without a distorted appearance.					
	a. Join the back to the fronts at the shoulders with a 3/8-inch seam, working in the proper fullness on the backs in accordance with good manufacturing practice.	301	SSa-1	10-14	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulders short and exercising much care in pressing in order not to effect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
64.	Set shoulder loops to jacket back.					
	a. The front end of each loop shall be stitched 5/8 inch in front of the shoulder seam and aligned with each other. (See Fig 8)	301	EFb-1	10-14	A (silk)	A
	b. Fold loop to the back turning under the raw end of the loop to the 1 inch required length of the finished loop. Stitch the loop to the coat 1/16 inch from the folded edge, catching the turned-under end in the stitching.	301	EFb-1	10-14	A (silk)	A
65.	Baste shoulder.					
	a. Position the front lining and coat front interlining at the neck, shoulder and armhole edges of the fronts. Baste all plies together on the outside along the front edge of armhole and continue along the shoulder seam and the gorge, catching the shoulder pad in the basting. Turn the coat on the inside.	Hand or 101	Hopper			
66.	Baste back lining and facing-lining assembly at shoulder.					
	a. Turn under and lap the shoulder edge of the back lining on the facing-lining assembly. Baste lining to coat along the folded edge of the back lining with the top end of the chest pleat caught in the basting.	Hand				
67.	Seam neckline with size label and coat hanger.					
	Finished appearance. The neckline shall finish smooth and flat, without twists, pleats or puckers. The size label shall be positioned between the ends of the coat hanger, and the ends of the coat hanger shall be					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
67.	Seam neckline with size label and coat hanger. (cont'd)					
	positioned so that in the finished coat, the hanger opening shall be 2-1/4 inches long when measured along the lower edge of collar lining.					
	a. Join facings and back lining to coat at the neckline from collar notch to collar notch, with a 1/4-inch seam and with the upper edge of the size label and the ends of the hanger properly positioned and caught in the stitching at the inside center back.	301	SSa-1	10-14	A	A
	b. Press the neckline of the coat smooth and flat with a heated pressing iron or pressing machine.					
68.	Set collar with lining.					
	Finished appearance. The collar shall be carefully joined to the coat without distortion of the collar.					
	a. Mark the neckline on the outside 3/8 inch from top edge for proper position of collar.					
	b. Position the collar with the lower edge lapped on the outside top edge of the coat at the mark.					
	c. Seam the collar, from end to end, to the coat as close as possible to the lower edge of the collar. The stitching shall not be through the lining.	301	LSa-1	10-14	A	A
69.	Set sleeve.					
	Finish appearance. The armhole sleeve seam shall finish without twists, gathers, puckers, or pleats.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
69.	Set sleeve. (cont'd)					
	a. Position sleeve on outside of coat at the armhole, with back arm seam of sleeve matching the side back seam, and with notch in top sleeve and front matching.					
	b. Join the sleeve to the coat with a 3/8-inch seam, distributing the fullness in accordance with good manufacturing practice.	301	SSa-1	10-14	A	A
	c. Press the entire armhole smooth and flat with a heated pressing iron, exercising care not to stretch the armhole. Spread open upper part of the armhole sleeve seam from the back arm seam of the sleeve to approximately midway between shoulder seam and notch at front edge of armhole and press smooth and flat with a heated pressing iron.					
	d. Fold the excess material at armhole pit up to the line of stitching of the armhole sleeve seam, forming a hinge effect. The fold shall extend from the armhole notch to approximately 4 inches from the backarm seam.					
	e. Press the fold smooth and flat with a heated pressing iron.					
70.	Baste armhole.					
	a. Baste around the entire armhole on the inside, holding the back lining, shoulder pad and front lining in place and distributing fullness evenly. Turn coat on the outside.	Hand or 101	Hopper			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
70.	Baste armhole. (cont'd)					
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend from the backarm seam of sleeves to the front notch of coat.	Hand or 101	Hopper			
71.	Set underarm shields to coat.					
	a. Position the underarm shield on the lining side of coat with the raw edges even with lower edge of armhole.					
	b. Baste the underarm shields to coat along the vertical center and top, side and bottom edges.	Hand or 301	Hopper			
72.	Stitch sleeve head pads and linings at armhole.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleeve head pads and linings at the armhole.					
	a. Position the sleeve head pad on the sleeves with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole sleeve seam, and with the one end of the pad matching the notch in the fronts.					
	b. Stitch the sleeve head pad to the sleeve from end to end through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings and the shoulder pad in the stitching. Continue stitching the linings around the remainder of the armhole, catching the underarm shields in the stitching and trimming away the excess material.	301	SSa-1	4-6	24/4	24/4

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currenversion before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
73.	Fell facings.					
	a. Fell the facing to the piping at the bottom edge of the coat, starting at the bottom edge of the lining and continuing along the back and bottom edges of facing to the front edge of coat.	Hand		8-10	C (silk)	
	b. Fell the folded edge of the facing to the piping along the top edge from collar notch to front edge of coat.	Hand		8-10	C (silk)	
	c. Fell the front eyelet cover to the facing across the bottom edge of the eyelet cover.	Hand		8-10	C (silk)	
74.	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, placing the stitching over the folded edge of back lining and securing the top end of the chest pleat in the felling.	Hand		8-10	C (silk)	
75.	Fell sleeve lining at armhole.					
	a. Position the sleeve lining at the armhole with the back and forearm seams of the sleeve and sleeve lining matching.					
	b. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of the sleeve lining, catching the underarm shield in the felling and distributing the fullness in accordance with good commercial practice. Backstitch the lower armhole edge approximately 1-1/2 inches in front of the forearm seam to the side seam line.	Hand		8-10	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
75.	Fell sleeve lining at armhole. (cont'd)					
	-or-					
	c. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operation 74.	Machine		8-10	C (silk)	
	- or -					
	d. Machine stitch the lower edge of the sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and stitch the remaining portion of the sleeve lining at the armhole with machine simulated had felling.	Machine		8-10	C (silk)	
	NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than the hand felling.					
76.	Sew hooks and eyes to collar.					
	Finished appearance. The hooks shall be positioned on the collar so that in the finished coat, the top and bottom hooks shall be approximately 1/4 inch from top and bottom edges of collar, and the remaining hook shall be midway between top and bottom hooks. The eyes shall be postitioned to properly engage the hooks, effecting a flat, smooth closure at front of collar without misalignment or gapping.					
	a. Position and securely sew three hooks to the right end and three eyes to the left end of the collar. (See Fig 10)	Hand		16 per hook	C (silk) double thread	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
77.	Finish collar. (See Fig 10)					
	a. Securely tack the lower corners of the collar to the coat.	Hand		8-10	C (silk)	
	b. Turn under the end and top edge of the lining at the right end of the collar and position the folded edge of the lining under the hook. Fell the folded end of the collar lining to the end of the collar and continue felling along the top folded edge to the end of the stitching joining the lining to the collar.	Hand		8-10	C (silk)	
	c. Turn under and fell the lower folded edge of the collar lining to the coat from end to end. The lining may be basted prior to felling.	Hand		8-10	C (silk)	
	d. Fell the collar extention tab from the underside to the collar, across the left front end, leaving an opening of 1/4 to 3/8 inch between the stitching line and the back edge of the eyes to properly engage the hooks. Continue felling along the folded top edge to the end of the stitching joining the lining to the collar.	Hand		8-10	C (silk)	
	e. Turn the collar eyelet covers to the inside of the collar and fell the cover to the collar lining along the front edge and along the bottom edge for a distance of approximately 3/4 inch from the front edge.	Hand		8-10	C (silk)	
78.	Press coat.					
	a. The coat shall be well pressed throughout with a heated pressing iron or pressing machine suitable to obtain the desired shape and appearance in accordance with good commercial practices.					
	b. Press the fronts smooth and flat, straightening and shaping the front edges and working the fullness towards the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBV LPR
78.	Press coat. (cont'd) c. Press the entire collar smooth and flat. d. Press the upper fronts on a body machine, shrinking in and properly shaping the chest. e. Press the lower fronts smooth and flat. f. Press the sides, working the fullness towards the back. g. Press the back smooth and flat, removing all fullness. h. Press the sleeves smooth and flat, creasing at the backarm and forearm seam. The backarm crease shall be on the backarm seam. The forearm crease shall extend uniformly to a point 3 to 3-1/2 inches below the base of the armhole. i. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine. j. Press the armholes solid from the inside, creasing the armholes at the front, and creasing the excess material at the armpit. The armpit and back of the armhole shall be held short while pressing. k. Block the armholes on a pressing buck, shrinking in the top sleeves. l. Press lower edge of coat smooth, flat and even. m. Press body lining throughout, removing all wrinkles and creases. Press the lining pleats smooth and flat. n. Remove all gloss marks.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOBN/ LPR
78.	Press coat. (cont'd) o. Remove any wrinkles and creases missed by previous pressing operations.					
79.	Attach buttons. a. Insert a 27-line button through each eyelet on the ornamental back patch. b. Insert a 40-line button through each eyelet on the fronts and secure with a ring toggle. NOTE: All buttons shall be attached with the head of the eagle in the upright position.					
80.	Finish sleeve ornamentation. Finished appearance. The ornamental sleeve insignia shall finish smooth and flat without distortion and shall be uniform. a. Trim underside of the buckram evenly along the embroidered edges so that 1/8 inch of the basic material will be uniformly exposed beyond the outer row of jaceron on the top, front and bottom finished edges as shown in Figures 11 and 12. b. Position the pattern marker on the underside of the insignia in line with the trimmed portion of the buckram and mark the scalloped end of the patch. c. Trim the buckram at the mark and the basic material all around, allowing approximately 1/2 inch for turnunder. Notch the background material in order to prevent pulling and to eliminate gathers and bulges at the points and corners.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE 1 MANUFACTURING REQUIREMENTS

NO	OPERATION	STCH TYPE	SEAM/ STCH TYPE	STCH/ IN	THREAD NDL	THREAD BOB/ LPR
80.	Finish sleeve ornamentation. (cont'd)					
	d. Turn background material to the underside, forming smooth corners and points. Tack turned edges to buckram.	Hand		2-6	C (silk)	
	e. Mark location for insignia buttons as indicated by marks on the pattern. Assemble sleeve insignia in pairs.					
	f. Punch a hole through the sleeve insignia at each mark for attaching 27-line insignia buttons.					
	g. Insert the shank of a 27-inch insignia button through each hole, and secure button to sleeve insignia with a metal ring toggle.					
81.	Join sleeve ornamentation to sleeve.					
	Finished appearance. The ornamental sleeve insignia shall be uniformly attached without raw edges or distortion to sleeve or sleeve insignia and shall finish smooth and flat.					
	a. Position the sleeve ornamentation at the mark on the sleeve with the front and button edge of sleeve insignia even with front crease and bottom edge of sleeves. The scalloped edge shall be toward the back seam.					
	b. Fell the sleeve ornamentation to the sleeve at all edges.	Hand		4-6	C (silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements specified in Table II.

Table II. Coat measurement 1/

Size	Back length 2/	Sleeve length 3/
	SHORT	
34	29-3/4	17-1/2
35	29-7/8	17-1/2
36	30	17-1/2
37	30-1/8	17-1/2
38	30-1/4	17-1/2
39	30-3/8	17-1/2
40	30-1/2	17-1/2
41	30-5/8	17-1/2
42	30-3/4	17-1/2
44	31	17-1/2
46	31-1/4	17-1/2
	REGULAR	
34	30-3/4	18-1/2
35	30-7/8	18-1/2
36	31	18-1/2
37	31-1/8	18-1/2
38	31-1/4	18-1/2
39	31-3/8	18-1/2
40	31-1/2	18-1/2
41	31-5/8	18-1/2
42	31-3/4	18-1/2
44	32	18-1/2
46	32-1/4	18-1/2
	LONG	
34	31-3/4	19-1/2
35	31-7/8	19-1/2
36	32	19-1/2
37	32-1/8	19-1/2
38	32-1/4	19-1/2
39	32-3/8	19-1/2
40	32-1/2	19-1/2
41	32-5/8	19-1/2
42	32-3/4	19-1/2
44	33	19-1/2
46	33-1/4	19-1/2

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Table II. Coat measurements 1/ (cont'd)

Size	Back Length 2/	Sleeve Length 3/
	EXTRA LONG	
34	33-1/4	20-1/2
35	33-3/8	20-1/2
36	33-1/2	20-1/2
37	33-5/8	20-1/2
38	33-3/4	20-1/2
39	33-7/8	20-1/2
40	34	20-1/2
41	34-1/8	20-1/2
42	34-1/4	20-1/2
44	34-1/2	20-1/2
46	34-3/4	20-1/2

1/ Tolerance on all measurements ± 3/8 inch.

2/ Back measurement. Back measurement shall be taken along center back from lower edge of collar to bottom edge of coat.

3/ Sleeve length. Sleeve length measurement taken along underarm seam from pit of armhole to bottom edge of sleeve.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the levels set by the applicable acceptable quality levels (AQL's).

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to the prescribed requirement.

4.1.1 Certificate of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4)
2. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be performed in accordance with the test conditions specified in MIL-STD-105.

4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection.

4.5.1 Testing of components. Testing of components shall be in accordance with the applicable subsidiary specifications and standards to the extent applicable, except that this specification shall govern in the event of conflict. The method of testing will be as specified in FED-STD-191, wherever applicable. Testing shall be performed on components listed in Table III for characteristics noted.

4.5.1.1 Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following. The lot shall be unacceptable if one or more sample units fail to meet any test requirement specified.

Lot size	Sample size
800 or less	2
801 to 22,000 inclusive	3
22,001 and over	5

The unit for expressing lot sizes and sample unit for testing each component shall be in accordance with applicable subsidiary specifications and as follows:

Components	Lot size expressed as	Sample unit for testing
Cloth, cotton buckram	Yards	2 yards full width
Shoulder pads	Pairs	1 pair
-cloth cotton print	Yards	1/2 yard full width
-Batting	10 lbs or yards	1 oz or 1/2 yd full width
-Buckram	Yards	1 yard full width
Braid	Yards	5 yards
Cloth cotton crinoline	Yards	1 yard full width
Buckram (backing)	Yards	1 yard full width
Fasteners snap	Gross	10 each
Hook and eyes	Each	10

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III. Test Methods

Components	Characteristics	Rqmt. para.	Test method	No. Determinations per sample unit	Results reported as
Cloth, Cotton, Buckram (collar interlining)	Material identification	3.3.7.1	1200	1	Pass or fail
	Weave (single ply)	3.3.7.2	Visual	1	Pass or fail
	Texture-threads per inch (single ply)	3.3.7.3	5050		
	- warp			3	Avg of the 3 det in each direction to the nearest whole number
	- filling			3	
	Resistance to:				
	- Wet (dry) cleaning (laminated cloth)	3.3.7.4	5622	1	Satisfactory or unsatisfactory to std. If no standard: good, fair or poor.
	- Accelerated aging (laminated cloth 1/	3.3.7.4	5850	1	Pass or fail
	- Perspiration	3.3.7.4	5680	1	Satisfactory or unsatisfactory to std. If no standard: good, fair or poor.
	Stiffness - in. lb.				
	- original 2/	3.3.7.4.1	5202	10	Nearest 0.001 lb.
	- after wet (dry) cleaning 3/	3.3.7.4.1	5622	10	
	- after accelerated aging 1/	3.3.7.4.1	5850	10	
	- after perspiration 4/	3.3.7.4.1	5680	10	
	Weight-oz per sq yd	3.3.7.4.1	5041	5	Avg of the 5 det to Nearest 0.1 oz.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III. Test Methods (cont'd)

Components	Characteristics	Rqmt. para.	Test method	No. Determinations per sample unit	Results reported as
Cloth (cont'd)	Breaking strengths lbs. (laminated cloth)	3.3.7.4.2	5100	5	Avg of the 5 det in each direction
	- warp direction			5	to the nearest
	- filling direction			5	1.0 lb.
Front braid	Cover thread	3.3.14			
	- matl. identification		1100, 1200 or 1530	1	Pass or fail
	- color		Visual	1	Pass or fail
	- ply		Visual	1	Pass or fail
	Cover wire	3.3.14			
	- metal undercoat		Std. comml	2	To nearest 0.1%
	- metal plating		Std. comml	2	To nearest 0.1%
	Core (stuffer)	3.3.14			
	- matl identification		1100, 1200 or 1530	1	Pass or fail
	- number of threads		Visual	1	Pass or fail
	- ply of threads		Visual	1	Pass or fail
	Color	3.3.14	Visual	1	Pass or fail
	Weave	3.3.14	Visual	1	Pass or fail
	No. of carriers	3.3.14	Visual	1	Pass or fail
	Ends/carriers	3.3.14	Visual	1	Pass or fail

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Table III. Test Methods (cont'd)

Components	Characteristics	Rqmt. para.	Test method	No. Determinations per sample unit	Results reported as
Front braid (cont'd)	Shape	3.3.14	Visual	1	Pass or fail.
	Width (in.)	3.3.14	5020	1	Pass or fail.
	Metal content (%) - gold - silver - alloy	3.3.14	4.6.1.2	2	To nearest 0.1%
	Fastness to:	3.3.14			
	- water		5630	1	Good, fair or poor
	- dry cleaning		5620	1	Good, fair or poor
Hook and eye	Matl. identification	3.3.18	Std comml	1	Pass or fail
	Finish	3.3.18	Std comml	1	Pass of fail
	Finish 5/	3.3.18.1	Std comml	1	Pass of fail

1/ Method 5850, except the aging process shall be limited to 5 hours at a temperature of 100°C.

2/ Method 5202, using a moment-weight of 1 pound.

3/ Method 5622, except the material shall be subjected to three 20 minute test cycles.

4/ Method 5680, except the material shall be immersed in the specified solution for 20 minutes and then air-dried.

5/ Test for tackiness. At room temperature (60° to 80°F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

4.5.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

4.5.3 Examination of end item. The end item shall be examined for defects listed in 4.5.3.1, 4.5.3.2, and 4.5.3.3. All defects shall be classified as indicated below, except those with an asterisk (*) in classification column, which shall be classfied as follows:

Major defect - When seriously affecting appearance or serviceability.
Minor A defect - When affecting appearance or serviceability but not seriously.

4.5.3.1 General defects. General defects shall be classified as follows:

Examine	Defect	Classification		
		Major	Minor	
			A	B
Buttonhole	a. One or more omitted, added or wrong type.	X		
	b. Not corresponding to size of button:			
	-too small, not permitting button to enter buttonhole.	X		
	-too large, 3/8 inch or more longer than the diameter of button (measured at inside of purling).		X	
	c. Buttonhole not securely caught on fabric, causing stitching to pull away from fabric.	X		
	d. Bartack missing or loose on:			
	-one buttonhole.		X	
	-two or more buttonholes.	X		
	e. Bartack misplaced, not serving intended purpose on:			
	-two or more buttonholes.		X	
	-one buttonhole.			X

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor A	Minor B
	f. One or more broken stitches in:		X	
	-one buttonhole.			
	-two or more buttonholes.	X		
	g. More than 2 skipped stitches in:			
	-one buttonhole.			X
	-two or more buttonholes.		X	
	h. Ragged edges, affecting appearance or exposed interlining not colored with indelible ink of the color specified.			X
	i. Any uncut buttonhole.		X	
	j. Gimp omitted in one or more buttonholes or ends of gimp not pulled through to underside.		X	
	k. Stitches per buttonhole (not including bartack) less than the minimum specified:			
	-one or two stitches.			X
	-three or more stitches.		X	
	l. One or more buttonholes finished with purling on the underside.	X		
Buttons or ring toggles	a. One missing, loose, defective or improper size or type.		X	
	b. Two or more missing, loose, defective or improper size or type.	X		
	c. One or more buttons sewn with the head of the eagle in other than upright position.		X	
NOTE: Buttons shall be considered defective if they have sharp, rough, cracked, or split edges; unsound soldering; scratches; dents; blemishes, or imbedded foreign matter; loose shanks; or are poorly plated or badly shaded.				
Cleaness	a. One or more spots or stains of a permanent nature clearly noticeable:			
	-on the outside	X		
	-on the inside.		X	
	b. One or more removable spots or stains clearly noticeable:			
	-on the outside.	X		
	-on the inside.		X	

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	c. Threads ends not trimmed throughout garment; or one or more bastings nor removed, or two or more shade tickets not removed.		X	
Components and assembly	Any component part or required operation omitted (unless otherwise classified herein).	*		
Cutting	a. Any component part of basic wool material not cut in accordance with directional lines on patterns or in accordance with specification requirements.	X		
	b. Piping material cut on the bias.		X	
	c. Any lining part not cut in accordance with directional lines on patterns, or in accordance with specification requirements.		X	
Hooks and eyes	a. One hook or eye omited.		X	
	b. Two or more hooks or eyes omitted	X		
	c. Not specified type or size.		X	
	d. Hook or eye not securely tacked to ends of collar.		X	
	e. Not aligned, causing collar ends to be uneven by 1/4 inch or more when front is buttoned and hook and eye are fastened.		X	
Material defects and damages	a. Any weakening defect, such as smash, multiple float and loose slub.	*		
	b. Any hole.	*		
	c. Shade bar, unsightly slub, etc., affecting appearance: -on outside.	*		
	-on inside.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor A	Minor B
	d. Scissors or knife cut, tear, mend, or burn.	*		
	e. Needle chews that may develop into a hole.	*		
Note: Material defects and workmanship damages are to be classified as indicated above only when the condition is one which definitely weakens the fabric or when it is so conspicuously located as to be clearly noticeable. Weakening or nonweakening conditions which are inconspicuous and have negligible effect on serviceability are to be classified as follows: Material defect — No defect; Workmanship damages — Minor B defect				
Pressing	a. Burned or scorched	*		
	b. Pressing omitted entire garment.		X	
	c. Armhole stretched	*		
	d. Poorly pressed (unless otherwise indicated).			X
	e. Basting or pressing impressions not removed		X	
	on major portion of coat			X
	f. Gloss not removed on major portion of coat.			
	g. Armholes not blocked or poorly blocked, affecting appearance.		X	
	h. Edges bulky, i.e., not pressing solid, affecting appearance.		X	
	i. Inside of armhole not creased as required.		X	
	j. Sleeve not creased at front or backarm seam.		X	
	k. Wrinkles or pressing impressions not removed under side or center back seam allowance.		X	
	l. Lining not pressed smooth.		X	
	m. Armhole seam not pressed across top as specified.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Seams and stitching	a. Accuracy of seaming.			
	1. Any seam twisted, puckered or pleated, affecting appearance.	X		
	2. Part of garment caught in any unrelated operation or stitching.	*		
	3. Unsightly hand felling or blindstitching exposed on outside of coat, affecting appearance.		X	
	4. Ends of all stitching (when not caught in other seams or stitching) not backtacked or backstitched as required.			X
	5. Wrong color of thread or two shades of thread used on outside of coat, affecting appearance.	*		
	b. Gage of stitching (edge or raised stitching).			
	1. Irregular, i.e., unevenly gaged, or stitchings not uniform, affecting appearance.		X	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			X
	c. Open seams.			
	1. On outside:			
	-up to 1/4 inch inclusive.			X
	-more than 1/4 inch but not more than 1/2 inch.		X	
	-more than 1/2 inch.	X		
	2. On inside:			
	-more than 1/2 inch (except machine felling).		X	
	-up to 1/2 inch inclusive (except machine felling).			X
	up to 1 inch inclusive (machine felling).			X
	more than 1 inch (machine felling).		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
NOTE: One or more broken stitches or two or more continuous skipped or run-off stitches constitute an open seam.				
	d. Raw edges.			
	1. On outside:			
	-up to 1/8 inch inclusive.			X
	-more than 1/8 inch but not more than 1/4 inch.		X	
	-more than 1/4 inch	X		
	2. On inside:			
	-more than 1/8 inch but not more than 1/4 inch.			X
	-more than 1/4 inch.		X	
NOTE: Raw edges shall be classified as such when they occur at places where an edge is required to be turned under. Raw edges not caught in stitching shall be classified as an open seam.				
	e. Run-offs (see classification of open seams).			
	f. Stitch tension.			
	1. Loose tension resulting in loose seam.	X		
	2. Loose tension on raised or edge stitching, resulting in loosely exposed bobbin or top thread.			X
	3. Tight tension (stitches break when normal strain is applied).	X		
NOTE: Puckering is evidence of tight tension. When puckering is evident, the inspector shall test seam by exerting pull in lengthwise direction of seam.				
	g. Stitches per inch (excluding labels)			
	Less than minimum specified:			
	-one or two stitches.			X
	-three stitches.		X	
	-four or more stitches.	X		
	-one or more stitches on label			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
NOTE: To be scored only if condition exists on major portion of seam.				
	h. Stitch and seam type Wrong stitch or seam type.		X	
	i. Stitching skipped or broken (on edge or raised stitching when seam is seamed, turned and stitched): -1/4 inch or more but not more than 1/2 inch.			X
	-more than 1/2 inch.		X	
Shaded parts	a. Any outside part shaded.	*		
	b. Any lining part badly shaded except sleeve lining.		X	
	c. Sleeve lining parts badly shaded, or parts not matching each other.			X

4.5.3.2 Detained defects (coat buttoned on form or spread out on a table). Detailed defects with coat buttoned on form or spread out on a table shall be classified as follows:

Examine	Defect	Classification		
		Major	Minor	
			A	B
Collar (construction and setting)	a. Interlining omitted	X		
	b. Interlining tight or twisted causing puckers on collar, affecting appearance.		X	
	c. Tight at joining to front or back, causing puckers or pleats at neck of coat, affecting appearance.	*		
	d. Braid irregular, affecting appearance.		X	
	e. Collar ends overlapping when fastened.		X	
	f. Collar ends spread open more than 3/8 inch when fastened.		X	
	g. Front finished ends of collar uneven in width by 3/16 inch or more.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Alignment of front buttons and buttonholes	Not aligned, causing a noticeable bulge or twist on front when buttoned, affecting appearance.		X	
Length of buttoned fronts	a. Left front at corner shorter than right front at bottom by:			
	-more than 1/8 inch but not more than 1/4 inch.		X	
	-more than 1/4 inch.	X		
	b. Left front at corner longer than right front by:			
	-more than 1/4 inch but not more than 3/8 inch.			X
	-more than 3/8 inch.		X	
	c. Right front at corner exposed beyond bottom edge of left front by more than 1/8 inch.		X	
Shoulder (construction)	Improperly joined or set, causing shoulders or back to twist.	*		
Shoulder pads	a. Not completely caught in armhole tacking.		X	
	b. Misplaced, not serving intended purpose, i.e., too far back or too far forward.		X	
	c. One or both pads omitted.		X	
Armholes (construction)	a. Badly stretched, affecting appearance.	*		
	b. Taped too tight, causing puckering around armhole seam, affecting appearance.	*		
	c. Crooked seam, affecting appearance.		X	
	d. Tape stitching exposed and visible on outside surface.			X
	e. Sleeve head pads not completely tacked to armholes, or misplaced, not serving intended purpose.		X	
	f. One or both sleeve head pads omitted.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Sleeves	a. Setting and hang.			
	1. Sleeve fullness misplaced, affecting appearance.		X	
	2. Backarm seam of sleeve not matching side back seam by:			
	-more than 1/4 inch but not more than 1/2 inch.		X	
	-more than 1/2 inch	X		
	3. Hang of sleeve on the same coat in opposite direction by more than 2 inches.		X	
	4. Sleeve tight in armhole, i.e., roll effect not present.		X	
	b. Sleeve lining.			
	1. Twisted, tight, or short, causing bulge, twist, or puckering on outside of sleeves.	*		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch.			X
	3. Sleeve lining seams out of alignment more than 3/4 inch with sleeve seams at armholes or at bottom of sleeves.			X
	c. Construction of sleeves.			
	1. Tacking on bottom turn-up to body of sleeve omitted or insecure.		X	
	2. Sleeve bottom edge uneven by more than 1/4 inch.			X
	3. Tacking on 1 or both sleeve lining seams to seam sleeve seams omitted, or insecure.			X
	4. Bottom edge of sleeve lining turnup less than 1 inch or more than 1-1/4 inches up from bottom edge of sleeve.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Body (outside)	a. Fitting of body linings tight, short, or twisted, causing fullness or twist on outside of coat, affecting appearance.	*		
	b. Fitting of front interlining.			
	1. Tight, short or twisted, causing fullness or twist on outside of coat, affecting appearance.	*		
	2. Too full, causing coat front to have a wavy appearance.	*		
	c. Chest and waist darts.			
	1. One or more darts not properly tapered, causing puckers or pleats at one or more ends, affecting appearance.		X	
	2. Cut edges of chest dart pressed toward front of coat.			X
	3. Folded edge of waist dart pressed toward front of coat.			X
Sleeve ornamentation construction	a. Leaves and acorns not positioned in accordance with Figure 11, affecting appearance.		X	
	b. Top of ornament less than 6-1/4 or more than 6-3/4 inches.		X	
	c. Bottom of ornament less than 5-1/2 or more than 6 inches.		X	
	d. Height of ornament less than 5-1/4 or more than 5-3/4 inches.		X	
	e. Top braid less than 5 or more than 5-1/2 inches.		X	
	f. Bottom braid less than 4-1/4 or more than 4-3/4 inches.		X	
	g. Scalloped edge not toward back seam.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	h. Puckering along edges, affecting appearance.		X	
	i. Border irregular, affecting appearance.		X	
Front and bottom edges	a. Front edges stretched, affecting appearance.		X	
	b. Piping set on tight, causing puckering on front affecting appearance.		X	
	c. Front or bottom piping irregular, affecting appearance.		X	
	d. Bottom edge stretched, puckered, or uneven, affecting appearance.			X
	e. Bottom corner of left poorly shaped, affecting appearance.		X	
	f. Left front rolling outward below bottom button.	*		X
	g. Front edge irregular, affecting appearance.			X
	h. Piping tight on bottom edge, causing puckering on outside of coat, affecting appearance.			
	i. Left front not dressed as specified.	X		
Front facings	Short, tight, or twisted, causing fullness or twists on fronts, affecting appearance.	*		
Back side panel seams	Curved panel seam on back of coat stretched or distorted, affecting appearance.			X
Back ornamentation	a. Bottom of patch: -less than 3/4 inch or more than 1-1/4 inches from bottom edge (include piping).			X
	-less than 5/8 inch or more than 1-1/2 inches (include piping).	X		

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor A	Minor B
	b. Buttons out of horizontal alignment:			
	-by more than 1/8 inch but not more than 1/4 inch.		X	
	-more than 3/8 inch.	X		
Front buttonholes	a. Position from front edge including piping to inside edge of eyelet:			
	-less than 1/2 inch but not less than 3/8 inch or more than 3/4 inch but not more than 7/8 inch.			X
	-less than 3/8 inch or more than 7/8 inch.		X	
	b. More than 1/4 inch from equal spacing.		X	
	c. Unevenly spaced from front edge by more than 3/16 inch.		X	
Front buttons (position and stitching)	a. Top button not in vertical alignment with right end of collar by more than 1/8 inch.		X	
	b. Any front button out of vertical alignment by 1/4 inch or more.		X	
	c. Stitching not caught through front interlining on one or more buttons.	X		
	d. Stitching caught through front interlining but not through facing:			
	-one button.			X
	-two or more buttons.		X	
Braid placement on fronts	a. Braid out of horizontal alignment on left and right, affecting appearance.	X		
	b. Harp edge less than 5/8 inch or more than 1 inch from edge of armhole.	X		
	c. Harp position more than 1/8 inch or less than 7/8 inch (see Figure 6).		X	

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
	d. Harp position more than 1-1/4 inches or less than 3/4 inch (see Figure 6).	X		
Labels	a. Any required label missing, incorrect, illegible, or size label not securely caught in stitching.		X	
	b. Identification label not stitched on 4 sides.			X
	c. Bottom edge of identification label less than 3 inches or more than 5 inches from bottom edge of coat.			X
Hanger	a. Hanger omitted or ends not securely stitched.		X	
	b. Less than 1-7/8 inches or more than 2-1/8 inches long measured along edge of collar lining.			X
	c. Hanger not stitched to neck of coat prior to seaming collar to neck of coat.			X
Front facings	a. Fullness or pleats on facings between buttons, buttonholes, or between front edge and buttons or buttonholes.			X
	b. Tacking on back edge to 1 or both interlinings: -omitted.		X	
	-insecure or incomplete for a distance of more than 4-1/2 inches below shoulder seam, or more than 4 inches above bottom edge of coat.			X
	c. Felling at top edge of facing omitted or insecure on one or both facings.		X	
	d. Felling at bottom edge of front facing or back edge of facing omitted or insecure on one or both facings.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification		
		Major	Minor	
			A	B
Body lining	a. Excessive puckering or pleated.			X
	b. Twisted, not affecting smoothness on outside of coat.		X	
	c. One or both chest pleats on shoulders omitted.		X	
	d. Folded edge of one or both chest pleats facing front edge of coat.			X
	e. Pleat omitted at center of back lining.		X	
	f. Pleat less than 1/2 inch in depth at center of back lining.			X
	g. Bottom hem less than 5/8 inch or more than 7/8 inch.			X
	h. One or both lining securing straps at bottom of coat omitted or insecure.		X	
	i. Position of one or both lining securing straps more than 1 inch from side seam.			X
	j. One or both lining securing straps not folded and stitched.			X
	k. Lining too long, i.e., exposed beyond bottom edge of coat.		X	
Serging	Serging omitted on one or more seams where required.		X	
Collar extension tab	a. Omitted.		X	
	b. Extending less than 1/2 inch or more than 1 inch from left end of collar.			X
	c. Insecurely felled or felling not on four sides.			X
Shoulder loops	a. Not uniform in width and length: Any point varying			
	-more than 1/8 inch		X	
	-less than 1/8 inch		X	
	b. Not positioned correctly:			
	-more than 1/8 inch			X
	-less than 1/8 inch			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.5.3.3 Finished measurements. Any measurement deviating from the nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

4.5.3.4 Inspection levels and AQL's. Inspection levels and AQL's expressed in defects per 100 units (DHU) shall be as follows:

4.5.3.1 and 4.5.3.2 (combined)

Inspection level II of MIL-STD-105

AQL's Major	2.5 DHU
Major & Minor A (combined)	15.0 DHU
Total Major, Minor A and Minor B (combined)	65.0 DHU

4.5.3.3

Inspection level - S-3 (MIL-STD-105)

AQL's	One class	4.0 DHU

4.5.4 Examination of packaging requirements. An examination shall be made to determine compliance with packaging, packing and marking requirements of Section 5 of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully prepared for delivery with the exception that it need not be sealed. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the end item inspection lot. The inspection level shall be S-2 and the AQL shall be 4.0 DHU.

Examine	Defect
Marking (exterior & interior	Omitted, incorrect, illegible, of improper size, location, sequence, or method of application.
Materials	Any component missing or damaged.
Workmanship	Inadequate application of components such as incomplete closure of case liners and container flaps, loose straping, and inadequate stapling. Bulging or distortion of containers.
Content	Number of coats per container is more or less than required.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

4.6 Tests.

4.6.1 Tests for stiffness.

4.6.1.1 After wet (dry) cleaning. Method 5622 of FED-STD-191, except the material shall be subjected to three 20-minute test cycles.

4.6.1.2 After accelerated aging. Method 5850 of FED-STD-191, except the aging process shall be limited to 5 hours at a temperature of 100°C.

4.6.1.3 After test for perspiration. Method 5682 of FED-STD-191, except the material shall be immersed in the specified solution for 20 minutes and then air dried.

4.6.2 Test for tackiness. At room temperature (60° to 80° F), press a piece of tissue paper against the lacquered surface for 30 seconds, using any pressure capable of being exerted by the thumb and two fingers. The tissue shall not adhere to the lacquered surface, but shall fall free when pressure is released.

4.6.3 Liver of sulfur. The samples to be tested shall be immersed in a 2-percent by weight of chemically pure liver of sulfur (potassium sulphide) water solution, at a temperature of 100° to 110°F, for not less than 3 minutes. The samples shall then be removed and rinsed in warm, then cold, then hot water, after which they shall be wiped gently with an absorbent cellulose material or whirled to remove residual moisture, and allowed to air dry at room temperature for a period of 1 hour.

4.6.4 Quantity of gold and silver. At least two pieces, 1 yard each, shall be assayed for the quantity of gold and silver. The quantities of gold and silver may be determined by standard commercial methods of assay, but in case of dispute, shall be determined in accordance with 4.6.4.1 and 4.6.4.2, respectively.

4.6.4.1 Gold content. Boil 1 gram of alloy (accurately weighed) with 60 ml 1:1 nitric acid (HNO_3) in a 400-ml beaker using a small flame or hot plate. Continue boiling until all metal except the gold are in solution. Dilute to 200 ml with hot water. Filter through a rapid ashless filter paper, and wash several times with hot water. Take the filter paper with the gold (cutting off any excess filter paper), wrap in a 2-inch by 2-inch piece of silver-free lead foil, and roll into a ball. Place the ball in the hollow of a bond ash cupel, and add lead shot around the ball. Place cupel in a muffle furnace for 1 hour at

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

1000°C. Remove from the furnace, and examine hollow for flakes of gold, impurities and discolored gold bead. If any are noticed, add additional lead shot and return cupel to the muffle furnace for 1 hour. Otherwise, cool the gold bead and weigh. The gold content shall be calculated as follows:

$$\text{Gold Content} = \frac{W(AU) \times 100}{WS} = P\ (AU)$$

Whereas:

W(AU) = Weight of gold
WS = Weight of sample
P(AU) = Percent of gold

4.6.4.2 Silver content. Dilute the filtrate from 4.6.4.1 to a 1000 ml volumetric flask, and dilute to the mark. Pipette a 200 ml aliquot from the flask into a 400 ml beaker. Heat to boiling and add HCL (3:100) drop by drop from a pipette until precipitation is complete by adding a few drops of the HCL (3:1000). If solution remains clear, filter on a weighed porcelain Gooch crucible. Wash the precipitate several times with HNO (1:200) and finally with cold water. Protect the silver chloride from the light, dry in an oven for not less than 2 hours, cool and weigh. The silver content shall be calculated as follows:

$$\text{Silver content} = \frac{W\ (AGCL) \times 752.63X5}{WS}$$

Whereas:

W (AGCL) = Weight of silver chloride
WS = Weight of sample minus weight of gold

4.6.4.3 Alloy. Ascertain by difference.

5. PACKAGING

5.1 Preservation and packaging. Unless otherwise specified (see 6.2), the coats shall be packaged in accordance with good commercial practice and packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight Classification Rules, National Motor Freight Classification, U.S. Postal Service Manual or regulations of other carriers applicable to the mode of transportation.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

5.2 Marking. In additional to any special marking required by the contract, the shipping containers shall be marked in accordance with the requirements of MIL-STD-129.

6. NOTES

6.1 Intended use. The coat covered by this specification is intended to be worn by male officers of the U. S. Marine Corps Band.

6.2 Ordering data. Procurement documents should specify the following:

6.2.1 Procurement requirements.

(a) Title, number, and date of this specification.
(b) Class and size required (see 1.2)
(c) When first aricle is not required (see 3.2)
(d) Class of ornamentation required (see 3.3.16)
(e) When coats shall not be packaged and packed in accordance with commercial practice (see 5.1).

6.2.2 Contract data requirements. Data conforming to Data Item Description DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902 and DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on DD Form 1423 included in the contract.

6.3 Standard sample. The standard sample and color sample may be obtained from the procuring activity or as directed by the contracting officer.

6.4 First article. Examination, tests and approval shall be as specified by the contracting officer (see 3.2).

6.5 Figures. Figures 1 through 12 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

6.6 Marginal notations. Asterisks are not used in this revision to identify changes with respect to the previous issue, due to the extensiveness of the changes.

Preparing activity
Navy - MC
Proj: No. 8405-N724

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

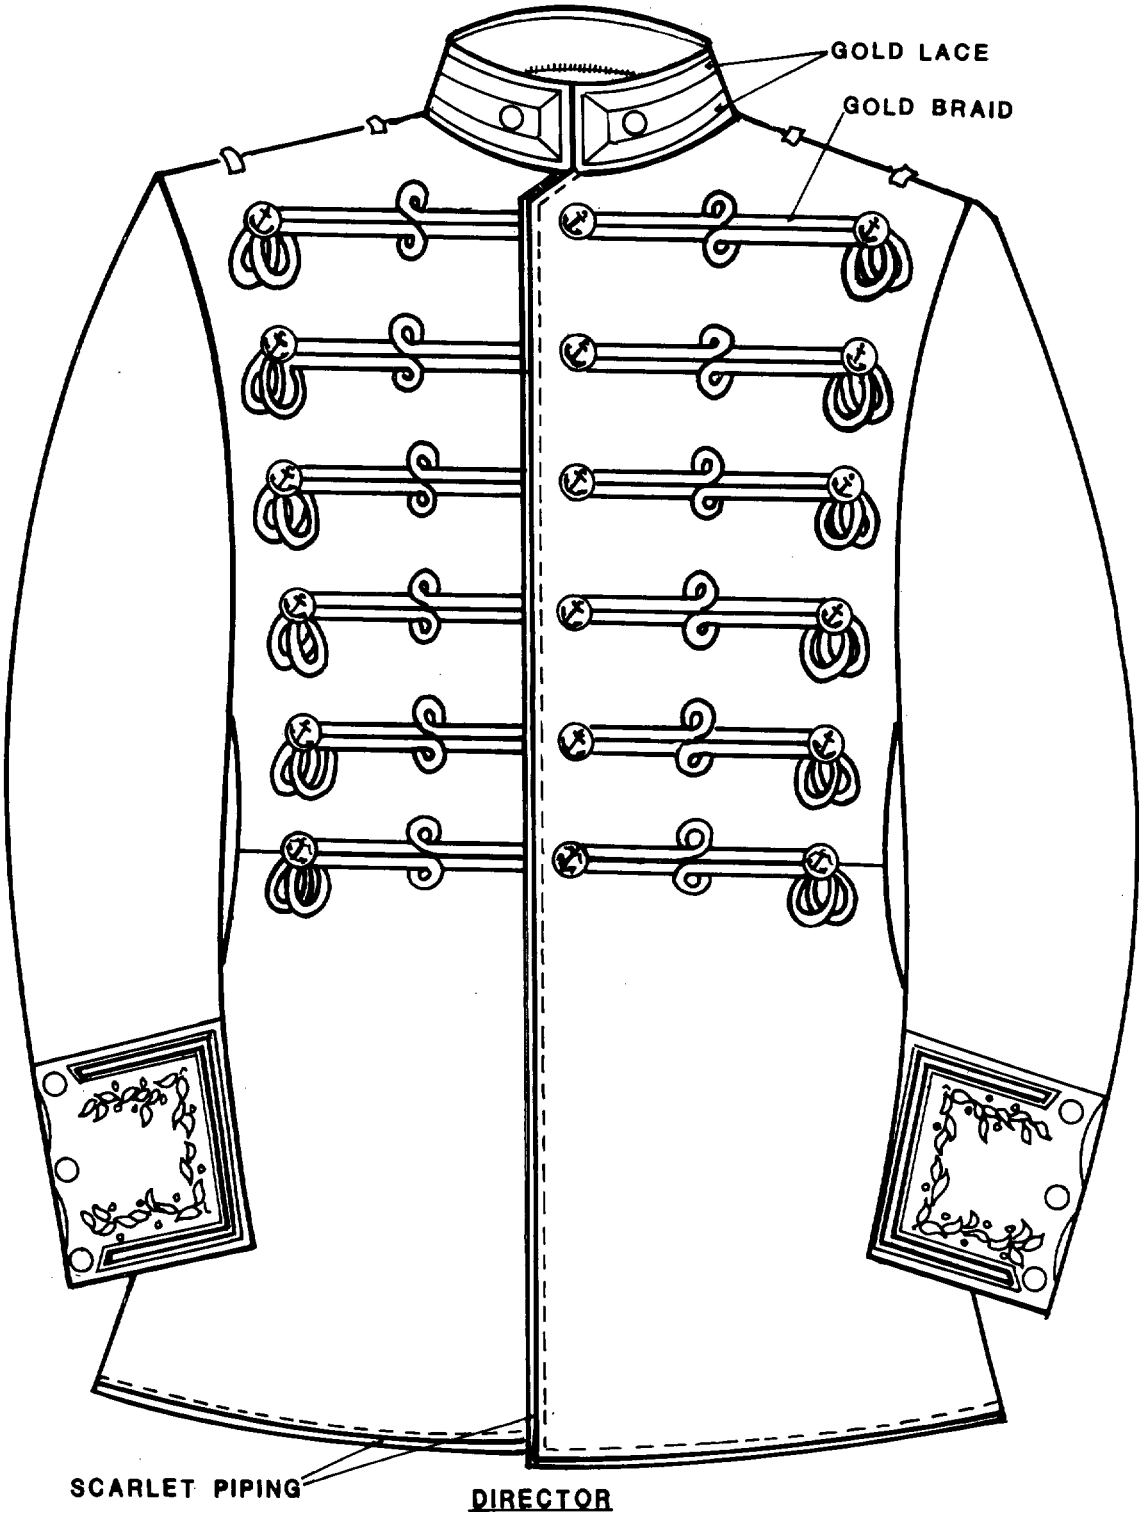


FIGURE 1. COAT, MAN'S: FULL DRESS, U.S. MARINE BAND; OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

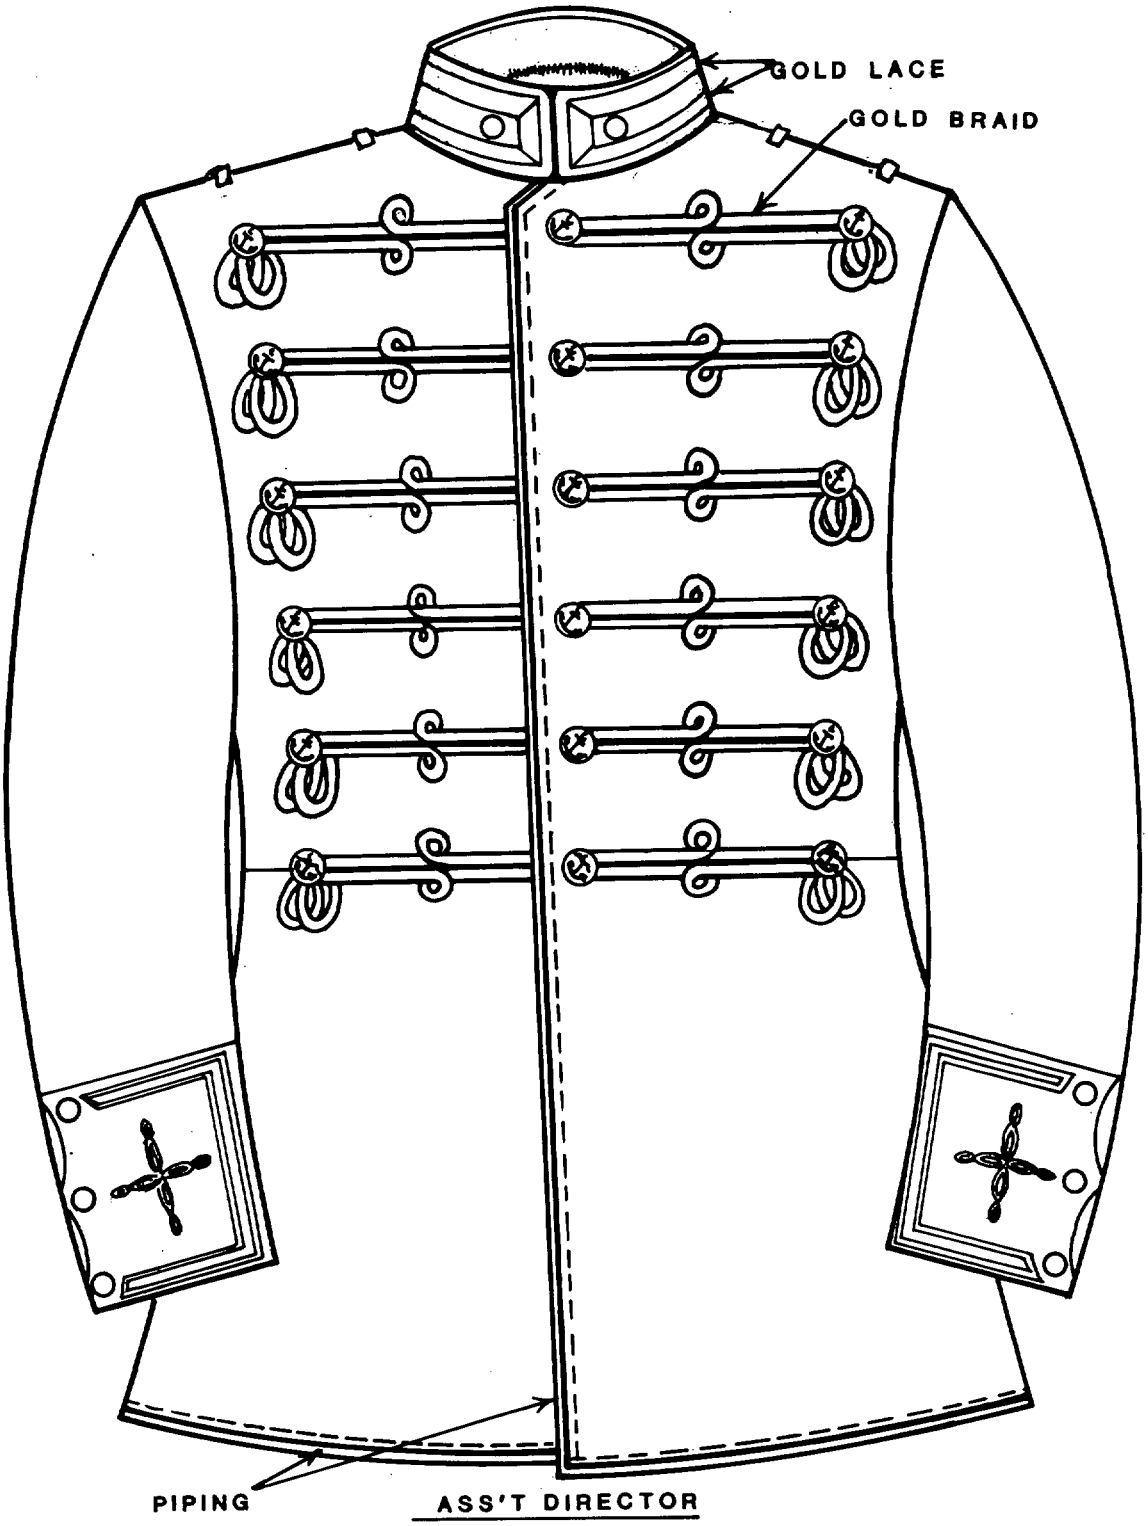


FIGURE 2. COAT, MAN'S FULL DRESS, U.S. MARINE BAND: OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.


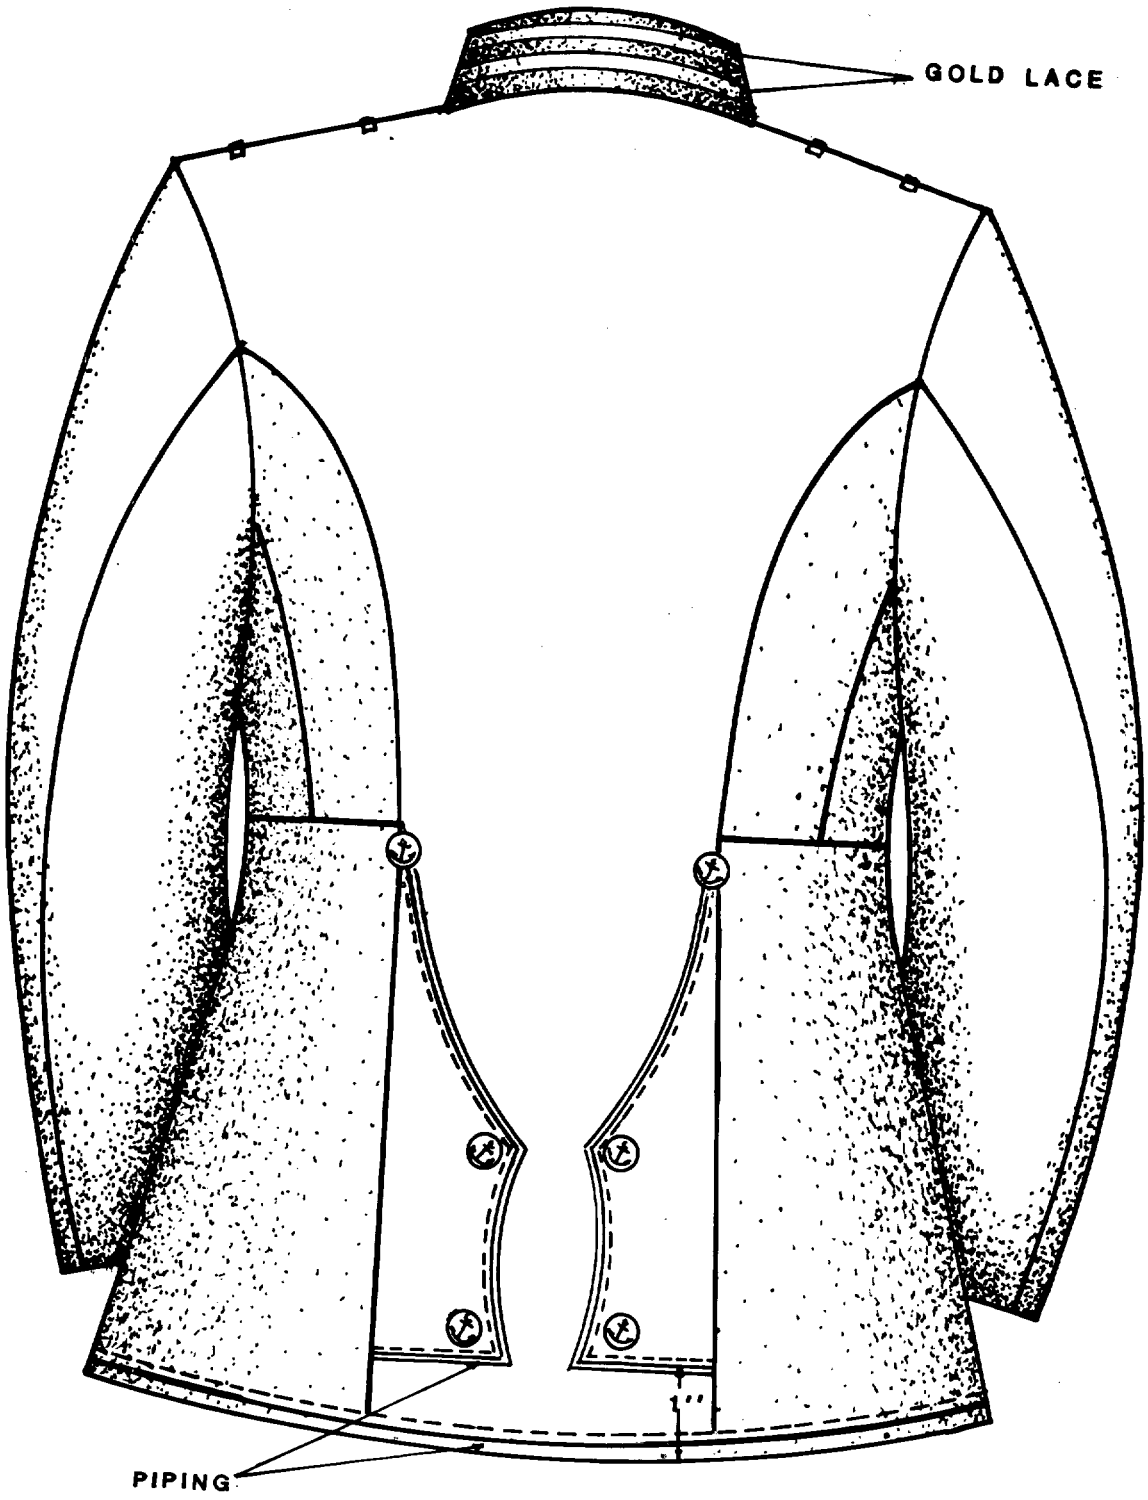


FIGURE 3. COAT, MAN'S: FULL DRESS, U.S. MARINE BAND; OFFICER'S


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

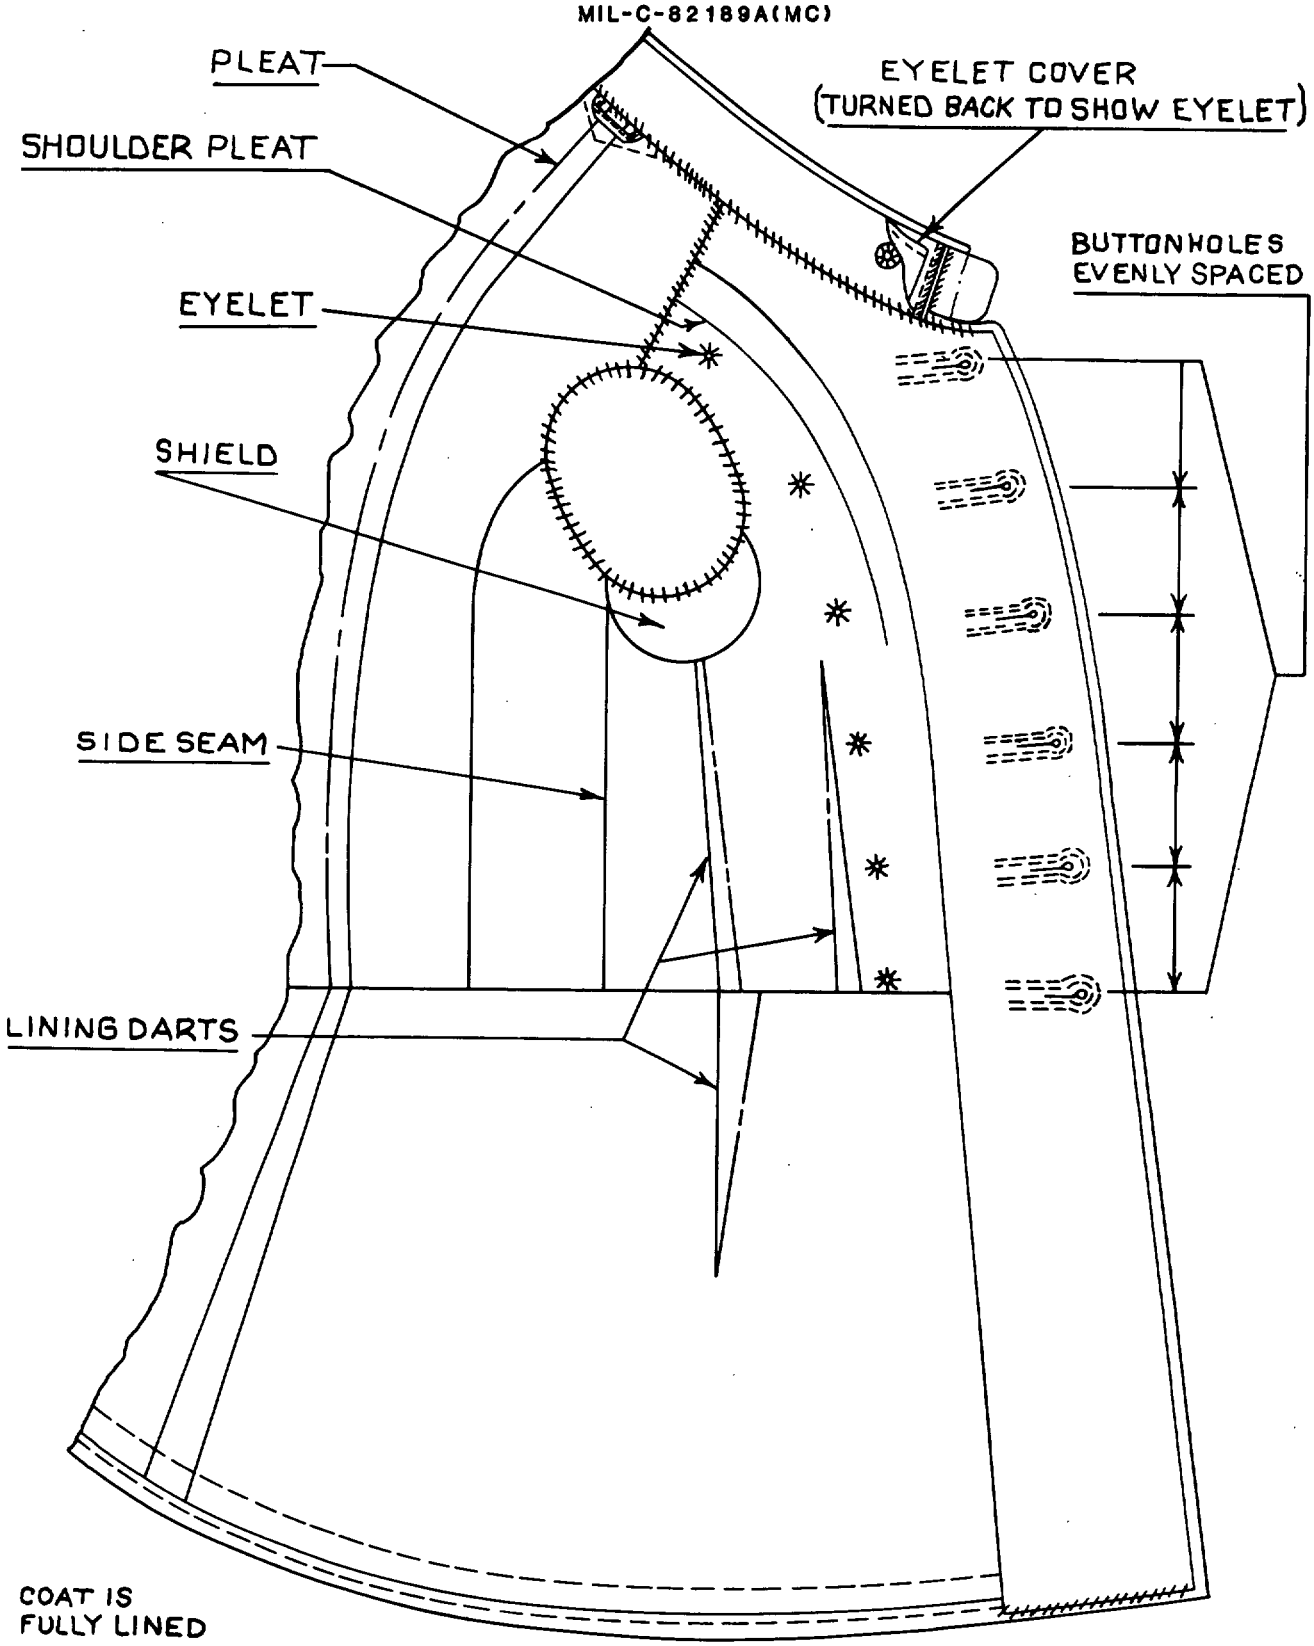


LEFT INSIDE VIEW

FIGURE 4 COAT,MAN'S: FULL DRESS
US MARINE BAND:OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

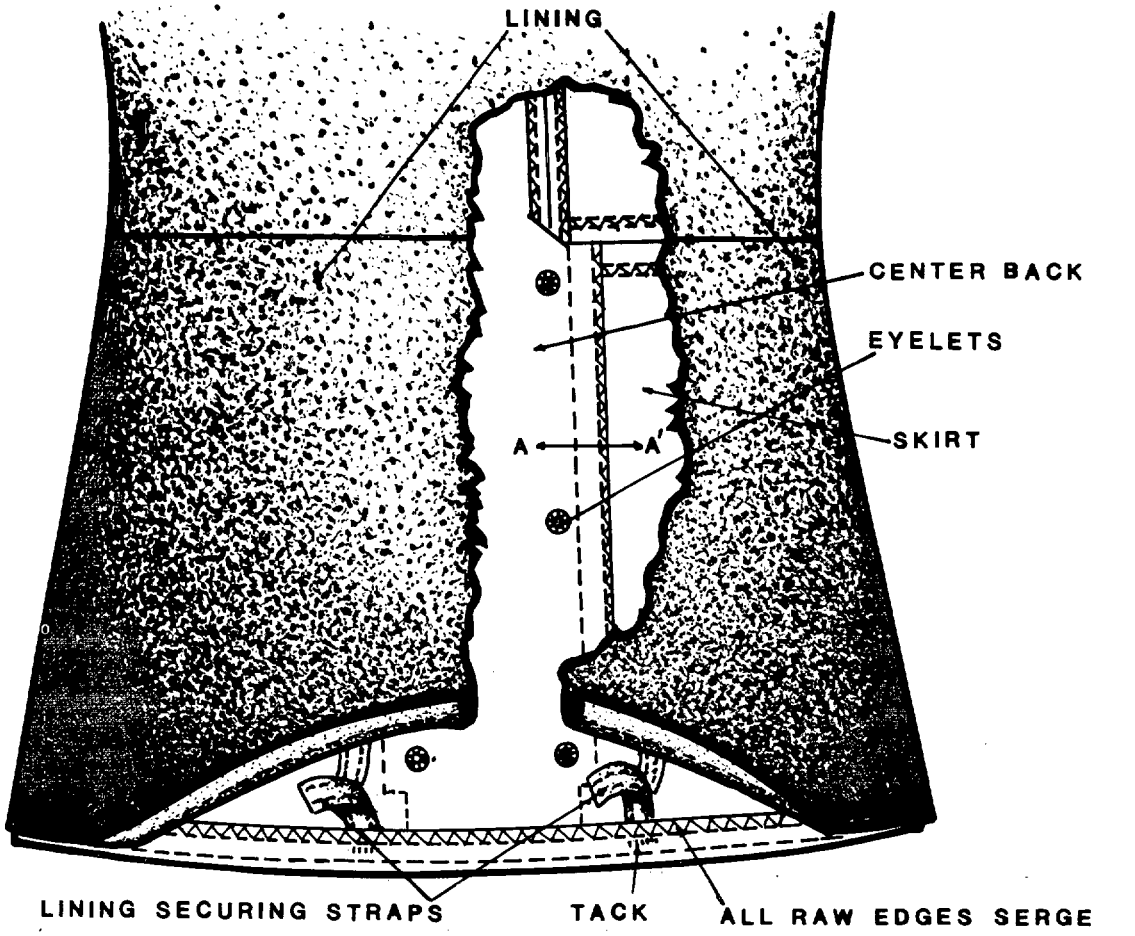


BACK INSIDE-CUT THROUGH VIEW

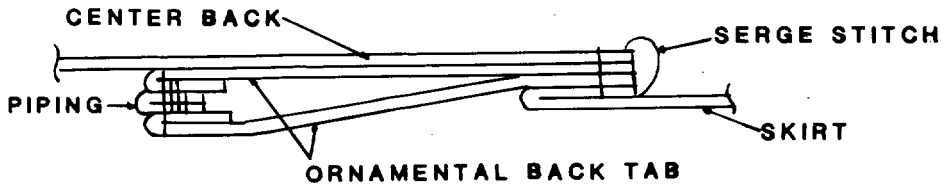

SECTION A-A'

FIGURE 5. COAT, MAN'S: FULL DRESS, U.S. MARINE BAND; OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

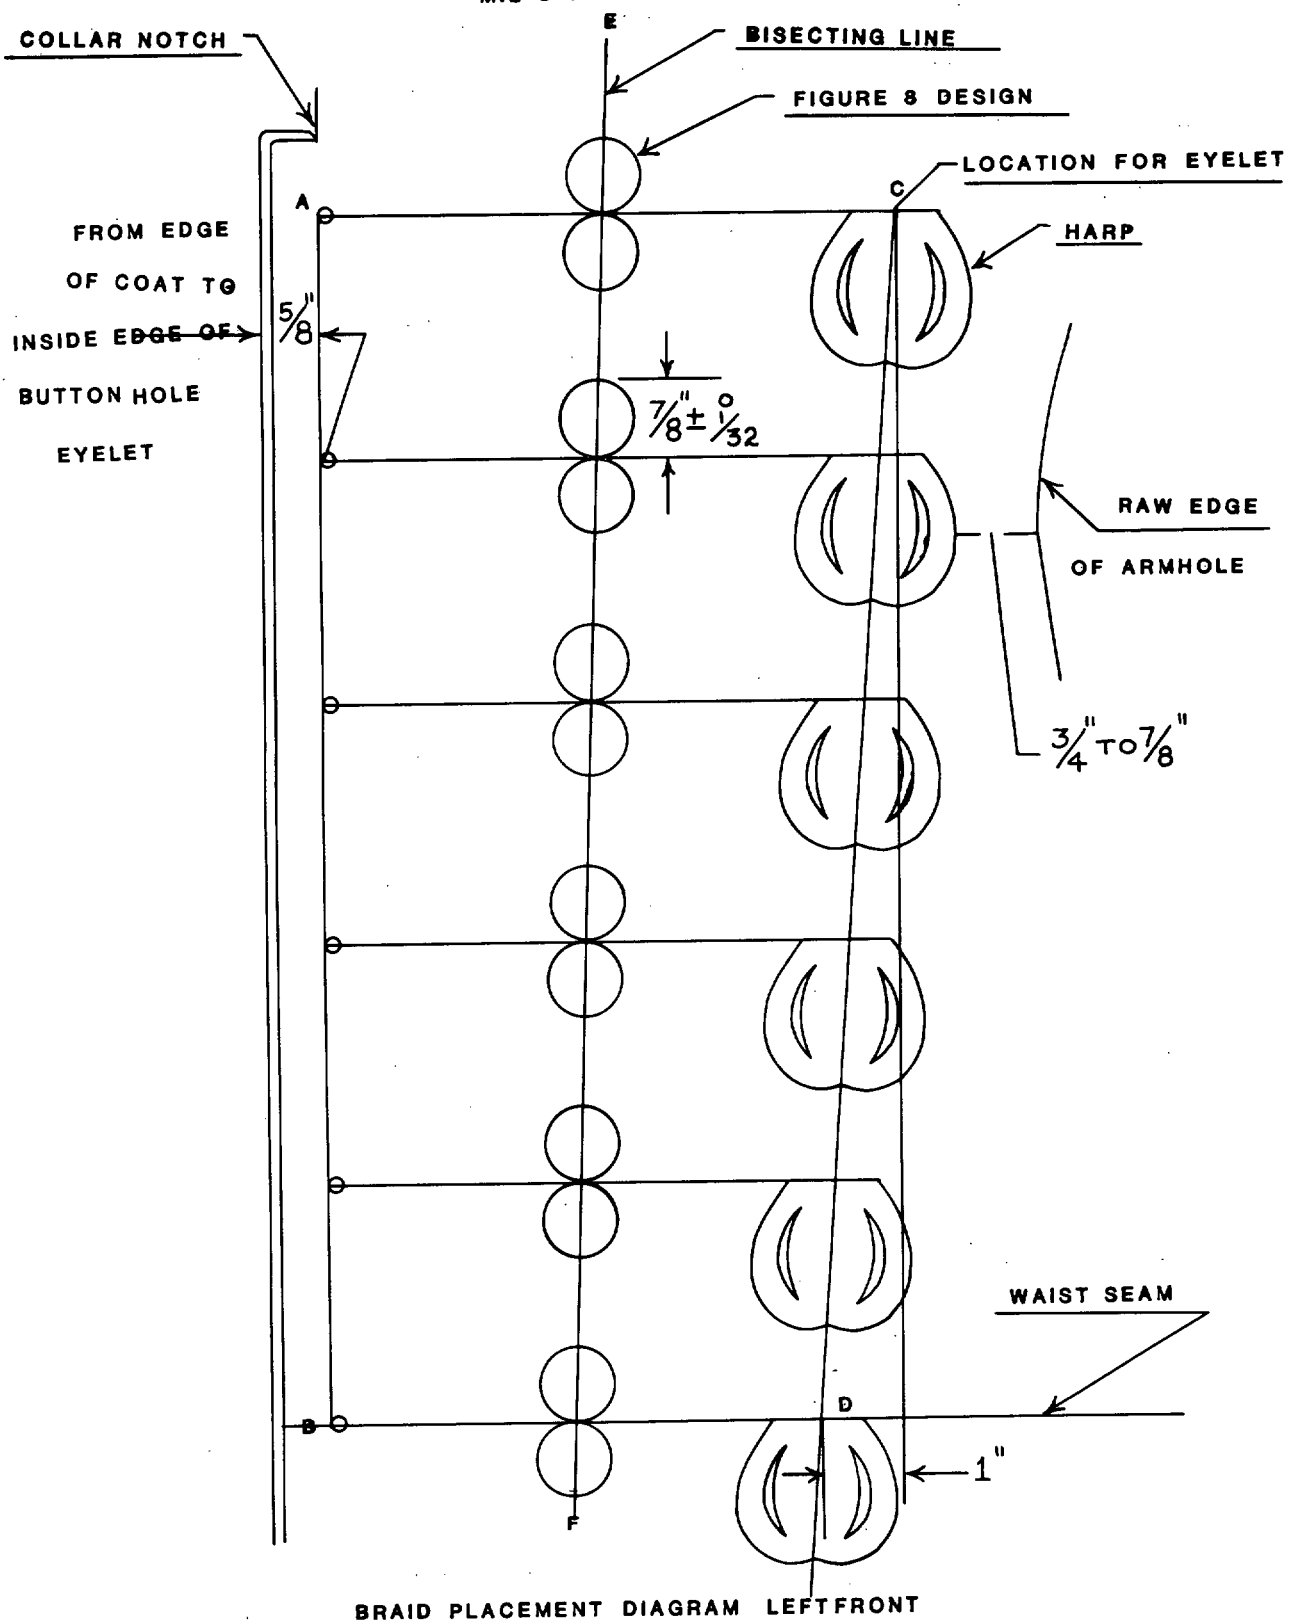

BRAID PLACEMENT DIAGRAM LEFT FRONT

FIGURE 6. COAT, MAN'S: FULL DRESS
US MARINE BAND: OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

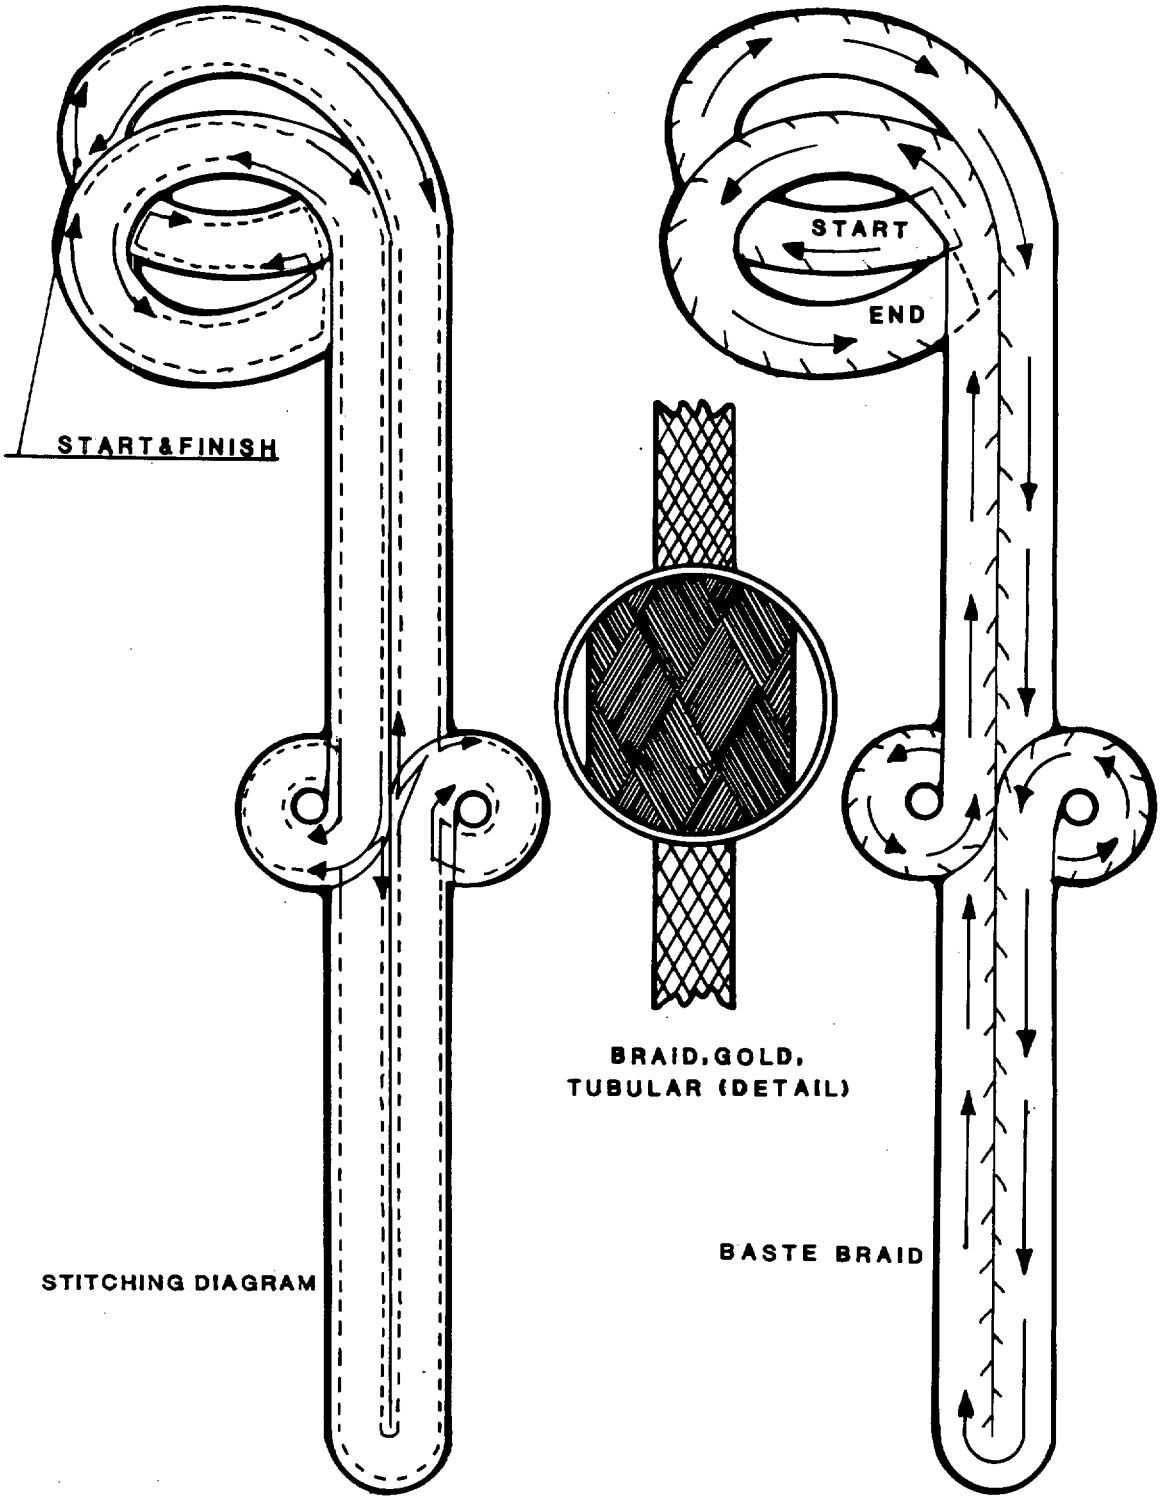


FIGURE 7. COAT, MAN'S: FULL DRESS, U.S. MARINE BAND; OFFICER'S
RIGHT FRONT OF COAT: (REVERSE FOR LEFT FRONT)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.



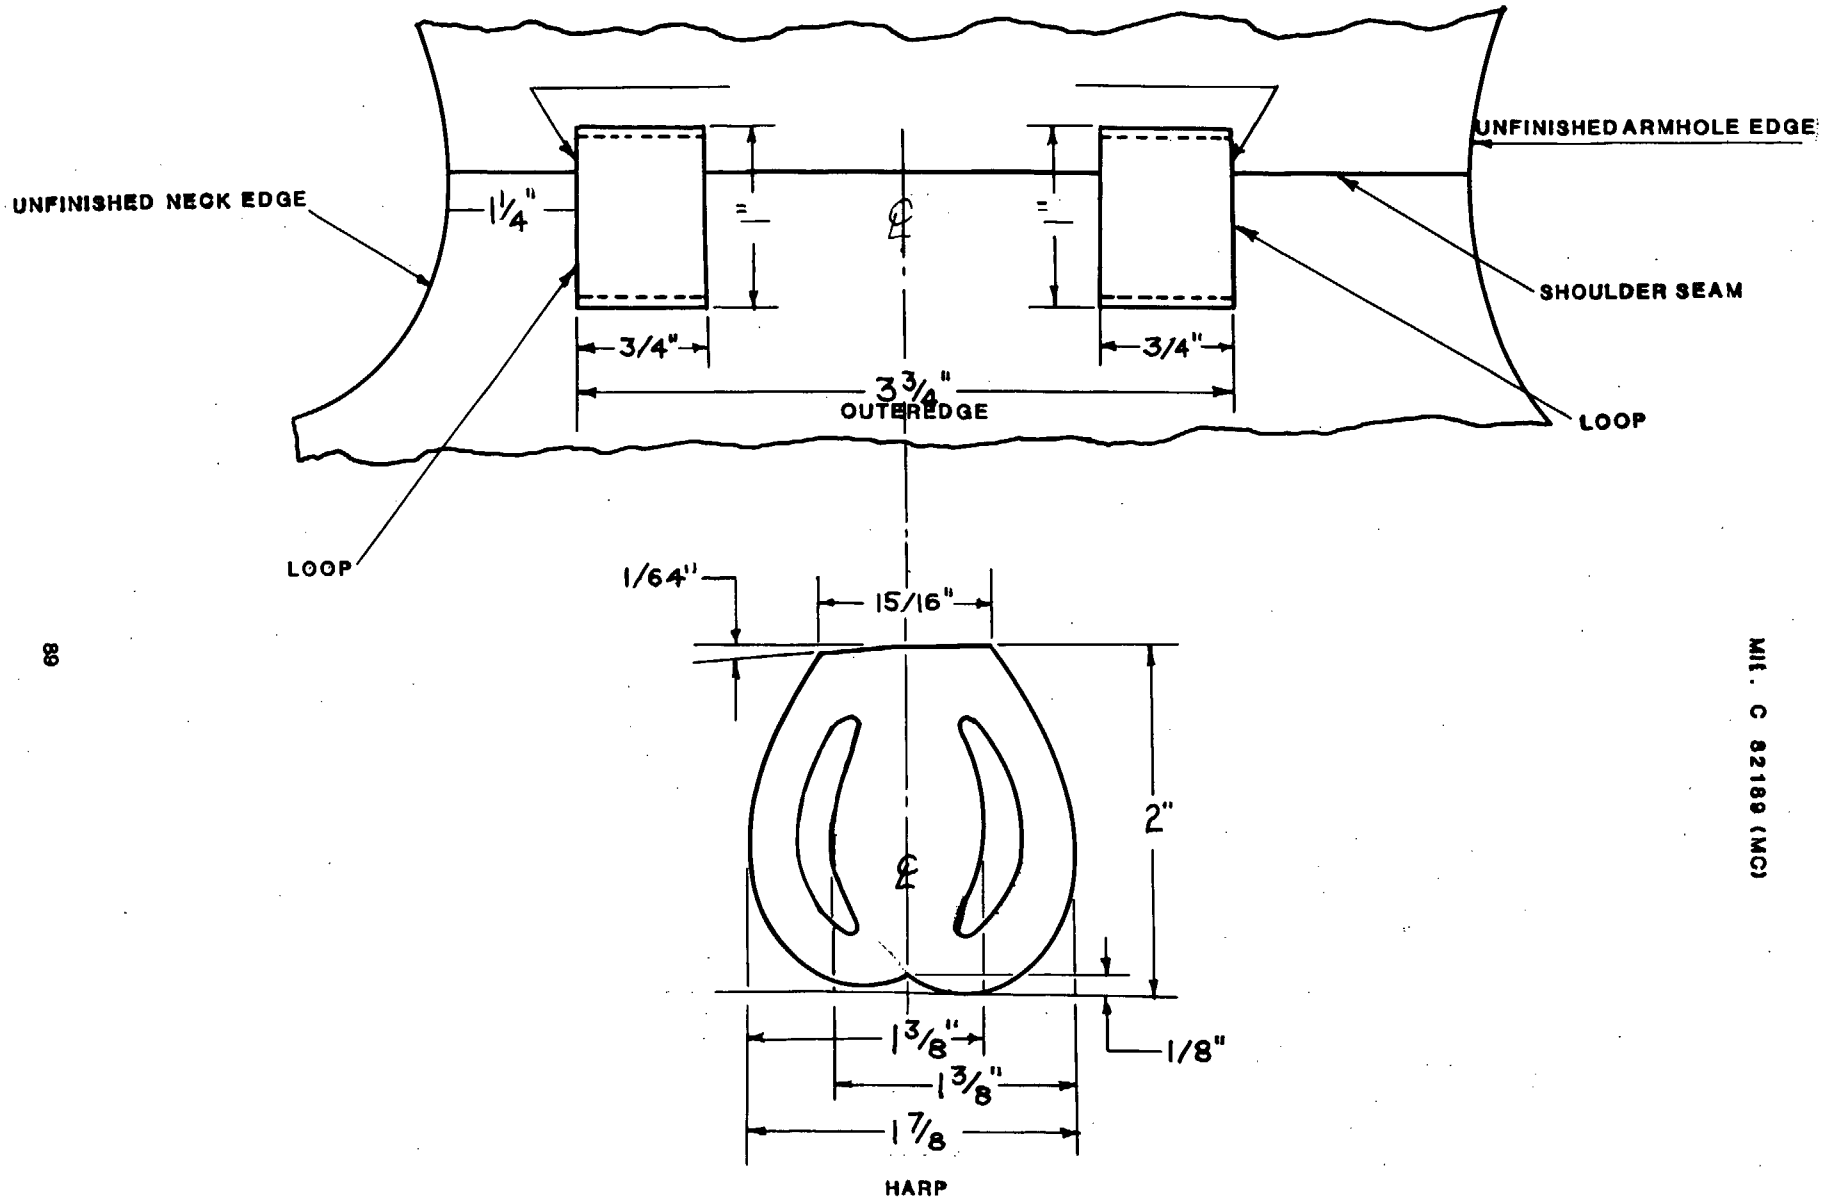


FIGURE 8: COAT, MANS: FULL DRESS US MARINE BAND OFFICERS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

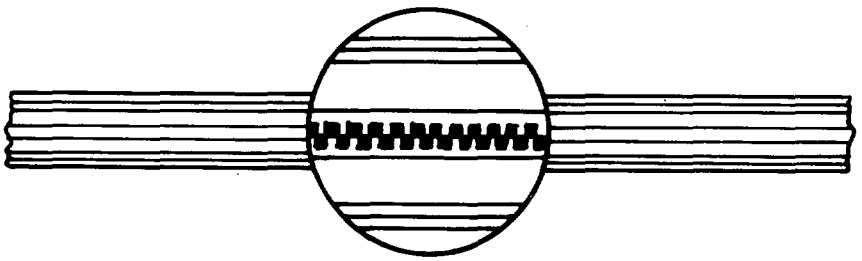

GOLD LACE (DETAIL)

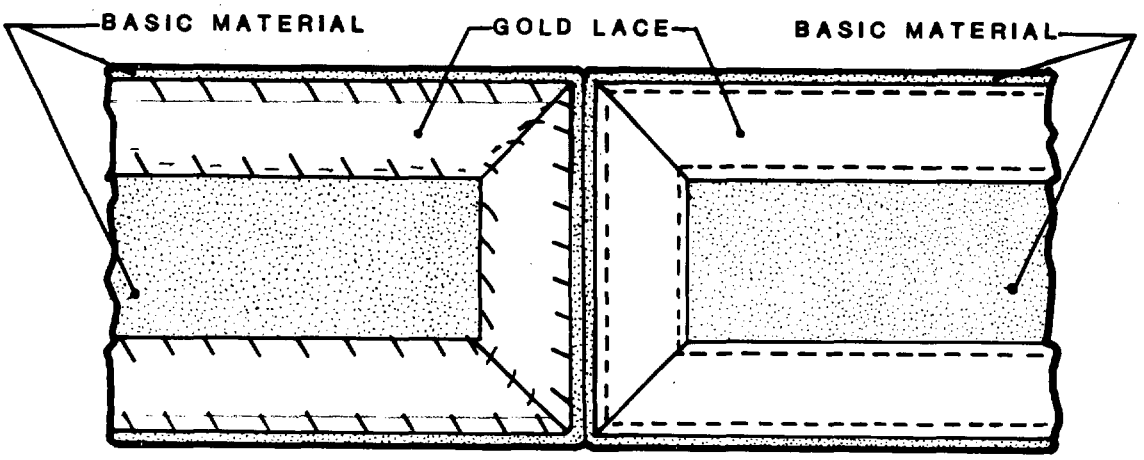

BASTING & STICHING DIAGRAM

FIGURE 9. COAT, MAN'S: FULL DRESS, U.S. MARINE BAND; OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.


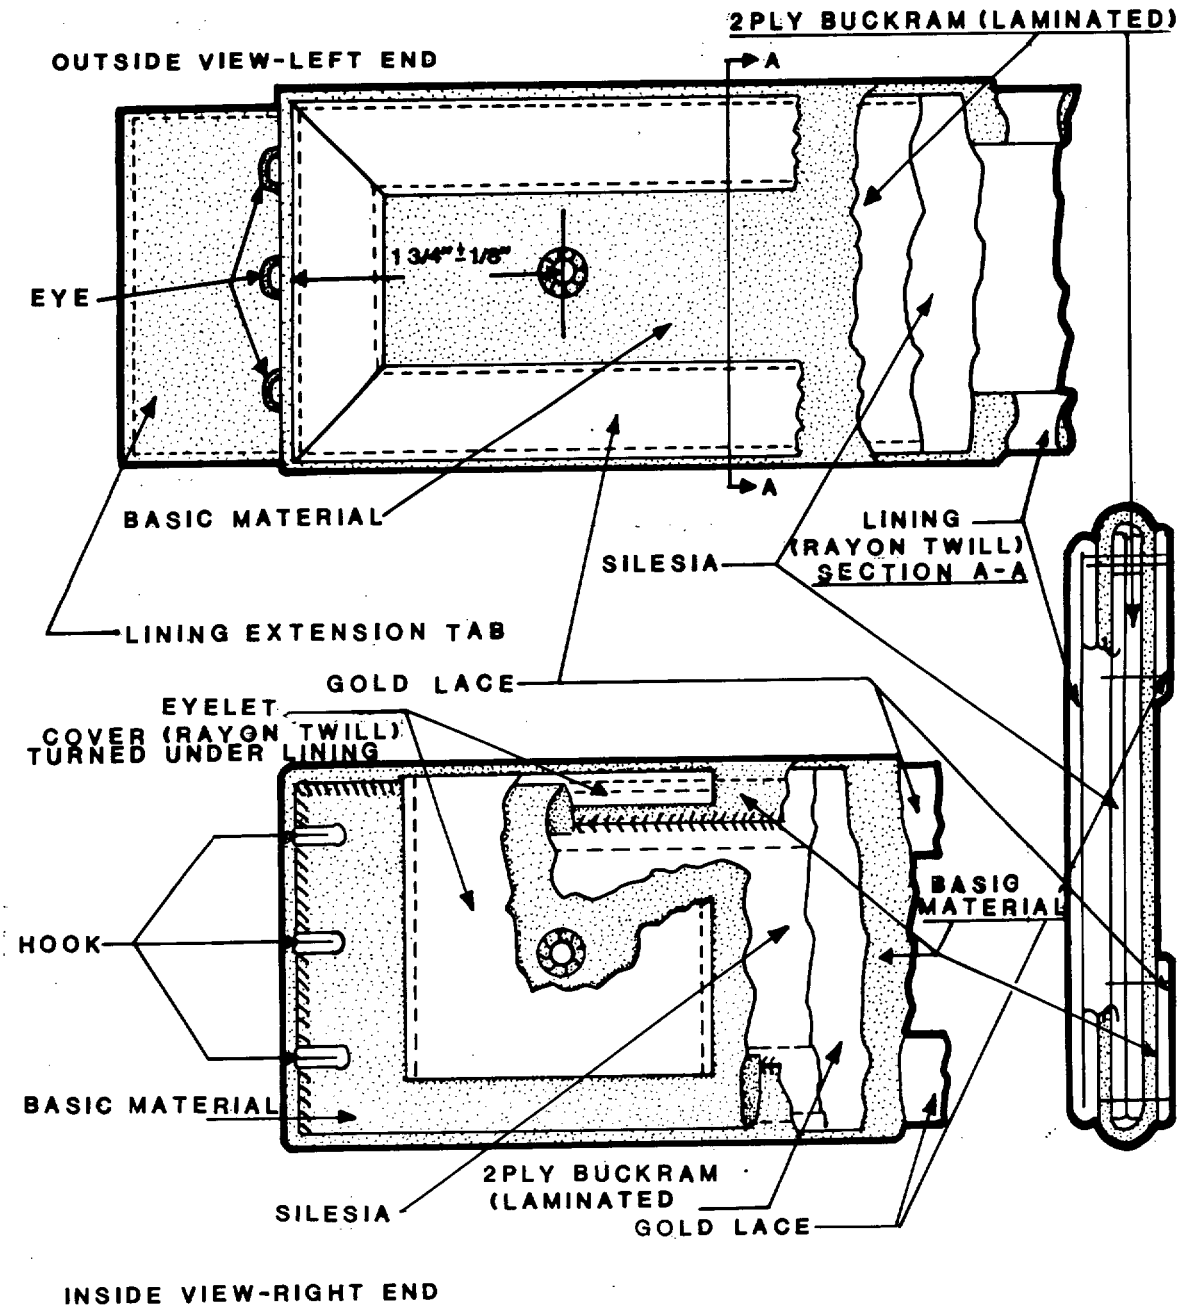


FIGURE 10. COAT, MAN'S: FULL DRESS, U.S. MARINE BAND; OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

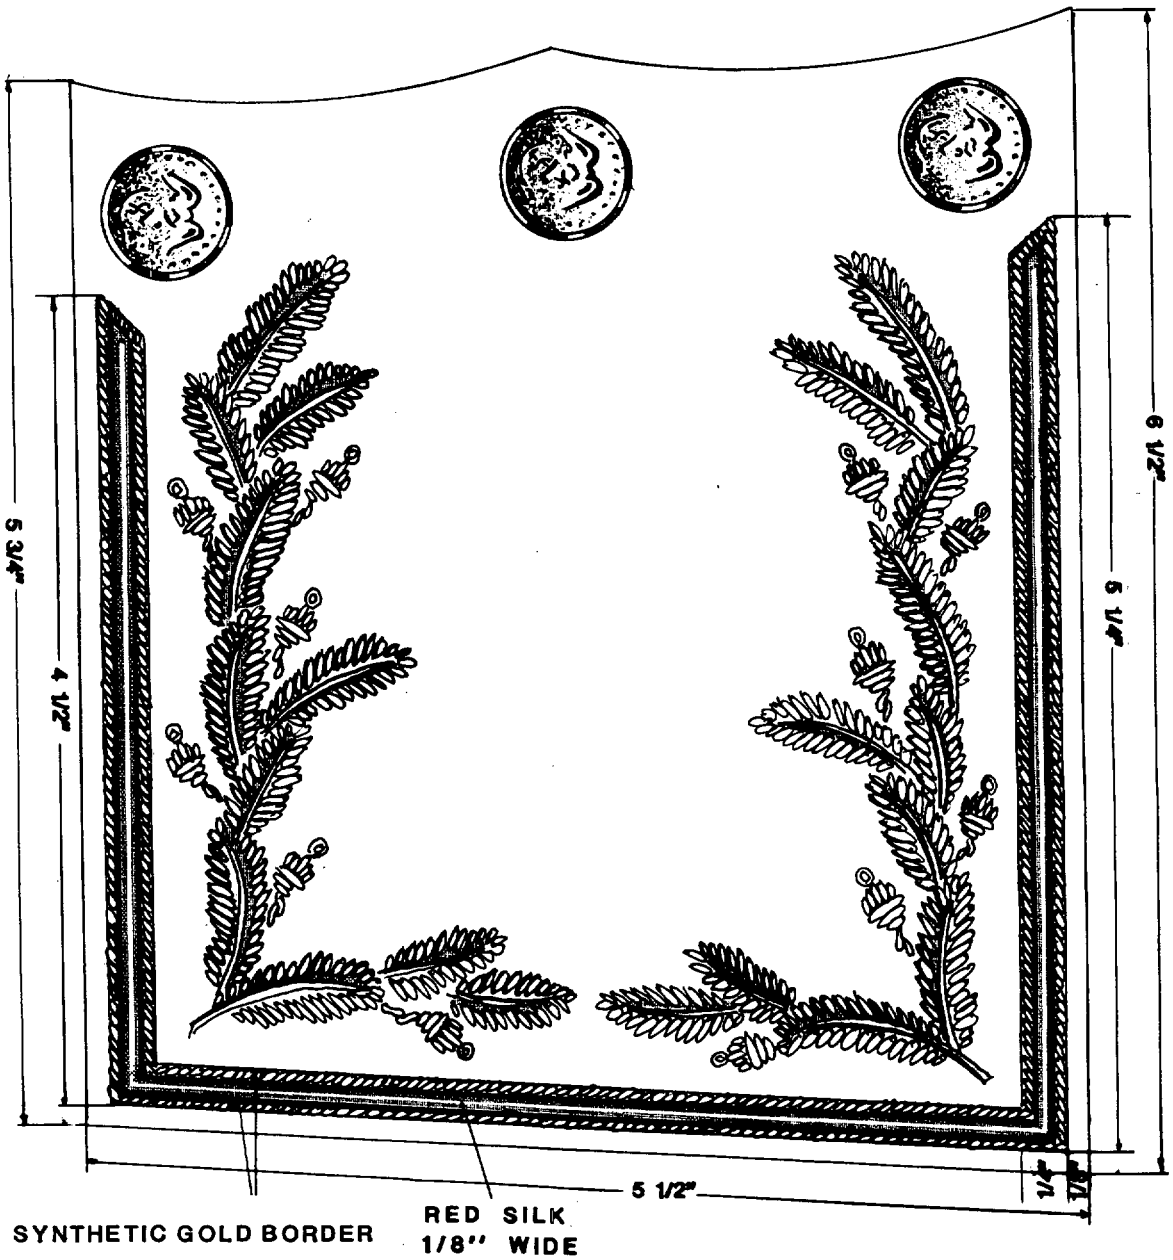


INSIGNIA, SLEEVE, DIRECTOR

FIG. 11. COAT MAN'S, FULL DRESS,

U.S. MARINE BAND, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

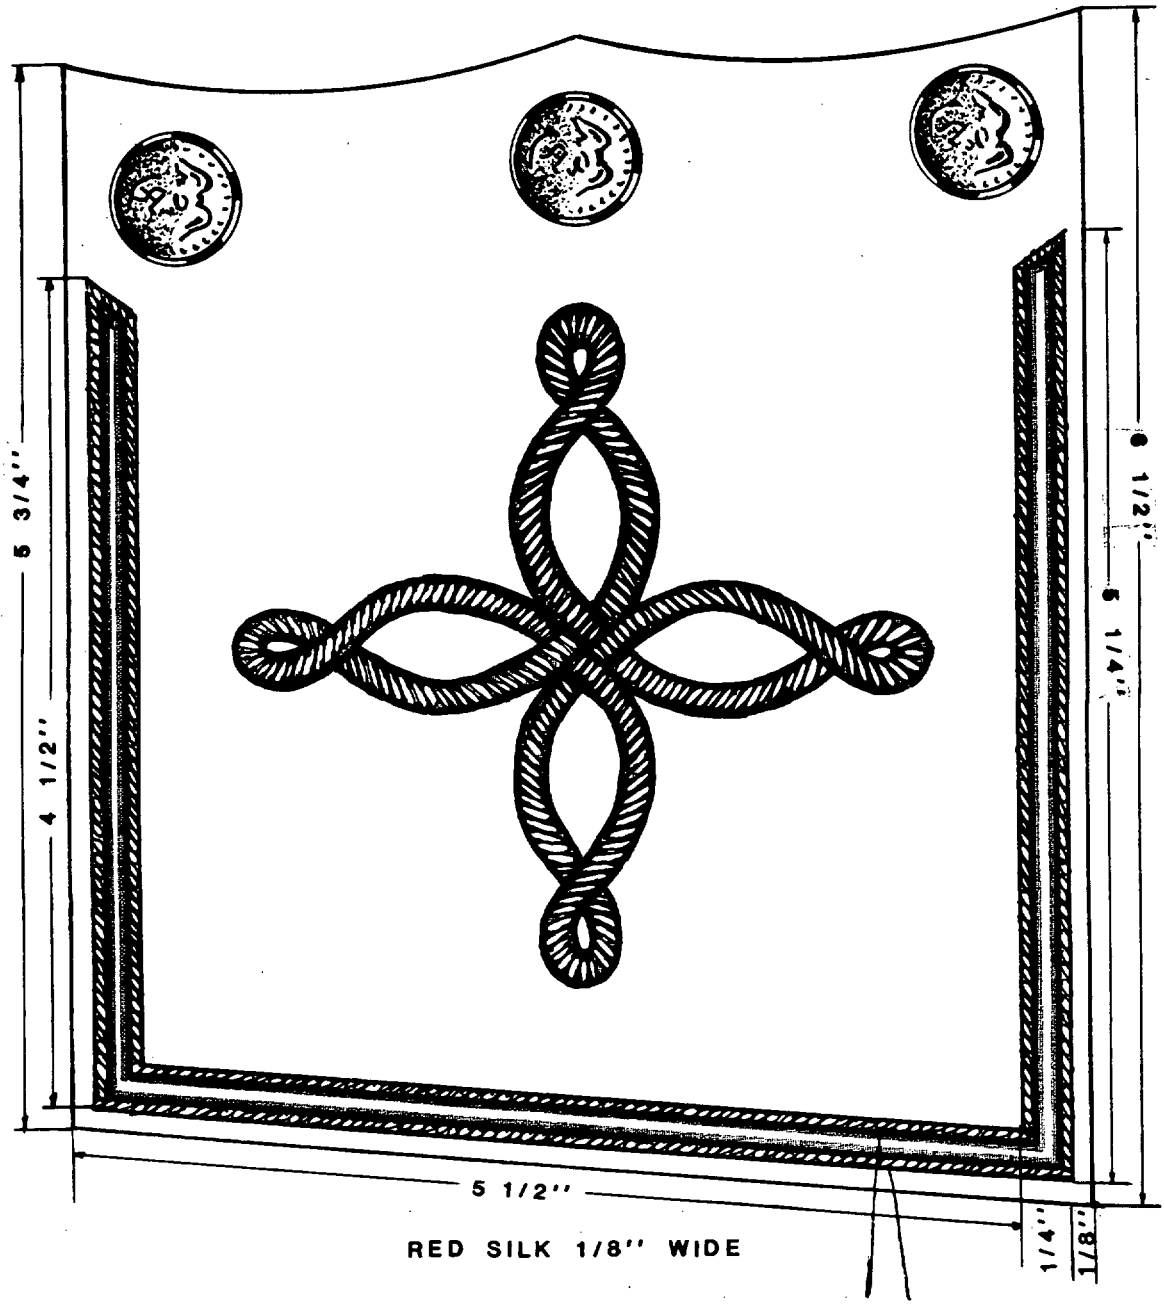

INSIGNIA, SLEEVE, ASS'T DIRECTOR

FIG. 12. COAT MAN'S, FULL DRESS, U.S. MARINE BAND, OFFICER'S

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE MIL-C-82189(MC) COAT, MAN'S: FULL DRESS, U. S. MARINE BAND, OFFICER'S

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

S/N 0102-LF-014-1802

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

FOLD

Department of the Navy
Headquarters, U.S. Marine Corps
Washington, D.C. 20380

POSTAGE AND FEES PAID
DEPARTMENT OF THE NAVY
DOD-317



OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

Commandant of the Marine Corps
Headquarters. U.S. Marine Corps
(Code LMA-1)
Washington, D.C. 20380

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.