MILITARY SPECIFICATION

FUZE, ELECTRONIC TIME, M762 LOADING, ASSEMBLING, PACKING AND FUZE, ELECTRONIC TIME, M767 LESS BOOSTER

This specification is approved for use within the US Army Armament, Munitions and Chemical Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the parts, loading, assembling and packing for the Fuze, Electronic Time M762, and parts, loading assembling, but not installation of the booster or packing for the Fuze, Electronic Time M767.

2. APPLICABLE DOCUMENTS

2.1 Government documents

2.1.1 Specifications and standards. The following specifications and standards form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of these documents shall be those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation.

SPECIFICATIONS

MILITARY

MIL-W-8939 - Welding, Resistance of Electronic Circuit Modules

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, U.S. Army Armament, Munitions, and Chemical Command, Attn. AMSMC-QA, Picatinny Arsenal, New Jersey 07806-5000 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.
Source: https://assist.dla.mil -- Downloaded: 2020-03-19 10:10
Check the source to verify that this is the current version before use.

MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specifications for
MIL-P-60412 - Packaging, Packing, and Marking for Shipment of Artillery Type and Rocket Fuzes: General Specification For

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-331 - Fuze and Fuze Components, Environmental and Performance Tests for
MIL-STD-454 - Standard General Requirement for Electronic Equipment
MIL-STD-45662 - Calibration System Requirements

2.1.2 Other Government documents, drawings, and publications The following other Government documents form a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

DRAWINGS: (see 6.11)

US Armament Research, Development and Engineering Center (ARDEC)

8861213 - Box, Wirebound, Packing Ammunition for Artillery or Rocket Fuzes
8864492 - Box, Ammo, Metal, for Artillery Type and Rocket Fuzes
8886458 - Box, Pallet Type, Wirebound, Packing, Ammunition for Artillery Type and Rocket Fuzes (Within M2A1 Box)
12551000 - Fuze Assembly, M762
12551001 - Fuze Assembly M767 Less Booster
12550753 - Inductive Setting Requirements for M762/M767 E.T. Fuze
12550756 - Sneak Circuit Analysis

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

International Test Operation Procedures

ITOP 1-2-601	-	Laboratory Vibration Schedules
ITOP 4-2-602	-	US Army Test and Evaluation Command International Test Operations Procedure, "Rough Handling Tests"

Army Regulation

AR70-38	-	Research, Devlopment, Test and Evaluation of Material for Extreme Climatic Conditions

(Copies of specifications, standards, handbooks, drawings, and publications required by manufacturers in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer.)

2.2 Other publications. The following documents form a part of this specification to the extent specified herein. Unless otherwise specified, the issue of the documents which are DOD adopted shall be those listed in the issue of the DODISS specified in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS shall be the issue of the nongovernment documents which is current on the date of the solicitation.

AMERICAN NATIONAL STANDARDS INSTITUTE (ANSI)

ANSI Z1.1	-	Guide for Quality Control Charts
ANSI Z1.2	-	Control Chart Method of Analyzing Data
ANSI Z1.3	-	Control Chart Method of Controlling Quality During Production

(Applications for copies should be addressed to American National Standards Institute, 1430 Broadway, New York, New York 10018.)

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

ASTM E29	-	Standard Recommended Practice for Indicating Which Places of Figures Are To Be Considered Significant In Specified Limiting Values

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

(Application for copies of ASTM publications should be addressed to the American Society for Testing and Materials, 1916 Race Street, Philadelphia, Pennsylvania 19103.

2.3 Order of precedence. In the event of a conflict between the text of this specification and the references cited herein, (except for associated detail specifications, specification sheets or MS standards), the text of this specification shall take precedence. Nothing in this specification, however, shall supercede applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 Material. Materials shall be in accordance with applicable drawings and specifications.

3.1.1 Interface definition. The fuze shall be fitted to the desired projectile by means of a threaded plug with 2.0-12 UNS-1A threads. No other mechanical or electrical interfaces with the selected projectile is required.

3.2 Parts and assemblies. The parts and assemblies shall comply with all requirements specified on the drawings (dwg. 12551000 for the M762, 12551001 for the M767) and with all requirements specified in applicable specifications, except where further definition is provided by this specification.

3.3 Performance characteristics.

3.3.1 Time setting (air burst) mode. The fuze shall be capable of being set manually or inductively for actuation times from 0.5 to 199.9 seconds in 0.1 second increments. When the set time is reached, the fuze shall cause the projectile to function in an air burst mode within $\pm$ .3 seconds of the set time in the temperature range $-25^{o}F$ to $+110^{o}F$.

3.3.2 Impact mode. The fuze shall be capable of being set to an impact mode and shall be functional in the impact mode no earlier than 500 ms after muzzle exit.

3.3.3 Safe and arm device. The S&A Assembly (12550900) shall be tested for Arming and Non-Arming according to 4.6.2.3.

3.4 Statistical process control. The contractor's quality program plan or detailed inspection plan shall include documented statistical process controls (SPC). The SPC plan shall be submitted to the contracting officer for review and approval by the cognizant technical agency (CTA) in accordance with the

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

approved Data Item Description (DID) Specified on the Contract Requirements List (CDRL) in the contract (see 6.4). The contractor shall not initiate production without written approval from the contracting officer. Once approved, if SPC is used for process control purposes only, the contractor may change process control parameters or add new SPC features as necessary. However, if SPC is used for acceptance purposes, the contractor shall not change the SPC without written approval from the contracting officer.

3.5 Ballistic functioning.

3.5.1 Time set. The fuze shall function at the set time within the set time tolerance when set to the time mode.

3.5.2 Point detonation set. When set to the Point Detonation (PD) mode, the fuze shall cause the projectile to function on impact with a six inch minimum thick plywood target if impact occurs after a flight time of 500 msecs or more after muzzle exit. When fired at this target so that impact occurs within 400 calibers of muzzle exit, the fuze shall not function when impacting the target.

3.5.3 Premature (see 6.3.1) or early bursts (see 6.3.2). There shall be no premature bursts or early bursts in the gun tube or in-flight.

3.6 Environmental Requirements.

3.6.1 Storage. The fuze, in its standard packing container, shall be capable of being stored in a -60°F to +160°F environment and remain safe and operable.

3.6.2 Logistic vibration. The fuze shall meet the requirements of ITOP 1-2-601, according to 4.6.3.1 of this specification.

3.6.3 Twenty-eight day hot. The fuze shall meet the requirements of 4.6.3.2 of this specification.

3.6.4 Fourteen day humidity. The fuze shall meet the requirements of 4.6.3.3 of this specification.

3.6.5 Tactical vibration. The fuze shall meet the requirements of ITOP 1-2-601, according to 4.6.3.4 of this specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

3.6.6 Salt fog. The fuze shall meet the requirements of MIL-STD-331, Test 107.1, according to 4.6.3.5 of this specification.

3.6.7 Seven foot drop - boxes. The fuze shall meet the requirements of MIL-STD-331, Test T121, according to 4.6.3.6 of this specification.

3.6.8 Bounce (loose cargo). The fuze shall meet the requirements of ITOP 4-2-602, according to 4.6.3.7 of this specification.

3.6.9 Seven foot drop - cans. The fuze shall meet the requirements of MIL-STD-331, Test T121, according to 4.6.3.8 of this specification.

3.6.10 Five foot drop - bare. The fuze shall meet the requirements of MIL-STD-331, Test T121, according to 4.6.3.9 of this specification.

3.6.11 Accelerating aging test. The fuze shall meet the requirements of 4.3.3.2.3 of this specification.

3.7 First article sample.

3.7.1 First article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract and 4.3 of this specification.

3.8 Lot acceptance sample. Lot Acceptance Sample and testing shall be in accordance with 4.4.2.

3.9 Electrical performance.

3.9.1 PWB electrical tests (PN 12550830). The PWB assembly shall be tested per 4.6.1.1 of this specification.

3.9.2 Level II tests (PN 12550800).. The Level II assembly shall be tested per 4.6.1.3 and Table VI of this specification.

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

3.9.3 Battery assembly (PN 12550890). The battery assembly shall be tested for non-activated voltage and resistance per 4.6.1.7.

3.9.4 Explosive resistance.

a. Actuator, piston (12550906).
The resistance of the piston actuator shall be measured per 12550900 using a meter supplying less than 1 ma.

b. Detonator, electric (12550926).
The detonator resistance shall be measured per 12550920 using a meter supplying less than 1 ma. (see drawing 12550926 note 4).

c. Battery primer assembly, stab/electrical (12550991).
The battery primer resistance shall be measured per 12550990 using a meter supplying less than 1 ma.

d. Detonator, electric socket contact to ground socket (12550900).
Using a meter supplying less than 1 ma, verify that the S&A assembly detonator contact (see drawing 12550900, note 4H) to ground socket resistance is greater than 10 megaohms.

e. Battery primer socket to ground socket (12550900).
Using a meter supplying less than 1 ma, verify that the S&A assembly battery primer contact (see drawing 12550900, note 4H) to ground socket resistance is greater than 10 megaohms.

f. Detonator electric resistance (12550900).
Using a meter supplying less than 1 ma, verify that the S&A assembly detonator electrode (see drawing 12550900, note 4G) to ground socket resistance is less than 0.30 ohm.

3.10 Change of circuit design. Whenever an engineering change proposal involves a change of the approved circuit design, as a minimum, the contractor shall perform a sneak circuit analysis in accordance with drawing 12550756 to ensure that the change shall not adversely affect the performance, quality or reliability of the fuze.

3.11 Workmanship.

3.11.1 General workmanship. All parts shall be fabricated and finished in a thorough, workmanship manner and all manufacturing, processing and assembly operations shall be

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

correctly performed. The parts shall be clean and free of burrs, short edges, unblended radii, surface defects, cracks, chips, dirt, grease, and oil (except where specifically required), rust and other foreign matter. The cleaning method used shall not be injurious to any part, nor shall the parts be contaminated by the cleaning agent. All required markings shall be neat, legible and sharply defined.

3.11.2 Solder workmanship. Solderability workmanship includes requirement 5 of MIL-STD-454 and the following specific requirements pertaining to surface mount device soldering.

3.11.3 Chip capacitor or resistor attachment. Reject for the following defects:

a. Insufficient solder such that a melt line is not visible around at least 1/2 of the visible bonding area on each end.

Note: On end terminated parts, a melt line must be visible around at least 1/2 of the visible bonding area on each end.

b. Any solder extending onto the top surface of resistors, capacitors, switches, etc., or if there is no visible space between the part and the solder under magnification no greater than 10X.

c. Any residual flow.

d. Any foreign material in solder melt that does not exhibit a fillet.

e. Any flaking solder.

f. Any solder run-out towards an uncommon part or deposited resistor or capacitor that leaves no visible space under magnification no greater than 10X.

g. Any solder on a substrate bond pad which would prevent bonding to clear metal.

h. Solder reflow on end terminated parts that reduces the original separation end to end to less than 1/2 or that leaves no visible space under magnification no greater than 10X.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

i. End terminated chip-caps must have a continuous metallization path to the top of the capacitor.

j. Cold solder-dull, stringy, porous looking solder with voids along 1/2 of the contact perimeter at either end (see Figure 1).

k. Any chip component which is not oriented on the solderable pad area per Figure 2 of this specification.

l. Any chip component which has shifted or rotated toward adjacent uncommon components or has reduced uncomon conductor spacing by more than 1/2 the design width.

3.11.4 Surface mount discrete devices (quad packs crystals). Reject for the following defects:

a. Misalignment - Leads misaligned from the attachment area more than 1/2 lead width.

b. The lap solder length is less than 2X the diameter or width of a lead or less than 1X the width of a ribbon.

c. Excess solder creates a short or contour of the lead is not visible.

d. Heel to toe solder fillet on "J" bend leads is less than 1 lead diameter in length.


3.11.5 Cast and molded components. Cast and molded components shall be of uniform quality, free of coldshuts, blowholes, shrinkage defects, voids, cracks, and foreign inclusions. Casting must be clean, dry and free of chips. Cast and molded plastic parts may display surface color variations due to flow pattern and filler content.

3.11.6 Flash removal. All flash must be completely removed from parting lines, internal and external profiles, cored holes and ejector pin marks, except as noted on drawings.

3.11.7 Gates. All waste materials remaining from the gate must be removed except when so noted on the drawings.


3.11.8 Remelted scrap. No scrap shall be used other than sprues, gates, and rejected die castings of the particular manufacturer's own plant. Rejected die castings may be used if free from finishes, lubricants or any substance which may contaminate the alloy.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

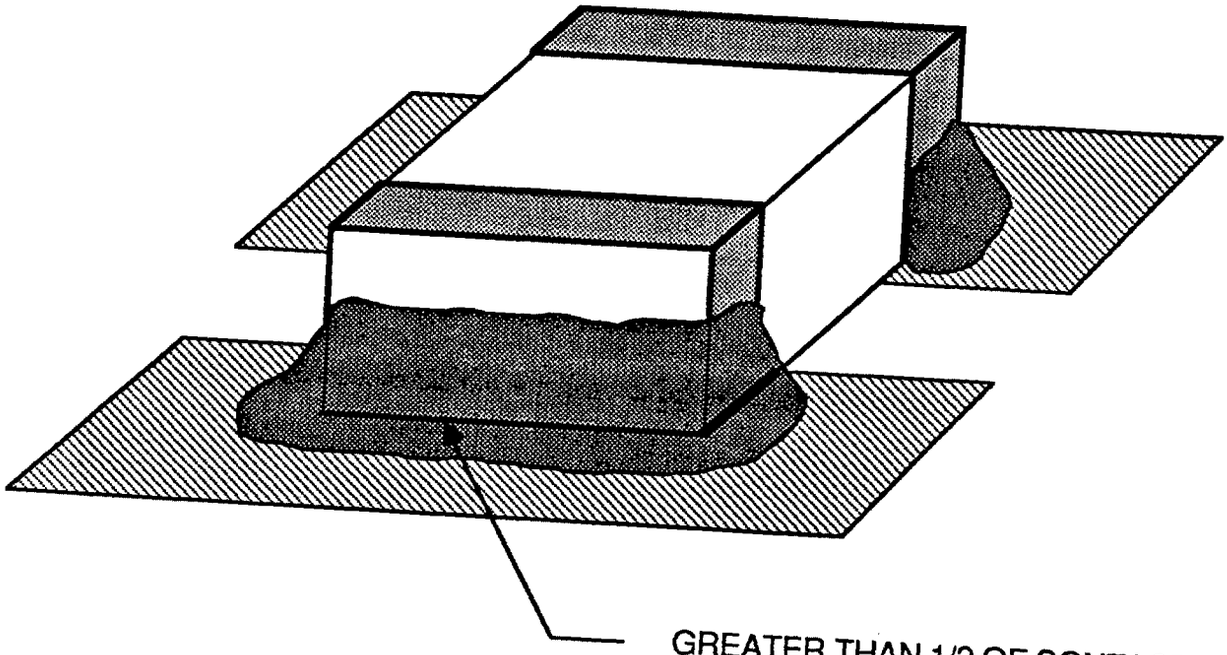


CAPACITOR SOLDER CONFIGURATION
FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

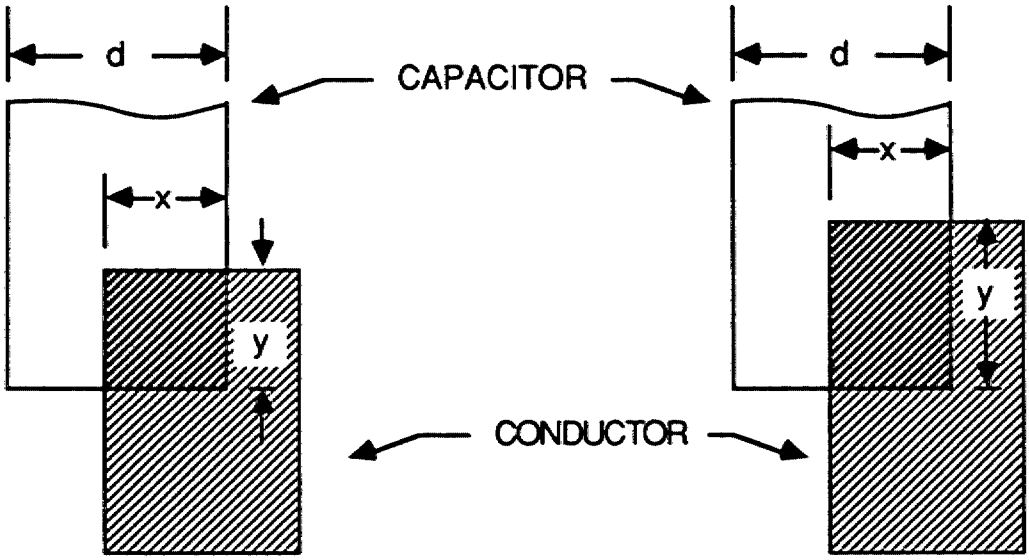

REJECT, for y less than 3 mils

ACCEPT, y equal to or greater than 3 mils

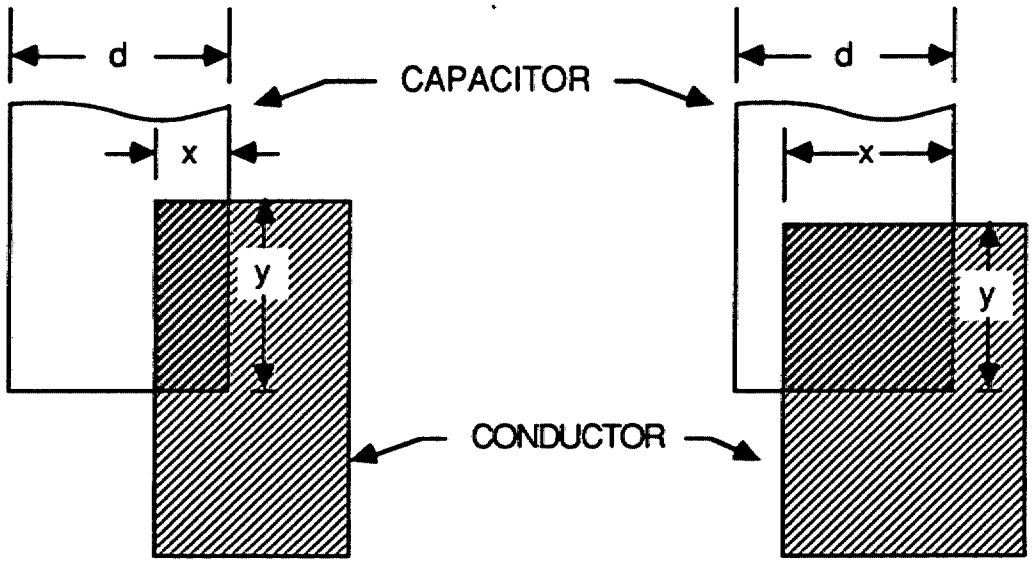

REJECT, for x less than 1/2 d

ACCEPT, x equal to or greater than 1/2 d

CHIP COMPONENT ORIENTATION
FIGURE 2

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

3.11.9 Solvent precaution. In the manufacture of the fuze or its components, only those cleaners or solvents which are known to have no interaction with the fuze materials shall be used. Particular attention must be directed to plastics, elastomers and other organic materials which are generally susceptible to chemical attack in the form of solvation, absorption, plasticization or stress cracking. Determination of suitability for use must consider not only immediate and short term effects, but also long term effects of chemical interaction that may manifest in long term storage at temperature extremes and rough handling environments.

3.11.10 Welding. Welding workmanship requirements shall be per MIL-W-8939, section 3.7.1.1.

4. QUALITY ASSURANCE PROVISIONS.

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contact, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirement in the specification should not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality performance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.2 Classification of inspections. Inspection requirements specified herein are classified as follows:

a. First Article Inspections (see 4.3).

b. Quality Conformance Inspections (see 4.4)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.2.1 Alternate inspection provisions. Alternative inspection procedures, methods or equipment (including tool inspection, statistical process control, substitute sampling plans, etc.) may be used by the contractor when they provide as a minimum, the level of quality assurance required by the provisions specified herein. Prior to applying such alternative inspection procedures, methods or equipment, the contractor shall describe in writing how the proposed alternative(s) is equal to or better than the specified quality assurance provisions specified herein. In cases of dispute as to whether certain procedures of the contractor's proposed alternative(s) provide equal assurance, the provisions of this specification shall apply. Approved alternative inspecting provisions shall be incorporated in the contractor quality program plan or detailed inspection plan.

4.3 First article inspection.

4.3.1 First article submission. The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with the provisions of 4.3.2. The first article sample shall consist of the following quanities:

a. Ten (10) each of every component, subassembly and assembly listed in 4.4.3.1 through 4.4.3.61 herein, except that for cast, molded and stamped components, five (5) each shall be submitted from every die/mold cavity or stamping tool from which each component was made. Inspection shall be per 4.3.2.1.

b. Two hundred fifty-five (255) complete fuze assemblies. Inspection shall be per 4.3.2.2.

4.3.2 Inspections to be performed.

4.3.2.1 Examinations and static tests. The first article samples submitted in accordance with 4.3.1a shall be subjected to any or all of the inspections listed in 4.4.3.1 through 4.4.3.61 and to any or all of the applicable drawing requirements.

4.3.2.2 Functioning performance tests. The fuze assemblies submitted in accordance with 4.3.1b shall be subjected to the following tests:


a. Cold temperature sequential operational and safety tests per Tables I-A and I-C (60 fuzes).

b. Hot temperature sequential operational, safety and accelerated aging per Tables I-B and I-C (80 fuzes).

c. Reliability tests per Table II, III and IV (115 fuzes)


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE I-A First article cold temperature sequential operational and safety tests

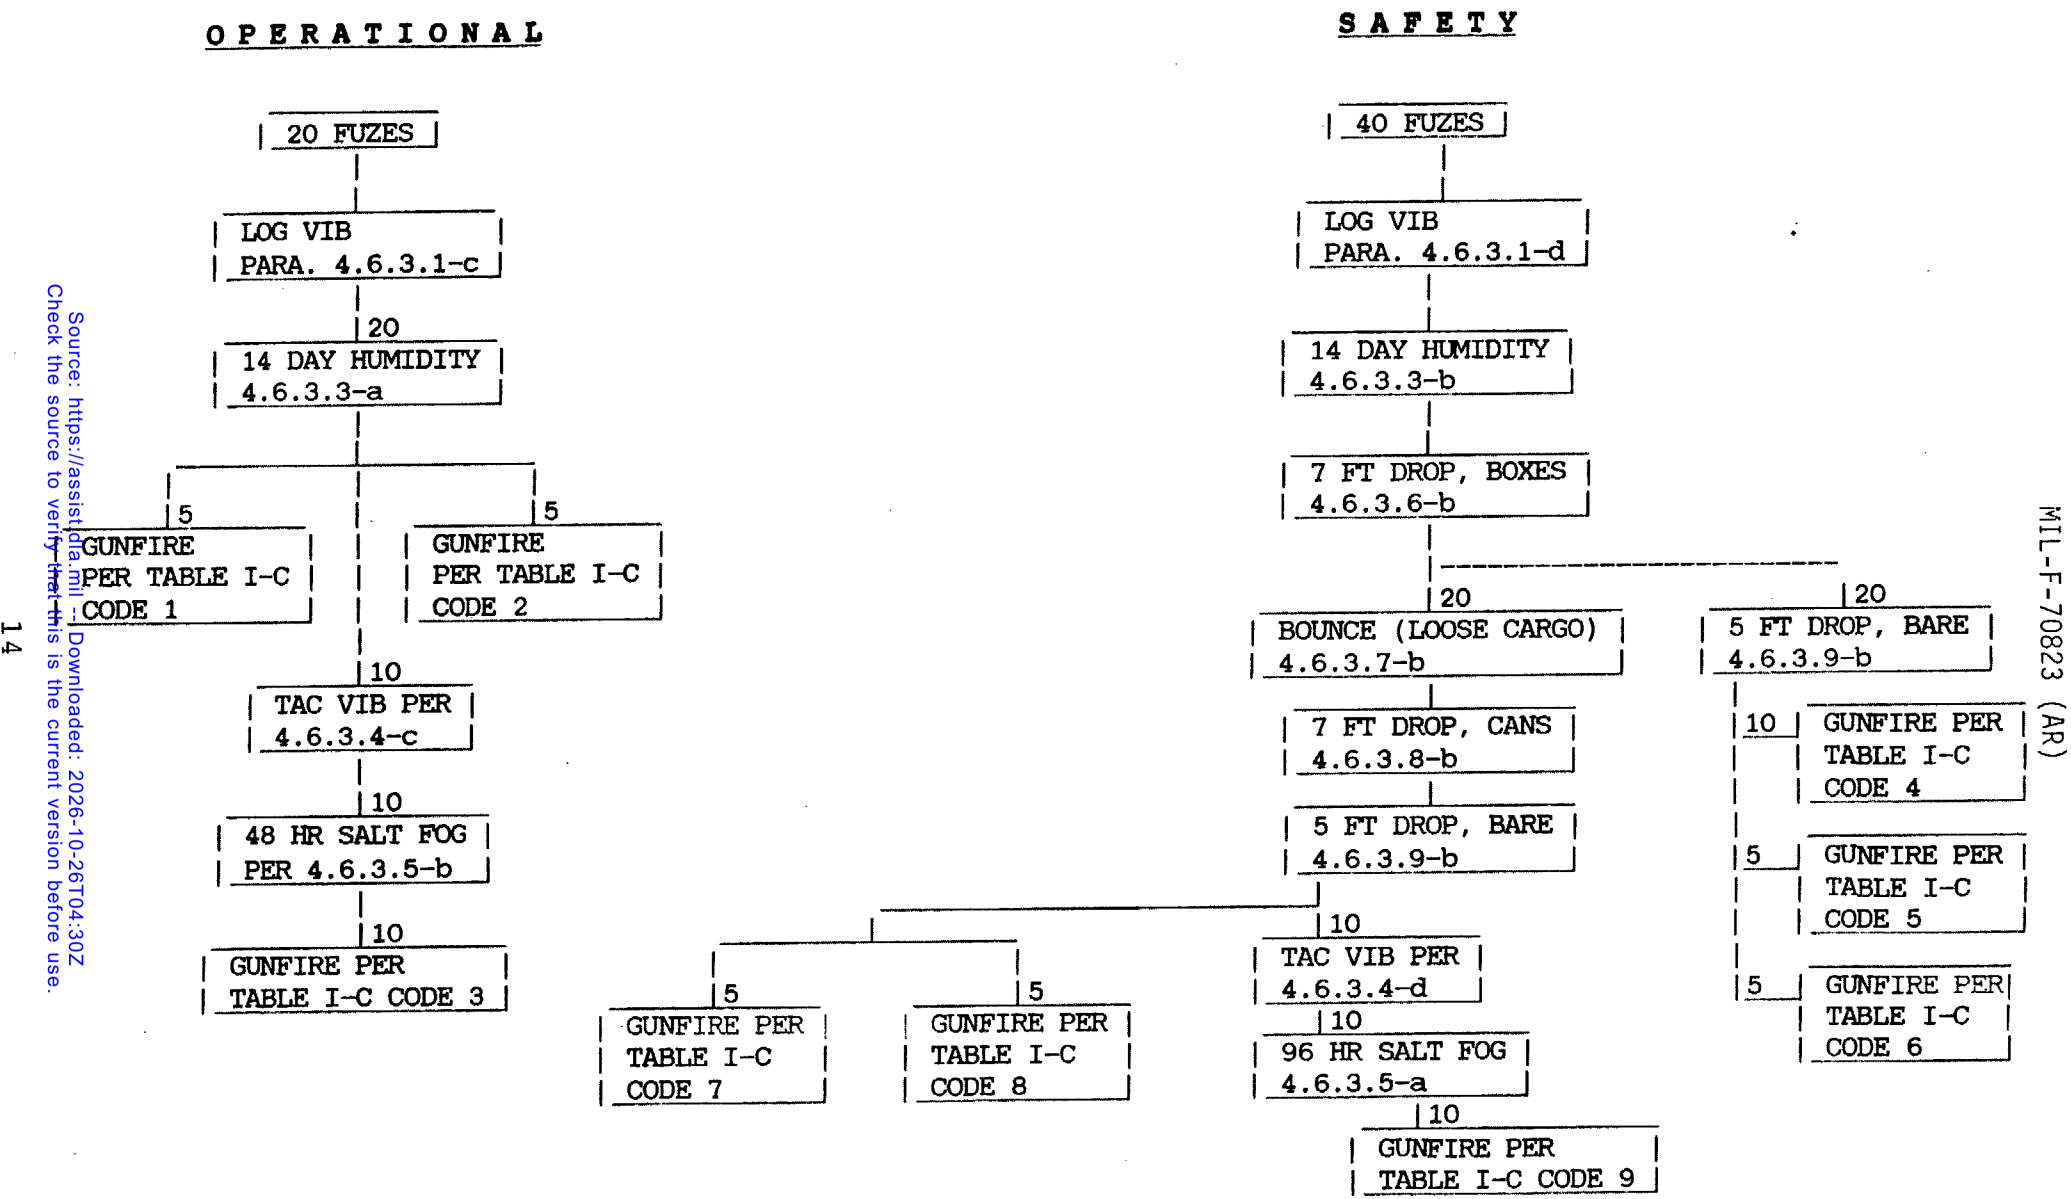

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE I-B First article hot temperature sequential operational and safety tests

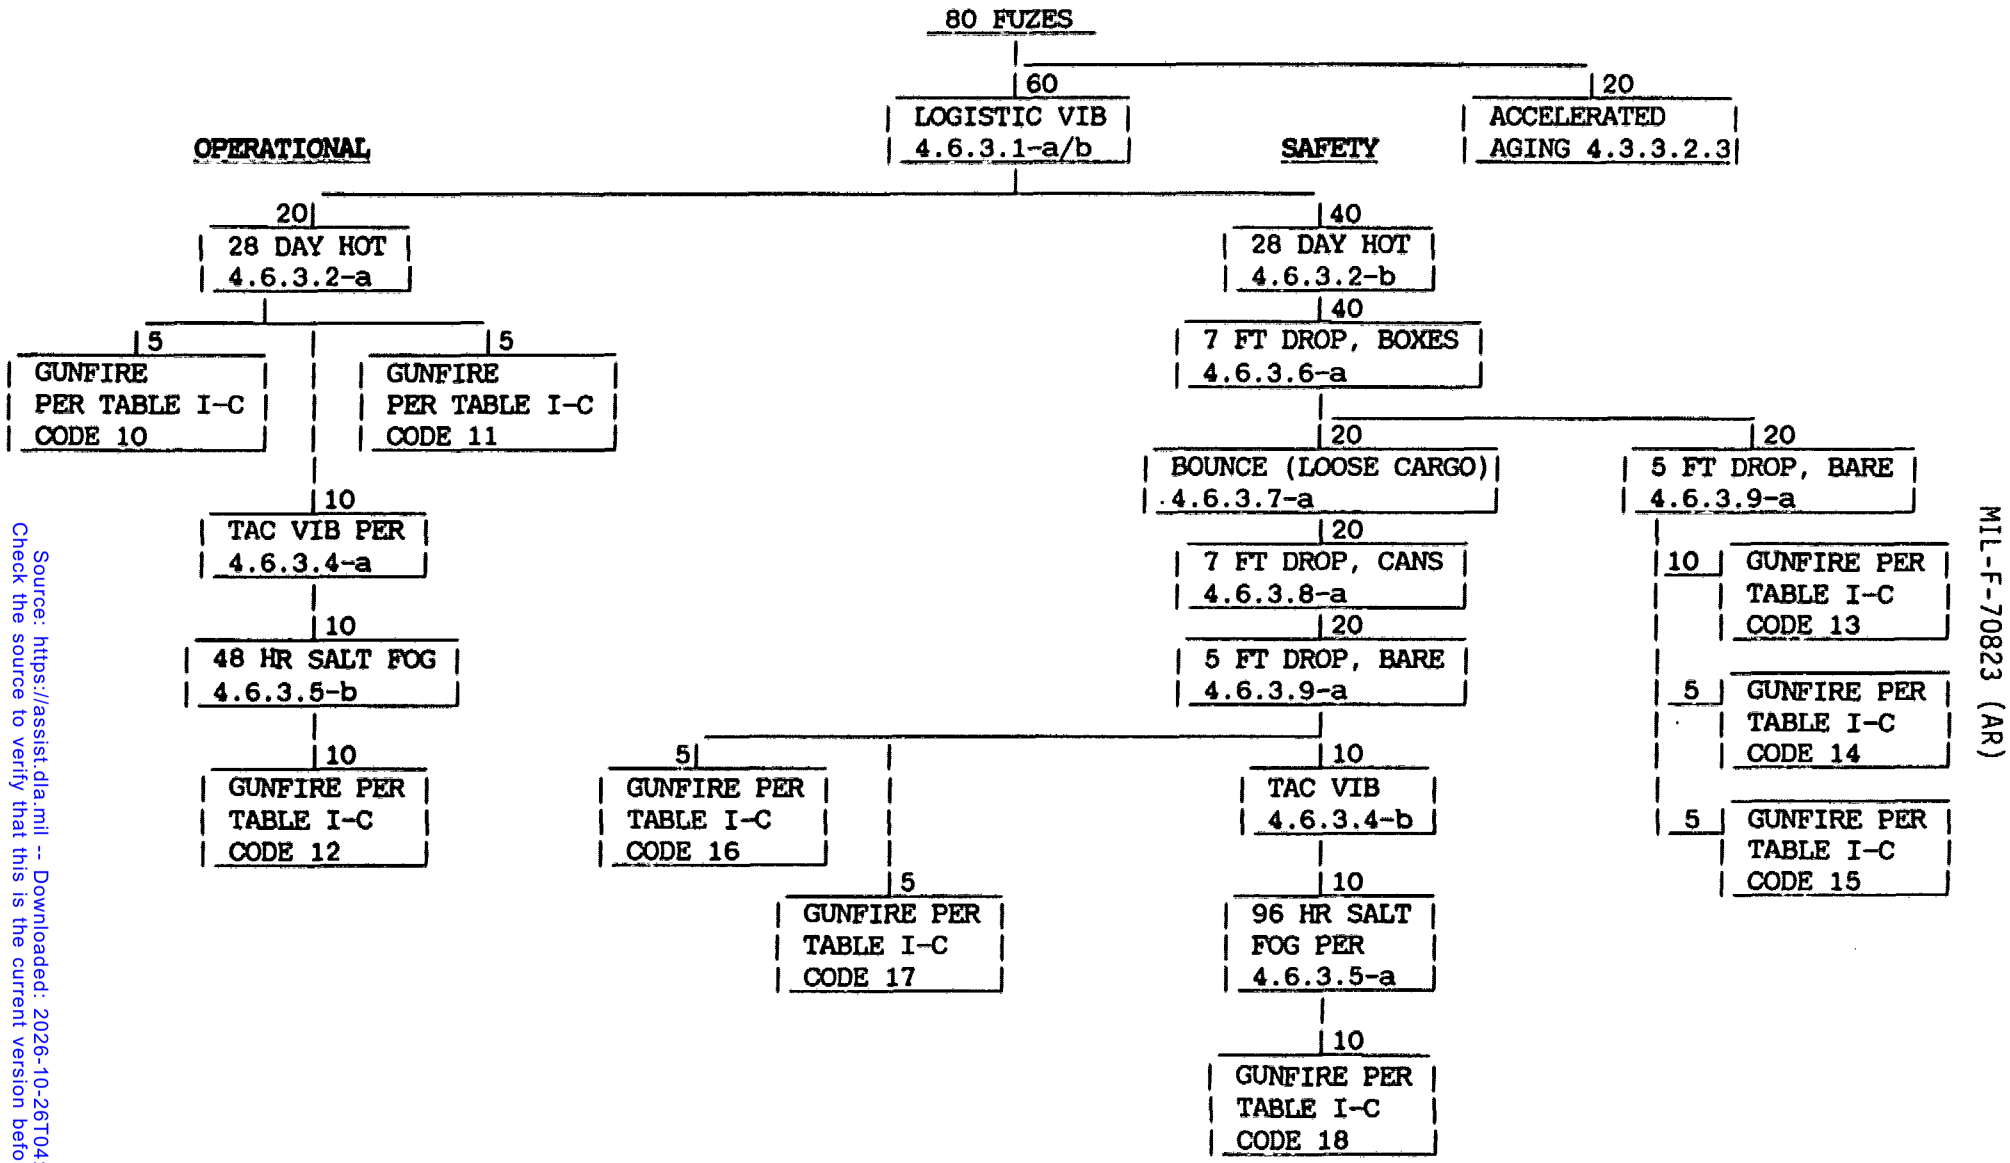

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE I-C First article safety / sequential operational gunfire matrix

CODE[1]	CALIBER	WEAPON	TUBE[2]	PROPELLANT	ZONE[4]	PROJECTILE[5]	TEMP FUZE	TEMP PROJ	TEMP PROP
1	105MM	M119	L20A1	M200	8	M1	-25°F	-25°F	-25°F
2	8 INCH	M110A2	M201A1	M188A1	9	M650A1[3]	-25°F	-25°F	-25°F
3	155MM	M198	M199	M203A1	8	M549A1[3]	-25°F	-25°F	-25°F
4	105MM	M2A2	M2A2E2	M67	1	M1	-60°F	-60°F	+70°F
5	8 INCH	M110A2	M201A1	M1	1	M106	-60°F	-60°F	+70°F
6	155MM	M109A2/A3	M185	M3A1	1	M107	-60°F	-60°F	+70°F
7	105MM	M119	L20A1	M200	8	M1	-60°F	-60°F	+70°F
8	8 INCH	M110A2	M201A1	M188A1	9	M650A1[3]	-60°F	-25°F	+70°F
9	155MM	M198	M199	M203A1	8	M549A1[3]	-60°F	-60°F	+70°F
10	105MM	M119	L20A1	M200	8	M1	+110°F	+110°F	+110°F
11	8 INCH	M110A2	M201A1	M188A1	9	M650A1[3]	+110°F	+110°F	+110°F
12	155MM	M198	M199	M203A1	8	M549A1[3]	+110°F	+110°F	+110°F
13	105MM	M2A2	M2A2E2	M67	1	M1	+145°F	+145°F	+145°F
14	8 INCH	M110A2	M201A1	M1	1	M106	+145°F	+145°F	+145°F
15	155MM	M109A2/A3	M185	M3A1	1	M107	+145°F	+145°F	+145°F
16	105MM	M119	L20A1	M200	8	M1	+145°F	+145°F	+145°F
17	8 INCH	M110A2	M201A1	M188A1	9	M650A1[3]	+145°F	+145°F	+145°F
18	155MM	M198	M199	M203A1	8	M549A1[3]	+145°F	+145°F	+145°F

1. From Table I-A or I-B
2. All tubes to have 90% remaining life or better.
3. All Rocket Assist Projectile rounds will be fired in the rocket-on mode.
4. Approximately 80% of the fuzes to be set to timeout mode. Timeout mode set fuzes shall be set so that a minimum of 75% of maximum range will be achieved using standard weapon quadrant elevations. Timeout mode setting shall be per paragraph 4.7.3. The remaining fuzes shall be fired in PD mode at a quadrant elevation between 800 and 900 mils.
5. If M762 fuzes are used, the booster shall be the M767 booster assembly. M767 booster assembly shall not be subjected to sequential environments and shall be installed at the test site.
6. Projectiles shall be of the standard HE configuration.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE II First article test
(reliability)
(105mm)

HOWITZER	TUBE[3]	PROJECTILE/ FUZE	CHARGE	ZONE	TEMP[1]	NO.	SETTING[7]	APPROXIMATE QUADRANT ELEVATION (mils)
M2A2	M2A2E2	M1/M762*	M67	1	COLD/HOT	5/5	27.4[6]	1108
M2A2	M2A2E2	M1/M762*	M67	5	COLD/HOT	5/5	49.4[6]	985
M119	L20A1	M760/M762*	M200	8	HOT	5	50.1[6]	770
M204	M205	M760[8]/M762* (INERT)	M200	8	HOT	5	P.D.[2,4]	---
M2A2	M2A2E2	M1[8]/M762* (INERT)	M67	1	COLD	5	P.D.[2,5]	---

TOTAL -	35

Notes: Hot temperature - +110°F
Cold temperature - -25°F
* - Booster assembly installed at test site. M767 booster assembly shall be used.
[1]Fuze/projectile/propellant at same temperature
[2]See paragraph 4.7.2
[3]Tubes to have 90% or better remaining life
[4]Target distance to be 1200 ft. minimum
[5]Target distance to be 450 ft. minimum
[6]Setting per paragraph 4.7.3.
[7]Indicated setting times may vary from those shown depending on conditions at the time of testing.
[8]All spotting charges to be T2 with inert projectiles.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE III First article test
(reliability)
(155mm)

HOWITZER	TUBE[3]	PROJECTILE/ FUZE	CHARGE	ZONE	TEMP[1]	NO.	SETTING[6]	APPROXIMATE QUADRANT ELEVATION (mils)
M109A2/A3	M185	M107/M762*	M3A1	2	COLD/HOT	5/5	20.0[5]	575
M109A2/A3	M185	M107/M762*	M119A2	7	COLD/HOT	5/5	66.7[5]	870
M109A2/A3	M185	M483A1/M762	M3A1	3	COLD/HOT	5/5	26.1[5]	679
M109A2/A3	M185	M483A1/M762	M4A2	7	COLD/HOT	5/5	76.4[5]	1170
M198	M199	M549A1/M762*	M203A1	8	HOT	5	97.4[5]	909
M109A2/A3	M185	M107[7]/M762* (INERT)	M4A2	7	AMBIENT	5	P.D.[2,4]	---
TOTAL -						50		

Notes: Hot temperature - +110°F
Cold temperature - -25°F
* - Booster assembly installed at test site. M767 booster assembly shall be used.
[1]Fuze/projectile/propellant at same temperature
[2]See paragraph 4.7.2
[3]Tubes to have 90% or better remaining life
[4]Target distance to be 1100 ft. minimum
[5]Setting to be per paragraph 4.7.3
[6]Indicated setting times may vary from those shown depending on conditions at the time of testing.
[7]All spotting charges to be T2 with inert projectiles.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE IV First article test
(reliability)
(8 inch)

HOWITZER	TUBE[3]	PROJECTILE/ FUZE	CHARGE	ZONE	TEMP[1]	NO.	SETTING[8]	APPROXIMATE QUADRANT ELEVATION (mils)
M110A2	M201A1	M106/M762*	M1	1	COLD/HOT	5/5	40.0[6]	1100[7]
M110A2	M201A1	M650A1/M762*	M188A1	9	HOT	5	119.6[6]	1100[7]
M110A2	M201A1	M509A1/M762	M1	1	COLD	5	20.0[6]	600
M110A2	M201A1	M106[9]/M762* (INERT)	M1	1	COLD	5	P.D.[2,4]	---
M110A2	M201A1	M106[9]/M762* (INERT)	M188A1	9	HOT	5	P.D.[2,5]	---

TOTAL -	30

Notes: Hot temperature - +110°F
Cold temperature - -25°F
* - Booster assembly installed at test site. M767 booster assembly shall be used.
[1]Fuze/projectile/propellant at same temperature.
[2]See paragraph 4.7.2.
[3]Tubes to have 90% or better remaining life
[4]Target distance to be 500 ft. minimum
[5]Target distance to be 1800 ft. minimum
[6]Setting per paragraph 4.7.3.
[7]Maximum testing Quadrant Elevation
[8]Indicated setting times may vary from those shown depending on conditions at the time of testing.
[9]All spotting charges to be T2 with inert projectiles.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.3.3 Rejection. See MIL-A-48078.

4.3.3.1 Examinations and static tests. If any component, subassembly or assembly fails to comply with any of the applicable requirements, the first article sample shall be rejected.

4.3.3.2 Functioning performance tests. Defects categories and rejection criteria for this tests are as follows:

4.3.3.2.1 Reliability and sequential operational tests.

a. Safe Position - Critical Defect - Any fuze found with the S&A module not in the safe position (see paragraph 6.3.8) prior to gunfire shall be cause for rejection. The S&A module shall be examined using x-ray techniques, shielding the fuze electronics with a .5 inch minimum thick lead shield.

b. Premature Burst - Critical Defect - Any premature burst (see 6.3.1) shall be cause for rejection.

c. Function - Critical Defect - Any function (see 6.3.4) in a nonfunction test shall be cause for rejection.

d. Early Burst - Critical Defect - Any early burst (see 6.3.2) shall be cause for rejection.

e. Point Detonating Dud - Major Defect - More than one point detonating dud (see 6.3.10) in a functioning test shall be cause for rejection.

f. Off Time (see 6.3.5) - Major Defect - More than two early improper off time total, or more than one late improper off time in any one time set group shall be cause for rejection.

g. Fuze unsettable at the Proving Ground - Major Defect - More than two fuzes total, or more than one fuze in any environmentally preconditioned subgroup (see 6.10) which cannot be set to the required setting, shall be cause for rejection (see 6.3.12).

h. Total Duds - More than five fuze duds in the entire Reliability and Sequential Operational Test Matrix.

Source: https://assist.dla.mil-Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.3.3.2.2 Safety sequential tests.

a. Safe Position - Critical Defect - Any fuze found with the S&A module not in the full safe position (see 6.3.8) prior to gunfire shall be cause for rejection. The S&A module shall be examined using x-ray techniques, shielding the fuze electronics with a .5 inch minimum thick lead shield.

b. Premature Burst - Critical Defect - Any premature burst (see 6.3.1) shall be cause for rejection.

c. Function - Critical Defect - Any function (see 6.3.4) in the PD nonfunction test shall be cause for rejection.

d. Early Burst - Critical Defect - Any early burst (see 6.3.2) shall be cause for rejection.

4.3.3.2.3 Accelerated aging tests. A test sample of 20 fuzes shall be subjected to a test temperature of + 160°F and 85% relative humidity. One fuze shall be removed after 54 hours, 135 hours, and 270 hours after starting the conditioning, and be disassembled and tested according to 4.6.1.3. After 540 hours the remaining 17 fuzes shall be removed, disassembled, and tested according to paragraph 4.6.1.3.

4.4 Quality conformance inspections.

4.4.1 Inspection lot formation. Inspection lots shall comply with lot formation provisions of MIL-A-48078. In addition inspection lots shall contain:

a. Batteries from lots with one interfix number manufacturer

b. Crystals oscillators from lots with one interfix number manufacturer

c. Liquid crystal displays from lots with one interfix number manufacturer

d. Linear IC's from lots with one interfix number manufacturer

e. CMOS IC's from lots with one interfix number manufacturer

f. Electric detonators from lots with one interfix number manufacturer

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

g. Piston actuators from lots with one interfix number manufacturer

h. Battery primers from lots with one interfix number manufacturer

i. Lead charges from lots with one interfix number manufacturer

j. Metal parts from lots with the same interfix number from one manufacturer

4.4.2 Sampling for functioning performance tests.

4.4.2.1 Lot sample sizes. The lot sample size shall be according to Table V. Until three consecutive lots are accepted, the sample size shall be one hundred sixteen (116) fuzes, as shown in Note a of Table V. After three consecutive lots are passed, the sample shall be reduced to fifty (50) fuzes as shown in Note b of Table V and tested in accordance with the reject criteria of 4.4.2.3.

4.4.2.2 Lot sample reject criteria. The sample shall be rejected according to the following criteria:

a. Premature Burst - Critical Defect - Any premature burst (see 6.3.1).

b. Early burst - Critical Defect - Any early burst (see 6.3.2).

c. Function - Critical Defect - Any function in a non function test (see 6.3.4) shall be cause for rejection.

d. Point Detonating Dud - Major Defect - More than one point detonating dud (see 6.3.10) in the functioning test.

e. Time Dud - Major Defect - More than one time dud (see 6.3.3) for all configurations and temperature.

f. Off time - Major Defect - More than one early improper off time or late improper off time (see 6.3.5) in the ballistic test.

g. Fuze Unsettable - Major Defect - More than two fuzes which cannot be set to the time required by the ballistic test (see 6.3.12).

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE V Lot operational and safety test matrix

TEST	WEAPON	TUBE f	PROJECTILE	CHARGE	ZONE	TEMP e	SAMPLE SIZE a	SAMPLE SIZE b	SET MODE	FUZE TYPE g
PD-MODE										
NON- m	M109A2	M185	M107[i]	M3A1	1[p]	-25°F	10	5	k	M767
FUNCTIONING	(155mm)		(INERT)	M4A2/A3	7	+70°F	10 c	5 c	k	M767
PD-MODE	M109A2/A3	M185	M107[i]	M3A1	1[p]	-25°F	10	5	k	M767
n	(155mm)		(INERT)	M4A2/A3	7	-25°F	10	5	k	M767
FUNCTIONING						+70°F	10 c	5 c	k	M767
TIME - MODE	M102	M2A2	M1	M67	1	-25°F	10	5	k	M767
105mm l	M119	L20A1	M760	M200	8	+110°F	10	5	k	M767
TIME - MODE										
8-INCH l	M110A2	M201A1	M106	M1	1	-25°F	10	5	k	M767
8-INCH l	M110A2	M201A1	M650A1	M188A1	9	+110°F	10	-	k	M767
TIME - MODE										
155mm d,l	M109A2/A3	M185	M483A1	M3A1	3	-25°F	13	-	k	M762
155mm l	M198	M199	M549A1	M203A1	8	+110°F	13	10	k	M767

NOTES:

a. For three consecutive acceptable lots (See 4.4.2.1).
b. For subsequent lots after "a" above (See 4.4.2.1).
c. Logistic Vibration samples (per Paragraph 4.6.3.1, except at ambient temperature).
d. Eight (8) rounds to be fired with expulsion charge and five (5) rounds with self registration charge.
e. Projectile/Fuze/charge at same temperature.
f. All tubes will have 90% remaining life or better.
g. Fuzes to be set per paragraph 4.7.3.
h. Set times may vary +/- 25% depending on conditions.
i. All spotting charges to be T2 with inert projectiles.
j. All temperature preconditioning per para. 4.6.3.10.
k. 80% of fuzes will be hand-set(do not verify setting with autosetter)/20% of fuzes will be auto-set.
l. The Quadrant Elevation (QE & Settings (seconds) shall be as specified in 6.5.
m. Per paragraph 4.7.1.
n. Per paragraph 4.7.2.
p. Caution, stickers may occur. Follow all safety procedures to clear gun tube.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

h. Total Duds - More than two duds in the entire ballistic test.

4.4.2.3 Subsequent lot sample reject criteria. The subsequent lot sample shall be rejected according to the following criteria:

a. Premature Burst - Critical Defect - Any premature burst (see 6.3.1) shall cause for rejection.

b. Early Burst - Critical Defect - Any early burst (see 6.3.2) shall be cause for rejection.

c. Function - Critical Defect - Any function (see 6.3.4) in a non-functioning test.

d. Point Detonating Dud - Major Defect - More than one point detonating dud (see 6.3.10) in the functoning test.

e. Time Dud - Major Defect - More than one time dud (see 6.3.3) for all configuration and temperature condition.

f. Total Duds - More than two duds in the entire ballistilc test.

4.4 3 Individual unit quality conformance inspections. Fuzes, subassemblies, or parts, as indicatied, are required to pass the inspections of the following paragraphs that form the Classification of Defects Tables. The number of samples shall be as indicated either in the "No. of Samples" column, or as specified in the "AQL or 100%" column for each paragraph. The samples shall be per MIL-STD-105, Level II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF	DRAWING NUMBER
4.4.3.1	Fuze final level II assembly		1 1	12550800
				NEXT HIGHER ASSEMBLY
				12551000
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	Electrical performance		100%	3.9.2	4.6.1.3 *
Major					
101	Electrical performance		100%	3.9.2	4.6.1.3.a
102	Spin test		0.40%	3.9.2	4.6.1.3.b
103	Level advance switch test		0.40%	3.9.2	4.6.1.3.c
104	Count advance switch test		0.40%	3.9.2	4.6.1.3.d
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

*Test parameter No. 21 only.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550804
4.4.3.2	Contact, spin switch				NEXT HIGHER ASSEMBLY 12550800
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Contact width [D]	(a)		3.2	Gage
102	Beam offset dimension [E]	(a)		3.2	Gage
103	Material thickness [F]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET	OF	DRAWING NUMBER
4.4.3.3	Cover, spin switch		1	1	12550805
					NEXT HIGHER ASSEMBLY: 12550800
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Overall length [D]	(a)		3.2	Gage
102	Stepped feature [E]	(a)		3.2	Gage
103	Location of chamfered holes [F]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
(a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550807
4.4.3.4	Contact, battery				NEXT HIGHER ASSEMBLY 12550800
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Contact width [A]	(a)		3.2	Gage
Minor 201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550810
4.4.3.5	Inductive coil assembly				NEXT HIGHER ASSEMBLY 12550800
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Contact, crush switch missing		100%	3.2	Visual/gage
102	Inductance and Q per note 5 [A]		0.40%	3.2	4.6.1.2
Minor					
201	Winding diameter, max. [B]		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.6	Contact, crush switch	1 OF 1	12550811
			NEXT HIGHER ASSEMBLY: 12550810

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Inside diameter [B]	(a)		3.2	Gage
102	Flange outer diameter [C]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.7	Coil form	1	1	12550812
				NEXT HIGHER ASSEMBLY 12550810

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Dimension across ribs [E]	(a)		3.2	Visual/Gage
102	Intermediate internal diameter [B]	(a)		3.2	
103	Largest outside diameter [D]	(a)		3.2	
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY COMFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET	OF	DRAWING NUMBER
4.4.3.8	Shield protective ESD		1	1	12550815
					NEXT HIGHER ASSEMBLY: 12550800
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None				
Minor					
201	Inside diameter [F]	(a)		3.2	Gage
202	Overall Length [C]		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.3	Visual/Gage

NOTES:

(a) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF		DRAWING NUMBER
4.4.3.9	Cup, shield, outer		1 1		12550816
					NEXT HIGHER ASSEMBLY
					12550800
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None				
Minor					
201	Outside diameter [D]	(a)		3.2	Gage
202	Overall length [E]		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.3	Visual/gage

NOTES: See (a) 4.6.5

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY COMFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET	OF	DRAWING NUMBER
4.4.3.10	Cup		1	1	12550816
					NEXT HIGHER ASSEMBLY: 12550800
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None				
Minor					
201	Inside diameter [C]	(a)		3.2	Gage
202	Overall length [D]		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.3	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550820
4.4.3.11	Power supply module assembly				NEXT HIGHER ASSEMBLY 12550820
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Crystal pad missing [A]		0.40%	3.3	Visual
Minor 201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.12	Housing, power supply	1	1	12550821
				NEXT HIGHER ASSEMBLY: 12550820

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Overall part width [B]	(a)		3.2	Gage
102	Length to shoulder [P]	(a)		3.2	Gage
103	Shoulder height [A]	(a)		3.2	Gage
104	Flange hole [R]	(a)		3.2	Gage
105	Slot surface mismatch per note 12 [S]	(a)		3.2	Gage
106	Bottom slot [T]	(a)		3.2	Gage
107	Body flange [D]	(a)		3.2	Gage
108	Location of 5 holes -L- , -M- , and -U-	(a)		3.2	Gage
109	Depth of cavity [V]	(a)		3.2	Gage
110	Length of opening [X]	(a)		3.2	Gage
111	Flash not permitted per note 13 [Y]	(a)		3.2	Visual
112	Small slot diameter [Z]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage
202	Cavity width [W]	(a)		3.2	

NOTES:

(a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.13	PWB Assembly	1	1	12550830
				NEXT HIGHER ASSEMBLY: 12550820

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Electrical performance:				
	Ambient temperatures		100%	3.9.1	4.6.1.1.b
	Hot temperatures		100%	3.9.1	4.6.1.1.c
	Cold temperatures		100%	3.9.1	4.6.1.1.c
102*	Solder workmanship		100%	3.11.2	Visual
103	Crystal mount missing [D]		0.40%	3.2	Visual
Minor					
201	PWB pins height [E]		0.65%	3.2	Gage
202	Adhesive missing under C3 [F]		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES: *See 4.9

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.14	Contact, button	1 OF 1	12550836
			NEXT HIGHER ASSEMBLY: 12550830

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage
202	Tab width C	(a)		3.2	Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550838
4.4.3.15	Pin interface				NEXT HIGHER ASSEMBLY 12550830
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Material thickness [D]	(a)		3.2	Gage
102	Pin widths and locations [C] and [E]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF	DRAWING NUMBER
4.4.3.16	LCD housing assembly		1 1	12550860
				NEXT HIGHER ASSEMBLY
				12550800
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH / PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined			
Major	None defined			
Minor 201	Evidence of poor workmanship		0.65%	3.11 Visual/Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF	DRAWING NUMBER
4.4.3.17	Housing, LCD		1 1	12550861
				NEXT HIGHER ASSEMBLY
				12550860
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH / PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined			
Major				
101	Overall part width [-B-]	(a)		3.2 Gage
102	Length of shoulder [F]	(a)		3.2 Gage
103	Cavity depth [G]	(a)		3.2 Gage
104	Flash not permitted per note 11 [H]	(a)		3.2 Visual
105	Location, width, length, height of Two small slots [J]	(a)		3.2 Gage
106	Body flange [-D-]	(a)		3.2 Gage
Minor				
201	Evidence of poor workmanship		0.65%	3.11 Visual/Gage

NOTES:
(a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550862
4.4.3.18	Bushing, guide				NEXT HIGHER ASSEMBLY 12550860
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	No flash per note 4 [C]	(a)		3.2	Visual
102	Diameter and position of thru hole [C]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550872
4.4.3.19	Bezel, liquid crystal display				NEXT HIGHER ASSEMBLY 12550870
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Length to snap features [D]	(a)		3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET	OF	DRAWING NUMBER
4.4.3.20	Battery pack assembly		1	1	12550880
					NEXT HIGHER ASSEMBLY: 12550800
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Battery assembly compression check [A]		0.65%	3.2	Visual/Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: http://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.21	Housing, battery	1 OF 1	12550881
			NEXT HIGHER ASSEMBLY: 12550880

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Overall length [D]	(a)		3.2	Gage
102	Overall width [E]	(a)		3.2	Gage
103	Depth and width of notch [F]	(a)		3.2	Gage
104	Overall height [G]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550890
4.4.3.22	Battery assembly				NEXT HIGHER ASSEMBLY 12550880
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critica	None defined				
Major					
101	Voltage and resistance test		100%	3.9.3	4.6.1.7
102*	Weld pull test (destructive test)	(a)		3.2	4.6.2.2
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:
(a) Three (3) samples per lot.
* See 4.9

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.23	Insulator, battery	1	1	12550892
				NEXT HIGHER ASSEMBLY: 12550890

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Dimensions across ribs [C]	(a)		3.2	Gage
102	Flange thickness [D]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550893
4.4.3.24	Contact, negative				NEXT HIGHER ASSEMBLY 12550890
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Position and size of spoke center [C]	(a)		3.2	Gage
Minor 201	Evidence of poor workmanship		0.65%	3.11	Gage/Visual

NOTES:

(a) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.25	Support, battery	1	1	12550894
				NEXT HIGHER ASSEMBLY: 12550890

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Thickness of bottom [C]	(a)		3.2	Gage
102	Diameter across ribs [D]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550900
4.4.3.26	Safe and arm assembly				NEXT HIGHER ASSEMBLY 12551000
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
101	Actuator, piston resistance		100%	3.9.4a	4.6.1.4
102	Detonator, electric per note 4G		100%	3.9.4f	4.6.1.5
103	Resistance check across battery primer		100%	3.9.4e	4.6.1.9
104	Resistance check across detonator electric socket and ground		100%	3.9.4d	4.6.1.8
Major					
101	Setback lock missing [A]		100%	3.2	Visual/Gage
102	Spin lock missing [B]		100%	3.2	Visual/Gage
103	Shear pin of slider assembly Missing [C]		100%	3.2	Visual/Gage
104*	Setback lock and spin lock, lock/unlock condition		0.40%	3.3.3	4.6.2.3
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES: *See 4.9

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.27	Housing, safe and arm	1	1	12550901
				NEXT HIGHER ASSEMBLY: 12551000

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Finish of large cavity wall and floors [F]	(a)		3.2	Gage
102	Length of large cavity to centerline [G]	(a)		3.2	Gage
103	Radius of large cavity from centerline [H]	(a)		3.2	Gage
104	Width of large cavity [J]	(a)		3.2	Gage
105	Thru slot width [K]	(a)		3.2	Gage
106	Raised slot width [L]	(a)		3.2	Gage
107	Width of small cavity [M]	(a)		3.2	Gage
108	Height from cavity floor to raised shelf [N]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET	OF	DRAWING NUMBER
4.4.3.28	Lock, spin		1	1	12550902
					NEXT HIGHER ASSEMBLY: 12550900
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	No flash on surface indicated [C]	(a)		3.2	Visual
102	Shear test (destructive) [D]	(b)		3.2	Gage
103	Greatest overall width [E]	(a)		3.2	Gage
104	Greatest overall height [F]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See paragraph 4.6.4

(b) Three (3) samples per lot.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550903
4.4.3.29	Spring, spin lock				NEXT HIGHER ASSEMBLY 12550990
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	confirm spring force per note 6 [C]	(a)		3.2	Gage
Minor 201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF	DRAWING NUMBER
4.4.3.30	Lock, slider		1 1	12550904
				NEXT HIGHER ASSEMBLY
				12550900
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Size and location of hole [D]	(a)		3.2	Gage
Minor 201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage
202	Leg angle [E]	(a)		3.2	Gage

NOTES:

(a) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.31	Cover, safe and arm	1 OF 1	12550908
			NEXT HIGHER ASSEMBLY 12550900

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None				
Minor					
201	Thickness D	(a)		3.2	Gage
202	Greatest diameter -B-	(a)		3.2	Gage
203	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF		DRAWING NUMBER
4.4.3.32	Insulator, piston actuator		1 1		12550909
					NEXT HIGHER ASSEMBLY 12550900
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Hole diameter [D]	(a)		3.2	Gage
Minor 201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.33	Lock, setback	1 OF 1	12550911
			NEXT HIGHER ASSEMBLY: 12550910

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Thru hole diameter [E]	(a)		3.2	Gage
102	Shear test [F]	(b)		3.2	Gage
Minor					
201	No flash where indicated [G]	(a)		3.2	Visual/Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage
203	Protective finish per note 11	(a)		3.2	Gage

NOTES:
(a) See paragraph 4.6.4
(b) Three (3) samples per lot.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550912
4.4.3.34	Spring, setback lock				NEXT HIGHER ASSEMBLY 12550910
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
MAJOR					
101	Diameter of wire [A]		0.40%	3.2	Gage
102	Direction of helix [B]		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550920
4.4.3.35	Slider assembly				NEXT HIGHER ASSEMBLY 12550900
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Detonator resistance after insertion		100%	3.9.4b	Gage
102	Shear pin missing		100%	3.2	Visual/Gage
103	Detonator and sleeve above slider surface		100%	3.2	Visual/Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.36	Slider, S&A	1 OF 1	12550921
			NEXT HIGHER ASSEMBLY: 12550920

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Insufficient shear pin strength [E]	(a)		3.2	Gage
102	Width of part [F]	(b)		3.2	Gage
103	Height of part [G]	(b)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
(a) Three (3) samples per lot

(b) See 4.6.4

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF	DRAWING NUMBER
4.4.3.37	Insulator, slider		1 1	12550922
				NEXT HIGHER ASSEMBLY 12550920
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Height of rails [D]	(a)		3.2.	Gage
Minor					
201	Diameter of short bosses [E]	(a)		3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

Source: https://assist.dla.mil - Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.38	Contact plate, detonator	1	1	12550923
				NEXT HIGHER ASSEMBLY: 12550920

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Contact width [D]	(a)		3.2	Gage
102	Finger width and location [E]	(a)		3.2	Gage
Minor					
201	Through hole diameter and location [-B-]	(a)		3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.39	Contact plate, piston actuator	1	1	12550924
				NEXT HIGHER ASSEMBLY: 12550920

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Finger width and locations [D]	(a)		3.2	Gage
Minor 201	Hole diameter and location [-B-]	(a)		3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF		DRAWING NUMBER
4.4.3.40	Contact, sleeve - detonator		1 1		12550925
					NEXT HIGHER ASSEMBLY
					12550920
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Inside diameter across ribs [C]	(a)		3.2	Gage
102	Length [D]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550940
4.4.3.41	Housing assembly				NEXT HIGHER ASSEMBLY 12551000
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Incorrect lens adhesive application per note 2 and 3 [A]		0.40%	3.2	Visual
102	Button washer missing per note 6 [B]		0.40%	3.2	Visual
Minor 201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF	DRAWING NUMBER
4.4.3.42	Housing fuze		1 1	12550941
				NEXT HIGHER ASSEMBLY
				12550940
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Zone of surface finish [F]	(a)		3.2	Gage
102	Third inside diameter [G]	(a)		3.2	Gage
103	Size and position of smallest diameter along the axis of the housing [H]	(a)		3.2	Gage
104	Distance across wrench flats [J]	(a)		3.2	Gage
105	Protective finish per note 15	(a)		3.2	Gage
106	Pitch and position of threads [K]	(a)		3.2	Gage
107	Largest side hole diameter [L]	(a)		3.2	Gage
108	Radius of ribs Datum [-B-]	(a)		3.2	Gage
Minor					
201	Lens area length and width [M]	(a)		3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.43	Lens, liquid crystal display	1 OF 1	12550942
			NEXT HIGHER ASSEMBLY: 12550940

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Optical quality per note 6 [D]		0.40%	3.2	Visual
Minor					
201	Flange profile [E] and [A]	(a)		3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

Source: http://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER 12550944
4.4.3.44	Washer, button		NEXT HIGHER ASSEMBLY 12550940

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Outer diameter [C]	(a)		3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550945
4.4.3.45	Button, level advance				NEXT HIGHER ASSEMBLY 12550940
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	No flash where indicated [D]	(a)		3.2	Visual
102	Largest diameter [E]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

(a) See 4.6.4

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF	DRAWING NUMBER
4.4.3.46	Retainer, button		1 1	12550946
				NEXT HIGHER ASSEMBLY
				12550940
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH / PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined			
Major				
101	Diameter over serrations [C]	(a)		3.2 Gage
102	Protective finish per note 9	(a)		3.2 Gage
103	Size of smallest diameter [-B-]	(a)		3.2 Gage
104	Flash per note 4	(a)		3.2 Visual
Minor				
201	Evidence of poor workmanship		0.65%	3.11 Visual

NOTES: (a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550960
4.4.3.47	End cap assembly				NEXT HIGHER ASSEMBLY 12551000
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Improper lead orientation per note 2 [A]		0.40%	3.2	Visual
Minor 201	Improper lead push out force (Destructive) per note 3 [B]	(a)		3.2	Gage
202	Foil seal missing per note 4 [C]		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

(a) Three (3) per lot.

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.48	Cap, end	1 OF 1	12550961
			NEXT HIGHER ASSEMBLY: 12550960

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Position and diameter of intermediate cavity [B]		0.40%	3.2	Gage
102	Position and diameter of small cavity [C]		0.40%	3.2	Gage
103	Position and diameter of larger cavity [D]		0.40%	3.2	Gage
104	Pitch diameter [-A-]		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550962
4.4.3.49	Foil seal, end cap				NEXT HIGHER ASSEMBLY 12550960
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Holes in material [A]		0.40%	3.2	Visual
Minor	None defined				

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.50	Stab assembly	1	1	12550970
				NEXT HIGHER ASSEMBLY
				12551000

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Total length, max. [A]		0.40%	3.2	Gage
102	Compression spring missing [B]		0.40%	3.2	Gage
Minor					
201	Depth of block pin, min. [C]		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550971
4.4.3.51	Rod actuating				NEXT HIGHER ASSEMBLY 12551000
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Thickness and flatness [A]	(a)		3.2	Gage
102	Overall length [B]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET	OF	DRAWING NUMBER
4.4.3.52	Block, stab		1	1	12550972
					NEXT HIGHER ASSEMBLY: 12550970
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Large inside diameter [D]	(a)		3.2	Gage
102	Small inside diameter [E]	(a)		3.2	Gage
103	Overall depth of small diameter [F]	(a)		3.2	Gage
104	No flash where indicated per note 12	(a)		3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550977
4.4.3.53	Pin, stab				NEXT HIGHER ASSEMBLY 12550970
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Shoulder to point [C]		0.40%	3.2	Gage
102	Point [D]		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550981
4.4.3.54	Ogive				NEXT HIGHER ASSEMBLY 12550980
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Large diameter [C]	(b)		3.2	Gage
102	Intermediate diameter [D]	(b)		3.2	Gage
103	Intermediate diameter [B]	(b)		3.2	Gage
104	Shoulder length [E]	(b)		3.3	Gage
105	Compression test to failure per note 12 [F]	(a)		3.2	4.6.2.1
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:
(a) Three (3) samples per lot
(b) See 4.6.4

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12550990
4.4.3.55	Battery primer assembly				NEXT HIGHER ASSEMBLY 12551000
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Resistance of battery primer assembly		100%	3.9.4c	4.6.1.6
Minor 201	Incorrect seating of battery primer and contact per note 2 and 3 [A]		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65	3.11	Visual

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET OF		DRAWING NUMBER
4.4.3.56	Block, battery primer		1 1		12550992
					NEXT HIGHER ASSEMBLY: 12550990
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Dimension of larger inner radius [D]	(a)		3.2	Gage
102	Dimension of smallest radius [E]	(a)		3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:

(a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.3.57	Contact, battery primer	1	1	12550993
				NEXT HIGHER ASSEMBLY: 12550990

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Leg width [A]	(a)		3.2	Gage
Minor					
201	Small radius [B]	(a)		3.2	Gage
202	Evidence of poor workmanship		0.65%	3.11	Visual

NOTES:
(a) See 4.6.5

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12551000
4.4.3.58	Fuze assembly M762				NEXT HIGHER ASSEMBLY FINAL
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Liquid crystal display not blank		100%	3.2	Visual/Gage
102	End cap assembly depth		100%	3.2	Gage
103	Major diameter of large outside thread		100%	3.2	Gage
104	Pitch diameter of large outside thread		100%	3.2	Visual
105	Hatch mark of housing not aligned within a rib of ogive		100%	3.2	Visual/Gage
106	Incorrect installation of S&A and cushion		100%	3.2	Visual/Gage
107	Incorrect torque on end cap		100%	3.2	Gage
108	O-Ring missing		0.40%	3.2	Visual/Gage
Minor					
201	Foil seal damaged		0.65%	3.2	Visual/Gage
202	Marking incorrect or illegible		0.65%	3.2	Visual/Gage
203	Total fuze length		0.65%	3.2	Gage
204	Improper application of adhesive on end cap per note 3		0.65%	3.2	Visual/Gage
205	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE	SHEET OF	DRAWING NUMBER
4.4.3.59	Fuze assembly M767 less booster	1 2	12551001
			NEXT HIGHER ASSEMBLY 12550850

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	End cap assembly depth		100%	3.2	Gage
102	Liquid crystal display not blank		100%	3.2	Visual/Gage
103	Major diameter of large outside thread		100%	3.2	Gage
104	Pitch diameter of large outside thread		100%	3.2	Gage
105	Major diameter of small outside thread		100%	3.2	Gage
106	Pitch diameter of small outside thread		100%	3.2	Gage
107	Hatch mark of housing not aligned within a rib of ogive		100%	3.2	Visual/Gage
108	Incorrect torque on end cap		100%	3.2	Gage
109	Incorrect installation of S&A and cushion		100%	3.2	Visual/Gage
110	O-ring missing		.40%	3.2	Visual/Gage

NOTES:

AMSMC Form 1570, 1 Feb 85 Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER 12551001
4.4.3.59	Fuze assembly M767 less booster				NEXT HIGHER ASSEMBLY 12550850
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Minor					
201	Marking incorrect or illegible		0.65%	3.2	Visual/Gage
202	Total fuze length		0.65%	3.2	Gage
203	Improper application of adhesive on end cap		0.65%	3.2	Visual/Gage
204	Foil seal damaged		0.65%	3.2	Visual/Gage
205	Evidence of poor workmanship		0.65%	3.11	Visual/Gage

NOTES:

AMSMC Form 1570, 1 Feb 85

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-F-70823 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 12551008
4.4.3.60	Gear, stab actuator				NEXT HIGHER ASSEMBLY 12551000/1001
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major 101	Shaft diameters -C- and -B-	(a)		3.2	Gage
Minor 201	Evidence of poor workmanship		0.65%	3.11	Visual/Gage
202	Overall height of body D	(a)		3.2	Gage

NOTES:

(a) See 4.6.4

Replaces DRSMC-QA (D) Form 160, 1 Aug 83, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.4.4 Inspection equipment. The inspection equipment required to perform the examinations and tests prescribed herein is described in the "Paragraph Reference/Inspection Method" column in the tables starting with 4.4.3.1 The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078 and 6.7 herein.

4.5 Calibration and maintenance. All measuring and test equipment used by the contractor to perform the inspections herein shall be calibrated and maintained in accordance with MIL-STD-45662.

4.6 Methods of inspection

4.6.1 Electrical tests.

4.6.1.1 PWB assembly tests (12550830).

a. Attach the following load simulations and switches to the assembly:

1) EED simulators
3.9 ohm ,1%, 1/4 watt resistors from U2-1,4,5 to ground.

2) Spin switch simulator
Single pole double throw switch with common to U1-14 normally closed contact to ground, and normally open contact to U2-16 (battery positive).

3) Impact switch simulator
Connect a single pole single throw normally open switch form ground to U1-44.

4) Level advance/count advance simulators
Connect single pole single throw normally open switches from ground to U2-3 and U2-4.

5) VBAT simulator
Connect a power supply positive lead to U2-16 and negative lead U2-2. The power supply shall be capable of supplying 0.0 volt to 3.0 volts $\pm$ 1% with resolution of 0.01 volt. The VBAT is normally at 0.0 volts unless indicated in Table VI.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VI Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient LL	Ambient HL	-60°F LL	-60°F HL	+160°F LL	+160°F HL
1.0 C1 Peak Voltage	a. VBAT off (U2-160=0.0V) b. Autoset per 10.0 c. Measure Peak Voltage at U2-20	10.7V	11.5V	11.6V	12.3V	10.2V	10.8V
2.0 C1 Risetime	a. VBAT off (U2-16=0.0V) b. Autoset per 10.0 c. 10% min. to 90% max time at U2-20	4.0ms	16.0ms	12.0ms	22.0ms	3.0ms	15.0ms
3.0 BP Peak Voltage	a. Autoset per 10.0 b. Measure Peak Voltage at U2-1 when BP fire pulse occurs	4.5V	9.7V	4.38	10.6V	4.5V	9.0V
4.0 BP Energy	a. Autoset per 10.0 b. Integrate voltage pulse at U2-1 when BS fire pulse occurs, calculate pulse energy to 0.20V	946ergs	2000ergs	1016ergs	2252ergs	942ergs	1734ergs
5.0 Battery Current, Spin Open	a. VBAT = 3.0V (U2-16) b. Spin Switch set to unactivated position c. Measure average Battery Current	98ua	143ua	109ua	159ua	97ua	133ua
6.0 Battery Current, Spin Closed	a. VBAT = 3.0V (U2-16) b. Activate Spin Switch (U2-19 connected to U2-16) c. Measure average Battery Current	62ua	108ua	82ua	137ua	54ua	100ua

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VI Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient		-60°F		+160°F	
		LL	HL	LL	HL	LL	HL
7.0 Oscillator Frequencies	a. VBAT = 3.0V (U2-16) b. Tset = 000.5 sec according to 9.0 or 10.0 c. Activate Spin Switch (U2-19 connected to U2-16) d. Wait 0.20 seconds. e. Pull Remote Data Line (U1-18) to ground f. Pull level advance (U1-3) and count advance (U1-4) to ground g. Measure oscillator 1 frequency at U1-9 h. Open level advance (U1-3) i. Measure oscillator 2 frequency at U1-19	163.800KHz	163.870KHz	163.800KHz	163.905KHz	163.700KHz	163.850KHz
8.0 Initialize for Setting	a. VBAT = 3.0V (U2-16) b. Check for all LCD segments on c. Toggle level advance (U1-3) to ground for 125ms±10ms d. Check LCD for only Lx, Ly (Underlines) on e. Toggle level advance (U1-3) to ground for 125ms±10ms f. Check LCD displays 000.0 g. Toggle level advance (U1-3) to ground once. Toggle level advance to ground again and hold level advance at ground h. Toggle count advance (U1-4) to ground for 125ms±10ms i. Release level advance j. Check LCD displays 001.0	N/A		N/A		N/A	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VI Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient		-60°F		+160°F	
		LL	HL	LL	HL	LL	HL
9.0 Set - Manual	a. VBAT = 3.0V b. Toggle level advance (U1-3) to ground for 125ms±10ms twice to initialize for setting c. Toggle count advance (U1-4) to ground for 125ms±10ms to advance digit count while holding level advance (U1-3) down	N/A		N/A		N/A	
10.0 Set - Inductive	a. See 12550753 "Inductive Set Requirements for M762 Fuze"						
11.0 PA and Det Times, Peak Voltages, & Energies - Time Set	a. VBAT = 3.0V (U2-16) b. Tset to a valid time setting according to 9.0 or 10.0 c. Activate Spin Switch (U2-19 connected to U2-19)						
	d. Measure time from spin switch activation to PA pulse rising edge (Tpa)	Tset-50ms±0.4% at all temps					
	e. Measure peak voltage at Tpa at pin U2-4	1.20V	2.5V	1.10V	2.5V	1.20V	2.5V
	f. Integrate PA voltage waveform at U2-4 and calculate PA energy to 0.2V	815ergs	1500ergs	700ergs	1200ergs	1000ergs	1570ergs
	g. Measure time from spin switch activation to Det pulse rising edge (Tdet) at U2-5	Tset±0.4% at all temps					
	h. Measure Peak Voltage at Tdet at pin U2-5	1.2V	2.5V	1.10V	2.5V	1.2V	2.5V

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VI Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient LL	Ambient HL	-60°F LL	-60°F HL	+160°F LL	+160°F HL
11.0 PA and Det Times, Peak Voltages, & Energies - Time Set (Cont'd)	i. Integrate Det voltage waveform at U2-4 and calculate detonator energy to 0.2V	850ergs	1500ergs	700ergs	1200ergs	960ergs	1500ergs
	j. Measure U2-5 Voltage at Tdet+300µs	.5V	1.0V	.4V	.9V	.5V	1.0V
12.0 PA and Det Times - Impact Set	a. VBAT = 3.0V (U2-16)						
	b. Tset to a PD (Delta 98.0) per 9.0 or 10.0						
	c. Close spin switch (U2-16 shorted to U2-19)						
	d. At Tspin+1.05 sec., -0, +10ms, close impact switch (U2-44 to ground)						
	e. Measure time from spin closure to PA pulse occurrence (U2-4)	.450 sec. ± .06% at all temp					
	f. Measure time from spin closure to det pulse occurrence (U2-5)	1.0 sec.	2.2 sec.	1.0 sec.	1.1 sec.	1.0 sec.	1.0 sec
13.0 Invalid Time Test Set	a. VBAT = 3.0V (U2-16)						
	b. Tset per 9.0 or 10.0 to 000.4						
	c. Close spin switch						
	d. Monitor PA (U2-4) and Det (U2-5) for 500ms. No pulses should occur.						
	e. Check Dud Latch Per 18.0.						
14.0 Shorted Spin Switch	a. Close Spin Switch						
	b. VBAT = 3.0V						
	c. Set to 0.5 per 9.0 or 10.0						
	d. Monitor PA and Det for 500ms for pulse occurrence. No pulses should occur.						
	e. Check Dud Latch per 18.0.						

Source: https://assist.dla.mil - Downloaded: 2026-1[illegible]26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VI Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient LL	Ambient HL	-60°F LL	-60°F HL	+160°F LL	+160°F HL
15.0 Early Impact Closure	a. VBAT = 3.0V b. Set to Delta 98.0 per 9.0 or 10.0 c. Close Spin Switch d. Wait 0.2 second e. Close the impact switch f. Monitor PA and Det for 500ms for pulse occurrence. No pulses should occur.						
16.0 POR Voltage	a. Increase VBAT in 0.1V steps while monitoring BP1 (U1-28) and BP2 (U2-26) b. Record VBAT when BP1 or BP2 crosses 2.0V.	1.2V	2.0V	1.4V	2.3V	1.1V	1.8V
17.0 Fast Clock	a. VBAT = 3.0V b. Test to 199.9 sec. using 9.0 or 10.0 c. Close Spin Switch d. Wait .55 second e. Open Spin Switch f. Switch Remote Data (U1-18) to ground g. Apply to 1994 square wave pulses to the Impact Input (U1-U4) at a 150KHz maximum frequency h. Test that the Fire Line (U1-23) is low. i. Apply one square wave pulse, 10µs minimum duration, to the Impact Input (U1-U4) j. Test that the fire line (U1-23) is high.						

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VI Electrical test parameter definitions

Parameter		Measurement Conditions		Ambient LL	Ambient HL	-60°F LL	-60°F HL	+160°F LL	+160°F HL
18.0	Dud Latch Clock	a. .200 second after spin switch closure pull remote data (U1-18) to ground b. Pull level advance (U1-3) and count advance (U1-4) to ground c. Monitor Talkback line (U1-9) for presence of crystal frequency; if none, latch is set.							
19.0	Backplane Voltage Check	a. VBAT = 3.0V	MAX	3.0V	5.0V	3.0V	5.0V	3.0V	5.0V
		b. Check voltage levels of BP1 & PB2 at Max, Mid, and Min levels.	MID	1.5V	2.5V	1.5V	2.5V	1.5V	2.5V
			MIN	-0.4V	0.0V	-0.4V	0.0V	-0.4V	0.0V
20.0	Startup Time	a. VBAT = 3.0V (U2-16) b. Delay a time depending on the test temperature: 1. Ambient - 410ms 2. -60°F = 1.13 sec. 3. +160°F = 260ms							
		c. Measure frequency of BP-1 (U1-28)		39Hz	41Hz	39Hz	41Hz	39Hz	41Hz
		d. Measure frequency of BP-2 (U1-26)							
21.0	EA/Fuze Housing	a. Check resistance between ground (U2-2) and the Housing Assembly		0	0.15Ω	N/A	N/A	N/A	N/A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

b. Ambient Tests

Perform the following tests from Table VI:

Parameter No.	Title
1	C1 Peak Voltage
2	C1 Risetime
3	BP Peak Voltage
4	BP Energy
5	Battey Current, Spin Open
6	Battery Current, Spin Closed
7	Oscillator Frequencies
8	Initialize for Setting
9	Set-Manual
10	Set-Inductive
11	PA/Det Times, Energies
12	PA/Det Times-Impact Set
13	Invalid Time Set
14	Shorted Spin Switch
15	Early Impact Closure
16	POR Voltage
18	Dud Latch Clock
19	Backplane Voltage Check.

NOTE: Fast clock per parameter 17 of Table VI may be used for the above testing.

c. Temperature Tests

The following tests are to be performed with the fuze assembly conditioned to -60°F and +155°F (both ± 10°F) for a time sufficient to allow CMOS IC, PN 12550834 in the assembly to reach the conditioning temperature.

Parameter No.	Title
5	Battey Current, Spin Open
6	Battery Current, Spin Closed
7	Oscillator Frequencies
8	Initialize for Setting
10	Set Inductive
13	Invalid Time Set
14	Shorted Spin Switch
15	Early Impact Closure
20	Startup Time (cold temperature only)

Note: Fast clock per parameter 17 of Table VI may be used for the above testing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

d. The tests from Table VI may be combined within b and c and measured within a simulated fuze mission or portions of a mission, as long as the specified parameters for each individual test are measured.

4.6.1.2 Inductive coil assembly tests.

a. Measure the coil inductance in accordance with drawing 12550810.

b. Measure the coil Q in accordance with drawing 12550810.

4.6.1.3 Level II assembly tests.

a. Attach the following load simulations and switches to the assembly prior to installation of the spin switch.

1) EED simulators
Three 3.9 ohm 1%, 1/4 resistors form TP3, 16, and 17 to TP14A (ground).

2) Spin switch simulator
Connect a single pole double throw switch with common to TP13 normally closed contact to TP14A, and normally open contact to TP4 (Battery positive).

3) Impact switch simulator
Connect a single pole single throw normally open switch from TP18 to TP14A.

4) Level advance/count advance simulators
Connect single pole single throw normally open switches form TP14A to TP19 and TP20.

5) VBAT simulator
Connect a power supply positive lead to TP4 and negative lead to TP4A. The power supply shall be capable of supplying 0.0 volts to 3.0 volts $\pm$ 1% in 0.01 volt increments. VBAT is normally at 0.0 volts unless indicated in Table VI. After each test is completed, VBAT shall be returned to 0.0 volts.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

6) Perform the folowing tests at ambient from Table VI:

Parameter No.	Title
1	C1 Peak Voltage
3	BP Peak Voltage
5	Battey Current, Spin Open
6	Battery Current, Spin Closed
7	Oscillator Frequencies
8	Initialize for Setting
11	PA/Det Times, Energies Impact Set
12	PA/Det Times-Impact Set
13	Invalid Time Set
14	Shorted Spin Switch
15	Early Impact Closure
21	EA/Fuze Housing

The Table VI tests may be combined and measured within a simulated fuze mission or portions of a mission as long as the specified parameters for each set are measured.

b. Spin Switch Closure/Nonclosure
The spin switch shall meet the closure requirements of drawing 12550800 when monitoring Test Point 13. The test method may use techniques to simulate rotational forces.

c. Level Advance Switch Closure
After Level II Assembly (12550800) has been assembled into fuze housing assembly (12550940), with 3.0 volts applied between Test Point 4 and Test Point 14, and with the level advance switch not depressed, the voltage measured at Test Point 0 shall be a minimum of 2.90 volts. With the switch closed, the Test Point 20 voltage shall be .05 volts maximum.

d. Count Advance Switch Closure
After Level II Assembly (12550800) has been assembled into fuze housing assembly (12550940), with 3.0 volts applied between Test Point 4 and Test Point 14, and with the digit advance switch not depressed, the voltage measured at Test Point 19 shall be a minimum of 2.90 volts. With the switch closed, the Test Point 20 voltage shall be .05 volts maximum.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.6.1.4 Actuator, piston resistance. The resistance of the PA shall be in accordance with drawing 12550900 when using a meter supplying no more than 1.0 ma through the PA bridgewire.

4.6.1.5 Detonator, electric resistance. The resistance between the detonator electrode and the ground socket must be in accordance with drawing 12550900 when using a meter supplying no more than 1.0 ma.

4.6.1.6 Battery primer resistance. The resistance between the pin and the contact shall be in accordance with drawing 12550990 when using a meter supplying no more than 1.0 ma through the primer bridgewire.

4.6.1.7 Battery Assembly (12550890) Voltage and Resistance.

a. Voltage: With a 500K ohm resistance across the cell, no more than .005 volts shall be measured at the cell terminals with a meter having a minimum one megohm input impedance.

b. Resistance: The batteries shall not measure less than one megohm resistance at the terminals.

4.6.1.8 Detonator electric socket contact to ground socket resistance. Measure the resistance between the detonator socket of the S&A assembly (12550900, note 4H) and the ground socket using a meter supplying less than 1 ma. The resistance shall measure greater than 10 megaohms.

4.6.1.9 Battery primer socket to ground resistance. Measure the resistance between the S&A assembly battey primer socket (12550900, note 4H) and the ground socket using a meter supplying less than 1 ma. The resistance shall measure greater than 10 megaohms.

4.6.2 Mechanical tests.

4.6.2.1 Ogive compression test. The ogive shall be tested by applying a compressive force as indicated on drawing (12550981). The cross head speed shall be 0.05 inch/minute. The measurement instrument must have an accuracy of at least $\pm$ 0.2% of full scale for force and speed of travel. The ogive must fail in compression as specified in 12550981.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.6.2.2 Battery weld pull test. The weld strength of the battery assembly (12550890), shall be tested to ensure weld bond integrity during gunfire. This directly relates to the weld strength of the terminal plate assembly (12550995) and the negative contact (12550893). These representative parts can be pull tested in place of a battery assembly for safety reasons.

The welded assembly shall be placed in a fixture which supports the negative contact, (12550893). Force is then applied to the battery (12550891), or the representative terminal plate assembly (12550995). Care must be taken to apply force only to the battery or terminal plate and not to the negative contact (12550891). Force shall be applied by a system capable of measuring force up to 100 lb, in increments of 0.1 lb with an accuracy of 0.25% of full scale (each range), with the ability to maintain the maximum force applied. The weld must not separate completely at any force less than that shown on 12550890.

4.6.2.3 S&A lock/unlock Test.

a. The spin lock shall not unlock from the slider assembly in accordance with drawing 123550900. The test method may utilize Government approved techniques to simulate the spin forces.

b. With the setback lock initially depressed, the lock shall be tested in accordance with the requirements of drawing 12550900. The test method may utilize Government approved techniques to simulate the setback forces.

4.6.3 Environmental. The following environmental tests shall apply to the applicable portion of Tables I, II, III and IV (FAAS sequence), or Table V (Lot Acceptance Test Sequence).

4.6.3.1 Logistic vibration (safety and operational). The fuze shall be tested in accordance with ITOP-1-2-601, paragraph 4.1.1, Appendix B, table B-1, Figures B1 through B21, with the exception that the power spectral density (PSD) values for lower frequency ranges in Figures B-1 through B-6 are clipped. The modified PSD values for the corresponding breakpoint frequencies in the figures shall be as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

ITOP 1-2-601 FIGURE	BREAKPOINT FREQ (Hz)	MODIFIED PSD VALVE
B1	5	0.001
B2	5	0.001
B2	9	0.001
B3	5	0.001
B4	5	0.001
B4	8	0.001
B5	5	0.001
B5	6	0.001
B5	7	0.001
B6	5	0.001
B6	6	0.001
B6	8	0.001

a. Hot Operational Tests: 145°F.

b. Hot Safety Tests: +145°F.

c. Cold Operational Tests: -28°F.

d. Cold Safety Tests: -60°F.

The M762/M767 (less booster) E.T. Fuze must be safe to handle, store, transport and be launch and flight safe.

4.6.3.2 Twenty-eight day hot (hot safety and operational). The fuze shall be packaged 8 fuzes to an M2A1 ammunition can, two cans per box as described in drawing 8861213, Revision AK. The fuzes shall be subjected to 28 consecutive daily cycles of the temperature/relative humidity conditions specified in AR70-38, table 2-3 for the hot safety test and Table 2-5 for the hot operational test:

a. Hot Operational Tests: Table 2-5 (Category B2), Storage and Transit Conditions, except if the test chamber temperature controller cannot be programmed to produce the required relative humidities at each given temperature. Then it is acceptable if the relative humidity at each temperature in the cycle equals or exceeds the posted value, but does not exceed 80%.

b. Hot Safety Tests: Table 2-3, Storage and Transit Conditions (Category B3), except if the temperature chamber's controls cannot be programmed to produce the required relative humidities at each given temperature. Then it is acceptable if the relative humidity at each temperature in the cycle equals or exceeds the posted value but does not exceed 95% relative humidity.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.6.3.3 Fourteen day humidity (cold safety and operational). The fuze shall be packaged 8 fuzes to an M2A1 ammunition can, two cans per box as described in drawing 8861213, Revision AK. The fuzes shall be subjected to 14 consecutive daily cycles of the temperature/relative humidity conditions specified in AR70-38, Table 2-8 for the cold safety test and Table 2-7 for the cold operational test:

a. Cold Operational Tests: Table 2-7

b. Cold Safety Tests: Table 2-8

4.6.3.4 Tactical vibration (safety and operational). The fuze shall be tested in accordance with ITOP 1-2-601:

a. Hot Operational Tests: Table C-4, +110°F.

b. Hot Safety Tests: Table C-5, +145°F.

c. Cold Operational Tests: Table C-4, -25°F.

d. Cold Safety Tests: Table C-5, -60°F.

The fuze may be held in the threaded socket of a rigid vibration test fixture. Vibration exposure per fuze axis is intended to correspond to a transportation distance of 550 km, so that the total test time per axis shall be 20 to 25 minutes. Therefore, for any test phase, 4 to 5 minutes of testing are required, but not less than the time required to perform one ascending frequency sweep.

4.6.3.5 Salt fog (safety and operational). The fuze shall be tested in accordance with MIL-STD-331, Test 107.1, paragraph 5.0, except fuze orientation to be 45° (nose up) and 45° (nose down). The following exposure times shall be used:

a. Hot/Cold Safety Tests: 96 hours

b. Hot/Cold Operational Tests: 48 hours

4.6.3.6 Seven foot drop - boxes (safety). The fuze shall be tested in accordance with MIL-STD-331, Test T121, Figure 6, Notes 2 and 3, at the following test temperatures:

a. Hot Safety Tests: +145°F.

b. Cold Safety Tests: -60°F.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.6.3.7 Bounce (loose cargo) (safety). The fuze shall be tested in accordance with ITOP 4-2-602, for Rough Handling Tests, per the first three paragraphs of paragraph 3.0, Appendix B of the ITOP, at the following temperatures:

a. Hot Safety Tests: +145°F.

b. Cold Safety Tests: -60°F.

4.6.3.8 Seven foot drop - cans (safety). The fuze shall be tested in accordance with MIL-STD-331, test T121, Figure 6, notes 2 and 3, one drop per can, with test temperatures as follows:

a. Hot safety tests: +145°F.

b. Cold Safety Tests: -60°F.

4.6.3.9 Five foot drop - bare (safety). The fuze shall be tested in accordance with MIL-STD-331, Test T121, Figure 6, first requirement, two drops per fuze, with test temperatures as follows:

a. Hot Safety Tests: +145°F.

b. Cold Safety Tests: -60°F.

4.6.3.10 Pre-ballistic temperature conditioning. Fuzes shall be conditioned for a minimum of 18 hours prior to removal from the temperature chamber for firing according to the requirements of Tables I, II, III, IV and V. The test temperature shall be maintained at ± 5°F. Time from removal to firing shall be less than 15 minutes.

4.6.4 Die check for cast and molded parts. A sample of at least three parts from each cavity shall be inspected in accordance with the applicable Classification of Defects and Tests paragraph to qualify a new or reworked cavity for use in production. Individual cavity identification must be provided.

If any defective parts are found during qualification of the cavity due to a defective cavity, the cavity producing the defective part shall not be used in production. All cavities formerly removed form production because of a fault may, after reworking, be returned to production, providing they pass the qualification test. In addition, a minimum sample of one part from each cavity shall be inspected for each lot acceptance in accordance with the applicable Classifications of Defects Table. If the one piece sample passes the inspection, the contractor may

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

proceed with the lot. This, however, does not relieve the contractor from ensuring that the entire lot is acceptable. If the one piece inspection fails the inspection of the Classification of Defects specified, the contractor shall pull a lot sample in accordance with MIL-STD-105 and inspect to those criteria listed in the Classification of Defects Table that failed the initial one piece inspection. The sample shall be pulled utilizing general Level II, 0.4% AQL for major characteristics and 0.65% AQL for minor characteristics. If the lot passes the inspection, the contractor may proceed with the lot. If the lot fails the inspection, the lot shall be rejected.

4.6.5 Die check for stamped parts. A sample of at least three parts from each die shall be inspected in accordance with the applicable Classification of Defects (see section 4.4). If any defective parts are found during qualification of the tool due to a defective tool, the tool producing the defective part shall not be used in production. All tools removed from production because of some fault may, after reworking, be returned to production providing they pass the qualification test above. In addition, a minimum sample of one part from each cavity shall be inspected for each lot acceptance in accordance with the applicable Classifications of Defects Table. If the one piece sample passes the inspection, the contractor may proceed with the lot. This, however, does not relieve the contractor from ensuring that the entire lot is acceptable. If the one piece inspection fails the inspection of the Classification of Defects specified, the contractor shall pull a lot sample in accordance with MIL-STD-105 and inspect to those criteria listed in the Classification of Defects Table that failed the initial one piece inspection. The sample shall be pulled utilizing general Level II, 0.4% AQL for major characteristics and 0.65% AQL for minor characteristics. If the lot passes the inspection, the contractor may proceed with the lot. If the lot fails the inspection, the lot shall be rejected.

4.7 Ballistic testing.

4.7.1 PD non-functioning. The fuze shall not function when impacting a six inch thick minimum marine grade plywood target set at a distance corresponding to the gun/tube/propellant/zone designations for non-functioning testing as indicatied in Table V requirements.

4.7.2 PD functioning. The fuze shall function when fired into six inch minimum marine grade plywood set at a distance corresponding to the gun/tube/propellant/zone designations for

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

functioning testing as indicated in the Table II, III, IV or V requirements. Camera coverage shall be employed to observe fuze functioning.

4.7.3 Setting. Time or PD setting shall be performed manually or inductively so that 80% of the fuzes are set manually, and 20% are set inductively (round up test sample for manual set).

4.7.4 Time set function. Fuze settings shall be photographed using an instant, self-processing camera. Three independent infrared sensing chronograph systems shall be used to measure time to burst. The timer shall be recorded from the chronograph counters to four decimal places. The three recorded time values for each round shall be averaged and rounded to the nearest 0.001 second according to the procedure in ASTM E29,paragraph 3.4, and recorded. If one time value is lost or considered invalid (see 4.7.5), the remaining two values shall be used. If a round fails to function in flight, observations shall be made to determine if the round functions on impact. A back up system of electronic clocks or stop watches shall also be employed and their measurements recorded to the nearest 0.01 second. These times shall not be used in computations. To be counted as a pass, the averaged, rounded readings must be within the set time $\pm$ 0.3 second.

4.7.5 Lost time. When a fuze is fired for an airburst function and is observed to have functioned, but a chronograph system used to determine the elapsed time to function fails for any reason to record the appropriate value, then an entry of lost time shall be used instead of any recorded value. The round shall be considered lost when the above occurs for 2 or more chronograph systems. (See 6.2.7)

4.8 Logistic vibration. A sample of thirty (30) M762/M767 (less booster) fuze assemblies with lead charge set in the shipping position shall be randomly selected from each lot and subjected to the Logistic Vibration test specified in 4.6.3.1. If any fuze fails to meet the criteria of 4.6.3.1, the lot shall be rejected. If the fuzes are not found to be defective, then ten (10) fuzes shall be disassembled for examination and twenty (20) fuzes shall be forwarded to the proving grounds for ballistic testing in accordance with 4.7. After the third consecutive lot, twenty (20) M767 fuze assemblies with lead charge shall be used in lieu of thirty (30) fuzes with ten (10) fuzes going to the proving grounds in lieu twenty (20) fuzes.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.8.1 Logistic vibration test criteria. The M762/M767 less booster fuze assemblies with lead charge shall be subjected to the Logistic Vibration test in accordance with 4.6.3.1. After this test, ten (10) fuzes from the sample shall be randomly selected and disassembled to determine that the fuzes are safe. After disassembling the End cap assembly (12550960) and the Safe and arm assembly (12550900), the following criteria must be met as a minimum inspection requirements:

a. The resistance outlined in the test parameter 21 of Table VI shall be acceptable.

b. No part of the explosive train shall have functioned.

c. The slider in the S&A shall be located and locked in the safe position by both safety features.

d. The setback lock and spin lock shall be secure and in the safe position.

e. The setback lock shall not be broken and the spin lock shall be secure and restrained by the spring lock.

4.9 Statistical process control plan. The SPC shall be used in parallel with MIL-STD-105 and applied to the appropriate important characteristics (process or product) of the fuze assemblies and parts. As a minimum, SPC shall be applied to those processes which produce the characteristics identified in the Classification Of Defects Table by the "*" symbol. In addition, the contractor is advised to use SPC in order to reduce rework and scrap. The SPC plan shall include: a time-phased schedule for implementation of SPC; as a minimum, SPC techniques specified in ANSI Z1.1, Z1.2, and Z1.3; control audit procedures for validating the accuracy, adequacy and interpretation of control charts; the training program and qualification of personnel on SPC techniques; identification of responsibility for performing measurements and corrective actions; contractor's general policy for applying SPC along with goals and commitments regarding SPC; documents that are basis for contractors SPC program; applicable records pertaining to SPC; test/measurements equipment calibration and control; and the corrective action procedures to be used and actions to be taken upon statistical signal or an out of tolerance part. When SPC has been fully implemented, the process has been demonstrated to be in a state of statistical control and the fuze conforms to final acceptance specification, the contractor may request for Government approval that sampling (MIL-STD-105), except 100% electrical tests, be reduced or eliminated for acceptance purposes. (See 6.8)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

5. PACKAGING

5.1 Packaging

5.1.1 Level A, B and C. Packaging shall be in accordance with drawing 8864492 and MIL-P-60412.

5.2 Packaging.

5.2.1 Level A. Packaging shall be in accordance with drawing 8861213.

5.2.2 Level B and C. Packaging shall be in accordance with drawing 8886458.

5.3 Marking.

5.3.1 Packaging, marking level, A, B and C. Packaging, Marking, Level A, B and C shall be in accordance with drawing 8864492.

5.3.2 Packing, marking.

5.3.2.1 Level A. Packing, marking shall be in accordance with drawing 8861213.

5.3.2.2 Level A and C. Packing, marking shall be in accordance with drawing 8886458.

6. NOTES

6.1 Intended use. The components covered by this specification are intended for use in Artillery Systems.

6.2 Ordering Data. See MIL-A-48078.

6.2.1 Submission of acceptance inspection equipment design. See MIL-A-48078 (AR). Required equipment designs shall be submitted for approval to Commander, US Army Armament, Munitions and Chemical Command; ATTN: AMSMC-QAR-R (D), Picatinny Arsenal, New Jersey 07806-5000.

6.3 Definitions.

6.3.1 Premature burst. A malfunction in which a fuze functions before the required safe separation distance (see 6.3.10) from the weapon. This includes functions in handling, loading and inside the barrel.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

6.3.2 Early burst. A malfunction in which a fuze functions prior to set time minus four seconds but later than safe separation (see 6.3.10). For a PD-set fuze, a function prior to impact but later than safe separation.

6.3.3 Dud. A malfunction in which a ballistically fired fuze does not function at all, except where impact occurs prior to 500 ms after muzzle exit in the PD mode or prior to set time plus 0.3 second.

6.3.4 Ballistic function. A function is defined as initiation of the output lead charge, normally resulting in initiation of the projectile. For determining reliability, a function is proper only if the proper response (detonation or expulsion) of the projectile results. For determining safety, any function of the output lead charge prior to T-4 in the time mode or prior to 400ms in he PD mode shall be considered a safety failure, whether or not normal functioning of the projectile results.

6.3.5 Off time. A malfunction in which a time-set fuze functions later than set time minus four seconds, but not within ±0.3 second of set time. Functions between set time minus four seconds and set time minus 0.3 second are early improper off times, and functions in the air later than set time plus 0.3 second are late improper off times.

6.3.6 Significant difference in chronograph. When the highest or lowest chronograph reading differs by more than 10 ms from the next closest chronograph reading, the first reading shall be disregarded. If the remaining two chronograph readings do not agree within 10 ms then all three will be disregarded and the data considered lost.

6.3.7 Lost time. Whenever, for any reasons, including 6.3.6, there are not two good chronograph readings for the function time, the time data shall be considered lost. This definition shall not be used to invalidate the results of a test round in which the observers report a malfunction (premature, early, off time, impact or dud).

6.3.8 Safe position. The safe position for an S&A assembly consists of a slider located in the safe position with an intact shear pin, the spin lock in position locking the slider, and setback lock in position to lock the slider. The detonator lead shall be shorted to ground.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

6.3.9 Safe separation distance. The safe separation distance is the projectile flight distance covered in 400 calibers measured from muzzle exit.

6.3.10 Point detonating dud. A malfunction in which a point detonating (PD) set fuze tested in accordance with the requirement of paragraph 6.6 does not function on impact, where impact occurs after 500 ms from muzzle exit.

6.3.11 Gage. Any calibrated aide used to perform examinaton or test called for in Classifiation of Defects.

6.3.12 Unsettable fuze. The fuze shall be considered unsettable if the following criteria are not met:

a. Manual set. Upon activation all display segments shall be on. The first depression of the level advance button shall result in a display of only the four underline and the decimal point. A second depression of the level advance button shall cause each digit to show a zero character, with the most significant digit underlined. Subsequent setting shall not indicate an out of sequence or invalid character or symbol.

b. Autoset. Following autoset, the fuze shall talkback in accordance with the Inductive Setting Requirement for M762/M767 ET Fuze (drawing 12550753).

6.4 Contract data requirements. When this specification is used in acquisition and data are required to be delivered, the data requirements identified below shall be developed as specified by an approved Data Item Description (DD Form 1664) and delivered in accordance with the approved CDRL incorporated into the contract. When the provisions of DOD FAR supplement, Part 27, Sub-Part 27.410-6 (DD Form 1423) are invoked and the DD Form 1423 is not used, the data specified below shall be delivered by the contractor in accordance with the contract or purchase order requirements. Deliverable data required by this specification are cited in the following paragraphs.

Ref. Para.	DID Number	DID Title	Suggested Tailoring
3.4	DI-R-5297	Quality Program Plan	None

6.5 Submission of statistical process control plan. The contractor will submit a SPC plan to the contracting officer with a copy forwarded to ARDEC, Picatinny Arsenal, New Jersey 07806-5000, ATTN: AMSMC-QAR-R (D) and SMCAR-AEF-F as specified in DD form 1423.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

6.6 QE and settings. QE and settings to be used in the ballistic tests shall fall within the following ranges for the applicable weapon systems:

Weapon	Zone	Setting (seconds)	QE (mils)
105mm	1	20.8	590
105mm	8	73.5	1050
155mm	1	PD(98.0)	Direct fire
155mm	3	27.1	585
155mm	7	PD(98.0)	Direct fire
155mm	8	124.1	1170
8-Inch	1	34.4	1100
8-Inch	9	119.6	1100

Distances must be adjusted to achieve a minimum of 0.55 second flight time, except for non-functioning PD testing. Fuzes must not function prior to 0.50 second flight time.

6.7 Submission of designs for approval. See MIL-A-48078 (AR). Submission of test/inspection equipment designs, as required to Commander, ARDEC, ATTN: AMSMC-QAR-R (D), Picatinny Arsenal, New Jersey 07806-5000. This address will be specified on the Contract Data Requirements List, DD Form 1423 in the contract. Unless otherwise specified, data item DI-R-1714 will apply.

6.8 Guidelines for request to use SPC for reducing sampling or for acceptance. In the request, the contractor shall supply sufficient history (6 to 12 months) and data to meet the following criteria:

a. The product meets the TDP requirements.

b. The process is continuously in a state of control.

c. The Cpk value is not less than 1.33.

d. The center line of the Xbar chart is maintained in a desired interval.

e. An effective audit system is established between the contractor and the Government such that all tasks specified in the SPC plan can be monitored and audited.

f. If attribute data is used in the SPC Plan sufficient data and yield information for a minimum of 6 months production must be supplied.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

6.9 Fuze autosetting. Fuze autosetting systems for ballistic test purposes shall be Government Furnished Equipment (GFE).

6.10 Subgroup. For sequential environmentally condition fuzes, each code number listed in Table I-C is a subgroup. For lot acceptance and First Article reliability testing, each different test configuration (including temperature) shall be considered a subgroup.

6.11 Drawings. Drawings listed in Section 2 of this specification under the heading U. S. Army Armament Research Development and Engineering Center (ARDEC) may also include drawings prepared by, and identified as, Edgewood Arsenal, Frankford Arsenal, Rock Island Arsenal or Picatinny Arsenal drawings. Technical data originally prepared by these activities is now under the cognizance of ARDEC.

6.12 Subject term (key word) listing.

Ballistic Function
Dud
Early Burst
Lost Time
Off Time
Premature Burst
Safe Position
Safe Separation Distance

Custodian
Army-AR

Preparing Activity
Army-AR

Project (1390-A614)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-F-70823 (AR)	

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

(TO DETACH THIS FORM, CUT ALONG THIS LINE.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.