INCH POUND
MIL-F-70823A (AR)
2 June 1994
SUPERSEDING
MIL-F-70823 (AR)
9 September 1988

MILITARY SPECIFICATION

FUZE, ELECTRONIC TIME, M762 LOADING, ASSEMBLING AND PACKING AND FUZE, ELECTRONIC TIME, M767 LESS BOOSTER

This specification is approved for use by the U.S. Army Armament, Munitions and Chemical Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the parts, loading, assembling and packing for the Fuze, Electronic Time M762, and parts, loading assembling, but not installation of the booster or packing for the Fuze, Electronic Time M767.

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issues of these documents are those listed in the issue of the Department of Defense Index of Specifications and Standards (DODISS) and supplement thereto, cited in the solicitation (see 6.2).

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document, should be addressed to: Commander, U.S. Army ARDEC, ATTN: SMCAR-BAC-S, Picatinny Arsenal, New Jersey 07806-5000 by using the Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 1390

DISTRIBUTION STATEMENT A. **Approved for public release; distribution is unlimited.**

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

MILITARY

MIL-W-8939	-	Welding, Resistance of Electronic Circuit Modules
MIL-A-48078	-	Ammunition, Standard Quality Assurance Provisions, General Specifications for
MIL-P-60412	-	Packaging, Packing, and Marking for Shipment of Artillery Type and Rocket Fuzes: General Specification for

STANDARDS

MILITARY

MIL-STD-109	-	Quality Assurance Terms and Definitions
MIL-STD-331	-	Fuze and Fuze Components, Environmental and Performance Tests for
MIL-STD-1520	-	Corrective Action and Disposition System for Nonconforming Material
MIL-STD-2000	-	Standard Requirements for Soldered Electrical and Electronic Assemblies
MIL-STD-45662	-	Calibrated System Requirements

(Unless otherwise indicated, copies of federal and military specifications, standards, and handbooks are available from DODSSP - Customer Service, Standardization Documents Order Desk, 700 Robbins Avenue, Bldg. 4D Philadelphia, PA 19111-5094)

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this document to the extent specified herein. Unless otherwise specified, the issues are those cited in the solicitation.

DRAWINGS (See 6.5)

U.S. ARMY ARMAMENT RESEARCH, DEVELOPMENT AND ENGINEERING CENTER (ARDEC)

PRODUCT AND PACKAGING DRAWINGS.

8861213	-	Box, Wirebound, Packing Ammunition for Artillery or Rocket Fuzes
8864492	-	Box, Ammo, Metal, for Artillery Type and Rocket Fuzes

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

8886458 - Box, Pallet Type, Wirebound, Packing, Ammunition for Artillery Type and Rocket Fuzes (within M2A1 Box)
12551000 - Fuze Assembly, M762
12551001 - Fuze Assembly, M767 Less Booster
12550753 - Inductive Setting Requirements for 762/M767 E.T. Fuze
12550756 - Sneak Circuit Analysis

International Test Type Operation Procedures

ITOP 1-2-601 - Laboratory Vibration Schedules
ITOP 4-2-602 - U.S. Army Test and Evaluation Command International Test Operations Procedure, Rough Handling Tests"

Army Regulation

AR70-38 - Research, Development, Test and Evaluation of Material for Extreme Climatic Conditions

Army Technical Test Manual

TM 43-0001-28-6 - Authorized Projectiles, Fuze And Propelling Charge Combinations For Howitzer, Medium, Self-propelled, 155MM: M109A2, M109A3, M109A4 With Cannon M185

TM 43-0001-28-7 - Authorized Projectiles, Fuze And Propelling Charge Combinations For Howitzer, Medium, Towed, 155MM: M198 With Cannon M199

(Copies of other Government documents, drawing and publications required by contractors in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting activity.)

2.2 Non-Government publications. The following document(s) form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of the documents which are DOD adopted are those listed in the issue of the DODISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS are the issue of the documents cited in the solicitation (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

AMERICAN NATIONAL STANDARDS INSTITUTE (ANSI)

ANSI Z1.1 - Guide for Quality Control Charts
ANSI Z1.2 - Control Chart Method of Analyzing Data
ANSI Z1.3 - Control Chart Method of Controlling Quality During Production

(Applications for copies should be addressed to American National Standards Institute, 1430 Broadway, New York, New York 10018.)

AMERICAN SOCIETY FOR TESTING AND MATERIALS (ASTM)

ASTM E29 - Standard Recommended Practice for Indicating Which Places of Figures are to be Considered Significant in Specified Limiting Values

(Application for copies of ASTM should be addressed to the American Society for Testing and Materials, 1916 Race Street, Philadelphia, Pennsylvania 19103).

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document takes precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained. (See contract provisions for additional precedence criteria).

3. REQUIREMENTS

3.1 Materials. Materials shall be in accordance with applicable drawings and specifications.

3.1.1 Interface definition. The fuze shall be fitted to the desired projectile by means of a threaded plug with 2.0-12 UNS-1A threads. No other mechanical or electrical interfaces with the selected projectile is required.

3.2 Components and assemblies. The components and assemblies shall comply with all requirements specified on the Drawings 12551000 for the M762 and 12551001 for the M767 less booster, all associated drawings and with all requirements specified in applicable specifications and standards.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

3.3 Performance characteristics.

3.3.1 Time setting (air burst) mode. The fuze shall be capable of being activated and set manually or inductively for functioning times from 0.5 to 199.9 seconds in 0.1 second increments. When the set time is reached, the fuze shall cause the projectile to function in an air burst mode within ± 0.3 seconds of the set time in the temperature range -45 degrees F to +145 degrees F.

3.3.2 Impact mode. The fuze shall be capable of being activated and set manually or inductively to an impact mode and shall be functional in the impact mode no earlier than 500 ms after muzzle exit.

3.3.3 Safe and arm device. The S&A assembly 12550900 shall be tested for arming and non-arming according to 4.6.2.3.

3.4 Statistical process control quality program plan. The contractor's quality program plan or detailed inspection plan shall include documented statistical process controls (SPC). The SPC plan shall be submitted to the contracting officer for review and approval by the Cognizant Technical Agency (CTA) in accordance the contract (see 6.8).

The contractor shall not initiate production without written approval from the contracting officer. Once approved, if SPC is used for process control purposes only, the contractor may change process control parameters or add new SPC features as necessary. However, if SPC is used for acceptance purposes, the contractor shall not change the SPC without written approval from the Contracting Officer.

3.4.1 Process yields. A system shall be implemented for the reporting and monitoring of process yields. The yield at each inspection station shall be determined. First time seen and rework shall be reported separately. Multiple defects, when due to a single event or common cause, shall be counted as a single defect and classified in accordance with MIL-STD-1520. All rejects, including reworkable rejects, shall be counted. A system of defect codes is to be used, so as to adequately describe the reason for rejection. During the time manufacturing is in process, the following yield information shall be reported monthly to the procuring activity as an update of the process yield history.

a. The percent yield and quantity through each inspection/test station.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

b. The percentage of defects by defect codes, counting only rejects, not counting rework, and including the identification of the inspection/test station.

3.4.2 Process trends and alert system. A history of the process yields shall be kept so that adverse trends that indicate process problems can be readily observed. An alert system shall be utilized to institute investigations and corrective actions when yields fall below the criteria established by the manufacturer. The alert thresholds shall be clearly marked on the yield reports.

3.4.3 Control of processes. The contractor shall constantly control all processes. Control shall be demonstrated through completion of the following:

a. Process documentation shall list all control parameters, e.g., time, temp, etc., and associated specifications and requirements.

b. Process documentation shall define control limits for all control parameters.

c. Process documentation shall detail set-up requirements, including sketches of machines and typical settings.

d. Process documentation shall provide for sample inspection as elements of process acceptance, and the feedback of evaluation results to adjust the process control limits.

e. Process documentation shall include a system for setting and monitoring controlled parameters such as machine settings of temperature and time.

f. Process documentation shall provide a system for recording records of machine calibration for all control parameters.

g. Process documentation shall provide a system for process audits at two-week maximum intervals.

3.5 Ballistic functioning.

3.5.1 Time set. The fuze shall function at the set time within the set time tolerance when set to the time mode.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

3.5.2 Point detonation set. When set to the Point Detonation (PD) mode, the fuze shall cause the projectile to function on impact with a six inch minimum thick plywood target if impact occurs after a flight time of 500 ms or more after muzzle exit. When fired at this target so that impact occurs at 400 calibers of muzzle exit, the fuze shall not function when impacting the target.

3.5.3 Premature (see 6.7.1) or early bursts (see 6.7.2). There shall be no premature bursts or early bursts in the gun tube or in-flight.

3.6 Environmental requirements.

3.6.1 Storage. The fuze, in its standard packing container, shall be capable of being stored in a -60 degree F to +160 degree F environment and remain safe and operable in a -45 degree F to +145 degree F environment, according to TABLE I-C of this specification.

3.6.2 Logistic vibration. The fuze shall meet the requirements of ITOP 1-2-601, according to 4.6.3.1 of this specification.

3.6.3 Twenty-eight day hot. The fuze shall meet the requirements of 4.6.3.2 of this specification.

3.6.4 Fourteen day humidity. The fuze shall meet the requirements of 4.6.3.3 of this specification.

3.6.5 Tactical vibration. The fuze shall meet the requirements of ITOP 1-2-601, according to 4.6.3.4 of this specification

3.6.6 Salt fog. The fuze shall meet the requirements of MIL-STD-331, Test 107.1, according to 4.6.3.5 of this specification.

3.6.7 Seven foot drop - boxes. The fuze shall meet the requirements of MIL-STD-331, Test T121, according to 4.6.3.6 of this specification.

3.6.8 Bounce (loose cargo). The fuze shall meet the requirement of ITOP 4-2-602, according to 4.6.3.7 of this specification.

3.6.9 Seven foot drop - cans. The fuze shall meet the requirements of MIL-STD-331, Test T121, according to 4.6.3.8 of this specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

3.6.10 Five foot drop - bare. The fuze shall meet the requirements of MIL-STD-331, Test T121, according to 4.6.3.9 of this specification.

3.6.11 Acceleration aging test. The fuze shall meet the requirements of 4.3.3.2.3 and 4.3.3.2.4 of this specification.

3.7. First article. When specified in the contract or purchase order, a sample shall be subjected to first article inspection in accordance with the technical provisions herein (see 4.3).

3.8 Lot acceptance sample. Lot acceptance sample and testing shall be in accordance with 4.4.2.

3.9 Electrical performance.

3.9.1 PWB electrical tests (PN 12550830). The PWB assembly shall be tested per 4.6.1.1 of this specification.

3.9.2 Level II tests (PN 12550800). The Level II assembly shall be tested per 4.6.1.3 and TABLE VII of this specification.

3.9.3 Battery assembly (PN 125508790). The battery assembly shall be tested for non-activated voltage and resistance per 4.6.1.7.

3.9.4 Explosive resistance.

a. Actuator, piston (12550906). The resistance of the piston actuator shall be measured per 12550900 using a meter supplying less than 1 ma.

b. Detonator, electric (12550926). The detonator resistance shall be measured per 12550920 using a meter supplying less than 1 ma. (see drawing 12550926 note 4).

c. Battery primer assembly, stab/electrical (12550991). The battery primer resistance shall be measured per 12550990 using a meter supplying less than 1 ma.

d. Detonator, electrical socket contact to ground socket (12550900). Using a meter supplying less than 1 ma, verify that the S&A assembly detonator contact (see drawing 12550900, note 4H) to ground socket resistance is greater than 10 megohms.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

e. Battery primer socket to ground socket (12550900). Using a meter supplying less than 1 ma, verify that the S&A assembly battery primer contact (see drawing 12550900, note 4H) to ground socket resistance is greater than 10 megohms.

f. Detonator electric resistance (12550900). Using a meter supplying less than 1 ma, verify that the S&A assembly detonator electrode (see drawing 12550900, note 4G) to ground socket resistance is less than 0.30 ohm.

3.10 Change of circuit design. Whenever an engineering change proposal involves a change of the approved circuit design, as a minimum, the contractor shall perform a sneak circuit analysis in accordance with Drawing 12550756 to ensure that the change shall not adversely affect the performance, quality or reliability of the fuze.

3.11 Workmanship.

3.11.1 General workmanship. All parts shall be fabricated and finished in a thorough, workmanlike manner and all manufacturing, processing and assembly operations shall be correctly performed. The parts shall be clean and free of burrs, sharp edges, unblended radii, surface defects, cracks, chips, dirt, grease, and oil (except where specifically required), rust and other foreign matter. The cleaning method used shall not be injurious to any part, nor shall the parts be contaminated by the cleaning agent. All required markings shall be neat, legible and sharply defined.

3.11.2 Cast and molded components. Cast and molded components shall be of uniform quality, free of coldshuts, blowholes, shrinkage defects, voids, cracks, and foreign inclusions. Casting must be clean, dry and free of chips. Cast and molded plastic parts may display surface color variations due to flow pattern and filler content.

3.11.3 Flash removal. All flash must be completely removed from parting lines, internal and external profiles, cored holes and ejector pin marks, except as noted on drawings.

3.11.4 Gates. All waste materials remaining from the gate must be removed except when so noted on the drawings.

3.11.5 Remelted scrap. No scrap shall be used other than sprues, gates, and rejected die casting of the particular manufacturer's own plants. Rejected die casting may be used if

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

free from finishes, lubricants or any substance which may contaminate the alloy.

3.11.6 Solvent precaution. In the manufacture of the fuze or its components, only those cleaners or solvents which are known to have no interaction with the fuze materials shall be used. Particular attention must be directed to plastics, elastomers and other organic materials which are generally susceptible to chemical attack in the form of solvation, absorption, plasticization or stress cracking. Determination of suitability for use must consider not only immediate and short term effects, but also long term effects of chemical interaction that may manifest in long term storage at temperature extremes and rough handling environments.

3.11.7 Welding. Welding workmanship requirements shall be per MIL-W-8939, section 3.7.1.1.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements (examinations and tests) as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to ensure supplies and services conform to prescribed requirements.

4.1.1 Responsibility for compliance. All items shall meet all requirements of Sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of ensuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling inspection, as part of manufacturing operations, is an acceptable practice to ascertain conformance to requirements, however, this does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to accept defective material.

4.1.2 General provisions. Unless otherwise specified herein, the provisions of MIL-A-48078, apply and form a part of this

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

specification. Reference shall be made to MIL-STD-109 to define quality assurance terms used herein.

4.2 Classification of inspections. The inspection requirements specified herein are classified as follows:

a. First article inspection (see 4.3).

b. Quality conformance inspection (see 4.4).

4.3 First article inspection.

4.3.1 Submission. The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2. The first article sample shall consist of the following quantities:

a. Ten (10) each of every component, subassembly and assembly listed in 4.4.3.1 through 4.4.3.62 herein, except that for cast, molded and stamped components, five (5) each shall be submitted from every die/mold cavity or stamping tool from which each component was made. Inspection shall be per 4.3.2.1.

b. Two hundred fifty-five (255) complete fuze assemblies. Inspection shall be per 4.3.2.2.

4.3.2 Inspections to be performed. As determined by the Government, the first article assemblies, components and test specimens may be subjected to any or all of the examinations and tests specified in this detail specification and be inspected for compliance with any or all requirements of the applicable drawings.

4.3.2.1 Examination and static tests. The first article samples submitted in accordance with 4.3.1.a shall be subjected to any or all of the inspections listed in 4.4.3.1 through 4.4.3.62 and to any or all of the applicable drawing requirements.

4.3.2.2 Functioning performance tests. The fuze assemblies submitted in accordance with 4.3.1.b shall be subjected to the following tests:

a. Cold temperature sequential operational and safety tests per TABLEs I-A and I-C (60 fuzes).

b. Hot temperature sequential operational, safety and

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

accelerated aging per TABLES I-B and I-C (80 fuzes).

c. Reliability tests per TABLES II, III and IV (115 fuzes).

4.3.3 Rejection. See MIL-A-48078.

4.3.3.1 Examinations and static tests. If any component, subassembly or assembly fails to comply with any of the applicable requirements, the first article sample shall be rejected.

4.3.3.2 Functioning performance tests. Defect categories and rejection criteria for these tests are as follows:

4.3.3.2.1 Reliability and sequential operational tests.

a. Safe position - critical defect - Any fuze found with the S&A module not in the safe position (see 6.7.8) prior to gunfire shall be cause for rejection. The S&A module shall be examined using x-ray techniques, shielding the fuze electronics with a .5 inch minimum thick lead shield.

b. Premature burst - critical defect - Any premature burst (see 6.7.1) shall be cause for rejection.

c. Function - critical defect - Any function (see 6.7.4) in a nonfunction test shall be cause for rejection.

d. Early burst - critical defect - Any early burst (see 6.7.2) shall be cause for rejection.

e. Point detonating dud - major defect - More than one point detonating dud (see 6.7.10) in all PD functioning tests shall be cause for rejection.

f. Off time (see 6.7.5) - major defect - More than two early improper off time total, or more than one late improper off time in any one time set group shall be cause for rejection.

g. Fuze unsettable at the proving ground - major defect - More than two fuzes total, or more than one fuze in any environmentally preconditioned subgroup (see 6.12) which cannot be activated and set as required, shall be cause for rejection (see 6.7.12).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

h. Time mode dud - more than one time dud in a gunfire code shall be cause for rejection.

i. Total duds - More than five fuze duds in the entire Reliability and Sequential Operational Test Matrix.

4.3.3.2.2 Safety sequential tests.

a. Safe position - critical defect - Any fuze found with the S&A module not in the full safe position (see 6.7.8) prior to gunfire shall be cause for rejection. The S&A module shall be examined using x-ray techniques, shielding the fuze electronics with a .5 inch minimum thick lead shield.

b. Premature burst - critical defect - Any premature burst (see 6.7.1) shall be cause for rejection.

c. Function - critical defect - Any function (see 6.7.4) in the PD nonfunction test shall be cause for rejection.


d. Early burst - critical defect - Any early burst (see 6.7.2) shall be cause for rejection.

4.3.3.2.3 Accelerated aging tests. A test sample of 20 fuzes shall be subjected to a test temperature of +160 degrees F and 85% relative humidity. Tolerance of test conditions should be in accordance with MIL-STD-331, paragraph 4.5.2. One fuze shall be removed after 54 hours, 135 hours, and 270 hours after starting the conditioning, and be disassembled and tested according to 4.6.1.3. After 540 hours the remaining 17 fuzes shall be removed, disassembled, and tested according to 4.6.1.3.

4.3.3.2.4 S&A accelerated aging test. A test sample of 10 S&A Housings (12550901) and 10 Sliders (12550921) shall be subjected to a test temperature of +160 degrees F and 85% relative humidity for 540 hours. At the completion of the test a visual inspection of the test samples shall be visually inspected under a 10X magnification minimum. Any piece part that exhibits evidence of corrosion due to residues trapped under the plating shall be cause for rejection.


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE I-A First article cold temperature sequential operational and safety tests

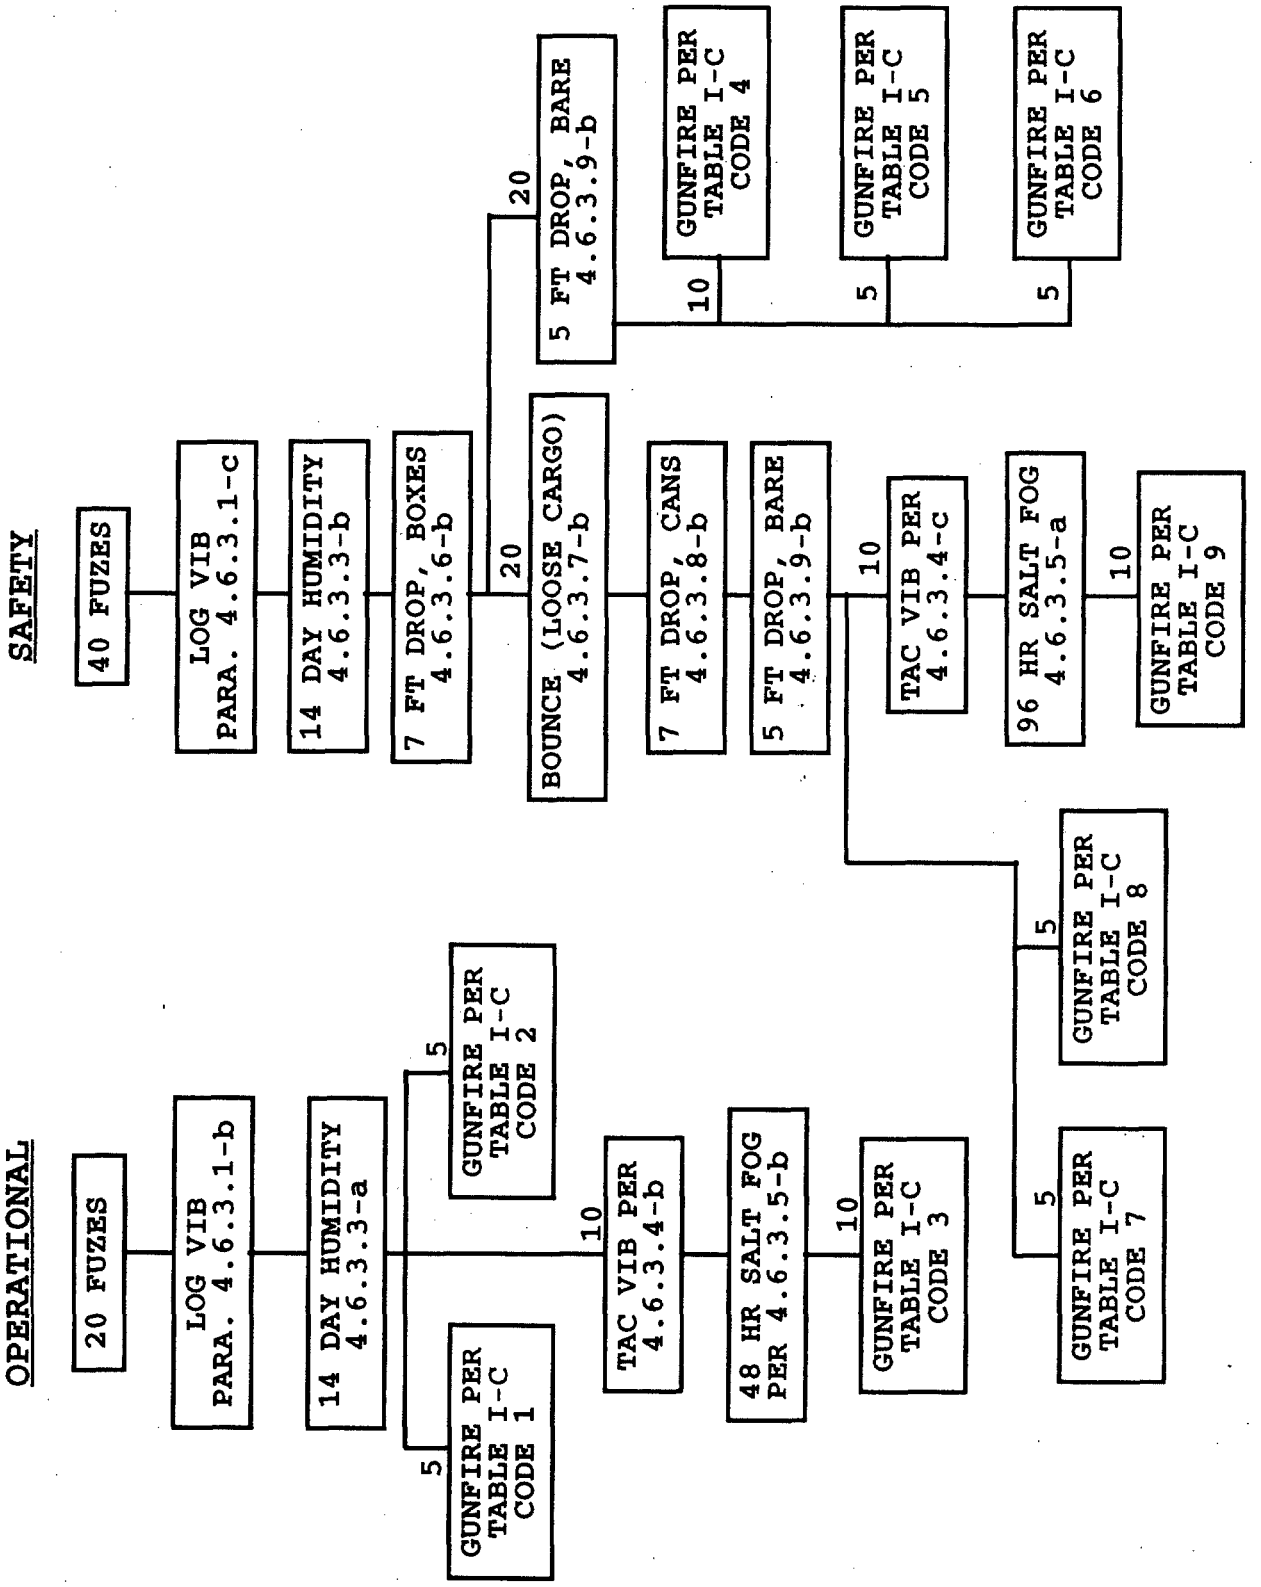

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE I-B First article hot temperature sequential operational and safety tests

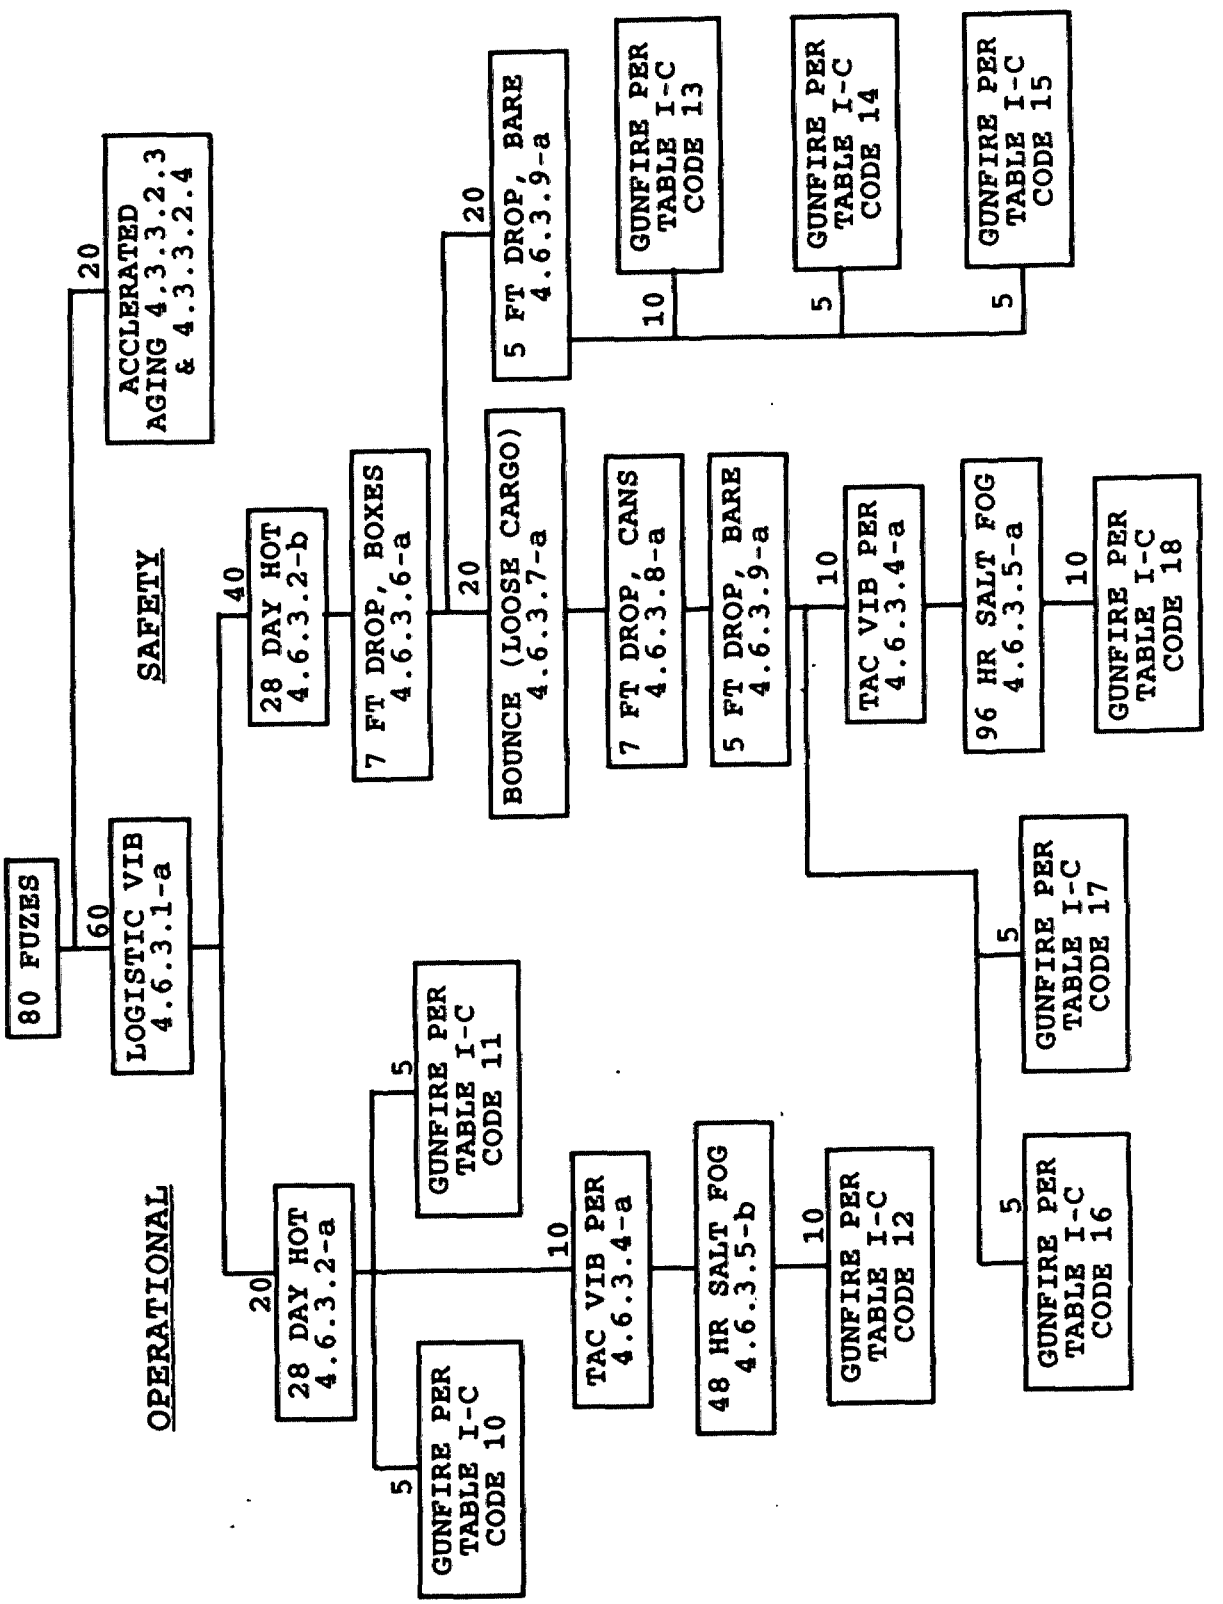

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE I-C M762 First article safety / sequential operational gunfire matrix

CODE[1]	CALIBER	WEAPON	TUBE[2]	PROPELLANT	ZONE[3]	PROJECTILE[4]	TEMP FUZE	TEMP PROJ	TEMP PROP
1	105MM	M119	L20A1	M200	8	M1	-45°F	-45°F	+70°F
2	8 INCH	M110A2	M201A1	M188A1	9	M106	-45°F	-45°F	+70°F
3	155MM	M198	M199	M203A1	8S	M864	-45°F	-45°F	+70°F
4	105MM	M101A1	M2A2	M67	1	M1	-60°F	-60°F	+70°F
5	8 INCH	M110A2	M201A1	M1	1	M106	-60°F	-60°F	+70°F
6	155MM	M109A2/A3	M185	M3A1	2	M107	-60°F	-60°F	+70°F
7	105MM	M119	L20A1	M200	8	M1	-60°F	-60°F	+70°F
8	8 INCH	M110A2	M201A1	M188A1	9	M106	-60°F	-60°F	+70°F
9	155MM	M198	M199	M203A1	8S	M864	-60°F	-60°F	+70°F
10	105MM	M119	L20A1	M200	8	M1	+145°F	+145°F	+70°F
11	8 INCH	M110A2	M201A1	M188A1	9	M106	+145°F	+145°F	+70°F
12	155MM	M198	M199	M203A1	8S	M864	+145°F	+145°F	+70°F
13	105MM	M101A1	M2A2	M67	1	M1	+145°F	+130°F	+145°F
14	8 INCH	M110A2	M201A1	M1	1	M106	+145°F	+130°F	+145°F
15	155MM	M109A2/A3	M185	M3A1	2	M107	+145°F	+130°F	+145°F
16	105MM	M119	L20A1	M200	8	M1	+145°F	+130°F	+145°F
17	8 INCH	M110A2	M201A1	M188A1	9	M106	+145°F	+130°F	+145°F
18	155MM	M198	M199	M203A1	8S	M864	+145°F	+145°F	+145°F

1. From Table I-A or I-B.
2. All tubes to have 90% remaining life or better.
3. Approximately 80% of the fuzes to be set to timeout mode. Timeout mode set fuzes shall be so that a minimum of 75 % range will be achieved using standard weapon quadrant elevations. Timeout and PD mode settings shall be paragraph 4.7.3. The remaining fuzes shall be fired at PD mode at a quadrant elevation between 800 and 900 mils.
4. If M762 fuzes are used, the booster shall be the M767 booster assembly. M767 booster assembly shall not be subjected to sequential environments and shall be installed at the test site.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE II M762 First article test
(reliability)
(105mm)

HOWITZER	TUBE[3]	PROJECTILE/ FUZE	CHARGE	ZONE	TEMP[1]	NO.	SETTING[7]	APPROXIMATE QUADRANT ELEVATION(mils)
M110A1	M2A2	M1/M762*	M67	1	COLD/HOT	5/5	27.4[6]	1108
M2A2	M2A2E2	M1/M762*	M67	5	COLD/HOT	5/5	49.4[6]	985
M119	M20A1	M760/M762*	M200	8	HOT	5	50.1[6]	770
M119	L20A1	M760[8]/M762* (INERT)	M200	8	HOT	5	P.D.[2,4]	---
M2A2	M2A2E2	M1[8]/M762* (INERT)	M67	1	HOT	5	P.D.[2,5]	---
TOTAL -							35	

Notes: Hot temperature - +145°F
Cold temperature - -45°F
* Booster assembly installed at test site. M767 booster assembly shall be used.
1. Fuze/projectile/propellant at same temperature.
2. See paragraph 4.7.2.
3. Tubes to have 90% or better remaining life.
4. Target distance to be 1200 ft. minimum.
5. Target distance to be 450 ft. minimum.
6. Setting per paragraph 4.7.3.
7. Indicated setting times vary from those shown depending on conditions at the time of testing.
8. All spotting charges to be T2 with inert projectiles.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE III M762 First article test
(reliability)
(155mm)

HOWITZER	TUBE[3]	PROJECTILE/ FUZE	CHARGE	ZONE	TEMP[1]	NO.	SETTING[6]	APPROXIMATE QUADRANT ELEVATION(mils)
M109A1/A3	M185	M107/M762*	M3A1	2	COLD/HOT	5/5	20.5[5]	575
M109A1/A3	M185	M107/M762*	M119A2	7	COLD/HOT	5/5	66.7[5]	870
M109A1/A3	M185	M483A1/M762	M3A1	3	COLD/HOT	5/5	26.1[6]	679
M109A1/A3	M185	M483A1/M762	M4A2	7	COLD/HOT	5/5	76.4[5]	1170
M198	M199	M864/M762	M203A1	8	HOT	5	97.4[5]	909
M109A1/A3	M185	M107[7]/M762* (INERT)	M4A2	7	AMBIENT	5	P.D.[2,4]	---

TOTAL -	50

Notes: Hot temperature - +145°F
Cold temperature - -45°F

* Booster assembly installed at test site. M767 booster assembly shall be used.

1. Fuze/projectile/propellant at same temperature.
2. See paragraph 4.7.2.
3. Tubes to have 90% or better remaining life.
4. Target distance to be 1100 ft. minimum.
5. Setting per paragraph 4.7.3.
6. Indicated setting times vary from those shown depending on conditions at the time of testing.
7. All spotting charges to be T2 with inert projectiles.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE IV M762 First article test
(reliability)
(8 inch)

HOWITZER	TUBE[3]	PROJECTILE/ FUZE	CHARGE	ZONE	TEMP[1]	NO.	SETTING[8]	APPROXIMATE QUADRANT ELEVATION(mils)
M110A2	M201A1	M106/M762*	M1	1	COLD/HOT	5/5	40.0[6]	1100[7]
M110A2	M201A1	M106/M762*	M188A1	9	HOT	5	119.6[6]	1100[7]
M110A2	M201A1	M509A1/M762	M1	1	COLD	5	20.0[6]	600
M110A2	M201A1	M106[9]/M762* (INERT)	M1	1	COLD	5	P.D.[2,4]	---
M110A2	M201A1	M106[9]/M762* (INERT)	M188A1	9	HOT	5	P.D.[2,5]	---

TOTAL -	30

Notes: Hot temperature - +145°F
Cold temperature - -45°F
* Booster assembly installed at test site. M767 booster assembly shall be used.
1. Fuze/projectile/propellant at same temperature.
2. See paragraph 4.7.2.
3. Tubes to have 90% or better remaining life.
4. Target distance to be 500 ft. minimum.
5. Target distance to be 1800 ft. minimum.
6. Setting per paragraph 4.7.3.
7. Maximum testing Quadrant Elevation.
8. Indicated setting times vary from those shown depending on conditions at the time of testing.
9. All spotting charges to be T2 with inert projectiles.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspections.

4.4.1 Inspection lot formation. Inspection lots shall comply with lot formation provisions of MIL-A-48078. In addition inspection lots shall contain:

a. Batteries from lots with the same interfix number from one manufacturer.

b. Crystal oscillators from lots with the same interfix from one manufacturer.

c. Liquid crystal displays from lots with the same interfix number from one manufacturer.

d. Linear IC's from lots with the same interfix number from one manufacturer.

e. CMOS IC's from lots with the same interfix number from one manufacturer.

f. Electric detonators from lots with the same interfix number from one manufacturer.

g. Piston actuators from lots with the same interfix number from one manufacturer.

h. Battery primers from lots with the same interfix number from one manufacturer.

i. Lead charges from lots with the same interfix number from one manufacturer.

4.4.2 Sampling for functioning performance tests.

4.4.2.1 Lot sample sizes. The lot sample size shall be according to TABLE V. Until three consecutive lots are accepted, the sample size shall be one hundred sixteen (116) fuzes, as shown in Note 'a' of TABLE V. After three consecutive lots are passed, the sample shall be reduced to fifty-five (55) fuzes as shown in Note 'b' of TABLE V with the criteria of reintroduction of the large sample size if one reduced sample fails to meet the criteria of 4.4.2.3.

4.4.2.2 Lot sample reject criteria. The sample shall be rejected according to the following criteria:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

a. Safe and arm fails x-ray.

b. Premature burst - critical defect - Any premature Burst (see 6.7.1) in the entire ballistic test.

c. Early burst - critical defect - Any early burst (see 6.7.2) in the entire ballistic test.

d. Function - critical defect - Any function in a non-function test (see 6.7.4) shall be cause for rejection.

e. Point detonating dud - major defect - More than one point detonating dud (see 6.7.10) in all PD functioning tests.

f. Time dud - major defect - More than three time duds (see 6.7.3) for all configurations and temperatures.

g. Off time - major defect - More than one early improper off time or one late improper off time (see 6.7.5) in the entire ballistic test.

h. Fuze unsettable - major defect - More than two Fuzes which fails to activate or subsequent to activation fail to be set to the setting required by the ballistic test (see 6.7.12).

i. Total duds - More than four duds in the entire ballistic test.

4.4.2.3 Subsequent lot sample reject criteria. The subsequent lot sample shall be rejected according to the following criteria.

a. Safe and arm fails x-ray.

b. Premature burst - critical defect - Any premature Burst (see 6.7.1) shall be cause for rejection.

c. Early burst - critical defect - Any early burst (see 6.7.2) shall be cause for rejection.

d. Function - critical defect - Any function (see 6.7.4)in a non-function test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

e. Point detonating dud - major defect - More than one point detonating dud (see 6.7.10) in all PD functioning tests.

f. Time dud - major defect - More than one time dud (see 6.7.3) for all configurations and temperature conditions.

g. Offtime - major defect - More than one early improper off time or late improper off time (see 6.7.5) in the entire ballistic test.

h. Fuze unsettable - major defect - More than one fuze which fails to activate or subsequent to activation fail to be set to the setting required by the ballistic test (see 6.7.12).

i. Total Duds - More than two duds in the entire ballistic test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE V M762 Lot operational and safety test matrix

TEST	WEAPON	TUBE f	PROJECTILE	CHARGE	ZONE	TEMP e	SAMPLE SIZE o	SAMPLE SIZE b	SET MODE	FUZE TYPE
PD MODE NON- m FUNCTIONING	M102 (105mm)	M137A1	M1 i	M67	1	-45°F	5/5c	5/5c	k	M762**
	M109A2/A3 (155mm)	M185	M107 i	M3A1	2	+70°F	5/5c	-	k	M762**
PD MODE n FUNCTIONING 155mm	M109A2/A3	M185	M107 i	M3A1	2	-45°F	5	5/5c	k	M762**
				M4A2	7	+70°F	5/5c	-	k	M762**
TIME MODE 105mm 1	M101A1	M2A2	M1	M67	1	-45°F	10	5	k	M762**
	M119	L20A1	M760	M200	8	+145°F	15	5	k	M762**
TIME MODE 8-inch 1	M110A2	M201A1	M106	M188A1	9	+145°F	10	5	k	M762**
	M110A2	M201A1	M106	M1	1	-45°F	5	5	k	M762**
TIME MODE 155mm 1	M109A2/A3	M185	d	M3A1	3	-45°F	16	5	k	M762*
155mm 1	M198	M199	o	M203A1	8R	+70°F	10	-	k	M762*
155mm 1	M198	M199	o	M201A1	8R	+145°F	15	10	k	M762*
TOTAL							116	55		

Notes:
* M762 fuze shall be assembled with self registration charge, T2 spotter charge, APG charge or expulsion charge as required.
** M762 fuze shall be assembled with M767 booster assembly.
a. For three consecutive acceptable lots (see 4.4.2.1).
b. For subsequent lots after "a" above (see 4.4.2.1).
c. Logistic Vibration samples (per 4.6.3.1, except at ambient temperature).
d. Use any cargo carrying projectiles as authorized by TM 43-0001-28-6 (inert cargo projectiles are acceptable), or use M107, HE, Projectile with boostered fuze.
e. Projectile/Fuze/Charge at same temperature.
f. All tubes will have 90% remaining life or better.
g. Fuzes to be activated and set per 4.7.3.
h. Set times may be vary +/- 25% depending on conditions.
i. All spotting charges to be T2 or APG with inert projectiles.
j. All temperature preconditioning per 4.6.3.10.
k. 80% of fuzes will be hand activated and set (do not verify setting with autosetter)/20% of fuzes will be auto activated and set. Only one attempt at hot (+145°F) and two attempts at ambient and cold (-45°F) shall be made to activate and set the fuze.
fuze failing to activate or set shall be counted against the fuze unsettable category.
l. The Quadrant Elevation (QE) and Setting (seconds) shall be as specified in 6.9.
m. Per 4.7.1 (Target distance to be at 400 calibers).
n. Per 4.7.2 (Target distance to be approximately 500 feet for zone 2 and 1200 feet for zone 7.
o. Use only cargo carrying projectiles as authorized by TM 43-0001-28-7. Inert cargo projectile are acceptable.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.4.3 Examinations and tests.

a. Classification of characteristics. Quality conformance examinations and tests are specified in the following Classification of Characteristics paragraphs. The contractor's quality program or detailed inspection system shall provide assurance of compliance of all characteristics with the applicable drawing and specification requirements utilizing as a minimum the conformance criteria specified. When cited herein, attributes sampling inspection shall be conducted in accordance with TABLE VI below, using the inspection levels stated in the Classification of Characteristics paragraphs.

TABLE VI Attributes sampling inspection

Lot Size	Inspection Levels					
	I	II	III	IV	V	VI
2 to 8	*	*	*	*	5	3
9 to 15	*	*	*	13	5	3
16 to 25	*	*	*	13	5	3
26 to 50	*	*	32	13	5	3
51 to 90	*	*	32	13	13	5
91 to 150	*	125	32	13	13	5
151 to 280	*	125	32	32	20	8
281 to 500	*	125	32	32	20	8
501 to 1200	*	125	80	50	20	13
1201 to 3200	1250	125	80	50	32	13
3201 to 10000	1250	125	125	50	32	13
10001 to 35000	1250	315	125	80	50	13
35001 to 150000	1250	315	125	80	50	13
150001 to 500000	1250	500	200	125	50	13
500001 and over	1250	500	200	125	50	13

Numbers under inspection levels indicate sample size; asterisks (*) indicate one hundred percent inspection. If sample size exceeds lot size, perform one hundred percent inspection. Accept on zero and reject on one or more for all inspection levels.

b. Alternative quality conformance provisions. Unless otherwise specified herein or provided for in the contract, alternative quality conformance procedures, methods, or equipment such as statistical process control, tool control, variables sampling or other types of special sampling procedures, etc., may

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

be used by the contractor when they provide, as a minimum, the level of quality assurance required by the provisions specified herein. Prior to applying such alternative procedures, methods, or equipment, the contractor shall describe them in a written proposal submitted to the Government for evaluation (see 6.6). When required, the contractor shall demonstrate that the effectiveness of each proposed alternative is equal to or better than the specified quality assurance provision(s) herein. In cases of dispute as to whether the contractor's proposed alternative(s) provides equivalent assurance, the provisions of this specification shall apply. All approved alternative provisions shall be specifically incorporated into the contractor's quality program or detailed inspection system, as applicable.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.1	Fuze final level II assembly	1 OF 1	12550800
			NEXT HIGHER ASSEMBLY 12551000

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Special				
a	Electrical performance	100%	3.9.2	4.6.1.3.a Note 1,2
Major				
101	Electrical performance	100%	3.9.2	4.6.1.3.a
102	Spin test	Level IV	3.9.2	4.6.1.3.b
103	Level advance switch test	Level IV	3.9.2	4.6.1.3.c
104	Count advance switch test	Level IV	3.9.2	6.6.1.3.d
105	Evidence of poor solder workmanship	100%	3.2	MIL-STD-2000
106	Contact, crush switch; cup, Shield, inner and cup, shield, outer missing per note 10	100%	3.11	Visual/Gage
Minor				
201	Evidence of poor workmanship	Level V	3.2	Visual/Gage

NOTES: Note 1. Test parameter no. 11,13,14 and 21. Note 2. Special failure criteria: TEST 11-Any output(PA or DET) less than Spec.; Test 13&14 - Any pulse output.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.2	Contact, spin switch	1 OF 1	12550804
			NEXT HIGHER ASSEMBLY: 12550800

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Contact width [D]	(a)	3.2	Gage
102	Beam offset dimension [E]	(a)	3.2	Gage
103	Part thickness after plating [F]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE		DRAWING NUMBER
4.4.3.3	Cover, spin switch	SHEET 1 OF 1	12550805
			NEXT HIGHER ASSEMBLY: 12550800

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Overall length D	(a)	3.2	Gage
102	Stepped feature E	(a)	3.2	Gage
103	Location of chamfered holes F	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.4	Contact, battery	1 OF 1	12550807
			NEXT HIGHER ASSEMBLY: 12550800

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major 101	Contact width [A]	(a)	3.2	Gage
Minor 201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.5	Inductive coil assembly	1 OF 1	12550810
			NEXT HIGHER ASSEMBLY: 12550800

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Inductance and Q of Shielded Coil Assembly per note 5 [A]	Level IV	3.2	4.6.1.2
102	Solderability test	15 (a)	3.2	MIL-STD-2000
Minor				
201	Winding diameter, max [B]	Level V	3.2	Gage
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) Accept on 0 failure /reject on 1 or more failures.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.6	Contact, crush switch	1 OF 1	12550811
			NEXT HIGHER ASSEMBLY: 12550810

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Inside diameter [B]	(a)	3.2	Gage
102	Flange outer diameter [C]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.7	Coil form	1 OF 1	12550812

NEXT HIGHER ASSEMBLY: 12550810

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Dimension across rib [E]	(a)	3.2	Gage
102	Intermediate internal diameter [-B-]	(a)	3.2	Gage
103	Largest outside diameter [-D-]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.8	Shield protective ESD	1 OF 1	12550815
			NEXT HIGHER ASSEMBLY: 12550800

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major	None defined			
Minor				
201	Inside diameter -B-	(a)	3.2	Gage
202	Overall length C	(a)	3.2	Gage
203	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.9	Cup, shield, outer	1 OF 1	12550816
			NEXT HIGHER ASSEMBLY: 12550800

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major	None defined			
Minor				
201	Outside diameter [D]	(a)	3.2	Gage
202	Overall length [E]	(a)	3.2	Gage
203	Evidence of poor workmanship	Level V	3.2	Visual/Gage

NOTES:
(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.10	Cup, shield, inner	1 OF 1	12550817
			NEXT HIGHER ASSEMBLY: 12550800

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major	None defined			
Minor				
201	Inside diameter [C]	(a)	3.2	Gage
202	Overall length [D]	(a)	3.2	Gage
203	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.11	Power supply module assembly	1 OF 1	12550820
			NEXT HIGHER ASSEMBLY: 12550800

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major 101	Crystal pad missing [A]	Level IV	3.2	Visual
Minor 201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.12	Housing, power supply	1 OF 1	12550821
			NEXT HIGHER ASSEMBLY: 12550820

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Overall part length [B]	(a)	3.2	Gage
102	Length to shoulder [P]	(a)	3.2	Gage
103	Shoulder height [A]	(a)	3.2	Gage
104	Flange hole [R]	(a)	3.2	Gage
105	Slot surface mismatch per note 12 [S]	(a)	3.2	Gage
106	Bottom slot [T]	(a)	3.2	Gage
107	Body flange [D]	(a)	3.2	Gage
108	Location of 5 holes [-L-], [-M-], and [-U-]	(a)	3.2	Gage
109	Depth of cavity [V]	(a)	3.2	Gage
110	Depth of opening [X]	(a)	3.2	Gage
111	Flash not permitted per note 13 [Y]	(a)	3.2	Visual
112	Small slot diameter [Z]	(a)	3.2	Gage
Minor				
201	Cavity width [W]	(a)	3.2	Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE		DRAWING NUMBER
4.4.3.13	PWB Assembly	SHEET 1 OF 1	12550830
			NEXT HIGHER ASSEMBLY 12550820

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Special				
a	Electrical performance:			
	Ambient temperature	100%	3.9.1	4.6.1.1.b Note 1
	Hot temperature	100%	3.9.1	4.6.1.1.c Note 2,3
	Cold temperature	100%	3.9.1	4.6.1.1.c Note 2,3
Major				
101	Electrical performance:			
	Ambient temperature	100%	3.9.1	4.6.1.1.b
	Hot temperature	100%	3.9.1	4.6.1.1.c
	Cold temperature	100%	3.9.1	4.6.1.1.c
102	Evidence of poor solder workmanship	100%	3.2	MIL-STD-2000
103	Crystal mount missing [D]	Level IV	3.2	Visual/Gage
Minor				
201	PWB pins height [E]	Level IV	3.2	Gage
202	Adhesive missing under C3 [F]	Level IV	3.2	Visual
103	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES: Note 1. Test parameter #.11,13,14 and 17. Note 2. Test parameter # 11,13 and 14. Note 3. Special failure criteria: Test 11 - Any output(PA or DET) less than spec.; Test 13 and 14 - Any pulse output; Test 17 - Any pulse before 1995 input pulses.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.14	Contact, button	1 OF 1	12550836
			NEXT HIGHER ASSEMBLY: 12550830

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Solderability test	15 (a)	3.2	MIL-STD-2000
Minor				
201	Tap width C	(b)	3.2	Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) Accept on 0 failure/reject on 1 or more failures.
(b) See 4.6.5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1	DRAWING NUMBER
4.4.3.15	Pin interface			12550838
				NEXT HIGHER ASSEMBLY
				12550830
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Material thickness D	(a)	3.2	Gage
102	Smaller pin width E	(a)	3.2	Gage
103	Smaller pin location E	(a)	3.2	Gage
104	Large pin width -C-	(a)	3.2	Gage
105	Large pin width F	(a)	3.2	Gage
106	Large pin location F	(a)	3.2	Gage
107	Solderability test	15 (b)	3.2	MIL-STD-2000
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.5
(b) Accept on 0 failure/reject on 1 or more failures.

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.16	LCD housing assembly	1 OF 1	12550860
			NEXT HIGHER ASSEMBLY: 12550800

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major	None defined			
Minor 201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.17	Housing, LCD	1 OF 1	12550861

NEXT HIGHER ASSEMBLY: 12550860

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Overall part width -B-	(a)	3.2	Gage
102	Length of shoulder F	(a)	3.2	Gage
103	Cavity depth G	(a)	3.2	Gage
104	Flash not permitted per note 11 H	(a)	3.2	Gage
105	Body flange -D-	(a)	3.2	Gage
106	Location of width of two small slots J	(a)	3.2	Gage
107	Width of two small slots J	(a)	3.2	Gage
108	Location of length of two small slots J	(a)	3.2	Gage
109	Length of two small slots J	(a)	3.2	Gage
110	Height of two small slots J	(a)	3.2	Gage
111	Width across two small slots J	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.18	Bushing, guide	1 OF 1	12550862
			NEXT HIGHER ASSEMBLY: 12550860

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	No flash per note 4 C	(a)	3.2	Visual
102	Diameter of thru hole C	(a)	3.2	Gage
103	Location of thru hole C	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.19	Bezel, liquid crystal display	1 OF 1	12550872
			NEXT HIGHER ASSEMBLY: 12550870

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major	None defined			
Minor				
201	Length to snap features D	(a)	3.2	Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.20	Battery pack assembly	1 OF 1	12550880
			NEXT HIGHER ASSEMBLY: 12551000

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major	None defined			
Minor				
201	Battery assembly compression check [A]	Level V	3.2	Visual/Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.21	Housing, battery	1 OF 1	12550881

NEXT HIGHER ASSEMBLY: 12550880

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Overall length D	(a)	3.2	Gage
102	Overall width F	(a)	3.2	Gage
103	Profile of Depth and width of notch F	(a)	3.2	Gage
104	Overall length G	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.22	Battery assembly	1 OF 1	12550890
			NEXT HIGHER ASSEMBLY: 12550880

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Voltage and resistance test	100%	3.9.3	4.6.1.7
102*	Weld pull test (destructive test)	(a)	3.2	4.6.2.2
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) Three (3) sample per lot.
* See 4.9

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.23	Insulator, battery	1 OF 1	12550892
			NEXT HIGHER ASSEMBLY: 12550890

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Dimensions across ribs [C]	(a)	3.2	Gage
102	Flange thickness [D]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.24	Contact, negative	1 OF 1	12550893
			NEXT HIGHER ASSEMBLY: 12550890

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Location of spoke center [C]	(a)	3.2	Gage
102	Size of spoke center [C]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1	DRAWING NUMBER
4.4.3.25	Support, battery			12550894
				NEXT HIGHER ASSEMBLY
				12550890
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Thickness of bottom [C]	(a)	3.2	Gage
102	Diameter across ribs [D]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.26	Safe and arm assembly	1 OF 1	12550900
			NEXT HIGHER ASSEMBLY: 12551000

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Special				
a	Actuator, piston resistance	100%	3.9.4.a	4.6.1.4
b	Detonator, electrical per note 4G	100%	3.9.4.f	4.6.1.5
c	Resistance check across battery primer	100%	3.9.4.e	4.6.1.9
d	Resistance check across detonator electrical socket and ground	100%	3.9.4.d	4.6.1.8
Major				
101	Setback lock missing [A]	100%	3.2	Visual/Gage
102	Spin lock missing [B]	100%	3.2	Visual/Gage
103	Shear pin of slider assembly missing [C]	100%	3.2	Visual/Gage
104*	Setback lock and spin lock, lock/unlock condition	Level IV	3.3.3	4.6.2.3
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

* See 4.9

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.27	Housing, Safe and Arm	1 OF 1	12550901
			NEXT HIGHER ASSEMBLY: 12550900

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Finish of large cavity wall and floors [F]	(a)	3.2	Gage
102	Length of large cavity to centerline [G]	(a)	3.2	Gage
103	Radius of large cavity from centerline [H]	(a)	3.2	Gage
104	Width of large cavity [J]	(a)	3.2	Gage
105	Thru slot width [K]	(a)	3.2	Gage
106	Raised slot width [L]	(a)	3.2	Gage
107	Width of small cavity [M]	(a)	3.2	Gage
108	Height from cavity wall to raised shelf [N]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.28	Lock, spin	1 OF 1	12550902
			NEXT HIGHER ASSEMBLY: 12550900

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	No flash on surface indicated [C]	(a)	3.2	Visual
102	Shear test (destructive) [D]	(b)	3.2	Gage
103	Greatest overall width [E]	(a)	3.2	Gage
104	Greatest overall height [F]	(a)	3.2	Gage
Minor				
201	Protective finish per note b	(a)	3.2	Visual
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4
(b) Three (3) samples per lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.29	Spring, spin lock	1 OF 1	12550903
			NEXT HIGHER ASSEMBLY: 12550900

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major 101	Confirm spring force per note 6 [A]	(a)	3.2	Gage
Minor 201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.30	Lock, slider	1 OF 1	12550904
			NEXT HIGHER ASSEMBLY: 12550900

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Size of hole [D]	(a)	3.2	Gage
102	Location of hole [D]	(a)	3.2	Gage
Minor				
201	Leg angle [E]	(a)	3.2	Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.31	Cover, safe and arm	1 OF 1	12550908
			NEXT HIGHER ASSEMBLY: 12550900

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major	None defined			
Minor				
201	Thickness D	(a)	3.2	Gage
202	Greatest diameter -B-	(a)	3.2	Gage
203	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.32	Insulator, piston actuator	1 OF 1	12550909
			NEXT HIGHER ASSEMBLY: 12550900

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major 101	Hole diameter [D]	(a)	3.2	Gage
Minor 201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.33	Lock, setback	1 OF 1	12550911
			NEXT HIGHER ASSEMBLY: 12550910

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Thru hole diameter [E]	(a)	3.2	Gage
102	Shear test [F]	(b)	3.2	Gage
Minor				
201	No flash where indicated [G]	(a)	3.2	Gage/Gage
202	Protective finish per note 11	(a)	3.2	Visual
203	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

(b) Three (3) sample per lot.

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.34	Spring, setback lock	1 OF 1	12550912
			NEXT HIGHER ASSEMBLY: 12550910

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Diameter of wire [A]	IV	3.2	Gage
102	Direction of helix [B]	IV	3.2	Visual
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE		DRAWING NUMBER
4.4.3.35	Slider assembly	SHEET 1 OF 1	12550920
			NEXT HIGHER ASSEMBLY: 12550900

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Detonator resistance after insertion	100%	3.9.4.b	Gage
102	Shear pin missing	100%	3.2	Visual/Gage
103	Detonator and sleeve above slider surface	100%	3.2	Visual/Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.36	Slider, S&A	1 OF 1	12550921
			NEXT HIGHER ASSEMBLY: 12550920

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Insufficient shear pin strength [E]	(a)	3.2	Gage
102	Width of part [F]	(b)	3.2	Gage
103	Height of part [G]	(b)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) Three (3) samples per lot.
(b) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.37	Insulator, slider	1 OF 1	12550922
			NEXT HIGHER ASSEMBLY: 12550920

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Height of rails [D]	(a)	3.2	Gage
Minor				
201	Diameter of short bosses [E]	(a)	3.2	Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.38	Contact plate, detonator	1 OF 1	12550923
			NEXT HIGHER ASSEMBLY: 12550920

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Contact width [D]	(a)	3.2	Gage
102	Finger width [E]	(a)	3.2	Gage
103	Finger location [E]	(a)	3.2	Gage
Minor				
201	Through hole diameter [-B-]	(a)	3.2	gage
202	Through location [-B-]	(a)	3.2	Gage
203	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.39	Contact plate, piston actuator	1 OF 1	12550924
			NEXT HIGHER ASSEMBLY: 12550920

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Finger width [D]	(a)	3.2	Gage
102	Finger location [D]	(a)	3.2	Gage
Minor				
201	Hole diameter [-B-]	(a)	3.2	Gage
202	Hole location [-B-]	(a)	3.2	Gage
203	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.40	Contact, sleeve, detonator	1 OF 1	12550925
			NEXT HIGHER ASSEMBLY: 12550920

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Inside diameter across ribs [C]	(a)	3.2	Gage
102	Length [D]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.41	Housing assembly	1 OF 1	12550940

NEXT HIGHER ASSEMBLY: 12551000

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Incorrect lens adhesive application per note 2 and 3 [A]	Level IV	3.2	Visual
102	Button washer missing per note 6 [B]	Level IV	3.2	Visual
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.42	Housing, fuze	1 OF 1	12550941
			NEXT HIGHER ASSEMBLY: 12550940

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Zone of surface finish [F]	(a)	3.2	Gage
102	Third inside diameter [C]	(a)	3.2	Gage
103	Size of smallest diameter along axis of Housing [H]	(a)	3.2	Gage
104	Location of smallest diameter along axis Housing [H]	(a)	3.2	Gage
105	Diameter across wrench flats	(a)	3.2	Gage
106	Protective finish per note 15	(a)	3.2	Visual
107	Pitch diameter of threads [K]	(a)	3.2	Gage
108	Location of threads [K]	(a)	3.2	Gage
109	Largest inside hole diameter [L]	(a)	3.2	Gage
110	Radius of ribs Datum [-B-]			
Minor				
201	Lens area length [M]	(a)	3.2	Gage
202	Lens area width [M]	(a)	3.2	Gage
203	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.43	Lens, liquid crystal display	1 OF 1	12550942
			NEXT HIGHER ASSEMBLY: 12550940

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Optical quality per note 6 [D]	Level IV	3.2	Visual
Minor				
201	Flange profile [E] and [-A-]	(a)	3.2	Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.44	Washer, button	1 OF 1	12550944
			NEXT HIGHER ASSEMBLY: 12550940

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major	None defined			
Minor				
201	Outer diameter C	(a)	3.2	Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.45	Button, Level advance	1 OF 1	12550945

NEXT HIGHER ASSEMBLY: 12550940

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	No flash where indicated [D]	(a)	3.2	Visual
102	Largest diameter [E]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.46	Retainer, button	1 OF 1	12550946
			NEXT HIGHER ASSEMBLY: 12550940

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Diameter over serrations C	(a)	3.2	Gage
102	Protective finish per note 9	(a)	3.2	Visual
103	Size of smallest diameter -B-	(a)	3.2	Gage
104	Flash per note 4	(a)	3.2	Visual
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.47	End cap assembly	1 OF 1	12550960
			NEXT HIGHER ASSEMBLY: 12551000

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Improper lead orientation per note 2 [A]	Level III	3.2	Visual
Minor				
201	Improper lead push out force (Destructive) per note 3 [B]	(a)	3.2	Gage
202	Foil seal missing per note 4 [C]	Level IV	3.2	Visual
203	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) Three (3) samples per lot.

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.48	Cap, end	1 OF 1	12550961
			NEXT HIGHER ASSEMBLY: 12550960

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Location of intermediate cavity [B]	Level IV	3.2	Gage
102	Diameter of intermediate cavity [B]	Level IV	3.2	Gage
103	Location of small cavity [C]	Level IV	3.2	Gage
104	Diameter of small cavity [C]	Level IV	3.2	Gage
105	Location of large cavity [D]	Level IV	3.2	Gage
106	Diameter of large cavity [D]	Level IV	3.2	Gage
107	Pitch diameter [-A-]	Level IV	3.2	Gage
108	Major diameter [E]	100%	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.49	Foil seal, end cap	1 OF 1	12550962
			NEXT HIGHER ASSEMBLY: 12550960

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major 101	Holes in material [A]	Level IV	3.2	Visual
Minor 201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.50	Stab assembly	1 OF 1	12550970
			NEXT HIGHER ASSEMBLY: 12551000

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Total length, max. [A]	Level IV	3.2	Gage
102	Compression spring missing [B]	Level IV	3.2	gage
Minor				
201	Depth of block pin, min. [C]	Level IV	3.2	Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.51	Rod, actuating	1 OF 1	12550971
			NEXT HIGHER ASSEMBLY: 12550970

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Thickness [A]	(a)	3.2	Gage
102	Straightness (note 5) [A]	(a)	3.2	Gage
103	Overall length [B]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.52	Block, stab	1 OF 1	12550972
			NEXT HIGHER ASSEMBLY: 12550970

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Large inside diameter D	(a)	3.2	Gage
102	Small inside diameter E	(a)	3.2	Gage
103	Overall depth of small diameter F	(a)	3.2	Gage
104	No flash where indicated per note 12	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

77

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.53	Pin, stab	1 OF 1	12550977
			NEXT HIGHER ASSEMBLY: 12550970

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Shoulder to point [D]	Level IV	3.2	Gage
102	Point [C]	Level IV	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.54	Ogive	1 OF 1	12550981
			NEXT HIGHER ASSEMBLY 12550980

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Large diameter C	(a)	3.2	Gage
102	Intermediate diameter D	(a)	3.2	Gage
103	Intermediate diameter -B-	(a)	3.2	Gage
104	Shoulder length E	(a)	3.2	Gage
105	Compression test to failure per note 12 F	(b)	3.2	4.6.2.1
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4
(b) Three (3) samples per lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1	DRAWING NUMBER
4.4.3.55	Battery primer assembly			12550990
				NEXT HIGHER ASSEMBLY
				12551000
CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Resistance of battery primer assembly	100%	3.9.4.c	4.6.1.6
Minor				
201	Incorrect seating of contact per note 2 [A]	Level V	3.2	Gage
202	Incorrect seating of battery primer per note 3 [A]	Level V	3.2	Gage
203	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.56	Block, battery primer	1 OF 1	12550992
			NEXT HIGHER ASSEMBLY: 12550990

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Diameter of larger inner radius [D]	(a)	3.2	Gage
102	Diameter of smallest radius [E]	(a)	3.2	Gage
Minor				
201	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:
(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.57	Contact, battery primer	1 OF 1	12550993
			NEXT HIGHER ASSEMBLY: 12550990

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Leg width [A]	(a)	3.2	Gage
Minor				
201	Small radius [B]	(a)	3.2	Gage
202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.5

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.58	Fuze assembly M762	1 OF 1	12551000
			NEXT HIGHER ASSEMBLY: FINAL

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Liquid crystal display not blank	100%	3.2	Visual/Gage
102	End cap assembly depth	100%	3.2	Gage
103	Hatch mark of housing not aligned within a rib of ogive	100%	3.2	Visual/Gage
104	Incorrect installation of S&A and cushion	100%	3.2	Visual/Gage
105	Incorrect torque on end cap	100%	3.2	Gage
106	O-ring missing	Level IV	3.2	Visual/Gage
107	Large outside threads damaged	100%	3.2	Visual
Minor				
201	Foil seal damaged	Level V	3.2	Visual/Gage
202	Marking incorrect or illegible	Level V	3.2	Visual/Gage
203	Total fuze length	Level V	3.2	Gage
204	Improper application of adhesive on end cap per note 3	Level V	3.2	Visual/Gage
205	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

AMSMC Form 1570b-E, 1 Jul 89 Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.59	Fuze assembly M767 less booster	1 OF 1	12551001
			NEXT HIGHER ASSEMBLY: 12550850

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	End cap assembly depth	100%	3.2	Gage
102	Liquid crystal display not blank	100%	3.2	Visual/Gage
103	Major diameter of small outside threads	100%	3.2	Gage
104	Pitch diameter of small outside threads	100%	3.2	Gage
105	Hatch mark of housing not aligned within a rib of ogive	100%	3.2	Visual/Gage
106	Incorrect torque on end cap	100%	3.2	Gage
107	Incorrect installation of S&A and cushion	100%	3.2	Visual/Gage
108	O-ring missing	Level IV	3.2	Visual/Gage
109	Large outside threads damaged	100%	3.2	Visual
Minor				
201	Marking incorrect or illegible	Level V	3.2	Visual/Gage
202	Total fuze length	Level IV	3.2	Gage
203	Improper application of adhesive on end cap	Level IV	3.2	Visual/Gage
204	Foil seal damaged	Level IV	3.2	Visual/Gage
205	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.60	Gear, stab actuator	1 OF 1	12551008
			NEXT HIGHER ASSEMBLY: 12551000/1001

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major 101	Shaft diameters -C- and -B-	(a)	3.2	Gage
Minor 201	Overall height of body D	(a)	3.2	Gage
Minor 202	Evidence of poor workmanship	Level V	3.11	Visual/Gage

NOTES:

(a) See 4.6.4

AMSMC Form 1570b-E, 1 Jul 89

Replaces AMSMC Form 1570, 1 Feb 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF CHARACTERISTICS

MIL-F-70823A (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.61	Other components- all component parts and assemblies not specifically listed in 4.4.3.1 through 4.4.3.62 shall be subjected to the following inspections.	1 OF 1	NEXT HIGHER ASSEMBLY

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Solderability test shall be performed on the following drawings: 12550831 Printed Wiring Board 12550837 Pin, Contact 12550842 Wire Electrical, Flat 12550931 Safe & Arm Contact Plate	15 Note (a)	3.2	MIL-STD-2000
102	Evidence of poor solder workmanship	100%	3.2	MIL-STD-2000

NOTES:

(a) Accept on 0 failure/reject on 1 or more failures per lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.3.62	Box, ammo, metal for artillery type and rocket fuzes (prior to closing)	1 OF 1	8864492
			NEXT HIGHER ASSEMBLY

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined			
Major				
101	Humidity indicator card missing	Level IV	3.2	Visual
102	Polyethylene cushion missing	Level IV	3.2	Visual
103	Barrier bag damage or not sealed	Level IV	3.2	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.4.4 Inspection equipment. The inspection equipment required to perform the inspections specified herein is identified in the "Inspection Method Reference" column of the Classification of Characteristics listings starting with 4.4.3.1. Contractor inspection equipment designs shall be submitted for Government approval as specified in the contract. Designs which provide variable measurements instead of attributes data are preferred in order to facilitate the use of statistical process control. See Section 6 of MIL-A-48078 and 6.4 herein.

4.5 Calibration and maintenance. All measuring and test equipment used by the contractor to perform the inspections herein shall be calibrated and maintained in accordance with MIL-STD-45662.

4.6 Methods of inspection.

4.6.1 Electrical tests.

4.6.1.1 PWB assembly tests (12550830).

a. Attach the following load simulations and switches to the assembly:

1. EED simulators.
   a. Three 3.9 ohm, 1%, 1/4 watt resistors from U2-1, 4, 5 to ground.
   b. The resistor simulating the piston actuator (U2-4 to Gnd) shall be removed from the circuit if latchup of SCR2 occurs. This resistor shall be removed from the circuit no greater than 1.0 milliseconds after the voltage level at U2-4 is equal to 0.2 +/- 10% volts following a positive voltage pulse at U2-4.

2. Spin switch simulator.
   Single pole double throw switch with common to U1-14 normally closed contact to ground, and normally open contact to U2-16 (battery positive).

3. Impact switch simulator.
   Connect a single pole single throw normally open switch from ground to U1-44.

4. Level advance/count advance simulators.
   Connect single pole single throw normally open switches from ground to U2-3 and U2-4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

5. VBAT simulator.
Connect a power supply positive lead to U2-16 and negative lead U2-2. The power supply shall be capable of supplying 0.0 volt to 3.0 volts ± 1% with resolution of 0.01 volt. the VBAT is normally at 0.0 volts unless indicated in TABLE VII.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VII Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient LL	Ambient HL	-60°F LL	-60°F HL	+155°F LL	+155°F HL
1.0 C1 Peak Voltage	a. VBAT off (U2-16=0.0V) b. Autoset per 10.0 c. Measure Peak Voltage at U2-20	9.9V	13.4V	10.3V	14.5V	9.6V	12.7V
2.0 C1 Risetime	a. VBAT off (U2-16=0.0V) b. Autoset per 10.0 c. 10% min. to 90% max. time at U2-20	4.0ms	16.0ms	12.0ms	22.0ms	3.0ms	15.0ms
3.0 BP Peak Voltage	a. Autoset per 10.0 b. Measure Peak Voltage U2-1 when BP fire pulse occurs	4.5V	9.7V	4.3V	10.6V	4.5V	9.0V
4.0 BP Energy	a. Autoset per 10.0 b. Integrate voltage pulse at U2-1 when BP fire pulse occur, calculate pulse energy to 0.20V	946ergs	2000ergs	1016ergs	2252ergs	942ergs	1734ergs
5.0 Battery Current, Spin Open	a. VBAT=3.0V (U2-16) b. Spin Switch set to unactivated position c. Measure average Battry Current.	N/A	143ua	N/A	159ua	N/a	143ua
6.0 Deleted							

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VII Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient		-60°F		+155°F	
		LL	HL	LL	HL	LL	HL
7.0 Oscillator Frequencies	a. VBAT=3.0V (U2-16) b. Tset=000.5 sec accordance 9.0 or 10.0 c. Activate Spin Switch(U2-19 connected to U2-16) d. Wait 0.10-0.20 or 0.4-0.5 seconds e. Pull Remote Data Line(U1-18) to ground. f. Pull Level Advance(U1-3) and Count Advance(U1-4) to ground g. Measure oscillator 1 frequency at U1-19. h. Open Count Advance(U1-4) i. Measure oscillator 2 frequency at U1-19	163.800KHz	163.888KHz	163.700KHz	163.905KHz	163.700KHz	163.905KHz
8.0 Initialize for setting	a. VBAT=3.0V(U2-16) b. Check for all LCD segments on c. Toggle Level Advance(U1-3) to ground for 125ms±10ms d. Check LCD on for only Lx, Ly (Underline) on e. Toggle Level Advance(U1-3) to ground for 125ms±10ms f. Check LCD displays 000.0 g. Toggle Level Advance(U1-3) to ground once. Toggle Level Advance to ground again and hold Level Advance at ground h. Toggle Count Advance(U1-4) to ground for 125ms± 10ms i. Release Level Advance j. Check LCD displays 001.0		N/A		N/A		N/A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VII Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient		-60°F		+155°F	
		LL	HL	LL	HL	LL	HL
9.0 Set - Manual	a. VBAT=3.0V b. Toggle Level Advance(U1-3) to ground for 125±10ms twice to initialize for setting c. Toggle Count Advance(U1-4) to ground for 125±10ms to advance digit count while holding Level Advance(U1-3) down		N/A		N/A		N/A
10.0 Set - Inductive	a. See 12550753 " Inductive Set Requirements for M762 Fuze"						
11.0 PA and Det Times, Peak Voltages, & Energies - Time Set	a. VBAT=3.0V(U2-16) b. Tset to a valid time setting c. Activate Spin Switch (U2-19 connect to U2-16).						
	d. Measure time from Spin Switch activation to PA pulse rising edge (Tpa)	Tset-50ms±0.4% at all temps					
	e. Measure peak voltage at TPA at pin U2-4	1.2V	2.5V	1.10V	2.5V	1.2V	2.5V
	f. Integrate PA voltage wave form at U2-4 and calculate PA Energy to 0.2V	815ergs	2345ergs	700ergs	2345ergs	1000ergs	2345ergs
	g. Measure time from spin switch activation to Det pulse rising edge (Tdet) at U2-5	Tset±0.4% at all temps					
	h. Measure peak voltage at Tdet at pin U2-5	1.2V	2.5V	1.1V	2.5V	1.2V	2.5V

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VII Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient LL	Ambient HL	-60°F LL	-60°F HL	+155°F LL	+155°F HL
11.0 PA and Det Times, Peak Voltages,& Energies -Time set(Cont'd)	i. Integrate Det voltage wave form at U2-5 and calculate detonator energy to 0.2V	850ergs	2345ergs	700ergs	2345ergs	960ergs	2345ergs
	j Measure U2-5 Voltage at Tdet+300us	0.5V	1.0V	0.4V	0.9V	0.5V	1.0V
12.0 PA and Det Times - Impact Set	a. VBAT=3.0V (U2-16)						
	b. Tset to PD(Deta 98.0) per 9.0 or 10.0						
	c. Close Spin Switch (U2-16 shorted to U2-19)						
	d. At Tspin+1.05 sec.,-0, +10ms, close Impact Switch(U1-44) to Ground.						
	e. Measure time from spin closure to PA pulse occurrence (U2-4)	0.450 sec ±0.06% at all temp					
	f. Measure time from spin closure to Det pulse occurrence(U2-5)	1.0sec.	1.1sec.	1.0sec.	1.1sec.	1.0sec.	1.1sec.
13.0 Invalid Set Time Tset	a. VBAT=3.0V(U2-16)						
	b. Test per 9.0 or 10. to 000.4						
	c. Close Spin Switch.						
	d. Monitor PA(U2-4) and Det(U2-5) for 500ms. No pulses should occur.						
	e. Check Dud Latch per 18						
14.0 Short Spin Switch	a. Close Spin Switch						
	b. VBAT=3.0V						
	c. Set to 0.5 sec. per 9.0 or 10.0						
	d. Monitor PA and Det for 500ms for pulse occurrence. No pulses should occur.						

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VII Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient		-60°F		+155°F	
		LL	HL	LL	HL	LL	HL
15.0 Early Impact Closure	a. VBAT=3.0V b. Set to Delta 98.0 per 9.0 or 10.0 c. Close Spin Switch d. Wait 0.2 sec e. Close the Impact Switch f. Monitor PA and Det for 500ms for pulse occurrence. No pulses should occur.						
16.0 POR Voltage	a. Increase VBAT in 0.1V steps while monitoring BP1(U1-28) and BP2(U1-26) b. Record VBAT when BP1 or BP2 crosses 2.0V	1.2V	2.2V	1.4V	2.3V	1.1V	1.8V
17.0 Fast Clock	a. VBAT=3.0V b. Tset to 199.9 sec. using 9.0 or 10 c. Close Spin Switch d. Wait 0.552-0.553 seconds e. Open Spin Switch f. Switch Remote Data(U1-18)to ground g. Apply to 1994 square wave pulses to the Impact Input(U1-44) at a 150KHz maximum frequency h. Test that the fire Line(U1-23) is low. i. Apply one square wave pulse, 10us minimum duration, to the Impact Input(U1-44) j. Test that the Fire Line(U1-23) is high						

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VII Electrical test parameter definitions

Parameter	Measurement Conditions		Ambient LL	Ambient HL	-60°F LL	-60°F HL	+155°F LL	+155°F HL
18.0 Dud Latch Clock	a. Pull remote Data (U1-18) to ground b. Pull Level Advance(U1-3) and Count Advance(U1-4) to Ground c. Monitor Talkback Line(U1-19) for presence of crystal frequency: if none, Duch Latch is set.							
19.0 Backplane Voltage Check	a. VBAT=3.0V b. Check voltage Levels of BP1 & BP2 at Max, Mid and Min levels.	MAX MID MIN	1.2V 1.5V -0.4V	5.0V 2.5V 0.5V	3.4V 1.5V -0.4V	5.0V 2.5V 0.5V	3.0V 1.5V -0.4V	5.0V 2.5V 0.5V
20.0 Startup Time	a. VBAT=3.0V(U2-16) b. Delay time depending on the test temperature: 1. Ambient-410ms 2. -60°F=1.13sec. 3. +160°F=260ms c. Measure frequency of BP1(U1-28) d. Measure frequency of BP2(U1-26)		39Hz	41Hz	39Hz	41Hz	39Hz	41Hz
21.0 EA/Fuze Housing	a. Check resistance between gound and the Housing Assembly		0	0.15ohm	N/A	N/A	N/A	N/A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

TABLE VII Electrical test parameter definitions

Parameter	Measurement Conditions	Ambient		-60°F		+155°F	
		LL	HL	LL	HL	LL	HL
22.0 Impact Rise Time Closure	a. VBAT=3.0V b. Connect Impact Switch (U1-44) to ground c. Disconnect Impact Switch(U1-44) from ground, measure rise time of U1-44 from 0.3 to 2.7 volt. f. Monitor PA and Det for 500ms for pulse occurrence. No pulses should occur.	19.3us	28.1us	16.3us	30.1us	16.3us	30.1us

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

b. Ambient tests.

Perform the following tests from TABLE VII:

Parameter No.	Title
1	C1 Peak Voltage
2	C1 Risetime
3	BP Peak Voltage
4	BP Energy
5	Battery Current, Spin Open
8	Initialize for Setting
9	Set-Manual
10	Set-Inductive
11	PA/Det Times, Energies
12	PA/Det Times-Impact Set
13	Invalid time Set
14	Shorted Spin Switch
15	Early Impact Closure
16	POR Voltage
17	Fast Clock
19	Backplane Voltage Check
22	Impact Risetime

Note: Fast clock per parameter 17 of TABLE VII may be used for the above testing.

c. Temperature tests.

The following tests are to be performed with the fuze assembly conditioned to -60 degrees F and +155 degrees F (both ± 10 degrees F) for a time sufficient to allow CMOS IC, PN 12550834 in the assembly to reach the conditioning temperature.

Parameter No.	Title
3	BP Peak Voltage
4	BP Energy
5	Battery Current, Spin Open
8	Initialize for Setting
10	Set Inductive
11	PA/DET Times Energies
13	Invalid Time Set
14	Shorted Spin Switch
15	Early Impact Closure
20	Startup Time (cold temperature only)
22	Impact Risetime

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

Note: Fast clock per parameter 17 of TABLE VII may be used for the above testing.

d. The tests from TABLE VII may be combined within b and c and measured within a simulated fuze mission or portions of a mission, as long as the specified parameters for each individual test are measured.

4.6.1.2 Inductive coil assembly tests.

a. Measure the coil inductance of shielded coil assembly in accordance with Drawing 12550810.

b. Measure the coil Q of shielded coil assembly in accordance with Drawing 12550810.

4.6.1.3 Level II assembly tests.

a. Attach the following load simulations and switches to the assembly prior to installation of the spin switch.

1. EED simulators

   a. Three 3.9 ohm, 1%, 1/4 watt resistors from TP3, 16 and 17 to TP14 (ground).
   b. The resistor simulating the piston actuator (TP17 to Gnd) shall be removed from the circuit if latchup of SCR2 occurs. This resistor shall be removed from the circuit no greater than 1.0 milliseconds after the voltage level at TP17 is equal to 0.2 +/- 10% volts following a positive voltage pulse at TP17.

2. Spin switch simulator
   Connect a single pole double throw switch with common to TP13 normally closed contact to TP14, and normally open contact to TP4 (Battery positive).

3. Impact switch simulator
   Connect a single pole single throw normally open switch from TP18 to TP14.

4. Level advance/count advance simulators
   Connect single pole single throw normally open switches from TP14 to TP19 and TP20.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

5. VBAT simulator
Connect a power supply positive lead to TP4 and negative lead to TP14. The power supply shall be capable of supplying 0.0 volts to 3.0 volts ± 1% in 0.01 volt increments. VBAT is normally at 0.0 volts unless indicated in TABLE VII. After each test is completed, VBAT shall be returned to 0.0 volts.

6. Perform the following tests at ambient from TABLE VII:

Parameter No.	Title
3	BP Peak Voltage
5	Battery Current, Spin Open
8	Initialize for Setting
11	PA/Det Times, Energies Impact Set
13	Invalid Time Set
14	Shorted Spin Switch
21	EA/Fuze Housing

The TABLE VII tests may be combined and measured within a simulated fuze mission or portions of a mission as long as the specified parameters for each set are measured.

b. Spin switch closure/nonclosure. The spin switch shall meet the closure requirements of Drawing 12550800 when monitoring Test Point 13. The test method may use techniques to simulate rotational forces.

c. Level advance switch closure. After Level II assembly (12550800) has been assembled into fuze housing assembly (12550940), with 3.0 volts applied between Test Point 4 and Test Point 14, and with the level advance switch not depressed, the voltage measured at Test Point 20 shall be a minimum of 2.85 volts. With the switch closed, the Test Point 20 voltage shall be .05 volts maximum.

d. Count advance switch closure. After Level II assembly (12550800) has been assembled into fuze housing assembly (12550940), with 3.0 volts applied between Test Point 4 and Test Point 14, and with the digit advance switch not depressed, the voltage measured at Test Point 19 shall be a minimum of 2.85 volts. With the switch closed, the Test Point 19 voltage shall be .05 volts maximum.

4.6.1.4 Actuator, piston resistance. The resistance of the PA shall be in accordance with Drawing 12550900 when using a meter

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

supplying no more than 1.0 ma through the PA bridgewire.

4.6.1.5 Detonator, electric resistance. The resistance between the detonator electrode and the ground socket must be in accordance with Drawing 12550900 when using a meter supplying no more than 1.0 ma.

4.6.1.6 Battery primer resistance. The resistance between the pin and the contact shall be in accordance with Drawing 12550990 when using a meter supplying no more than 1.0 ma through the primer bridgewire.

4.6.1.7 Battery assembly (12550890) voltage and resistance.

a. Voltage: With a 500K ohm resistance across the cell, no more than .005 volts shall be measured at the cell terminals with a meter having a minimum one megohm input impedance.

b. Resistance: The batteries shall not measure less than one megohm resistance at the terminals.

4.6.1.8 Detonator electric socket contact to ground socket resistance. Measure the resistance between the detonator socket of the S&A assembly (12550900, note 4H) and the ground socket using a meter supplying less than 1 ma. The resistance shall measure greater than 10 megohms.

4.6.1.9 Battery primer socket to ground resistance. Measure the resistance between the S&A assembly battery primer socket (12550900, note 4H) and the ground socket using a meter supplying less than 1 ma. The resistance shall measure greater than 10 megohms.

4.6.2 Mechanical tests.

4.6.2.1 Ogive compression test. The ogive shall be tested by applying a compressive force as indicated on Drawing 12550981. The cross head speed shall be 0.05 inch/minute. The measurement instrument must have an accuracy of at least ± 0.2% of full scale for force and speed of travel. The ogive must fail in compression as specified in 12550981.

4.6.2.2 Battery weld pull test. The weld strength of the battery assembly (12550890), shall be tested to ensure weld bond integrity during gunfire. This directly relates to the weld strength of the terminal plate assembly (12550995) and the negative contact (12550893). These representative parts can be pull tested

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

in place of a battery assembly for safety reasons.

The welded assembly shall be placed in a fixture which supports the negative contact, (12550893). Force is then applied to the battery (12550985), or the representative terminal plate assembly (12550995). Care must be taken to apply force only to the battery or terminal plate and not to the negative contact (125509893). Force shall be applied by a system capable of measuring force up to 100 LB, in increments of 0.1 LB with an accuracy of 0.25% of full scale (each range), with the ability to maintain the maximum force applied. The weld must not separate completely at any force less than that shown on 12550890.

4.6.2.3 S&A lock/unlock test.

a. The spin lock shall not unlock from the slider assembly in accordance with Drawing 12550900. The test method may utilize Government approved techniques to simulate the spin forces.

b. With the setback lock initially depressed, the lock shall be tested in accordance with the requirements of Drawing 12550900. The test method may utilize Government approved techniques to simulate the setback forces.

4.6.3 Environmental. The following environmental tests shall apply to the applicable portion of TABLES I, II, III and IV (FAAS sequence), or TABLE V (Lot Acceptance Test Sequence).

4.6.3.1 Logistic vibration (safety and operational). The fuze shall be tested in accordance with ITOP-1-2-601, paragraph 4.1.1, Appendix B, TABLE B-1, Figures B1 through B21, with the exception that the power spectral density (PSD) values for lower frequency ranges in Figures B-1 through B-6 are clipped. The modified PSD values for the corresponding breakpoint frequencies in the figures shall be as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

ITOP 1-2-601 FIGURE	BREAKPOINT FREQ (Hz)	MODIFIED PSD VALUE
B1	5	0.001
B2	5	0.001
B2	9	0.001
B3	5	0.001
B4	5	0.001
B4	8	0.001
B5	5	0.001
B5	6	0.001
B5	7	0.001
B6	5	0.001
B6	6	0.001
B6	8	0.001

Note: A tolerance of ± 1 Hz is allowed when programming frequency breakpoints.

a. Hot operational/safety tests: +145 degrees F. (B1 through B21).

b. Cold operational tests: -45 degrees F. (B1 through B21).

c. Cold safety tests: -60 degrees F. (B1 through B21).

A ten (10) hour minimum preconditioning temperature soak is required for M762 packaged fuzes prior to the commencement of vibration testing at temperature. Following a change of test units, or the rotation of test units, the temperature in the vibration chamber must be restabilized at the specified test temperature before continuing with vibration testing.

The M762/M767 (less booster) E.T. Fuze must be safe to handle, store, transport and be launch and flight safe.

4.6.3.2 Twenty-eight day hot (hot safety and operational). The fuze shall be packaged 8 fuzes to an M2A1 ammunition can, two cans per box as described in Drawing 8861213, . The fuzes shall be subjected to 28 consecutive daily cycles of the temperature/relative humidity conditions specified in AR70-38, TABLES 2-3 for the hot safety test and TABLES 2-5 for the hot operational test:

a. Hot operational tests: TABLES 2-5 (Category B2), Storage and Transit Conditions, except if the test chamber temperature controller cannot be programmed top produce the required relative

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

humidities at each given temperature. Then it is acceptable if the relative humidity at each temperature in the cycle equals or exceeds the posted value, but does not exceed 80%.

b. Hot safety tests: TABLES 2-3, Storage and Transit Conditions (Category B3), except if the temperature chamber's controls cannot be programmed to produce the required relative humidities at each given temperature. Then it is acceptable if the relative humidity at each temperature in the cycle equals or exceeds the posted value but does not exceed 95% relative humidity.

4.6.3.3 Fourteen day humidity (cold safety and operational). The fuze shall be packaged 8 fuzes to an M2A1 ammunition can, two cans per box as described in Drawing 8861213, Revision AK. The fuzes shall be subjected to 14 consecutive daily cycles of the temperature/relative humidity conditions specified in AR70-38, TABLES 2-8 for the cold safety test and TABLES 2-7 for the cold operational test:

a. Cold operational tests: TABLES 2-7, Storage and Transit conditions.

b. Cold Safety Tests: TABLES 2-8, Storage and Transit conditions.

4.6.3.4 Tactical vibration (safety and operational). The fuze shall be tested in accordance with ITOP 1-2-601:

a. Hot operational/safety tests: TABLE C5, +145 degrees F.

b. Cold operational tests: TABLE C-4, -45 degrees F.

c. Cold safety tests: TABLE C-5, -60 degrees F.

A four (4) hour minimum preconditioning temperature soak is required for M762 bare fuzes prior to the commencement of vibration testing at temperature. Following a change of test units, the temperature in the vibration test chamber must be restabilized at the specified test temperature before continuing with vibration testing.

The fuze may be held in the threaded socket of a rigid vibration test fixture. Vibration exposure per fuze axis is intended to correspond to a transportation distance of 550 km, so that the total test time per axis shall be 20 to 25 minutes. Therefore, for any test phase, 4 to 5 minutes of testing are required, but not less than the time required to perform one

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

ascending frequency sweep.

4.6.3.5 Salt fog (safety and operational). The fuze shall be tested in accordance with MIL-STD-331, Test 107.1, paragraph 5.0, except fuze orientation to be 45 degrees (nose up) and 45 degrees (nose down). The following exposure times shall be used:

a. Hot/Cold Safety Tests: 96 hours.

b. Hot/Cold Operational Tests: 48 hours.

4.6.3.6 Seven foot drop - boxes (safety/operational). The fuze shall be tested in accordance with MIL-STD-331, Test T121, Figure 6, Notes 2 and 3, at the following test temperatures:

a. Hot safety/operational tests: +145 degrees F.

b. Cold safety tests: -60 degrees F.

4.6.3.7 Bounce loose cargo (safety/operational). The fuze shall be tested in accordance with ITOP 4-2-602, for Rough Handling Tests, per the first three paragraphs of paragraph 3.0, Appendix B of the ITOP, at the following temperatures:

a. Hot safety/operational tests: +145 degrees F.

b. Cold safety tests: -60 degrees F.

Bounce test shall be a packaged test consisting of M762 fuzes packaged in the can configuration (M2A1 ammunition box). For inspection purposes the packaging will not include sealed moisture barrier bags. The cans will be tested on a 3/16 in. to 3/8 in. thick steel plate securely fastened to the surface of the package tester.

The package tester will be preconditioned at test temperature for minimum of ten (10) hours prior to the commencement of testing. Testing will be conducted at five (5) minute intervals to allow inspection for component movement and to maintain test temperature. After each inspection, the test item will be reconditioned at temperature for a minimum of two (2) hours.

4.6.3.8 Seven foot drop - cans (safety/operational). The fuze shall be tested in accordance with MIL-STD-331, test T121, Figure 6, Notes 2 and 3, one drop per can, with test temperatures as follows:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

a. Hot safety/operational tests: +145 degrees F.

b. Cold safety tests: -60 degrees F.

4.6.3.9 Five foot drop - bare (safety/operational). The fuze shall be tested in accordance with MIL-STD-331, Test T121, Figure 6, first requirements, two drops per fuze, with test temperatures as follows:

a. Hot safety/operational tests: +145 degrees F.

b. Cold safety tests: -60 degrees F.

4.6.3.10 Pre-ballistic temperature conditioning. Fuzes shall be conditioned for a minimum of 18 hours prior to removal from the temperature chamber for firing according to the requirements of TABLES, I, II, III, IV and V. The test temperature shall be maintained at ± 5 degrees F. Time from removal to firing shall be less than 15 minutes.

4.6.4 Die check for cast and molded parts. Samples of at least three parts from each cavity shall be inspected in accordance with the applicable Classification of Characteristics and Tests paragraph to qualify a new or reworked cavity for use in production. Individual cavity identification must be provided. If any defective parts are found during qualification of the cavity due to a defective cavity, the cavity producing the defective part shall not be used in production. All cavities formerly removed from production because of a fault may, after reworking, be returned to production, providing they pass the qualification test. In addition, a minimum sample of one part from each cavity shall be inspected for each lot acceptance in accordance with the applicable Classifications of Characteristics Table. If the one piece sample passes the inspection, the contractor may proceed with the lot. This, however, does not relieve the contractor from ensuring that the entire lot is acceptable. If the one piece inspected fails the inspection of the Classification of Characteristics specified, the lot shall be rejected.

4.6.5 Die check for stamped parts. A sample of at least three parts from each die shall be inspected in accordance with the applicable Classification of Characteristics (see section 4.4). If any defective parts are found during qualification of the tool due to a defective tool, the tool producing the defective part shall not be used in production. All tools removed from production because of some fault may, after reworking, be returned to production, providing they pass the qualification test above. In

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

addition, a minimum sample of one part from each cavity shall be inspected for each lot acceptance in accordance with the applicable Classifications of Characteristics Table. If the one piece sample passes the inspection, the contractor may proceed with the lot. This, however, does not relieve the contractor from ensuring that the entire lot is acceptable. If the one piece inspected fails the inspection of the Classification of Characteristics specified, the lot shall be rejected.

4.7 Ballistic testing.

4.7.1 PD non-functioning. The fuze shall not function when impacting a six inch thick minimum CDX grade plywood (or marine grade plywood as an alternate) target set at a distance corresponding to the gun/tube/propellant/zone designations for non-functioning testing as indicated in TABLE V requirements.

4.7.2 PD functioning. The fuze shall function when fired into a six inch thick minimum CDX grade plywood (or marine grade plywood as an alternate) target set at a distance corresponding to the gun/tube/propellant/zone designations for functioning testing as indicated in TABLE II, III, IV or V requirements. Camera coverage shall be employed to observe fuze functioning.

4.7.3 Activation and setting. Time or PD activation and setting shall be performed manually or inductively so that 80% of the fuzes are activated and set manually, and 20% are activated and set inductively (round up test sample for manual set). Only one attempt shall be made to activate and set the fuze. Fuzes failing to activate or subsequent to activation fail to be set will be counted against the unsettable category.

4.7.4 Time set function. Fuze settings shall be photographed using an instant, self-processing camera. Three independent infrared sensing chronograph systems shall be used to measure time to burst. The timer shall be recorded from the chronograph counters to four decimal places. The three recorded time values for each round shall be averaged and rounded to the nearest 0.001 second according to the procedure in ASTM E29, paragraph 3.4, and recorded. If one time value is lost or considered invalid (see 4.7.5), the remaining two values shall be used. If a round fails to function in flight, observations shall be made to determine if the round functions on impact. A back up system of electronic clocks or stop watches shall also be employed and their measurements recorded to the nearest 0.01 second. These times averaged, rounded readings must be within the set time ± 0.3 second.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.7.5 Lost time. When a fuze is fired for an airburst function and is observed to have functioned, but a chronograph system used to determine the elapsed time to function fails for any reason to record the appropriate value, then an entry of lost time shall be used instead of any recorded value. The round shall be considered lost when the above occurs for 2 or more chronograph systems. (See 6.7.7).

4.8 Logistic vibration. A sample of thirty (30) M762/M767 (less booster) fuze assemblies with lead charge set in the shipping position shall be randomly selected from each lot and subjected to the Logistic Vibration Test specified in 4.6.3.1. Ten (10) fuzes shall be disassembled for examination per 4.8.1. If any fuze fails to meet the criteria of 4.8.1 the lot shall be rejected. If the fuzes are not found to be defective, then twenty (20) fuzes shall be forwarded to the proving grounds for ballistic testing in accordance with 4.7. After the third consecutive acceptable lot, twenty (20) M767 fuze assemblies with lead charges shall be used in lieu of thirty (30) fuzes. Ten (10) fuzes shall be disassembled for examination per 4.8.1. If any fuze fails to meet the criteria of 4.8.1 the lot shall be rejected. If the fuzes are not found to be defective, then ten (10) fuzes shall be forwarded to the proving grounds for ballistic testing in accordance with 4.7.

4.8.1 Logistic vibration test criteria. The M762/M767 less booster fuze assemblies with lead charge shall be subjected to the Logistic Vibration test in accordance with 4.6.3.1. After this test, ten (10) fuzes from the sample shall be randomly selected and disassembled to determine that the fuzes are safe. After disassembling the End Cap Assembly (12550960) and the Safe and Arm Assembly (12550900), the following criteria must be met as a minimum inspection requirements:

a. The resistance outlined in the test parameter 21 of TABLE VII shall be accepted.

b. No part of the explosive train shall be functioned.

c. The slider in the S&A shall be located and locked in the safe position by both safety features.

d. The setback lock and spin lock shall be secure and in the safe position.

e. The setback lock shall not be broken and the spin lock shall be secure and restrained by the spring lock.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

4.9 Statistical process control plan. As a minimum, SPC shall be applied to those processes which produce the characteristic identified in the Classification of Characteristics table by the "*" symbol. In addition, the contractor is advised to use SPC in order to reduce rework and scrap. The SPC plan shall include: a time-phased schedule for implementation of SPC; as a minimum, SPC techniques specified in ANSI Z1.1, Z1.2, and Z1.3; control audit procedures for validating the accuracy, adequacy and interpretation of control charts; the training program and qualification of personnel on SPC techniques; corrective actions; contractor's general policy for applying SPC along with goals and commitments regarding SPC; documents that are basis for contractors SPC program; applicable records pertaining to SPC; test/measurements equipment calibration and control; and the corrective action procedures to be used and actions to be taken upon statistical signal or an out of tolerance part. When SPC has a state of statistical control and the fuze conforms to final acceptance specification, the contractor may request for Government approval that sampling, except 100% electrical tests, be reduced or eliminated for acceptance purposes(See 6.10).

5. PACKAGING

5.1 Packaging.

5.1.1 Level A, B, and C. Packaging shall be in accordance with Drawing 8864492 and MIL-P-60412.

5.2 Packaging.

5.2.1 Level A. Packaging shall be in accordance with Drawing 8861213.

5.2.2 Level B and C. Packaging shall be in accordance with Drawing 8886458.

5.3 Marking.

5.3.1 Packaging, marking level, A, B and C. Packaging, Marking, Level A, B and C shall be in accordance with Drawing 8864492.

5.3.2 Packing, marking.

5.3.2.1 Level A. Packing, marking shall be in accordance with Drawing 8861213.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

5.3.2.2 Level B and C. packing, marking shall be in accordance with Drawing 8886458.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory).

6.1 Intended use. The components covered by this specification are intended for use in Artillery Systems.

6.2 Acquisition requirements. Acquisition documents must specify the following:

a. Title, number and date of this specification.

b. Issue of DODISS to be cited in the solicitation, and, if required, the specific issue of individual documents referenced (see 2.1.1)

c. Requirements for submission of first article sample.

6.3 Consideration of data requirements. The data requirements should be considered when this specification is applied on a contract, per Contract Data Requirements List, DD Form 1432

6.4 Submission of contractor inspection equipment design for approval. Submit copies of designs as required to: Commander, US Army ARDEC, ATTN: SMCAR-QAR-I, Picatinny Arsenal, New Jersey 07806-5000. This address will be specified in the Contract Data Requirements List, DD From 1423 in the contract.

6.5 Drawings. Drawings listed in Section 2 of this specification under the heading U.S. Army Armament Research, Development, and Engineering Center (ARDEC) may also include drawings prepared by, and identified as U.S Army Armament, Research and Development Command (ARRADCOM), Frankford Arsenal, Rock Island Arsenal or Picatinny Arsenal drawings. Technical data originally prepared by these activities is now under the cognizance of ARDEC.

6.6 Submission of alternative quality conformance provisions. All contractor proposed alternative quality conformance provisions will be submitted to the Government for evaluation/approval as directed by the contracting activities.

6.7 Definitions.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

6.7.1 Premature burst. A malfunction in which a fuze functions before the required safe separation distance (see 6.7.9) from the weapon. This includes functions in handling, loading and inside the barrel.

6.7.2 Early burst. A malfunction in which a fuze functions prior to set time minus four seconds but later than safe separation (see 6.7.9) . For a PD-set fuze, a function prior to impact but later than safe separation.

6.7.3 Dud. A malfunction in which a ballistically fired fuze does not function at all, except where impact occurs prior to 500 ms after muzzle exit in the PD mode or prior to set time plus 0.3 second.

6.7.4 Ballistic function. A function is defined as initiation of the output lead charge, normally resulting in initiation of the projectile. For determining reliability, a function is proper only if the proper response (detonation or expulsion) of the projectile results. For determining safety, any function of the output lead charge prior to T-4 in the time mode or prior to 400 ms in the PD mode shall be considered a safety failure, whether or not normal functioning of the projectile results.

6.7.5 Off time. A malfunction in which a time-set fuze functions later than set time minus four seconds, but not within ± .03 seconds of set time. Functions between set time minus four seconds and set time minus 0.3 seconds are early improper off times, and functions in the air later than set time plus 0.3 second are late improper off times.

6.7.6 Significant difference in chronograph. When the highest or lowest chronograph reading differs by more than 10 ms from the next closest chronograph reading, the first reading shall be disregarded. If the remaining two chronograph readings do not agree within 10 ms then all three will be disregarded and the data considered lost.

6.7.7 Lost time. Whenever, for any reasons, including 6.7.6, there are not two good chronograph readings for the function time, the time data shall be considered lots. This definition shall not be used to invalidate the results of a test round in which the observers report a malfunction (premature, early, off time, impact or dud). Stopwatch times are acceptable for cargo carrying projectiles for cargo ejection.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

6.7.8 Safe position. The safe position of an S&A assembly consists of a slider located in the safe position with an intact shear pin, the spin lock in position locking the slider, and setback lock in the slider. The detonator lead shall be shorted to ground.

6.7.9 Safe separation distance. The safe separation distance is the projectile flight distance covered in 400 calibers measured from muzzle exit.

6.7.10 Point detonating dud. A malfunction in which a point detonating (PD) set fuze tested in accordance with the requirement of 6.9 does not function on impact, where impact occurs after 500 ms from muzzle exit.

6.7.11 Gage. Any calibrated aide used to perform examination or tests called out in the Classification of Characteristics paragraphs.

6.7.12 Unsettable fuze. The fuze shall be considered unsettable if the following criteria are not met.

a. Fuze that fails to activate or subsequent to activation on the first attempt fails to meet any of the following procedures:

1. Manual set. Upon activation all display segments shall be on. The first depression of the level advance button shall result in a display of only the four underline and the decimal point. A second depression of the level advance button shall cause each digit to show a zero character, with the most significant digit underlined. Subsequent setting shall not indicate an out of sequence or invalid character or symbol.

2. Autoset. Following autoset activation, the fuze shall talkback in accordance with the Inductive Setting Requirement for M762/M767 ET Fuze (drawing 12550753).

b. Any change after intended fuze setting on the LCD display window prior to gun launch.

6.7.13 Special defect. A defect, other than Critical, that judgment and experience indicate may, depending upon the degree of variance from the design requirement:

a. Result in hazardous or unsafe conditions for individuals using, maintaining or depending upon the product, or

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

b. Prevent performance of the tactical function of major end item.

6.8 Submission of statistical process control plan. The contractor will submit a SPC plan to the contracting officer with a copy forwarded to ARDEC, Picatinny Arsenal, New Jersey 07806-5000, ATTN: SMCAR-QAR-I and SMCAR-AEF-F as specified in DD Form 1423.

6.9 QE and settings. QE and settings to be used in the ballistic tests shall fall within the following ranges for the applicable weapon systems:

WEAPON	ZONE	Setting (seconds)	QE (mils)
105mm	1	20.8	590
105mm	8	62.0	800
155mm	1	PD (◁98.0)	Direct fire
155mm	2	23.0	780
155mm	3	27.1	585
155mm	7	PD (◁98.0)	Direct fire
155mm	8	124.1	1170
8-Inch	1	34.4	1100
8-Inch	9	119.6	1100

Distances must be adjusted to achieve a minimum of 0.55 second flight time, except for non-functioning PD testing. Fuzes must not function prior to 0.50 second flight time.

6.10 Guidelines for request to use SPC for reducing sampling or for acceptance. In the request, the contractor shall supply sufficient history (6-12 months) and data to meet the following criteria:

a. The product meets the TDP requirements.

b. The process is continuously in a state of control.

c. The Cpk value is not less than 1.33.

d. The center line of the Xbar chart is maintained in a desired interval.

e. An effective audit system is established between the contractor and the Government such that all tasks specified in the SPC plan can be monitored and audited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

If attribute data is used in the SPC Plan sufficient data and yield information for a minimum of 6 months production must be supplied.

6.11 Fuze autosetting. Fuze autosetting systems for ballistic test purposes shall be Government Furnished Equipment (GFE).

6.12 Subgroup. For sequential environmentally condition fuzes, each code number listed in TABLE I-C is a subgroup. For lot acceptance and First Article reliability testing, each different test configuration (including temperature) shall be considered a subgroup.

6.13 Subject term (key word) listing.

Ballistic Function
Dud
Early Burst
Lost Time
Off Time
Premature Burst
Safe Position
Safe Separation Distance

6.14 Change from previous issue. Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extensiveness of the changes.

Custodian:
Army-AR

Preparing activity:
Army-AR

(Project 1390-0817)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given.
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form.

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

I RECOMMEND A CHANGE:	1. DOCUMENT NUMBER	2. DOCUMENT DATE (YYMMDD)
	MIL-F-70823A (AR)	940602

3. DOCUMENT TITLE: FUZE, ELECTRONIC TIME, M762 LOADING, ASSEMBLING AND PACKING AND FUZE, ELECTRONIC TIME, M767 LESS BOOSTER

4. NATURE OF CHANGE (Identify paragraph number and include proposed rewrite, if possible. Attach extra sheets if needed.)

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a. NAME	b. TELEPHONE (Include Area Code)	
U.S. ARMY ARDEC STANDARDIZATION OFFICE	(1) Commercial 201-724-6675	(2) AUTOVON DSN-880-6675
c. ADDRESS (Include Zip Code) ATTN: SMCAR-BAC-S PICATINNY ARSENAL, NJ 07806-5000	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT: Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:30Z
Check the source to verify that this is the current version before use.