MIL-J-82133A(MC)
12 December 1972
SUPERSEDING
MIL-J-82133(MC)
10 November 1966

MILITARY SPECIFICATION

JACKET, WOMAN'S: MESS DRESS (OFFICER'S)

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for a white mess jacket.

1.2 Classification. The jacket shall be of one type in the following sizes as specified (see 6.2):

Schedule of sizes

Short	Regular	Long
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18
20	20	20

1.3 Individual orders. When jackets are custom tailored to an individual order, this specification shall govern, except the detail requirements of Table I may be modified to the extent necessary for good custom tailoring practice.

2. APPLICABLE DOCUMENTS

*2.1 The following documents of the issue is effect on the date of invitation for bids or request for proposal, form a part of the specification to the extent specified herein.

FSC 8410

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

V-T-276	- Thread, Cotton.
V-T-280	- Thread, Cotton, Gimp, Buttonhole.
V-T-285	- Thread, Polyester
V-T-301	- Thread, Silk.
CCC-C-438	- Cloth, Buckram, Cotton.
DDD-L-20	- Label, For Clothing, Equipage, And Tentage, (General Use).
DDD-T-86	- Tape, Textile, Cotton, General Purpose, (Unbleached, Bleached, Or Dyed).

MILITARY

MIL-C-368	- Cloth, Satin, Rayon And Cloth, Twill, Rayon.
MIL-B-3461	- Buttons, Insignia, Metal, Uniform And Cap.
MIL-C-15064	- Pads, Shoulder And Sleeve-Head.
MIL-B-17757	- Boxes, Fiber, Corrugated (Modular Sizes).
MIL-C-21115	- Cloth, Tropical, Wool, Polyester/Wool.
MIL-C-41820	- Cloth, Gabardine, Polyester And Rayon.

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods.
FED-STD-751	- Stitch, Seam, And Stitching.

MILITARY

MIL-STD-105	- Sampling Procedures And Tables For Inspection By Attributes.
MIL-STD-129	- Marking For Shipment And Storage.

(Copies of specifications and standards required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

*2.2 Other publications. The following document forms a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on date of invitation for bids or request for proposal shall apply.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification Rules

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

3. REQUIREMENTS

3.1 Samples. Samples are furnished solely for guidance and information to the supplier (see 6.3). Variation from this specification may appear in the sample, in which case the specification shall govern.

*3.2 First article. Unless otherwise specified (see 6.2), before production is commenced, a first article consisting of the number of finished jackets specified by the procuring activity (see 6.2) shall be submitted, or made available to the contracting officer or his authorized representative for approval. The approval of the first article authorizes the commencement of production, but does not relieve the supplier of responsibility for compliance with all provisions of this specification. The first article shall be manufactured by the supplier in the same facilities to be used for the manufacture of the production items.

3.3 Materials.

*3.3.1 Basic material. The basic material shall be cloth, gabardine, polyester and rayon, 6.0 ounces per square yard, white shade 2411 (see 6.3), conforming to type I, class 1, of MIL-C-41820.

*3.3.2 Lining. The material for lining the jacket and for making the hanger shall be cloth, twill, rayon, white shade 3001 (see 6.3), 3.7-ounce conforming to class 1 of MIL-C-368.

*3.3.3 Topcollar and undercollar. The material for the topcollar and undercollar shall be cloth, wool, tropical, 10.5-ounce, scarlet shade 2502 (see 6.3), conforming to type I, class 1 of MIL-C-21115.

*3.3.4 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram conforming to type I, class 2 of CCC-C-438. The cloth shall be dyed scarlet. The dyed fabric shall show good fastness to wet (dry) cleaning.

3.3.5 Thread.

*3.3.5.1 Silk thread. The silk thread shall be used for outside seaming and stitching, eyelets and collar, except breakline on undercollar, and shall conform to V-T-301. The thread for machine sewing shall conform to type I, size A for all outside seaming and stitching. The thread for hand sewing shall be type III, class 3, size C, 2-ply.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

*3.3.5.2 Cotton thread. The cotton thread shall conform to V-T-276, type IC2, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching of the collar and breakline on undercollar. The thread for basting shall be a good commercial grade.

*3.3.5.3 Polyester thread. The thread for machine sewing and stitching eyelets on shoulder straps and fronts, sewing buttons and hand felling jacket and machine sewing and stitching lining shall be white conforming to type I, class 1, subclass B, letter size A, 3-ply of V-T-285.

*3.3.5.4 Color and colorfastness. All thread for the collar shall be scarlet shade W, cable No. 66040 except cotton thread for basting, which may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good fastness to wet (dry) cleaning, and in addition, the silk thread shall show good fastness to light.

3.3.6 Gimp. The buttonhole gimp shall be cotton, white (bleached), soft or glazed finish conforming to type I or II, size 8 of V-T-280.

*3.3.7 Buttons. When specified (see 6.2), the buttons shall be uniform insignia buttons, metal, gold plated, officer's design, 27-line conforming to type I, style 3, class A, subclass 1 of MIL-B-3461. Ring type fasteners conforming to MIL-B-3461 shall be used for securing the buttons to the front of the jacket.

3.3.8 Tape. The tape for the breakline of the lapels and for the armholes shall be 1/4-inch wide conforming to type III, class 2 of DDD-T-86.

*3.3.9 Shoulder pads. The shoulder pads shall conform to the following requirements when tested as specified in Section 4, Table III.

3.3.9.1 Shoulder pad materials.

*3.3.9.1.1 Face. The face of the pads shall be white pressed felt consisting of wool and cotton, or wool, cotton and synthetic fibers thoroughly mixed and carded to produce a uniform and even blend which shall be well felted. The felt shall be smooth, free from tears, holes, lumps or foreign matter, and shall contain no loading materials such as starch, glue, or other sizing substances. The felt shall weigh 3 to 4 ounces per square yard, have minimum thickness of 0.030 inch, and shall contain not less than 35 percent wool, when tested as specified in Section 4, Table III.

3.3.9.1.2 Bottom cover. The bottom cover shall be bias cut from plain woven, unbleached cotton cheese cloth, weighing 2 to 2.5 ounces per square yard.

3.3.9.1.3 Interlining. The interlining material for the center of the pad shall be matted noils consisting of wool, or a mixture of approximately 90 percent wool and the remainder cotton or cotton and synthetic fibers.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*3.3.9.2 Shoulder pad construction. The matted noils shall be shingled on the cheese cloth in such a manner that proper graduation of thickness is produced in the finished pad, and the felt shall be placed on top. The assembled pad shall be basted with a straight stitch around the curved edge, approximately 1/2 inch from the edge. The body of the pad shall be zig-zag stitched in such a manner that in the finished half pads there shall be two rows of stitches across the width, and the top and bottom ends of the pad shall be stitched and backstitched in accordance with good commercial practice. The two rows of zig-zag stitches shall be approximately 3/4 inch apart with the outer row approximately 1-3/4 inches from the center of the tapered end of the pad. Each row of zig-zag stitching shall contain not less than six stitches and the stitching shall be controlled in order to form a concave shape effect in the finished pad. The pads shall be cut in half across the width. The finished half pad shall measure 11 ±1/4 inches in length along curved edge, 7-1/2 ±1/4 inches in length at the straight edge, 3-1/2 ±1/4 inches at the point of widest dimension, approximately 3/4-inch thick at the center of the straight edge tapering to approximately 1/8 inch at curved edge. Pads shall weigh 3/4 ounce per pair.

*3.3.10 Sleeve head wadding. The sleeve head wadding shall conform to type IV of MIL-P-15064.

*3.3.11 Labels. Each jacket shall have an identification and a size label as follows. The label shall show good fastness to dry cleaning.

*3.3.11.1 Identification label. The identification label shall conform to type I, class 1 of DDD-L-20 and shall measure not less than 2-1/2 by 1-1/2 inches. The content and format shall be as follows:

Nomenclature (Item description)
Contract Number
Name of contractor
Wool Products Act information

NOTE: Size of characters for name of contractor shall be minimum 8 point (approximately 3/32 inch).

*3.3.11.2 Size label. The size label shall conform to type I, class 2 of DDD-L-20 and shall measure not less than 1-1/2 inches by 1 inch. The label shall consist of the numercial size designation specified in 1.2 followed by the letters S, R, or L for Short, Regular and Long, and the stock number as shown by the following example.

$$\frac{14R}{\text{Stock Number}}$$

The stock number may be included on the identification label instead of on the size label.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*3.4 Design. The jacket shall be the U.S. Marine Corps design shown in Figures 1, 2 and 3, semiformfitting, fully lined, with two worked eyelets on each front for detachable buttons, designed to be worn open, with one button on each shoulder, bust darts, three-piece plain back, pointed ornamental sleeve cuffs, conventional collar with worked eyelets, notched collar lapels and shoulder straps with buttonholes.

3.5 Patterns. Standard patterns will be furnished to the supplier by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the supplier's working patterns. The supplier's working patterns shall be identical to the standard patterns. The standard patterns provide 3/16-inch allowance for seams at front edge of jacket and for shoulder straps; 3/4-inch allowance for side seams; 1/4-inch allowance for collar and collar joining seams and 3/8-inch allowance for all other seams, except as otherwise specified in Table I. Standard patterns show size, seam allowances, directional lines for cutting, and are marked or notched for proper placement and assembly of the component parts.

*3.5.1 List of pattern parts. The jacket shall be cut from the materials specified herein in accordance with the number of pattern parts indicated below:

Item	Pattern nomenclature:	No. of cut parts
	Material: Cloth, gabardine, polyester and rayon	
1.	Front	2
2.	Side, front	2
3.	Front, interlining	2
4.	Side front interlining	2
5.	Side back	2
6.	Center back	1
7.	Topsleeve	2
8.	Undersleeve	2
9.	Front facing	2
10.	Sleeve cuff	2
11.	Shoulder strap	4
	Material: Cloth, twill rayon	
12.	Front	2
13.	Side back	2
14.	Center back	1
15.	Topsleeve	2
16.	Undersleeve	2
17.	Underarm shield	4
18.	Eyelet reinforcement lining	2
	Material: Cloth, wool, tropical	
19.	Topcollar	1
20.	Undercollar (one piece)	1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Item	Pattern nomenclature:	No. of cut parts
	Material:: Cloth, buckram, cotton	
21.	Collar interlining	1
	Marker	
22.	Sleeve cuff marker	
23.	Collarstand marker	
	Shapers	
24	Undercollar shaper	
25.	Finished lapel shaper	
26.	Working lapel shaper	

3.6 Construction.

3.6.1 Manufacturing requirements. The jacket shall be manufactured in accordance with the operations and the stitch, seam, and stitching types specified in Table I.

3.6.1.1 Operations. The supplier is not required to follow the exact sequence of operations as listed in Table I but all operations specified shall be used to manufacture the jacket.

*3.6.1.2 Stitches, seams, and stitchings. The stitch, seam and stitching types specified in Table I shall conform to FED-STD-751. The number of stitches per inch as specified in Table I indicates the minimum and maximum number permitted.

*3.6.1.2.1 Thread breaks and ends of seams. Ends of seams and stitching produced with 301 type stitch, when not caught in other seams or stitchings, shall be backtacked not less than 1/4 inch; thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch.

*3.6.1.3 Shade marking. The component parts of the jacket cut from one piece of basic and lining materials, including pairs of sleeve lining when cut from ends, shall be shade marked to insure a uniform shade and size throughout the garment. Sized parts cut from ends shall be identified for size. Any method of shade marking may be used except:

(1) Corrosive metal fastening devices or metal fastening devices on rayon lining.
(2) Sew-on shade tickets.
(3) Adhesive type tickets which show discoloration and the adhesive mass which adheres to the material upon removal of tickets.
(4) Any marking medium which would tend to leave a permanent mark.

3.6.1.4 Pressing. All pressing, as required in Table I, shall be accomplished with a heated pressing iron or pressing machine set at medium (low) temperature (285°F maximum).

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
1.	Cutting. a. Cut jackets in strict accordance with patterns furnished. b. Cut the material in the directions indicated by warp directional lines on pattern. c. Cut all polyester and rayon gabardine cloth parts of the jacket from one piece of basic material, except the front and side front interlining may be cut from ends. When cut from ends, the front and side front interlinings shall harmonize with the shade of the jacket. d. Cut lining parts from one piece of rayon twill material. Cut the piece for the hanger 1-1/8-inches wide and 4-1/4 - inches long. e. Cut the cotton, buckram cloth for the undercollar interlining in accordance with patterns furnished. f. Cut the one-piece undercollar wool material on the bias.					
2.	Replacement of damaged parts. a. Replace, at time of cutting, any parts of the jacket containing holes or seriously weakening defects such as smashes, multiple floats, loose or weakening slubs, etc., expected to develop into holes. b. Replace any parts damaged during manufacturing process by needle chew which may develop into a hole, scissor or knife cut, tear, hole, mend, burn, or large drill hole.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
3.	Shade marking. a. Mark all component parts, except those parts cut from ends (see 1.c), in order to insure a uniform shade, size, and proper assembly throughout the jacket. b. The use of metal fastening devices is prohibited on the rayon lining. c. Adhesive type shade tickets, when used, shall be adhered to the inside of the jacket.					
4.	Make hanger. a. Fold the 1-1/8-inch-wide strip of lining in half lengthwise, turning edges to the inside, to finish 1/4-inch wide, and seam 1/16 inch from single and double folded edges.	301	EFp-2	10-14	A	A
5.	Make shoulder straps. Finished appearance. The shoulder straps shall be uniformly stitched and shall finish smooth and flat, without twists, gathers, puckers, pleats or raw edges. The buttonholes shall be cut-first type, well made, properly positioned and well worked over gimp to fit 27-line insignia buttons. The gimp and thread ends shall be pulled through to the underside of the buttonhole, and the purling of the buttonhole shall be on the outside of shoulder straps. a. The shoulder straps shall be made of two plies of basic material.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
5.	Make shoulder straps(cont'd)					
	b. Position the two pieces of basic material with the edges even at front, back and collar end. Seam the two plies together 3/16 inch from front, back, and collar end edges.	301	SSe-2 (a)	12-16	A	A
	c. Trim edges for proper turning. Turn straps, working the seam-lines out to the edges.					
	d. Edgestitch the straps uniformly 1/8 inch from the seamed edges.	301	SSe-2 (b)	12-16	A	A
	e. Make a horizontal eyelet end square bar type buttonhole, cut 3/4 inch long, in each strap, midway between the back and front edges and with the inside purled edge of the eyelet 5/8 ±1/8 inch from collar edge of strap.	Button-hole	38 per button (not including bartack)		A	A
	f. Securely bartack the end of the buttonhole and trim the ends of the gimp.	Bar-tack	21 per bartack (minimum)		A	A
	g. Press the shoulder straps smooth and flat with a heated pressing iron or pressing machine.					
6.	Make undercollar.					
	Finished appearance. The undercollar shall finish smooth and flat without distortions and shall be of uniform appearance. The gage of the stitching shall be uniform.					
	a. The undercollar assembly shall be one piece, consisting of one ply of wool material and one ply of interlining material.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
6.	Make undercollar (cont'd)					
	b. Position the collar interlining on the undercollar with notches matching and raw edges even and quilt the two pieces together with 5 to 6 rows of blindstitching. The rows of stitching shall extend to approximately 3/4 inch from each end with the first row approximately 3/4 inch from the lower (neck) and top edge and evenly spaced.	103	SSm-5 or 6	4-6	A	
	c. Mark and trim undercollar-interlining assembly in accordance with the undercollar shaper. Trim the interlining 3/16 to 1/4 inch back from lower (neck) edge of undercollar.					
	d. Mark the breakline of undercollar with collarstand marker. Stitch the one-piece undercollar and interlining at the mark for the breakline. In the finished jacket, the one-piece undercollar shall measure 1-1/4 ±1/8 inches at the vertical center.	301	SSv-1	10-14	A	A
	e. Smoothly turn the lower (neck) edge of undercollar over the lower edge of interlining and stitch 1/8 inch from folded edge and through the turned-under portion.	301	SSbc-1	10-14	A	A (silk)
	f. Press the undercollar-interlining assembly smooth and flat with a heated pressing iron or pressing machine.					
7.	Assemble topcollar to undercollar.					
	Finished appearance. The complete collar shall finish smooth and flat without distortion.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
7.	Assemble topcollar to undercollar (cont'd) Edges shall be uniformly even. The seam line shall finish at the edges of the collar. The points and seamed edges shall be neatly and completely forced out. The points shall be uniform in length.					
	a. Position the undercollar on outside of topcollar with top and side edges even and notches matching. Seam undercollar to topcollar 1/4 inch from side and top edges.	301	SSe-2 (a)	10-14	A	A
	b. Trim interlining approximately 1/8 inch from the seamed edges in order to reduce bulkiness. Trim corners for proper turning. Turn collar, completely working out corners and seamed edges.					
	c. Baste collar along the side (ends) and upper (outer) edge and along the breakline with the fullness placed between two rows of basting stitches. Basting shall extend from end to end.	101 or Hand		4-6		
	d. Press the collar smooth and flat with a heated pressing machine. Edges and corners shall be smooth, flat and uniformly even.					
	e. Trim the lower (neck) edge of topcollar to provide for proper seaming to jacket, and cut a guide notch in the lower edge of topcollar at the center. Press and crease collarstand at breakline to approximately 2 inches from each end.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
7.	Assemble topcollar to undercollar (cont'd)					
	f. Make one eyelet at each end of the collar, 1 inch from the side (end) and upper edge (outer), respectively. The eyelets shall be well worked with the purling on the outside of the collar, and shall finish with a 1/8-to 3/16-inch diameter opening.	Eyelet		20 minimum per eyelet	A (silk)	A
	g. On the finished jacket, the collar shall be 1-5/8 ±1/8 inches at the center back when collar is folded along the breakline and measured from the fold to the outer edge.					
8.	Seam sleeve at forearm.					
	Finished appearance. The forearm seam shall finish smooth and flat without distortions and shall start and finish evenly at seam line.					
	a. Position the topsleeve with upper forearm edge in line with the notch in the armhole edge of undersleeve and with the notches in the lower forearm edge of top and undersleeves matching. Stitch the top and undersleeve together 3/8 inch from forearm edge of topsleeve, forming a tapered outlet on the undersleeve.	301	SSbd-1	10-14	A	A
	b. Spread open the forearm seam and press flat with a heated pressing iron.					
9.	Tack point of cuff.					
	Finished appearance. The point of the cuff shall finish smooth and flat without distortion and shall conform to the pattern. The upper curved edge of cuffs					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
9.	Tack point of cuff. (cont'd)					
	shall be properly shaped and creased or basted and shall finish smooth and flat.					
	a. Fold the cuff lengthwise, face to face, at the point, and seam the point 1/8 inch from the raw edge.	301	SSa-1	10-14	A	A
	b. Turn the cuff, completely working out the point.					
	c. Turn under the upper edge of the cuff, 1/4 to 3/8 inch and baste or crease with a heated pressing iron, forming the finished edge to conform to the shape of the pattern.					
10.	Join cuffs to sleeve.					
	Finished appearance. The cuff shall be uniformly stitched to sleeve. When the backarm seam is joined, the point of cuff shall be at the center of top-sleeve.					
	a. Mark the sleeves in accordance with sleeve cuff marker for positioning cuffs.					
	b. Position the upper edge of cuffs at the mark and seam to the body of the sleeve 1/8 inch from the upper edge. Trim the ends of the cuff even with the backarm edges of the sleeves when necessary.	301	LSd-1	12-16	A	A
11.	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without distortions and shall start and finish evenly.					
	a. Join the top and undersleeve together at the backarm with a	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
11.	Seam sleeves at backarm. (cont'd)					
	3/8-inch seam to bottom of cuff, catching the sleeve edges and the ends of the cuff in the seam.					
	b. Spread open the backarm seam and press smooth and flat with a heated pressing iron.					
12.	Tack cuff to sleeve.					
	Finished appearance. The bottom of the cuff shall finish smooth and flat without distortion.					
	a. Smoothly turn cuff as close as possible over the bottom end of the sleeve and baste turnup through all plies.	Hand or 101		4-6		
	b. Tack the raw edge of cuff turnup to the body of the sleeve with blindstitching.	103	EFc-1	4-6	A	
	c. On the finished jacket, the length of the cuff shall be 2-3/4 ±1/4 inches at the forearm and backarm seams, and 4-3/4 ±1/4 inches at the point.					
13.	Seam sleeve linings.					
	Finished appearance. The seams shall be smooth and flat without distortion, shall be uniform in appearance and shall start and finish evenly.					
	a. Position the topsleeve lining with the upper forearm edge in line with the notch in the armhole edge of undersleeve lining and with the notches in the lower forearm edge of top and undersleeve lining matching.	301	SSbd-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
13.	Seam sleeve linings. (cont'd)					
	Seam topsleeve and undersleeve lining together 3/8 inch from forearm edge of topsleeve lining forming a tapered outlet on the undersleeve.					
	b. Join topsleeve and undersleeve lining at the backarm with a 3/8-inch seam.	301	SSa-1	10-14	A	A
14.	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve linings shall be seamed to sleeve without twists, gathers, puckers or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of the lining extending 3/4-to 1 inch beyond the armhole edge of the sleeve.					
	b. Seam the sleeve lining to the topsleeve at backarm and forearm seam allowances, respectively, commencing approximately 4 inches above finished bottom edge of sleeve and extending to approximately 6 inches from armhole edge at the backarm and approximately 4-1/2 inches from armhole edge at the forearm.	301 or Hand	SSa-1	6-8	A A	A
15.	Fell turnup of sleeve lining.					
	Finished appearance. The sleeve linings shall not be short, tight, or twisted at bottom of sleeves.					
	a. Turn the lining over the sleeve and turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 inches above the finished bottom edge of sleeve cuff and baste to turnup of cuff.	Hand or 101		4-6		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
15.	Fell turnup of sleeve lining. (cont'd)					
	b. Fell the folded edge of the sleeve lining to the turnup the cuff with blindstitching.	Hand or 314	 LScz-2 (a)	8-10 6-8	A A	 A
	c. Turn sleeves right side out and assemble in pairs. Insert a sleeve pad in the sleeve, to avoid creasing the front and back edges, and press smooth and flat.					
16.	Make underarm shields.					
	Finished appearance. The underarm shields shall finish smooth and flat without pleats, puckers or raw edges.					
	a. The underarm shields shall be made of two pieces of lining material.					
	b. Position the two plies together face to face with all edges even and join together at the outward (convex) curved edges with a 1/4-inch seam. Turn the shield, working out the seamed edges so that seam line is at edge.	301	SSa-1	10-14	A	A
	c. Press the shields smooth and flat with a heated pressing iron or pressing machine.					
	d. In lieu of pressing, the underarm shields may be edgestitched 1/16 to 1/8 inch from seamed edge.	301	SSe-2 (b)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
17.	Make interlining.					
	a. Seam front and side front interlining together with a 3/8-inch seam.	301	SSa-1	12-16	A	A
	b. Spread open the joining seam and press from end to end.					
18.	Assemble back.					
	Finished appearance. The back seams shall start and finish evenly at seam line and shall be smooth, without distortion.					
	a. The back shall be made of three pieces of basic material.					
	b. Properly position and join the left and right side backs to the center back with a 3/8-inch seam and with notches matching.	301	SSa-1	12-16	A	A
	c. Spread open the back seams and press smooth and flat with a heated pressing iron or pressing machine.					
19.	Assemble fronts.					
	Finished appearance. Front and side fronts shall be carefully joined, uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges. The seams shall start and finish evenly at the seam line. The underarm bust dart in side fronts shall be tapered to a point towards the front edge of side front.					
	a. Fold the side front, matching the cut edges of the bust dart, and stitch the entire length of the dart 1/4 inch from the cut edges at the back end and tapering to a point towards the front edge of side front, securely backtacking the pointed end.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
19.	Assemble fronts. (cont'd)					
	b. Position front and side front with notches matching and join with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	c. Spread open the seam and press smooth and flat with a heated pressing iron or pressing machine.					
20.	Interline fronts.					
	a. Position the left and right front and side fronts on the respective front-side front interlining with the front seam line matching and the seam allowances in the interlining toward the inside of the jacket and baste along the front seam, properly distributing the fullness over the breast area. The basting shall extend from approximately 3 inches from the shoulder edge of fronts to approximately 1-1/2 inches from the bottom edge.	301 Hopper or Hand				
	b. Baste horizontally along the shoulder, allowing room for setting shoulder pad and working the fullness in the front towards the armhole. Baste along the front of the armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of the interlining down to approximately 1-1/2 inches from the bottom edge of front.	301 Hopper or Hand				
	c. Baste along the breakline of the lapel, starting at the gorge and baste to approximately 1 inch from front edge then continue to bottom of front.	301 Hopper or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
20.	Interline fronts. (cont'd)					
	d. Baste along the top and front edge of lapel down to the lower end of lapel.					
21.	Stitch bridle tape to lapel.					
	Finished appearance. The bridle tape shall be stitched along the breakline with proper tension to allow the lapel to roll properly in the finished jacket.					
	a. Position the 1/4-inch-wide bridle tape on the interlining side of the fronts along the breakline of the lapel and with the front edge of the tape in line with the notch in the gorge.					
	b. Stitch the tape through the interlining and the front of the jacket along the breakline of the lapel, holding the tape taut and properly distributing the fullness. The tape shall be stitched 1/16 inch from each edge.	301	SSau-2	10-14	A	A
	c. The tape shall extend from the gorge notch to approximately 4 inches above the lower end of lapel.					
22.	Join back and front at sides.					
	Finished appearance. The side back and side front shall be carefully joined at the sides without twists, gathers, puckers or pleats. The seam shall start and finish at the seam line.					
	a. Position the side back and side front with edges even and notches matching and join together at the sides with a 3/4-inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
22.	Join back and front at sides. (cont'd)					
	b. Spread open the side seams and press flat with a heated pressing iron.					
23.	Seam darts in front lining.					
	Finished appearance. The dart shall be properly positioned and finished without pleats, puckers or gathers.					
	a. Fold the front lining, matching the cut edges of underarm bust dart and stitch the entire length of dart 1/4 inch from the cut edges at back end and tapering to a point at front end, securely backtacking the pointed end.	301	SSa-1	10-14	A	A
	b. Press the darts smooth and flat with a heated pressing iron or pressing machine with the raw edges of the underarm bust darts toward the armhole.					
24.	Make front facing eyelet opening.					
	Finished appearance. The eyelet reinforcement lining shall be attached without distortion or fullness which will affect the facing in the finished jacket and shall not show at the edge of the button opening.					
	a. Position the lining eyelet reinforcement piece on the outside of front facing even with the lower back edge and with notches matching. Stitch the lining eyelet reinforcement piece to facing from upper to lower notches with 3/8-inch seam	301	SSe-2 (a)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
24.	Make front facing eyelet opening (cont'd)					
	b. Slash the seam allowance at the notches for the button opening to the seam line at ends of stitching. Turn lining to the inside of facing and edgestitch 1/16 to 1/8 inch from the seamed edge.	301	SSe-2 (b)	10-14	A	A
	c. Stitch the raw front edge of lining eyelet reinforcement to the front edge of facing with 1/8-to 3/16-inch seam.	301	SSa-1	10-14	A	A
25.	Seam facing to front lining; sew on identification label.					
	Finished appearance. The lining shall be carefully and properly aligned, and seamed to the facing so that in the finished jacket the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material or other defects or distortion. The button opening shall not gap or be distorted.					
	a. Position the front lining on the facing with the top shoulder edges even at seam line and with notches matching.					
	b. Seam the front edge of the front lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from top shoulder edge of facing to top of button opening on facing and from bottom of button opening in facing to approximately 1-1/4 inches from bottom edge of facing and front lining.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
25.	Seam facing to front lining; sew on identification label. (cont'd)					
	c. Open the parts joined, with the seam allowances turned against the front lining, and tack across the top and bottom ends of the button opening with a 3/8-inch bartack or straight tack.	301		10-14 or 28 per Straight Tack	A	A
	d. Stitch 1/16 to 1/8 inch along the folded edge of lining at the button opening from backtack to backtack.	301	EFb-1	10-14	A	A
	e. Sew the identification label to the left front lining with a single row of stitching 1/16 inch from each edge of label. The label shall be positioned with right edge even with facing-lining seam line and the lower edge in line with the top end of button opening.	301	SSa-1 (each edge)	10-14	A	A
26.	Assemble body lining.					
	Finished appearance. The front, side back, and center back lining shall be carefully joined, uniformly stitched, and shall finish smooth and flat without twists, gathers, puckers, pleats, or raw edges. Seams shall start and finish evenly at seam line.					
	a. Position and join the left and right side back linings to the center back lining with a 3/8-inch seam and with notches matching.	301	SSa-1	10-14	A	A
	b. Position the side back and front linings with notches matching and the raw edges of underarm bust dart turned toward the armhole and join together at the sides with a 3/4-inch seam.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
27.	Press lining seam and darts. a. Press the facing-lining seam, and lining side seam smooth and flat with a heated pressing iron, with raw edges of the facing lining seams and side seams towards the center back.					
28.	Make eyelets in fronts. Finished appearance. The eyelets shall be worked with the purling on the outside of the fronts and shall finish with a 1/8-to 3/16-inch diameter opening. All stitches shall be securely caught in the fabric. a. Mark location of eyelets in right and left fronts for removable buttons in accordance with marks on the patterns. In the finished jacket, the center of the eyelets shall be 3/4 to 7/8 inch from the finished front edge. b. Make an eyelet at each of the marks through fronts and interlining.	Eyelet		21 minimum per eyelet	A	A
29.	Shape fronts. Finished appearance. The fronts shall be shaped in such a way as to produce a uniform appearance with neat flat seams and hems in the finished jacket. a. Mark and shape the front edges of the jacket. Mark and shape the lapels in accordance with the shaper furnished.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
29.	Shape fronts. (cont'd) b. Mark the jacket 1-1/4 inches above the bottom edge for the bottom turnup.					
30.	Tape armholes. Finished appearance. The tape shall not distort the armhole. a. Sew 1/4-inch-wide stay tape along the armhole, starting from approximately 1 to 1-1/4 inches above the notch in the front and continue along the back edge, to approximately 3/4 inch from the shoulder edge. The tape shall be sewn through the interlining at the front. b. The tape shall be stitched with slight tension from front notch to side seam and shall be held taut along the back edge of armhole. c. Press armhole tapes smooth and flat with a heated pressing iron. d. Press the shoulder blades and the lapels smooth and flat with a heated pressing iron or suitable type pressing machine.	301	SSaa-1	10-14	A	A
31.	Baste facing-lining assemblies to fronts. a. Position the right and left facing-lining assemblies on the outside of the respective fronts, and baste along break-line, distributing the fullness in the breast area; continue to baste along the front and bottom edge. Baste from top and front edges of lapel down to the lower end of lapel, working fullness towards the center of lapel.	301 Hopper				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
32.	Join facings and fronts.					
	a. Join the facing to each front and interlining along top edge of lapel from collar notch along front edge of lapel and front and bottom edge to back edge of the facing with 3/16-inch seam.	301	SSa-1	10-14	A	A
	b. Remove all basting stitches, trim lower front corner of the facings and corner of lapels, and slash the seam allowance at collar notch on lapel for proper turning.					
	c, Spread open the front-facing seam from the collar notch on top of lapel to the bottom edge of the jacket and press smooth and flat with a heated pressing iron.					
33.	Baste fronts and bottom edge of jacket.					
	a. Turn the facing-lining assemblies to the inside of the fronts, working out completely the corner of the lapels. Turn up the bottom of the jacket, lapping the back edge of the facings over the front ends of the bottom turnup, and working out completely the front bottom corner.					
	b. Baste along the top and front edges of the lapels, the fronts and for width of the facings, working the seam lines out to the edges and along the bottom folded edge of the hem turnup.	101		4-6		
34.	Baste facing (second time).					
	a. Baste lapel approximately 1-1/4 inches down from the gorge starting at breakline of lapel and baste horizontally to approximately 1-1/4 inches from front edge of lapel. Continue to baste					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
34.	Baste facing (second time)(cont'd)					
	1-1/4 inches from front edge of lapel and front and bottom edge of jacket, distributing the fullness in the facing to allow for the lapel roll. Baste along the breakline of lapel, placing the proper fullness at the center of the lapel.	101		4-6		
	b. Baste the facing to the fronts as close to the facing-lining seam as possible, placing the proper fullness over the breast area. The basting shall extend from approximately 1-1/2 inches from the bottom edge of the jacket to approximately 3 inches from the shoulder edge of facing.	Hand or 301 Hopper				
35.	Tack facing to interlining.					
	a. Raise the lining and tack the facing-lining seam allowance to the front interlining, with blindstitching, from the top of eyelet opening to approximately 3 inches from shoulder edge of interlining.	306 or	SSm-1	4-6	A	A
		103 or	SSm-1	4-6	A	
		Hand		4-6	A	
36.	Fell bottom turnup.					
	a. Fell the raw edge of the bottom turnup to the body of the jacket with blindstitching. The stitching shall extend the entire length of bottom turnup.	103 or	SSm-1	4-6	A	A
		Hand		4-6	A	
37.	Baste body lining to jacket.					
	Finished appearance. The body linings shall finish without pleats, puckers or distortions and with the proper fullness.					
	a. Fold the front lining in accordance with the notches, forming the chest pleat, and baste along the entire length	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
37.	Baste body lining to jacket. (cont'd)					
	of the pleat. The folded edge of the pleat on outside of the lining shall be towards the armhole.					
	b. Baste the front lining to the jacket, starting at the lower end of the chest pleat and basting the lower edge of armhole approximately 2 inches from the edge, to the side seam. Match side seam of jacket and lining and continue basting as close to the side seam line as possible to approximately 4 inches from bottom finished edge of jacket, and from that point, baste horizontally to approximately the center of the front lining.	Hand or 301 Hopper				
	c. Fold the back lining at the center back, forming a 3/4-inch-wide pleat, and baste from top end of pleat to approximately 4 inches from bottom finished edge of jacket. The folded edge of the pleat on the outside of the lining may be towards the right or left.	Hand or 301 Hopper				
	d. Baste lining to back, starting at side seam and basting along armhole and shoulder edges to approximately 2 inches from top end of center back pleat, allowing room at the shoulder for setting of shoulder pads.	Hand or 301 Hopper				
	e. Turn under bottom edge of lining and baste lining to jacket approximately 1/2 inch from folded edge, catching the turned under portion in the basting and with the folded edge of lining approximately 1/2 inch above bottom finished edge of jacket.	Hand				
	f. The fullness shall be properly distributed throughout the lining.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
38.	Trim lining and interlining.					
	a. Trim excess lining and interlining even with the edge of armhole.					
39.	Baste shoulder pad to jacket.					
	a. Position shoulder pad over the interlining with straight edge of pad even with the edge of armhole. Securely tack the pad to the interlining.	Hand or 301 Hopper				
40.	Seam shoulders.					
	Finished appearance. The shoulder seam shall be uniformly stitched and the fullness on the backs shall be properly placed in order that the shoulders may be properly shaped. The shoulder seam shall finish without a distorted appearance.					
	a. Join the fronts and back together at the shoulder with a 3/8-inch seam, working in the proper fullness on the backs.	301	SSa-1	12-16	A	A
	b. Spread open the shoulder seam and press flat, holding the shoulder short and exercising much care in the pressing in order not to affect a distorted appearance in the finished seam. The pressing shall be accomplished with a heated pressing iron or pressing machine over a suitable block.					
41.	Baste lining at shoulder and neck line.					
	a. Position shoulder interlining and lining at neck and baste upper part of each shoulder on the outside. Turn the jacket on the inside. Turn under and lap the shoulder edge of the	Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
41.	Baste lining at shoulder and neck line. (cont'd) back lining on the facing-lining assembly. Baste lining to jacket along the folded edge of the back lining with the top end of the chest pleat caught in the basting. Baste the lining to back at the neck from shoulder seam to shoulder seam.					
42.	Stitch hanger and label to jacket. a. Stitch the upper edge of the size label and the ends of the hanger to the inside center back of the jacket at the neck. b. The hanger opening, in the finished jacket, shall be 1-1/2 ±1/8 inches when measured along the lower edge of the top collar.	301	SSa-1	10-14	A	A
43.	Seam topcollar to facings at gorge. Finished appearance. The collar joining shall be smooth and flat without puckers, gathers or pleats. a. Mark neck line 5/8 inch from top edge of back, from shoulder seam to shoulder seam. Continue the marking on the fronts along the gorge with the line of marking to taper to 3/8 inch at the collar notch on top of lapel. b. Position the collar on inside of jacket with neck (gorge) edge of facing and topcollar even and lower corner of topcollar and collar notch on top of lapel matching.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
43.	Seam topcollar to facings at gorge. (cont'd)					
	c. Join topcollar to facing at the gorge with 3/8-inch seam, from the collar notch on top of lapel to a point not less than 3/4 inch in back of the breakline of lapel.	301	SSa-1	10-14	A	A
	d. Slash the facing at the back end of the joining seam.					
44.	Tack topcollar to fronts at gorge.					
	a. Spread open the seam joining topcollar to facing and tack the seam allowance of the topcollar to the fronts at the gorge from the end of the collar to the back end of the gorge seam.	Hand		2-4	C (silk)	
45.	Baste undercollar to jacket.					
	a. Lap the neck edge of the undercollar on the outside of the fronts and back at the mark. Baste undercollar to fronts and back, placing proper fullness over the shoulder.	Hand				
	b. Securely tack the corners of the undercollar across the juncture point of undercollar to fronts.	Hand		2-4	C (silk)	
	c. In the finished jacket, the ends of the collar and the top edge of lapels shall each be 1-5/8 ±1/8 inches when measured from corner at juncture of collar and lapel to finished edge of collar and lapel, respectively.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
46.	Tack collar interlining to jacket.					
	a. Raise the loose portion of the top collar neck edge and tack the neck outlet of fronts and back to the collar interlining between the ends of the gorge seam.	Hand		2-4	C (silk)	
47.	Baste topcollar to jacket.					
	a. Turn under the neck edge of topcollar across the back, between the ends of the gorge seam, and lap the folded edge on the neck edge of the facing and back lining. Baste neck edge of topcollar to neck across the back between the ends of the gorge seam.	Hand				
48.	Fell collar to jacket.					
	a. Fell the neck edge of the undercollar to the fronts and back from end to end.	Hand		8-10	C (silk)	
	b. Fell the folded neck edge of top collar to the neck edge of jacket across the back between the neck edge of jacket across the back between the ends of the gorge seams, catching the top edge of size label and the ends of the hanger in the stitches.	Hand		8-10	C (silk)	
49.	Set shoulder straps.					
	Finished appearance. The shoulder straps shall be properly positioned and stitched to jacket without twists, puckers, pleats or other distortions. On the finished jacket, the straps shall measure 1-3/4 ±1/8 inches wide at the armhole seam line and shall taper to 1-1/2 ±1/8 inches at eyelet end of buttonhole.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
49.	Set shoulder straps. (cont'd)					
	a. Position the shoulder straps with the rounded end of the strap 1/4 to 3/8 inch from the neck edge of the undercollar and with the notch of shoulder strap matching the shoulder seam.					
	b. Seam the shoulder straps to the jacket 1/8 inch from the armhole edge.	301	SSa-1	10-14	A	A
50.	Set sleeves.					
	Finished appearance. The sleeves shall be properly and uniformly set and the fullness at the armholes shall be properly distributed. The armhole-sleeve seam shall finish smooth and flat without twists, puckers or pleats. The armhole shall not be stretched or distorted due to pressing.					
	a. Position the sleeves on outside of jacket at the armholes, with back notches of sleeve matching notch in the back, and with notch in top sleeve and fronts matching.					
	b. Join the sleeves to the jacket with a 3/8-inch seam, distributing the fullness in accordance with good manufacturing practice, and catching the ends of the shoulder straps and armhole edge of front interlining in the stitching.	301	SSa-1	10-14	A	A
	c. Press the entire armhole smooth and flat with a heated pressing iron to remove the fullness in sleeve head.					

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
51.	Baste armhole.					
	a. Baste around inside armhole, positioning back lining, shoulder pad, and front lining in place. Turn the jacket on the outside.	Hand				
	b. Baste the front and interlining together on the outside as close as possible to the armhole seam, catching the shoulder pad in the basting and properly forcing out the armhole while basting. The basting shall extend the entire circumference of the armhole.	Hand				
52.	Baste underarm shield to jacket.					
	a. Properly position the underarm shield on the lining side of jacket with the center of the shield aligned with lining side seam and the raw edges even with the lower edge of armhole.					
	b. Baste the underarm shields to the jacket along the vertical center armhole and outer edges.	Hand				
53.	Tack armhole and stitch sleevehead pads.					
	Finished appearance. The armhole shall not be distorted or puckered due to stitching the sleevehead pads and linings at armhole.					
	a. Position sleevehead pad on each sleeve with the folded edge of pad approximately 1/8 inch back from the raw edge of the armhole seam, and with the front end of pad matching the notch in fronts.					
	b. Stitch sleevehead pad to sleeve from end to end, through the armhole-sleeve seam allowance, 1/8 inch from the folded edge of pad, catching the front and back-	301	SSa-1	4-6	16/4	16/4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
53.	Tack armhole and stitch sleeve-head pads. (cont'd)					
	part linings, underarm shield, and shoulder pad in the stitching. Continue stitching the lining and interlining to the remainder of armhole, trimming away the excess material.					
54.	Tack underarm shields to lining.					
	Finished appearance. The underarm shields shall be tacked without distortion.					
	a. Tack the underside of the underarm shields to the body lining approximately 1/2 inch from the outer edge of the shield.	Hand		4-6	A	
	b. In the finished jacket, the shields shall measure 2-1/2 ±1/8 inches at the vertical center.					
55.	Edgestitch jacket.					
	Finished appearance. The edgestitching shall be of uniform width without twisting, pleating or puckering and shall finish flat and smooth.					
	a. Edgestitch the top and front edges of lapels, the front edges of jacket and continue the stitching along the bottom edge of jacket for the width of facing. Edgestitch the collar.	301	SSe-2 (b)	10-14	A	A
	b. The stitching shall be uniformly 1/8 inch from all edges.					
56.	Fell linings.					
	a. Fell the back lining and facing lining assembly together at the shoulders, securing the top end of the chest pleat in the felling. The felling shall be placed over the folded edge of the back lining.	Hand		8-10	A	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
56.	Fell linings. (cont'd)					
	b. Position the sleeve lining at the armhole with the back and forearm seam line of the sleeve and sleeve lining matching.					
	c. Turn under the armhole edge of the sleeve lining and lap the lining on the outside of the front and back lining and the top edge of the underarm shield at the armhole. Fell the sleeve lining to the jacket around the entire armhole, catching the underarm shield in the felling and properly distributing the fullness around the armhole. The stitches shall be placed over the folded edge of the sleeve lining. Backstitch the lower part of armhole from approximately 1-1/2 inches in front of the forearm sleeve lining seam line to the side seam line of the body lining.	Hand		8-10	A	
	d. Fell the turned under portion of the lining to the bottom turnup of the jacket with blindstitching 1/4 to 3/8 inch from bottom folded edge of lining.	301 or Hand	EFc-1 (b)	6-8 6-8	A A	A
	e. Fell the lower back edge of facing to the bottom turnup, from bottom to top edge of turnup.	Hand		6-8	A	
57.	Clean jacket.					
	a. Pull and remove all basting thread. Trim all ends of stitching and remove all loose ends of thread from the jacket. Remove all spots, stains, and shade tickets and markings without injury to the material.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
58.	Press jacket. Finished appearance. The jacket shall be well pressed throughout with heated pressing irons or pressing machines (see 3.6.1.4) of a type suitable to obtain the desired shape and appearance with good manufacturing procedures. a. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine with shoulder straps properly positioned over shoulder seam and pressed flat. b. Press armholes solid from the inside, creasing the sleeve lining at edge of armhole seam line at the front, back and armpit. The armpit and the back of armhole shall be held short while pressing. c. Block armholes on pressing buck, shrinking in the top sleeves. Sleeves shall not be creased. d. Press the fronts smooth and flat on a body machine, straightening the front edges of the jacket, working the fullness towards the chest and shrinking and properly shaping the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. e. Press bottom edge of jacket smooth and flat, exercising care that the lining is not exposed below the bottom edge. f. Press the sides, working the fullness towards the back.					

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
58.	Press jacket. (cont'd) g. Press the back smooth and flat, removing all fullness. h. Press the lapels smooth and flat from approximately 2 inches below the gorge seam line to the front edge, straightening the edges and working the fullness towards the center of the lapel and removing the fullness by shrinking. Lapels shall not be creased. i. Press and crease the collar on the breakline indicated on the under collar, continuing the crease onto the lapel to approximately 2 inches below the gorge seam line. j. Press the entire collar smooth and flat, stretching outer edge where necessary to obtain the proper shape, straightening the edges, working any fullness towards the center of the collar and removing the fullness by shrinking. k. Insert a sleeve pad in the sleeves in order to prevent creasing, and press sleeves smooth and flat. l. Remove all wrinkles and impressions from under the lapels, collar, and shoulder straps. Remove all impressions of the front, side, and back seam allowances from the jacket. m. Press chest pleat in upper front lining and center back lining smooth and flat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

TABLE I MANUFACTURING REQUIREMENTS

OPN NO.	OPERATION	Stitch Type	Seam or Stitch'g Type	Stitches Per Inch	THREAD	
					Needle	Bobbin or Looper
58.	Press jacket. (cont'd) n. Press lining throughout with a heated pressing iron, removing all wrinkles and creases. Remove all gloss marks.					
59.	a. Mark the location for sewing one 27-line insignia button to each shoulder, aligned with the buttonhole eyelet in the shoulder straps to assure a smooth flat strap without bulging or misalignment.					
60.	Attach and sew on buttons. Finished appearance. The shoulder buttons shall be properly attached and sewn to the jacket. a. When required, attach four 27-line, insignia buttons to each front with shank of buttons inserted through eyelets and secured by ring fasteners.					
	b. Sew one 27-line insignia button at each of the marks on each shoulder through all plies except the lining and shank wrap not less than four times. c. The shoulder buttons shall be sewn with the head of the eagle towards the edge of the collar.	Hand or 101 or 301		21 per button 21 per button	A A	 A

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*3.7 Finished measurements. The finished jacket shall conform to the measurements shown in Table II.

Table II - Finished measurements 1/

	Back length 2/			Sleeve length 3/		
Size	Short Inches	Regular Inches	Long Inches	Short Inches	Regular Inches	Long Inches
8	16-1/8	17-5/8	19-1/8	16	17	18
10	16-1/4	17-3/4	19-1/4	16	17	18
12	16-3/8	17-7/8	19-3/8	16	17	18
14	16-1/2	18	19-1/2	16	17	18
16	16-5/8	18-1/8	19-5/8	16	17	18
18	16-3/4	18-1/4	19-3/4	16	17	18
20	16-7/8	18-3/8	19-7/8	16	17	18

1/ Tolerance on all measurements: ±3/8 inch.

2/ Back length measurement taken along center back in line with undercollar from lower center back seam neck edge of undercollar to bottom edge of jacket.

3/ Sleeve length measurement taken along forearm seam from armhole to bottom edge of sleeve.

*3.8 Workmanship. The finished jackets shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the levels set by the applicable quality levels (AQL).

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserve the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

*4.1.1 Certificate of compliance. Where certificates of compliance are permitted, the Government reserves the right to check test such items to determine the validity of the certification.

*4.2 Inspection. Inspection shall be in accordance with the provisions set forth in MIL-STD-105 except where otherwise indicated herein.

*4.2.1 First article inspection. When first article is required, inspection shall be performed on a completely fabricated jacket for conformance to all provisions of this specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*4.2.2 Component and material inspection. In accordance with 4.1 above, components and material shall be tested in accordance with all the requirements of referenced specifications, figures and standards unless otherwise excluded, amended, modified or qualified in this specification or applicable purchase document. In addition to testing provisions contained in subsidiary specifications, figures and standards, testing shall be performed on components listed in Table III for characteristics noted. Wherever applicable, tests shall be conducted in accordance with FED-STD-191. All test reports shall contain individual values utilized in expressing the final results.

*4.2.1.1 Sampling for testing. Unless otherwise specified in subsidiary specifications, sampling shall be in accordance with the following. The lot shall be unacceptable if one or more sample units fail to meet any test requirements specified herein.

Lot size (lot unit)	Sample size (sample unit)
800 or less	2
801 thru 22,000	3
22,001 and over	5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Table III. - Test methods

Components	Characteristic	Rqmt. para.	Test method	No. Determinations per sample unit	Results reported as:
Felt for shoulder pad	Material identification 1/	3.3.9.1.1	1100, 1200 or 1500	1	Pass or fail
	Weight, oz. per sq. yd.	3.3.9.1.1	5041	5	Avg. of the 5 det. to the nearest 0.1 oz.
Felt for shoulder pad	Thickness, inches	3.3.9.1.1	5030	1	Pass or fail
	Wool content	3.3.9.1.1	1100	1	Pass or fail
	Starch, glue or other sizing substances 1/	3.3.9.1.1	2611	2	Pass or fail
	Color	3.3.9.1.1	Visual	1	Pass or fail
Unbleached, cotton, cheese cloth	Material identification 1/	3.3.9.1.2	1200	1	Pass or fail
	Weave	3.3.9.1.2	Visual	1	Pass or fail
	Weight, oz, per sq. yd.	3.3.9.1.2	5041	5	Avg. of the 5 det. to the nearest 0.1 oz.
Matted, noils	Material identification 1/	3.3.9.1.3	1100, 1200 or 1500	1	Pass or fail
	Wool content	3.3.9.1.3	1100	1	Pass or fail

1/ A certificate of compliance may be submitted for this requirement.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*4.2.2.2 In-process inspection. Inspection shall be performed during the manufacturing of the end item to ascertain that the operations are performed as specified herein. The Government reserves the right to determine the acceptability of construction methods not performed in accordance with specified requirements for operations or subassemblies.

*4.2.3 Examination of end item. The end item shall be examined for defects listed in 4.2.3.2, 4.2.3.3 and 4.2.3.4. The sample unit shall be one jacket.

*4.2.3.1 Classification of defects. All defects shall be classified as indicated below except those with an asterisk (*) in the classification column which shall be classified as:

Major defect - When seriously affecting appearance or serviceability.
Minor A defect - When affecting appearance or serviceability, but not seriously.

*4.2.3.2 General defects. General defects shall be classified as follows:

Examine	Defect	Classification Major (*)	Minor A	Minor B
Material defects and workmanship damages	a. Any hole.		*	
	b. Any weakening defect, such as smash, multiple float, loose slub, etc., that may develop into hole.		*	
	c. Shade bar, unsightly slub, etc. -on outside.		*	
	-on inside.			X
	d. Needle chew which may develop into a hole.		*	
	e. Any scissors or knife cut, tear, mend or burn.		*	
	f. Large exposed drill hole.	X		

NOTE: Material defects and workmanship damages are to be classified as a Major or Minor A defect as indicated by the asterisk (*) only when the condition is one which definitely weakens the structure of the garment or when it is so conspicuously located as to be clearly noticeable. Nonweakening conditions which are inconspicuous are to be classified as follows:

Material defect - No defect.
Workmanship damages - Minor B defect.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Shaded parts	a. Any outside part shaded.	*		
	b. Any lining part badly shaded, except underside of underarm shield or hanger loop and sleeve linings.		X	
	c. Sleeve lining parts or hanger loops badly shaded or pair of sleeve linings not matching each other.			X
Cleanness	a. One or more spots or stains of a permanent nature.	*		
	b. One or more removable spots or stains, clearly noticeable.		X	
	c. One or more bastings not removed.			X
	d. Thread ends not trimmed or loose threads not removed throughout major portion of jacket.		X	
	e. Any shade marking exposed and visible on outside of jacket.	*		
Components and assembly	a. Any defective component.	*		
	b. Any component part omitted.	*		
	c. Any required operation omitted or improperly performed.	*		
Cutting	a. Any component part of basic material not cut in accordance with directional lines on patterns or specified requirements.	X		
	b. Any lining or interlining part not cut in accordance with directional lines on patterns or specified requirements.			X
Pressing	a. Burned or scorched.	*		
	b. Armhole stretched.	*		
	c. Inside of armhole lining not creased or armhole not creased solid at front, armpit and back.		X	

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	d. Armhole not blocked or poorly blocked, affecting appearance.		X	
	e. Collar breakline not creased or poorly creased or creased less than 1-1/2 inches or more than 2-1/2 inches below gorge seamline.		X	
	f. Omitted or poorly pressed (unless otherwise classified.)		X	
	g. Body lining not pressed smoothly.			X
	h. Pleat on front or back lining not pressed flat and smooth.			X
	i. Lapel, front, or collar edge bulky, i.e., not pressed solid, affecting appearance.		X	
	j. Pressing impressions not removed under one or more of the following places, i.e., lapel,collar, or shoulder strap.			X
Seams and stitching	a. Accuracy of seaming.			
	1. Any seam twisted, puckered or pleated, affecting appearance (unless otherwise classified).		X	
	2. Part of garment caught in any unrelated operation or stitching.	*		
	3. Unsightly hand felling or blindstitching exposed and visible on the outside of jacket, affecting appearance.		X	
	4. End of any seam or stitching (301 stitch type), when not caught in another seam or stitching, backtacked less than 1/4 inch.			X
	5. Stitching overlapping end(s) of thread break less than 1/2 inch (all stitch types).			X
	6. Repaired thread break on edge stitching not neatly accomplished, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	b. Gage of stitching.			
	1. Irregular, i.e., unevenly gaged or various stitchings not uniformly gaged, affecting appearance.		X	
	2. Beyond range of width specified or varies more than 1/16 inch when no range is specified.			X
	c. Open seam.			
	1. Any open seam on outside of jacket:			
	-1/8 inch or more but not more than 1/4 inch.			X
	-more than 1/4 inch but not more than 1/2 inch.		X	
	-more than 1/2 inch.	X		
	2. Any open seam on inside of jacket (except felling):			
	-1/4 inch or more but not more than 1/2 inch.			X
	-more than 1/2 inch.		X	
	3. Any open seam on felling:			
	-1/4 inch or more on hand felling.		X	
	-1 inch or more on machine felling.		X	

NOTE: One or more broken or two or more continuous skipped or run-off stitches constitutes an open seam.

	d. Raw edges.			
	1. Any raw edge on outside of jacket:			
	-1/8 inch or less.			X
	-more than 1/4 inch.	X		
	-more than 1/8 but not more than 1/4 inch.		X	
	2. Any raw edge on inside of jacket:			
	-1/8 inch or more but not more than 1/4 inch.			X
	-more than 1/4 inch.		X	

NOTE: Raw edges are classified as such only when they occur at places where edge is required to be turned under. Raw edges not securely caught in stitching shall be classified as an open seam.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	e. Run-offs.			
	1. Joining seams - when resulting in an open seam use "open seam" classification.			
	2. Edge or raised stitching (when not resulting in an open seam):			
	-1/4 inch or more but not more than 1/2 inch.			X
	-more than 1/2 inch.		X	
	f. Not specified seam or stitch type.		X	
	g. Stitch tension.			
	1. Loose tension, resulting in a loose seam.	X		
	2. Loose tension on edge or raised stitching, resulting in loosely exposed bobbin thread or top thread, affecting appearance.		X	
	3. Tight tension (stitches break when normal strain is applied in length direction of seam or stitching), use open seam classification.			
	NOTE: Puckering is evidence of tight tension; when puckering is evident, test seam by exerting pull in the lengthwise direction of the seam.			
	h. Stitches per inch (to be scored only when the condition exists on major portion of the seam) less than minimum specified by:			
	-1 stitch (except on hanger or label).			X
	-2 stitches (except on hanger or label).		X	
	-3 or more stitches (except on hanger or label).	X		
	-one or more stitches on hanger or label.			X
	i. One or more stitches skipped or broken on edge or raised stitching (when seam is seamed, turned and stitched) not amounting to an open seam:			
	-1/4 inch or less.			X
	-more than 1/4 inch but not more than 1 inch.		X	
	-more than 1 inch.	X		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Buttonholes and eyelets	a. One or more omitted or added.	X		
	b. Not specified type buttonhole or eyelet.	X		
	c. Buttonhole or eyelet stitches not securely caught in fabric, causing stitches to pull away from fabric.	X		
	d. Diameter of eyelet opening less than 1/8 inch or more than 3/16 inch.			X
	e. Buttonhole opening not corresponding to size of button:			
	-too small, not permitting button to enter buttonhole.	X		
	-too large, 3/8 inch or more longer than diameter of button (measured at inside edge of purling).		X	
	f. Bartack on buttonhole omitted or loose on:			
	-1 buttonhole.		X	
	-2 buttonholes.	X		
	g. Bartack on buttonhole misplaced, not serving intended purpose:			
	-1 buttonhole.			X
	-2 buttonholes.		X	
	h. One or more broken stitches in:			
	-1 buttonhole.		X	
	-2 buttonholes.	X		
	i. More than 2 skipped stitches in:			
	-1 buttonhole.			X
	-2 buttonholes.		X	
	j. Gimp omitted on:			
	-1 buttonhole.			X
	-2 buttonholes.		X	
	k. Ragged edges.			X
	l. Poorly made, affecting appearance (unless otherwise specified).		X	
	m. One or more buttonholes finished with the purling on underside.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	n. Gimp or thread ends not pulled through to the underside on one or more buttonholes or not caught in bartack.			
Metal buttons, or ring toggles	a. Missing, loose, broken or defective: -1 button or ring toggle.		X	
	-2 or more buttons or ring toggles.	X		
	b. Not specified type, size, color or finish.		X	

NOTE: A button shall be considered defective if it has sharp, rough, cracked or split edges; scratches, dents, blemished or imbedded foreign matter, loose shank or shell; or is poorly plated or badly shaded.

*4.2.3.3 Detailed defects applicable to specific parts. Detailed defects applicable to specific parts shall be classified as follows:

Examine	Defect	Classification Major (*)	Minor A	Minor B
Collar	a. Construction and setting.			
	1. Short, i.e., causing puckers on back or front or pulling lapel at gorge, causing front to roll out.	*		
	2. Collar not properly set, causing a decided curve or bulge on creaseline at gorge seam.	*		
	3. Top corner tight at joining to gorge seam or across back, causing fullness on lapel or pleats across outside of back.	*		
	4. Eyelet positioned from end or outer edge of collar: -more than 1-1/8 inches but not more than 1-1/4 inches.			X
	-less than 7/8 inch but not less than 3/4 inch.			X
	-more than 1-1/4 inches or less than 3/4 inches.		X	
	5. Collar width at center back from breakline to outer edge less than 1-1/2 inches or more than 1-3/4 inches.			X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	b. Collar edge.			
	1. Collar edge short across shoulder, causing collar to rise more than 1/4 inch at creaseline or causing puckers on front or back.	*		
	2. Irregular, affecting appearance.		X	
	3. Undercollar exposed along collar edge for a distance of 1 inch or more, affecting appearance.		X	
	4. Tacking on corner of undercollar to front omitted or insecure.		X	
	c. Collar points and collar ends.			
	1. Collar ends uneven in length by:			
	-1/4 inch or more but less than 1/2 inch.		X	
	-1/2 inch or more.	X		
	d. Top collar.			
	1. Tight, i.e., causing edge to curl or bulge on undercollar.	*		
	2. Twisted, i.e., having a diagonal twist.	*		
	3. Full, i.e., having excessive fullness.	*		
	4. Full, i.e., topcollar folds 1/8 inch or more from creased edge of undercollar.			X
	e. Undercollar.			
	1. Interlining pleated, affecting smoothness of topcollar.	*		
	2. Interlining tight or twisted, causing puckers on undercollar.		X	
	3. Undercollar stand less than 1-1/8 inches or more than 1-3/8 inches wide at center back.		X	
	4. Tacking of back neck seam allowance to interlining omitted or insecure.			X

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	f. Gorge seam.			
	1. Not straight, affecting appearance.		X	
	2. Not spread open.		X	
	3. Tacking omitted or insecure.			X
Lapels	a. Lapel facing.			
	1. Twisted, tight or short, causing lapel to curl out, or twist on facings.	*		
	2. Fullness or puckers.	*		
	b. Lapel edges.			
	1. Irregular, affecting appearance.		X	
	2. Not properly forced out, having a fold of 1/8 inch or more.			X
	3. Front part exposed on lapel edge, affecting appearance.		X	
	c. Bridle tape.			
	1. Misplaced, not serving intended purpose.			X
	2. Tape partly on creased edge or on lapel side.		X	
	3. Not stitched through fronts of jacket.		X	
	d. Collar and lapel shape.			
	1. Not uniform, i.e., top edge of lapels or end of collar and lapel varying in length by 1/4 inch or more.		X	
	2. Corner of collar or lapel points poorly shaped or not of uniform shape, affecting appearance.		X	
	3. Lapels poorly shaped or not of uniform shape or size.	*		
	4. Length of collar ends and lapel notches:			
	-less than 1-1/2 inches but not less than 1-3/8 inches.			X
	-more than 1-3/4 inches but not more than 1-7/8 inches.			X
	-less than 1-3/8 inches or more than 1-7/8 inches.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Fronts	a. Length of fronts uneven by:			
	-1/4 inch but not more than 1/2 inch.		X	
	-more than 1/2 inch.	X		
	b. Underarm bust darts (left and right darts) uneven in length by more than 1/2 inch.			X
Shoulder	a. Construction.			
	1. Improperly joined or set, causing shoulder or back to twist.	*		
	2. Shoulder seam curved towards back from normal position by:			
	-more than 1/4 inch but not more than 1/2 inch.			X
	-more than 1/2 inch.		X	
	3. One or both shoulder seams not pressed open.		X	
	b. Shoulder pads.			
	1. Not completely caught in armhole tacking.		X	
	2. Misplaced, not serving intended purpose, i.e., too far back or forward.		X	
	3. One or both pads omitted.	X		
	4. Shoulder pad not properly set on shoulder, causing shoulder to twist or pucker, or causing shoulder lining or pad to bulge excessively.	*		
	c. Shoulder strap (construction and setting).			
	1. Misplaced, so that it will not lie flat when buttoned, causing bulge or twist on strap.	*		
	2. Straps misplaced, i.e., one strap further forward or backward from position of other strap, affecting appearance.		X	
	3. Misplaced so that shoulder seam is exposed (except rounded ends).		X	
	4. Poorly shaped, affecting appearance.		X	

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the currentversion before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	5. Upperside of strap full or twisted, affecting appearance.			X
	6. Width of strap at armhole seamline less than 1-5/8 inches or more than 1-7/8 inches.			X
	7. Width of strap at eyelet end of buttonhole less than 1-1/4 inches or more than 1-1/2 inches.		X	
	d. Shoulder strap buttonhole and button (position).			
	1. Button not aligned with buttonhole eyelet, causing bulge or twist on strap or puckers on shoulder, affecting appearance.		X	
	2. Buttons not uniformly set by more than 1/4 inch.			X
	3. Button stitches caught through lining.		X	
	4. Buttonhole 1/4 inch or more off center.		X	
Armholes (construction)	a. Stretched.	*		
	b. Tape set on too tight, causing puckering around armhole, affecting appearance.		X	
	c. Crooked seam line, affecting appearance.		X	
	d. Armhole not tacked completely.			X
	e. Tape stitching exposed and visible on outside surface, affecting appearance.			X
	f. Tacking of lining and interlining to armhole seams omitted on one or both armholes.	X		
	g. Tacking stitch exposed on outside of jacket.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Sleeves	a. Setting and hang.			
	1. Sleeve fullness misplaced.	*		
	2. Sleeve tight at armhole, i.e., roll effect not present on front or back part of sleeves.	*		
	3. Lower part of top or under sleeve tight, causing bulge, break or twist on sleeve at front or back base of armhole.	*		
	4. Hang of sleeves in opposite directions, i.e., one sleeve too far forward and one sleeve too far back by more than 1 inch but not more than 1-1/2 inches.		X	
	5. Sleeve back seam lines unequal distance from shoulder seam lines by 1/2 inch or more.		X	
	b. Sleeve lining.			
	1. Twisted, tight or short, causing bulge or twist on outside of sleeves.	*		
	2. Sleeve lining too long, causing lining to sag at bottom more than 1/2 inch below felling stitches to cuff hem.			X
	3. Sleeve lining seam lines out of alignment more than 3/4 inch with corresponding sleeve seam lines at armhole or back arm lining seam line at bottom of sleeve with back arm seam line of cuff.		X	
	4. Front or back arm sleeve lining seams not turned against top sleeve at armhole or bottom of sleeve.		X	
	c. Construction of sleeves.			
	1. Front or back sleeve seam not pressed open		X	
	2. Tacking on bottom turnup, one or both cuffs to sleeves omitted or insecure.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	3. Bottom edge of sleeve lining positioned less than 1 inch or more than 1-1/4 inches from bottom edge of sleeve cuff.			X
	4. Bottom fold of cuff more than 1/4 inch below bottom of sleeve.		X	
	d. Sleeve cuffs.			
	1. Top edge on top sleeve part poorly shaped, affecting appearance.		X	
	2. Height of point on both sleeves varying in length by more than 1/4 inch.		X	
	3. Sleeve puckered at joining of cuff, affecting appearance.			X
	4. Cuff puckered or twisted at joining to sleeve, affecting appearance.		X	
	5. Ends of cuff staggered at backarm seam by:			
	-1/8 inch or more but not more than 1/4 inch.			X
	-more than 1/4 inch.		X	
	6. Height of cuff at point on topsleeve:			
	-less than 4-1/2 inches			X
	-less than 4-1/4 inches or more than 5 inches but not more than 5-1/4 inches.			
	-less than 4-1/4 inches or more than 5-1/4 inches.		X	
	7. Height of cuff at backarm seam or forearm seam:			
	-less than 2-1/2 inches but not less than 2-1/4 inches or more than 3 inches but not more than 3-1/4 inches.			X
	-less than 2-1/4 inches or more than 3-1/4 inches.		X	
	8. The point of cuff not centered between the forearm and back arm folds of sleeve by more than 1/4 inch.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Fitting of front interlinings	a. Tight, short, or twisted, causing fullness or twist on outside of jacket.	*		
	b. Too full, causing front to have a wavy appearance.	*		
Front facing	a. Short, tight, or twisted, causing fullness or twist on fronts.	*		
	b. Facing long, causing bottom corner of front to curl outward.	*		
Front and bottom edges	a. Front edge stretched, affecting appearance.		X	
	b. Tape set on too tight, causing puckering on front edge, affecting appearance.		X	
	c. Front edge irregular, causing crooked or curved edges, affecting appearance.		X	
	d. Facing exposed and visible on fronts, affecting appearance (score only when clearly noticeable and the condition exists along major portion of edge).			X
	e. Front edge not forced out so that seam line is at edge having a fold of 1/8 inch or more deep.		X	
	f. Lining exposed below bottom of jacket.		X	
Linings	a. Back lining.			
	1. Excessive fullness or pleats, except center back pleat.			X
	2. Twisted, not affecting smoothness on outside of back.			X
	3. Center pleat omitted.		X	
	4. Center pleat less than 1/2 inch or more than 3/4 inch deep.			X

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
	b. Front lining.			
	1. Excessive puckering or pleats, except shoulder pleat.			X
	2. Twisted, not affecting smoothness on outside surface of fronts.			X
	3. Chest pleat at shoulder omitted.		X	
	4. Underarm bust dart omitted.		X	
	c. Underarm shields.			
	1. Top edge not securely caught in armhole tacking or felling.		X	
	2. Tacking on lower edge to lining omitted or insecure.			X
	3. Badly puckered, pleated, or twisted.		X	
	4. Underarm shields omitted.		X	
	5. Shield less than 2-1/8 inches or more than 2-3/8 inches at the vertical center.			X
	d. Lining side of armholes.			
	1. Backstitching at armpit of armholes from forearm sleeve seam line to side seam line omitted or insecure.	X		
	2. Machine tacking of shield lining or interlining to armhole omitted.	X		
Hanger	a. Omitted or ends insecurely stitched to neck edge.		X	
	b. Ends of loop measured along lower edge of collar less than 1-3/8 inches or more than 1-5/8 inches apart.			X
Bottom	a. Hem badly twisted.		X	
	b. Edge irregular by more than 1/8 inch.			X
	c. Turn under less than 1-1/2 inches or more than 1-3/8 inches.			X
	d. Bottom folded edge of lining more than 3/4 inch from bottom edge of hem.		X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

Examine	Defect	Classification Major (*)	Minor A	Minor B
Labels	a. Identification label.			
	1. Missing, incorrect or illegible.		X	
	2. Not stitched on one or more sides.			X
	3. Not on left front lining.			X
	4. Right edge more than 1/4 inch from facing-lining seam line or lower edge more than 1/2 inch above or below the top end of button opening.			X
	b. Size label.			
	1. Missing, incorrect or illegible.		X	
	2. Not securely caught in stitching and felling stitches.		X	

*4.2.3.4 Finished measurements. Any measurement deviating from nominal dimensions and tolerance specified in Table II shall be classified as a size measurement defect. Sleeve lengths uneven by 1/2 inch or more shall be classified as a size measurement defect.

*4.2.3.5 Inspection levels and AQL's. Inspection levels and AQL's expressed in defects per 100 units (DHU) shall be as follows:

4.2.3.2 and 4.2.3.3

Inspection Level III of MIL-STD-105

AQL's Major	1.5 DHU
Major and Minor A (combined)	10.0 DHU
Total Major, Minor A and Minor B (combined)	25.0 DHU

4.2.3.4

Inspection Level S-3 of MIL-STD-105

One class	4.0 DHU

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

*4.2.4 Examination of preparation for delivery requirements. An examination shall be made to determine compliance with packaging, packing and marking requirements of Section 5 of this specification. Defects shall be scored in accordance with list below. The sample unit shall be one shipping container fully packed, selected just prior to closing operation. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of containers in the inspection lot. The inspection level shall be S-2 and the AQL shall be 2.5 DHU.

Examine	Defect
Marking (exterior and interior)	Omitted; incorrect; illegible; of improper size, location, sequence or method of application.
Materials	Any component missing or damaged, affecting serviceability.
Workmanship	Inadequate application of components, such as incomplete closure of case liners, container flaps, loose strapping, inadequate stapling, bulging or distortion of containers.
Content	Number of jackets per shipping container more or less than required.

5. PREPARATION FOR DELIVERY

5.1 Packaging. Packaging shall be level A or C, as specified (see 6.2).

*5.1.1 Level A. Each jacket, in the buttoned position, shall be folded to approximately 12 by 11 inches, and placed in individual polyethylene bags measuring 18 by 12 inches with a 1-inch lip along the 12-inch dimension. The polyethlene flexible film shall be 0.0015 inch thick. Prior to or during the final heat sealing operation, excess air within the bag shall be expelled. Each bag shall contain a label (see 5.3).

*5.1.2 Level C. Jackets shall be packaged in accordance with the manufacturers' commercial practice.

5.2 Packing. Packing shall be level A, B, or C, as specified (see 6.2).

5.2.1 Level A.

*5.2.1.1 Method 1. Twenty-five (25) jackets of one size only, packaged as specified in 5.1, shall be packed in a fiberboard shipping container with liner, conforming to class weather resistanct, grade V2s, size 3A of MIL-B-17757. The fiberboard used for fabricating the liner shall be grade V3c. Each shipping container shall be assembled, closed, and reinforced as specified in the appendix thereto. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

*5.2.1.2 Method 2. When specified (see 6.2), three level B shipping containers (75 jackets of one size only), shall be packed in a fiberboard

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

shipping container conforming to class weather resistant, size No. 4 of MIL-B-17757, assembled, closed, and reinforced as specified in the appendix thereto. Towards the end of the contract, or when there is less than the amount per container of the same size, mixed sizes may be packed within the same shipping container.

*5.2.2 Level B. Twenty-five (25) jackets of one size only, packaged as specified in 5.1, shall be packed in a fiberboard shipping container with liner conforming to class domestic, size 3A of MIL-B-17757. The fiberboard used for fabricating the container and the liner shall be grade 275. Each shipping container shall be assembled and closed as specified in the appendix thereto. Towards the end of the contract, or when there is less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

*5.2.3 Level C. Jackets, folded as specified in 5.1, shall be packed in a manner to insure carrier acceptance and safe delivery at destination. Containers shall be in accordance with Uniform Freight Classification Rules or regulations of other carriers applicable to the mode of transportation.

*5.3 Marking. In addition to any special marking required by the contract or order, shipping containers shall be marked in accordance with the requirements of MIL-STD-129. A white paper label with the following information legibly printed or stamped thereon in black shall be inserted within each polyethylene bag in order to permit ready identification:

Nomenclature

Size_____ Stock number_____

Contract number

Name of contractor

*5.3.1 Mixed sizes. Each shipping container packed with mixed sizes shall have securely attached to the end and side, directly under the printing or stenciling, a white paper label 5 by 4 inches with the words "MIXED SIZES" plainly stamped or printed thereon and under these words shall be legibly printed the correct quantity and sizes contained therein.

6. NOTES

*6.1 Intended use. The jackets described herein are intended for wear only by women officers of the Marine Corps.

*6.2 Ordering data. Purchasers should exercise any desired options offered herein, and procurement documents should specify the following:

*6.2.1 Procurement requirements.

(a) Title, number and date of this specification.
(b) Sizes required (see 1.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

(c) Whether first article is required (see 3.2).
(d) Number of jackets in first article (see 3.2).
(e) Whether buttons are required (see 3.3.7).
(f) Selection of applicable levels of packaging and packing (see 5.1 and 5.2).
(g) When level A, method 2, packing is required (see 5.2.1.2).

*6.2.2 Contract data requirements. Data conforming to Data Item Descriptions. DI-R-4803, DI-R-4805, DI-T-4901, DI-T-4902, DI-T-4903 and DI-T-4904 will usually be required for delivery in connection with this specification. When so required, such data will be specified for delivery on a DD Form 1423 in the contract.


6.3 Samples and shade samples. For information regarding availability of sample jacket and standard shades specified, address inquiry to the procuring activity issuing the invitation for bids.

*6.4 First article. First article examination, test and approval shall be as specified by the contracting officer (see 3.2).

*6.5 Marginal notations. The margins of this specification are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship of the last previous issue.

Preparing activity:
Navy - MC
Project No. 8410-N223

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

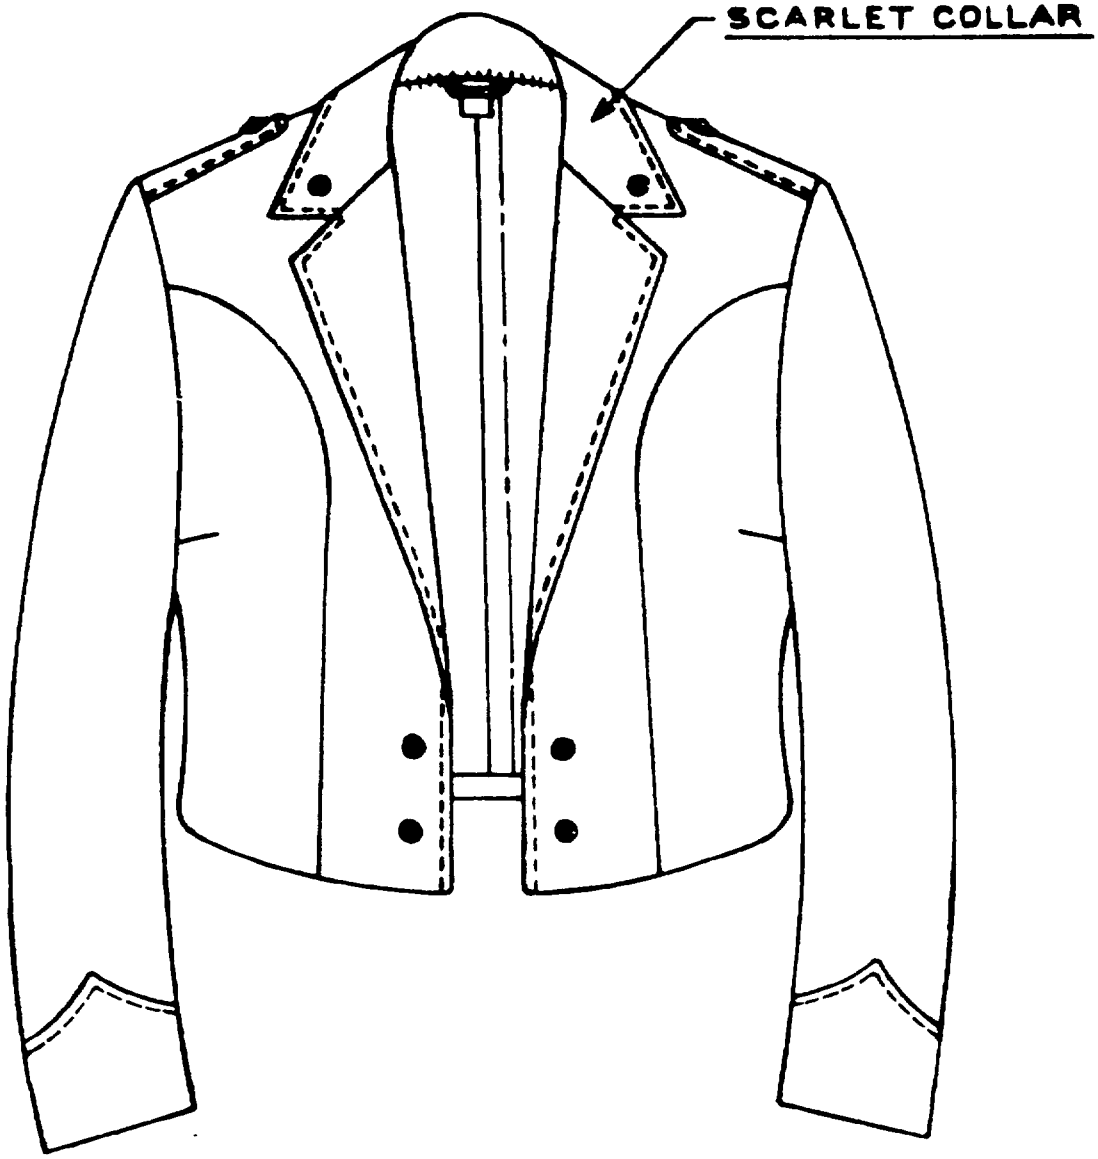


FRONT VIEW

FIGURE 1. JACKET, WOMAN'S: MESS DRESS, (OFFICER'S)

M.C.S.A.
826:R&E
12 Dec '78

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

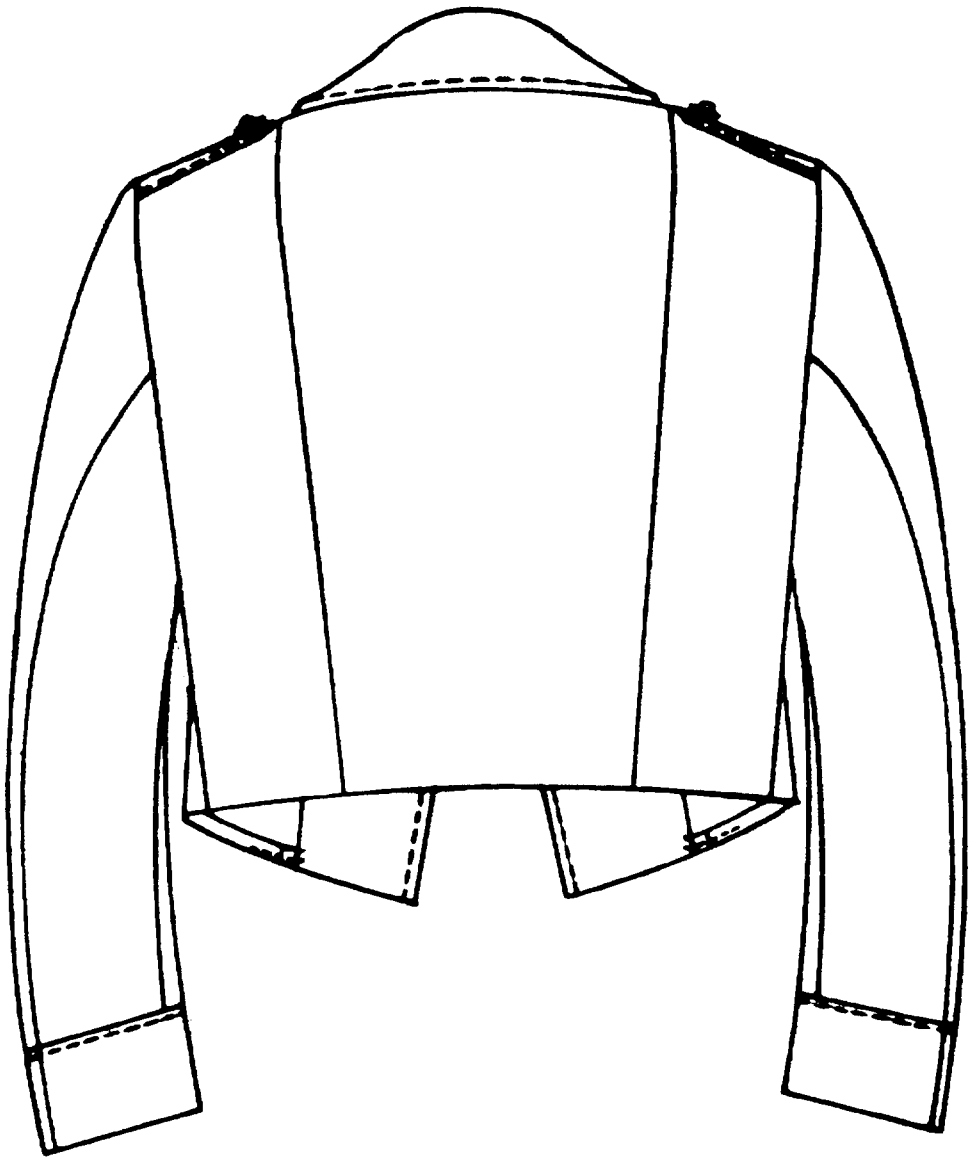


BACK VIEW


FIGURE 2. JACKET, WOMAN'S: MESS DRESS (OFFICER'S)

M.C.S.A.
826:R.O.F.
12 Dec 78


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.

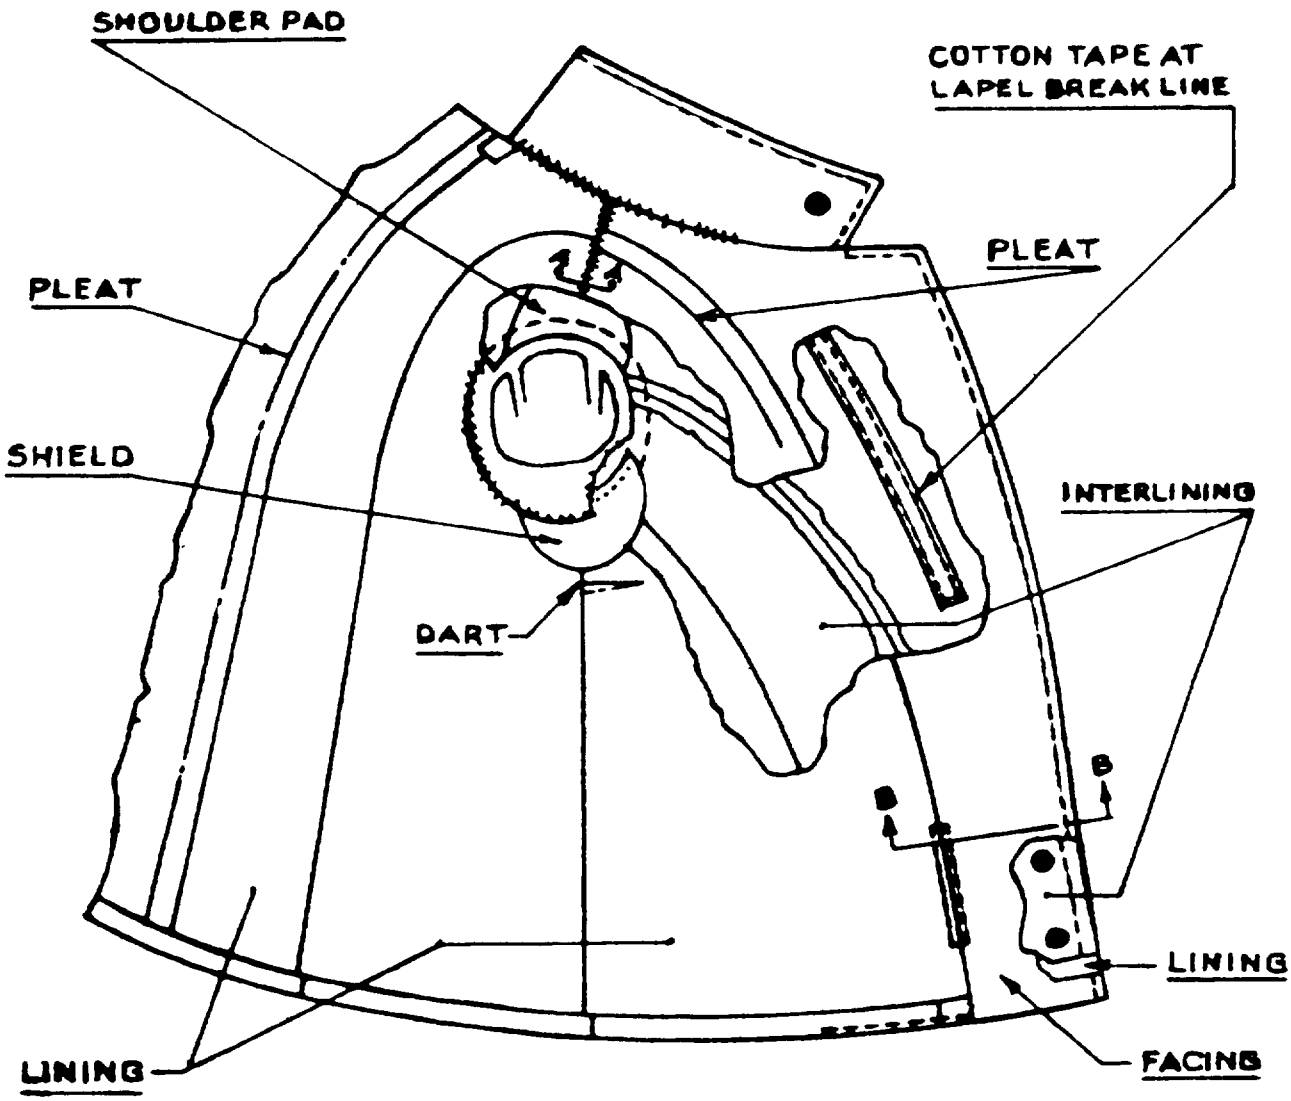

DETAIL: INSIDE LEFT FRONT

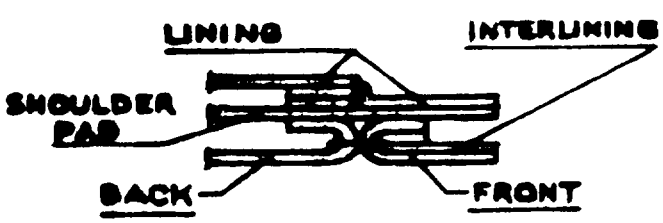

SECTION A-A

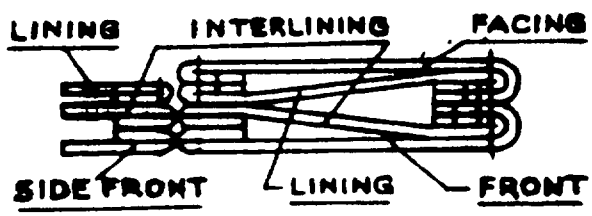

SECTION B-B

FIGURE 3. JACKET, WOMAN'S: MESS DRESS, (OFFICER'S)

M.C.R.A.
826: R&P.
12 Dec 72

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:39Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?
   A. GIVE PARAGRAPH NUMBER AND WORDING.

   B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

   ☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 68 WHICH MAY BE USED

S/N 0102-014-1802

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:39Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID
DEPARTMENT OF THE NAVY
DOD 317



OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

Commanding General (826)
Marine Corps Supply Activity
1100 South Broad Street
Philadelphia, Pennsylvania 19146

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:39Z
Check the source to verify that this is the current version before use.