MIL-P-82277C
23 June 1977
SUPERSEDING
MIL-P-82277B
15 October 1973

MILITARY SPECIFICATION

PARKA, WET-WEATHER

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope This specification covers the requirements for a waterproof parka made of a double coated nylon twill cloth.

1.2 Classification The parkas shall be one type only and in the following sizes as specified (see 6.2):

Sizes

Extra Small (30-32) Small (34-36)
Medium (38-40) Large (42-44) Extra Large (46-48)

2. APPLICABLE DOCUMENTS

* 2.1 Issues of documents The following documents of the issue in effect on date of invitation for bids or request for proposal form a part of this specification to the extent specified herein:

SPECIFICATIONS

FEDERAL

V-F-106	- Fastener, Slide, Interlocking
V-T-295	- Thread, Nylon
CCC-C-432	- Cloth, Sheeting, Cotton (Unbleached, Bleached and Dyed)

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Navy Clothing and Textile Research Facility, Natick, MA by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC 8405

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

DDD-L-20 - Label; For Clothing, Equipage and Tentage (General Use)

MILITARY

MIL-B-371 - Braid, Textile, Tubular
MIL-B-543 - Buckles, Tongueless and Web Strap
MIL-B-17757- Boxes, Shipping Fiberboard (Modular Sizes)
MIL-C-19759- Cloth, Coated, Twill, Nylon (Low Count)
MIL-F-21840- Fastener Tapes, Hook and Pile, Synthetic
MIL-T-43566- Tape, Textile, Cotton, General Purpose, Natural or in Colors

STANDARDS

FEDERAL

FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitches, Seams, and Stitchings

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129 - Marking for Shipment and Storage

(Copies of specifications, standards, drawings and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

LAWS AND REGULATIONS

US POSTAL SERVICE MANUAL

(Copies of the manual may be obtained from the Superintendent of Documents, US Government Printing Office, Washington, DC 20402.)

* 2.2 Other publications The following documents form a part of this specification to the extent specified herein. Unless a specific issue is identified, the issue in effect on date of invitation for bids or request for proposal shall apply.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Application for copies should be addressed to American Trucking Association, ATTN: Tariff Order Section, 1616 P Street, N.W., Washington, DC 20036.)

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606.)

3. REQUIREMENTS

3.1 Guide sample Guide samples, when furnished, are solely for guidance and information to the contractor (see 6.3). Variations from this specification may appear in the samples, in which case the specification shall govern.

3.2 First article When specified, (see 6.2) the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.2).

3.3 Materials

3.3.1 Basic material The basic material for the parka shall be a chloroprene coated nylon twill conforming to type II of MIL-C-19759, except that the coating shall be unvulcanized.

* 3.3.2 Cement, chloroprene The cementing compound shall have a chloroprene base and the same curing characteristics as the coating compound specified in 3.3.1. The use of reclaimed rubber is prohibited. Cemented sample seams shall have a minimum adhesion of 5 pounds per inch width (22N/2.5cm) when tested as specified in 4.3.1. The color of the cement shall approximate the shade of the green coating compound specified in 3.3.1 or shall be unpigmented.

3.3.3 Interlining, coated, cotton The finished interlining, used as a stiffener in the visor, shall be of the material specified in 3.3.3.1 equally coated on both sides with the compound specified in 3.3.3.2. When tested as specified in 4.3.1, the overall thickness of the coated interlining shall be 0.045 to 0.055 inch (1.14 to 1.40mm): the adhesion of the coating shall be not less than 10 pounds per 2 inch width (45N/5.0cm) and the stiffness of the coated interlining shall show the following bending moment:

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:40Z
Check the source to verify that this is the currenversion before use.

Interlining cloth, direction	Bending moment, inch - LB 1/ Min.	Max
Warp, inch - lb. (N.m)	0.120 (0.014)	0.140 (0.016)
Filling, inch - lb. (N.m)	0.100 (0.011)	0.120 (0.014)

3.3.3.1 Cloth, cotton, sheeting The base cloth shall conform to type VII, class 3 of CCC-C-432 except that the cloth shall not be dyed. The amount of starch and protein may exceed 2 percent, but shall not adversely affect the application or adhesion of the coating compound. As an alternate, a 5 ounce minimum weight per square yard ($0.17 Kg/m^2$), 3 harness twill which meets the specified requirements of type VII, class 3 sheeting conforming to CCC-C-432 may be substituted.

* 3.3.3.2 Coating compound The compound used for coating the cotton sheeting shall be of synthetic rubber, natural or color pigmented, and suitably compounded to meet the requirements specified in 3.3.3.

* 3.3.4 Foam, rubber The foam rubber used for cushioning the hood opening facings shall be expanded chlorinated cellular rubber, 5/32 to 7/32 inch (4.0 to 5.6mm) thick, having a closed cell structure. The foam shall have a density of 10 to 20 pounds per cubic foot (16 to 32 Kg/m^3) when tested in accordance with 4.3.1. The color of the foam rubber shall be natural or pigmented.

* 3.3.5 Braid, cotton, tubular The braid used in the hem bottom as a drawcord shall conform to type V, class 1 of MIL-B-371. The ends of the drawcord shall be dipped in a resin or provided with firmly attached plastic tips. The drawcord shall be of sufficient length to be equal to the length of the bottom of the parka for each respective size and to provide for a firm knot at each end plus a free end extending a minimum of 1/2 inch (12.7mm) beyond each knot. The color of braid shall be Olive Green 107 or shall approximate the green shade of the basic material.

* 3.3.6 Thread, nylon The nylon thread used for all seaming and stitching shall conform to type III, Size B or E of V-T-295, except that the colorfastness requirements shall not apply. The color shall be Olive Drab S-1, C.A. 66022 or shall approximate the green shade of the basic material.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

* 3.3.7 Tape, cotton The cotton tape for the hood adjustment strap assembly shall conform to type I, class 3 of MIL-T-43566. The tape shall be 5/8 inch (15.9mm) in width. The color of tape shall be Olive Green 107 or shall approximate the green shade of the basic material.

* 3.3.8 Buckles, tonguleless, 2-bar The buckles for the hood adjustment strap assembly shall conform to type II, style 3, class 3, size 5/8 inch (15.9mm) of MIL-B-543, except that the color shall be black or olive green.

3.3.9 Fastener tapes The fastener tapes shall conform to type II, class 3 of MIL-F-21840. The tapes for the neck closure shall be 2 inches (5.1cm) wide and the tapes for the sleeve cuff adjustment shall shall be 1 inch (2.5cm) wide. The color shall be Green 3422 or shall approximate the green shade of the basic material.

* 3.3.10 Fasteners, slide The slide fastener for closing the front opening shall be interlocking short tab pull, natural brass or bronze chain conforming to type IV, style 8, size M of V-F-106. The color of the tape shall be Olive Green 107 or shall approximate the green shade of the basic material. Tape shall be cotton, synthetic or a combination of both. All brass components of the slide fastener shall be furnished by the same supplier. The top tape extension beyond scoops shall be 1 3/8 inches (3.5cm) minimum.

3.3.10.1 Length of slide fasteners The length of the slide fastener chain shall be as follows:

Size of parka	Length (inches	(centimeters)
Extra Small, Small and Medium	22 ± 1/4	(55.9 ± 0.6)
Large and Extra Large	23 ± 1/4	(58.4 ± 0.6)

3.3.10.2 Thong The thong for slide fastener tab pull shall be as specified in V-F-106, except that the finished length after attachment shall be 3 to 4 inches (7.6 to 10.2cm). The color of the thong shall be Olive Green 107 or shall approximate the green shade of the basic material.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

* 3.3.11 Combination label A combination identification, size and instruction label, conforming to type IV, classes 12 and 13 of DDD-L-20 shall be printed on a suitable sized piece of unvulcanized basic material or may be marked directly on parka. All markings shall be bright yellow in color. The inscription and size of characters shall be as follows:

Inscription	Size of characters	
	INCH	(mm)
PARKA, WET WEATHER	3/16	(4.8)
CONTRACT NO: DSA 100-00-0-000 (EXAMPLE)	1/8	(3.2)
STOCK NO: 8405-00-000-0000 (EXAMPLE)	1/8	(3.2)
SIZE: MEDIUM (38-40) (EXAMPLE)	1/8	(3.2)
NAME OF CONTRACTOR:	1/8	(3.2)
INSTRUCTIONS	3/16	(4.8)
This waterproof parka has been over-	3/32	(2.4)
sized to fit over heavy clothing for	3/32	(2.4)
use under cold/wet conditions. If over-	3/32	(2.4)
sized when worn over light clothing,	3/32	(2.4)
use a smaller size. Hood sizing can be	3/32	(2.4)
adjusted by the use of the straps and	3/32	(2.4)
chin tabs.	3/32	(2.4)
DO NOT DRY CLEAN	3/16	(4.8)

3.3.12 Dusting medium The dust used in fabricating both the basic material and the parka shall be a suitable dusting medium that does not support mildew growth, with the exception that zinc stearate may be used (see 3.6.3 and 4.3.1).

3.4 Design The parka shall be jacket style with cemented side neck, shoulder, hood, and sleeve joining seams. The parka shall have a permanently attached hood, adjustable fastener tapes at neck closure, take-up straps at sides of hood, foam lined cushion around face opening, and a flexible visor. The parka shall also have two front patch pockets with flaps, slide fastener front closure with two moisture barrier flaps, tunnel hem with adjustable drawcord at bottom, and adjustable fastener tape tabs at sleeve bottoms.

3.4.1 Figures The figures are furnished for information purposes only. When inconsistencies exist between the written specification and the figures, the specification shall govern.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

3.5 Patterns Standard patterns will be furnished by the Government. The standard patterns shall not be altered in any way and are to be used for cutting the contractor's working patterns. The working patterns shall be identical to the standard patterns.

3.5.1 Pattern parts The component parts shall be cut from the material specified in accordance with the following pattern parts:

Materials	Nomenclature of pattern parts	Cut parts
Cloth, coated, nylon twill	Back	1
	Front	2
	Sleeve	2
	Pocket	2
	Pocket flap 1/	4
	Pocket strapping	2
	Moisture barrier flap (right side)	1
	Moisture barrier spacer	1
	Moisture barrier flap (left side)	1
	Hood side piece	2
	Hood center piece	1
	Hood visor	2
	Hood face opening facing	2
	Hood visor strapping (bias cut)	1
	Neck protective flap (right side)	1
	Neck protective flap (left side)	1
	Hood adjustment strap patch	4
	Sleeve adjustment tab (one piece)	2
	OR	
	Sleeve adjustment tab (two piece)	4
	Sleeve adjustment patch	2
	Sleeve tab reinforcement patch	2
Interlining, coated cotton	Visor stiffener	1
Foam, rubber	Face opening inner cushion 1/	2
Templates	Pocket V-strip marker 2/	
	Pocket finishing cement marker	
	Flap and pocket cement marker	
	Hood visor	

1/ This part may be cut in one piece.
2/ For dual application as marker and locater.

3.6 Construction

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

3.6.1 Sewn seams Stitch and seam types specified in Table I shall conform to FED-STD-751. Seam allowances shall be maintained with seams properly sewn so that no raw edges, runoffs, twists, pleats, or open seams will result. Thread breaks shall be secured by starting the repair stitch not less than 1/2 inch (12.7mm) in back of the break. Skipped stitches may be repaired using 301 stitch type. The minimum and maximum number of stitches per inch shall be as specified in Table I.

* 3.6.2 Cemented seams and parts Prior to the joining of precemented and dusted parts the surfaces to be joined shall be washed with a suitable solvent. Care shall be exercised in performing this operation to avoid solvent staining of adjacent surfaces. Unless otherwise specified in Table I all LSA type cemented seams shall overlap 1/2 to 3/4 inch (12.7 to 19.0mm). The width of the cemented area (cement margin) for seams before joining shall be a maximum of 7/8 inch (22.2mm) per single ply of material. The width of the visible cement line allowed for seams after joining shall be a maximum of 3/8 inch (9.5mm) on the outside and 3/8 inch (9.5mm) on the underside. Wherever possible, cementing shall be performed by shingling or with the aid of templates to insure that cement lines are even, uniform, and within specified tolerances. Cemented parts such as pockets and reinforcement patches, shall show a maximum cement line of 3/8 inch (9.5mm) around all outer edges. All cemented seams and parts shall be rolled to remove any puckers, tunnels or wrinkles and shall be dusted in accordance with 3.3.12. Cemented seam types specified in Table I are similar to the seam types indicated in FED-STD-751, minus the stitchline.

* 3.6.3 Dusting visible cement lines Before vulcanization, visible cement lines along edges of seams and parts shall be dusted with the minimum amount of dusting medium necessary to prevent adhesion of uncured coated fabric and cemented surfaces. Care shall be taken to insure that only the cemented areas are dusted (see 3.3.12).

* 3.6.4 Vulcanization The parkas shall be vulcanized in accordance with the time and temperature requirements supplied by the coated fabric manufacturer. A certificate of compliance shall be submitted by the garment contractor for this requirement.

* 3.7 Manufacturing operations requirements The contractor shall manufacture the parkas in accordance with every applicable operation specified in Table I. The contractor is not required to follow the exact sequence of operations listed.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

3.7.1 Shade and size marking The component parts shall be marked, ticketed or bundled to insure a uniform shade and size throughout the parka, except parts which may be cut from ends. Any method may be used except:

1. Metal fastening devices.
2. Sew-on tickets.
3. Adhesive type tickets whose adhesive causes discoloration or whose adhesive mass adheres to the material upon removal the tickets.

The use of a rubber stamp, ink pad numbering machine or pencil is acceptable provided the numbers are legible and are not visible on the outside of the parka.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
1.	Cutting a. The parka shall be cut in strict accordance with patterns furnished, which show size, shape and directional lines for cutting, and notches for proper assembly of all parts. The use of devices, such as staples, pins, etc., to hold the working patterns on the basic material during cutting, are not permitted. b. All basic fabric component parts shall be cut from one piece of material except inner ply of pocket flap, labels, strappings, patches, moisture barrier flaps, barrier spacer, and hood face opening facing, which may be cut from ends. c. The use of a drill hole is permitted only when the hole is located in an area where it will be covered in a later operation by the cement portion of a cemented component part. d. All other trimmings shall be cut in accordance with pattern or in accordance with Description of Operation when no pattern is furnished. e. The lightly coated (green) side of the basic material shall finish on the outside of the parka.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
2.	Replacement of defective components During the spreading, cutting and manufacturing process, components having material defects or damages that are classified as defects in Section 4, shall be removed from production and replaced with non-defective and properly matched components.					
*3.	Shade and size marking (see 3.7.1) All parts shall be marked, ticketed or bundled to insure a uniform shade and proper sizing of the parka except those parts cut from ends which shall closely match the major component parts of the parka.					
*4.	Make pocket and flap assembly a. Cement solid the black side of the two piece pocket flap and join together. The superimposed pieces shall have all edges even with no black coating visible from either side. As an alternate, the pocket flap may be cut in one piece and folded in half.		SSa or OSf-			
	b. Turn under the top edge of the pocket piece, where indicated by pattern marks, and cement solid to form a hem.		EFa			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
*4.	Make pocket and flap assembly (cont'd)					
	c. Fold the hem on pocket piece, face to face, to form a welt. Position the pocket flap over the pocket welt and join (stitch or cement) at each side with bottom edges of flap and pocket welt lined up evenly. When sides of assembly are stitched, the stitching shall be 1/16 to 1/8 inch (1.6 to 3.2mm) from side edges.	301	SSa-1	8-10	E or E	E or E
	d. Tack each lower corner of flap/welt assembly 1/8 to 3/16 inch (3.2 to 4.8mm) from side and bottom edges with a 3/8 to 1/2 inch (9.5 to 12.7mm) bartack. Bartack shall be parallel to the sides (ends) of flap.	Bartack		21-28 per bartack	E or E	E or E
	e. Using a template, cement a bias cut 15/16 to 1 1/16 inch (23.8 to 27.0mm) wide V-strip of basic material (see 3.3.1) to the sides and bottom edges on inside of pocket piece. One-half the width of V-strip shall overlap the pocket piece edges and shall be cemented black side to black side. The ends of the V-strip shall extend 1/2 to 5/8 inch (12.7 to 15.9mm) beyond pocket piece onto pocket flap.					
	NOTE: As an alternate, the V-strip may be cemented to the front before joining to the pocket.					
	f. Cement top of pocket flap to front of parka, as indicated by marks on pattern.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table - Construction parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
*4	Make pocket and flap assembly (cont'd) g. Stitch top of pocket flap to front of parka with two rows of 1/4 inch (6.4mm) gage stitching. The outer row of stitching shall be 1/16 to 1/8 inch (1.6 to 3.2mm) from top raw edge. The two rows of stitching shall be closed at each end with a 3/8 to 1/2 inch (9.5 to 12.7mm) bartack or with a single row of stitching at each end. Rectangular box stitching may also be used.	301 and Bartack or 301 or Boxstitch	SSa-2	8-10 21-28 per bartack 8-10 8-10	B or E	B or E
	h. Cement pocket piece, V-strip, and ends of pocket flap to front of parka.					
	i. Tack pocket flap to front at each side of flap with a 3/8 to 1/2 inch (9.5 to 12.7mm) bartack centered between the two previously stitched bartacks and 1/8 to 3/16 inch (3.2 to 4.8mm) from raw edge. Bartack shall be parallel to ends (width) of flap and shall catch the top corner of welt.	Bartack		21-28 per bartack	B or E	B or E
	j. Cut a piece of strapping approximately 1 1/2 by 11 inches (3.8 by 17.9cm) from the basic material specified in 3.3.1 and cement solid to the underside of the fronts, covering all visible pocket flap stitching, including the bartacks.		LSbj			

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread: Needle	Thread: Bobbin or Looper
*4	Make pocket and flap assembly (cont'd) k. The finished measurements of the pocket welt and pocket flaps taken at the widest point shall be as follows: Parka Sizes X Small, Small — Inches (Centimeters) Welt: 9 7/8 to 10 1/8 (25.1 to 25.7) Flap: 10 1/8 to 10 3/8 (25.7 to 26.4) Med., Lge., X-Lge Welt: 10 3/8 to 10 5/8 (26.4 to 27.0) Flap: 10 5/8 to 10 7/8 (27.0 to 27.6)					
5.	Make visor assembly a. Stitch visor sections together along the outside curved edge, face to face, 1/4 inch (6.4mm) from the raw edge.	301 or 401	LSq-2(a)	8-10	B or E	B or E
	b. Turn and topstitch 1/16 inch (1.6mm) from the folded edge.	301	LSq-2(b)	8-10	B or E	B or E
	c. Insert visor stiffener between the visor plies and stitch together along the inside curved edge 1/16 to 1/8 inch (1.6 to 3.2mm) from the raw edge of visor stiffener. Do not stitch thru the visor stiffener.	301 or 401	SSa-1	8-10	B or E	B or E

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
6.	Make hood adjustment strap assembly (see Figure 2) a. Cut a 6 1/4 to 6 1/2 inch (15.9 to 16.5cm) length of tape specified in 3.3.7.					
	b. Turn under one end 3/8 to 1/2 inch (9.5 to 12.7mm) then turn under again 1/2 to 5/8 inch (12.7 to 15.9mm) Secure end by stitching a 1/2 inch (12.7mm) box-stitch thru all plies.	301 box-stitch		8-10	B or E	B or E
	c. Thread the unhemmed edge of tape thru the underside of the front opening of buckle, passing over the first bar and down thru the center opening of buckle.					
	d. Turn under the unhemmed end 5/8 to 3/4 inch (15.9 to 19.1mm). Center the folded end on hood adjustment strap patch and join to patch with a 1/2 inch (12.7mm) cross-box-stitch.	301 cross-box-stitch		8-10	B or E	B or E
	e. Cut a 2 7/8 to 3 1/8 inch (7.3 to 7.9mm) length of tape specified in 3.3.7.					
	f. Thread tape thru back opening of buckle. Turn under end of top ply 1/4 to 3/8 inch (6.4 to 9.5mm). Fold back opposite end of tape to abut folded end of top ply. Center end of tape opposite buckle on a hood adjustemnt strap patch and join to patch with a 1/2 inch (12.7mm) cross-box-stitch.	301 cross-box-stitch		8-10	B or E	B or E

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
*7	Make sleeve adjustment tab a. Cement method (see figure 4): 1. Apply cement to the entire surface of the one or two piece adjustment tab on the black side. Place a piece of release paper large enough to cover an area of 3/4 to 1 inch (19.1 to 25.4mm) on the cemented surfaces at the straight end of tab and join the two surfaces.		SSa and OSf			
	2. Apply cement to the entire surface of the reinforcement patch on the black side.					
	3. Apply cement to an area of 3/4 to 1 inch (19.1 to 25.4mm) at the bottom of the straight end of tab on each green side.					
	4. Insert straight end of tab thru slit of reinforcement patch. Activate cement on green sides of tab and also on black side of patch. Spread ends of tab in opposite directions and join tab to patch.					
	5. Stitch a 6 1/8 to 6 3/8 inch (15.6 to 16.2cm) lengh of pile fastener tape to the green side of adjustment patch, as indicated by marks on pattern, 1/16 to 1/8 inch (1.6 to 3.2mm) from all outer edges of tape.	301	LSbj-1	8-10	B or E	B or E
	6. Apply cement to the entire surface of the adjustment patch on the black side.					
	OR					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
*7	Make sleeve adjustment tab (cont'd) b. Alternate stitch method: Stitch the one or two piece adjustment tab 1/16 to 1/8 inch (1.6 to 3.2mm) from all outer edges. Reinforcement and adjustment patches are not require with this method.	301	SSa-1 and OSf-1	8-10	B or E	B or E
	c. Stitch a 7/8 to 1 1/8 inches (22.2 to 28.6mm) length of hook fastener tape to the sleeve adjustment tab as indicated by marks on pattern, 1/16 to 1/8 inch (1.6 to 3.2mm) from edge of tape on all sides. The tape shall finish on the underside of tab on the finished parka.	301	LSbj-1	8-10	B or E	B or E
8.	Make front opening assembly (see Figure 3) a. Apply cement to the entire black side of left and right moisture barrier flaps. Fold each flap in half lengthwise and roll.		OSf			
	b. Fold moisture barrier spacer in half lengthwise and sandwich between the right moisture barrier flap and the right side slide fastener tape (side with pull tab) with all raw edges aligned. Stitch thru all plies 3/16 to 5/16 inch (4.8 to 7.9mm) from raw edges.	301	SSa-1	8-10	B or E	B or E

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil/ -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
8.	Make front opening assembly (see Figure 3) (cont'd)					
	c. Position the left side slide fastener tape over the left moisture barrier flap with the back edges aligned and stitch together 3/16 to 5/16 inch (4.8 to 7.9mm) from raw edges.	301	SSa-1	8-10	B or E	B or E
	d. Position the right moisture barrier and fastener assembly on the right front of parka, face to face, with back raw edges aligned and stitch thru all plies 3/16 to 5/16 inch (4.8 to 7.9mm) from back edge.	301	SSa-1	8-10	B or E	B or E
	e. Position the left moisture barrier and fastener assembly on the left front of parka, face to face, with back raw edges aligned and stitch thru all plies 3/16 to 5/16 inch (4.8 to 7.9mm) from back edge.	301	SSa-1	8-10	B or E	B or E
	f. Turn under the left and right fronts and cement, black side to black side, with folded edge of each front positioned 3/16 to 1/4 inch (4.8 to 6.4mm) from the back edge of the slide fastener chain.		EFa			
*	NOTE: Operations d, e, and f cannot be fully finished until the hood is attached to the neck portion of the body (see operation 10.e). The slide fastener parts shall be positioned on the moisture barrier so that the top of the slide fastener chain will be positioned 1/2 to 1 inch (12.7 to 25.4mm) above the bottom edge of the neck protective flap when the parka is completely assembled.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
9.	Make hood assembly					
	a. Cement the side hood pieces to the center hood piece, center piece over side piece, with a 3/8 to 1/2 inch (9.5 to 12.7mm) overlap.		LSa			
	b. Stitch the two hood facing pieces together across the width at the top center, 3/16 to 5/16 inch (4.8 to 7.9mm) from the raw edge.	301	SSa-1	8-10	B or E	B or E
	c. Stitch the assembled facing piece to the hood face opening, face to face, 1/4 inch (6.4mm) from the raw edge.	301	LSq-2(a)	8-10	B or E	B or E
	d. Turn facing to finished position and topstitch on the facing side, 1/16 inch (1.6mm) from the stitchline.	301	LSq-2(b)	8-10	B or E	B or E
	e. Center and cement the foam face opening cushion to the inside of the hood adjacent to the stitchline around the face opening.		SSa			
	f. Turn under the facing piece to its finished position and cement to the inside of the hood only that portion of the facing piece that is not in contact with the foam cushion.		SSj			

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
9.	Make hood assembly (cont'd)					
	g. Stitch the visor assembly to the hood as indicated by marks on pattern, with two rows of 1/4 inch (6.4mm) gauge stitching. Outer row of stitching shall be 1/8 to 3/16 inch (3.2 to 4.8mm) from raw edge.	301	LSa-1	8-10	B or E	B or E
	h. Center and cement the bias cut visor strapping over the raw edge of visor. Slit strapping so it fits over flexible part of visor at sides. The strapping shall extend a minimum of 1/2 inch (12.7mm) beyond edge of visor.		SSa			
	i. Cement hood adjustment strap patches to hood as indicated by marks on pattern. Assembly shall be positioned on hood to allow straps to be pulled toward hood opening.		SSa			
	j. Stitch a 2 1/4 long by 2 inch wide (5.7 by 5.1cm) piece of hook fastener tape to the lower right front of the hood as indicated by marks on the pattern, 1/8 to 3/16 inch (3.2 to 4.8mm) from edge of tape.	301	LSbj-1 (on all sides)	8-10	B or E	B or E
10.	Make body assembly					
	a. Cement sleeve inseams, front over back.		LSa			
	b. Cement body side seams, front over back.		LSa			
	c. Cement sleeves to body, sleeves over body.		LSa			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:46:42
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
*10	Make body assembly (cont'd)					
	d. Cement hood to body, hood over body.		LSa			
	e. Fold back front edge of hood and front and complete operations 8.d, 8.e., and 8.f.					
	f. Bartack the bottom corner of each slide fastener and the top corner of the right slide fastener to the fronts with 3/8 to 1/2 inch (9.5 to 12.7mm) long vertical bartacks.	Bartack		21-28 per bartack	B or E	B or E
	g. Turn under the raw edges of the sleeves and cement solid to form a 3/4 to 1 inch (19.1 to 25.4mm) hem.		EFa			
	OR					
	h. As an alternate, the sleeve hem may be stitched. When necessary, even off the bottom raw edge of sleeve before forming hem. Only the minimum amount of material shall be trimmed off so as not to affect the finished sleeve inseam requirement. Turn under the bottom raw edge of sleeve 5/8 to 7/8 inch (15.9 to 22.2mm) and stitch 1/8 to 1/4 inch (1.6 to 4.8mm) from the raw edge to form a 3/8 to 5/8 inch (9.5 to 15.9mm) wide hem when measured from stitchline to finished bottom edge of sleeve.	301	EFa-1	8-10	B or E	B or E

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table - Construction

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
*10	Make body assembly (cont'd) i. Activate cement on the black side of an assembled tab reinforcement patch and cement to each sleeve, centered on the inseam with the bottom edge of the patch 1 3/8 to 1 5/8 inches (3.5 to 4.1cm) from the finished sleeve bottom. The tab shall finish facing toward the front of the parka.		LSbj			
	OR					
	j. As an alternate, stitch the straight end of the sleeve adjustment tab to each sleeve, centered on the sleeve inseam with bottom edge of tab positioned 1 5/8 to 1 7/8 inches (4.1 to 4.8cm) from the finished sleeve bottom. The rounded end of the tab shall finish facing toward the front of parka.	301	cross-box-stitch	8-10	B or E	B or E
	NOTE: The adjustment tab may be stitched or cemented to the sleeve before joining the inseam.					
	k. Cement a sleeve adjustment patch assembly to each sleeve positioned so that the sleeve tab overlaps 7/8 to 1 1/8 inches (22.2 to 28.6mm) and the bottom edge of the patch is 1 5/8 to 1 7/8 inches (4.1 to 4.8cm) from the finished sleeve bottom.		LSbj			
	OR					

NCTR Form 1, 15 Sep 1967

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
*10	Make body assembly (cont'd) l. Stitch a 6 1/8 to 6 3/8 inches (15.6 to 16.2cm) long pile fastener tape to each sleeve positioned so that the tab overlaps 7/8 to 1 1/8 inches (22.2 to 28.6mm) and the bottom edge of the tape is 1 5/8 to 1 7/8 inches (4.1 to 4.8cm) from the finished sleeve bottom. Stitching shall be along all sides 1/16 to 1/8 inch (1.6 to 3.2mm) from edge of tape. Note: The adjustment patch or strip of fastener tape may be stitched or cemented to the sleeve before joining the inseam. m. When necessary, even off the bottom raw edge of parka before forming hem. Only the minimum amount of material shall be trimmed off so as not to affect the finished length requirement of parka. n. Turn under the bottom raw edge of the parka 3/4 to 1 inch (19.1 to 25.4mm) and stitch 1/8 to 1/4 inch (3.2 to 6.4mm) from the raw edge to form a tunnel-type hem to accommodate a draw-cord.	301 301	LSbj-1 EFa-1	8-10 8-10	B or E B or E	B or E B or E

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread: Needle	Thread: Bobbin or Looper
*10	Make body assembly (cont'd) o. Thread a length of tubular braid (see 3.3.5) through the tunnel hem for use as a drawcord. Knot each end allowing for a 1/2 inch (12.7mm) extension of cord beyond each knot. The drawcord shall be cut long enough to equal the bottom circumference of the parka and to allow for the knot plus a 1/2 inch (12.7mm) extension at each end.					
	p. Stitch 3/8 to 1/2 inch (9.5 to 12.7mm) long horizontal bartacks in the center of the tunnel hem 1/4 inch (6.4mm) from the left and right front ends, respectively. Do not catch drawcord in stitching.	Bartack		21-28 per bartack	B or E	B or E
*11	Make and attach neck protective flaps a. Prepare the right neck protective flap by turning under the top and diagonally cut side forming 7/16 to 9/16 inch (11.1 to 14.3mm) wide hems, as indicated by marks on pattern. Trim hems to form point and cement					
	b. Cut, overlap, and cement the dart as indicated by marks on pattern.					
	c. Position and cement the right neck protective flap to the inside of parka at top of right moisture barrier flap and front opening at neck, as indicated by marks on pattern.		LSa			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread	
					Needle	Bobbin or Looper
*11	Make and attach neck protective flaps (cont'd) d. Bartack the top corner of the right protective flap to the hood with a 3/8 to 1/2 inch (9.5 to 12.7mm) vertical bartack.	Bartack		21-28 per bartack	B or E	B or E
	e. Stitch a 1 1/2 inch long by 2 inch wide (3.8 by 5.1cm) pile fastener tape to the face (green) side of the left neck protection flap, where indicated by marks on the pattern, 1/16 to 1/8 inch (1.6 to 3.2mm) from all outer edges of tape.	301	LSbj-1	8-10	B or E	B or E
	f. Apply cement to black side of left neck protective flap, except that 1 inch (25.4mm) from each end of flap shall remain uncemented. Fold flap in half widthwise, as indicated by marks on pattern and join cemented surfaces together.		OSf			
	g. Center and cement the free ends of the left flap on the front straight edge of the hood. The hood shall be sandwiched between the free ends.					
	h. Bartack the top corner of the left neck protective flap to the hood with a 3/8 to 1/2 inch (9.5 to 12.7mm) vertical bartack.	Bartack		21-28 per bartack	B or E	B or E

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table I - Construction of parka (cont'd)

No.	Description of Operation	Stitch Type	Seam and Stitching Type	Stitches Per Inch	Thread: Needle	Thread: Bobbin or Looper
*11	Make and attach neck protective flaps (cont'd) i. Bartack the lower corner of the left neck protective flap to the hood with a 3/8 to 1/2 inch (9.5 to 12.7m) vertical bartack. The stitching shall pass through the slide fastener tape and the moisture barrier flap.	Bartack		21-28 per bartack	B or E	B or E
	j. Cut strapping in suitable sizes from the basic material specified in 3.3.1 and cement to the underside of the parka, covering the four neck protective flaps bartacks and hook fastener tape stitching on right front.		LSbj			
*12	Label Cement the combination identification-size-instruction label or print label inscription directly on inside of parka approximately 1 inch (25.4mm) below the neck joining seam on back panel.					
13	Vulcanization The assembled parka shall be fully vulcanized using a heat curing or pressure vulcanizing process.					
*14.	Cleaning a. Trim all thread ends to less than 1/2 inch (12.7mm) b. Clean all removable spots, stains, and shade/size markings on outside of parka, taking care not to damage coating in the process.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

3.8 Sizes and measurements Sizes and measurements of the finished parka shall be as shown in Table II. All measurements and tolerances are expressed in inches and centimeters.

Table II - Finished measurements

Size	Chest A	Bottom B	Length C	Sleeve inseam D
X-Small 30-32	22 5/8 (57.5)	22 5/8 (57.5)	28 (71.1)	17 (43.2)
Small 34-36	24 5/8 (62.5)	24 5/8 (62.5)	28 3/8 (72.1)	18 (45.7)
Medium 38-40	26 5/8 (67.6)	26 5/8 (67.6)	28 3/4 (73.0)	19 (48.3)
Large 42-44	28 5/8 (72.7)	28 5/8 (72.7)	29 1/8 (74.0)	19 1/2 (49.5)
X-Large 46-48	30 5/8 (77.8)	30 5/8 (77.8)	29 1/2 (74.9)	20 (50.8)
Tolerance	± 1/2 (1.3)	± 1/2 (1.3)	± 1/2 (1.3)	± 1/2 (1.3)

NOTE: Refer to Figure 1 for A, B, C and D measurements. All measurements shall be taken with the parka laid flat and the slide fastener completely closed.

A. Measure across front at bottom of armhole, from folded edge to folded edge.
B. Measure across bottom from folded edge to folded edge.
C. Measure at base of collar seam at center back to bottom of parka.
D. Measure from base of armhole along inseam to bottom of sleeve.

* 3.9 End item performance testing The vulcanized cemented seams shall conform to the requirements listed in Table II when tested as specified in 4.4. The requirements listed do not refer to stitched or strapped seams.

Table III - Requirements for cemented seams in end item

Characteristics	Requirements Average, Min.	Individual, Min.
Seam strength, lbs 1/	150	100
Seam adhesion - lbs/1 inch width 2/	5.0	4.0
Hydrostatic resistance - lb/sq in 3/		
Initial	100	50
After 1 dry cleaning	80	50
After 3 launderings	80	50

1/ Metric conversion to newton multiply lbs. by 4.45.
2/ Metric conversion to newton/2.5cm multiply lbs/inch width by 4.45.
3/ Metric conversion to pascal multiply lbs/sq inch by 6.894 X 10^3 .

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

3.10 Coating repairs on parkas

* 3.10.1 Black coated side (inside) Pinholes and uncoated areas of any type shall be repaired either before or after curing the assembled parkas with the black coating compound specified in 3.3.1. When parkas are repaired after curing, the repair compound shall be formulated to cure at room temperature. The size of the inside repair shall not exceed 3/4 inch (19mm) in length and width. The number of repairs allowed per parka on the black coated side shall not exceed four. The repairable area shall be coated with a minimum of two coats of the repair compound. The first coat shall completely wet out the defective area and shall be thoroughly worked into the surface. The second coat shall be spread on smoothly and evenly over the first coating. After the compound is dry, the repaired area shall be lightly dusted with the dusting powder specified in 3.3.12. When fully cured there shall be no lifting of the edges, cracking, flaking or removal of the repair compound from the inside repaired area when subjected to a flexing action between the hands.

*3.10.2 Green coated side (outside) Any area where the nylon base fabric is exposed shall be touched-up (hidden), before or after curing, with a suitably thinned solution of the green coating compound specified in 3.3.1. When parkas are repaired after vulcanization the touch-up solution shall be formulated to cure at room temperature. Only the minimum amount of solution necessary to hide the uncoated area shall be applied. The number of repairs allowed per parka on the green coated side shall not exceed two. The color of the repaired areas shall be a good match to the surrounding coating.

3.11 Workmanship The finished parkas shall conform to the quality established by this specification. The occurrence of defects shall not exceed the applicable acceptable quality levels.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements as specified herein unless disapproved by the Government. The Government reserves the right to perform any of the inspection set forth in the specification where such inspection are deemed necessary to assure supplies and services conform to prescribed requirements.

4.1.1 Certificate of compliance Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

4.2 First article inspection When required, the first article submitted in accordance with 3.2 shall be inspected for compliance with design, construction, workmanship, dimensional requirements, and end item testing.

4.3 Inspection Inspection shall be in accordance with the provisions set forth in MIL-STD-105, except where otherwise indicated.

* 4.3.1 Component and material inspection In accordance with 4.1, components and materials shall be inspected and tested in accordance with all the requirements of referenced specifications, drawings, and standards unless otherwise excluded, amended, modified, or qualified in this specification or applicable purchase document. In addition, components and materials listed in Table IV and below, shall be tested for the characteristics specified and in accordance with the referenced test methods of FED-STD-191, unless otherwise specified. The unit of product for lot formation and testing shall be as shown below. The lot shall be unacceptable if one or more units fail to meet any requirement specified. All test reports shall contain the individual values utilized in expressing the final result.

Component	Lot Size Expressed As	Sample Unit For Testing
Cloth, coated nylon twill (vulcanized)	Yards	3 continuous yards, full width
Interlining, coated cotton sheeting	Yards	1-1/2 yards

The sample size (number of units of product) shall be as shown below:

Lot Size	Sample Size
800 or less	2
801 thru 22,000	3
22,001 and up	5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table IV - Instructions for component testing

Component	Characteristics	Requirement paragraph	Test method
Cloth, coated, nylon twill (vulcanized)	Blocking	3.3.1	
	Breaking strength	3.3.1	
	Weight	3.3.1	
	Tear strength	3.3.1	1/
	Hydrostatic resistance	3.3.1	
	Flex stiffness	3.3.1	
	Adhesion of coating	3.3.1	
	Resistance to heat	3.3.1	
Cement, chloroprene	Identification	3.3.2	2/
	Seam adhesion	3.3.2	5960 3/
Interlining, coated cotton sheeting	Adhesion of coating	3.3.3	5970 4/
	Thickness	3.3.3	5030 5/
	Stiffness	3.3.3	5202 6/
Foam, rubber	Identification	3.3.4	2/
	Thickness	3.3.4	2/
	Density	3.3.4	2/
Dusting powder	Resistance to mildew growth	3.3.12	2/

1/ Three yards of unvulcanized cloth shall be cured under conditions similar to those used on the end item and shall be tested to meet the requirements specified in paragraph 3.3.3.4 of MIL-C-19759 for Type II vulcanized cloth.

2/ A certificate of compliance shall be submitted for this requirement.

3/ Cemented seam specimens shall be prepared in accordance with 3.6.2, except that the seam shall overlap 1 1/4 inches (3.2cm). After vulcanization, a 1 inch (2.5cm) wide by 6 inch (15.2cm) long strip shall be marked and cut from the overlapped seam in the length direction.

4/ Actual separation of the coating from the basic cloth shall not be required if the adhesion of the cement registers higher than the adhesion requirement for the coating.

5/ Paragraph 4.1.4 of Test Method 5030 shall be used, except that thickness shall be determined with a total load of 0.10 pounds per square inch (689 Pa) only.

6/ Test Method 5202 applies, excpet that a 20 degree angular deflection and a moment weight of 0.255 pounds (0.115Kg) shall be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

4.3.2 Examination of the end item Examination of the end item shall be in accordance with 4.3.2.1 and 4.3.2.2. The applicable inspection levels and acceptable quality levels (AQL's) shall be as indicated in 4.3.2.3. The sample unit shall be one finished parka. The lot size shall be expressed in units of parkas.

* 4.3.2.1 Visual examination The parkas shall be examined for defects classified in accordance with the list below:

Defect	Classification Major	Minor
I MATERIAL DEFECT(S) AND DAMAGE(S)		
A. Cloth, coated, nylon		
1. Any stitched mend or cemented cut patch	X	
2. Any hole, cut, tear or burn	X	
3. Any pinhole, blister, lump or imbedded foreign matter	X	
4. Any weak or thin area	X	
5. Abraded or scuffed, resulting in a weak place or coating removal	X	
6. Permanent crease or wrinkle	X	
7. Any pickoff or uncoated area	X	
8. Any tackiness	X	
9. Coating soft, not fully cured	X	
10. Any brittle area, coating cracks when bent	X	
11. Any objectionable odor	X	
II SEAMS AND STITCHINGS		
A. General		
1. Any seam twisted, puckered or pleated	X	
2. Part of garment caught in an unrelated cementing or stitching operation		X
B. Cemented seams, patches, and strapping		
1. Poorly rolled forming:		
(a) An open tunnel:		
(1) Extending for up to 1/2 the width of the seam, patch or strapping		X
(2) Extending for more than 1/2 the width of seam, patch or strapping	X	
(b) A permanent pucker, wrinkle, fold or closed tunnel		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Defect	Classification Major	Minor
II SEAMS AND STITCHINGS (cont'd)		
2. Seam overlapped less than 1/2 inch (12.7mm) or more than 3/4 inch (19.0mm)		X
3. Direction of seam lap other than specified		X
4. Any loose or unaffixed edge with a:		
(a) Length:		
(1) -up to 1/4 inch (6.4mm) inclusive		X
(2) - more than 1/4 inch (6.4mm)	X	
(b) Depth:		
(1) -up to 1/8 inch (3.2mm) inclusive		X
(2) -more than 1/8 inch (3.2mm)	X	
5. Dusting powder omitted or improperly applied causing adhesion between two surfaces	X	
6. Visible cement line more than 3/8 inch (9.5mm) wide for more than 1/2 the length of seam		X
7. Excessive cement resulting in adhesion of surfaces that were not required to be cemented	X	
C. Stitches seams		
1. Stitching margin not as specified		X
2. Ends not securely tacked		X
3. Any open seam (see Note)		
(a) -1/4 to 1/2 inch, inclusive (6.4 to 12.7mm)		X
(b) -more than 1/2 inch (12.7mm)	X	
NOTE: One or more broken stitches or two or more continuous skipped or runoff stitches constitute an open seam.		
4. Loose tension resulting in a loosely secured seam		X
5. Tight tension (stitches break when normal strain is applied in the direction of the seam or stitching	X	
D. Stitches per inch (score only when condition exists on more than 1/2 the length of seam)		
1. One stitch less than the minimum or any number in excess of the maximum specified		X
2. Two or more stitches less than the minimum specified	X	

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:40Z
Check the source to verify that this is the current version before use.

Defect	Classification Major	Minor
II SEAMS AND STITCHINGS (cont'd)		
E. Seam and stitch types		
1. Not specified seam or stitch type	X	
2. Any line of stitching not beginning or not ending where specified		X
3. Any required line of stitching omitted	X	
F. Bartack(s)		
1. Missing or misplaced; not serving intended purpose	X	
2. Not size specified		X
3. Insecure or loose stitch tension		X
III CLEANNESS		
1. Any permanent spot, stain, (except solvent) streak or assembly marking on any outside portion of the parka which would be visible when garment is worn		
a. More than 1/2 inch (12.7mm) in diameter or length	X	
b. Up to 1/2 inch, inclusive (12.7mm) in diameter or length		X
2. Any size permanent spot, stain, (except solvent) streak or assembly marking not visible on outside when parka is worn		X
3. Two or more removable spots, stains, streaks or assembly markings on outside of parka		X
4. Six or more thread ends not trimmed to less than 1/2 inch (12.7mm)		X
5. Cement on any area other than where specified		X
6. Excessive dusting powder distributed over seams, patches, and/or strapping outside only		X
7. Excessive dusting powder on any area other than seams, patches, and/or strapping outside only		X
8. Excessive solvent staining on outside		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Defect	Classification Major	Minor
IV COMPONENT AND ASSEMBLY (unless otherwise classified)		
1. Any component omitted, misplaced, damaged or otherwise defective	X	
2. Any required operation omitted	X	
3. Any required operation not as specified		X
4. Any component not type specified		X
V REPAIRED AREA(S)		
1. Repair compound on coated fabric cracks, lift offs or flakes when coated fabric is flexed between the hands		X
2. Repair compound not smoothly or evenly applied		X
3. Repair compound does not cover defective area		X
4. Repaired area not dusted		X
5. Size of repair more than 3/4 inch (19.1mm) in length or width		X
6. Repaired areas number more than four on black side or more than two on green side		X
7. Color of repaired area on green side not good color match		X
VI CUTTING		
Any part not cut in accordance with directional lines indicated on patterns or not in accordance with specification requirements	X	
VII SHADED PART(S)		
Any outside part badly shaded, except those which may be cut from ends		X
VIII POCKET(S), FLAP(S), AND WELT(S)		
A. General		
1. Set on crookedly or poorly shaped	X	
2. V-strip omitted or misplaced	X	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Defect	Classification Major	Minor
VIII POCKET(S), FLAP(S), AND WELT(S) (cont'd)		
B. Welt:		
1. Irregular in width		X
2. Less than 9 7/8 inches (25.1cm) or more than 10 1/8 inches (25.7cm) long for sizes X-Small and Small		X
3. Less than 10 3/8 inches (26.4cm) or more than 10 5/8 inches (27.0cm) long for sizes Medium, Large, and X-Large		X
C. Flap:		
1. Irregular in width		X
2. Less than 10 1/8 inches (25.7cm) or more than 10 3/8 inches (26.4cm) long for sizes X-Small and Small		X
3. Less than 10 5/8 inches (27.0cm) or more than 10 7/8 inches (27.6cm) long for sizes Medium, Large, and X-Large		X
4. Out of horizontal alignment with each other by 1/2 inch (12.7mm) or more		X
IX VISOR ASSEMBLY		
1. Not securely stitched to hood	X	
2. Any part of interlining (stiffener) caught in visor seam	X	
3. Visor finished too short or too tight causing twisting or puckering	X	
X ADJUSTMENT STRAP(S) AND TAB(S)		
1. Omitted or insecurely attached	X	
2. Misplaced or distorted:		
a. Not serving intended purpose	X	
b. Serving intended purpose		X
3. Not secured in specified manner	X	
4. Strap incorrectly threaded thru buckle		X

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

Defect	Classification Major	Minor
XI FRONTS		
Closed fronts uneven at bottom by 1/2 inch (12.7mm) or more		X
XII DRAWCORD		
1. Other than type specified	X	
2. Length not as specified	X	
3. Not knotted		X
4. Free length of cord less than 1/2 inch (12.7mm) beyond knot		X
5. Not dip coated or tipped at end		X
6. Caught by stitching, including bartack	X	
XIII SLIDE FASTENER		
1. Stitching too close to chain not permitting slider to pass freely	X	
2. Ends of chain uneven by 1/4 inch (6.4mm) or more	X	
3. Any part broken, bent, or otherwise damaged	X	
4. Length of slide fastener not as specified		X
5. Thong omitted or not as specified		X
6. Top of slide fastener below bottom of neck protective flap	X	
7. Tape set on too loose or too tight causing waviness, twisting or fullness when fastener is closed		X
NOTE: Slide fastener shall be checked for proper function by opening and closing at least two times.		
XIV HEMS		
1. Puckered, twisted or pleated		X
2. Irregular in width by 1/4 inch (6.4mm) or more		X
3. Width of sleeve hems not as specified		X
4. Width of bottom hem less than 3/4 inch (19.1mm)	X	
5. Width of bottom hem more than 1 inch (25.4mm)		X

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Defect	Classification Major	Minor
XV HOOD		
1. Foam cushion misplaced, not serving intended purpose	X	
2. Neck flap misplaced or distorted, not serving intended purpose	X	
XVI MOISTURE BARRIER FLAP(S)		
1. Top edge of moisture barrier flaps below bottom edge of neck protective flap	X	
2. Positioned improperly, slide fastener will not function properly	X	
3. Set too tight or twisted, causing puckers on outside of parka		X
XVII LABEL		
1. Missing, incorrect, or illegible	X	
2. Misplaced		X
3. Not securely cemented (when applicable)		X

4.3.2.2 Dimension examination The parkas shall be examined for defects in dimensions in accordance with the following:

a. Any measurement deviating from nominal dimensions and tolerances specified in Table II shall be scored as a measurement defect.

b. Sleeve lengths unequal in length by 1/2 inch (12.7mm) or more shall be scored as a size measurement defect.

4.3.2.3 Inspection levels and acceptable quality levels The inspection levels and acceptable quality levels (AQL's) expressed as defects per 100 units, for visual and dimensional examinations shall be as follows:

	AQL's	Inspection level
For visual examination in 4.3.2.1:		
Major	2.5	II
Total (Major and Minor combined	15.0	II
For dimensional examination in 4.3.2.2:		
One class	4.0	S-3

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

4.3.3 Examination of packaging requirements An examination shall be made to determine that packaging, packing, and marking comply with Section 5 requirements. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully prepared for delivery except that it need not be closed. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the end item inspection lot. The inspection level shall be S-2 and the AQL shall be 2.5 defects per 100 units.

Examine	Defect
Marking (exterior and interior)	Omitted, incorrect, illegible, improper size, location, sequence or method of application.
Materials	Any component missing, damaged, or not as specified.
Workmanship	Inadequate application of components, such as incomplete closure of container flaps, improper taping, loose strapping, or inadequate stapling; bulging or distortion of container.
Content	Number of parkas per shipping container is more or less than specfied.

* 4.4 Testing of the end item The methods of testing specified in FED-STD-191, wherever applicable, and as listed in Table V shall be followed. Tests shall be conducted on cemented seams cut from three finished parkas randomly selected from each assembled shipping lot. Failure of any of the specimens tested to meet either the individual or average test requirements shall be cause for rejection of the lot. Test reports shall contain the individual test values.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

Table V - End item testing of cemented seams in end item

Characteristic	Requirement paragraph	Test method	Number of tests per garment
Seam strength, initial	3.9	5100 1/	4
Seam adhesion, initial	3.9	5960 2/	3
Hydrostatic			
Initial	3.9	5512 3/	2
After 1 dry cleaning	3.9	5508 and 5512 3/	2
After 3 launderings	3.9	5556 and 5512 3/	2

1/ A 4X6 inch (10.2 X 15.2cm) test specimen shall be cut from a side, sleeve, armhole and neck seam. The seam shall be centered equidistant from the clamps at right angles to the direction of load application.

2/ The result shall be calculated and reported to the nearest 0.1 pounds per inch by dividing the actual width of the seam tested into the actual test result recorded in pounds.

3/ Water pressure shall be applied to the lightly (green) coated side with the seam centered directly over the circular opening of clamp.

5. PACKAGING

5.1 Preservation-packaging Preservation-packaging shall be level A or C as specified (see 6.2).

* 5.1.1 Level A Each parka shall be folded as follows: (1) Close slide fastener, neck tab, buckles, and sleeve adjustments. (2) Fold visor up. (3) Lay parka flat, face-down. (4) Fold the body in thirds lengthwise so that the folded width shall be approximately 11 inches (28cm). (5) Fold bottom of parka up approximately 10 inches (25cm) and then fold in half again by bringing down top of hood to meet the folded bottom. The folded parka shall measure approximately 11 by 15 inches (28 by 38.cm). Each folded parka shall be individually inserted in a snug-fitting polyethylene bag as hereinafter specified.

* 5.1.1.1 Polyethylene bag The bag shall be made of clear polyethylene film of 0.0015 inch (0.038mm) thickness (± 20 percent tolerance). The bag shall be formed with heat sealed seams that are straight, continuous and parallel to each other and the formed edges of the bag. The final closure of the bag shall be heat sealed with the heat seal made as close as possible to the open end. The bag may be fabricated from polyethylene film tubing or sheeting. A 1/4 inch (6.4mm) diameter hole shall be made at one corner of the polyethylene bag to allow excess air to escape. Alternatively, the final closure of the polyethylene bag may be accomplished by means of a tuck or reverse flap.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

5.1.2 Level C Commercial Packaging) Parkas shall be packaged to afford adequate protection against physical damage during shipment from the contractor to the first receiving activity. The contractor may use his standard practice when it meets this requirement.

5.2 Packing Packing shall be level A, B, or C (see 6.2).

* 5.2.1 Level A Twenty (2) parkas, of one size only, packaged as specified in 5.1, shall be packed in a corrugated fiberboard shipping container conforming to type SF, class weather-resistant, size 3A, grade V2s of MIL-B-17757. Each shipping container shall be fitted with a liner conforming to type CF, class weather-resistant, variety DW, grade V15c of MIL-B-17757. Closure and reinforcement requirements shall be as specified in the appendix of the box specification. Level A packages shall be packed flat, in two tiers of ten each, with each package reversed end to end and the length of the package parallel to the end panels of the container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Toward the end of the contract or when there are less than the required amount per container of the same size, mixed sizes may be packed in the same shipping container.

* 5.2.2 Level B Twenty (20) parkas, of one size only, packaged as specified in 5.1, shall be packed in a corrugated fiberboard shipping container conforming to type CF, class domestic, size 3A, variety SW, grade 275 of MIL-B-17757. Each shipping container shall be fitted with a liner conforming to type CF, class domestic, variety DW, grade 200 of MIL-B-17757. Closure requirements shall be as specified in the appendix of the box specification. Level A packages shall be packed flat, in two tiers of ten each, with each package reversed end to end and the length of the package parallel to the end panels of the container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Towards the end of the contract or when there are less than the required number per container of the same size, mixed sizes may be packed in the same shipping container.

5.2.2.1 Weather-resistant fiberboard container When specified (see 6.2), the shipping container shall be a grade V3c, V3s or V4s fiberboard box fabricated in accordance with MIL-B-17757 and closed in accordance with the appendix of the container specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

5.2.3 Level C (Commercial packing) Parkas packaged as specified in 5.1, shall be packed in a manner to insure carrier acceptance and safe delivery at destination at the lowest transportation cost for such supplies. Containers shall be in accordance with the US Postal Service Manual, Uniform Freight Classification Rules or National Motor Freight Classification Rules, as applicable.

5.3 Marking In addition to any special marking required by the contractor or order, shipping containers shall be marked in accordance with MIL-STD-129.

5.3.1 Polyethylene bagged packages Polyethylene bagged packages shall have the following information legibly printed or stamped in black directly on the bag across the center face or on a white paper label inserted within the bag so as to permit ready identification.

STOCK NUMBER
PARKA, WET WEATHER
SIZE
QUANTITY

5.3.2 Labels, mixed sizes Each shipping container, packed with mixed sizes, shall have securely attached to the end and side, directly under the printing or stenciling, a white paper label 5 by 4 inches (12.7 by 10.2cm) with the words "MIXED SIZES" plainly printed or stamped thereon and under those words shall be legibly printed or stamped the correct quantity and each size contained therein.

6. NOTES

6.1 Intended use The waterproof parkas are intended for use in conjunction with the wet weather overalls for protection of Military personnel working in wet or wet/cold conditions.

6.2 Ordering data Procurement documents should specify the following:

a. Title, number, and date of this specification.
b. Sizes required (see 1.2).
c. First article requirements (see 3.2).
d. Selection of the applicable levels of packaging and packing (see 5.1 and 5.2).
e. When weather-resistant grade fiberboard shipping containers are required for level B packing (see 5.2.2.1).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

6.3 Samples For access to samples, address the procuring office issuing the invitation for bids.

6.4 Changes from previous issue The margins of this specification are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

Custodians:
Army - GL
Navy - SA
Air Force - 99

Review activities:
Army - GL, MD
Air Force - 99
Navy - MC
DLA-CT

Preparing Activity:
Navy - SA

Project No. 8405-0716

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.



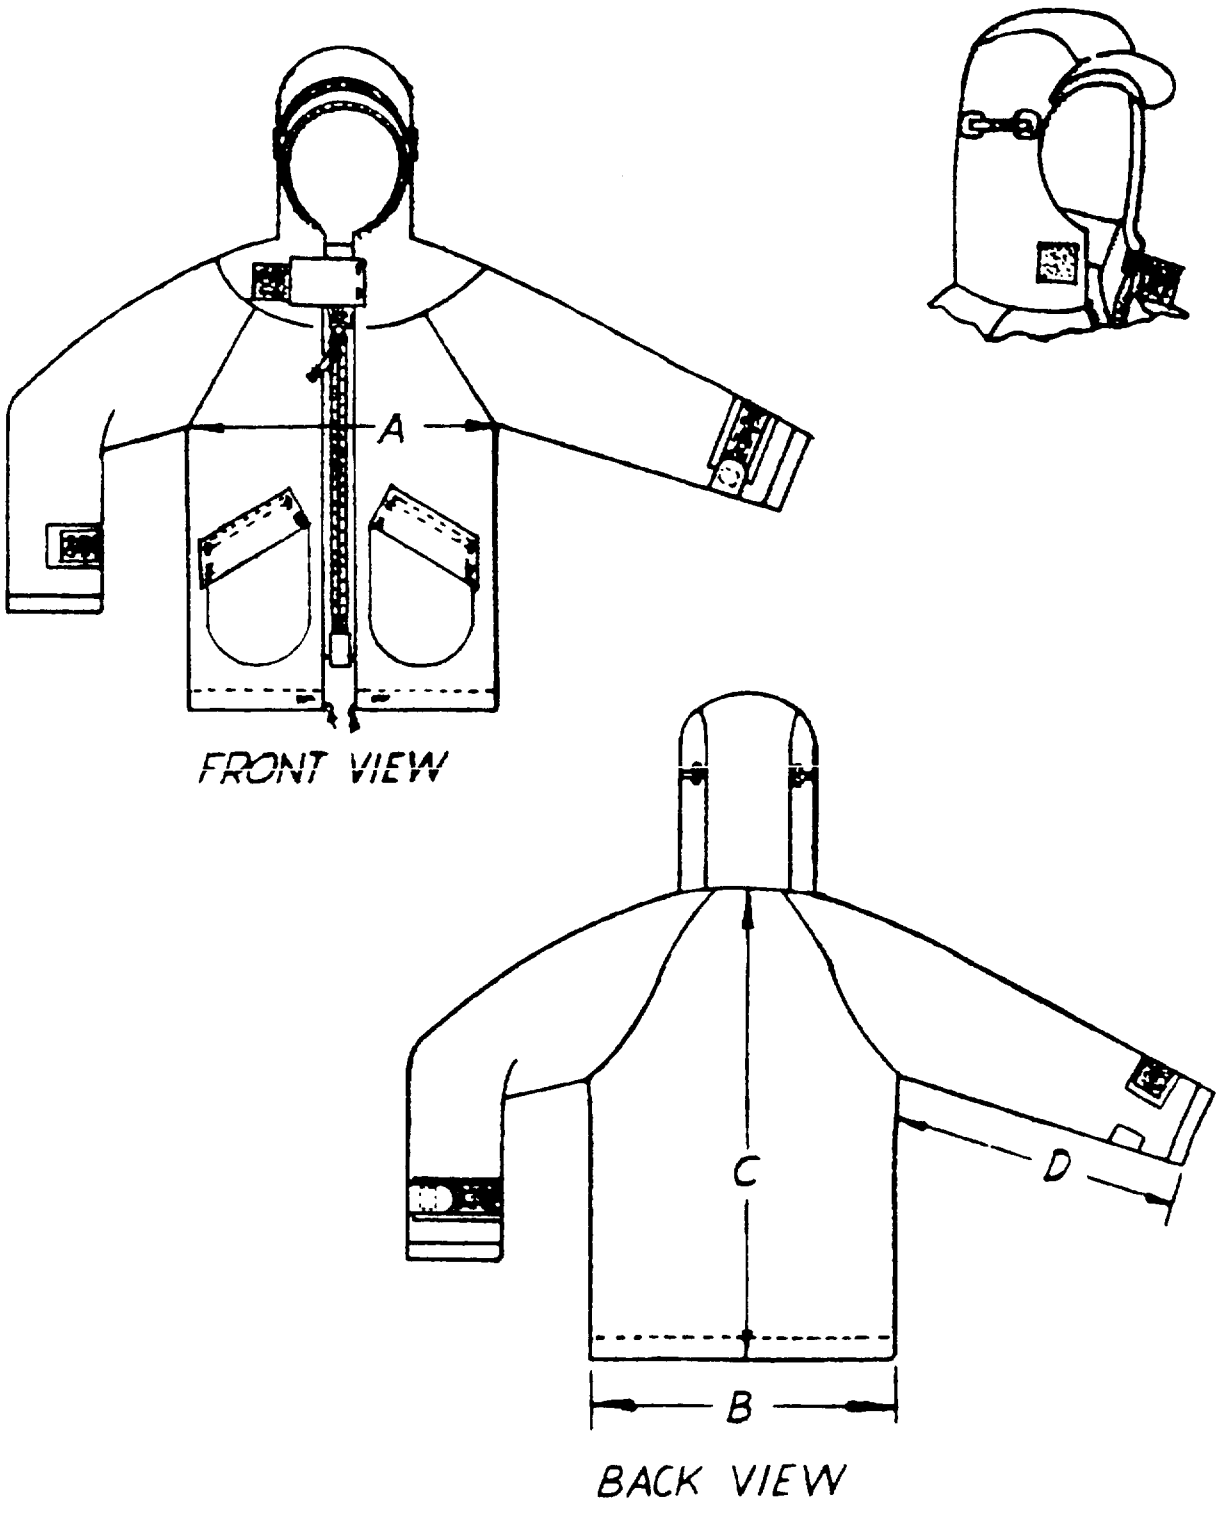


FIGURE-1 PARKA, WET WEATHER

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

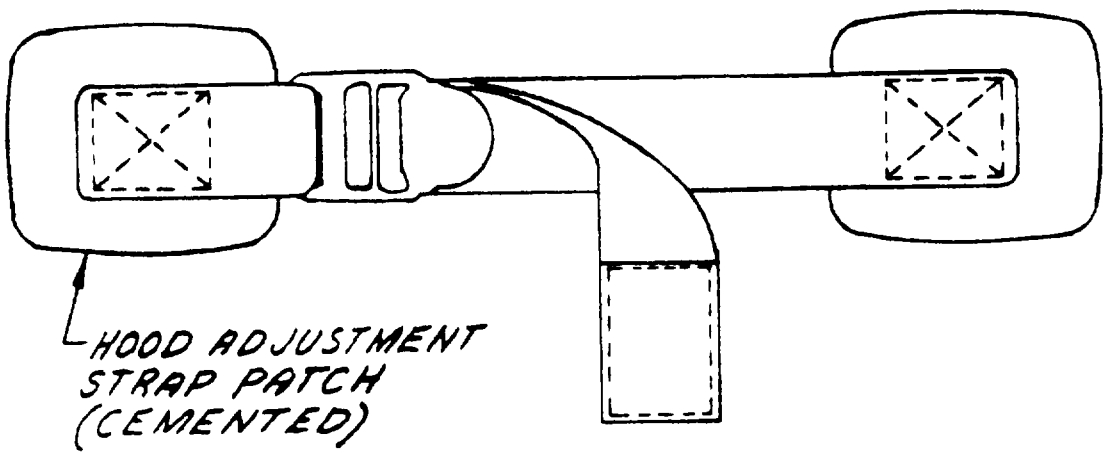


TOP VIEW

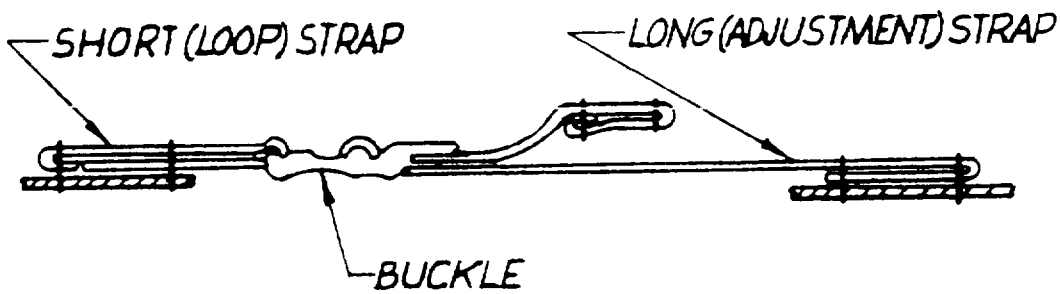

SIDE VIEW

HOOD ADJUSTMENT STRAP AND BUCKLE ASSEMBLY
FIGURE 2-PARKA, WET WEATHER

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

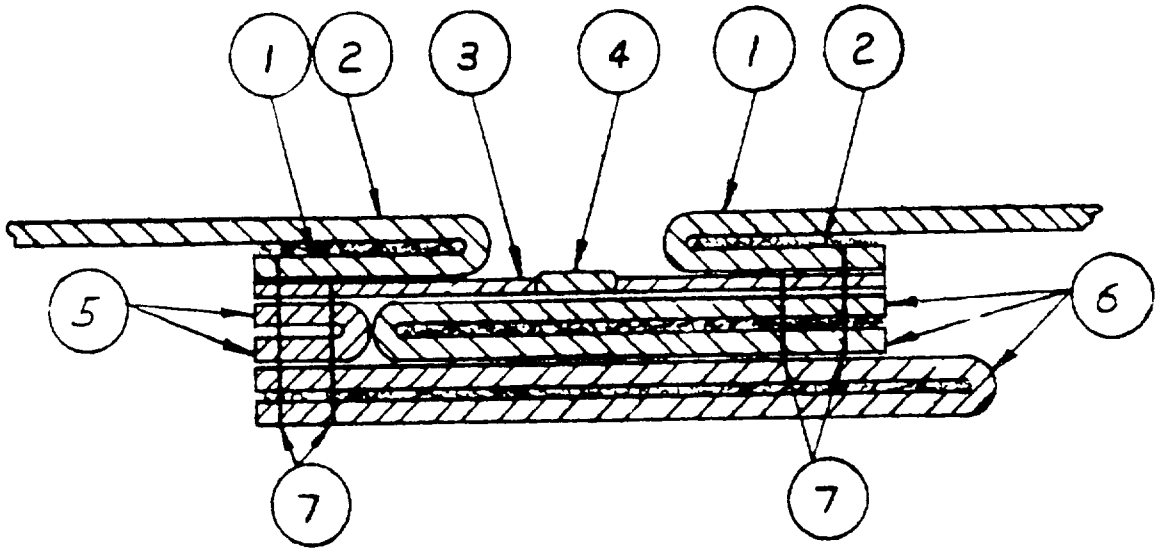


LEGEND:


1. BODY
2. BODY FACING
3. SLIDE FASTENER TAPE
4. SLIDE FASTENER CHAIN
5. 2 PLY SPACER
6. 2 PLY MOISTURE BARRIER FLAP
7. STITCH LINES

CEMENTED AREAS

FRONT OPENING ASSEMBLY
FIGURE 3 - PARKA, WET WEATHER

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

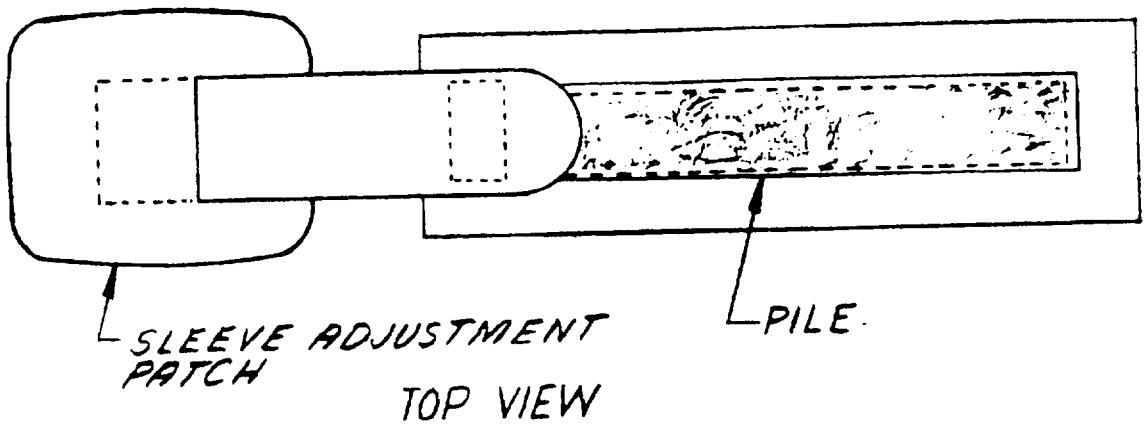

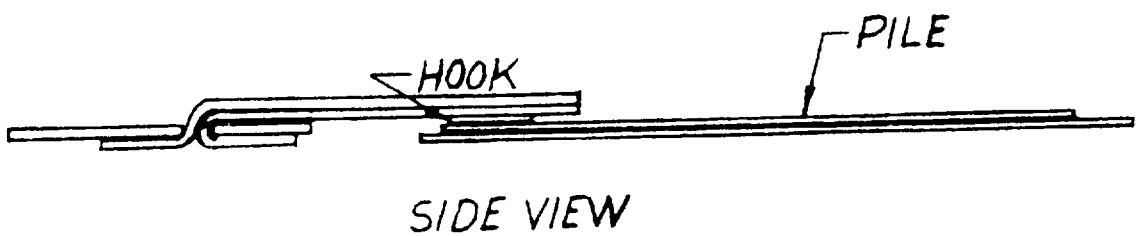

SLEEVE ADJUSTMENT STRAP ASSEMBLY
FIGURE 4 PARKA, WET WEATHER

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:40Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE NAVY

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12503 WASHINGTON D. C

POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE NAVY

Officer in Charge
Navy Clothing & Textile Research Facility
(Code 50)
21 Strathmore Road
Natick, MA 01760

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:40Z
Check the source to verify that this is the current version before use.

(TO DETACH THIS FORM, CUT ALONG THIS LINE.)

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ USER
	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:40Z
Check the source to verify that this is the current version before use.