INCH-POUND

MIL-DTL-3661/65D
25 February 2019


SUPERSEDING
MIL-L-3661/65C
25 October 1978

MILITARY SPECIFICATION SHEET

LAMPHOLDER, LIGHTS, INDICATOR (HOUSING), STYLE LH98

This specification is approved for use by all Departments and Agencies of the Department of Defense (DoD).

The complete requirements for acquiring the indicator lights (housing) described herein shall consist of this document and the latest issue of MIL-DTL-3661.

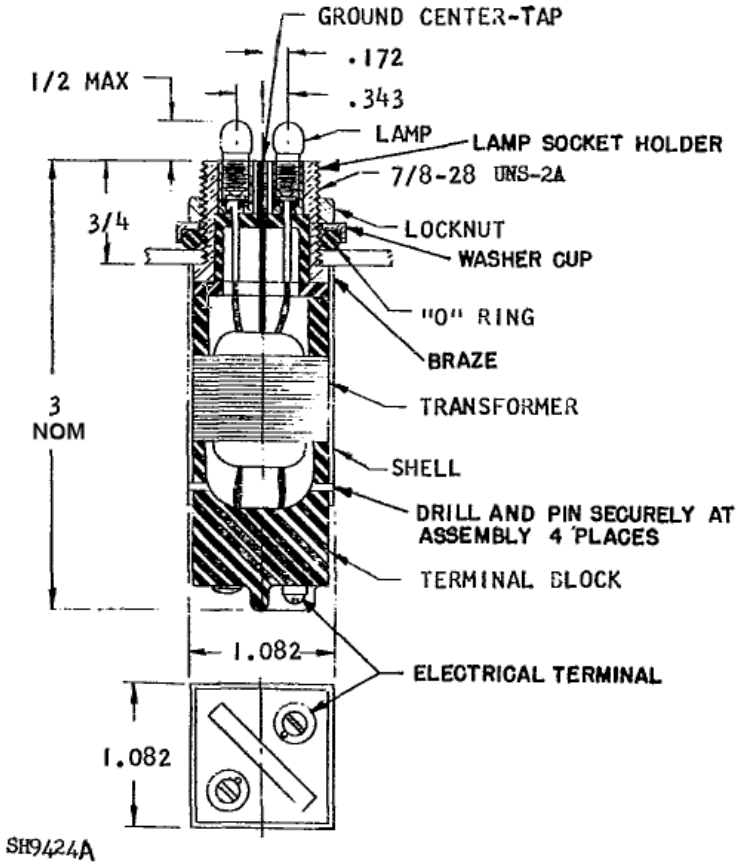

Inches	mm	Inches	mm
0.172	4.37	3/4	19.05
0.343	8.71	7/8	22.23
1/2	12.70	1.082	27.48
		3	76.20

FIGURE 1. Lights, indicator (housing), style LH98.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T21:10Z
Check the source to verify that this is the current version before use.

NOTES:

1. Dimensions are in inches. Unless otherwise specified, tolerances are plus or minus 1/64 inch (0.38 mm) for fractions and plus or minus 0.015 inch (0.38 mm) for decimals.
2. Metric equivalents (to the nearest 0.01 mm) are given for general information only and are based upon 1 inch = 25.4 mm.

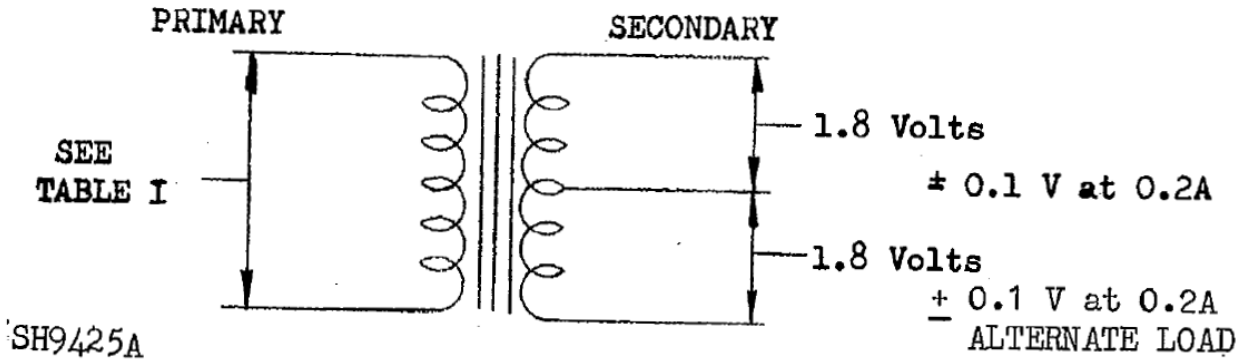


FIGURE 2. Wiring diagram.


Table I – Style LH98 housings.

Type Designation[1]	Voltage	Lamp Accommodation [2]
LH98/1	12	Industry number 1769[3]
LH98/2	26	
LH98/3	117	
LH98/4	450	

[1] The style LH98 indicator light housing shall mate with any of the lenses shown on MIL-L-3661/52 through MIL-L-3661/59. Mating lens is not furnished (shown herein for information purposes).
[2] Lamps are not furnished. They are shown herein for information purposes.
[3] Miniature Bulb Midget Screw Base - 2.5 Volt, 0.2 Amp, T-1-3/4 Midget Screw Base, 500 Hour.

Supersession data: This specification sheet replaces type B-27A and B-27B of Drawing 9000-S6202-73907.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T21:10Z
Check the source to verify that this is the current version before use.

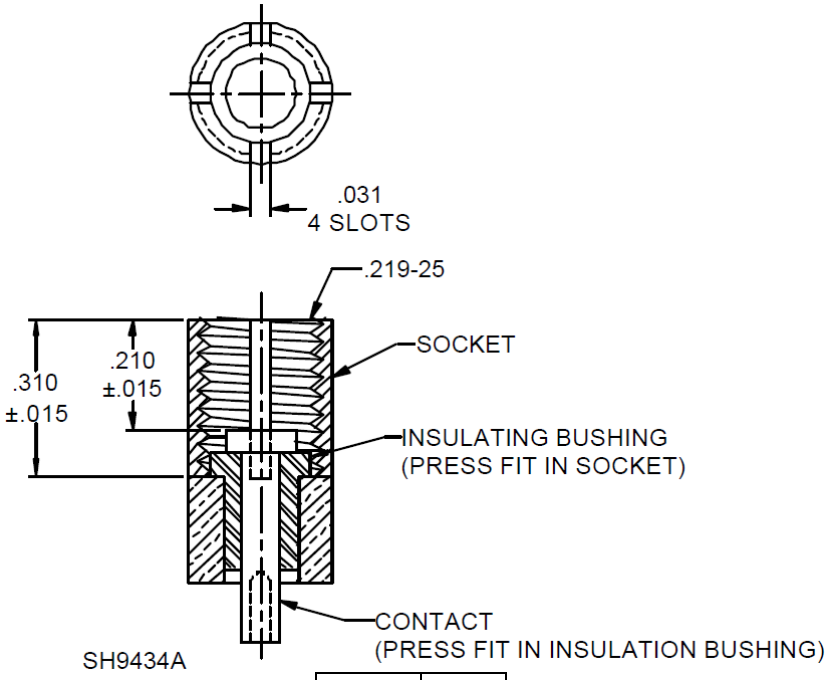

Inches	mm
1/32	0.79
0.195	4.95
7/32	5.56
9/32	7/14

FIGURE 3. Midget screw lamp socket.

REQUIREMENTS:

1. Qualification: Not required.
2. Material:
   a. Terminal block: Type MME and MAI-60 of ASTM D5948.
   b. Shell, locknut, washer cup, lampsocket holder, socket, contact, electrical terminal: Brass.
   c. "O" ring: Rubber.
3. Finish: Exposed metal parts shall be black nickel.
4. Design and construction: See figures 1 and 2.
5. Internal wiring: Shall be insulated to prevent the possibility of shorting.
6. Lamp sockets: Shall be as show on figure 3.
7. Transformers: Center tap of transformer secondary shall be grounded to the face plate of indicator light housing.
8. Locknut: Hexagonal with rounded corners, 1-1/16 inches (26.99 mm) outside diameter (o.d.), 7/8-UNS-2B thread, 1 inch (25.40 mm) across flats, 3/16-inch (4.76 mm) thick.
9. Washer cup: 1-5/16 inches (33.45 mm) o.d., 57/64 inches (22.62 mm) inside diameter 1/8 inch (3.18 mm) high, .051 inch (1.30 mm) thick.
10. "O" ring: Size shall conform to SAE-AS28775-212.
11. Electrical terminals: Electrical terminals shall be provided by using No. 6-32 round head, corrosion resistant steel or brass machine screws, ¼ inch (6.35 mm) long and inserts securely attached to the terminal block. Molded separations, at least 3/16 inch (4.76 mm) high and

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T21:10Z
Check the source to verify that this is the current version before use.

3/32 inch (2.38 mm) wide, shall be provided between the terminals to prevent short outs when electrical connections are made using terminal lugs.

12. Dielectric withstanding voltage: At sea level shall be 1,000 volts alternating current (a.c.).
13. Shock: Method II.
14. Voltage regulation: With rated voltage impressed on the primary of the transformer, the low secondary voltage shall be 2.0±0.1 volts with both 2.5 volt, 0.2 ampere lamps burning and 2.5±0.3 volts with one lamp removed. Load conditions are 0 (no load) and 0.5 ampere full load.
15. Temperature rise: Transformers shall be capable of operating continuously with rated voltage impressed across the primary and rated output on the secondary without exceeding a temperature rise of 32°C. The standard ratings shall be as shown in table I.

QUALITY ASSURANCE PROVISIONS

First article inspection: First article inspection of style LH98 housings shall consist of the following:

(a) Visual and dimensional examination.
(b) Shock.
(c) Vibration.
(d) Moisture resistance.
(e) Dielectric withstanding voltage.
(f) Temperature rise (as specified herein).
(g) Voltage regulation (as specified herein).

Conformance inspection: Conformance inspection of style LH98 housing shall consist of the following:

(a) Visual and dimensional examination.
(b) Dielectric withstanding voltage.

Sampling for quality conformance inspection: A random sample of lenses shall be selected from each lot in accordance with MIL-STD-1916, verification level I.

TESTS:

Temperature rise: Temperature rise with rated output and primary voltage shall be measured with the transformer installed in the enclosing case and with the cover securely fastened in place. For the 1-hour intermittent duty, the measurements shall be made at the end of 1 hour. Temperature rise shall be determined by the resistance method (see requirement 15).

Voltage regulation: Voltage regulation to determine conformance with requirement 14 shall be made while the transformer is still hot, immediately following the temperature rise.

INTENDED USE: Indicator lights are intended for use in conjunction with 60 or 400 Hz a.c. systems.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T21:10Z
Check the source to verify that this is the current version before use.

Referenced documents. In addition to MIL-DTL-3661, this document references the following:

ASTM-D5948
SAE-AS28775
MIL-STD-1916
MIL-L-3661/52
MIL-L-3661/53
MIL-L-3661/54
MIL-L-3661/55
MIL-L-3661/56
MIL-L-3661/57
MIL-L-3661/58
MIL-L-3661/59

CHANGES FROM PREVIOUS ISSUE: Marginal notations are not used in this revision to identify changes with respect to the previous issue due to the extent of the changes.

Custodian:
Navy — SH

Preparing activity:
DLA — GS2
(Project 6210-2019-004)

Review activity:
DLA — IS

NOTE: The activities listed above were interested in this document as of the date of this document. Since organizations and responsibilities can change, you should verify the currency of the information above using the ASSIST Online database at https://assist.dla.mil.

Source: https://assist.dla.mil -- Downloaded: 2026-10-16T21:10Z
Check the source to verify that this is the current version before use.