MILITARY SPECIFICATION

CLOTHING OUTFIT, EXTREME COLD WEATHER SURVIVAL A/P22S-18

This specification is approved for use by the Department of the Air Force and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers a clothing outfit consisting of an SRU-6/P arctic survival overcoat that is vacuum packaged in plastic and placed in a fabric container. The clothing outfit is designed A/P22S-18.

2. APPLICABLE DOCUMENTS

2.1 Issues of documents. The following documents, of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

FEDERAL

V-T-295	Thread, Nylon
PPP-B-636	Boxes, Shipping, Fiberboard

MILITARY

MIL-W-4088	Webbing, Textile, Woven Nylon
MIL-C-20696	Cloth, Coated, Nylon, Waterproof
MIL-F-21840	Fastener Tapes, Hook and Pile, Synthetic
MIL-O-27525	Overcoat, Survival, Arctic SRU-6/P

STANDARDS

FEDERAL

FED-STD-191	Textile Test Methods
FED-STD-406	Plastics: Methods of Testing
FED-STD-751	Stitches, Seams, and Stitchings

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: ASD/ENESS, Wright-Patterson AFB, Oh 45433 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 202610-23T11:52Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-STD-105	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129	Marking for Shipment and Storage
MIL-STD-130	Identification Marking of US Military Property
MIL-STD-143	Standards and Specifications, Order of Precedence for the Selection of
MIL-STD-831	Test Reports, Preparation of

DRAWINGS

AIR FORCE

77167	Clothing Outfit, Extreme Cold Weather Survival A/P22S-18
77168	Container, Overcoat - Clothing Outfit, Extreme Cold Weather Survival A/P22S-18
77169	Pattern - Overcoat Container, Clothing Outfit, Extreme Cold Weather Survival A/P22S-18
77170	Pack, Overcoat - Clothing Outfit, Extreme Cold Weather Survival A/P22S-18
77171	Label, Identification and Instruction - Overcoat A/P22S-18

(Copies of specifications, standards, drawings, and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

3. REQUIREMENTS

3.1 First article. When specified (see 4.3 and 6.2), the contractor shall furnish samples for first article inspection and approval.

3.2 Major components. The clothing outfit shall consist of the following major components:

(a) One overcoat pack

(b) One overcoat pack container.

3.3 Selection of specifications and standards. Specifications and standards for necessary commodities and services not specified herein shall be selected in accordance with MIL-STD-143.

3.4 Materials

3.4.1 Fabric container

3.4.1.1 Basic material. The basic material for the fabric container shall conform to type III, class 5 of MIL-C-20696 and shall be sage green conforming to USAF color shade No. 1535 (see 6.3).

3.4.1.2 Webbing. The webbing for the two carrying handles and for the strap for attaching the scissors shall conform to type I of MIL-W-4088 amd shall be yellow conforming to USAF color shade No. 1365 (see 6.3).

Source: https://assist.dla.mil -- Downloaded: 202610-23T11:52Z
Check the source to verify that this is the current version before use.

3.4.1.3 Fastener tape. The hook and the pile fastener tape for the fabric container shall be 1 inch wide and shall be Green OG 106 (see 6.3). The hook fastener tape shall conform to type II, class 1 of MIL-F-21840. The pile fastener tape shall conform to class 1 of MIL-F-21840.

3.4.1.4 Thread. The thread used for sewing the fabric container shall conform to type II, size E of V-T-295. The color of the thread shall approximately match the color of the basic material.

3.4.2 Sealant. The sealant required for the operations specified in table I shall be Glyptal No. 1201 red enamel, or equivalent, manufactured by the General Electric Company, Schenectady, New York.

3.4.3 Plastic material. The material for vacuum packaging the overcoat shall be a low gas transmission, peelable, heat sealable plastic material. The plastic material shall be Vacugard 112A, or equal, which shall conform to the requirements specified in table II. (Vacugard 112A is manufactured by the Guardian Packaging Corporation, Newark, California.)

3.5 Design and construction. Except for the overcoat, the clothing outfit shall be designed and constructed in accordance with Drawings 77167 through 77171 and as specified herein. In the event the requirements of the drawings and the requirements of the text of this specification conflict, the text of this specification shall apply.

3.5.1 Overcoat pack container. The overcoat pack container shall conform to Drawing 77168 and shall consist of a scissors to cut the plastic envelopes of the overcoat pack and of a fabric container to form the outer protective cover of the overcoat pack. The stitches, the seams, and the stitchings used in the construction of the fabric container shall conform to FED-STD-751. The part of the fabric container that is made of the basic material shall be cut in accordance with the dimensions on the pattern part referenced on Drawing 77169.

3.5.2 Overcoat pack. The overcoat pack shall conform to Drawing 77170 and shall consist of an overcoat, an identification and instruction label, and two plastic envelopes. The overcoat and the identification and instruction label shall be vacuum packed in the plastic envelopes and inserted into the overcoat pack container as specified in table I.

3.5.2.1 Overcoat. The overcoat shall conform to class 1 (sage green) or class 2 (Indian orange) of MIL-O-27525 as specified by the procuring activity (see 3.8 and 6.2).

3.6 Envelope dimensions. The maximum envelope dimensions of the clothing outfit shall be as specified on Drawings 77168 and 77170.

3.7 Markings

3.7.1 Overcoat pack container. The top cover of the fabric container and the strap for attaching the scissors shall be marked, with indelible black ink, in accordance with MIL-STD-130 and Drawing 77168.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

TABLE I. Overcoat pack.

Operation No.	Description
1	Dry overcoat (a) Tumble dry the overcoat specified in 3.5.2.1 for 45 minutes at 180 degrees Fahrenheit.
2	Vacuum package overcoat in first (inner) envelope (a) Place a plastic envelope that conforms to the -01 configuration on Drawing 77170 in the bottom of a mold that will produce the dimensions shown on Drawing 77170. The proximal end of the neck of the plastic envelope shall be adjacent to the lower surface of the mold. (b) Fold and place the overcoat in the plastic envelope as evenly as possible. (c) Expel the entrapped air as much as possible, and heat seal the plastic envelope. (d) Heat seal the bottom edge of the plastic envelope with three seams, as shown on Drawing 77170, as close as possible to the overcoat; trim the excess plastic material. (e) Adjust the overcoat in the plastic envelope, and position the plastic envelope to fit in the mold. (f) Install the evacuation tube in the neck of the plastic envelope with a shoestring tracer. (g) Connect the evacuation tube in the vacuum pump, and remove the free air. (h) Adjust the overcoat as necessary to form a level pack. (i) Install a plastic top form and a pressure board on the top of the pack. (j) Place the mold with the plastic envelope, the plastic top form, and the pressure board under a 6-inch press, and perform the following: (1) Observe the barometric pressure on a manometer to determine ambient pressure. (2) Connect the evacuation tube to the rough vacuum pump.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

TABLE I. Overcoat pack. - Continued

Operation No.	Description
	(3) Reduce supply air to 0 pound per square inch gage (psig) on press. (4) Open the air control valve to allow the piston ram to drop on the plastic envelope. (5) Adjust the shop air to increase the absolute manometer pressure to 0.3 inch above the ambient barometric pressure that was observed in No. 2(j)(1). (6) Open the vacuum pump valve to decrease the pressure to 0.3 inch below the ambient barometric pressure that was observed in No. 2(j)(1). (7) Increase the shop air by 0.3 inch, and open the vacuum pump valve to decrease pressure by 0.03 inch. Continue incrementing until the supply air is at 180 psig. (8) Open the vacuum valve and increase the air pressure to the piston ram to 200 psig. (9) Apply the first coat of the sealant around the neck of the plastic envelope and around the evacuation tube. (k) Isolate the plastic envelope from the rough vacuum pump; transfer the mold, the plastic envelope, and the pressure plate to a 10-inch press. (l) Reconnect the plastic envelope to the vacuum pump, and continue to evacuate under pressure for 24 hours while periodically coating the neck of the plastic envelope and the evacuation tube with the sealant until all visible voids are filled. (m) At the completion of the 24-hour evacuation period, remove the plastic envelope from the mold and isolate the plastic envelope from the vacuum pump. (n) Connect the plastic envelope to a high pressure vacuum pump (see figure 1), and continue to evacuate for 24 hours. (o) Observe the vacuum meter for decrease in pressure; coat the evacuation tube and the neck of the plastic envelope with sealant, as required, until the vacuum meter indicates 0.050

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

TABLE I. Overcoat pack. - Continued

Operation No.	Description
	torr. Periodically close the line valve and observe the meter. Any increase in the meter reading shall be considered an indication of leakage. Open the line valve, and repeat the application of the sealant. If the meter indication of 0.050 torr is not achieved or if leakage other than around the neck of the plastic envelope or around the evacuation tube is present, remove the plastic envelope from the vacuum line and repackage in accordance with No. 1(a) through No. 2(o). If the meter indication of 0.050 torr is achieved and if no leakage other than around the neck of the plastic envelope or around the evacuation tube is present, proceed with No. 2(p). (p) Partially withdraw the evacuation tube to clear the shoestring tracer; apply a clamp across the neck between the overcoat and the end of the evacuation tube, assuring that all wrinkles are removed. (q) Cut the neck of the plastic envelope; remove the evacuation tube; immediately heat seal the neck of the plastic envelope. (r) Measure and record the height (thickness) of the plastic envelope containing the overcoat. The height shall be not greater than 1-3/16 inches. (s) Store the plastic envelope containing the overcoat for 4 days, and observe daily for growth. (t) If growth is observed, remove the overcoat from the plastic envelope and repackage the overcoat starting with No. 1(a).
3	Package first (inner) envelope in second (outer) envelope (a) Remove the aged plastic envelope containing the overcoat from the ambient storage, and verify no growth. (b) Insert the plastic envelope containing the overcoat in a second (outer) plastic envelope that conforms to the -01 configuration on Drawing 77170.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

TABLE I. Overcoat pack. - Continued

Operation No.	Description
	(c) Date and serialize the identification and instruction label; insert it in the outer plastic envelope. (d) Heat seal with three seams, as shown Drawing 77170, the outer plastic envelope as close as possible to the inner plastic envelope, and trim the excess plastic material. (e) Install the evacuation tube with the showstring tracer in the neck of the outer plastic envelope, and connect it to the manifold of the rough vacuum pump. (f) While the outer plastic envelope is being evacuated, adjust the shape. (g) Apply sealant to the neck of the outer plastic envelope and to the vacuation tube; evacuate for 24 hours, recoating the neck area with a sealant, as required by visual inspection. (h) Isolate the outer plastic envelope from the rough vacuum pump; connect the outer plastic envelope to the high vacuum pump. (i) Subject the outer plastic envelope to the operations described in No. 2(o) through No. 2(t). (j) Pull on the edges of the outer plastic envelope to check for leakage. The outer plastic envelope shall not pull away from the pack. If there is any indication of leakage of the outer plastic envelope, remove the outer plastic envelope and repeat the operations described in No. 3(a) through No. 3(i).
4	Insert overcoat pack into fabric container (a) If there is no indication of leakage of the outer plastic envelope, place the double-packaged overcoat in the overcoat pack container specified on Drawing 77168.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

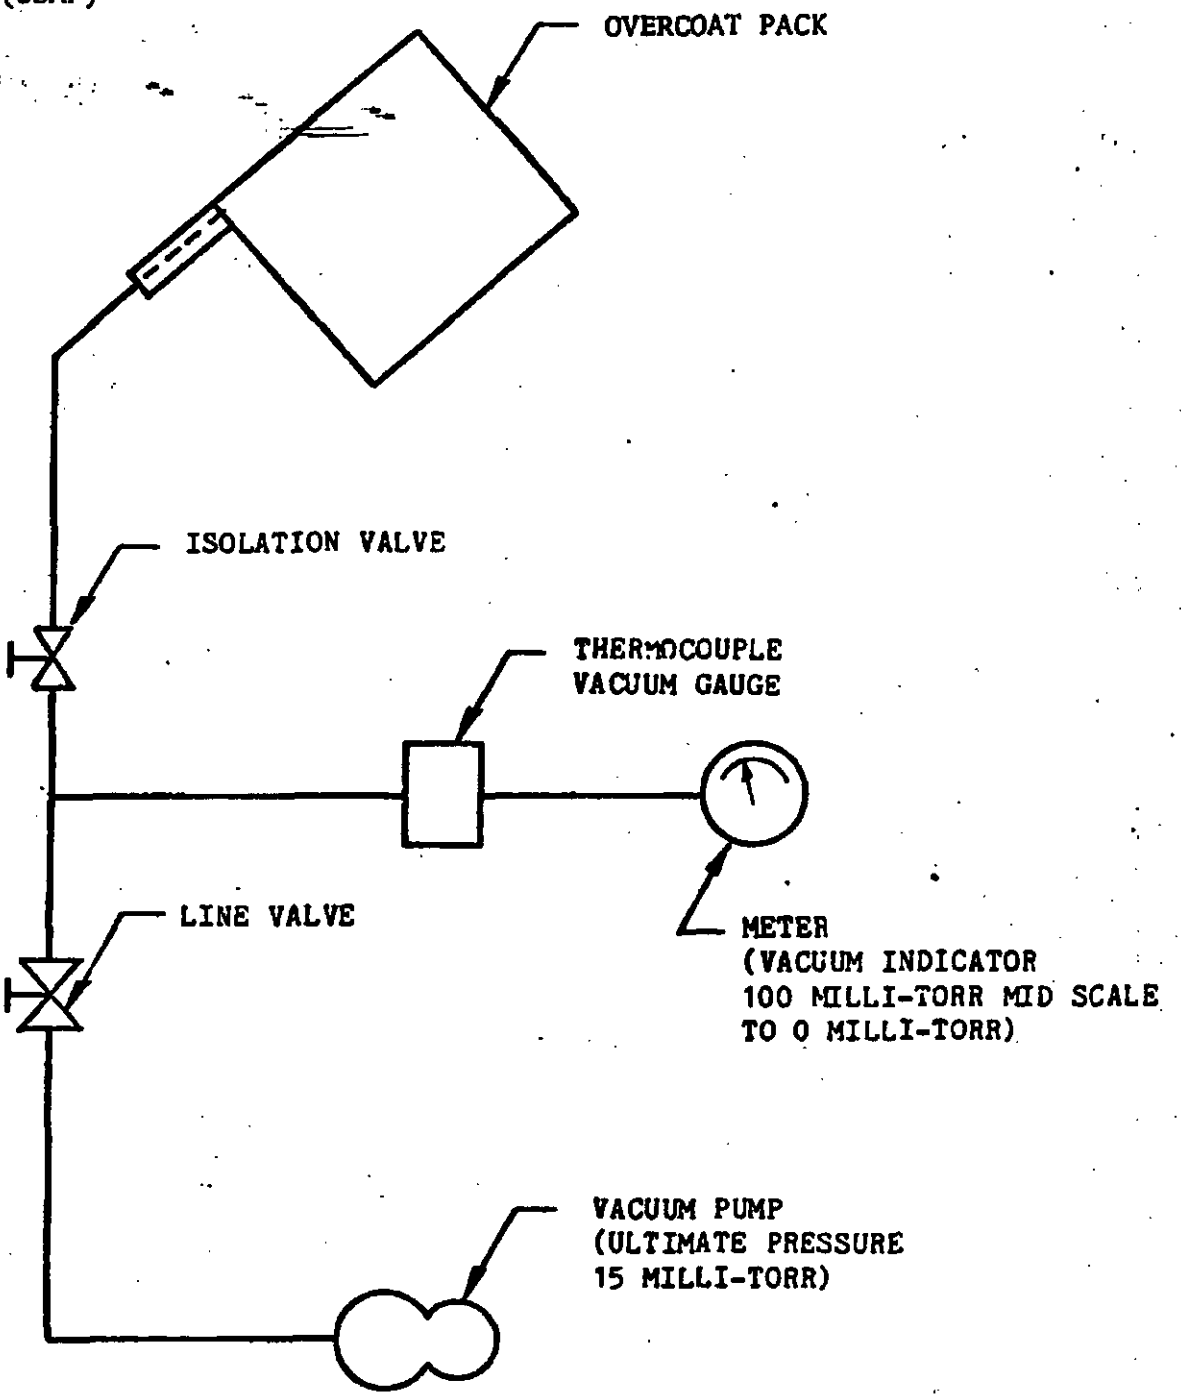


FIGURE 1. Instrumentation schematic.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

TABLE II. Plastic material.

Properties	Requirements
Yield and variation	3.2 mils, approximately 7,740 square inches (plus or minus 10 percent) per pound
Gas transmission rate (oxygen)	1 cubic centimeter per 100 square inches per 24 hours at ambient pressure, 38 degrees Fahrenheit, and 90 percent relative humidity
Tear strength (Elmendorf method)	1/
Machine direction	216 grams
Transverse direction	550 grams
Burst strength (Mullen method)	Material yields without bursting at 30 psi
Tensile strength	2/
Machine direction	10.1 pounds per 1-inch width
Transverse direction	10.1 pounds per 1-inch width
Elongation (percentage)	2/
Machine direction	260 percent
Transverse direction	180 percent
Flex crack resistance (Gelbo)	Withstand 120 cycles 3/
Seal strength	2,900 grams per 1-inch width 2/
Sealing conditions	
Temperature range	280 to 385 degrees Fahrenheit
Dwell	0.5 second and 30 psi

1/ The tear strength shall be determined in accordance with method 5132 of FED-STD-191.
2/ The tensile strength, the elongation, and the seal strength shall be determined in accordance with method 1013 of FED-STD-406.
3/ A cycle shall consist of 440-degree rotation, 6-inch stroke at 40 cycles per minute.

Source: https://assist.dla.mil -- Downloaded: 202610-23T11:52Z
Check the source to verify that this is the current version before use.

3.7.2 Identification and instruction label. The identification and instruction label shall be marked, with indelible black ink, in accordance with MIL-STD-130 and Drawing 77171. The marking on the identification and instruction label shall include the date of vacuum packaging and the serial number of clothing outfit.

3.8 Government furnished property. When specified by the procuring activity (see 6.2), the overcoat specified in 3.5.2.1 will be furnished by the Government.

3.9 Workmanship. The clothing outfit shall be constructed in a thoroughly workmanlike manner. The accuracy of dimensions, the marking of parts and assemblies, and the thoroughness of sealing shall be given particular attention.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

4.2 Classification of inspection. The inspection required by this specification is classified as follows:

(a) First article inspection

(b) Quality conformance inspection.

4.3 First article inspection. Unless otherwise specified by the procuring activity (see 3.1 and 6.2), the first article samples shall be subjected to the first article inspection to determine compliance with the requirements specified herein with respect to materials, design, construction, dimensions, and workmanship. The first article samples shall consist of five assembled overcoat packs and of five completely assembled clothing outfits. The first article inspection for the assembled overcoat packs shall consist of the intermediate inspection described in 4.4.3.1, 4.4.3.2 and 4.4.3.3. The first article inspection for the completely assembled clothing outfits shall consist of the end item inspection described in 4.4.4.1. When required by the procuring activity (see 6.2), a first article test report shall be prepared in accordance with MIL-STD-831.

4.4 Quality conformance inspection. Quality conformance inspection shall consist of the following inspection as described herein:

(a) Material and component inspection

(b) In-process inspection

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

(c) Intermediate inspection

(d) End item inspection.

4.4.1 Material and component inspection. Unless otherwise specified herein, the materials and the components to be used in the manufacture of the clothing outfits shall be inspected in accordance with the applicable quality assurance provisions of the specifications referenced herein and inspected for compliance with the applicable provisions of the drawings referenced herein. When specified by the procuring activity (see 6.2), certificates of compliance for the requirements specified herein for the applicable materials and components shall be furnished by the supplier. The certificates of compliance shall be accompanied by actual test or inspection reports or other verifiable data. If a certificate of compliance is furnished for any requirement specified herein, the Government shall have the right to check test items to determine the validity of the certification.

4.4.2 In-process inspection. In-process inspection of the clothing outfits as required to determine whether operations or assemblies conform to the requirements specified herein shall be made at any point or during any phase of the manufacturing process. Nonconformance of the operations or the assemblies to the requirements specified herein during in-process inspection of the clothing outfits shall be cause for rejection of the clothing outfits represented by the operations or assemblies.

4.4.2.1 Points or phases of operations. In-process inspection to determine compliance with the requirements specified in table I shall include the following points or phases of operations:

(a) Drying of overcoat

(b) Folding and positioning of overcoat in first (inner) envelope

(c) Heat sealing of first (inner) envelope

(d) Evacuation of first (inner) envelope

(e) Application of sealant around neck of first (inner) envelope and around evacuation tube

(f) Check for leakage of first (inner) envelope

(g) Check of height (thickness) of first (inner) envelope after it is vacuum packaged with overcoat

(h) Insertion of first (inner) envelope that is vacuum packaged with overcoat into second (outer) envelope

(i) Insertion of identification and instruction label between inner and outer envelopes

(j) Heat sealing of second (outer) envelope

(k) Application of sealant around neck of second (outer) envelope and around evacuation tube

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

(l) Evacuation of second (outer) envelope

(m) Check for leakage of second (outer) envelope.

4.4.3 Intermediate inspection. The overcoat pack shall be subjected to the intermediate inspection which shall consist of the examinations described in 4.4.3.1 and 4.4.3.2 and the test described in 4.4.3.3. The sample unit for the intermediate inspection shall be one assembled overcoat pack. The inspection level for the intermediate inspection shall be I of MIL-STD-105 for the examinations described in 4.4.3.1 and 4.4.3.2 and S-4 of MIL-STD-105 for the test described in 4.4.3.3. The acceptable quality level for the intermediate inspection shall be 4.0 defects per 100 units (dhu) for the examination described in 4.4.3.1, 2.5 dhu for the examination described in 4.4.3.2, and 0.65 dhu for the test described in 4.4.3.3.

4.4.3.1 Visual examination of overcoat pack. The assembled overcoat pack shall be visually examined for the defects listed for the overcoat pack in table III.

4.4.3.2 Examination of dimensions. The assembled overcoat pack shall be examined to determine conformance of the assembled overcoat pack to the dimensions specified for the overcoat pack on the drawings referenced herein. Each dimension that is not in accordance with the dimensions specified on the drawings shall be classified as a defect.

4.4.3.3 Determination of maximum thickness. The test equipment used to determine conformance of the overcoat pack to the maximum thickness specified herein shall include a flat surface and a height gauge mounted above the flat surface. The width of the flat surface and the span of the height gauge shall be at least 1 inch greater than the maximum width of the overcoat pack. The distance between the height gauge and the flat surface during this test shall not exceed 1-3/16 inches. The overcoat pack shall be placed on the flat surface and pushed under the height gauge. An overcoat pack that is restricted from sliding under the height gauge by contact with the height gauge shall be considered to be defective.

4.4.4 End item inspection. The clothing outfit shall be subjected to the end item inspection which shall consist of the examination described in 4.4.4.1. The sample unit for the end item inspection shall be one fully assembled clothing outfit. The inspection level for the end item inspection shall be II of MIL-STD-105. The acceptable quality level for the end item inspection shall be 4.0 dhu.

4.4.4.1 Visual examination of end item. The clothing outfit shall be visually examined for the defects listed for the overcoat pack container in table III.

5. PACKAGING

5.1 Packaging. Packaging shall be level A.

5.1.1 Level A. Each clothing outfit shall be packaged in accordance with level A which shall consist of placing the overcoat pack specified in 3.5.2 into the overcoat pack container specified in 3.5.1.

5.2 Packing. Packing shall be level A, B, or C as specified (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

TABLE III. Examination for defects.

Examine	Defect (One Class)
Overcoat pack container	Coated nylon cloth containing any coating defect such as abrasion, blister, cut, hole, or uncoated area
	Color of coated nylon material not sage green
	Webbing containing any hole, cut, or tear
	Edge of webbing frayed or scalloped or webbing not firmly and tightly woven
	Cut end of webbing not fused
	Webbing not specified color or width
	Any hole, cut, or tear in fastener tape
	Hooks missing from hook fastener tape
	Hooks of hook fastener tape flattened
	Hooks or pile surface of fastener tape not located as specified
	Hook or pile fastener tape not specified width or color
	Scissors not attached as specified or insecurely attached
	Scissors broken or malformed or scissors containing burr or corroded areas
	Scissors failing to serve intended purpose
	Nylon sewing thread cut, torn, chafed, or otherwise damaged, affecting serviceability
	Nylon sewing thread not specified type, size, or color
	Seam or stitch type not specified type
	Loose stitch tension, resulting in loose seam
	Tight stitch tension, resulting in excessive tightness or puckering of cloth
	Open seam

Source: https://assist.dla.mil Downloaded: 202610-23T11:52Z
Check the source to verify that this is the current version before use.

TABLE III. Examination for defects.- Continued

Examine	Defect (One Class)
	Two stitches per inch more or less than stitches per inch specified
	Row of stitching omitted
	Boxstitching not located where specified
	Boxstitching incomplete
	Dimensions of boxstitching less than specified
	Variation from specified design or construction
	Any characteristic not in accordance with specified requirements
	Operation not accomplished as specified
	Component omitted or operation omitted
	Component not attached as specified
	Marking on fabric container omitted, incorrect, illegible, misplaced, or improperly applied
Overcoat pack	Design and construction not as specified
	Bulging or distortion of overcoat pack
	Evidence of leakage of overcoat pack
	Identification and instruction label missing
	Identification and instruction label not located in specified position
	Marking on identification and instruction label omitted, incorrect, illegible, misplaced, or improperly applied
	Inner plastic envelope missing
	Overcoat missing or damaged
	Heat-sealed seams not in proper location

Source: https://assist.dla.mil -- Downloaded: 202610-23T11:52Z
Check the source to verify that this is the current version before use.

TABLE III. Examination for defects.- Continued

Examine	Defect (One Class)
	Evidence of poor heat seals, resulting in inadequate fusion Any component damaged

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.

5.2.1 Level A. Each clothing outfit packaged as specified in 5.1.1 shall be packed in a snug-fitting box. The box shall be constructed, closed, and reinforced to conform to type CF or SF, class weather-resistant, style RSC of PPP-B-636.

5.2.2 Level B. Each clothing outfit packaged as specified in in 5.1.1 shall be packed in a snug-fitting box. The box shall be constructed, closed, and reinforced to conform to type CF or SF, class domestic, style RSC of PPP-B-636.

5.2.3 Level C. Each clothing outfit packaged as specified in 5.1.1 shall be packed to afford adequate protection against damage during direct shipment from the supply source to the first receiving activity for immediate use at the lowest transportation rate for such supplies. The shipping container shall be in accordance with the rules or regulations applicable to the mode of transportation. This level may be the supplier's commercial practice provided the latter meets the requirements of this level.

5.3 Marking. In addition to any special marking required by the contract or order, exterior shipping containers shall be marked in accordance with MIL-STD-129.

6. NOTES

6.1 Intended use. The A/P22S-18 clothing outfit covered by this specification is intended for inclusion in the survival kit of the ACES II ejection seat.

6.2 Ordering data. Procurement documents should specify the following:

(a) Title, number, and date of this specification

(b) First article requirements (see 3.1 and 4.3)

(c) Class (color) of overcoat (see 3.5.2.1)

(d) Serial number of clothing outfit (see 3.7.2)

(e) Government furnished property (see 3.8)

(f) Requirements for certificates of compliance (see 4.4.1)

(g) Selection of applicable level of packing (see 5.2).

6.3 Color samples. Color samples can be obtained from the procuring activity or as directed by the contracting officer.

Custodian:
Air Force - 11

Reviewers:
Air Force - 45, 99

Preparing activity:
Air Force - 11

Project No. 8415-F201

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T11:52Z
Check the source to verify that this is the current version before use.