MILITARY SPECIFICATION

CHARGE, PROOF, 155MM, PXR-6255 LOADING, ASSEMBLING, AND PACKING

This specification is approved for use by US Army Armament Research and Development Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the loading, assembling and packing for one type of propelling charge designated as Charge, Proof, 155MM, PXR-6255, for 155MM Cannon M185 and M199. (See 6.1)

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposals form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-P-223	-	Powder, Black
MIL-A-48078	-	Ammunition, Standard Quality Assurance Provisions, General Specification For

DRAWINGS

ARRADCOM

PRODUCT AND PACKAGE DRAWINGS

9289154 - Charge, Proof, 155MM, PXR-6255 for 155MM Cannon M185 and M199.

FSC: 1320

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

9293302 - Packing and Marking for Container, Ammo, Metal; M16A2 for Charge, Proof, 155MM, PXR-6255

3. REQUIREMENTS

3.1 Materials.-Materials shall be in accordance with applicable drawings and specifications.

3.2 Proof Charge.-The proof charge shall comply with all requirements specified on drawing 9289154 and with all requirements specified in applicable specifications.

3.3 Moisture Content of Black Powder.-The moisture content of the black powder at the loading station at the time of loading shall not exceed the amount specified in MIL-P-223.

3.4 Propellant Weight.-The propellant weight shall comply with the weight specified in the loading authorization within plus or minus 0.20 ounce.

3.5 Dimensional Gage.-The completed charge shall freely enter the prescribed gage. The gage shall be designed to inspect the maximum diameter and length. If the diameter feature is separate from the length feature, the diameter feature must extend approximately the full length of the charge.

3.6 Workmanship.-All components shall be free of dirt, grease and other foreign material. There shall be no discoloration or deterioration of cloth and there shall be no evidence of rips, tears, or other cloth defects. All work performed shall be performed in a thorough workmanlike manner.

3.7 Assembly Torque.-The test plug shall be assembled to withstand subsequent reapplication of the minimum assembly torque specified on the applicable drawing, without moving.

3.8 Igniter Tubes.-All tubes shall be free of cracks, dents, creases, bends, tears, flat areas, and softness.

3.9 Complete Igniter Alignment.-An approved method of centering the complete igniter assembly in the increment assembly will be utilized for all charges.

4. QUALITY ASSURANCE PROVISIONS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

4.1 Responsibility for Inspection and Standard Quality Assurance Provisions.-Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of Inspections.-The following types of inspection shall be conducted on this item:

a. Quality Conformance Inspection

4.3 First Article Inspection.-Unless otherwise specified in the contract, first article inspection is not required for this item.

4.4 Quality Conformance Inspection

4.4.1 Inspection Lot Formation.-Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of proof charge assemblies shall contain:

a. Propellant from not more than one lot number from one manufacturer.

b. Black powder from not more than one interfix number from one manufacturer.

c. Tubes from not more than one interfix number from one manufacturer.

4.4.2 Examination.-See MIL-A-48078.

a. Sampling Plans.-Unless otherwise specified in the Classification of Defects and Test tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.1	Body		9289169
			NEXT HIGHER ASSEMBLY
			9289183

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				(See 6.4)
Major					
101	Cloth improper			3.1	4.5.5
Minor					
201	Length (as established)		0.65%	3.2	Scale
202	Width (as established)		0.65%	3.2	Scale

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.2	Strap, Tying		9289177
			NEXT HIGHER ASSEMBLY
			9289183

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
Minor					
201	Length		0.65%	3.2	Scale
202	Width		0.65%	3.2	Scale

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289178
4.4.2.3	Tape				NEXT HIGHER ASSEMBLY 9289166
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
Minor					
201	Length		0.65%	3.2	Scale

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289176
4.4.2.4	Bag, Igniter Core				NEXT HIGHER ASSEMBLY 0289161
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Width of cloth		0.40%	3.2	Scale
102	Cloth improper			3.1	4.5.5
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

7

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.5	Igniter Core Bag Assembly				9289161
					NEXT HIGHER ASSEMBLY 9289162
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Ties missing or improperly located		100%	3.2	Gage
102	Location of seams		100%	3.2	Visual
103	Cloth Improper (tape)			3.1	4.5.5
Minor					
201	Length of ties after tack		0.65%	3.2	Scale
202	Evidence of poor workmanship		0.65%	3.6	Visual
203	Width of filling opening (as established)		0.65%	3.2	Scale

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.6	End, Base Igniter		9289173
			NEXT HIGHER ASSEMBLY
			9289159/9289166

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
102	Diameter of base igniter end		0.40%	3.2	Gage
Minor					
201	Marking missing, misleading, or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.7	Tape and End Assembly				9289164
					NEXT HIGHER ASSEMBLY
					9289159
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Location of tape (including location of tacks)		0.40%	3.2	Scale
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

10

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.8	Base Igniter End Assembly				9289159
					NEXT HIGHER ASSEMBLY
					9289182
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Diameter of seam circle		0.40%	3.2	Scale
102	Quilting missing or improper		0.40%	3.2	Visual-Manual
103	Quilting seam improper length		0.40%	3.2	Scale
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289183
4.4.2.9	Body and Strap Assembly				NEXT HIGHER ASSEMBLY 9289182
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Tying strap missing, incompletely stitched or improperly located		0.40%	3.2	Visual-Scale
Minor	None defined				

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289182
4.4.2.10	Base Igniter Cap Assembly				NEXT HIGHER ASSEMBLY 9289156
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Any seam incompletely stitched		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289156
4.4.2.11	Base Igniter Cap Loading Assembly				NEXT HIGHER ASSEMBLY 9289160
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Assembly incorrect or damaged to the extent that black powder can escape (including any seams or openings incompletely stitched or broken threads)		100%	3.2	Visual-Manual
Major					
101	Weight of black powder			3.2	4.5.1
102	Moisture content of black powder	(a)		3.3	4.5.3
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

(a) See paragraph 4.4.3.2

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289162
4.4.2.12	Igniter Core Loading Assembly				NEXT HIGHER ASSEMBLY 9289160
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Assembly incorrect or damaged to the extent that black powder can escape		100%	3.2	Visual-Manual
Major					
101	Weight of black powder			3.2	4.5.1
102	Moisture content of black powder	(a)		3.3	4.5.3
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

(a) See paragraph 4.4.3.2

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.13	Cap		9321401
			NEXT HIGHER ASSEMBLY
			9289160

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Inside diameter		0.65%	3.2	Gage
202	Width		0.65%	3.2	Scale
203	Thickness		0.65%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74 4B10

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.14	Base Igniter Cap and Tube Assembly				9289160
					NEXT HIGHER ASSEMBLY 9289155
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Igniter core loading assembly missing		100%	3.2	Visual
2	Igniter core loading assembly twisted or folded in tube (to be checked prior to tying of base igniter loading assembly to tube)		100%	3.2	Visual
Major					
101	Base igniter cap improperly tied to tube, i.e., tie missing, loose, or incorrect (excluding length of ties after tying) (see Figure 1)		100%	3.2	Visual-Gage
102	Distance from end of tube to igniter core loading assembly		100%	3.2	Gage
103	Cap missing or insecure		100%	3.2	Visual-Manual
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.15	Body		9289174
			NEXT HIGHER ASSEMBLY 9289157

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
Minor					
201	Length (as established)		0.65%	3.2	Scale
202	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289164
4.4.2.16	Liner, Additive				NEXT HIGHER ASSEMBLY 9289163
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Area coverage of additive coating, minimum		0.40%	3.2	Visual-Scale
102	Weight of additive		0.40%	3.2	Balance
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26 03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289163
4.4.2.17	Liner Assembly				NEXT HIGHER ASSEMBLY 9289157
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Lead foil not properly matched or not properly assembled to the scrim side of the additive liner		0.40%	3.2	Visual
102	Weight of lead foil prior to laminating to scrim		0.40%	3.2	Balance
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289157
4.4.2.18	Body and Liner Assembly				NEXT HIGHER ASSEMBLY 9289158
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Liner assembly improper, improperly assembled, missing or improperly located		0.40%	3.2	Visual-Scale
Minor	None defined				

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289175
4.4.2.19	End, Increment				NEXT HIGHER ASSEMBLY 9289165
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
Minor					
201	Established length		0.65%	3.2	Scale
202	Established width of straight section		0.65%	3.2	Scale

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289165
4.4.2.20	Increment End Assembly				NEXT HIGHER ASSEMBLY 9289158
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Seam improper		0.40%	3.2	Visual-Manual
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289158
4.4.2.21	Body and End Assembly				NEXT HIGHER ASSEMBLY 9289155
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	End assembly improperly assembled to body and liner assembly		0.40%	3.2	Visual
102	Any seam incompletely stitched		0.40%	3.2	Visual-Manual
Minor	None defined				

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.22	Increment Loading Assembly		9289155
			NEXT HIGHER ASSEMBLY
			9289184

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Base igniter cap and tube assembly improperly tacked to body and liner assembly		100%	3.2	Visual-Manual
102	Base igniter cap and tube assembly improper or damaged (including condition of tube immediately prior to insertion into body and end assembly)		100%	3.2/3.8	Visual-Manual
103	Propellant weight			3.4	4.5.2
104	Method of assuring alignment	(a)		3.9	4.5.8
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES: (a) During each hours production a verification will be made that the method of assuring alignment is being utilized.

DRDAR-QA Form 160 Jul 77 Replaces SARPA-QA Form 2567 Feb 74 Which is Obsolete

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.23	Proof Charge Loading Assembly				9289184
					NEXT HIGHER ASSEMBLY 9289154
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Assembly damaged to the extent that propellant can escape (includes any seams or openings incompletely stitched and broken threads)		100%	3.2	Visual
102	Tube above or below flush exceeding tolerance		100%	3.2	Visual
103	Any component missing or improperly assembled		100%	3.2	Visual
104	Strap loose, broken, or insecurely tied		0.40%	3.2	Visual-Manual
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289170
4.4.2.24	Jacket, Lacing				NEXT HIGHER ASSEMBLY 9289154
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Cloth improper			3.1	4.5.5
102	Lacing cord missing or improperly assembled (2 locations)		0.40%	3.2	Visual-Manual
Minor					
201	Jacket of excessive length		0.65%	3.2	Scale
202	Marking missing, misleading, or unidentifiable		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.6	Visual
204	Any seam improper or incompletely stitched		0.65%	3.2	Visual-Manual

NOTES:

SARPA-QA FORM 2567 FEB 74 4B10

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9289154
4.4.2.25	Charge, Proof, 155MM, PXR-6255 for 155MM Cannon M185 and M199				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Assembly damaged or improper to the extent that black powder can escape		100%	3.2	Visual-Manual
Major					
101	Base pad not in true position with respect to outer diameter of charge (to be determined after straps are securely tied and charge is laced)		100%	3.2	Gage
102	Dimensional gage failure		100%	3.5	Gage
103	Lacing missing, improper, or insecure		100%	3.2	Visual-Manual
104	Igniter protector cap missing or improperly attached		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.6	Visual
202	Location of lacing jacket		0.65%	3.2	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.26	Container, Prior to insertion of charge		9293302
			NEXT HIGHER ASSEMBLY: -

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Foreign matter or rust in container		100%	3.2	Visual
102	Bottom cushion missing		100%	3.2	Visual
103	Charge not tightly wrapped immediately prior to insertion into container (i.e., no void is allowed between charge and wrapper)		0.40%	3.2	Visual
Minor					
201	Damaged container (to include dents protruding greater than 1/4 inch into container)		0.65%	3.2	Visual-Gage (see 6.4)

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 2	DRAWING NUMBER
4.4.2.27	Container, Prior to Sealing		9293302
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Wrapper or long filler above top of charge (to be inspected with charge in container)		100%	3.2	Visual
102	Charge diametrically loose to the extent that a long filler may be inserted		100%	3.2	Manual
103	Any component missing or improper		100%	3.2	Visual
104	Dimension "X", minimum. (In lieu of measuring Dimension "X", the measurement of Dimension "Y", maximum may be taken)		100%	3.2	Gage
105	Filler inserted in container prior to inserting top cushion		0.40%	3.2	Visual
106	More than five long fillers present		0.40%	3.2	Visual
107	Overlap of one long filler with another		0.40%	3.2	Visual
108	Fillers improper type		0.40%	3.2	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.27	CONTINUATION SHEET				9293302
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Major					
109	Cover cannot be removed by hand (immediately prior to application of torque)		0.40%	3.2	Manual
110	Charge cannot be removed by hand	(a)		3.2	4.5.7
111	Top cushion incorrect type		0.40%	3.2	Visual
Minor	None defined				
(a)	One sample from each eight (8) hours production.				

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.28	Container, Sealed				9293302
					NEXT HIGHER ASSEMBLY –
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Test plug missing		100%	3.2	Visual
102	DOD symbol missing, misleading or unidentifiable (if applicable)		0.40%	3.2	Visual
103	Test plug assembly torque		0.40%	3.7	Test
104	Air pressure test		100%	3.2	4.5.4
Minor					
201	Test plug not greased (to be checked after air pressure test and prior to reassembly)		0.65%	3.2	Visual
202	Metallic seal missing or incorrectly applied		0.65%	3.2	Visual
203	Marking missing, misleading, or unidentifiable		0.65%	3.2	Visual
204	Cover incompletely engaged		0.65%	3.2	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-C-48361 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9293302
4.4.2.29	Containerized Charge				NEXT HIGHER ASSEMBLY –
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Note (a)	Tear down Inspection	(b)		(c)	4.5.6

NOTES:

(a) Category is critical or major dependent upon the category of the defect inspected.
(b) See paragraph 4.4.3.1
(c) Requirement paragraph is dependent upon inspection performed.

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Teardown Inspection

4.4.3.1.1 Lot Sampling.-Twenty-five completely assembled charges shall be randomly selected from each lot. If there is a lapse in production in excess of ninety (90) days, sampling will return to initial production lot sampling.

4.4.3.1.2 Initial Production Lot Sampling.-In addition to the samples of 4.4.3.1.1, three completely assembled charges shall be randomly selected from each days production until three consecutive days production is found acceptable.

4.4.3.2 Moisture Content of Black Powder.-At least one sample of black powder from each eight hours loading of igniter core bag assemblies and base igniter cap assemblies will be tested for moisture content.

4.4.4 Inspection Equipment.-The inspection equipment required to perform the examinations and tests prescribed herein is described in the 'Paragraph Reference/Inspection Method' column in the tables starting with paragraph 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078 and para. 6.3 of this specification.

4.5 Test Methods and Procedures

4.5.1 Weight of Black Powder in Igniter Core Loading Assembly and Base Igniter Cap Loading Assembly.-The inspection below is to be conducted by inspection personnel using equipment designated for inspection purposes and shall be clearly distinguished from production operations. The loaded assemblies will be inspected 100 percent. The weight of the black powder will be determined by subtracting an average weight of the empty assembly or the actual weight as marked on the individual assembly from the loaded assembly weight. Any assembly which fails to comply with the applicable requirement shall be classed defective and removed from the lot. Inspection equipment shall be in accordance with 4.4.4.

4.5.2 Propellant Weight (see 3.4).-The inspections below are to be conducted by inspection personnel using equipment designated for inspection purposes and shall be clearly distinguished from production operations. Any increment which fails to comply with the applicable requirement shall be classed defective and removed from the lot. Inspection equipment shall be in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

4.5.2.1 Method 1 - The loaded increments will be inspected 100 percent. The weight of the propellant will be determined by subtracting an average weight of the empty increment bag or the actual weight as marked on the individual increment bag from the loaded increment weight.

4.5.2.2 Method 2 - The propellant will be inspected 100 percent prior to loading the increment on a different balance. In addition, the propellant weight of the loaded increment will be inspected using a sampling plan from MIL-STD-105 or MIL-STD-1235 with an AQL of 0.40 percent. The weight of the propellant will be determined by subtracting an average weight of the empty increment bag or the actual weight as marked on the individual increment bag from the loaded increment weight.

4.5.3 Moisture Content of Black Powder.-The moisture content of the black powder will be determined in accordance with MIL-P-223. If any sample fails to meet the specified requirement, the eight hour production represented by the sample shall be rejected.

4.5.4 Air Pressure Test.-Each container shall be tested as specified on the appropriate drawing. A pressure drop equivalent to 3 inches of water shall be cause for rejection and removal from the lot.

4.5.5 Cloth.-At the time cloth is introduced to the sewing or cutting operation, an identification will be made for each roll to verify that proper material is used. Any cloth failing to be identified as proper material in accordance with applicable drawings and specifications shall be rejected from the lot.

4.5.6 Teardown Inspection.-Each container and proof charge will be subjected to each of the critical and 100 percent major (except major defect 101, paragraph 4.4.2.11; major defect 101, paragraph 4.4.2.12; major defect 103, paragraph 4.4.2.22; major defect 101, paragraph 4.4.2.25: major defect 104, paragraph 4.4.27) inspections defined in 4.4.2 of this specification. Samples may be accumulated or inspected upon selection providing the selection remains random and represents the lot. The inspections will be performed by the contractor and witnessed by the Government. The detection of any one of the above defects shall be cause for rejection of the lot represented by the sample, (see 6.6).

4.5.7 Charge Removal from Container.-Each sample shall be tested for removal of the propelling charge from the container by hand. The charge may be pulled out by the tying straps or the container may be inverted and the charge either pulled out

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:56Z
Check the source to verify that this is the current version before use.

or slid out. Each charge tested shall be checked for damage to the tying straps (looseness, tears, etc.) and the charge will be repaired (retie the tying straps and re-lace the charge, if necessary). Each charge tested shall be re-wrapped (may use the same wrapper if the wrapper is not badly damaged) and re-packed in accordance with this specification and the applicable drawings. Any charge that cannot be removed from the container using the above method shall be cause for rejection of the production represented by this sample.

4.5.8 Complete Igniter Alignment.-Each complete igniter assembly shall be assembled to the increment assembly utilizing an approved method of assuring alignment between the igniter method to be used during production is to be established by the contractor and approved by the government (see 6.7).

5. PREPARATION FOR DELIVERY

5.1 Packing and Marking.-The proof charges shall be packed, sealed, tested and marked in accordance with the specified requirements of Dwg. 9293302.

6. NOTES

6.1 Intended Use.-The proof charges covered by this specification are intended for use with 155MM projectiles, development and acceptance tests, and for M185 and M199 cannon proof tests. This proof charge is for Proving Ground use only, to be fired in a M199 or M185 cannon with all personnel behind a protective barrier. The proof charge is not intended for firing when the charge temperature is less than 35 degrees Fahrenheit or greater than 75 degrees Fahrenheit.

6.2 Ordering Data.-See MIL-A-48078 (PA).

6.3 Submission of Designs for Approval.-See 6.2.3 of MIL-A-48078. Submit equipment designs, as required, to Commander, US Army Armament Research and Development Command, Attn: DRDAR-QAR-I, Dover, New Jersey 07801.

6.4 Visual Examination Qualification.-When compliance with the applicable requirement is in doubt as a result of visual examination the characteristic may be measured or gaged to determine acceptability.

6.5 Inspection Lot Size.-It is noted that the size of inspection lots of components, assemblies, or items of delivery may differ from the actual quantities contractually scheduled for delivery. However, in order to facilitate scheduling of

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

tests or deliveries, inspection lots of items of delivery may be equivalent to such contract quantities provided all of the lot formation criteria and sampling provisions of this specification are maintained.

6.6 Teardown Inspection.-A list of all defects found during teardown inspection shall be submitted to Commander, US Army Armament Research and Development Command, Attn: DRDAR-QAR-Q, Dover, New Jersey 07801.

6.7 Method of Assuring Alignment Submission.-The method for assuring alignment of the complete igniter assembly shall be submitted to Commander, US Army Armament Research and Command, Attn: DRDAR-QAR-Q, Dover, New Jersey 07801, for approval.


6.8 Data Cards.-A copy of all data cards should be submitted to Commander, US Army Armament Research and Development Command, Attn: DRDAR-QAR-Q, Dover New Jersey 07801.

Custodian:
Army-AR

Preparing Activity:
Army-AR

Project Number: 1320-A245

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

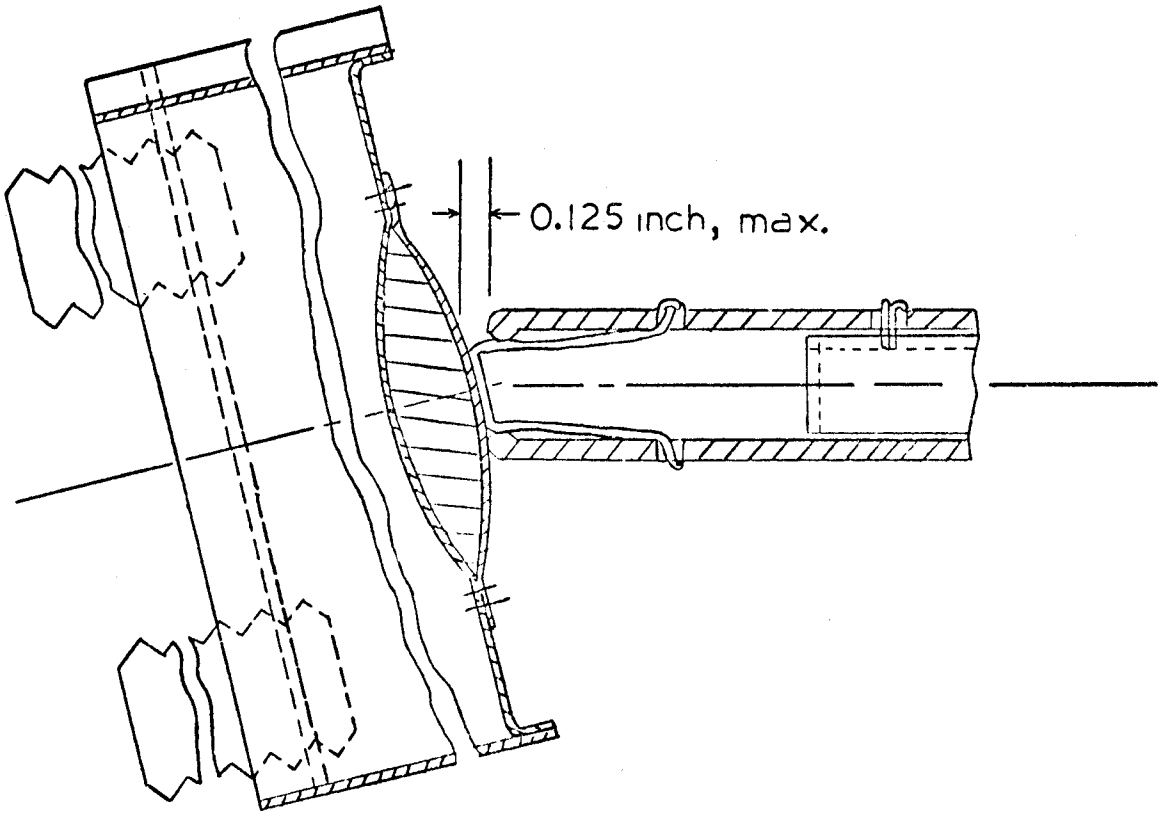

BASE IGNITER CAP AND TUBE ASSEMBLY

FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS: This form is provided to solicit beneficial comments which may improve this document and enhance its use. DoD contractors, government activities, manufacturers, vendors, or other prospective users of the document are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity. A response will be provided to the submitter, when name and address is provided, within 30 days indicating that the 1426 was received and when any appropriate action on it will be completed.
NOTE: This form shall not be used to submit requests for waivers, deviations or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements.

DOCUMENT IDENTIFIER *(Number)* AND TITLE

MIL-C-48361 Gharge, Proof, 155MM PXR-6255 Loading, Assembling, and Packing

NAME OF ORGANIZATION AND ADDRESS OF SUBMITTER

☐ VENDOR ☐ USER ☐ MANUFACTURER

1. ☐ HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE? ☐ IS ANY PART OF IT TOO RIGID, RESTRICTIVE, LOOSE OR AMBIGUOUS? PLEASE EXPLAIN BELOW.

A. GIVE PARAGRAPH NUMBER AND WORDING

B. RECOMMENDED WORDING CHANGE

C. REASON FOR RECOMMENDED CHANGE(S)

2. REMARKS

SUBMITTED BY *(Printed or typed name and address — Optional)*

TELEPHONE NO.

DATE

DD FORM 1 OCT 76 1426 EDITION OF 1 JAN 72 WILL BE USED UNTIL EXHAUSTED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:56Z
Check the source to verify that this is the current version before use.