This specification is approved for use by all Departments and Agencies of the Department of Defense

MIL-W-48272 (PA)
26 November 1973

MILITARY SPECIFICATION

WARHEAD SECTION, GM, HE: XM251

LOADING, ASSEMBLING AND PACKING

1. SCOPE

1.1 This specification covers the loading, assembling and packing for one type of warhead section designated as Warhead Section, GM, HE: XM251.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitations for bids or request for proposal, form a part of this specification to the extent specified herein:

SPECIFICATIONS

FEDERAL

MILITARY

MIL-A-2550	- Ammunition, General Specification for

STANDARDS

MILITARY

MIL-STD-105	- Sampling Procedures and Tables for Inspection by Attributes (ABC-STD-105)
MIL-STD-109	- Quality Assurance Terms and Definitions
MIL-STD-1168	- Lot Numbering of Ammunition

FSC: 1340

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

MIL-STD-1235 - Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes

DRAWINGS

U.S. Army Armament Command

9284000 - Warhead Section, GM, HE: XM251

(Copies of specifications, standards, drawings and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer).

2.2 Other publications.-The following documents form a part of this specification to the extent specified herein. Unless otherwise indicated, the issue in effect on the date of invitations for bids or request for proposal shall apply.

CODE OF FEDERAL REGULATIONS

. Title 49 - Transportation, Parts 0-190

(The Code of Federal Regulations is available from the Superintendent of Documents, U.S. Government Printing Office, Washington, D.C., 20402. Orders should specify, "49 CFR 0-190 (latest revision)".)

3. REQUIREMENTS

3.1 Material.-Materials shall be in accordance with the applicable drawings and specifications.

3.2 Parts.-The parts shall comply with all requirements specified on Drawing F-9284000, all associated drawings, and with all requirements specified in applicable specifications.

3.3 Stability of bag and filler assembly.-The foaming filler in the bag assembly shall expand and achieve a uniformly firm set within the specified time after removal from cold temperature storage.

3.4 Continuity and resistance of loaded warhead when fuze is installed at time of loading.-The cable assembly in the loaded warhead shall meet the continuity and resistance requirements listed below:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

a. With XM811 Fuze Disconnected:

From Connector 9208142	To Connector 9208136	Requirement
11	c	0.5Ω max
11	M	0.5Ω max

b. With XM811 Fuze and fuze gasket (Dwg. 9267741) installed:

From Connector 9208136	To Connector 9208136	Requirement
a	V	3.1 ± 1.0Ω
B	C	1.0Ω max
P	N	1.0Ω max
G	Z	1.0Ω max
H	Y	1.0Ω max
H	U	1.0Ω max
a	b	1.0Ω max
V	F	1.0Ω max
X	W	0.5Ω max
W	R	0.5Ω max
R	A	0.5Ω max

3.5 Plot of radial C.G. and principal axis of inclination.-The plot of the radial C.G. and principal axis of inclination for each warhead shall fall within the "acceptable" envelope of Figure 1.

3.6 Workmanship.-All parts and assemblies shall be fabricated, loaded and assembled in a thorough, workmanlike manner. They shall be free of burrs, sharp edges, cracks, dirt, grease, rust, and other foreign matter. The cleaning method used shall not be injurious to any part, nor shall the parts be contaminated by the cleaning agents. Exterior surface coatings shall be continuous; however a few light scratches not exposing base material may be permitted. All required marking and stamping shall be neat and sharply defined.

3.7 Submission of results of contractor-conducted examinations and tests.-The contractor shall forward copies of the results of any of his examinations or tests to the designated address as required by the contract. (see 6.5).

4. QUALITY ASSURANCE PROVISIONS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.1 Responsibility for inspection.-Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspection set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements. Reference shall be made to MIL-A-2550 shall apply.

4.1.1 Submission of product.-At the time the completed lot of items deliverable under the contract is submitted to the Government for acceptance, the contractor shall supply the following information accompanied by a certificate which attests that the information provided is correct and applicable to the product being submitted:

a. A statement that the lot complies with all the quality assurance provisions specified in this specification.
b. Drawing and specification number and date, together with identification and date of changes thereto.
c. A statement that all material purchased by the contractor meets requirements when such material is purchased by the contractor or commercial specifications referenced in any of the contractual documents, and that certificates of conformance are on file and available for review.
d. Number of items in the lot.
e. Date submitted.

The certificates shall be signed by a responsible agent of the certifying organization. The initial certificate submitted shall be substantiated by evidence of the agent's authority to bind his principal. Substantiation of the agent's authority will not be required with subsequent certificates unless, during the course of the contract, this authority is vested in another agent of the certifying organization.

4.2 First article inspection.-This section is not applicable to this specification.

4.3 Inspection provisions.-

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.3.1 Lot formation.-The term "inspection lot" as used in this specification is defined as an essentially homogeneous collection of units of product from which a representative sample is drawn and inspected to determine conformance with applicable requirements. The sample selected shall represent only that quantity of units from which the sample was drawn and shall not be construed to represent any prior or subsequent quantities presented for inspection. Homogeneity shall be considered to exist provided the inspection lot has been produced by one manufacturer, in one unchanged process in accordance with the same drawing, same drawing revision, same specification and same specification revision, and complies with the provisions for submission of product as specified in MIL-STD-105. Changes to process, specification, or drawing not affecting safety, performance, interchangeability, or storage, as determined by the Government, shall not be deemed to alter the homogeneity of an inspection lot. All material submitted for inspection in accordance with this specification shall comply with the homogeneity criteria specified herein regardless of the type of sampling procedure which is being applied to determine conformance with requirements. Lot numbering, as required, shall be in accordance with MIL-STD-1168. Each inspection lot shall contain:

a. Metal parts assemblies of one lot interfix number from one manufacturer.
b. Grenades from one lot interfix number from one manufacturer.
c. Warhead fuzes of one lot interfix number from one manufacturer.

4.3.2 Examination.-The examinations listed in the following subparagraphs shall be performed on inspection lots (see 4.3.1) of the components or assemblies designated in the applicable paragraph headings. Inspection for critical defects (and major defects, when so specified) shall be 100 percent. Sampling plan for major and minor defects shall be in accordance with MIL-STD-105 except that continuous sampling plans in accordance with MIL-STD-1235 may be used if approved by the Government. Individual defects shall have an AQL of 0.40 percent for each major defect and an AQL of 0.65 percent for each minor defect. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.3.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.3.2.1 Metal parts assembly, XM251 (See Dwg. 9283999).-

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	100% Inspection		
101.	Gap between booster and end primer in forward shield assembly No. 1, max (2 places) port covers removed - See View HH	Gage	01001
102.	Gap between booster and end primer in double end primer assembly, max (4 places) port covers removed - See Section BB	Gage	01002
103.	Gap between booster and end primer in forward shield assembly No. 2, max. (2 places) port covers removed - See View TT	Gage	01003
104.	Centerline mismatch of booster and end primer in forward shield assembly No. 2, max. (2 places) port covers removed- See View TT	Gage	01004
105.	Gap between booster and end primer in aft ring assembly, max. (with booster cover off) See 4.4.8 - See View L	Gage	01005
106.	Height of booster above end primer in MDF and primer assembly, min. (with booster cover off)-See View L	Gage	01006
107.	Centerline mismatch of booster end primer assembly, max. (with barrier cover off)- See View ZZ	Gage	01007
108.	Gap between booster and end primer in MDF and primer assembly, max (with booster cover off)-See View ZZ	Gage	01008
109.	Gap between booster and primer in aft shield assembly, max. (2 places)	Gage	01009
110.	Any component loose, missing or damaged	Visual	01010

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

INSPECTION NO

Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	01010

4.3.2.2 Metal parts assembly, with nose assembly and aft ring assembly removed (see dwg. 9283999).-

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	100% Inspection		
101.	Flexible explosive missing from fuze ring (peel tape back)	Visual/Manual	02001
102.	Gap between booster and detonating cord booster in detonating cord and booster assembly (4 places with boosters assembled to aft ring assembly)See Section HH	Gage	02002
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	02003

4.3.2.3 Bag (See Dwg. 8880946-1)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:			
101.	Width	Gage	03001
102.	Distance to radius	Gage	03002
103.	Radius	Gage	03003
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	03004

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.3.2.4 Bag (See Dwg. 8880946-2)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:			
101.	Length	Gage	04001
102.	Width	Gage	04002
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	04003

4.3.2.5 Bag assembly (See Dwg. 8880945)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	100% Inspection		
101.	Cut or tear	Visual	05001
102.	Stitches broken or missing	Visual	05002
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	05003

4.3.2.6 Bag and filler assembly (See Dwg. 8880943)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	100 Percent Inspection		
101.	Filler missing	Visual	06001
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	06002

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.3.2.7 Bag, polyethylene (See Dwg. 9287511)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	100% Inspection		
101.	Cut or tear	Visual	07001
Major:			
102.	Length	Gage	07002
103.	Width	Gage	07003
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	07004

4.3.2.8 Bag and bag and filler assembly (See Dwg. 9287515)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	100% Inspection		
101.	Flaps facing wrong direction	Visual	08001
102.	Open end of bag and filler assembly facing toward open end of polyethylene bag	Visual	08002
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	08003

4.3.2.9 Block, wood (See Dwg. 9287485) -

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:			
101.	Length	Gage	09001
102.	Width	Gage	09002
103.	Height	Gage	09003
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	09004

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.3.2.10 Warhead Section, during loading, GM, HE: XM251 (See Dwg. 9284000)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	100% Inspection		
101.	Containment block pad missing or improperly installed	Visual	10001
102.	Wood blocks missing	Visual	10002
103.	Distance to bombs and wood blocks	Gage	10003
104.	Polyethlene sheet improperly installed, torn, or missing	Visual	10004
105.	Incorrect number of bag and bag and filler assemblies	Visual	10005
106.	Bag and bag filler assembly flaps facing forward	Visual	10006
107.	Wedges missing or improperly assembled	Visual	10007
108.	Skin missing or improperly assembled	Visual	10008
109.	Spacer missing or improperly assembled	Visual	10009
110.	Insulation tape missing damaged or improperly installed on aft ring assembly	Visual	10010
111.	O-Ring missing, damaged or improperly installed on aft ring assembly	Visual	10011
Minor:			
201.	Evidence of poor workmanship (See 3.4)	Visual	10012

4.3.2.11 Warhead Section GM, HE: XM251 after assembly of aft ring assembly and prior to assembly of boosters (See Dwg. 9284000)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

Major:	100% Inspection		
101.	Gap between booster and end primer in forward shield assembly No. 1, max (2 places) port covers removed·See Dwg. 9283999-View HH)	Gage	11001
102.	Gap between booster and end primer in double end primer assembly,max (4 places) port covers removed -See Dwg. 9283999 - Section BB	Gage	11002
103.	Gap between booster and end primer in forward shield assembly No. 2 max (2 places) port covers removed-See Dwg. 9283999-View TT	Gage	11003
104.	Centerline mismatch of booster and end primer in forward shield assembly No. 2, max (2 places) port covers removed See Dwg. 9283999 View TT)	Gage	11004
105.	Gap between booster and end primer in aft ring assembly, max (with booster cover off) See 4.4.8 See Dwg. 9283999 - View L	Gage	11005
106.	Height of booster above end primer in MDF and primer assembly min. (with booster cover off)	Gage	11006
107.	Centerline mismatch of booster and end primer in MDF and primer assembly, max. (with booster cover off)	Gage	11007
108.	Gap between booster and end primer in MDF and primer assembly, max. (with booster cover off)	Gage	11008
109.	Gap between booster and primer in aft shield assembly, max. (2 places)	Gage	11009
110.	Distance from aft skin to aft ring assembly, max.	Gage	11010
111.	Screws holding aft ring assembly loose or missing	Visual/Manual	11011
112.	Center tube bolt O-ring improperly assembled or missing	Visual	11012
113.	Center tube bolt moves when subjected to minimum torque	Gage	11013
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	11014

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.3.2.12 Warhead section, GM, HE: XM251 during and after assembly of fuze, port covers, and boosters (See Dwg. 9284000)

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Fuze armed	Visual	12001
Major:	100% Inspection		
101.	Fuze gasket missing or improperly assembled	Visual	12002
102.	Lock washers missing from fuze cap screws	Visual	12003
103.	Fuze cap screws move when subjected to minimum torque	Gage	12004
104.	Lead seals missing or improperly assembled to fuze cap screws	Visual	12005
105.	Insulation missing from port covers	Visual	12006
106.	Setback plug missing or improperly assembled (2 places)	Visual	12007
107.	Setback rod missing (2 places)	Visual	12008
108.	Setback rod below tapered seating surface for setscrew (2 places)	Visual	12009
109.	Setscrew missing or improperly assembled (2 places)	Visual	12010
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	12011

4.3.2.13 Warhead Section, GM, HE: XM251 (See Dwg. 9284000)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:	100% Inspection		
101.	Adhesive missing from slits in skin, around port covers and between forward and aft skins	Visual	13001
102.	Nose assembly loose or improperly assembled	Visual/Manual	13002

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:55Z
Check the source to verify that this is the current version before use.

	103. Gap between nose assembly and forward skin, max (See Dwg. 9283999)	Gage	13003
	104. Tee bolts bind in cavities	Manual	13004
	105. Aft section seal missing, damaged or improperly assembled	Visual	13005
	106. Weight	Gage	13006
	107. Longitudinal center of gravity	Test	13007
	108. Runout	Gage	13008
	109. Pitch and yaw moment of inertia	Test	13009
	110. Roll moment of inertia	Test	13010
	111. Interface of aft ring assembly improper	Gage	13011
	112. Connector pins in cable assembly damaged (aft end)	Gage	13012
	113. Protector cap missing or improperly assembled to electrical receptacle connector	Visual/Manual	13013
	114. Any component removed during inspection and testing improperly reassembled or damaged	Visual	13014
Minor:			
	201. Evidence of poor workmanship (See 3.6)	Visual	13015

4.3.2.14 Pkg and Mkg for Warhead Section GM, HE: XM251; Prac: XM198E1, Tng: XM201, prior to assembly of cover assembly (See Dwg. 9211190)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:			
	101. Swing bolts not in place in aft support assembly	Visual	14001
	102. Swing bolt nuts move when minimum torque is applied	Gage	14002
	103. Safety pin missing or improperly assembled to strap assembly	Visual	14003
Minor:			
	201. Evidence of poor workmanship (See 3.6)	Visual	14004

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.3.2.15 Pkg and Mkg for Warhead Section, GM, HE: XM251; Prac: XM198E1; Tng XM201 (See Dwg. 9211190)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined		
Major:			
101.	Cover assembly improperly assembled	Visual	15001
102.	T-bolts missing or improperly assembled	Visual	15002
103.	T-bolts move when minimum torque is applied	Gage	15003
104.	Lead seals missing or improperly assembled	Visual	15004
105.	Marking missing, incomplete or illegible	Visual	15005
Minor:			
201.	Evidence of poor workmanship (See 3.6)	Visual	15006

4.3.3 Testing.

4.3.3.1 Stability of bag and filler assembly (See 3.3) Major Defect, Code No. 16001.-One (1) bag and filler assembly shall be selected from each group of twenty-five (25) or less bag and filler assemblies produced. The filler for each group shall be homogeneous and mixed at one time. Groups over twenty-five (25) shall be qualified by selecting one sample from each unit of twenty-five (25) or portion thereof produced. If a bag and filler assembly fails to meet the applicable requirement, the filler batch represented by that assembly shall be rejected. The test shall be performed as specified in 4.4.1 using equipment in accordance with 4.3.4.

4.3.3.2 Insulation resistance of cable assembly, prior to loading (See Dwg. 9208657), Major Defect, Code No. 17001.-Prior to loading, each cable assembly in each warhead shall be subjected to this test. The test shall be performed as specified in 4.4.2 using equipment in accordance with 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.3 Continuity and resistance of cable assembly, prior to loading (See Dwg. 9208657), Major Defect, Code No. 18001.-Prior to loading and after performance of the test specified in 4.3.3.2

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:55Z
Check the source to verify that this is the current version before use.

each cable assembly in each warhead shall be subjected to this test. The test shall be performed as specified in 4.4.3, using equipment in accordance with 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.4 Insulation resistance of cable assembly, after loading (See Dwg. 9208657), Major Defect, Code No. 19001.-After loading each cable assembly in each warhead shall be subjected to this test. The test shall be performed as specified in 4.4.4 using equipment in accordance with 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.5 Continuity and resistance of cable assembly, after loading (See Dwg. 9208657), Major Defect, Code No. 20001.-After loading and performance of the test specified in 4.3.3.4 each cable assembly in each warhead shall be subjected to this test. The test shall be performed as specified in 4.4.5, using equipment in accordance with 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.6 Continuity and resistance of loaded warhead when fuze is installed at time of loading (See 3.4), Major Defect Code No. 21001.-When the fuze is assembled to the warhead at the time of loading, this test shall be performed in lieu of the test specified in 4.3.3.5. The test shall be performed on each cable assembly in each warhead after performance of the test specified in 4.3.3.4. The test shall be performed as specified in 4.4.6, using equipment in accordance with 4.3.4. Any assembly which fails to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.7 Plot of radial C.G. and principal axis of inclination (See 3.5), Major Defect, Code No. 22001.-Each warhead shall have the radial C.G. and principal axis of inclination inspected. These results shall then be plotted and compared with Figure 1. Any assembly which fails to comply with the applicable requirement shall be classed defective and removed from the lot. The test shall be performed as specified in 4.4.7 using equipment in accordance with 4.3.4.

4.3.4 Inspection equipment.-The inspection equipment required to perform the examinations and tests prescribed in this section is identified under the "Method of Inspection" headings in 4.3.2 and in 4.3.3 (See 6.3)

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:55Z
Check the source to verify that this is the current version before use.

4.4 Test methods and procedures.-

4.4.1 Stability of bag and filler assembly.-The bag and filler assembly shall be removed from cold temperature storage and allowed to sit at room temperature. After the specified time, observation shall be made for conformance with the applicable requirement. This is a destructive test. Assemblies subjected to this test shall not be returned to the lot.

4.4.2 Insulation resistance of cable assembly, prior to loading.-The cable assembly in each warhead, prior to loading, shall be subjected to the insulation resistance test using approved test equipment. This is a non-destructive test. Assemblies subjected to this test shall be returned to the lot.

4.4.3 Continuity and resistance of cable assembly prior to loading.-The cable assembly in each warhead, prior to loading, shall be subjected to a continuity and resistance test using a approved test equipment. This is a non-destructive test. Assemblies subjected to this test shall be returned to the lot.

4.4.4 Insulation resistance of cable assembly, after loading.-The cable assembly in each warhead, after loading, shall be subjected to the insulation resistance test using approved test equipment. This is a non-destructive test. Assemblies subjected to this test shall be returned to the lot.

4.4.5 Continuity and resistance of cable assembly, after loading.-The cable assembly in each warhead, after loading shall be subjected to the continuity and resistance test using approved test equipment. This is a non-destructive test. Assemblies subjected to this test shall be returned to the lot.

4.4.6 Continuity and resistance of cable assembly of loaded warhead when fuze is installed at time of loading.-The cable assembly in each warhead, aftemloading and prior to assembly of the fuze, shall have the contacts listed in 3.8.1 inspected for continuity and resistance. After performance of this inspection and assembly of the fuze to the warhead, the contacts specified in 3.8.2 shall be subjected to a continuity and resistance test. Approved test equipment shall be used for these inspections. This is a non-destructive test. Assemblies subjected to this test shall be returned to the lot.

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:55Z
Check the source to verify that this is the current version before use.

4.4.7 Plot of radial C.G. and principal axis of inclination.-

4.4.7.1 Radial C.G.-Each loaded warhead shall be subjected to the radial C.G. Test using approved test equipment. This is a non-destructive test. Assemblies subjected to this test shall be returned to the lot.

4.4.7.2 Principal axis of inclination.-Each loaded warhead shall be subjected to the principal axis of inclination test using approved test equipment. This is a non-destructive test. Assemblies subjected to this test shall be returned to the lot.

4.4.7.3 Plot of radial C.G. and principal axis of inclination The results of the tests specified in 4.4.7.1 and 4.4.7.2 shall be plotted against Figure 1.

4.4.8 Gap between booster and end primer in aft ring assembly, Max.-This inspection shall be made using approved gages. First, the distance to the end primer from the aft ring assembly shall be measured. Then, the length of the booster shall be measured. Last, the distance from the aft ring assembly to the installed booster shall be measured. The gap between the booster and primer shall be determined as follows:

Gap = Distance from aft ring assembly to primer - (length of booster + distance from aft ring assembly to installed booster)

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging.-

5.1.1 Level A.-The warhead section shall be preserved and packaged in accordance with Dwg. 9211190.

5.2 Packing .-

5.2.1 Level A.-The warhead section, preserved and packaged as specified in 5.1.1, shall be packed in accordance with Dwg. 9211190.

5.3 Marking.-Marking shall be in accordance with Dwg. 9211190 and Code of Federal Regulations, Title 49 Parts 171-179.

5.4 Shipping.-When warhead sections from more than one lot are shipped as a carload, each lot shall be kept separate, and the division between lots clearly indicated to prevent mixing of the lots in transit.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

6. NOTES

6.1 Ordering data.-Procurement documents shall specify the following:

a. Title, number and date of this specification.

b. Data cards shall be prepared for each lot in accordance with the information specified in Standard MIL-STD-1167.

c. Provisions for submission of first article samples.

6.2 Inspection code numbers.-The five digit code numbers assigned to the inspections herein are to facilitate future data collection and analysis by the Government.

6.3 Inspection Equipment Designs.-Inspection equipment designs are of two types: Government Special Inspection Equipment (SIE) designs and contractor designs. SIE designs are designated by drawing numbers under the "Method of Inspection" headings in Section 4. Design responsibility for all other inspection equipment is assigned to the contractor. The contractor need not furnish any design when a complete Government SIE design is provided. Unless otherwise specified, however, the contractor may submit alternate or modified contractor designs of SIE in accordance with 6.3.2 and 6.3.3 should he elect to do so.

6.3.1 SIE designs.-SIE designs may consist of any of the following:

a. Detailed drawings which completely depict all information necessary for the fabrication and use of the item of inspection equipment.

b. A source control drawing or a specification control drawing as defined in MIL-STD-100.

c. An envelope drawing, as defined in MIL-STD-100, which establishes the criteria which a detail design shall meet. When envelope drawings are specified, the contractor shall prepare designs which comply with the criteria therein.

6.3.2 Contractor designs.-Contractor designs are required for all inspection equipment for which SIE designs are not specified and may include commercial equipment which the contractor proposes to use. (Commercial equipment is defined as unmodified equipment which is catalogued and available for purchase by the general public). Contractor designs shall include appropriate operating instructions, calibration pro-

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:55Z
Check the source to verify that this is the current version before use.

cedures and maintenance procedures. Commercial equipment shall be fully described by catalog listings or other means which provide sufficient information to permit identification and evaluation by the Government and may include illustrations and engineering data. Designs shall be prepared for any special fixture(s) required to be used with commercial equipment, or with SIE designs if not otherwise covered thereby (see 6.3.1c). Designs shall be of the category and form (per MIL-D-1000) specified in the Contract Data Requirement Lists (DD Form 1423).

The contractor is referred to MIL-HDBK-204, "Inspection Equipment Design" for guidance. The specification number and the applicable five-digit defect code number (or other specific identifying information) from Section 4 of this specification shall be referenced on each contractor design.

6.3.3 Submission of designs for approval.-Contractor designs shall be approved by the Government prior to fabrication or procuring the equipment. Designs shall be submitted for approval in accordance with the stipulations, time frame and distribution specified in the Contract Data Requirements List (DD Form 1423). Partial submission of inspection equipment designs is permissible and encouraged. However, the completion date for design review will be based on the date of the final submission of designs. Picatinny Arsenal design review will normally be accomplished within one month after receipt.

6.4 Submission of test data.-In addition to the normal distribution of records, when the warhead section is procured by the U.S. Army Munitions Command, one (1) copy of all ballistic data and ammunition data cards shall be forwarded to: Commanding Officer, Picatinny Arsenal, Attn: SARPA-QA-A-S.

6.5 Submission of results of contractor-conducted examinations and tests.-Unless otherwise specified by the Contracting Officer, the contractor shall forward records of examinations or tests to Commanding Officer, Picatinny Arsenal, Attn: SARPA-QA-A-S.

6.6 Distribution of ammunition data cards.-Distribution of data cards shall include the following: Commanding Officer, Picatinny Arsenal, Attn: SARPA-QA-A-S, Dover, New Jersey, 07801.

Custodian:
Army-PA

Preparing Activity:
Army-PA

Project Number: 1340-A412

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:55Z
Check the source to verify that this is the current version before use.

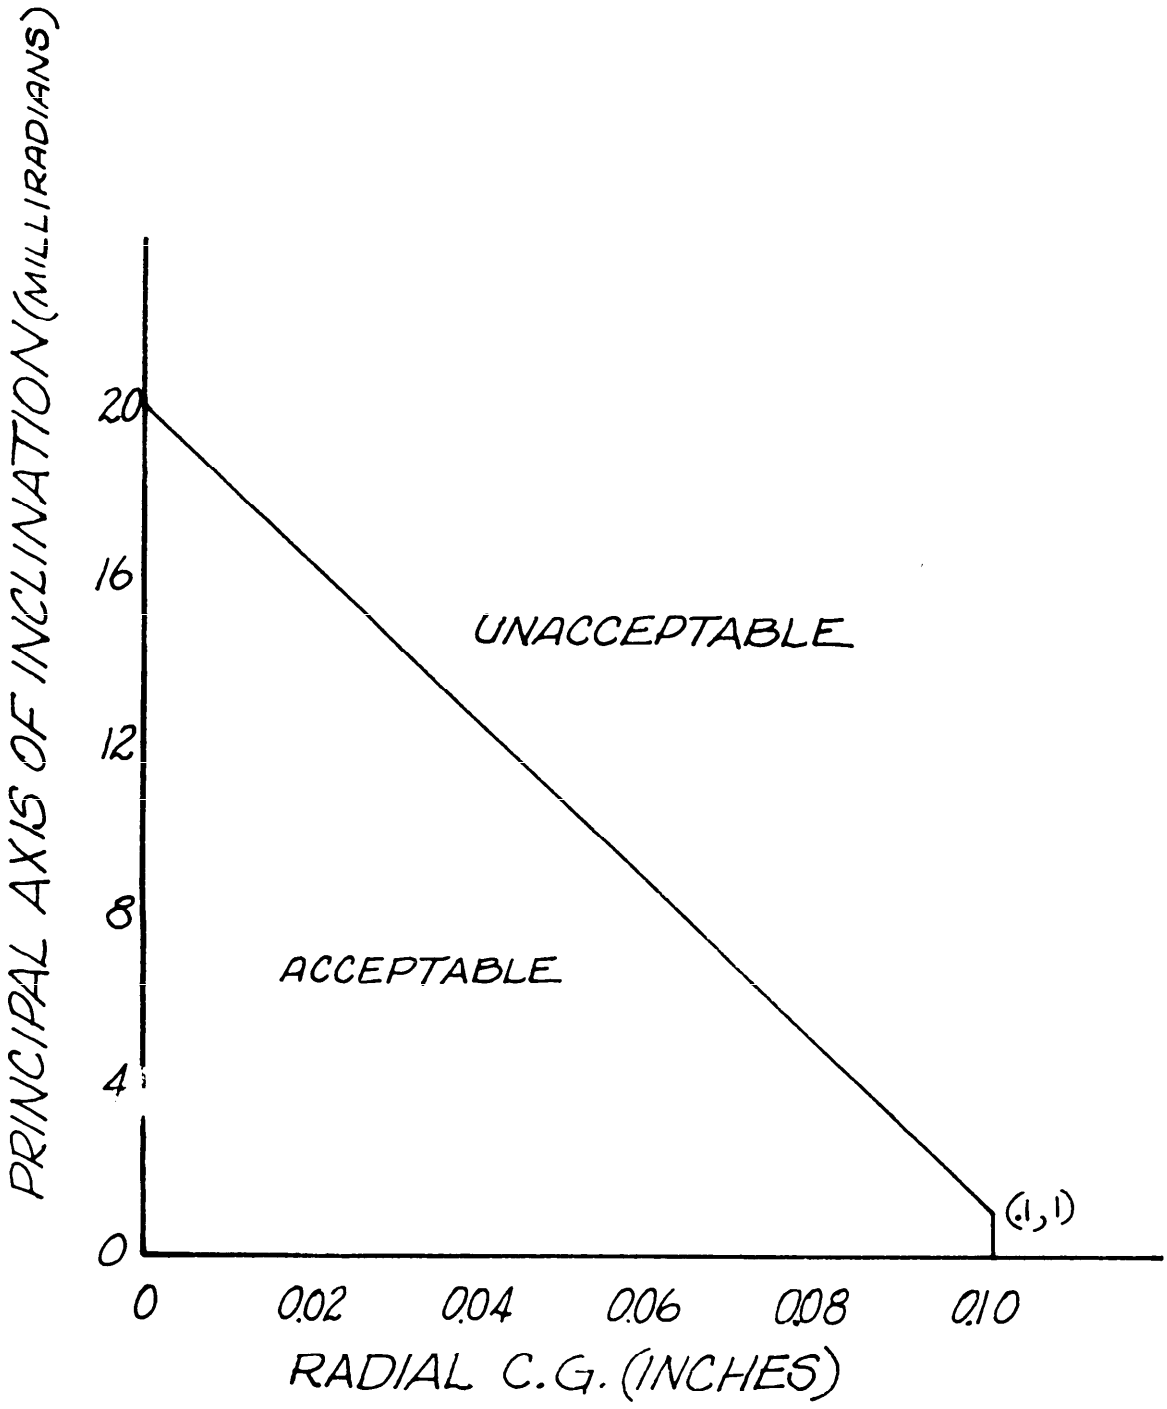


FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:55Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

[ ] DIRECT GOVERNMENT CONTRACT [ ] SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

[ ] YES [ ] NO *If "Yes", in what way?*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 65 WHICH MAY BE USED.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

FOLD

DEPARTMENT OF THE ARMY
PICATINNY ARSENAL
DOVER, NEW JERSEY 07801

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY
DOD – 314



COMMANDER
Picatinny Arsenal
ATTN: SARPA-QA-A
Dover, New Jersey 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.