MILITARY SPECIFICATION

WARHEAD, 2.75 INCH ROCKET, FLECHETTE, XM255 WITH AND WITHOUT FUZE LOADING, ASSEMBLING AND PACKING

This specification is approved for use by the U. S. Army Armament Research and Development Command, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the quality assurance provisions and special requirements not covered by the drawings for one type of Warhead designated as Warhead, 2.75 Inch Rocket Flechette, XM255.

2. APPLICABLE DOCUMENTS

2.1 Issues of Documents.- The following documents of the issue in effect on date of invitation for bids or request for proposals, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-A-48078 - Ammunition Standard Quality Assurance Provisions, General Specification for

STANDARDS

FEDERAL

FED-STD-151 - Metals, Test Methods

MILITARY

MIL-STD-1169 - Packaging, Packing and Marking for Shipment of Inert Ammunition Components

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Commander, US Army Armament Research and Development Command, Attn. DRDAR-QA, Dover, New Jersey 07801 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

FSC: 1340

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

DRAWINGS

Army

Dwg. 9298304 - Warhead, 2.75 Inch Rocket Flechette XM255 w/fuze,XM439

3. REQUIREMENTS

3.1 Material- Materials and parts shall be in accordance with applicable drawings and specifications.

3.2 Components and Assemblies.- The components and assemblies shall comply with all requirements specified on Dwg. 9298304 and associated drawings and with all requirements specified in applicable specifications and standards.

3.3 Metal and Plastic Defects.- All of the components prior to painting or chemical treatment shall be free of surface imperfections on the interior and exterior surfaces of the part which are indications of discontinuities internal to the material. (Included are cracks, lube bursts, pipes, laminations, segregations, porosity, air holes, flakes, inclusions, and other internal defects).

3.4 Leak Test.- Each warhead less fuze, but with the base plug properly installed shall not leak at a rate in excess of 0.0001 cc/sec.

3.5 Electrical Resistance of Warhead Assembly.- The electrical resistance between the forward umbilical connector on the warhead assembly and the aft receptacle on the warhead assembly for each individual conductor and shield shall be three (3.00) Ohms maximum. (Dwg. 9297239)

3.6 Insulation Resistance of Warhead Assembly.- The insulation resistance between the conductor and shield of the cable assembly and between the conductor and case on the warhead assembly and between the shield and case shall be one (1.00) megohm, minimum. (Dwg. 9297239)

3.7 Static Firing.- The warhead assembly (Dwg. 9297239) less fuze XM439, but with a detonator assembly simulating the XM439 fuze and approved by the procuring activity, shall fire expelling the flechettes and tracer assemblies and each tracer assembly will ignite and continue to undergo the combustion process for at least four (4) seconds emitting visible light.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

3.7.1 Warhead Outer Case Rupture.- A warhead assembly outer case shall not rupture.

3.7.2 Aft Closure Plug Rupture.- A warhead aft closure plug shall not rupture.

3.7.3 Payload Assembly Expulsion.- A warhead assembly shall not expel an incomplete payload. Incomplete payload expulsion shall be evidenced by any one flechette or flechettes remaining within the case. In addition, incomplete payload expulsion shall be evidenced by any one or more tracer assemblies remaining within the case. Ricocheting expelled flechettes/tracers reentering the warhead case shall not be considered an incomplete payload expulsion.

3.7.4 Tracer Assembly Ignition.- Each tracer assembly from each warhead assembly shall ignite and burn for 4.0 seconds minimum.

3.8 Warhead Charge Circuit Resistance (With Fuze XM439).- The resistance of the charge circuit shall be between 230 ohms minimum and 3300 ohms maximum.

3.9 First Article Inspection.- This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.10 Workmanship.- The components and assemblies shall be fabricated and finished in a thorough, workmanlike manner. They shall be free of burrs, sharp edges, unblended radii, dirt, grease, rust, corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part nor shall the parts be contaminated by the cleaning agent. Surface coatings shall be continuous except for a few slight scratches not exposing base material. All required markings shall be neat and sharply defined.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for Inspection and Standard Quality Assurance Provisions. - Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of Inspections.- The following types of inspection shall be conducted on this item:

a. First Article Inspection

b. Quality Conformance Inspection

Source: https://assist.dla.mil -- Downloaded: 202640-26T03:55Z
Check the source to verify that this is the current version before use.

4.3 First Article Inspection

4.3.1 Submission.- The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provision of 4.3.2. The first article sample shall consist of the following items in sample quantities as indicated.

PART DESCRIPTION	DRAWING	QUANTITY
WHD, 2.75 Inch Rocket, Flechette, XM255 W/Fuze XM439	9298304	5
WHD, 2.75 Inch Rocket, XM255	9297239	24
Pellet, Tracer	9271948	5
Pellet, Tracer Ignition	9271947	5
Case, Tracer Charge	9271946	5
Charge Assembly Tracer	9271945	5
Support, Ballast	9271944	5
Ballast, Tracer	9271942	5
Body, Tracer	9271941	5
Closure, Tracer	9271943	5
Tracer Assembly	9271940	5
Cable Assembly, Interconnecting	9271951	5
Container	9271936	5
Charge Assembly, Expulsion	9271935	5
Plate, Pusher	9271931	5
Support, Tracer	9271939	5
Spacer, Tracer Cavity	9271949	5
Support, Pusher Plate	9271932	5
Seal	9271934	5
Bushing, Cable Sealing	9297241	5
Support Fuze and Pusher Plate	9271933	5
Tube, Wire Support	9271950	5
Pusher Plate Assembly	9271930	5
Flechette	9271956	5
Flechette Belt Assembly	9271955-1	5
Flechette Belt Assembly	9271955-2	5
Flechette Belt Assembly	9271955-3	5
Sleeve	9271954	5
Payload Assembly	9271929	5
Case, Warhead	9271928	5
Packing	9271961	5
Pin, Nose Cone Base	9297238	5
Cone, Nose	9297237	5
Base, Nose Cone	9297236	5
Case Assembly, Flechette Warhead	9297235	5
Nose Cone Assembly	9297242	5
Plug, Case Closure	9271973	5
Plug Assembly	9287912	5
Pad, Felt	9287911	5
Packing	9271972	5

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.3.2 Inspections to be Performed.- The first aritcle parts submitted in accordance with paragraph 4.3.1 above will be subjected by the Government to any or all the requirements of the applicable drawings and to the Examinations and Tests of Table I.

4.3.3. Rejection.- See MIL-A-48078

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE TESTS

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48299 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
	Warhead, 2.75 Inch Rocket Flechette	1 OF 6	See Below
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
9	WHD, 2.75 Inch Rocket, Flechette XM255 (Dwg. 9297239)				
	Examination for Defects	24		3.2	4.4.2.33
	Electrical Resistance Test	24		3.5	4.5.1
	Insulation Resistance Test	24		3.6	4.5.2
	Leak Test	24		3.4	4.5.4
	Static Functioning Test	24		3.7	4.5.6
	WHD, 2.75 Inch Rocket, Flechette XM255 (Dwg. 9298304)				
	Examination for Defects	5		3.2	4.4.2.38
	WHD. Charge Circuit Resistance	5		3.8	4.5.9
	Tracer Ballast (Dwg. 9271942)				
	Examination for Defects	5		3.2	4.4.2.6
	Weight Test	5		3.2	4.5.3
	Expulsion Assembly Charges (Dwg. 9271936)				
	Examination for Defects	5		3.2	4.4.2.12
	Weight Test	5		3.2	4.5.5
	Flechette (Dwg. 9271956)				
	Examination for Defects	5		3.2	4.4.2.22
	Hardness Test	5		3.2	4.5.7

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE TESTS

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 2 OF 6		DRAWING NUMBER
	Warhead, 2.75 Inch Rocket Flechette				See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Pellet Tracer (Dwg. 9271948) Examination for Defects	5		3.2	4.4.2.1
	Pellet Tracer Ignition (Dwg. 9271947) Examination for Defects	5		3.2	4.4.2.2
	Case Tracer Charge (Dwg. 9271946) Examination for Defects	5		3.2	4.4.2.3
	Charge Assembly Tracer (Dwg. 9271945) Examination for Defects	5		3.2	4.4.2.4
	Support Ballast (Dwg. 9271944) Examination for Defects	5		3.2	4.4.2.5
	Body Tracer (Dwg. 9271941) Examination for Defects	5		3.2	4.4.2.7
	Closure Tracer (Dwg. 9271943) Examination for Defects	5		3.2	4.4.2.8

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE TESTS

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 3 OF 6		DRAWING NUMBER
	Warhead, 2.75 Inch Rocket Flechette				See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Tracer Assembly (Dwg. 9271940) Examination for Defects	5		3.2	4.4.2.9
	Cable Assembly Interconnecting (Dwg. 9271951) Examination for Defects	5		3.2	4.4.2.10
	Container (Dwg. 9271936) Examination for Defects	5		3.2	4.4.2.11
	Charge Assembly Expulsion (Dwg. 9271935) Examination for Defects	5		3.2	4.4.2.12
	Plate Pusher (Dwg. 9271931) Examination for Defects	5		3.2	4.4.2.13
	Support Tracer (Dwg. 9271939) Examination for Defects	5		3.2	4.4.2.14
	Spacer Tracer Cavity (Dwg. 9271949) Examination for Defects	5		3.2	4.4.2.15

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE TESTS

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 4 OF 6	DRAWING NUMBER
	Warhead, 2.75 Inch Rocket Flechette			See Below
				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Support Pusher Plate (Dwg. 9271932) Examination for Defects	5		3.2	4.4.2.16
	Seal (Dwg. 9271934) Examination for Defects	5		3.2	4.4.2.17
	Bushing Cable Sealing (Dwg. 9297241) Examination for Defects	5		3.2	4.4.2.18
	Support Fuze and Pusher Plate (Dwg. 9271933) Examination for Defects	5		3.2	4.4.2.19
	Tube Wire Support (Dwg. 9271950) Examination for Defects	5		3.2	4.4.2.20
	Pusher Plate Assembly (Dwg. 9271930) Examination for Defects	5		3.2	4.4.2.21
	Flechette Belt Assembly (Dwg. 9271955-1,-2,-3) Examination for Defects	5		3.2	4.4.2.23

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE TESTS

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 5 OF 6		DRAWING NUMBER
	Warhead, 2.75 Inch Rocket Flechette				See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Sleeve (Dwg. 9271954) Examination for Defects	5		3.2	4.4.2.24
	Payload Assembly (Dwg. 9271929) Examination for Defects	5		3.2	4.4.2.25
	Case Warhead (Dwg. 9271928) Examination for Defects	5		3.2	4.4.2.26
	Packing (Dwg. 9271961) Examination for Defects	5		3.2	4.4.2.27
	Pin Nose Cone Base (Dwg. 9297238) Examination for Defects	5		3.2	4.4.2.28
	Cone Nose (Dwg. 9297237) Examination for Defects	5		3.2	4.4.2.29
	Base Nose Cone (Dwg. 9297236) Examination for Defects	5		3.2	4.4.2.30

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE TESTS

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 6 OF 6		DRAWING NUMBER
	Warhead, 2.75 Inch Rocket Flechette				See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Case Assembly Flechette Warhead (Dwg. 9297235) Examination for Defects	5		3.2	4.4.2.31
	Nose Cone Assembly (Dwg. 9297242) Examination for Defects	5		3.2	4.4.2.32
	Plug Case Closure (Dwg. 9271973) Examination for Defects	5		3.2	4.4.2.34
	Plug Assembly (Dwg. 9287912) Examination for Defects	5		3.2	4.4.2.35
	Pad Felt (Dwg. 9287911) Examination for Defects	5		3.2	4.4.2.36
	Packing (Dwg. 9271972) Examination for Defects	5		3.2	4.4.2.37

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.4 Quality Conformance Inspection

4.4.1 Inspection Lot Formation.- Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of warheads shall contain:

a. M-9 flake propellant from not more than one lot from one manufacturer.

b. Fuzes from not more than one lot from one manufacturer.

c. Metal parts from not more than two lots with the same interfix number from one manufacturer.

4.4.2 Examination.- See MIL-A-48078

Sampling Plans. - Unless otherwise specified in the Classification of Defects and Test Tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, inspection Level II.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9271948
4.4.2.1	Pellet, Tracer				NEXT HIGHER ASSEMBLY 9271945
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Pellet Diameter		0.40%	3.2	Gage
102	Pellet Weight		0.40%	3.2	Balance
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4B10

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9271947
4.4.2.2	Pellet, Tracer Ignition				NEXT HIGHER ASSEMBLY 9271945
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Pellet Diameter		0.40%	3.2	Gage
102	Pellet Weight		0.40%	3.2	Balance
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assistdocs.com - Downloaded: 2026-10-26T00:56Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9271946
4.4.2.3	Case, Tracer Charge				NEXT HIGHER ASSEMBLY 9271945
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Outside diameter aft end		0.40%	3.2	Gage
102	Outside diameter forward end		0.40%	3.2	Gage
Minor					
201	Case, Length		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9271945
4.4.2.4	Charge Assembly Tracer				NEXT HIGHER ASSEMBLY 9271940
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Case bulged, split or cracked		0.40%	3.2	Visual
102	Pellet pattern, aft end, incorrect or incomplete		0.40%	3.2	Gage
Minor					
201	Depth to pellet aft surface		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9271944
4.4.2.5	Support Ballast				NEXT HIGHER ASSEMBLY 9271940
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Outside diameter, aft face		0.40%	3.2	Gage
Minor					
201	Distance from aft face to step		0.65%	3.2	Gage
202	Distance from forward face to step		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.10	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.6	Ballast, Tracer		9271942
			NEXT HIGHER ASSEMBLY 9271940

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Distance, aft face to start of cone base, forward		0.40%	3.2	Gage
102	Diameter, aft face		0.40%	3.2	Gage
103	O.D. main cylinder		0.40%	3.2	Gage
104	Weight test		0.40%	3.2	4.5.3
Minor					
201	Distance, aft face to forward face		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.7	Body, Tracer				9271941
					NEXT HIGHER ASSEMBLY 9271940
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	I.D. at aft end		0.40%	3.2	Gage
102	Angle, inside exit cone		0.40%	3.2	Gage
103	O.D. base exit cone		0.40%	3.2	Gage
104	O.D. of fin blades		0.40%	3.2	Gage
105	I.D. forward end of aft cavity		0.40%	3.2	Gage
106	Inside diameter center cavity		0.40%	3.2	Gage
107	Width of base exit cone O.D.		0.40%	3.2	Gage
108	Interior cavity profile incorrect		0.40%	3.2	Gage
109	Fin location (six places)		0.40%	3.2	Gage
110	Angle, outside exit cone		0.40%	3.2	Gage
Minor					
201	Overall length from nose to aft of fins		0.65%	3.2	Gage
202	Excessive flash		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 20260-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE	SHEET	OF	DRAWING NUMBER
4.4.2.8	Closure Tracer	1	1	9271943

NEXT HIGHER ASSEMBLY: 9271940

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Depth of basic diameter		0.40%	3.2	Gage
102	Inside diameter		0.40%	3.2	Gage
103	Evidence of dents, gouges, cuts, cracks or other surface imperfections		0.40%	3.2	Visual
104	Evidence of excessive flash		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.9	Tracer Assembly				9271940
					NEXT HIGHER ASSEMBLY
					9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Closure above aft surface prior to disc installation		0.40%	3.2	Gage
102	Evidence of surface damage		0.40%	3.2	Visual
103	Parts loose		0.40%	3.2	Visual/Manual
104	Tape loose		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.10	Cable Assembly Interconnecting				9271951
					NEXT HIGHER ASSEMBLY 9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Surface damaged		0.40%	3.2	Visual
Minor					
201	Length, assembly		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assistdocs.mil - Downloaded: 2026-02-26 10:03:39Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.11	Container				9271936
					NEXT HIGHER ASSEMBLY 9271935
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Evidence of dents, gouges, cuts, cracks or other imperfections on inside surface		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.12	Charge Assembly Expulsion				9271935
					NEXT HIGHER ASSEMBLY 9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Overall outside diameter, max		0.40%	3.2	Gage
102	Forward outside diameter, max		0.40%	3.2	Gage
103	Depth, max		0.40%	3.2	Gage
104	Charge weight test	2/8 hr		3.2	4.5.5
105	Cover not sealed 360°		0.40%	3.2	Visual
Minor					
201	Evidence of dents, gouges, cuts, cracks or other surface imperfections		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9271931
4.4.2.13	Plate Pusher				NEXT HIGHER ASSEMBLY 9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Outside diameter		0.40%	3.2	Gage
102	Diameter of tracer receptacle hole (3 holes)		0.40%	3.2	Gage
103	Location of holes (basic diameter).		0.40%	3.2	Gage
104	Flatness		0.40%	3.2	Gage
105	Thickness, min.		0.40%	3.2	Gage
106	Location of holes (angle)		0.40%	3.2	Gage
Minor					
201	Diameter of center hole		0.65%	3.2	Gage
202	Burrs on outside diameter surface		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 2	DRAWING NUMBER
4.4.2.14	Support Tracer		9271939
			NEXT HIGHER ASSEMBLY 9271930

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Inside dia. forward cavity, min		0.40%	3.2	Gage
102	Diameter of aft extension		0.40%	3.2	Gage
103	Distance from center to flat on aft extension		0.40%	3.2	Gage
104	Angle to flat		0.40%	3.2	Gage
105	True position of surface curvature adjacent to tracers to diameter aft extension		0.40%	3.2	Gage
106	Diameter of surface curvature adjacent to tracers		0.40%	3.2	Gage
107	Distance center to most external point radially out on center section of shaft (3 places)		0.40%	3.2	Gage
108	Angle of surface from most external point radially out on center section of shaft (3 places)		0.40%	3.2	Gage
109	Radius of interior of aft extension missing or incorrect		0.40%	3.2	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil - Downloaded: 2026-04-26T03:56Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.14	Support Tracer (continued)				9271939
					NEXT HIGHER ASSEMBLY 9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Minor					
201	Length of aft extension		0.65%	3.2	Gage
202	Distance forward face to rear step		0.65%	3.2	Gage
203	Distance forward face to interior step		0.65%	3.2	Gage
204	Diameter aft cavity		0.65%	3.2	Gage
205	Evidence of excessive flash		0.65%	3.2	Visual
206	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48299 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.15	Spacer Tracer Cavity	1 OF 1	9271949
			NEXT HIGHER ASSEMBLY 9271930

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Height, base of extended leg to angle of step		0.40%	3.2	Gage
102	Inside radius tracer seat		0.40%	3.2	Gage
103	Inside radius		0.40%	3.2	Gage
104	Angle, outside radius		0.40%	3.2	Gage
105	Length center of radius to end extended leg		0.40%	3.2	Gage
106	Length tab on extended leg		0.40%	3.2	Gage
107	Width of step for mating tab on radius end		0.40%	3.2	Gage
108	Length of step for mating tab on radius end		0.40%	3.2	Gage
Minor					
201	Height of shelf		0.65%	3.2	Gage
202	Distance from aft base to fin retainer		0.65%	3.2	Gage
203	Evidence of excessive flash		0.65%	3.2	Gage
204	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-04-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.16	Support Pusher Plate				9271932
					NEXT HIGHER ASSEMBLY
					9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Location of flash holes, angle (3 holes)		0.40%	3.2	Gage
102	Diameter of tracer holes (3 holes)		0.40%	3.2	Gage
103	Diameter of wire support hole		0.40%	3.2	Gage
104	Depth of tracer hole (3 holes)		0.40%	3.2	Gage
105	Diameter of tracer flash holes (3 holes)		0.40%	3.2	Gage
106	Distance, center of wire support hole to flat		0.40%	3.2	Gage
107	Depth of charge cavity		0.40%	3.2	Gage
108	Diameter of charge cavity		0.40%	3.2	Gage
109	Distance, base of outside diameter of charge cavity to step		0.40%	3.2	Gage
110	Angle of outside diameter of charge cavity		0.40%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.16	Support Pusher Plate (continued)				9271932
					NEXT HIGHER ASSEMBLY 9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Major					
111	Diameter of O.D. step		0.40%	3.2	Gage
112	True position of outside step diameter to outside diameter		0.40%	3.2	Gage
113	Outside diameter		0.40%	3.2	Gage
114	Diameter of wire hole		0.40%	3.2	Gage
115	Location of flash holes (diameter)		0.40%	3.2	Gage
Minor					
201	Angle of tracer hole side		0.65%	3.2	Gage
202	Flash holes counter sink incorrect		0.65%	3.2	Gage
203	Evidence of excessive flash		0.65%	3.2	Gage
204	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.17	Seal				9271934
					NEXT HIGHER ASSEMBLY 9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Width of solid portion of seal (see section A-A)		0.40%	3.2	Gage
102	Overall height of seal		0.40%	3.2	Gage
103	Diameter of seal		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297241
4.4.2.18	Bushing Cable Sealing				NEXT HIGHER ASSEMBLY 9297242
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major	None Defined				
Minor					
201	Outside diameter		0.65%	3.2	Gage
202	Length		0.65%	3.2	Gage
203	Inside diameter		0.65%	3.2	Gage
204	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4M0

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.19	Support Fuze and Pusher Plate				9271933
					NEXT HIGHER ASSEMBLY 9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Depth to basic I.D. of forward cavity		0.40%	3.2	Gage
102	Side face angle of forward cavity		0.40%	3.2	Gage
103	Depth of forward cavity		0.40%	3.2	Gage
104	Thickness of blow through material (center of aft chamber)		0.40%	3.2	Gage
105	Diameter of blow through hole (center of forward cavity)		0.40%	3.2	Gage
106	Diameter of the aft chamber fully forward		0.40%	3.2	Gage
107	Diameter of the aft chamber just forward of the tapered surface		0.40%	3.2	Gage
108	True position of the aft chamber diameter just forward of the tapered surface to the forward chamber basic diameter		0.40%	3.2	Gage
109	Depth of alignment key from aft face		0.40%	3.2	Gage
110	Width of alignment key (2 places)		0.40%	3.2	Gage
111	Thickness of membrane between chambers		0.40%	3.2	Gage
112	Height of alignment key (2 places)		0.40%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.19	Support Fuze and Pusher Plate (continued)				9271933
					NEXT HIGHER ASSEMBLY 9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Minor					
201	Outside diameter		0.65%	3.2	Gage
202	Outside diameter at step		0.65%	3.2	Gage
203	Width of flange		0.65%	3.2	Gage
204	Evidence of excessive flash		0.65%	3.2	Visual
205	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9271950
4.4.2.20	Tube, Wire Support				NEXT HIGHER ASSEMBLY 9271930
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Outside diameter		0.40%	3.2	Gage
Minor					
201	Total length		0.65%	3.2	Gage
202	Straightness		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.21	Pusher Plate Assembly				9271930
					NEXT HIGHER ASSEMBLY 9271929
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Parts missing or assembled incorrectly		0.40%	3.2	Visual
102	Seal damaged		0.40%	3.2	Visual
Minor					
201	Seal not lubricated properly		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.22	Flechette				9271956
					NEXT HIGHER ASSEMBLY 9297239
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Length, point to aft end of fins	(a)		3.2	(4.5.8) Gage
102	Fin blade width, minimum	(a)		3.2	(4.5.8) Gage
103	Point formation	(a)		3.2	(4.5.8) Gage
104	Fin surface(s) parallel to axis of part	(a)		3.2	(4.5.8) Gage
105	Width of fins, edge to edge	(a)		3.2	(4.5.8) Gage
106	Hardness Test of Flechette	(b)		3.2	(4.5.7) Test
Minor					
201	Evidence of poor workmanship	(a)		3.10	(4.5.8) Visual

NOTES: (a) See Para. 4.5.8 for special sampling plan
(b) See Para. 4.5.7 for special sampling plan

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.23	Flechette Belt Assembly				9271955, -1,-2,-3
					NEXT HIGHER ASSEMBLY 9271929
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Flechettes not secure		0.40%	3.2	Visual
102	Flechette quantity incorrect		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.24	Sleeve				9271954
					NEXT HIGHER ASSEMBLY 9271929
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Length		0.40%	3.2	Gage
102	Length of outside surface		0.40%	3.2	Gage
103	Wall thickness		0.40%	3.2	Gage
Minor					
201	Radius		0.65%	3.2	Gage
202	Protective finish improper		0.65%	3.2	Visual
203	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.25	Payload Assembly				9271929
					NEXT HIGHER ASSEMBLY 9271927
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Parts missing		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER
4.4.2.26	Case, Warhead				9271928
					NEXT HIGHER ASSEMBLY
					9297235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Inside diameter main cavity		0.40%	3.2	Gage
102	Straightness of outside surface		0.40%	3.2	Gage
103	Outside diameter forward of bourrelet		0.40%	3.2	Gage
104	Bourrelet outside diameter		0.40%	3.2	Gage
105	Concentricity of bourrelet outside diameter to outside diameter forward of bourrelet		0.40%	3.2	Gage
106	Outside diameter just forward of acme threads		0.40%	3.2	Gage
107	Pitch diameter of acme threads		0.40%	3.2	Gage
108	Major diameter of acme threads, max		0.40%	3.2	Gage
109	Concentricity of acme threads to outside diameter		0.40%	3.2	Gage
110	Pitch diameter of internal threads		0.40%	3.2	Gage
111	Outside diameter of aft portion of warhead		0.40%	3.2	Gage
112	Concentricity of outside diameter of aft portion of warhead to outside diameter		0.40%	3.2	Gage

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER 9271928
4.4.2.26	Case, Warhead (continued)				NEXT HIGHER ASSEMBLY 9297235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
113	True position of outside diameter of aft portion of warhead to acme threads		0.40%	3.2	Gage
114	Distance from aft face to motor mating surface		0.40%	3.2	Gage
115	Perpendicularity of motor mating surface to case outside diameter		0.40%	3.2	Gage
Minor					
201	Depth of forward cavity		0.65%	3.2	Gage
202	Diameter of fuze cavity		0.65%	3.2	Gage
203	True position of fuze cavity to inside diameter		0.65%	3.2	Gage
204	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.27	Packing				9271961
					NEXT HIGHER ASSEMBLY 9297235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major	None Defined				
Minor					
201	Inside diameter		0.65%	3.2	Gage
202	Diameter of cross section		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.28	Pin, Nose Cone Base				9297238
					NEXT HIGHER ASSEMBLY 9297235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Length, max		0.40%	3.2	Gage
102	Diameter, at neck, max		0.40%	3.2	Gage
103	Width of shoulder		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297237
4.4.2.29	Cone, Nose				NEXT HIGHER ASSEMBLY 9297235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Outside diameter of step		0.40%	3.2	Gage
102	Overall outside diameter forward of step		0.40%	3.2	Gage
103	Concentricity, overall outside diameter forward of step to outside diameter of step		0.40%	3.2	Gage
104	Inside diameter of aft cavity		0.40%	3.2	Gage
105	Concentricity, inside diameter of aft cavity to outside diameter of step		0.40%	3.2	Gage
106	Ogive radius		0.40%	3.2	Gage
107	Diameter of cable hole		0.40%	3.2	Gage
108	Width of step		0.40%	3.2	Gage
109	Perpendicularity of front face of step to outside diameter of step		0.40%	3.2	Gage
110	Distance, aft face to center line of ogive radius		0.40%	3.2	Gage
Minor					
201	Flash excessive		0.65%	3.2	Gage
202	Wall thickness		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4910

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.30	Base Nose Cone				9297236
					NEXT HIGHER ASSEMBLY 9297235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Outside diameter		0.40%	3.2	Gage
102	Diameter of internal cavity		0.40%	3.2	Gage
103	Concentricity of diameter of internal cavity to outside diameter		0.40%	3.2	Gage
104	Diameter of aft groove		0.40%	3.2	Gage
105	Concentricity of diameter of aft groove to outside diameter		0.40%	3.2	Gage
106	Width of part		0.40%	3.2	Gage
107	Width of aft groove		0.40%	3.2	Gage
108	Distance, aft face to forward face of groove		0.40%	3.2	Gage

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.30	Base, Nose Cone (continued)				9297236
					NEXT HIGHER ASSEMBLY
					9297235
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Minor					
201	Distance from aft face to center protrusion		0.65%	3.2	Gage
202	Diameter of wire hole		0.65%	3.2	Gage
203	Diameter of aft receptacle		0.65%	3.2	Gage
204	Depth of receptacle		0.65%	3.2	Gage
205	Depth of forward cavity		0.65%	3.2	Gage
206	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48299 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.31	Case Assembly, Flechette Warhead		9297235
			NEXT HIGHER ASSEMBLY 9297239

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Seal lubrication missing (2 places) in assembly prior to installation into case.		0.40%	3.2	Visual
102	Pins missing, loose or protruding above surface		0.40%	3.2	Gage
103	Red dye missing prior to assembly of nose cone base		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297242
4.4.2.32	Nose Cone Assembly				NEXT HIGHER ASSEMBLY 9297239
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Umbilical assembly pull test	2/hr		3.2	Gage
Minor					
201	Length, cable extends from nose cone		0.65%	3.2	Gage
202	Parts missing or incorrectly assembled		0.65%	3.2	Visual
203	Adhesive sealant incomplete or missing		0.65%	3.2	Visual
204	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4B10

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9297239
4.4.2.33	Warhead, 2.75 Inch Rocket Flechette				NEXT HIGHER ASSEMBLY 9298304
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major					
101	Insulation resistance test		100%	3.6	4.5.2
102	Electrical resistance test		100%	3.5	4.5.1
103	Leak test	10		3.4	4.5.4
104	Static fire test	24		3.7	4.5.6
Minor					
201	Parts missing (prior to installation of nose cone and base plug)		0.65%	3.2	Visual
202	Nomenclature missing, incorrect or illegible		0.65%	3.2	Visual
203	Diamond pattern missing, incorrect or illegible		0.65%	3.2	Visual
204	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-02-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.34	Plug, Case Closure		9271973
			NEXT HIGHER ASSEMBLY 9287912

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Pitch diameter of thread		0.40%	3.2	Gage
102	True position of threads to center O.D.		0.40%	3.2	Gage
Minor					
201	Main cavity I.D.		0.65%	3.2	Gage
202	Step O.D.		0.65%	3.2	Gage
203	True position of main cavity I.D. to step O.D.		0.65%	3.2	Gage
204	Evidence of excessive flash		0.65%	3.2	Visual
205	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.35	Plug Assembly				9287912
					NEXT HIGHER ASSEMBLY
					9298304
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major	None Defined				
Minor					
201	Felt pad not secure		0.65%	3.2	Visual
202	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.36	Pad, Felt				9287911
					NEXT HIGHER ASSEMBLY 9287912
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major	None Defined				
Minor					
201	Outside diameter		0.65%	3.2	Gage
202	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.37	Packing				9271972
					NEXT HIGHER ASSEMBLY 9298304
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major	None Defined				
Minor					
201	Inside diameter		0.65%	3.2	Gage
202	Diameter of cross section		0.65%	3.2	Gage
203	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.38	Warhead, 2.75 Inch Rocket Flechette XM255 W/Fuze XM439	1 OF 1	9298304
			NEXT HIGHER ASSEMBLY 9297240

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Charge circuit resistance		100%	3.8	4.5.9 Test
102	Umbilical not properly fastened		0.40%	3.2	Visual/Manual
103	Plug torque incorrect		0.40%	3.2	Manual/Gage
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.39	Packing and Marking for Box Fiberboard for Warhead 2.75 Inch Rocket Flechette XM255 (prior to closing)				9298030
					NEXT HIGHER ASSEMBLY 9298028 9298032
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Marking missing of illegible		0.40%	3.2	Visual
102	Evidence of moisture		0.40%	3.2	Visual
103	Evidence of loose warheads		0.40%	3.2	Visual/Manual
104	Plug assemblies missing		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.40	Packing and Marking for Box, Wood, Wirebound for Warhead 2.75 Inch Rocket Flechette, XM255				9298028
					NEXT HIGHER ASSEMBLY 9298032
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Filler missing or inadequate		0.40%	3.2	Visual
102	Marking missing or illegible		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS MIL-W-48299 (AR)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.41	Packing and Marking for Pallet (Boxed Type) for Warhead 2.75 Inch Rocket Flechette XM255	1 OF 1	9298032
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None Defined				
Major					
101	Boards broken or loose		0.40%	3.2	Visual
102	Marking missing or illegible		0.40%	3.2	Visual
103	Strapping missing or loose		0.40%	3.2	Visual
104	Seal missing		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		0.65%	3.10	Visual

NOTES:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.4.3 Testing.- Testing and examination of the samples for First Article and Quality Conformance are completely described in Table I - First Article Testing and the tables starting with paragraph 4.4.2.1 and paragraph 4.5.

4.4.4 Inspection Equipment.- The inspection equipment required to perform the examinations and tests prescribed herein is described in the 'Paragraph Reference/Inspection Method' column in the tables starting with paragraph 4.4.2.1. The contractor shall submit for approval inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078 and 6.3 herein.

4.5 Test Methods and Procedures

4.5.1 Electrical Resistance of Warhead Assembly.- This test shall be performed using equipment in accordance with 4.4.4. Known rejects shall be removed from the lot.

The continuity of the circuit shall be checked between the connector on the forward umbilical of the warhead assembly and the connector on the aft umbilical on the warhead assembly for the individual conductor and shield of the warhead assembly. The electrical resistance, for individual conductors of this cable assembly, shall not exceed three (3.00) ohms.

4.5.2 Insulation Resistance of The Warhead Assembly.- The test shall be conducted using equipment in accordance with 4.4.4. Any assembly exhibiting less than one (1) megohm between the conductor and shield and between the conductor and case and between shield and case shall be considered a defective. The insulation circuit shall be checked between the conductor and shield and the conductor and case and between the shield and case. The insulation resistance shall be 1.0 megohm, minimum. Known rejects shall be removed from the lot.

4.5.3 Tracer Ballast Weight (Dwg. 9271942).- The test shall be conducted on a simple balance using equipment in accordance with 4.4.4. Any tracer ballast outside of tolerance shall be considered a defective.

4.5.4 Leak Test.- The test shall be conducted using equipment in accordance with 4.4.4, Any warhead exhibiting leakage in excess of the requirement shall be considered a defect. Two or more defects shall be cause for lot rejection. The sample warheads shall be subjected to a leak test using a fluid that is not considered potentially damaging (Helium or air). Other fluids may be utilized if approved by the procuring activity. Each warhead, less fuze with a base plug properly installed, shall have a leakage rate determined. The leakage rate for any individual warhead shall not exceed 0.0001 cc/sec.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.5.5 Expulsion Assembly Charge Weight (see Dwg. 9271935).- This test shall be performed using equipment in accordance with 4.4.4. Two expulsion assemblies shall be selected for each eight hours' production of these assemblies. Each assembly shall be subjected to a charge weight test. If either sample contains a charge out of tolerance, the preceding eight hours of production shall be rejected. Charge weight (less container and cover, Dwg. 9271935) shall be determined by a simple weighing operation of each individual charge in the sample. values shall be recorded.

4.5.6 Static Fire Test

4.5.6.1 Conditioning.- .-Twenty-four (24) warheads, less fuze XM439, shall be selected and static fired from each lot. The twenty-four warhead samples shall be tested at three temperatures; eight warheads at -32 degrees C., eight warheads at +46 degrees C., and eight warheads at +63 degrees C. This test shall be performed using equipment in accordance with 4.4.4. Each warhead assembly (less simulated fuze/detonator assembly) selected for test shall be conditioned to assure a uniform temperature throughout its entire mass at the time of firing. Minimum conditioning time shall be eight hours. Maximum conditioning time shall be twenty-four hours. Prior to Static Firing, each warhead assembly (less simulated fuze/detonator assembly) shall receive an electrical resistance test. A warhead assembly not static fired at six minutes or more after removal from the conditioning cabinet shall be placed at ambient (+21 degrees C.) temperature for not less than twelve hours before reconditioning to the applicable temperature, and static fired.

4.5.6.2 Simulated Fuze/Detonator.- A simulated Fuze/Detonator Assembly (Figure I) shall be assembled. This assembly shall be utilized to simulate the XM439 fuze. An alternate Fuze/Detonator when approved by DRDAR-QAR-Q, may be used in place of the above.

This assembly shall be placed in the fuze cavity well of the XM255 warhead (see Figure 2). pin receptacles (Dwg. 9271963 and Dwg. 9271962) shall be mated to the simulated Fuze/Detonator Assembly. Each warhead and simulated Fuze/Detonator Assembly shall be static fired within six minutes of removal from the conditioning cabinet. Fire pulse shall be through the forward umbilical connection (Dwg. 9260889).

NOTE: All local safety regulations shall be observed, and precautions taken consistent with the handling of loaded items during assembly and firing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.5.6.3 Acceptance.- The warhead/simulated fuze detonator assembly shall be fired by applying the electrical energy from a sixteen (16) microfarad capacitor max., charged to a minimum of 2.5 volts D.C. The fire pulse shall be through the forward connector of the warhead/simulated fuze detonator assembly. The warhead assembly shall be mated to an adapter, utilizing the stub ACME thread on the warhead assembly. The static fire test stand, the warhead assembly mating adapter, and recording equipment used to measure all performance data and requirements shall be approved by the procuring activity. Time shall be recorded from zero time (time of fire pulse) to time to break away (nose cone).

Observation shall be made to the number of tracer assemblies that have ignited and burned. Time from fire pulse to the end of the tracer burn shall be recorded. In addition, observation shall be made for units that fail to fire, or exhibit an outer case rupture, or exhibit an aft closure plug rupture, exhibit incomplete payload expulsion, or exhibiting two or more tracer assemblies, failing to fire. All assemblies in the sample shall be fired. Any warhead that ruptures the outer case or aft closure plug or expels the aft closure plug or fails to fire or does not expel the payload completely or in which eight or more tracers total per lot (24 warheads) and/or two or more tracers per an individual warhead do not ignite and burn for 4.0 seconds minimum shall be considered a defective. One or more defective shall be cause for lot rejection. Any failure shall require a comprehensive analysis by the contractor to determine the cause of the failure. The DCAS representative shall indicate concurrence/nonconcurrence in the analysis. The analysis shall be forwarded to the procuring activity.

4.5.6.4 Retest.- A retest may be performed after submission of the analysis at the discretion of the procuring activity.

The retest shall consist of 16 warheads static fired at each temperature. If one or more warheads fail any of the above requirements, the lot shall be rejected (except tracer). During retest, if 16 or more tracers total per lot (48 warheads) and/or two or more tracers per an individual warhead do not ignite and burn for 4.0 seconds minimum, the lot shall be rejected.

4.5.7 Hardness Test of Flechette - 28 Grain - (see Dwg. 9271956).- The test shall be performed using equipment in accordance with 4.4.4. Any flechette sample that does not meet the hardness requirement shall be considered defective. Two or more defective shall be cause for lot rejection. A specimen shall be prepared for each flechette in the sample. Each specimen shall be prepared and tested In accordance with Federal Test Method Std. No. 151, Method 243.1.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.5.8 Flechette Inspection/Test (see Dwg. 9271956) -

SAMPLE PLAN

Inspect three (3) pieces taken from each Flechette die stamping machine five minutes after start, and every 30 minutes thereafter. Whenever any of the three pieces does not pass all inspections (paragraph 4.4.2.22), take three (3) additional pieces and inspect. If any one of the latter three pieces fail acceptance, stop the machine and notify the operator.

CONTINUATION OF PRODUCTION

Operations for the applicable die stamping machine/die may continue when the discrepancy is found and corrected and an additional three (3) pieces pass the inspections of paragraph 4.4.2.22.

This inspection/test shall be performed using equipment in accordance with 4.4.4.

4.5.9 Warhead Charge Circuit Resistance (with XM439 Fuze).- Each lot of warhead/fuze assemblies (Dwg. 9298304) shall be one-hundred percent subjected to a charge circuit resistance test.

Each warhead umbilical connector shall be connected to a pulsed continuity checking device. The resistance of the charge circuit shall be ascertained with a negative DC pulse. The pulse amplitude across a 10 megohm resistor minimum shall be -5.0 VDC maximum in amplitude and 120 microseconds maximum in duration. Pulse amplitude across a 2 ohm resistor shall be -0.020 VDC maximum in amplitude and 120 microseconds maximum in duration. Any fuzed warhead failing the requirements (paragraph 3.8) shall be classified as defective and removed from the lot. This test shall be performed using equipment in accordance with 4.4.4.

4.5.10 Umbilical Assembly Pull Test (see Dwg. 9297242).- Two (2) nose cone assemblies (Dwg. 9297242) per four hour's production of nose cone assemblies shall be selected at random and subjected to an umbilical pull test.

Each assembly shall be held in a fixture in such a manner enabling the umbilical assembly (Dwg, 9260889) to be subjected to a five (5) pound pull test.

The umbilical assembly wire shall be firmly held at or near the bushing (Dwg. 9297241) and a pull force of five (5) ± .5 pounds shall be applied at a rate of one pound per second ± .25 pounds to the connector (Dwg. 9260889).

At the completion of the pull test each assembly shall be subjected to an electrical continuity test of individual conductors. Any individual conductor not exhibiting electrical continuity between the forward receptacle of the umbilical assembly and the aft connector of the umbilical assembly shall reject the previous four hours' production of nose cone assemblies.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

4.5.11 Tracer Composition Test (Dwg. 9271970).-From the first three batches of tracer composition produced, the contractor shall submit to the cognizant DCAS representative a verification record indicating that the tracer composition complies to Dwg. 9271970. A tracer composition test of the ingredients shall be performed to determine the percentage by weight of the individual ingredients. This test shall be for information only.

4.5.12 Igniter Composition (Dwg. 9258060).- From the first three batches of tracer composition produced, the contractor shall submit to the cognizant DCAS representative a verification record indicating that the igniter composition complies to Dwg. 9258060. An igniter composition test of the ingredients shall be performed to determine the percentage by weight of the individual ingredients. This test shall be for information only.

5. PREPARATION FOR DELIVERY

5.1 Packaging.- Level C. The warheads shall be packaged and marked in accordance with Dwg. 9298030.

5.2 Packing.- Level C. The warheads shall be packed and marked in accordance with Dwg. 9298028.

5.3 Packing (Alt.).- Level C. The warheads shall be packed and marked in accordance with Dwg. 9298032.

6. NOTES

6.1 Intended Use.- See paragraph 1.1 of this specification.

6.2 Ordering Data.- See MIL-A-48078

6.3 Submission of Inspection Equipment Designs for Approval.- See MIL-A-48078. Submit equipment designs as required, to Commander, ARRADCOM, ATTN: DRDAR-QAR-Q
Dover, New Jersey 07801.


Custodian:
Army-AR

Preparing Activity:
Army-AR

Project Number: 1340-A-420

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

ALUMINUM SPOOL

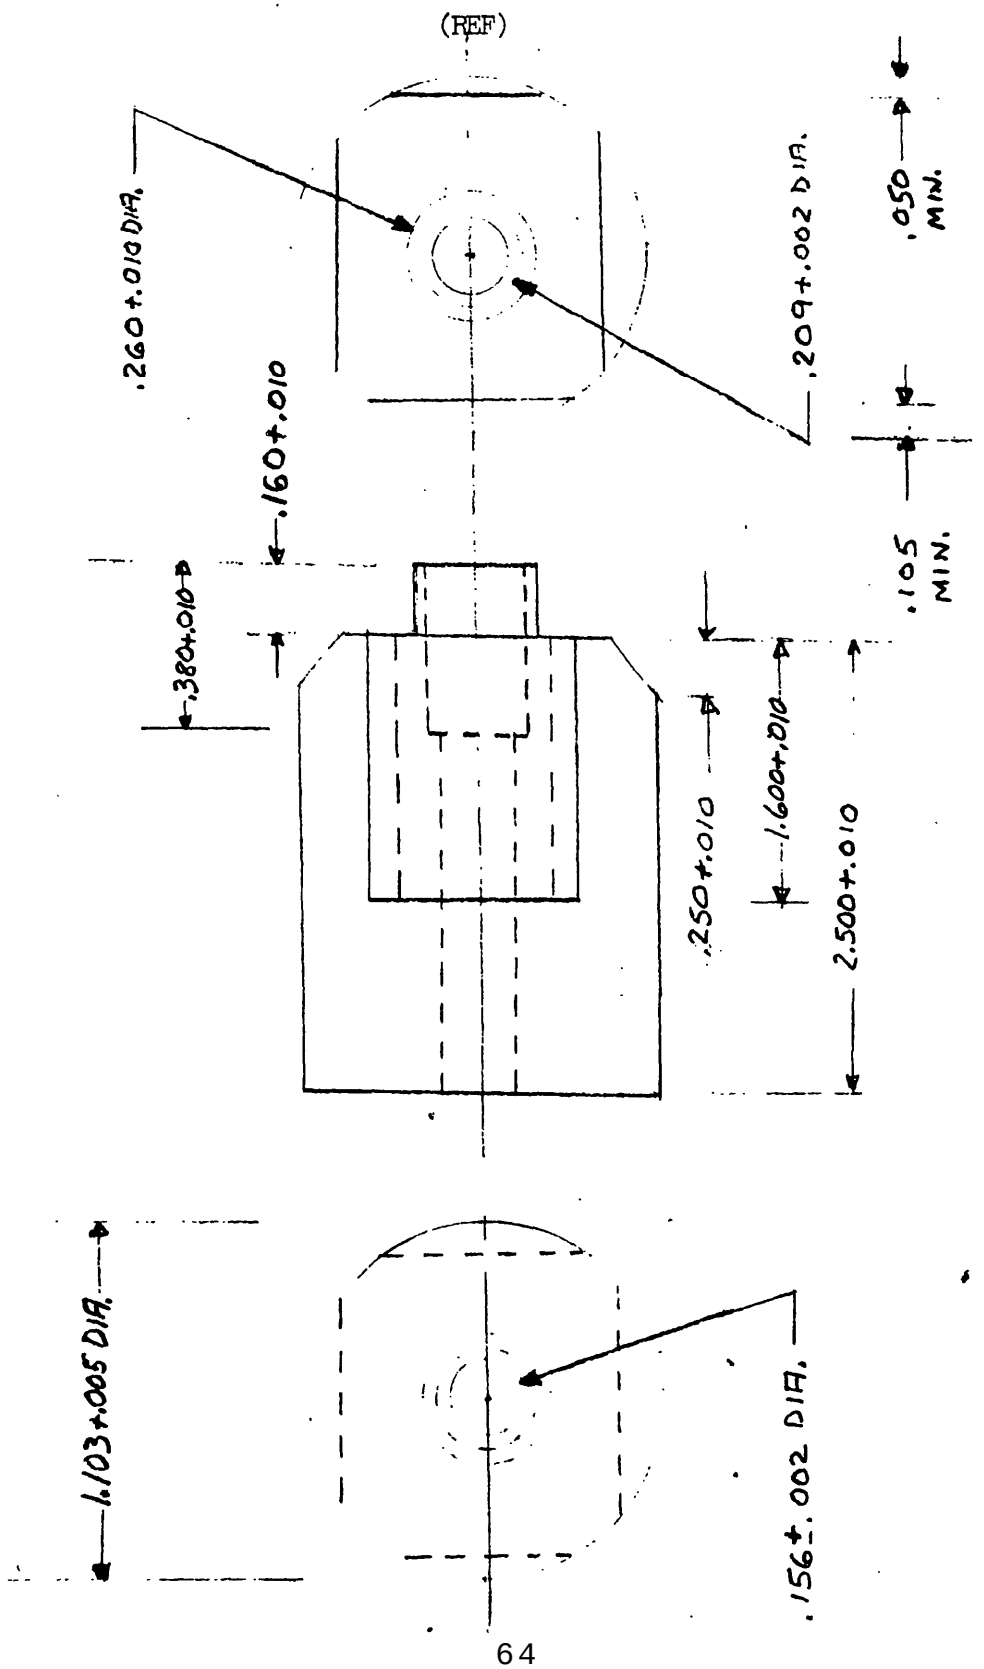

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:55Z
Check the source to verify that this is the current version before use.

SIMULATED FUZE/DETONATOR

ASSEMBLY

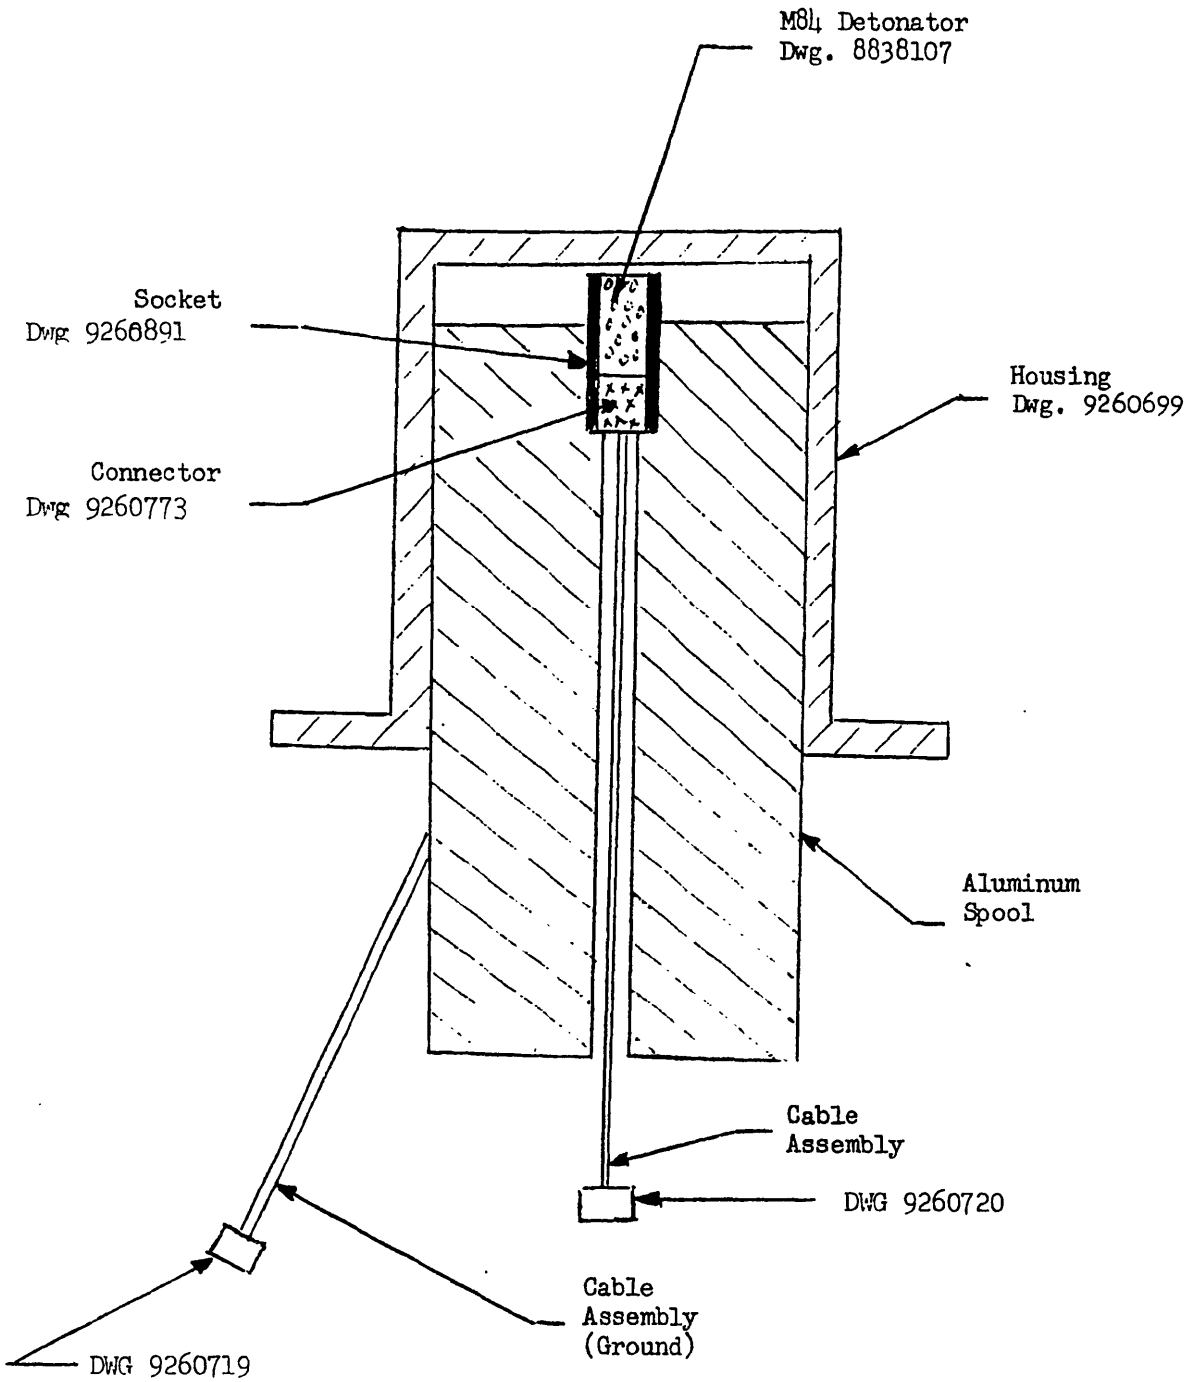


FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

1255 WARHEAD/DETONATOR
ASSEMBLY
(REF.)

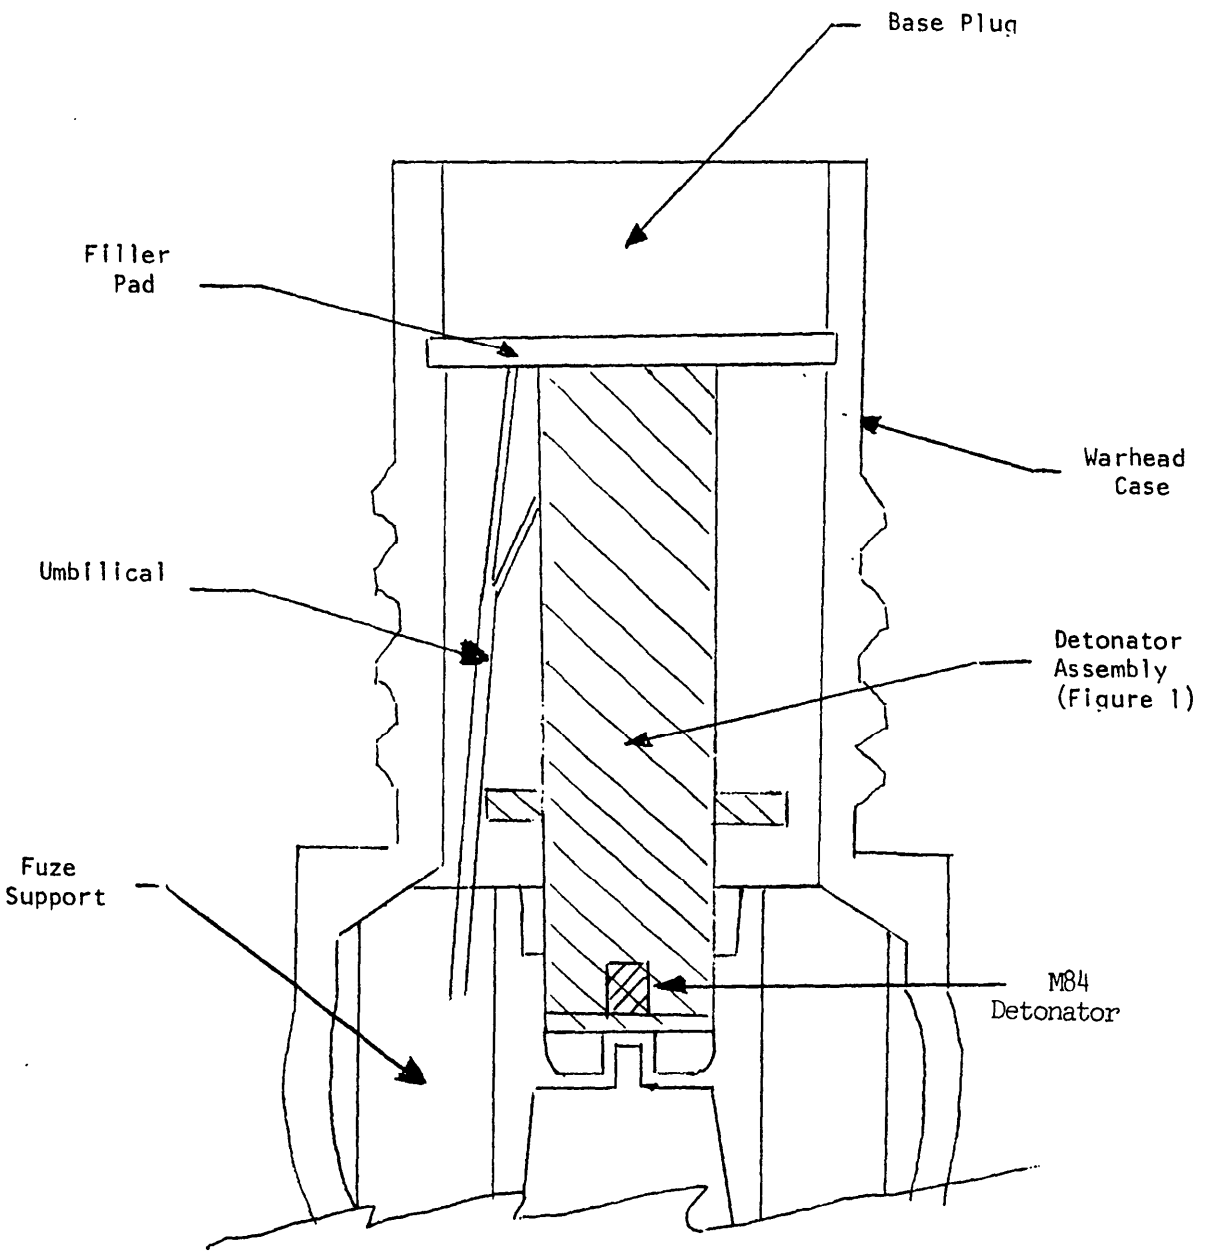


FIGURE 2

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

   A. GIVE PARAGRAPH NUMBER AND WORDING.

   B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

   ☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426

REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 202610-26T03:55Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY
DOD – 314

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

Commander
US Army Armament R&D Command
ATTN: DRDAR-QAR
Dover, NJ 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

NOTICE OF VALIDATION

INCH-POUND

MIL-W-48299(AR)
NOTICE 1
3 October 1991

MILITARY SPECIFICATION

WARHEAD, 2.75 INCH ROCKET, FLECHETTE, XM255 WITH AND WITHOUT FUZE, LOADING ASSEMBLING AND PACKING

MIL-W-48299(AR), dated 4 July 1977 has been reviewed and determined to be valid for use in acquisition.

Preparing Activity
Army-AR

AMSC N/A FSC 1340

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T03:55Z
Check the source to verify that this is the current version before use.