INCH-POUND

MIL-C-60315B (AR)
AMENDMENT 4
31 October, 1996

SUPERSEDING
AMENDMENT 3
5 April 1996

MILITARY SPECIFICATION

CHARGE, PROPELLING, M67 FOR 105MM HOWITZER
LOADING, ASSEMBLING AND PACKING

This Amendment forms a part of Military Specification MIL-C-60315B (AR), dated 9 September, 1991, and is approved for use by the US Army Armament Research, Development and Engineering Center, and is available for use by all Departments and Agencies of the Department of Defense.

PAGE 3

Add the following paragraph:

"3.6 First article test. This specification contains provisions for the submission of a first article sample. This is a one time qualification test for a new contractor to load, assemble, and pack M67 propelling charges. Test samples shall be withdrawn from the first lot of propelling charges produced by the contractor. Charges will be tested in accordance with all of the requirements of this specification and with Table III (see 6.9). Until the first article sample has been found to be acceptable, the contractor is in now way authorized by the Government to initiate production of a second lot unless otherwise directed by the contracting officer."

PAGE 4

4.2 Classification of inspection. Delete in its entirety and substitute the following:

"4.2 Classification of inspection. The following types of inspection shall be conducted on this item:

a. First Article Inspection.
b. Quality Conformance Inspection."

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:28Z
Check the source to verify that this is the current version before use.

4.3.1b: Add the following:

"An entire lot of multi-perforated propellant shall be utilized in the formation of one lot of propelling charges unless directed by the contracting officer."

PAGE 6

* 4.3.2.1 Bag increment. Delete in its entirety and substitute new paragraphs 4.3.2.1.a and 4.3.2.1.b as included

PAGE 8

* 4.3.2.3 Charge, assembly. Delete in its entirety and substitute new paragraph as included.

PAGE 11

4.3.3.3 Charge, propelling, assembly weight. Delete in its entirety.

PAGE 14

6.9 First Article Inspection. Delete in its entirety and substitute the following.

"6.9 First Article Inspection. The first article test is a one time qualification test for a new contractor to load, assemble and pack acceptable M67 propelling charges. Once a contractor has demonstrated the ability to load, assemble and pack the propelling charges, the first article test may be waived by the contracting officer. The following test program shall be used for the first article test. The test matrix attached as Figure I shall be used for the sequential environmental phase of the test. Testing will be conducted in accordance with TECOM ITOP-4-2-504.

TABLE III
First Article Test

Test Phase	Temp (Deg F)	No. Control Rounds	No. Test Rounds	TECOM TOP
Propellant Checkout	70		10	ITOP-4-2-504
	145		10	ITOP-4-2-504
	-60		10	ITOP-4-2-504
Sequential Environmental	145	10	20	ITOP-4-2-504
	-60	10	20	ITOP-4-2-504

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:28Z
Check the source to verify that this is the current version before use.

Figure I

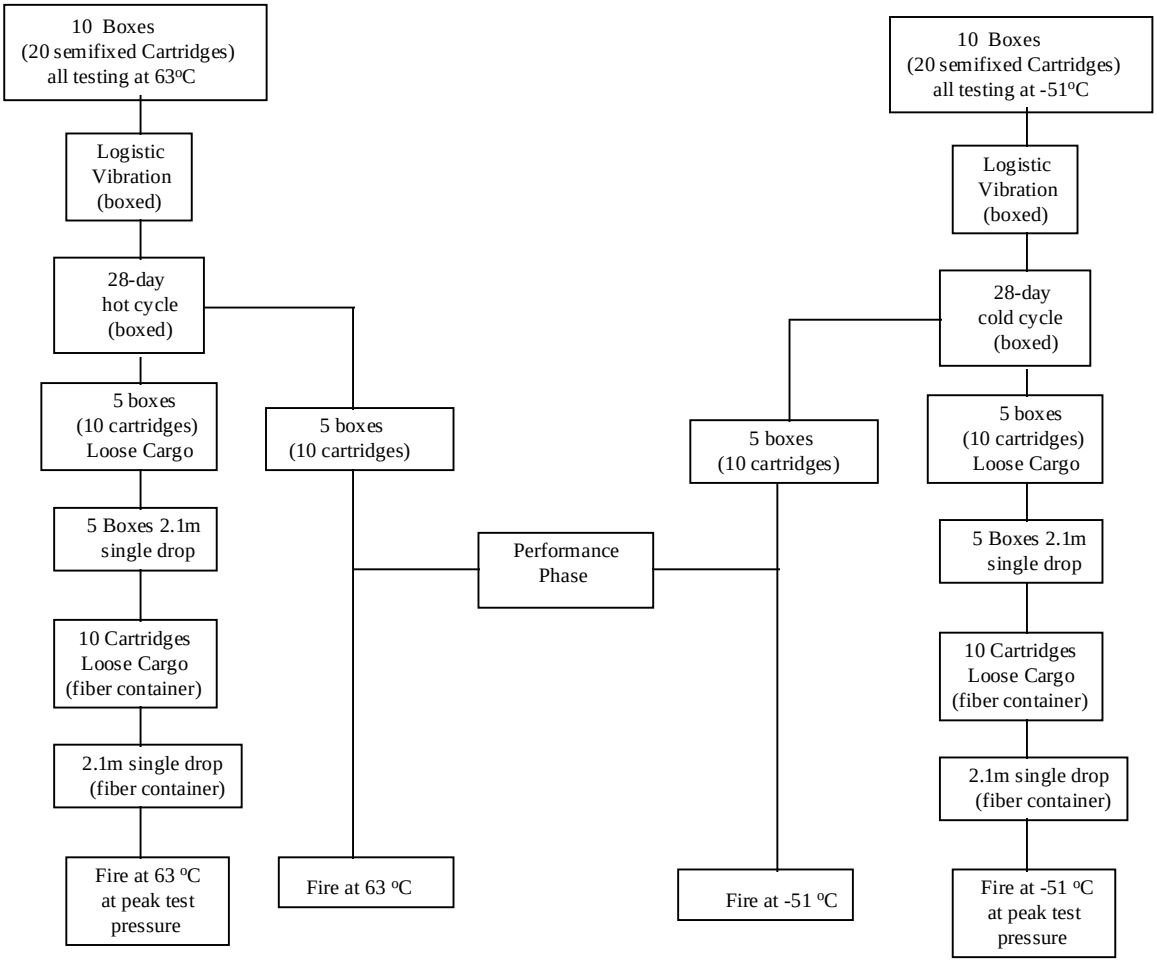

Sequential test for First Article of M67 Propelling Charge „

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:28Z
Check the source to verify that this is the current version before use.

PARAGRAPH 4.3.2.1.a	**TITLE** Bag increment	**SHEET** 1 **OF** 1	**DRAWING NUMBER** 9205470
			NEXT HIGHER ASSEMBLY 9205471

CLASSIFICATION	**EXAMINATION OR TEST**	**CONFORMANCE CRITERIA**	**REQUIREMENT PARAGRAPH**	**INSPECTION METHOD REFERENCE**
Critical	None defined.			
Major				
101	Foil missing or improperly assembled (applicable to increment 5 only).	Table II	3.2	Visual
Minor				
201	Any seam or opening incompletely stitched.	Table II	3.2	Visual
202	Marking misleading or unidentifiable.	Table II	3.2	Visual
203	Evidence of poor workmanship.	Table II	3.2	Visual

Notes:

AMSMC Form 1570a-E, 1 Jul 89 Replaces AMSMC Form 1570a, 1 Apr 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:28Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF CHARACTERISTICS

PARAGRAPH	TITLE		DRAWING NUMBER
4.3.2.1.b	Bag increment	SHEET 1 OF 1	9288697
			NEXT HIGHER ASSEMBLY 9288696

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical	None defined.			
Major	None defined.			
Minor				
201	Any seam or opening incompletely stitched.	Table II	3.2	Visual
202	Marking misleading or unidentifiable.	Table II	3.2	Visual
203	Evidence of poor workmanship.	Table II	3.2	Visual

Notes:

AMSMC Form 1570a-E, 1 Jul 89 Replaces AMSMC Form 1570a, 1 Apr 85, which may not be used.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:28Z
Check the source to verify that this is the current version before use.

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.3.2.3	Charge, Assembly		9205472 or 9288695
			NEXT HIGHER ASSEMBLY

CLASSIFICATION	EXAMINATION OR TEST	CONFORMANCE CRITERIA	REQUIREMENT PARAGRAPH	INSPECTION METHOD REFERENCE
Critical				
1	Missing or incorrect increments or incorrect propelling charge assembly weight	100 % 1/	3.2	Scale
Major				
101	Incorrect sequence of increments.	100 %	3.2	Visual
102	Assembly damaged to the extent that propellant can escape.	100 %	3.2	Visual
Minor				
201	Increments insecurely tied at junctions.	Table II	3.2	Visual
202	Ties loose, broken or insecurely tied.	Table II	3.2	Visual
203	Marking missing or unidentifiable.	Table II	3.2	Visual
204	Evidence of poor workmanship.	Table II	3.5	Visual

1/ The defect shall be classed critical when the weight is in excess of 3 times that specified in 3.4. Major when the weight is in excess of the in 3.4 but not greater than 3 times. Compliance with 3.4 shall be determined by using the average weight of the empty bag assembly. If the charges are assembled in accordacne with 9205472 and the defect is determined to be due to an incorrect propelling charge assembly weight, remove increment 5 by raising it off the scale without breaking the cord and replace it with a weight representing the average weight of increment 5. If the weight is incorrect, reject the charge. If the weight is correct and it can be determined that the off weight of increment 5 is caused by the lead foil (tare weight of bag) the charge shall be considered acceptable.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:28Z
Check the source to verify that this is the current version before use.

NOTE: The margins of this amendment are marked with an asterisk or vertical line to indicate where changes (additions, modifications, corrections, deletions) from the previous amendment were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous amendment.

Custodian
Army-AR

Preparing activity
Army-AR

(Project 1315-0157)

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T00:28Z
Check the source to verify that this is the current version before use.