MIL-C-24920A
15 January 1988

SUPERSEDING
MIL-C-24920
10 July 1985

MILITARY SPECIFICATION

COAT, ALL-WEATHER, MAN'S, WITH REMOVABLE LINER

This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers the requirements for an all weather coat made of polyester and cotton water repellent treated fabric.

1.2 Classification. The coats shall be of one type in the following sizes and lengths (see 6.2).

Sizes: 28, 30, 32, 34, 36, 38, 40, 42, 44, 46, 48, 50 and 52
Lengths: Short, Regular, Long and X-Long

2. APPLICABLE DOCUMENTS

2.1 Government documents.

2.1.1 Specifications, standards, and handbooks. Unless otherwise specified, the following specifications, standards, and handbooks of the issue listed in that issue of the Department of Defense Index of Specifications and Standards (DoDISS) specified in the solicitation form a part of this specification to the extent specified.

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Officer in Charge, Navy Clothing and Textile Research Facility, 21 Strathmore Road, Natick, MA 01760-2490 by using the self-addressed Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8405

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

SPECIFICATIONS

FEDERAL

V-B-871 - Button, Sewing Hole, and Button, Staple (Plastic)
V-F-106 - Fasteners, Slide, Interlocking
V-T-280 - Thread, Gimp, Cotton, Buttonhole
NN-P-71 - Pallet, Material Handling, Wood, Stringer Construction 2 Way and 4 Way
DDD-L-20 - Label: For Clothing, Equipage, and Tentage (General Use)

MILITARY

MIL-P-15011 - Pallet, Material Handling, Wood, Post Construction 4 Way Entry
MIL-B-17757 - Boxes, Shipping, Fiberboard, (Modular Sizes)
MIL-C-21852 - Cloth, Taffeta, Nylon
MIL-C-29363 - Cloth, Poplin: Polyester and Cotton (Water Repellent)
MIL-C-43251 - Cloth, Pile, Acrylic Fiber Pile
MIL-C-43525 - Cloth, Satin, Acetate or Rayon Face and Rayon or Cotton Back
MIL-T-43548 - Thread, Polyester, Cotton-Covered and Rayon-Covered
MIL-C-43836 - Cloth, Interlining, Non-woven

STANDARDS

FEDERAL

FED-STD-191 - Textile Test Methods
FED-STD-751 - Stitches, Seam, and Stitchings

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-129 - Marking for Shipment and Storage
MIL-STD-147 - Palletized Unit Loads
MIL-STD-1494- Provisions for Evaluating Quality of Raincoats

(Copies of specifications, standards, drawings, and publications required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

2.1.2 Other Government documents, drawings, and publications. The following other Government documents, drawings, and publications form a part of this specification to the extent specified herein. Unless otherwise specified, the issues shall be those in effect on the date of the solicitation.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

LAWS AND REGULATIONS

U.S. POSTAL SERVICE MANUAL

(Copies of the Manual may be obtained from the Superintendent of Documents, U.S. Government Printing Office, Washington, D.C. 20402)

* 2.2 Other publications. The following document(s) form a part of this specification to the extent specified herein. Unless otherwise specified, the issue of documents which are DOD adopted shall be the those listed in the issue of the DODISS specified in the solicitation. Unless otherwise specified, the issues of documents not listed in the DODISS shall be the issue of the nongovernment documents which is current on the date of the solicitation.

NATIONAL MOTOR FREIGHT TRAFFIC ASSOCIATION, INC., AGENT

National Motor Freight Classification

(Applications for copies should be addressed to the American Trucking Association, ATTN: Traffic Department, 1616 P Street, N.W., Washington, DC 20036-1404).

UNIFORM CLASSIFICATION COMMITTEE, AGENT

Uniform Freight Classification

(Application for copies should be addressed to the Uniform Classification Committee, Room 1106, 222 South Riverside Plaza, Chicago, Illinois 60606-5808).

THE COLOR ASSOCIATION OF THE UNITED STATES

Standard Shades for Buttons - 1966

Standard Shades for Threads - 1968

(Application for copies of color cards should be addressed to the Color Association of the U.S., 343 Lexington Avenue, New York, NY 10016).

* 2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this specification shall take precedence. Nothing in this specification, however, shall supersede applicable laws and regulations unless a specific exemption has been obtained.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

3. REQUIREMENTS

3.1 Guide sample. Samples, when furnished, are solely for guidance and information to the contractor (see 6.3). Variations from this specification may appear in the sample in which case this specification shall govern.

3.2 First article. When specified, the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.3 and 6.2).

3.3 Material.

* 3.3.1 Basic material. The basic material for the all weather coat shall be polyester and cotton water repellent poplin cloth, shade Blue 3346, conforming to MIL-C-29363. The piece number for the standard sample is 85193.

3.3.2 Liner material. The material for the removeable liner shall be acrylic fiber pile and acrylic, polyester or polypropylene backed cloth conforming to class 2 of MIL-C-43251. The color shall be black.

3.3.3 Sleeve lining and bindings. The material for the sleeve lining, for binding the back of the shell facings and binding of the removeable liner shall conform to type III or IV of MIL-C-21852. The color shall be black.

3.3.4 Liner sleeves. The material for the sleeves of the liner shall be shade Black 3202, and shall conform to types I or II of MIL-C-43525.

3.3.5 Fusible materials.

* 3.3.5.1 Fusible interlining. The fusible interlinings for the topcollar, epaulets, pocket welts, facings, front fly, top and bottom collarstands and for interlining sleeve bottoms shall be dark grey or black nonwoven web, thermally bonded, mechanically entangled together and shall be binder free. The fusible cloth may be composed of 100% polyester or polyester and nylon with not more than 25% nylon by base weight. The fusible adhesive shall be applied to one side of the web in a uniform dot pattern in accordance with good commercial practice. The finished weight of the fusible material shall be a minimum of 1.5 ounces per square yard. The interlining, when fused to the basic cloth as specified in 3.3.5.3, shall conform to the following requirements when tested as specified in 4.4.1.

Appearance of fused sample 1/	
Initial 2/	No evidence of bubbling, or delamination of the bond, color change or strike through.
after 5 dry cleanings and after 3 launderings	No evidence of bubbling or delamination of the bond.
Shrinkage	
after 5 dry cleanings	2 percent maximum
after 3 launderings	

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

Bond Strength (ounces per inch of width) 3/	
Initial	22 ounces
after 5 dry cleanings	18 ounces
after 3 launderings	18 ounces

1/ Initial requirement applies to both quality conformance and in-process tests.
2/ After evaluation for appearance and shrinkage, samples may be used for the remainer of tests.
3/ The item will be accepted if the fusible either splits from itself rather than separates from the outershell material or if it begins to separate from the outershell material higher than the minimum bond strength and then splits from itself.

3.3.5.2 Seam web tape. The tape for topstitching seams as specified in Table II, shall be a polyamide fusible web, 3/8 (±1/16) inch in width and weigh 1.0 (±0.2) ounces per square yard. The color shall be natural. Testing shall be as specified in 4.4.1.

3.3.5.3 Fusing conditions. The fusible interlining shall be fused to the basic material on a fusing press. All fusing of the fusible material shall be on a single ply basis (no stacking allowed). For optimum results with the particular fusible style and press used, specific settings should be obtained from the manufacturer of the fusible interlining. The statement "press fusible to various cut parts in accordance with the fusible manufacturers recommendations" refers to time, temperature, and pressure.

3.3.5.4 Sleeve hem interlining. When the alternate sleeve hem interlining is used, it shall be a non-woven interlining conforming to type I or II, class 1 of MIL-C-43836. The color shall be natural, black, or grey.

* 3.3.6 Labels. Each coat shall have a personnel-identification label, a size label and an instruction label conforming to type VI of DDD-L-20. The liner shall have a size and instruction label conforming to the above. The labels shall show fastness to laundering and dry cleaning. Each coat shall also have a removable size ticket attached to the lower left sleeve.

3.3.6.1 Personnel-identification label. The personnel-identification label shall conform to class 1 and 10.

3.3.6.2 Size label. The size labels shall conform to class 2. Short, Regular, Long and X-Long may be abbreviated S, R, L and XL, respectively.

* 3.3.6.3 Instruction label. The instruction labels shall conform to class 3 and shall contain the following information:

Source: https://assist.dla.mil -- Downloaded: 202640-20T02:58Z
Check the source to verify that this is the currentversion before use.

COAT LABEL

MACHINE WASH SEPARATELY WITH WARM
OR COLD WATER. RINSE THREE (3)
TIMES TO REMOVE ALL SOAP.
DO NOT SPIN OR WRING. HANG TO DRIP DRY.
OR, COMPLETE THE WASH CYCLE AND TUMBLE DRY AT 140 DEGREES F.
TOUCH UP WITH A COOL IRON.

OR

DRY CLEAN, THOROUGHLY RINSING
TO REMOVE ALL DETERGENTS

LINER LABEL

DRY CLEAN ONLY - DO NOT PRESS

3.3.6.4 Combination personnel-identification and instruction label. The personnel-identification (class 1 and 10) and the instruction labels (class 3) may be combined into one label. The combination label shall conform to class 10 and 15.

* 3.3.6.5 Removable size ticket. Each coat shall have a commercial type size ticket attached to the outside of the lower left sleeve. The ticket shall be 1 1/2 inches long and 2 inches high, made of a suitable plain white cardboard. The corners of the ticket may be double perforated for ease in tacking. The size (38R - Example) shall be printed or stamped on the upper left hand corner in black or blue ink. The lettering for the size shall be 1/4 inch in height. Abbreviations for lengths shall be allowed in accordance with 3.3.6.2.

3.3.7 Thread. The thread for all seaming and stitching shall be covered polyester thread, Ticket Nos. 30, 50 or 70, 2 or 3 ply, conforming to MIL-T-43548. The color shall be Black AA, C.A. 66043 in accordance with Standard Shade for Thread.

3.3.7.1 Colorfastness. The dyed thread shall show fastness to laundering and light equal to or better than that of the standard sample when tested as specified in MIL-T-43548. When no standard sample is available, the dyed thread shall show minimum of "good" fastness to laundering and light when tested as specified in MIL-T-43548.

3.3.8 Gimp. The gimp reinforcing buttonholes shall be cotton, Black AA, C.A. 66043 in accordance with Standard Shade for Thread, conforming to size No. 8, type I or II of V-T-280.

3.3.8.1 Colorfastness. The dyed gimp shall show fastness to laundering equal to or better than the standard sample, when tested as specified in V-T-280. When no standard sample is available, the dyed gimp shall show a minimum of "good" fastness to laundering when tested as specified in V-T-280.

Source: https://assist.dla.mil -- Downloaded: 202640-20T02:58Z
Check the source to verify that this is the current version before use.

3.3.9 Buttons. The buttons shall be type II, class D, style 20 and 21. T color shall be Black BT, Cable No. 62001 in accordance with Standard Shade f Buttons. The coat shall have 40-line for front fly; 30-line for the lape epaulets and storm tab; 24-line for sleeve tabs, sleeve liner, throat tab a back vent; and style 15, 18-line for stay buttons. The buttons shall confo with V-B-871.

3.3.10 Slide fastener. The slide fastener for the coat and liner shall b type IV, style 1, size L, with short tab pull and brass conforming to V-F-10 The length of the fastener shall be 68 inches for the shorts and 70 inches f regulars, longs and extra-longs. All metal component parts of the sli fastener shall be fabricated from brass and be from the same supplier (s 4.4.1).

3.3.10.1 Tape for slide fastener. The slide fastener tape shall be dy black. The dyed tapes shall show fastness to laundering (after 3 cycles) a dry cleaning equal to or better than the standard sample.

3.4 Design. The coat is single breasted with four (4) fly front button lapel button, and throat tab button. It has a split shoulder design (set- front and raglan back) with shoulder epaulets and a front and back yo lining. The coat has welt pockets with pass-through slits. The back has center vent with button and buttonhole closure. The front facing has a butt storm tab. The coat has a removable, zip-in pile liner with bound edge raglan sleeves with a button and loop for attaching to the sleeve bottom, a a bound, pass-through pocket slit.

3.4.1 Figures. Figures are furnished for information purposes only. To t extent of any inconsistencies between the written specification and t figures, the written specification shall govern.

3.5 Patterns. Standard patterns to be used to cut working patterns will furnished by the Government. The working patterns shall be identical to t Government patterns. Neither the Government patterns nor the working patter shall be altered in any way. The patterns provide a seam allowance of 3 inch for safety stitched seams and joining seams except for the collar a collar stand (which shall be 1/4 inch). Unless otherwise indicated in Tab II, seams shall be in accordance with these seam allowances.

* 3.5.1 List of pattern parts. The component parts of the coat shall be c from materials specified in accordance with the number of parts indicated Table I.

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE 1. List of pattern parts

Material	Nomenclature	Cut parts
Coat		
Cloth, cotton and polyester poplin, water repellent	Back	2
	Front	2
	Facing tab 1/	1
	Sleeve tab 1/	2
	Epaulet	4
	Collar 2/	2
	Collar stand 2/	2
	Pocket welt	2
	Pocket-inner ply	2
	Pocket-outer ply	2
	Fly piece	2
	Front lining	2
	Back lining	1
	Back sleeve	2
	Front sleeve	2
	Front facing	2
	Shoulder reinforcement	2
	Pocket facing	2
Nylon tafetta	Front sleeve lining	2
	Back sleeve lining	2
Cloth, fusible	Collar interlining	1
	Collarstand interlining	2
	Pocket welt interlining	2
	Front sleeve bottom interlining	2
	Back sleeve bottom interlining	2
	Front facing interlining	2
	Fly piece interlining	1
	Epaulet interlining	2
Templates	Finished fly stitching marker	-
	Fly front buttonhole marker	-
	Finished collar	-
	Lapel marker	-
Liner		
Cloth, acrylic fiber pile	Front 3/	2
	Back 3/	1
Cloth, satin, acetate or rayon face and rayon or cotton back	Frontsleeve	2
	Backsleeve	2

1/ May be cut as two pieces with seam allowance added.
2/ One part is to be used for the top and one for the bottom.
3/ The nap of the fabric shall lay in the downward direction.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

3.6 Construction.

3.6.1 Stitches, seams, and stitching. Stitch, seam, and stitching types specified in Table II shall conform to FED-STD-751. Whenever two or more seam or stitch types are given for the same part of the operation, any one of them may be used. When stitch type 401 is used, the looper thread shall be on the inside of the coat and on the coat side of the liner. Seam allowances shall be maintained with seams sewn so that no raw edges, runoffs, twists, pleats, puckers, or open seams will result. All seams shall start and finish evenly. Thread tension shall be maintained so that there is no tight or loose stitching. Unless otherwise specified, raise stitching or edge stitching shall be 1/4 to 5/16 inch from the edge. The width of the safety stitch shall be 3/8 inch and the guides and knives of the safety stitch machines shall be set to trim only the ravelled edges of the fabric. The fusible tapes for seams shall not be exposed in the seam construction. All bartacks shall be 1/2 (± 1/16) inch long unless otherwise specified in Table II.

3.6.2 Stitches per inch. The minimum and maximum number of stitches per inch shall be as specified in Table II.

3.6.3 Thread breaks and ends of seams. Ends of all seams and stitchings, when not caught in other seams or stitching, shall be backtacked not less than 1/2 inch. The ends of a continuous line of stitching (except labels) shall be overlapped not less than 1/2 inch. The ends of the label stitching shall be overlapped not less than three stitches. Thread breaks (all stitch types) shall be secured by stitching back of the break not less than 1/2 inch. Skipped stitches or thread breaks on 401 stitch type may be repaired using 301 stitch type.

* 3.6.4 Buttonholes. The buttonholes for the coat except for vent, shall be a cut-after, or cut-first eyelet end taper bar or square bar type, worked over gimp with the ends of gimp pulled through to the underside and bartacked. The ends of the taper bar buttonhole shall have a minimum of four tack stitches, not including the first cross-over stitch. The square bar buttonhole shall be bartacked in a seperate operation. The buttonhole for the vent shall be 1/2 (± 1/8) inch, straight-cut type, tacked at both ends.

3.7 Manufacturing operations requirements. The coat and liner shall be manufactured in accordance with operation requirements specified in Table II. The contractor is not required to follow the exact sequence of operations listed. Any additional basting or holding stitching to facilitate manufacture is permissible, provided that the thread is removed or does not show in the finished coat or liner.

3.7.1 Pressing. Unless otherwise specified, all pressing specified in Table II shall be performed with a heated pressing iron or steam pressing machine.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

3.7.2 Marking. The cut parts of the coat and liner shall be marked to insure a uniform shade and size throughout the garments. Any method of marking may be used except:

(a) Metal fastening devices.
(b) Sew-on shade tickets.
(c) Adhesive type tickets which leave traces of paper or adhesive on the material after removal of the tickets.

NOTE: The use of non-corrosive metal fastening devices is permitted for the liner only.

3.7.3 Abbreviations in table of operations. The abbreviations used in Table II are as follows:

Stch	-	Stitch
in	-	inch
Ndl	-	Needle
Bob	-	Bobbin
Lpr	-	Looper
Mchne	-	Machine
Brtck	-	Bartack
Comrcl	-	Commercial
smrl	-	similar
Btnhl	-	Buttonhole
incl	-	including
dbl	-	double

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
1.	Cutting.					
	a. Cut the coat in strict accordance with patterns furnished which show size directional lines, marks for placement of component parts, and notches for proper assembly. Directional lines shall be placed in the warp direction unless otherwise specified.					
	b. Cut the basic material parts for coat from the same piece of material except; facing tab, undercollar, underside of shoulder epaulets, inner ply of pocket, outer ply of pocket, front lining (yoke), back lining (yoke), fly pieces, undercollar stand, shoulder reinforcement pieces and hanger loop (see operation 1.c. for finished width and length of loop), which may be cut from ends. Parts cut from ends shall approximate the shade of the garment. When front and back (yoke) linings are cut from ends, they shall be shade marked and match each other.					
	c. Cut stripping for hanger loop from basic material of sufficient width to finish 3/8 (+ 1/8) inch wide and 3 (+ 1/8) inches in length.					
	d. Cut liner fronts and backs from the same piece of material, and in a manner so that on the finished liner the back and front pile pieces fall with the nap running down from top to bottom.					
	e. Cut the liner sleeves from the same piece of material. Cut coat lining sleeves from same piece of material.					
	f. Cut all interlining materials in accordance with patterns furnished.					
	g. Cut the binding material for both the coat and liner on a 45 degrees bias 1 to 1-5/16 inches wide.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T02:58Z
Check the source to verify that this is the currenversion before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
2.	Replacement of defective components. During the spreading, cutting, and manufacturing process, components having material defects or damages that are classified as defects in MIL-STD-1494 and section 4 shall be removed from production and replaced with non-defective and properly matched components.					
3.	Marking. Mark or ticket cut parts to insure a uniform shade and size throughout the coat and liner.					
	MAKE COAT					
4.	Fusing					
	a. Position fusing on the underside of the topcollar, top and under collarstands, pocket welt, front facing, fly piece and epaulet. Position fusing on under side of back and front sleeve bottoms or as an alternate a non-woven cloth may be used (operation 20c).					
	b. Press fusible to the above parts in accordance with the fusible manufacturer's recommendations.					
5.	Make shoulder epaulet.					
	a. Stitch two shoulder epaulet pieces together, face to face, around all sides, 1/4 inch from raw edges, leaving an opening at the square end for turning.	301 or 401	SSe-2(a)	10-12	50 50	50 70
	b. Trim points, turn and force out edges and points, and stitch 1/4 to 5/16 inch from edges the sides and pointed end.	301	SSe-2(b)	10-12	50	50
	c. Make a 7/8 inch eyelet end square bar buttonhole in each shoulder epaulet positioned as indicated by marks on pattern. The center of the eyelet shall be 3/4 inch from pointed end. The buttonhole shall not be off center by more than 1/8 inch. The purling shall be on the top side of the epaulet.	Button-hole		50-54 per button-hole	30	50
	d. Tack ends of buttonhole stitching and gimp by machine with a 1/4 inch bartack.	Bartack		21 per bar-tack	50	50

Source: https://assist.dla.mil -- Downloaded: 202640-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
*6.	Make facing and sleeve tabs.					
	a. Fold tab, or when two pieces used, place face to face, and stitch 1/4 inch from raw edge along side and pointed edges.	301 or 401	SSe-2(a)	10-12	50 50	50 70
	b. Trim, turn, and work out edges and pointed end. Stitch sides and point 1/4 to 5/16 inch from edges.	301	SSe-2(b)	10-12	50	50
	*c. Make a 7/8 inch eyelet end square bar or eyelet-end taper bar buttonhole in the facing tab and a 3/4 inch eyelet end square bar or eyelet-end taper bar in the sleeve tabs as indicated by marks on the pattern. The center of the eyelet shall be 3/4 inch from pointed end. The buttonhole shall not be off center by more than 1/8 inch. The purling shall be on the outside of tabs.	Button-hole		50-54 per Btnhl	30	50
	d. Tack ends of buttonhole stitching and gimp by machine with a 1/4 inch bartack.	Bar-tack		21 per Brtck	50	50
7.	Make hanger loop					
	a. Turn the edges of the loop to the center and stitch the abutted edges with a row of stitching (5/16 gauge) extending across and covering the edges of the material (see 1.c).	406	EFh-1	10-12	50	50
	or					
	b. Fold loop with the raw edges turned in and stitch 1/16 to 1/8 inch from each edge.	301	EFp-2	10-12	50	50
8.	Make collar.					
	a. Stitch undercollar to topcollar, face to face around the side and top edges, 1/4 inch from raw edges.	301 or 401	SSe-2(a)	10-12	50 50	50 70
	b. Trim, turn, force out edges, and stitch 1/4 to 5/16 inch from edges.	301	SSe-2(b)	10-12	50	50
9.	Make collar stand and attach collar.					
	a. Position collar between top and undercollar stand, as indicated by marks on pattern, and with raw edges even, stitch along top edge, side of collar stand and around throat tab.	301 or 401	SSe-2(a)	10-12	50 50	50 70

Source: https://assist.dla.mil -- Downloaded: 202640-20T02:58Z
Check the source to verify that this is the currenversion before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	b. Turn collar stand to finished position forcing out points and edges of throat tab and stitch 1/16 from turned edges, the top of collar stand, side of collar stand and around throat tab.	301	SSe-2(b)	10-12	50	50
	*c. Check finished collar with finished collar template for shape and size.					
	d. Position hanger loop on center of top collar stand. Turn ends under 3/8 inch and bartack 1/16 to 1/8 inch from each end. The distance between the bartacks shall be 2-7/8 (± 1/4) inches.	Bartack		28 per Brtck	50	50
	*e. Make 3/4 inch eyelet end square bar or eyelet-end taper bar buttonhole on throat tab positioned as indicated by mark on pattern, with center of the eyelet 1/2 to 5/8 inch from front edge of throat tab.	Button-hole		50-54 per Btnhl	50	50
	f. Tack ends of buttonhole stitching and gimp by machine with a 1/4 inch bartack. The purling shall be on outside of throat tab when buttoned in the not used position.	Bartack		21 per Brtck	50	50
10.	Make pocket welt.					
	a. Fold welt in half length-wise, face to face, and stitch side edges 1/4 inch from raw edge.	301 or 401	SSe-2(a)	10-12	50 50	50 70
	b. Trim, turn, force out edges and points, and stitch 1/4 to 5/16 inch from side and folded edges.	301	SSe-2(b) and OSf-1	10-12	50	50
11.	Make pockets.					
	a. Slash pocket-inner ply opening according to marks on pattern and tongue notch. Superimpose pocket pieces, back to back, and stitch together around all sides.	301 or 401	SSe-2(a)	10-12	50 50	50 70
	*b. Turn pocket right side out, and edge stitch 1/8 (± 1/16) inch from folded edge, around all sides.	301	SSe-2(b)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	c. Turn under back raw edge of pocket inner ply at slash and stitch to pocket outer ply 1/16 inch from turned edge, forming facing.	301	LSd-1	10-12	50	50
12.	Set pockets. Finished appearance. The pockets and welts shall be uniform in appearance and placement and shall lie flat and smooth, without twisting, pleating, or puckering. The stitching shall be uniform in width.					
	a. Set pocket welt on front as indicated by marks on pattern. Seam welts to fronts 1/4 inch from raw edge. The stitching shall not extend beyond the pocket line.	301	SSa-1	10-12	50	50
	b. Fold facing for hand-opening in half lengthwise and position raw edges of facing on opposite side of pocket opening with raw edges abutting raw edges of welt. Stitch facing to fronts along pocket opening mark from top to bottom of opening 1/8 inch from raw edge.	301	SSe-2	10-12	50	50
	c. Slash pocket opening as indicated by marks on coat front and tongue notch to ends of stitch line. (NOTE: Cut shall not be visible on the finished coat.)					
	d. Turn hand-opening facing to inside and stitch to front 1/16 inch from folded edge.	301	EFa-1	10-12	50	50
	e. Seam unfinished side of pocket inner ply slash opening to welt raw edge and front pocket opening, with the raw edges even, 3/16 to 1/4 inch from raw edges.	301	SSa-1	10-12	50	50
	f. Turn pocket to inside and raise stitch through welt and pocket inner ply evenly 1/16 to 3/32 inch of turned edge.	301	SSe-2(b)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202640-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	g. With pocket in a flat position, double stitch down top and bottom edges of welt, through front and hanging pocket, with two rows of stitching. The inner row shall be superimposed on the 5/16 inch top stitching on the welt and the outer row shall be 1/16 inch from the outer edge of the welt. The stitching at ends of hand opening shall be diagonal to the corners of the hand opening. The finishing stitch should cross over the beginning stitch.	301	LSq-3(b)	10-12	50	50
	h. Stitch front edge of pocket to front edge of coat.	301	SSa-1	6-12	50	50
13.	Attach labels and storm tab.					
	a. Stitch size label to right front facing starting approximately one inch below bottom front facing tab stay button (operation 34d).	301	LSbj-1	8-12	50	50
	b. Position personnel-identification label under the size label. The top edge of personnel-identification label may be caught in the bottom row of stitching of the size label.	301	LSbj-1	8-12	50	50
	c. Position the instruction label under the personnel-identification label. The top edge of instruction label may be caught in the bottom row of stitching of identification label.	301	LSbj-1	8-12	50	50
	or					
	d. When combination label is used it shall be positioned as in (a) above.	301	LSbj-1	8-12	50	50
	Note: The label shall be stitched on all four sides, and the stitching shall not be through the printing.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	e. Position facing tab on left front facing so that the buttonhole in the tab finishes the same distance from the bottom fly buttonhole as is the interval between the fly buttonholes. Position the raw edge of tab parallel to front edge of facing. Stitch to facing 1/4 inch from raw edge.	301 or 401	LSs-2(a)	10-12	50 50	50 70
	f. Turn tab to finished position (point of tab toward front of facing) and stitch, enclosing the raw edge. Continue stitching across the top of tab with stitching superimposed on the horizontal edge stitching of the tab. The purling of the buttonhole shall face the wearer on the finished coat. The eyelet edge of the buttonhole shall finish in line with the inside edges of the fly buttonholes.	301	LSs-2(b)	10-12	50	50
14.	Make left fly front					
	a. Position a fly piece on left front facing face to face, as indicated by notches on pattern. Stitch inward at top notch, down parallel of front edge 3/4 inch from raw edge and outward at bottom notch.	301	SSe-2(a)	10-12	50	50
	b. Cut facing and fly piece diagonally to stitch line at each corner.					
	c. Turn fly piece to inside and stitch the length of the fly piece 5/16 inch from turned edge, backtacking each end.	301	SSe-2(b)	10-12	50	50
	*d. Make four 1 1/8 inch eyelet end taper bar finished cut length buttonholes on fly piece in accordance with the fly front buttonhole marker. The purling shall face outward. The taper bar portion of the buttonhole may extend past the fly topstitching (see operation 28).	Button-holes		50-70 per button-hole	30	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	e. Position buttonhole fly onto top fly piece with raw edges even above and below notches, and front edge of buttonhole fly 3/4 inch back of top fly piece raw edge. Make 3 horizontal bartacks centered between the four buttonholes through both fly pieces only.(The bartacks may be vertically superimposed on the front fly stitching or horizontally centered between buttonholes, 1 inch from edge.)	Bartack		28 per bar-tack	50	50
15.	Make facings.					
	a. Bind back raw edge of facings. Binding shall finish 3/16 to 1/4 inch wide (see 3.3.3).	301 or 401	BSc-1	10-12	50	50
					50	70
16.	Make lining (coat).					
	a. Join front lining to back lining at side seams, face to face, with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50	70
					70	70
	b. Stitch underarm seam of sleeves, face to face with a safety stitch.	515 or 516 or 519	SSa-2	10-12	50	70
					70	70
	*c. Position shoulder reinforcement piece on back sleeve lining according to marks on pattern. Position the back edge of this sleeve assembly to the top edge of the back lining matching the notches. Safety stitch completely around armhole to front shoulder. The shoulder reinforcement shall finish between the sleeve lining and the outer shell of the coat.	515 or 516 or 519	SSa-2	10-12	50	70
					70	70
	d. Position front edge of back sleeve with shoulder reinforcement piece on top edge of front lining according to notches and safety stitch with stitching continuing the entire length of sleeve, closing top sleeve lining.	515 or 516 or 519	SSa-2	10-12	50	70
					70	70

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	e. Hem bottom of lining with raw edge turned under. Hem shall finish 3/8 t 5/8 inch in width.	301	EFb-1	10-12	50	50
17.	Make back and vent.					
	a. Position the back parts together, face to face, with the edge of the right back folded over the left back. Insert the seam web tape against the left back under the folded edge of the right back. The seam web tape shall extend from the top of the vent to the neck edge of the coat.					
	b. Stitch back pieces together (1/4 to 3/8 inch below top of vent to neckline) 3/8 inch from the folded edge catching the seam web tape in the stitching.	301 or 401	SSw-2(a)	10-12	50 50	50 70
	c. Press the seam toward left back, fusing the seam web tape and also forming left vent edge. Raise stitch 1/4 to 5/16 inch from fold of seam. Fold left vent in line with the center back seam and fold in the raw edge about 1-1/8 inch. Continue stitching to the bottom of the vent, catching the side with the raw edge in the stitching. The distance from the vent edge to the stitching shall be even with the length of the vent.	301	SSw-2(b)	10-12	50	50
	d. Fold right side of vent under even with the right centerback seam edge and with raw edge turned under, stitch 1/16 inch from back turned edge. Stitching shall be in line with the stitching at the right side of center back and shall be straight and even.	301	EFb-1	10-12	50	50
	e. With left side of vent overlapping right side, box stitch top of vent through all plies. The box stitching shall be diagonal to the center seam (approximately 45 degrees) and shall measure 1-1/4 (±1/4) inches long and 3/8 (±1/8) inch wide. (As an alternate, The box stitching may be perperdicular to the center seam.)	301		10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the currentversion before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	*f. Make a vertical 1/2 inch straight cut-type tacked at both ends buttonhole centered on right vent, positioned as indicated by marks on pattern.	Button-hole		50-54 per btnhl	50	50
18.	Join sleeves to body.					
	a. Stitch front sleeve to front armhole from shoulder to 3 (+ 1/4) inches below the step on front.	301 or 401	LSq-2(a)	10-12	50 50	50 70
	b. Turn, placing seam web tape against front and raise stitch seam 1/4 to 5/16 inch with stitching on front to step. At step, turn and stitch to joining seamline.(The seam web tape may be stay stitched or stitched during operation 18a on front sleeve.)	301	LSq-2(b)	10-12	50	50
	*c. Stitch back sleeve to back armhole from neckline to about 3 inches below the step on back, keeping a 1/2 inch seam allowance.	301 or 401	LSq-2(a)	10-12	50 50	50 70
	d. Turn, placing seam web tape against back and raise stitch seam 1/4 to 5/16 inch with stitching on back to step. At step, turn and stitch to joining seamline. (Or the seam web tape may be stay stitched or stitched during operation 18c to the back sleeve.)	301	LSq-2(b)	10-12	50	50
	e. Press top of sleeves at armhole, fusing the seam web tape.					
19.	Close sides.					
	a. Position fronts on back, face to face with edge of front folded over edge of back. Insert seam web tape on back under the folded edge of front, and stitch sides together 3/8 inch from folded edge, catching the seam web in the stitching.	301 or 401	SSw-2(a)	10-12	50 50	50 70
	b. Press the seam toward back, fusing the seam web tape. Raise stitch 1/4 to 5/16 inch from folded edge of seam.	301	SSw-2(b)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
20.	Close sleeves.					
	a. Join top arm seam from neckline to bottom of sleeve with a safety stitch, simultaneously stitching seam web tape to back edge of front sleeve and catching sleeve tab in stitching. Bottom of tab shall finish 2 1/2 (±1/4) inches from the hemmed sleeve.	515 or 516 or 519	LSq-2(a)	10-12	50 70	70 70
	*Note: The stitching may be accomplished with two operations, using 301 or 401 stitch type and 1/2 inch seam allowance and overedging with a 503 or 504 stitch type.					
	b. Turn seam toward front and raise stitch 1/4 to 5/16 inch from folded edge so raise stitching finishes on front of sleeve.	301	LSq-2(b)	10-12	50	50
	c. When the alternate non-woven cloth is used, stitch the cloth interlining across bottom width of sleeve 1/4 inch from raw edges.	301	SSa-1	10-12	50	50
	d. Press seam, fusing seam web tape.					
	*e. Stitch underarm seam. Press seam open and flat.	301	SSa-1	10-12	50	50
	f. Complete the stitching of sleeve to armhole.	301	SSa-1	10-12	50	50
	g. With a second row of stitching adjacent to the first row, stitch around the underarm from within 1 inch of the back step to within 1 inch of the front step. Clip seam allowance in this area to prevent puckering.	301	SSa-1	10-12	50	50
21.	Attach shoulder epaulets.					
	a. Center the square end of the shoulder epaulets on the shoulder seam, top side facing sleeve, and stitch along shoulder edge 1/4 inch from raw edge.	301	LSq-2(a)	10-12	50	50
	b. When shoulder epaulet is turned to its finished position, the point of the epaulet shall touch the finished collar seam and the epaulet shall be centered directly over the shoulder seam. Stitch epaulet 1/4 to 5/16 inch from the turned square end of the shoulder epaulet.	301	LSq-2(b)	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
22.	Attach collar to coat.					
	b. Stitch collar to coat with collar centered between the lapels, center backs matching. Clip front neckline seam allowance, as necessary.	301 or 401	SSa-1	10-12	50 50	50 70
23.	Attach lining to facing.					
	a. Mark facing 1-1/4 inch from bound back edge for position of lining. Lap the right facing over the left at center back 1 to 1-1/4 inches.					
	b. Position raw edge of front lining onto marks on facings and stitch lining to facing forming a 1 inch pleat at center back. The inner fold of the pleat shall be toward the left.	301	LSa-1	10-12	50	50
24.	Attach facing assembly to shell.					
	a. Position facing onto front and neckline with raw edges even and stitch across neckline through coat, collarstand, and collar. Continue stitching across lapels, down fronts and across bottom of facing. Stitching across bottom of facing shall be in accordance with the required hem depth. The lapel shall be uniform in size and shape when checked against the lapel marker.	301 301 or 401	SSe-2(a) and LSq-2(a)	10-12 10-12	50 50 50	50 50 70
	b. Turn neck facing and raise stitch across neckline 1/16 inch from edge, the length of the collarstand. The stitching shall not be visible on the outside of the coat.	301	LSq-2(b)	10-12	50	50
	*c. Overedge stitch bottom raw edge of sleeve lining.	503	EFd-1	10-12	70	70
	*d. Stitch sleeve lining to sleeve 1 (±1/8) inch from bottom of overedge seam of lining.	301 or 401	SSa-1 SSa-1	10-12 10-12	50 50	50 70
	e. Turn up bottom of sleeve at hem notch; align underarm seams of lining and shell and stitch seam allowances together for a distance of 6-1/2 (±1/4) inches, beginning 3 (±1/4) inches from hemmed edge.	301	SSa-1	10-12	50	50

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
*25.	Anchor lining to side seams. Tack lining to side seams with a vertical bartack or 1/2 inch automatic straight tack 2 to 3 inches below the sleeve setting seam. The stitching may be superimposed on the topstitching or the lining may be tacked to the inside of the seam allowance of the side seams.	Bartack		28 per	50	50
		or 301			50	50
26.	Finish coat fronts. Turn facing; force out edges and edge stitch fronts 1/4 to 5/16 inch from edge across top of lapels, down fronts and across bottoms to back edge of facings.	301	SSe-2(b)	10-12	50	50
27.	Hem bottom of coat. Turn in raw edge and hem bottom of coat. The hem shall finish 1 (±1/8) inches wide. The turned in raw edge may be stitched prior to hemming. Turn and stitch along bound edge of facing to bottom of coat, matching stitches of operation 26.	301	EFb-1	10-12	50	50
28.	Top stitch fly front. Position finished fly stitching marker on front and mark, extending the mark 1 (±1/8) inch below fly opening. Top stitch on mark line through all plies.	301	SSv-1	10-12	50	50
29.	Make buttonhole. a. Make a 7/8 inch horizontal eyelet end square bar buttonhole on lapel with inside edge of eyelet 3/4 (±1/8) inch from front edge and 3/4 (±1/8) from top edge.	Buttonhole		50-54 per buttonhole	30	50
	b. Tack ends of buttonhole stitching and gimp by machine using a 1/4 inch bartack. The purling of a buttonhole shall be on the outside of the coat.	Bartack		21 per bartack	50	50
30.	Tack pocket to facing. Tack back edge of facing to bottom of pocket with a vertical tack. The tack shall not be more than 1/2 inch from bottom edge of pocket and approximately 1 inch from the edge of the binding.	Bartack		28 per tack	50	50

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
31.	Set slide fastener on coat.					
	a. Position the slide fastener on the coat facings so that the ends of the fastener are equidistant from bottom edge of the coat. The separating pin of the slide fastener shall be on the right facing (as worn).					
	b. Position the slide fastener on the underside of coat facings with the front edge of the chain 1/8 to 3/16 inch from the bound edge.					
	c. Turn in the end of the tape 1/2 to 3/4 inch and stitch the length of tape 3/16 to 5/16 inch from back edge of chain. When slide fastener tape has a finished end, they do not need to be turned under.	301	SSa-1	10-12	50	50
32.	Clean coats.					
	a. Trim thread ends and remove loose threads.					
	Note: Care shall be taken when trimming thread ends that damage to fabric does not result.					
	b. Remove spots, stains, and markings.					
	c. Remove shade tickets.					
	*d. Attach removable size ticket to outside of lower left sleeve.	Hand or Machine		2-4 per tack 6-8 per tack		
33.	Press coat.					
	Press collar, fronts, backs, pockets, sleeves, and hems with steam pressing machine or hand pressing iron.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
34.	Sew on buttons.					
	a. Mark or gauge buttons to correspond to buttonholes and marks on patterns. The stitch type, stitches per inch and thread shall be the same for all buttons.	101		14-16 per button	30	
		or				
		301		14-16 per button	30	30
		or				
		Hand		4-6 per button	30	
	b. Sew four 40-line buttons 2 inches from front edge to correspond with buttonholes on the fly, on the opposite side, with stitching through coat, facing, pocketing (when applicable) and an 18-line stay button. Buttons shall be shank wrapped.					
	c. Sew a 30 line button on lapel to correspond with buttonhole on opposite lapel; button shall be shank wrapped with stitching through coat, facing and an 18-line stay button.					
	d. Sew a 30 line button on front to correspond with buttonhole in facing tab on opposite facing, with stitching through coat, facing and 18-line stay button. Shank wrap.					
	e. Sew a 30 line button on each shoulder to correspond with the shoulder loop buttonhole without distortion and with the button positioned on the top arm seam. Shank wrap.					
	f. Sew a 24 line button on left side of vent on the inside to correspond with buttonhole on right side. Stitching shall be through facing only.					
	g. Sew two 24 line buttons, one on each side of the collarstand, positioned to align with tab buttonhole when tab is in either the stay or closed position.					
	h. Sew a 24 line button on the underarm seam of each sleeve corresponding to loops on liner. The stitch shall be through seam, lining and coat.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	i. Sew two 24 line buttons on each sleeve, one to correspond with the buttonhole in the sleeve tab and one 2 inches back to be used for take up.					
	MAKE LINER					
35.	Attach sleeves to liner body.					
	a. Position front sleeve to front of liner as indicated by marks on pattern and safety stitch around armhole.	515 or 516 or 519	SSa-2	10-12	50 70	70 70
	b. Position front edge of back sleeve onto shoulder edge of front liner and top edge of front sleeve and safety stitch with stitching continuing the entire length of sleeve notching the notches.	515 or 516 or 519	SSa-2	10-12	50 70	70 70
	c. Position back edge of back sleeve to front edge of back liner and safety stitch to bottom of armhole.	515 or 516 or 519	SSa-2	10-12	50 70	70 70
	*d. Close side seam of liner and sleeve seam in one operation with a safety stitch. As an alternate, this may be done in two operations stopping and starting at armpit.	515 or 516 or 519	SSa-2	10-12	50 70	70 70
36.	Bind edges of liner. Finished appearance. The binding shall be uniformly stitched with no raw edges showing. The fabric shall be caught in the stitching. The binding shall finish 1/4 (±1/16) inch wide.					
	a. Bind edges of vent, bottom fronts and neck of liner in one operation. The binding shall start and finish other than at the top of vent and the end shall be turned in and caught in the stitching. The ends of the binding shall overlap not less than 1/2 inch with the top end of the binding turned over on itself and securely stitched or bartacked.	301 or 401 or Bartack	BSc-1	10-12 28 per bartack	50 50 50	50 70 50

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	b. Bind sleeve bottoms with binding starting and finishing at underarm seam. The end of the binding shall be formed into a loop to accommodate the 24 line button on coat lining. The end of binding shall be bartacked or securely stitched.	301 or	BSc-1	10-12	50	50
		401 or			50	70
		Bartack		28 per bartack	50	50
	c. Bind pocket pass-through opening as indicated by marks on pattern. The ends of binding shall start and finish at other than the top and bottom of opening and shall overlap not less than 1/2 inch. The top end of the binding shall be turned over onto itself and securely stitched or bartacked.	301 or	BSc-1	10-12	50	50
		401 or			50	70
		Bartack		28 per bartack	50	50
37.	Attach size and instruction label.	301	LSbj-1	10-12	50	50
	a. Position the size label on the center back of the pile side of liner so that the top edge of label finishes 1-1/4 to 1-3/4 inches from the bottom of the binding. Stitch label on all four sides.					
	b. Position the instruction label under the size label. The top edge of instruction label may be caught in the bottom row of stitching of size label.	301	LSbj-1	10-12	50	50
	c. When combination label is used, it shall be positioned as in (a) above.	301	LSbj-1	10-12	50	50
Note:	All the labels shall be stitched on all four sides and the stitching shall not be through the printing.					
38.	Set slide fastener on liner.					
	a. Position the slide fastener on the underside of liner with the back edge of the chain immediately adjacent to bound edge of liner and with the ends of the fastener equidistant from the bottom of the liner.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

TABLE II - CONSTRUCTION OF COAT

No.	Operation	Stch Type	Seam/ Stch type	Stch in	Thread Ndl	Thread Bob/ Lpr
	b. Turn under the raw edge end of the slide fastener tape 1/2 to 3/4 inch, and stitch the length of the tape with the stitching superimposed on the binding stitching. When slide fastener tape has a fininshed end, they do not need to be turned under.	301	LSa-1	10-12	50	50
	c. The slide shall be positioned on right side of liner (as worn).					
39.	Clean liners. a. Trim all thread ends and remove loose thread.					
	Note: Care shall be taken when trimming thread ends that damage to the fabric does not result.					
	b. Remove all spots, stains, and shade tickets.					
40.	Attach liner to raincoat. Attach liner to coat by means of the slide fastener, checking the finished operation to insure free and easy manipulation of the slider. There shall be no bulging or distortion of the coat or the liner when fastener is engaged. The liner shall match the coat in size.					
41.	Button up coat. a. Button the top front button.					
	b. Button down epaulets and sleeve tabs.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the currenversion before use.

* 3.8 Measurements. The finished coats and liners shall conform to measurements shown in Tables III and IV. Coat measurements shall be made with the garment fully buttoned, laid flat with the liner removed.

Table III - Coat Measurements in Inches

Size	Chest(A)	Sleeve length(B)				Back length(C)			
		Short	Regular	Long	X-Long	Short	Regular	Long	X-Long
28	36	17	18	19-1/4	20-1/4	38	40	42-1/4	44-1/2
30	38	17	18	19-1/4	20-1/4	38-1/4	40-1/4	42-1/2	44-3/4
32	40	17	18	19-1/4	20-1/4	38-1/2	40-1/2	42-3/4	45
34	42	17	18	19-1/4	20-1/4	38-3/4	40-3/4	43	45-1/4
36	44	17	18	19-1/4	20-1/4	39	41	43-1/4	45-1/2
38	46	17	18	19-1/4	20-1/4	39-1/4	41-1/4	43-1/2	45-3/4
40	48	17	18	19-1/4	20-1/4	39-1/2	41-1/2	43-3/4	46
42	50	17	18	19-1/4	20-1/4	39-3/4	41-3/4	44	46-1/4
44	52	17	18	19-1/4	20-1/4	40	42	44-1/4	46-1/2
46	54	17	18	19-1/4	20-1/4	40-1/4	42-1/4	44-1/2	46-3/4
48	56	17	18	19-1/4	20-1/4	40-1/2	42-1/2	44-3/4	47
50	58	17	18	19-1/4	20-1/4	40-3/4	42-3/4	45	47-1/4
52	60	17	18	19-1/4	20-1/4	41	43	45-1/4	47-1/2
Tolerance:	± 1	±1/2	±1/2	±1/2	±1/2	±3/4	±3/4	±3/4	±3/4

Table IV - Liner Measurements in Inches

Size	Chest(D)	Sleeve inseam length(E)				Back length(F)			
		Short	Regular	Long	X-Long	Short	Regular	Long	X-Long
28	29	16	17	18-1/4	19-1/4	29-3/8	31-3/8	33-5/8	35-3/4
30	31	16	17	18-1/4	19-1/4	29-5/8	31-5/8	33-7/8	36
32	33	16	17	18-1/4	19-1/4	29-7/8	31-7/8	34-1/8	36-1/4
34	35	16	17	18-1/4	19-1/4	30-1/8	32-1/8	34-3/8	36-1/2
36	37	16	17	18-1/4	19-1/4	30-3/8	32-3/8	34-5/8	36-3/4
38	38 1/2	16	17	18-1/4	19-1/4	30-5/8	32-5/8	34-7/8	37
40	40	16	17	18-1/4	19-1/4	30-7/8	32-7/8	35-1/8	37-1/4
42	42	16	17	18-1/4	19-1/4	31-1/8	33-1/8	35-3/8	37-1/2
44	44	16	17	18-1/4	19-1/4	31-3/8	33-3/8	35-5/8	37-3/4
46	46	16	17	18-1/4	19-1/4	31-5/8	33-5/8	35-7/8	38
48	48	16	17	18-1/4	19-1/4	31-7/8	33-7/8	36-1/8	38-1/4
50	50	16	17	18-1/4	19-1/4	32-1/8	34-1/8	36-3/8	38-1/2
52	52	16	17	18-1/4	19-1/4	32-3/8	34-3/8	37-5/8	38-3/4
Tolerance:	±1	±1/2	±1/2	±1/2	±1/2	±1	±1	±1	±1

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

A, B, C, D, E, and F refer to figure 1.

A - Chest - Double the measurements taken from folded edge to folded edge at base of armhole.
B - Sleeve - Measurement taken from base of armhole to sleeve hem along underarm seam.
C - Back length - Measurement taken from neckline seam to bottom hem along centerback.
D - Chest - Fold liner in half along centerback, measure from aligned front edges to back folded edge at base of armhole and double the measurement.
E - Sleeve - Measurement taken from base of armhole to sleeve hem along underarm seam.
F - Back length - measure from neck edge to bottom of liner.

3.9 Workmanship. The finished coats and liners shall conform to the quality of product established by this specification. The occurrence of defects shall not exceed the applicable acceptable point value.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the contractor may use his own or any other facilities suitable for performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

* 4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the government to acceptance of defective material.

4.1.2 Certificate of compliance. Where certificates of compliance are submitted, the Government reserves the right to check test such items to determine the validity of the certification.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.3).
2. Quality conformance inspection (see 4.4).

4.3 First article inspection. When required, the first article submitted in accordance with 3.2 shall be inspected for compliance with design, construction, workmanship, appearance, and dimensional requirements.

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection. Sampling for inspection shall be performed in accordance with MIL-STD-1494, except where otherwise indicated.

* 4.4.1 Component and material inspection. In accordance with 4.1 above, components and materials shall be tested in accordance with all the requirements of referenced specifications, drawings, and standards unless otherwise excluded, amended, modified, or qualified in this specification or applicable procurement documents. The contractor shall furnish a certificate of compliance for the slide fastener requirements stating that all metal components are brass and are furnished by the same contractor (see 3.3.10). In addition, testing shall be performed on components listed in Table V, and in accordance with characteristics noted. The method of testing specified in FED-STD-191, wherever applicable and as listed in Table V shall be followed. All requirements are applicable to the sample unit. All test reports shall contain the individual values used in expressing the final results. The lot shall be unacceptable if one or more sample units fail to meet any of the test requirements specified. The lot size and sample size shall be in accordance with the following:

Components	Lot expressed as	Sample unit for testing
Tape, non-woven polyamide web for seams	Yards	1/2 linear yard
Fusible interlining	Yards	two 24 by 24 inch samples (prepared by the contractor during the same period and under the same conditions as fusing of the end items)

Table V - Component Testing

Component	Characteristic	Requirement paragraph	Test method
Polyamide web tape	Width	3.3.5.2	5020
	Weight	3.3.5.2	5041
Non-woven interlining fused to basic cloth	Construction	3.3.5.1	1/
	Appearance (initial)	3.3.5.1	Visual
	after 5 dry cleanings		5580 and Visual
	after 3 launderings		5556 2/ and Visual
	Weight	3.3.5.1	5041
	Shrinkage	3.3.5.1	
	after 5 dry cleanings		5580
	after 3 launderings		5556 2/
	Bond strength 3/	3.3.5.1	
	initial		5951
	after 5 dry cleanings		5580 4/ and 5951
	after 3 launderings		5556 2/ and 5951

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

1/ A certificate of compliance will be acceptable for this requirement.
2/ Cotton laundering procedure shall be used.
3/ All bond strength test samples shall have a 1 inch minumim non-fused area at the top, perpendicular to the warp. Both the basic material and the fusible shall be fused with the warps (or machine direction) parallel.
4/ Pressing and shrinkage requirements shall not apply.

4.4.2 In-process inspection.

4.4.2.1 Sample Size. The size of the fused check sample shall correspond to the total area covered by the facings, pocket, welts, front fly pieces, topcollars, collarstands, or sleeve bottoms which are fused at one time on the press.

4.4.2.2 Number of check samples. One check sample shall be prepared following fusing of every 100 facings, front fly pieces, and topcollars, and 200 pocket welts, sleeve bottoms, and collarstands, or once every 4 hours, whichever occurs first.

4.4.2.3 Appearance of the fused check sample. Each check sample shall be visually inspected for color change, bleed through, bubbling, and delamination. If there is any evidence of these conditions present, the previously fused pieces represented by the sample shall be inspected for the above conditions. Any fused part exhibiting one of the above conditions shall be removed from the lot.

4.4.2.4 Bond strength. The method of testing shall be as specified in 4.4.2.4.1. If the check samples fail the bond strength requirements, the previously fused pieces and check samples shall be re-fused after the fault has been corrected. If the check samples fail a second time, all fused pieces represented by the sample shall be rejected (see 3.3.5.1).

* 4.4.2.4.1 Apparatus and procedures for in process bond strength testing. The apparatus to be used for this test shall be a commercial type spring scale accurate to 0.5 oz. The procedure to be followed in performing the test shall be as follows:

(1) Three 1 by 8 inch wide strips parallel to the warp direction shall be cut from right, middle and left side of the check sample for peel strength testing.
(2) Seperate the fusible from the basic material at the end of the 1 inch wide strips for a distance of 2 inches.
(3) Secure the end of the basic material to a lightweight clamp like holder. (1 inch or more in width and approxinately 1.0 oz. in weight) Hang the clamp to the end of the spring scale.
(4) Position the fusible in another clamp 1 inch or more in width and approximately 1.0 oz. in weight and pull the fusible downwards in a vertical direction with a steady continuous motion (motion to be exerted by hand), until complete separation of the fusible from the samples. Minimum bond strength reading shall be taken visually from the spring scale. Failure of any individual strips shall indicate failure of the check samples.

Note: Care shall be taken not to jerk the fabric during testing.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

4.4.3 End item examination. Sampling and examination of the coat and the liner shall be performed in accordance with the provisions of MIL-STD-1494 except that the following additional defects shall apply:

Defect	Point Value
Underarm seam not double stitched	2
Slider positioned on left side of liner	2
Bottom of sleeve tab less than 2-1/4 or more than 2-3/4 inches from bottom of sleeve hem.	2

* 4.4.4 Examination of packaging requirements. An examination shall be made to determine that packaging, packing and marking complies with Section 5 requirements of this specification. Defects shall be scored in accordance with the list below. The sample unit shall be one shipping container fully prepared for delivery. Defects of closure listed below shall be examined on shipping containers fully prepared for delivery. The lot size shall be the number of shipping containers in the end item inspection lot. The inspection level shall be S-2 and the AQL shall be 2.5 defects per hundred units.

Examine	Defects
Marking (interior and exterior)	Omitted, incorrect, illegible, of improper size, location, sequence, or method of application.
Material	Any component missing, damaged or not as specified.
Workmanship	Inadequate application of components, such as: incomplete closure of container flaps, improper taping, loose strapping, inadequate stapling. Distorted or bulging containers.
Content	Open and non-continuous heat sealed seams and closure of polyethylene bag. 1/ Alternate closure of polyethylene bag not provided with tuck or reverse flap. 1/ Omission of required vent hole in polyethylene bag. 1/

1/ For these defects, one package shall be examined from each shipping container in the sample.

4.5 Packaging and packing inspection. Sampling and examination of packaging and packing shall be in accordance with MIL-STD-1494.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

4.5.1 Palletization examination. An examination shall be made to determine that the palletization complies with the section 5 requirements. Defects shall be scored in accordance with the list below. The sample unit shall be one palletized unit load fully packaged. The lot size shall be the number of palletized unit loads in the end item inspection lot. The inspection level shall be S-1 and the AQL, expressed in terms of defects per hundred units, shall be 6.5 as specified in MIL-STD-105.

Examine	Defect
Finished dimension	Length, width, or height exceeds specified maximum requirements.
Palletization	Pallet pattern not as specified. Interlocking of loads not as specified. Load not bonded with required straps as specified.
Weight	Exceeds maximum load limits.
Marking	Omitted; incorrect; illegible; of improper size, location, sequence, or method of application.

5. PACKAGING

5.1 Preservation-Packaging. Packaging shall be level A or C as specified (see 6.2).

5.1.1 Level A. Each coat shall be buttoned at the top. The fronts are overlapped for an even width down the length of the coat. The arms are folded across the chest. The top front is folded down 1/3 and the botton front is folded up to measure approximately 23 x 15 inches. The folded coat shall be inserted into a close-fitting flat style clear polyethylene film bag of 0.00125-inch thickness (±25 percent tolerance). The polyethylene bag shall be formed with heat sealed seams that are straight, continuous, and parallel to each other and the formed edges of the bag. The bag may be fabricated from polyethylene film tubing or sheeting. The bag shall be not less than 1 inch greater in length than the folded coat. The final closure of the bag shall be heat sealed with the heat seal made as close as possible to the open end. A 1/4 inch diameter hole shall be made at one corner of each polyethylene bag to allow excess air to escape. As an alternate, the polyethylene bag may be of the tuck-in or reverse flap type in which case a heat seal closure and corner vent hole are not required.

5.1.2 Level C. Each coat shall be packaged to afford adequate protection against physical damage from contractor to the first receiving activity. The package and quantity per package shall be the same as that normally used by the contractor for retail distribution.

5.2 Packing. Packing shall be level A, B, or C as specified (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

5.2.1 Level A packing. Six (6), coats of one length and size only, packaged as specified in 5.1, shall be packed in a fiberboard shipping container, assembled, closed and reinforced according to the type CF, class weather resistant, variety DW, grade V15c, size 3A of MIL-B-17757. The fiberboard for the liner shall conform to type CF, weather resistant of MIL-B-17757. Level A packages shall be packed flat, six in depth, and alternately reversed top to bottom within a shipping container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Toward the end of the contract, or when there are fewer than the required number per container of the same size, mixed sizes may be packed within the same container.

5.2.2 Level B packing. Six (6), coats of one length and size only, preserved as specified in 5.1, shall be packed in a fiberboard shipping container, assembled, closed and reinforced according to type CF, class domestic, variety DW, grade 275, size 3A of MIL-B-17757. The fiberboard for the liner shall conform to type CF, class domestic of MIL-B-17757. Level A packages shall be packed flat, six in depth, and alternately reversed top to bottom within a shipping container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Toward the end of the contract, or when there are fewer than the required number per container of the same size, mixed sizes may be packed within the same container.

5.2.3 Level C. Coats packaged as specified in 5.1, shall be packed in a manner to ensure carrier acceptance and safe delivery at destination at the lowest transportation rate for such supplies. The quantity per shipping container shall be the same as that normally used by the contractor for retail distribution. Containers shall comply with the US Postal Service Manual, Uniform Freight Classification Rules or National Motor Freight Classification Rules, as applicable.

5.3 Marking. In addition to any special marking required by the contract as applicable, shipping containers shall be marked in accordance with MIL-STD-129.

5.3.1 Polyethylene bagged packages. Polyethylene bagged packages shall have the required information legibly printed or stamped in black directly on the bag across the center face or on a white paper label inserted within the bag so as to permit ready identification. The bag or label shall indicate the following information:

STOCK NUMBER
NOMENCLATURE
SIZE
QUANTITY

5.3.2 Labels, mixed sizes. Each shipping container packed with mixed sizes only, shall have securely attached to the end and side, directy under the printing or stenciling, a white paper label 4 by 5 inches with the words "MIXED NSN'S" plainly stamped or printed thereon, and under these words shall be legibly stamped or printed the correct quantity and national stock numbers contained therein.

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the currentversion before use.

* 5.4 Palletization. When specified (see 6.2), item, packed as specified in 5.2, shall be palletized on a 4-way entry pallet in accordance with load type IA of MIL-STD-147. Each prepared load shall be banded with primary and secondary straps in accordance with the banding means (C,K and L), or O or P. Pallet patterns shall be in accordance with the apendix of MIL-STD-147. The pallet shall be 4-way, Type III, Class 1, Style A, Size 2, wood group I, Grade A of NN-P-71, or 4-way, Style (1,1A or 1B), Size A, Type I, Class 1 of MIL-P-15011. Interlocking of loads shall be effected by reversing the pattern of each course. If the container is of a size which does not conform to any of the patterns specified in MIL-STD-147, the pallet pattern used shall first be approved by the contacting officer.

6. NOTES

6.1 Intended use. The coats are intended for wear by male personnel of the Department of the Navy.

* 6.2 Ordering data. Procurement documents should specify the following:

(a) Title, number, and date of this specification
(b) Length and sizes required (see 1.2).
(c) When first article inspection is required (see 3.2). (When required, the item inspected should be a first article sample. The contracting officer should include specific instructions in acquisition documents regarding arrangements for examinations, quantity, and testing and approval of the first article sample).
(d) When palletization is required (see 5.4).
(e) Level of packaging and packing required (see 5.1 and 5.2).

6.3 Samples. For access to samples of the end item and shade samples, address the procuring activity issuing the invitation for bids.

6.4 Fusing conditions. For optimum results, specific machine setting should be obtained from the contractor furnishing the fusible material.

* 6.5 Changes from previous issue. The margins of this specification are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

* 6.6 Subject term (key word) listing:
Coat, All-Weather, Man's
Raincoat
Liner, Removable
Cloth, Poplin, Water Repellent
Cloth, Pile, Fiber


Custodian:
Navy - NU

Preparing Activity:
Navy - NU

Review Activity:
DLA - CT


Project No.
8405-0056

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

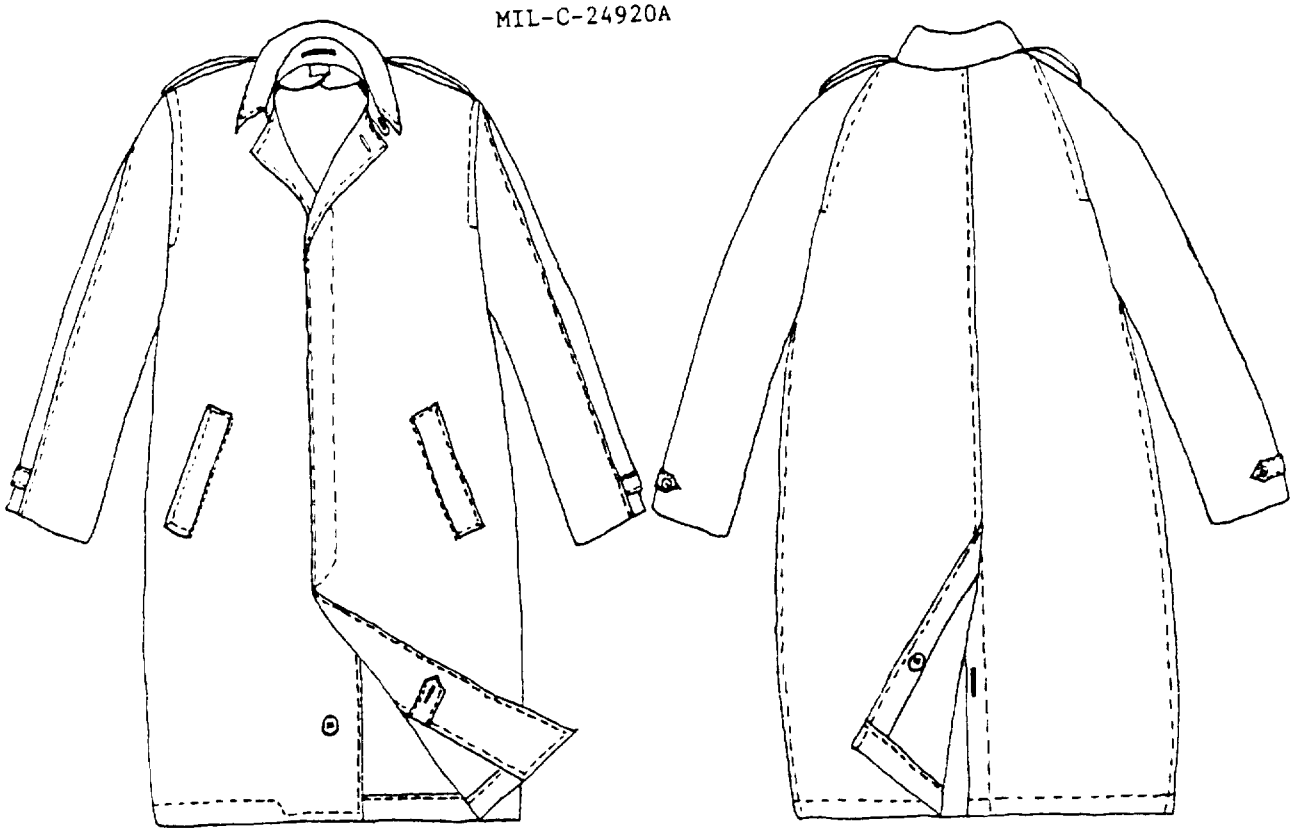

FRONT

BACK

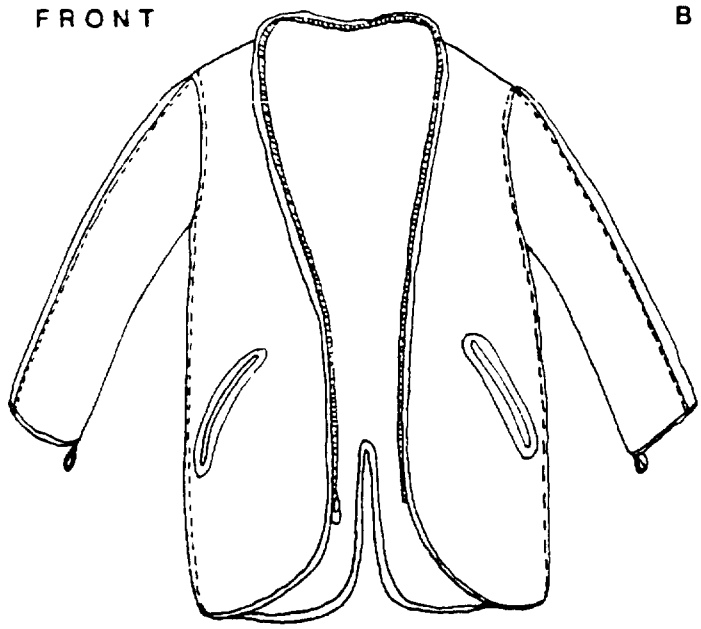

LINER

FIGURE 1 - MAN'S ALL-WEATHER COAT

Source: https://assist.dla.mil -- Downloaded: 202610-20T02:58Z
Check the source to verify that this is the current version before use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

INSTRUCTIONS: In a continuing effort to make our standardization documents better, the DoD provides this form for use in submitting comments and suggestions for improvements. All users of military standardization documents are invited to provide suggestions. This form may be detached, folded along the lines indicated, taped along the loose edge *(DO NOT STAPLE)*, and mailed. In block 5, be as specific as possible about particular problem areas such as wording which required interpretation, was too rigid, restrictive, loose, ambiguous, or was incompatible, and give proposed wording changes which would alleviate the problems. Enter in block 6 any remarks not related to a specific paragraph of the document. If block 7 is filled out, an acknowledgement will be mailed to you within 30 days to let you know that your comments were received and are being considered.

NOTE: This form may not be used to request copies of documents, nor to request waivers, deviations, or clarification of specification requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document*(s)* or to amend contractual requirements.

(Fold along this line)

(Fold along this line)

DEPARTMENT OF THE NAVY

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

BUSINESS REPLY MAIL
FIRST CLASS PERMIT NO. 12503 WASHINGTON D. C.

POSTAGE WILL BE PAID BY THE DEPARTMENT OF THE NAVY

Officer in Charge
Navy Clothing & Textile Research Facility
Code 50
21 Strathmore Road
Natick, MA 01760-2490

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

(See Instructions – Reverse Side)

1. DOCUMENT NUMBER	2. DOCUMENT TITLE
MIL-C-24920A	Coat, All Weather, Man's with Removable Liner

3a. NAME OF SUBMITTING ORGANIZATION	4. TYPE OF ORGANIZATION *(Mark one)*
	☐ VENDOR
	☐ USER
b. ADDRESS *(Street, City, State, ZIP Code)*	☐ MANUFACTURER
	☐ OTHER *(Specify)*: _____

5. PROBLEM AREAS

a. Paragraph Number and Wording:

b. Recommended Wording:

c. Reason/Rationale for Recommendation:

6. REMARKS

7a. NAME OF SUBMITTER *(Last, First, MI)* – Optional	b. WORK TELEPHONE NUMBER *(Include Area Code)* – Optional
c. MAILING ADDRESS *(Street, City, State, ZIP Code)* – Optional	8. DATE OF SUBMISSION *(YYMMDD)*

DD FORM 82 MAR 1426 PREVIOUS EDITION IS OBSOLETE.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T02:58Z
Check the source to verify that this is the current version before use.