INCH POUND

MIL-C-29453B
3 October 1994
SUPERSEDING
MIL-C-29453A(MC)
09 October 1990

MILITARY SPECIFICATION

COAT, WOMAN'S: POLYESTER/WOOL; GABARDINE, BLUE

This specification is approved for use by all departments and agencies of the Department of Defense.

1. SCOPE

1.1 Scope. This specification covers requirements for women's blue gabardine coats.

1.2 Classification. The coats shall be of one type in the following sizes as specified (see 6.2):

Beneficial comments (recommendations, additions, deletions) and any pertinent data which may be of use in improving this document should be addressed to: Defense Personnel Support Center, Clothing and Textiles Directorate, Attn: DPSC-FQSD, 2800 South 20th Street, Philadelphia, PA 19145-5099, by using the Standardization Document Improvement Proposal (DD Form 1426) appearing at the end of this document or by letter.

AMSC N/A FSC 8410

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

Schedule of sizes

Short	Regular	Long
X0	X0	X0
2	2	2
4	4	4
6	6	6
8	8	8
10	10	10
12	12	12
14	14	14
16	16	16
18	18	18

2. APPLICABLE DOCUMENTS

2.1 Government documents

2.1.1 Specifications, standards, and handbooks. The following specifications, standards, and handbooks form a part of this document to the extent specified herein. Unless otherwise specified, the issue of the Department of Defense Index of Specifications and Standards (DoDISS) and supplement thereto, cited in the solicitation

SPECIFICATIONS

FEDERAL

A-A-50067	- Cloth, Flannel, Wool
A-A-50186	- Cloth, Buckram, Woven and Nonwoven
A-A-50196	- Thread, Silk
A-A-50198	- Thread, Gimp, Cotton, Buttonhole
A-A-50199	- Thread, Polyester Core, Cotton or Polyester Covered
A-A-52094	- Thread, Cotton
A-A-52106	- Cloth, Twill or Plain Weave, Polyester or Polyester Blend
V-T-295	- Thread, Nylon
DDD-L-20	- Label, For Clothing, Equipage, and Tentage, (General Use)
DDD-T-86	- Tape, Textile, Cotton, General Purpose (Unbleached, Bleached or Dyed)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

MILITARY

MIL-C-368	- Cloth, Satin, Rayon and Cloth, Twill, Rayon
MIL-B-371	- Braid, Textile, Tubular
MIL-B-3461	- Button, Insignia, Metal, Uniform and Cap
MIL-C-10176	- Cloth, Gabardine, Wool, Polyester and Wool
MIL-P-15064	- Pads, Shoulder and Sleeve Head
MIL-C-15065	- Coat Fronts
MIL-C-16375	- Cloth, Wigan, Cotton
MIL-B-17757	- Box, Shipping, Fiberboard (Modular Sizes)
MIL-C-29405	- Cloth, Broadcloth, Wool, and Wool/Nylon
MIL-C-44192	- Container, Shipping and Storage, Coat (Hanger Pack)
MIL-C-44296	- Cloth, Fusibles

STANDARDS

FEDERAL

FED-STD-191	- Textile Test Methods
FED-STD-751	- Stitches, Seams, and Stitchings

MILITARY

MIL-STD-129	- Marking for Shipment and Storage
MIL-STD-147	- Palletized Unit Loads
MIL-STD-731	- Quality of Wood Members for Containers and Pallets
MIL-STD-984	- Provisions for Size Labeling of Women's Uniform Clothing
MIL-STD-1608	- Provisions for Evaluating Quality of Coats, Women's, Dress

(Unless otherwise indicated, copies of Federal and military specifications, standards and handbooks are available from the Standardization Documents Order Desk, Bldg 4D, 700 Robbins Avenue, Philadelphia, PA 19111-5094).

(Copies of specifications, standards and publications required by contractors in connection with specific acquisition functions should be obtained from the contracting activity or as directed by the contracting officer).

2.2 Non-Government publications. The following document(s) form a part of this specification to the extent specified herein. Unless otherwise specified, the issues of the documents which are DoD-adopted shall be those listed in the issue of the DoDISS cited in the solicitation. Unless otherwise specified, the issues of documents not listed in the DoDISS shall be the issues of the documents cited in the solicitation (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

AMERICAN SOCIETY OF TESTING AND MATERIALS

ASTM D 3951 - Standard Practice for Commercial Packaging

(Application for copies should be addressed to American Society for Testing Materials, 1916 Race Street, Philadelphia, PA 19103).

(Non-Government standards and other publications are normally available from the organizations that prepare or distribute the documents. These documents also may be available in or through libraries or other informational services).

2.3 Order of precedence. In the event of a conflict between the text of this document and the references cited herein, the text of this document shall take precedence. Nothing in this document, however, supersedes applicable laws and regulations unless a specific exemption has been obtained.

3. REQUIREMENTS

3.1 First article. When specified (see 6.2), the contractor shall furnish sample unit(s) for first article inspection and approval (see 4.4 and 6.4).

3.2 Materials

3.2.1 Basic material. The basic material shall be cloth, gabardine, polyester/wool, dark blue shade 2312 (see 6.3), 10.6 ounce, conforming to type II, class 12 of MIL-C-10176.

3.2.2 Lining. The material for lining the coats shall be cloth, rayon, twill, black shade 2604 (see 6.3), 3.7 ounce, conforming to class 1 of MIL-C-368.

3.2.3 Polyester twill. The material for the simulated breast pocket stays, armhole and shoulder seams of the coat shall be cloth conforming to class 2of A-A-52106, except the colorfastness requirements for crocking and perspiration shall not apply.

3.2.4 Undercollar material. The undercollar material shall be cloth, wool flannel, black (see 6.3), conforming to A-A-50067.

3.2.5 Piping. The material for the underply of shoulder straps and piping for the collar and ornamental sleeve pieces shall be cloth, broadcloth, wool, scarlet shade 2501 (see 6.3), conforming to type I or type II of MIL-C-29405.

3.2.6 Collar interlining. The material for interlining the collar shall be cloth, cotton, buckram, natural color, conforming to type I of A-A-50186, except that the test for shrinkage shall be in accordance with method 5580 of FED-STD-191.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

3.2.7 Coat fronts. The coat fronts shall conform to type XIII of MIL-C-15065.

3.2.8 Fusible interlinings

3.2.8.1 Fusible interlinings for small parts. The fusible for the collar ends, sleeve device, top ply of shoulder strap, full front facing, and top pocket welt shall be nonwoven cloth conforming to type V, class 1, style B of MIL-C-44296. The color shall be black or charcoal. The fusible shall be Pellon 8313, Handler 7208 or equal. Fusing conditions shall be as directed by the supplier or temperature 280°- 290°F, 140°- 145°CE, time 12-15 seconds, pressure 4.6 PSI.

3.2.8.2 Fusible coat fronts (alternate). The coat front may be fused using a twill weave woven fusible conforming to type II, class 1, style B of MIL-C-44296 or 100 percent cotton warp, 75-90 percent rayon, 10-25 percent wool, weight minimum 3.5 to 4.0 ounces maximum, polyamide dot, color black or charcoal. The fusible shall be Kufner Style G35 or National Style 200FL or Crown Style 241 or equal. The fusing conditions shall be as directed by the supplier or as follows: 300°- 310°F, 150°- 155°CE temperature, 12-15 seconds time, 4-5 PSI pressure.

3.2.9 Shoulder pads. The shoulder pads shall conform to type III, class 1 of MIL-P-15064.

3.2.10 Sleeve head pads. The sleeve head pads shall conform to type IV of MIL-P-15064.

3.2.11 Tape, cotton. The cotton tape shall conform to type III, class 1 of DDD-T-86, 1/4-inch wide for reinforcing the folded edge of the simulated pocket welt and armholes and 3/8-inch wide for the front edge of the coat and the bridle tape.

3.2.12 Bias binding. The binding for the underarm shields shall be bias cut out of the lining material specified in 3.2.2. The binding shall be cut 5/8 to 7/8 inch wide and shall have sized edges.

3.2.13 Wigan. The material for reinforcing the bottom edge of the sleeves shall be cloth, cotton, wigan, 2.5 ounces, conforming to type I of MIL-C-16375.

3.2.14 Hanger braid. The braid for the coat hanger shall be cotton or rayon tubular flat braid 1/8 to 3/16 inch wide, minimum breaking strength 50 pounds, color black conforming to type IX, class 1 of MIL-B-371.

3.2.15 Thread

3.3.15.1 Silk. The silk thread shall conform to A-A-50196; machine sewing, type I, size A, 3-ply for all outside seaming and stitching; machine felling, size 0, 3 ply and hand sewing, type III, size A.

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

3.2.15.2 Cotton. The cotton thread shall conform to A-A-52094, type III, mercerized finish, ticket No. A, 3-ply for all inside seaming and stitching; type II, glazed finish, ticket No. 24, 4-ply for sewing on buttons and type I, ticket No. 30, 3-ply for machine tacking armholes. The thread for basting shall be a good commercial grade. As an alternate, a polyester core, cotton-covered thread conforming to A-A-50199, ticket No. 50, 2-ply or ticket No. 70, 2-ply may be used.

3.2.15.3 Nylon. The nylon thread for padding lapels of coats shall conform to type III, size 00 of V-T-295.

3.2.15.4 Synthetic. A monofilament synthetic thread may be used for those basting operations where the thread is required to be removed, provided the garment is subsequently given a treatment by a dry cleaning agent in which the synthetic thread is soluble. When this thread is used, any residue remaining on the garment after the dry cleaning process shall be brushed off or removed.

3.2.15.5 Color and colorfastness. All thread shall be black AA Cable No. 66043 (See DoD Standard Shades for Sewing Threads), except cotton thread for basting and for machine tacking armholes, which may be white. The colored threads, when tested as specified in the applicable thread specification, shall show good colorfastness to wet (dry) cleaning. In addition, the silk thread shall show good colorfastness to light.

3.2.16 Gimp. The buttonhole gimp shall be cotton, No. 8, soft or glazed finish, conforming to type I or II of A-A-50198. The color of the gimp shall be black AA Cable No. 66043 showing good colorfastness to wet (dry) cleaning.

3.2.17 Insignia buttons and ring fasteners. The insignia buttons for coats shall be metal, gold-plated, 27-line and 40-line, conforming to MIL-B-3461, type I, style 3, class A, subclass 1. Ring fasteners for attaching buttons to ornamental sleeve pieces shall conform to MIL-B-3461.

3.2.18 Labels. Each coat shall have an identification label and a size label as follows. The coats are intended to be dry cleaned and the labels shall show colorfastness to dry cleaning.

3.2.18.1 Identification label. The identification label shall conform to type VI, class 1 of DDD-L-20. The content and format shall be as follows:

Dry clean only
Nomenclature (item description)
Contract number
Name of contractor
Fiber content

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

3.2.18.2 Size label. The size label shall conform to type VI, class 2 of DDD-L-20. The inscription on the size label shall conform to MIL-STD-984; Table II Body Dimensions for U. S. Marine Corps, Table III Height Ranges and Figure 2. Example as follows:

Stock Number:	8410-00-000-0000
Bust Circ:	35 inches
Hip Circ:	37-1/2 inches
Height:	63-1/2 to 67-1/2 (R) inches (Size Code 12)

3.2.18.3 Label/tag. Each item shall be individually bar-coded with the type VIII, class 17 label/tag of DDD-L-20. This label/tag shall be located so that it is completely visible on the item when it is folded and/or packaged as specified and so that it causes no damage to the item.

3.3 Design. The coats shall be the U. S. Marine Corps design shown in Figures 1 and 2, a four-button, single-breasted, semi-formfitting, fully-lined coat having a panel-type front, a four-piece back with center vent, an outside simulated breast pocket with outside welt, an inside pocket, shoulder straps to button, ornamental sleeve piece at bottom of sleeve, a worked eyelet in each collar end, and a notched collar and lapels. The collar, shoulder straps and ornamental sleeve pieces shall be piped with scarlet wool broadcloth.

3.4 Patterns. Standard patterns will be furnished to the contractor by the Government. The standard patterns shall not be altered in any way and shall be used only as a guide for cutting the contractor's working pattern. The standard patterns shall provide 3/16-inch allowance for seams at top (step) and front edges of lapels and front edges of coat; 1/8-inch allowance for shoulder straps and collar; 3/4-inch allowance for side seams; 5/8-inch allowance for center back seaming; and 3/8-inch allowance for all other seams. Standard patterns show size, seam allowances, warp directional lines for cutting, and are marked or notched for proper cutting, placement and assembly of the component parts. Also, minor modifications are permitted where necessary when using automatic equipment. These modifications shall not alter the dimensional, serviceability, or appearance requirements cited in the specification.

3.4.1 List of pattern parts. Coats shall be cut from the materials specified herein in accordance with the number of pattern parts indicated below:

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE 1. Pattern parts

Item	Pattern Nomenclature	No. of cut parts
	Material: Cloth, Wool, Gabardine	
1.	Front	2
2.	Side front	2
3.	Side back	2
4.	Center back	2
5.	Front facing (right)	1
6.	Front facing (left)	1
7.	Top sleeve	2
8.	Under sleeve	2
9.	Top collar	1
10.	Top collarstand	1
11.	Ornamental sleeve pieces	2
12.	Pocket welt	1
13.	Shoulder strap (top ply)	2
14.	Underarm shield	2
	Material: Cloth, Rayon Lining	
15.	Front	2
16.	Right center back	1
17.	Left center back	1
18.	Side back	2
19.	Top sleeve	2
20.	Under sleeve	2
	Material: Cloth, Wool Flannel	
21.	Undercollar	1
	Material: Cloth, Buckram, Cotton	
22.	Undercollar interlining	1
	Material: Cloth, Cotton, Wigan	
23.	Sleeve bottom reinforcement	2
	Material: Cloth, Polyester Twill	
24.	Breast Welt, Pocket Stay	1
25.	Inside Pocket	2
	Material: Cloth, Broadcloth, Wool Scarlet	
26.	Shoulder strap (under ply)	2
	Marker	
27.	Sleeve turnup and ornamental sleeve	
28.	Breast pocket welt	
29.	Collarstand	
30.	Right Front	
	Shaper	
31.	Top Collar (shaper)	
32.	Lapel shaper (working)	
33.	Undercollar (shaper)	
34.	Finished Collar and lapel (shaper)	
35.	Left vent (shaper)	

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:14Z
Check the source to verify that this is the current version before use.

3.5 Construction. The coats shall be manufactured in accordance with the operations and the stitch, seam and stitching types specified in Table II. The supplier is not required to follow the exact sequence of the operations as listed in Table II, but all operations specified shall be used to manufacture the coats.

3.5.1 Stitches, seams and stitchings. The stitch, seam and stitching types specified in Table II shall conform to FED-STD-751. The number of stitches per inch as specified in Table II indicates the minimum and maximum number permitted.

3.5.1.1 Thread breaks and ends of seams. Ends of seams and stitching produced with 301 stitch type, when not caught in other seams or stitching, shall be backtacked not less than 1/4 inch. Thread breaks (all stitch types) shall be secured by stitching back of break not less than 1/2 inch. Ends of a continuous line of stitching shall overlap not less than 1/2 inch except on the identification label.

3.5.2 Shade marking. The component parts of each coat, cut from one piece of basic material and lining material, including pairs of sleeve linings when cut from ends, shall be shade marked to insure a uniform shade and size. Any method of shade marking may be used except:

(a) Corrosive metal fastening devices
(b) Adhesive type tickets which show discoloration or the use of an adhesive mass which adheres to the material upon removal of the tickets
(c) Sew-on shade tickets

3.6 Abbreviations in Table of Operations. The abbreviations used in Table II are as follows:

Stch	-	Stitch
In	-	Inch
Ndl	-	Needle
Bob	-	Bobbin
Lpr	-	Looper
Mchne	-	Machine
Brtck	-	Bartack
Comrcl	-	Commercial
Smlr	-	Similar
Btn	-	Button
Btnhl	-	Buttonhole
Incl	-	Including
Dbl	-	Double

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
1.	Cutting. a. Cut the coats in strict accordance with patterns furnished by the Government. b. Cut all material in the direction indicated by the directional lines on the pattern. The directional lines shall be placed in the warp direction of the cloth unless otherwise indicated on the pattern. c. All parts of the coat shall be cut from the same piece of basic material, except underarm shields may be cut from ends. When underarm shields are cut from ends, the shields shall match each other. d. The body lining of the coat shall be cut from one piece of rayon lining material. All other rayon parts may be cut from ends. When pairs of sleeve linings are cut from ends, the shade of the lining in each pair shall match. e. The polyester twill stay for the simulated breast pocket shall be cut in accordance with the patterns furnished. Cut polyester twill stays for armhole and shoulder seam on the bias, 3/4 inch wide and 4 to 4-1/2 inches long. f. The wigan for the bottom edge of the sleeves shall be cut on the bias in accordance with the pattern furnished. g. Cut the undercollar from undercollar material, and in accordance with the pattern furnished.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
1.	Cutting. (contd.) h. The interlining for the collar shall be cut on the bias in accordance with the pattern furnished. The stays for the insignia buttons attached to the ornamental sleeve piece shall be 3/4 inch square pieces and may be cut from ends. i. The scarlet wool broadcloth for piping the edges of the collar, and ornamental sleeve pieces shall be cut in warp direction, 3/4 inch wide. The underply of the shoulder strap shall be cut in accordance with the pattern furnished. j. The use of drill holes is prohibited. k. The right front shall be dressed in front shaping operations only. (See operation 36.)					
2.	Replacement of damaged parts. a. Replace, at time of cutting, any parts of the coat containing holes, seriously weakening defects such as smashes, multiple floats, loose weakening slubs, etc., expected to develop into holes, shade bars and dye streaks or unslightly slubs, etc. b. Replace any parts damaged during the manufacturing process by needle chews which may develop in to holes, scissors or knife cuts, tears, holes, mends or burns in the material.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
3.	Shade marking. a. Mark or ticket (see 3.6.2) all component parts cut from one piece of basic and lining materials or the lining material can be bundled. b. The use of tickets with any metal fastening devices or sew-on shade tickets is prohibited on the rayon lining.					
4	Make shoulder straps. Finished appearance. The shoulder strap shall be pulled uniformly stitched and shall finish smooth and flat, without twists, gathers or puckers. The buttonhole shall be clean cut, well made, properly positioned, well worked over gimp to fit a 27-line insignia button and the stitching shall be securely caught in the basic material. The gimp shall be through to the underside of the buttonholes and the purling of the buttonholes shall be on the outside of the straps. On the finished coat, the straps, including the scarlet edging, shall measure 2-3/8 ± 1/8 inches wide. a. The shoulder straps shall be made of one ply of basic material and one ply of cloth, broadcloth, wool scarlet. b. Position top ply and underply face to face with edges even. Stitch together 3/16 inch from the edge at front, back and collar end and evenly trim the edges of the strap for proper turning.	301	SSe-2 (a)	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
4.	Make shoulder straps. (contd.)					
	c. Turn the strap, working out the seams and extending the edge of the underply 1/8 inch beyond the edge of the top ply. Top stitch the top ply to the underply uniformly 3/16 inch from the folded edge of the underply.	301	BSm-2 (a)	10-14	A (Silk)	A
	d. Press the strap smooth and flat with a heated pressing iron or pressing machine. OR: Shoulder strap may be constructed with 2 plys of straps with piping.					
e.	Make a horizontal eyelet-end, square-bar-type, cut first buttonhole, 3/4 inch long, in each strap midway between the back and front edges, with the inside edge of the eyelet placed so that in the finished coat, the edge of the shoulder strap button will be 1/4 to 1/2 inch from the edge of the collar. The purling shall finish on the outside of the strap.	Buttonhole		38 per buttonhole (minimum) not including bartack		
	f. The buttonhole shall be well worked over gimp and the ends of the gimp shall be pulled through to the underside.					
	g. Securely bartack the ends of the buttonholes and trim the ends of the thread and gimp.	Bartack		21 per bartack (minimum)	A	A
5.	Make undercollar.					
	Finished appearance. On the finished collar, the piping shall extend uniformly and evenly 1/8 inch beyond the side and top edges.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
5.	Make undercollar. (contd.)					
	a. The undercollar assembly shall consist of one piece of under-collar cloth and a single piece of interlining material.					
	b. Position the interlining to the undercollar with the bottom even and pad the interlining to the undercollar with 6 or 7 rows of blindstitching.	301	SSm-1- (each row)	4- 6	A	A
	c. Mark and trim undercollar in accordance with undercollar shaper. shaper. Trim interlining 1/8 to 3/16 inch at bottom, top and ends of undercollar.					
	d. Mark breakline on the under-collar with the collarstand marker and stitch through both plies. The breakline stitching shall measure 1-1/8 inches at the center of the undercollar.	301	SSa-1	10-14	A	A
6.	Assemble top collar and under-collar.					
	Finished appearance. On the finished coat, the collar shall be 2-7/8 ± 1/8 inches wide, including the piping, at the center back.					
	a. Position collarstand on top collar, face to face, with notches matching. Stitch collarstand to top collar, with 1/4-inch seam.	301	SSz-3 (a)	10-14	A	A
	b. Spread open the seam and top-stitch the collarstand and top collar, respectively, 1/16 inch from seamline.	301	SSz-3 (b)	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 20261-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
6.	Assemble top collar and under-collar. (contd.)					
	c. Place top collar shaper on the joining seam of top collar and collarstand and mark and trim in accordance with top collar shaper.					
	d. Position the 3/4-inch-wide strip of scarlet piping on the outside of the top collar with one edge even with the upper and side edges of collar. Stitch the piping to collar 1/8 inch from upper and side edges of the collar.	301	SSa-1	10-14	A	A
	e. Turn the piping to the inside, working out the points, and top-stitch uniformly 3/16 inch from the folded edge of piping, catching the turned under portion in the stitching. The piping shall finish 1/8 inch beyond the edges of the collar. Notch out the excess piping at each end.	301	SSe-2 (b)	10-14	A	A
	f. In order to retain the proper shape in accordance with the pattern, press the top collar smooth and flat with a heated pressing iron or pressing machine.					
	g. Mark notches on the underside of top collar marker for proper position of undercollar.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
6.	Assemble top collar and under-collar. (contd.)					
	h. Position the undercollar to the underside of the top collar with marks on the undercollar and top collar matching, and with the upper edge and each end of the undercollar in line with the stitching line of scarlet piping. Baste the undercollar to the top collar along the piped edges.	101	SSa-1	4- 6	A	A
	i. Fell raw edge of the under-collar to the scarlet piping on each end of the collar, and con-tinue to fell along the upper edge of entire length of collar.	Hand		8-10	A (Silk)	
	j. Press the collar smooth and flat with a heated pressing iron or pressing machine.					
	k. Trim the gorge and neck edge of top collar to provide for prop-er seaming to the coat, and cut a guide notch in the lower neck edge of top collarstand at center.					
	l. Make one eyelet at each end of the collar with center of eyelet 1 inch from the end and outer edge, respectively. The eyelet shall be well worked with the purling on either side of the collar, and shall finish with a 1/8 inch di-ameter opening.	Eyelet		20 per eyelet minimum	A (Silk) -or- 0 (Silk)	A 0

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL BOB/ LPR
7.	Make ornamental sleeve pieces. Finished appearance. The piping shall be uniformly stitched to the ornamental sleeve pieces without twists, gathers, puckers, or pleats. The ornamental pieces shall finish smooth and flat and shall be uniform in appearance. The position of insignia buttons shall be in accordance with the marks on the pattern. a. The ornamental sleeve pieces shall be made of one ply of basic material, piped with a 3/4-inch wide strip (unhemmed) of scarlet wool broadcloth.				
	b. Seam a 3/4-inch-wide strip of scarlet piping to the ornamental sleeve pieces 1/8 inch from the top, the scalloped side, and the bottom edges.	301	SSe-2 (a)	10-14	A A or A A (Silk)
	c. Fold the scarlet piping, slightly offsetting the raw edge, and seam edges as above.	301	SSav-2 (a)	10-14	A A or A A (Silk)
	d. Turn back the sleeve pieces and the scarlet piping at the seamed edges, uniformly working the folded edge of the piping 1/8 inch beyond the edges of the sleeve edges. Notch excess scarlet material at the top and lower points of ornamental pieces in order to reduce bulkiness. Topstitch the sleeve pieces uniformly 3/16 inch from the folded edge of the piping.	301	BSm-2	10-14	A A (Silk)

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
7.	Make ornamental sleeve pieces. (contd.) e. Press ornamental sleeve pieces smooth and flat with a heated pressing iron or pressing machine. Sleeve pieces shall be uniform in shape and size. f. Mark the edge of sleeve piece 1/4 inch from raw edge for seaming to sleeve. Mark location for insignia buttons as indicated by marks on the pattern. Assemble sleeve pieces in pairs. g. Punch a hole through the sleeve piece at each mark for attaching 27-line insignia buttons. h. Insert the shank of a 27-line insignia button through each hole and the stay piece and secure buttons to sleeve with ring toggle.					
8.	Seam sleeve at forearm. Finished appearance. The forearm seam shall finish smooth and flat without twists, gathers, puckers, or pleats, and shall start and finish evenly at seamline. a. Position the top and under sleeve with notches matching and join at the forearm with a 3/8-inch seam. b. Spread open the seam and press flat with a heated pressing iron. c. With pattern marker, mark sleeve for turnup and top sleeve for position of the ornamental sleeve piece.	301 or 401	SSa-1	12-16	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
9.	Baste wigan reinforcement to sleeve.					
	a. Position the sleeve on the wigan reinforcement piece with the notches on the ends of the wigan in line with the turnup notches on the sleeve.					
	b. Tack the sleeve to the reinforcement piece along the forearm seam allowance, and along the backarm edges of the top and under sleeve.	101		8-12	A	A
		or 301		8-12	A	A
	c. Baste sleeve and reinforcement piece together at the mark for the bottom turnup.	101	SSa-1-	6- 8	A	A
10.	Join ornamental sleeve piece to sleeve.					
	Finished appearance. The ornamental sleeve piece shall be uniformly stitched to the sleeve without twists, gathers, puckers, or pleats, and shall finish smooth, flat and without raw edges. The position of the ornamental sleeve piece shall be as shown on Figures 1 and 2.					
	a. Position the ornamental sleeve piece, face-to-face, on the top sleeve with marks on sleeve piece and sleeve matching, and the bottom edge of the sleeve piece aligned with the marked bottom turnup line. The bottom edge of the sleeve piece shall be even with the finished bottom edge of the sleeve.					
	b. Seam the ornamental sleeve piece to the sleeve on the mark, backtacking the sleeve piece no more than once for a distance of 3/8 to 1/2 inch at each end of stitching.	301	LSbj-1	10-14	A	A (Silk)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
11.	Seam sleeves at backarm. (contd.)					
	c. Turn the ornamental sleeve piece flat on the top sleeve and topstitch 3/16 inch from piped top, bottom and scalloped peaks, leaving two openings on scalloped back to remove and replace buttons.	314	SSa-1	10-14	A	A
11.	Seam sleeves at backarm.					
	Finished appearance. The backarm seam shall finish smooth and flat without twists, gathers, puckers, or pleats and shall start and finish evenly at seam line.					
	Join the top and under sleeve together at the backarm with a 3/8-inch seam, catching the ends of the wigan reinforcement piece in the stitching.	301 or 401	SSa-1	10-14	A	A
	b. Spread open the seam and press smooth and flat with a heated pressing iron.					
	c. Turn up the bottom of the sleeve at the mark and tack the raw edge to the reinforcement piece with blind stitching. The basic material shall not be caught in the stitching.	306 or 313 or 103	EFc-1	4-6	A A	A A
12.	Seam sleeve linings.					
	Finished appearance. The sleeve lining shall be uniform in appearance, uniformly stitched, and shall finish smooth and flat without twists, gathers, puckers, or pleats. The seams shall start and finish evenly at seam line.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
12.	Seam sleeve linings. (contd.)					
	a. Position the top and under sleeve lining in accordance with notches on the pattern and join the forearm and backarm respectively with 3/8 inch seams.	301 or 401	SSbd-1 or SSa-1	10-14	A	A
13.	Assemble sleeve and sleeve lining.					
	Finished appearance. The sleeve lining shall be positioned and seamed, or tacked, to sleeve without twists, gathers, puckers, or pleats.					
	a. Position the sleeve lining on the sleeve with the upper edge of lining extending 3/4 to 1 inch beyond the armhole edge of sleeve.					
	b. Seam or tack the forearm and backarm seam allowances to the corresponding seam allowance to top sleeve with the sleeve lines aligned, commencing at the top edge of wigan reinforcement piece and extending to approximately midway to the armhole edge at the forearm and backarm. The fullness in the lining shall be evenly distributed.	301	SSa-1	4- 6	A	A
		or Hand	SSa-1	4- 6	A	A
	c. Turn sleeve lining over the sleeve.					
14.	Fell turnup of sleeve lining; press sleeves.					
	Finished appearance. The sleeve linings shall not be short, tight or twisted.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
14.	Fell turnup of sleeve lining; press sleeves. (contd.)					
	a. Turn under the bottom edge of sleeve lining to finish 1 to 1-1/4 inches above the finished bottom edge of sleeve, and baste to turn-up of sleeve.	101 or Hand				
	b. Fell the folded edge of sleeve lining to turnup of sleeve with blindstitching. The stitching shall not show on face cloth of sleeves.	314 or Hand	SSm-1	6- 8 8-10	0 A (Silk)	0 (Silk)
	c. Turn sleeves right side out and assemble in pairs. Insert a sleeve pad in the sleeve to avoid creasing the front and back edges, and press smooth and flat with a heated pressing machine.					
15.	Make welt.					
	Finished appearance. The welt shall be uniformly stitched and shall finish smooth and flat without twists, gathers, puckers, or pleats or raw edges.					
	a. The welt for the simulated breast pocket shall be made of a single piece of basic material folded in accordance with notches and reinforced at the inside folded edge with 1/4-inch-wide cotton tape.					
	b. Position the tape on the underside of the welt piece with one edge even with the fold notches and seam 1/16 inch from the edge of the tape next to the fold line.	301	LSbj-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
15.	Make welt. (contd.)					
	c. Fold the welt at the fold notches with the tape on the outside and close the ends with a 1/4 inch seam. Trim the corners of welt for proper turning.	301	SSa-1	10-14	A	A
	d. Turn the welt to the right side, working out the edges and corners completely. Edgestitch the welt uniformly 1/8 inch from seamed and folded edges.	301	SSe-2 (Seamed edges) OSf-1 (Folded edges)	10-14	A	A (Silk)
	e. Press the welt smooth and flat with a heated pressing iron or pressing machine.					
16.	Make underarm shields.					
	Finished appearance. The underarm shields shall be made from one ply of basic material and shall finish smooth and flat without puckers, gathers, pleats or raw edges and shall be uniform in size and shape.					
	a. Bind the rounded edge of the underarm shield with bias binding, turning under the outside raw edge of the binding only and catching the turned under portion in the stitching 1/16 inch from folded edge.	301	BSb-1	10-14	A	A
17.	Fold and stitch darts in front lining.					
	Finished appearance. The dart shall be tapered to a point at upper and lower ends.					
	a. Sew the darts with a 3/8 inch seam, tapering the dart to a point at the upper ends, and securely backtack.	301 or 401	OSf-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
18.	Make inside pocket.					
	Finished appearance. The pocket shall be uniformly stitched and finish smooth and flat without causing distortion.					
	a. The pocket shall be made of 2 plies of polyester/twill material 5 inches wide by 6-1/2 inches long.					
	b. Position both plies of pocketing material face to face with notches matching and stitching together from the top notch across the top, back, bottom and up the front to the bottom notch with a 3/8 inch seam leaving a 4-1/2 inch opening for the pocket.	301	SSa-1	10-14	A	A
	c. The notch for placing the inside pocket shall be in line with the third buttonhole from the top. Attach the front pocket openings in accordance with the notches to the right front facing and the right front lining respectively with a 3/8-inch seam leaving a 4-1/2 inch pocket opening.	301	SSa-1	10-14	A	A
	d. Raise stitch the pocket material onto the facing and lining respectively with a 1/16 inch topstitch.	301	SSc-1	10-14	A	A
19.	Seam front lining to facing and sew on label.					
	Finished appearance. The lining shall be carefully seamed to the facing so that in the finished coat, the lining shall be smooth and flat along the facing without creases, bulges, overlapping of excess material, or other defects or distortion.					

Source: https://assist.dla.mil -- Downloaded: 2026-04-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
19.	Seam front lining to facing and sew on label. (cont'd.)					
	a. Position the lining on the facing, with notches matching, and seam the front edge of the lining to the back edge of the facing 3/8 inch from the edge. The stitching shall extend from top (shoulder) edge of facing to approximately 1-1/4 inches from the bottom edge.	301 or 401	SSa-1	10-14	A	A
	b. Sew the identification label to the left front lining with a single row of stitching 1/16 inch from each edge of the label. The label shall be positioned horizontally with one end adjacent to the facing-lining joing seam and the lower edge of label approximately 3 inches above the bottom edge of the coat. The ends of the label stitching shall overlap not less than three stitches.	301	SSbj-1	10-14	A	A
20.	Press front lining seams and darts.					
	a. Press the facing-lining joining seams and waist darts smooth and flat with a heated pressing iron or pressing machine.					
	b. The facing-lining joining seam shall be pressed with the raw edge of the seam allowance toward the back. The waist darts shall be pressed with the folded edge towards the front.					
21.	Join back lining parts.					
	Finished appearance. Back linings shall be carefully joined without pleats, puckers or gathers. The seam shall start and finish evenly at seam line.					

Source: https://assist.dla.mil - Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
21.	Join back lining parts. (contd.)					
	a. Position back linings with notches matching and join together at the center with a 3/8 inch seam, stopping at the top of the vent.	301 or 401	SSa-1	10-14	A	A
	b. Position left and right side back linings to the respective center back linings, matching notches and join with a 3/8 inch seam.	301	SSa-1	10-14	A	A
22.	Join back and front linings. (See Figure 3)					
	Finished appearance. The linings shall be carefully joined without pleats, puckers or gathers. The seam shall start and finish evenly at seam line.					
	a. Position the back and front linings together and join at the sides with a 3/4 inch seam.	301	SSa-1	10-14	A	A
23.	Press lining seams and darts.					
	a. Press the side and back seams and the waist darts smooth and flat with a heated pressing iron or pressing machine.					
	b. The facing-lining joining seams, side seams and left and right back seams shall be pressed with the raw edges of the seam allowance toward the back. The lining shall be folded face-to-face along the center back seam and the seam pressed flat. The waist darts shall be pressed with the folded edge towards the back. Fold back and press flat the facing and lining seam allowance of the unstitched portion of the lining facing joining seam at the bottom edge.					

Source: https://assist.dla.mil -- Downloaded: 20261020T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
24.	Join backs. Finished appearance. The side and center backs shall be joined without gathers, puckers or pleats. The folded edge of the left vent shall be in vertical line with the center back seam. In the finished coat, the left center back shall overlap the right center back.					
	a. Stitch the 1/4-inch-wide stay tape to the inside of left center back along the vent, with the edge of the tape positioned approximately 1/8 inch in front of the fold notch of the vent.	301	SSaa-1	10-14	A	A
	b. Position the center backs with edges even and join with a 5/8-inch seam from the top edge of the backs to approximately 3/4 inch below top end of the vent, and from that point continue to stitch diagonally across the top end of the vent.	301	SSaa-1	10-14	A	A
	c. Turn the left vent to the inside of the left center back, in accordance with the notches, and edge stitch uniformly 1/8 inch from the folded edge. The folded edge of vent shall be in line with the center back seam line.	301	OSf-1	10-14	A	A
	d. Join the left and right side backs to the respective center backs with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	e. Seam the 3/4 inch wide polyester twill stay to the underside of the back neckline 1/8 inch from the outer edge of neckline.	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
25.	Press back seams.					
	a. The side and center back seams shall be pressed with a heated pressing iron or pressing machine.					
	b. Notch the top end of the right vent diagonally from the juncture point of the vent and the center seam allowance of the right center back to the lower end of the stitching for the center back seam.					
26.	Topstitch top end of vent.					
	Finished appearance. The edge of right side of vent shall extend beyond the center seam allowance of the left back part.					
	a. Stitch and backstitch across the top end of vent through all plies from the back center seam to the edge of vent for a distance of 1 inch.	301	SSa-1	10-14	A (Silk)	A
27.	Join front and side front.					
	Finished appearance. Bust lines on both sides shall be alike. Fronts and side fronts shall be carefully joined without puckers or gathers. The seams shall start and finish evenly at the seam line. The contour of the waist and hip line shall be maintained in the seaming.					
	a. Fold side front with cut out edges even, and stitch waist dart in accordance with marks indicated on the pattern, tapering the upper end to a flat point. Points shall be securely backtacked. Stitching shall be 3/8 inch from cut edge at the center.	301	OSf-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
27.	Join front and side front. (contd.)					
	b. Position fronts and side fronts with notches matching and join together with 3/8 inch seams.	301 or 401	SSa-1	10-14	A	A
	c. Spread open the front seam and waist darts and press flat with a heated pressing iron, maintaining contour.	301	SSaa-1	10-14	A	A
	d. Tape gorge line on underside with 1/4 inch tape from shoulder to 1/4 inch below top of lapel.	301	SSaa-1	10-14	A	A
28.	Seam reinforcement stay to armhole and shoulder.					
	Finished appearance. The twill stays shall be sewn to the armhole and shoulder edges of the fronts without gathers, puckers, or pleats. The top end of the armhole hole stay and lower edge of the shoulder stay shall form a right angle at the armhole without the stays overlapping each other.					
	a. Seam the 3/4-inch-wide twill stays to the underside of each front along the shoulder and upper front edges of the armhole, respectively, 1/8 inch from the outer edge. The top end of the armhole stay shall form a right angle at the upper end of armhole without the stays overlapping each other.	301	SSaa-1	10-14	A	A

Source: https://assist.dla.mil - Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
29.	Assemble simulated breast pocket on left front. Finished appearance. The simulated breast pocket shall be smooth and flat with the ends of the welt uniformly stitched and with no puckering. In the finished garment, the breast pocket welt shall be horizontal with the bottom edge of coat. a. Mark the left front in accordance with breast pocket marker for position of breast pocket welt. Mark welt seam line on the underside 1 inch from folded edge for proper seaming to front.					
	b. Position the twill stay piece for the pocket on the underside of the front. Position the welt on the outside of the left front, with marks on welt and front matching and with folded edge of welt towards the bottom edge of coat. Seam top ply of welt to the front at the mark through the stay piece.	301	LSbj-1	10-14	A	A
	c. Turn the welt with the folded edge of welt towards top of front. Top stitch both ends of the welt to the front, 1/8 to 1/16 inch from the seamed edge of welt. The line of stitching shall extend from the lower seamed line of the welt up to the folded edge of welt. The welt shall be blindstitched to the body of the coat and the stitching shall not be visible on the outside of the welt.	301	SSe-2	10-14	A (Silk)	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
29.	Assemble simulated breast pocket on left front. (contd.) d. On the outside of the finished coat, the welt for the simulated pocket shall measure 1 ± 1/16 inch in height, and the width for each size coat, measured along top edge of welt, shall be as follows: Coat size — Width of Welt (inches) XO through 10 — 3-1/2 12 through 18 — 4					
30.	Join fronts and back at side. Finished appearance. The fronts and side backs shall be joined together without puckers or pleats. The seams shall start and finish evenly at seam line. The contour of the waist and hip line shall be maintained in the seaming.					
	a. Position side fronts to the side backs at the sides and join with a 3/4-inch seam.	301	SSa-1	10-1	A	A
31.	Press side seam. a. Spread open the side seams and press flat with a heated pressing iron.					
32.	Tape armholes. a. Sew the 1/4-inch-wide stay tape to the inside of coat at the lower edge of the armhole, starting from approximately 1-1/2 inches above the notch in the fronts and continue to the side seam.	301	SSaa-1	10-1	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
32.	Tape armholes. Cut the tape and continue stitching along bottom and back edge to lower notch. Holding tape taut, continue to stitch tape to back armhole to 1-1/4 inches from the shoulder. b. Press armhole tapes and shoulder blade smooth and flat with a heated pressing iron.					
33.	Interline fronts. a. Position the left and right fronts on the respective coat front interlining and baste along the front seams, properly distributing the fullness over the breast area. The basting shall extend from approximately 3 inches from the shoulder edge of fronts to approximately 1-1/2 inches from the bottom edge.	101 Hopper				
	b. Baste the left front along the welt-joining seam line on the outside, with the front and interlining lying smooth and flat.	101 Hopper				
	c. Tack the front and back ends of the simulated pocket stay to the coat front interlining. The tacking shall be as close as possible to the corners of the pocket.	101 Hopper or Hand				
	d. Baste horizontally along the shoulder, allowing room for setting shoulder pads and working the fullness on the front towards the armhole. Baste along the front of armhole approximately 1-1/2 inches from the edge and continue to baste down the back edge of interlining to approximately 1-1/2 inches from the bottom edge of front.	101 Hopper				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
33.	Interline fronts. (contd.)					
	e. Baste along the breakline of lapel, starting at the gorge, and continue basting along the front edge below the breakline to approximately 1-1/2 inches from the bottom edge of front.	101 Hopper				
	f. Baste along the top and front edge of lapel down to the lower end of lapel.					
34.	Baste bridle tape to lapel.					
	a. Position the 3/8-inch-wide bridle tape on the interlining side of the fronts along the breakline of lapel, with the front edge of the tape in line with notch in the gorge.					
	b. Baste tape through the interlining and the front of coat along the breakline of lapel evenly and smoothly, holding the tape taut and properly distributing the fullness. The tape shall extend from the gorge notch to approximately 1-1/2 inches from the lower edge of lapel.	101 Hopper		6- 8		
35.	Pad lapels.					
	a. Pad the lapels with seven to eight rows of blindstitching, from approximately 3/4 inch from front edge to the breakline, properly distributing the fullness of the interlining between the rows of stitching to roll the lapels.	103 or	SSm-7- or 8	4-8	A or 00	
		314	SSm-7 or 8	4-8	A or 00	A 00
	b. Blindstitch both edges of bridle tape to interlining.	103 or	SSm-2	4-8	A or 00	
		315	SSm-2	4-8	A or 00	A

Source: https://assist.dla.mil - Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
36.	Press chest and lapels. a. Roll press the lapels, shrinking to eliminate the fullness from the interlining, on a suitable type heated pressing machine. b. Press the fronts individually on a suitable type heated pressing machine to conform to the shape of the body and eliminate excess fullness in the breast.					
37.	Shape fronts. a. Mark and shape the front edge of the coat. Mark and shape the lapels in accordance with the shaper furnished. The right front edge shall be dressed from the bottom notch to base of the lapel, using the right front marker. b. Mark the coat 1-1/4 inches from the bottom edge for the bottom turnup. c. Trim the coat front interlining 1/4 inch back from the front edge of the fronts and top edge of the lapel. Trim bottom of interlining to approximately 1/4 inch above the mark for the bottom turnup. d. On the finished coat, the top edge of the lapel shall be 1-1/2 $\pm$ 1/8 inches when measured from tack at juncture point of collar and lapel to finished edge of lapel. NOTE: In-process inspection of this operation shall take place at this point before going to the next operation.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
38.	Baste facing-lining assemblies to fronts.					
	a. Position the facing-lining assembly on outside of respective fronts and baste along the break-line, distributing the fullness in the breast area and continue to baste along the front and bottom edge. Baste front along top and front edges of lapel down to the lower end of lapel, working the fullness towards the center of lapel.	101 Hopper				
39.	Join facings and fronts with tape.					
	a. Join the facings and fronts together 3/16 inch from the top and front edges of lapel and front edges of coat, with 3/8-inch-wide stay tape positioned on the inter-lining side of fronts. The edge of the tape shall be 1/8 inch from the front edge and caught in the stitching. Continue stitching along the lower edge of coat 3/16 inch above the front cutout with the tape properly positioned and caught in the stitching.	301	SSab-1	10-14	A	A
	b. The tape shall extend from the lapel notch to 1-1/2 to 2 inches from the side seams at the bottom of coat, except the tape is not required along the step of the left front. The tape shall be sewn with normal tension along the top and front edges of lapel and with slight tension along front and bottom edges of coat.					
	-or-					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
39.	Join facings and fronts with tape. (contd.)					
	Alternate. When fusible front construction is used, position tape 1/8 to 3/16 inch from the edge of the coat and stitch 1/16 to 1/8 inch from edge of tape, across top of lapel, down front and across bottom to back of facing. Press edge seam flat toward front; pull basting thread.	301	SSa-1	8-10	A	A
40.	Fell tape to interlining.					
	a. Fell the back edge of the stay tape to the coat front interlining from the collar notch on top of lapel to the end of the tape at the bottom edge.	103	SSm-1	4- 6	A	A
	b. Press the fronts and tape at the top and front edges of lapel, and front and bottom edges of coat, smooth and flat with a heated pressing iron or pressing machine.					
	c. Remove all basting stitches, trim lower front corner and corner of lapels. Notch lapel for proper turning.					
	d. Spread open the front facing seam from lapel notch to the bottom edge of coat and press smooth and flat with a heated pressing iron.					
41.	Baste fronts and bottom edge of coat.					
	a. Turn the facing-lining assemblies to the inside of the fronts, working the corners of lapels out completely. Turn up the bottom of coat lapping the back edge of facing on the ends of the bottom turn-up and working the front corners out completely.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
41.	Baste facing (second time). (contd.)					
	b. Baste along the top and front edges of the lapel, including the step of the left front and finished bottom edges of the coat, working the seams to the edge of the coat.	101 or Hand		4- 6		
42.	Baste facing (second time).					
	a. Baste facing to front approximately 1-1/4 inches from the top and front edges of lapel and front and bottom edges of the coat, holding the lower corners of the coat in such a manner as to cause the lower front edge of front to roll roll inward.	101 or Hand				
	b. Baste along the breakline of the lapel, properly placing the fullness to allow the lapel to roll.	101 or Hand				
	c. Baste the lapel diagonally from the corners to the breakline, properly placing the fullness to allow the lapel to roll.	101 or Hand				
	d. Baste the facings to the front as close to the facing-lining seam as possible, placing the proper fullness over the breast area. The basting shall extend approximately 1-1/2 inches from the bottom edge of the coat to approximately 3 inches from the shoulder edges of facings.	101 or Hand				

Source: https://assist.dla.mil - Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
43.	Tack facings at back edge to interlining.					
	a. Raise the lining and tack the seam allowance at back edge of the facings to the coat front interlining with blindstitching, starting approximately 2 inches from the bottom edge of the coat and tacking to approximately 2-1/2 inches from the shoulder edge of the interlining. Tacking shall be through seam allowance of facing and linings.	103	SSm-1	4- 6	A	
44.	Blindstitch bottom turnup and vent.					
	a. Blindstitch the bottom turnup and vent.	103 or 306 or Hand		4- 6 4- 6 4- 6	0 (Silk) 0 (Silk) 0 (Silk)	 0
45.	Join lining to vent.					
	a. Position the right and left back lining on the respective right and left vent opening, face to face, with notch of lining even with the top of the vent and join each side respectively with a 3/8 inch seam to 3/4 inch above bottom turnup.	301	SSe-2 (a)	10-14	A	A
	b. The left vent corner shall be finished with a mitre corner. (Do not cut corner.)	Hand or Machine		4- 6	A (Silk)	
	-or-					
	Alternate: The left vent corner may be piped for a distance of 1-1/2 to 2 inches and turned up 1-1/4 inches at the hem and stitched by hand or machine.	103 or 306 or Hand	EF1-1	4- 6	0 (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
45.	Join lining to vent. (contd.)					
	c. Edgestitch the right vent with a 1/8 inch seam from folded edge of vent ensuring the lining is not exposed on the outside.	301	SSe-2 (b)	10-14	A	A
46.	Baste body lining to coat.					
	a. Fold the front lining at the shoulder in accordance with notches, forming a chest pleat, and baste the entire length of the pleat. Continue to baste from the lower edge of armhole along the side seam and across the bottom edge of lining. The folded edge of the chest pleat on the outside of the lining shall be toward the armhole.	101 or Hand				
	b. Left side of coat. From side seam of lining at waist, baste across back lining to center vent. Fold lining up from bottom and continue basting lining approximately 1/2 inch from bottom edge of coat.	101 or Hand				
	c. Right side of coat. From side seam of lining at waist, baste across back lining to top of vent. Fold lining up from bottom and continue basting lining approximately 1/2 inch from bottom edge of coat.	101 or Hand				
	d. Baste center pleat from top of vent with a zero pleat, tapering up to the matched notches at the neckline, adding fullness to approximately 2 inches from the neck. The folded edge of the pleat on the outside of lining shall be toward the left side.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
46.	Baste body lining to coat. (contd.)					
	e. Baste the back lining along the lower edge of armhole, approximately 2 inches from the edge, and continue up and across the shoulders and neckline down to the other armhole. Leave ample room with basting to permit insertion of the shoulder pads.	101 or Hand				
47.	Trim front lining and interlining.					
	a. Trim the excess coat front interlining and front lining at the armhole.					
	-or-					
	When the shoulder lining seams are joined by machine, trim excess coat front interlining and front and back lining at shoulder to allow for insertion of shoulder pad.					
	b. Trim the lining even with the back at the neck.					
48.	Fell bottoms.					
	a. Fell the lining turnup to the bottom turnup.	Hand or Machine		4- 6	0 (Silk)	0
49.	Baste shoulder pads.					
	a. Insert shoulder pad between interlining and body lining, in line with the armhole edge, and securely tack the pad to the interlining.	101 or Hand				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
50.	Seam shoulders.					
	Finished appearance. The shoulders shall be evenly joined with the front and back seam lines matching, working in the proper fullness on the backs in order that the shoulder may be properly shaped.					
	a. Join fronts and back together at the shoulder with a 3/8-inch seam.	301	SSa-1	10-14	A	A
	b. Spread open the shoulder seam and press flat with a heated pressing iron or pressing machine over a suitable block, holding the shoulder short. Care shall be exercised in pressing the shoulder seam in order that the shoulders shall not have a distorted appearance in the finished coat.	Hand or 101 Hopper				
51.	Baste lining at shoulders and neckline.					
	a. Position shoulder interlining at neck. Baste upper part of each shoulder on the outside and turn the coat on the inside. Turn under and lap the shoulder edge of the lining on the front lining. Baste lining to coat along the folded edge with top end of chest pleat caught in the basting at the shoulders. Baste the lining to the back at the neck, from shoulder seam to shoulder seam.	Hand or 101 Hopper				
52	Stitch hanger and label to coat.					
	a. Stitch the ends of the hanger and upper edge of the size label to the neck of coat at the inside center back.	301	SSa-1	10-14	A	A

Source: https://assist.dla.mil - Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
52	Stitch hanger and label to coat. (contd.) b. The hanger opening, in the finished coat, shall be 1-1/2 ± 1/8 inches long when measured along the neck edge of the collar.					
53.	Set collar. Finished appearance. The seam joining top collar to facing at the gorge shall be of uniform gage and shall finish smooth and flat without twists, puckers, pleats, or other distortions. a. Mark the coat on the outside around the neck from shoulder seam to shoulder seam, 5/8 inch from the top edge, and continue to mark along the gorge with the line of marking tapering to 3/8 inch at the lapel notch.					
53.	Set collar. b. Join the top collar to the facing at the gorge, from the collar notch to a point not less than 1 inch in back of the lapel breakline. c. Clip the facing at the back end of joining seam.	301	SSa-1	10-14	A	A
54.	Tack top collar to fronts at gorge. a. Spread open the seam joining top collar to facing and tack the seam allowance of the top collar to the front at the gorge, from the collar notch to the back end of the seam, catching the top end of bridle tape in the tacking.	Hand or 301		2- 4	A (Silk)	

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL BOB/ LPR
55.	Baste undercollar to coat.				
	Finished appearance. Fullness in the collar along the neck edge shall be properly placed over the shoulders so that the collar will not be tight along the outer edge over the shoulders.				
	a. Turn the collar to the outside with the lower edge of the under collar lapped on the outside of the coat at the mark.				
	b. Securely tack the corners of the undercollar across the juncture point of the collar and the lapel.	Hand		8-10	A (Silk)
	c. Baste the undercollar to the fronts and backs, placing proper fullness over shoulder.	Hand			A (Silk)
	d. In the finished coat, the ends of the collar shall be 1 3/8 ± 1/8 inches for all sizes when measured from the juncture of the collar and lapel to the finished edge.				
56.	Tack coat to collar interlining.				
	a. Raise the lower (neck) edge of the top collar and tack the neck edge of coat to the undercollar interlining with overcast stitches, or blindstitching by machine, catching the back lining in the tacking from shoulder seam to shoulder seam.	Hand or 103		2- 3 3- 4	A (Silk) A
57.	Baste top collar to coat.				
	a. Turn under the lower edge of the top collar and baste from gorge seam to gorge seam.	Hand or 101		4- 6	
	-or-				

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
57.	Baste top collar to coat.					
	b. In lieu of operations 55.a, 56.a, and 57.a, join lower edge of top collar and collarstand from gorge seam to gorge seam, catching the back lining, size label and coat hanger in the stitching.	301	SSa-1	12-16	A	A
58.	Fell collar to coat.					
	a. Fell the neck edge of the under collar to the fronts and backs from collar notch to collar notch.	Hand		8-12	A (Silk)	
		or Machine (hand type felling)	LSa-1	8-12	A (Silk)	
		or 306	LSa-1	8-12	0 (Silk)	0
	b. Fell the folded edge of the top collar to the coat from gorge seam to gorge seam, catching the top edge of the size label and the ends of the coat hanger in the stitching.	Hand		8-10	A (Silk)	
59.	Edgestitch coat.					
	a. Edgestitch the coat 1/8 inch from the front edges of the coat, the front and top edges of the lapels, and the edges of the collar.	301	SSe-2	10-14	A (Silk)	A
	b. The stitching shall be uniformly 1/8 inch from the edge. (Lapels, front and bottom edges of coat show finished seam.)					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
60.	Set shoulder straps. Finished appearance. The shoulder straps shall be uniform in length and setting. In the finished coat, the straps shall be 2-1/2 ± 1/8 inches wide at the armhole seam and shall taper to 2-1/8 ± 1/8 inches at the buttonhole eyelet end. a. Position the shoulder straps with the rounded end of the strap even with the edge of the neck and with the raw edge in line with the armhole and the back finished edge of the strap 1/2 inch behind and in line with the shoulder seam. Position the button to properly engage the buttonhole without distorting the strap or shoulder. b. Stitch the shoulder straps to the coat 3/16 to 1/4 inch from the armhole edge. Trim the shoulder straps even with the armhole where necessary.	301 or 401	SSa-1	10-14	A	A
61.	Set sleeves. Finished appearance. The sleeves shall be properly and carefully set and shall be uniformly stitched without twists, gathers, pleats, puckers or raw edges. a. Position the outside of the sleeves on the outside of the coat with notches matching and with the sleeve lining turned back from the armhole edge. b. Join the sleeves to the coat with a 3/8 inch seam, evenly distributing the fullness between notches and catching the end of the shoulder strap in the stitching.	301 or 401	SSa-1	10-14	A	A

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
61.	Set sleeves. (contd.) c. Press the armhole smooth and flat with a heated pressing iron to remove the fullness. Care shall be exercised in pressing the armhole seam in order not to stretch the armhole.					
62.	Baste armhole. a. Baste around inside armhole, positioning yoke lining, shoulder pad, and front lining in place and distributing fullness evenly. Turn the coat on the outside.	101 or Hand				
	b. Baste around outside armhole adjacent to the armhole seam, forcing out the armhole in the basting. The basting shall extend the entire circumference of the armhole.	101 or Hand				
63.	Baste underarm shield to coat. a. Position the underarm shield on the lining side of the coat at the base of armhole, and baste the shield to the coat along the armhole and outer (convex) edges.	101 or Hand				
64.	Tack armhole and stitch sleeve head pads. a. Position the sleeve head pad on the sleeve, with the folded edge of the pad approximately 1/8 inch back from the raw edge of the armhole seam and with the front end of the pad matching the notch in the fronts.					

Source: https://assist.dla.mil -- Downloaded: 202640-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
64.	Tack armhole and stitch sleeve head pads. (contd.)					
	b. Stitch the sleeve head pad from end to end to the sleeve through the armhole sleeve seam allowance, 1/8 inch from the folded edge of the pad, catching the front and back linings, armhole shields at the base of armhole, and shoulder pad in the stitching. Continue stitching the lining around the remainder of the armhole. Trim away the excess material.	301	SSa-1	4- 6	30/3	30/3
65.	Tack underarm shields to lining.					
	a. Tack bottom edge of underarm shields on the underside to lining.	Hand		4 per tack (minimum)	A (Silk)	
	b. In the finished coat, the shields shall measure not less than 2 inches in length from the folded edge of sleeve lining.					
66.	Fell back lining and facing-lining assembly at shoulders.					
	a. Fell the back lining and facing-lining assembly together at the shoulders, securing the top end of the shoulder pleat in the felling. The felling shall be placed over the folded edge of the back lining.	Hand		8-10	A (Silk)	
	-or-					
	Join the back lining and facing lining assembly at the shoulders with a 3/8-inch seam, securing the top end of the shoulder pleat in the seam.	301	SSA-1	10-12	A	A

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
67.	Fell sleeve lining at armhole. (See Figure 3) a. Position the sleeve lining at the armhole, with the back and forearm seam of the sleeve and sleeve lining matching.					
	b. Turn under the top raw edge of the sleeve lining and lap 1/4 to 3/8 inch onto the armhole seam allowance over the front and back lining and underarm shield. Fell the sleeve lining to the coat around the entire armhole, placing the stitching over the folded edge of sleeve lining and distributing the fullness in accordance with good commercial practice. Backstitch 1/8 inch from the felled edge of sleeve lining along the lower armhole from approximately 1▲1/2 inches above the forearm seam line in sleeve lining to the side seam line in the body lining.	Hand		8-10	A (Silk)	
	-or-					
	c. Machine stitch lower edge of sleeve lining, at the armhole on the inside from forearm seam to backarm seam and hand fell the remaining portion as specified in operation 66.b. above.	301	SSa-1	12-16	A	A
	d. Machine stitch lower edge of sleeve lining, at the armhole, on the inside from forearm seam to backarm seam and stitch remaining portion of the sleeve lining at the armhole with machine simulated hand felling. NOTE: It is required that the simulated hand felling produced by machine shall be equal to or better than hand felling.	Machine simulated		8-10	A (Silk)	

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
68.	Make buttonholes. Finished appearance. The buttonholes shall be cut-first type, clean cut, well made and well worked over gimp to fit a 40-line insignia button. The stitching of the buttonholes shall be securely caught in the basic material. The gimp shall be pulled through to the underside of the front. The purling of the buttonholes shall be on the outside. a. Mark the right front in accordance with the marks on the pattern for the location of four buttonholes. The buttonholes shall be evenly spaced. b. Make one horizontal eyelet-end, square-bar type buttonhole, 1-1/4 inches long at each of the marks. The inside edge of the eyelet end of the buttonhole shall be 5/8 inch from the front edge of the coat. c. Securely bartack the ends of each buttonhole, catching the ends of the gimp in the bartack. Trim the ends of the gimp.	Buttonhole Bartack		50 per A button minimum (not including bartack) 21 per A bartack	A (Silk) A	
69.	Clean coat. a. Pull and remove all basting thread. Trim all ends of stitching and remove all loose ends of thread from the coat. Remove all spots, stains and shade tickets and markings without injury to the material.					

Source: https://assist.dla.mil - Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
70.	Press coat. a. The coat shall be well pressed throughout with a heated iron or pressing machine of a type suitable to obtain the desired shape and appearance in accordance with good manufacturing practices. b. Block the shoulders to remove the fullness and press shoulders smooth on a shoulder shaping machine with shoulder straps properly positioned over shoulder seam and pressed flat. c. Press the armholes solid from the inside, creasing the sleeve lining at the edge of the armhole seam allowance in the front, back and armpit of the lower armhole. The armpit and the back of the armhole shall be held short while pressing. d. Block the armholes on a pressng buck, shrinking in top sleeves. Sleeves shall not be creased. e. Press the entire collar smooth and flat, stretching where necessary to obtain the proper shape and straightening the edges, working any fullness towards the center of the collar and removing the fullness by shrinking. f. Press the lapels smooth and flat from the breakline to the front edge, straightening the edges and working the fullness towards the center of the lapel and removing the fullness by shrinking. Lapels shall not be creased.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
70.	Press coat. (contd.) g. Press the fronts and welt for the simulated pocket smooth and flat on a body machine, straightening the front edges of the coat, working the fullness towards the bust, and shrinking and properly shaping the chest. Care shall be exercised in pressing the fronts so that the bottom edges are even. h. Press the collar by creasing on the breakline for a distance of 4 to 5 inches centered across the center back. i. Press the bottom edge of coat smooth and flat, exercising care that the lining is not exposed below the bottom edge. j. Press the sides, working the fullness towards the back. k. Press the back smooth and flat, removing all fullness. l. Insert a sleeve pad in the sleeves in order to prevent creasing, and press sleeves smooth and flat. m. Remove all wrinkles and impressions from under the lapels, collar and shoulder straps. n. Press pleats in upper front lining, center back lining and left vent lining smooth and flat. o. Press lining throughout with a heated pressing iron, removing all wrinkles and creases.					

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

TABLE II. MANUFACTURING REQUIREMENTS (contd.)

NO.	OPERATION	STCH TYPE	STCH TYPE	STCH IN	NDL	BOB/ LPR
71.	Mark for buttons.					
	a. Mark the location for sewing four 40-line insignia buttons the left front of the coat, 1-5/8 inches back from the finished edge, to properly engage button-holes in the right front.					
	b. Mark the location for sewing one 27-line insignia button to each shoulder to properly engage with the neck end of the button-hole in the shoulder straps, in order that on the finished coat, the straps shall lie smooth and flat without twisting or bulging.					
72.	Sew on buttons.					
	a. The buttons shall be securely sewn to the coat with the ends of the stitching securely tacked.					
	b. Sew one 27-line insignia button at the mark on each shoulder. The buttons shall not be sewn through the lining.	Hand or 301 or 101		4- 6 per button (double thread)		24/4
	c. Sew one 40-line insignia button at each of the marks on the left front through all plies.	Hand or 301 or 101		4- 6 per button (double thread)		
	d. The insignia buttons on the front shall be sewn with the eagle upright. The shoulder buttons shall be sewn with the head of the eagle towards the edge of the collar.					

Source: https://assist.dla.mil -- Downloaded: 202610-20T23:14Z
Check the source to verify that this is the current version before use.

3.7 Finished measurements. The finished coat shall conform to the measurements shown in Table III.

Table III. Finished measurement 1/

Size	1/2 Bust 2/ (Short, Regular, Long) inches	Back Length 3/ Short inches	Back Length 3/ Regular inches	Back Length 3/ Long inches	Sleeve Length 4/ Short inches	Sleeve Length 4/ Regular inches	Sleeve Length 4/ Long inches
X0	16-3/4	23-7/8	25-1/8	26-3/8	16-3/4	17-3/4	18-3/4
2	17-1/4	24-1/8	25-3/8	26-5/8	16-3/4	17-3/4	18-3/4
4	17-3/4	24-3/8	25-5/8	26-7/8	16-3/4	17-3/4	18-3/4
6	18-1/4	24-1/2	25-3/4	27	16-3/4	17-3/4	18-3/4
8	19	24-3/4	26	27-1/4	16-3/4	17-3/4	18-3/4
10	19-3/4	25	26-3/16	27-3/8	16-3/4	17-3/4	18-3/4
12	20-1/2	25-1/8	26-3/8	27-5/8	16-3/4	17-3/4	18-3/4
14	21-1/2	25-3/8	26-5/8	27-7/8	16-3/4	17-3/4	18-3/4
16	22-1/2	25-1/2	26-3/4	28	16-3/4	17-3/4	18-3/4
18	23-1/2	25-3/4	27	28-1/4	16-3/4	17-3/4	18-3/4

1/ Tolerance on all measurements: + 3/8 inch. Tolerance is on 1/2 bust measurement.

2/ Bust measurement taken with coat buttoned from folded edge to folded edge in line with pit of armhole.

3/ Back length measurement taken along center back seam from lower edge of the undercollar to bottom edge of coat.

4/ Sleeve length measurement taken along forearm seam from the armhole seam line to bottom edge of sleeve.

3.8 Workmanship. The finished coats shall conform to the quality and grade of product established by this specification. The occurrence of defects shall not exceed the applicable point value or defect limit.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the contractor is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or purchase order, the contractor may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

4.1.1 Responsibility for compliance. All items must meet all requirements of sections 3 and 5. The inspection set forth in this specification shall become a part of the contractor's overall inspection system or quality program. The absence of any inspection requirements in the specification shall not relieve the contractor of the responsibility of assuring that all products or supplies submitted to the Government for acceptance comply with all requirements of the contract. Sampling in quality conformance does not authorize submission of known defective material, either indicated or actual, nor does it commit the Government to acceptance of defective material.

4.2 Classification of inspection. The inspection requirements specified herein are classified as follows:

1. First article inspection (see 4.4)
2. Quality conformance inspection (see 4.5)

4.3 Inspection conditions. Unless otherwise specified, all inspections shall be in accordance with the test conditions specified in MIL-STD-1608.

4.4 First article inspection. When first article is required, inspection shall be made of a completely fabricated coat for all provisions of this specification.

4.5 Quality conformance inspection

4.5.1 Examination and testing. Examination and testing for quality conformance shall be as stated in the contract.

5. PACKAGING

5.1 Preservation. Preservation shall be level A, commercial, or hanger pack (see 6.2).

5.1.1 Level A. Each coat shall be laid down and a bending or nonbending paperboard shoulder form conforming to Figure 4 shall be inserted into the coat so as to fit snugly into the collar and shoulders. The buttonhole front shall overlap the button front. The sleeves shall be positioned full length on the front of coat without fullness or wrinkles in the sleeve. The coat shall then be folded in half by bringing the collar portion down even with the bottom edge so that the folded coat measures not more than 23 by 15 inches.

5.1.2 Commercial. Coats shall be preserved in accordance with ASTM D 3951.

5.1.3 Hanger pack. Coats shall be hung with right front lapped over left front, unbuttoned, on a molded 14 inch hanger and preserved as specified in the appendix of MIL-C-44192.

5.2 Packing. Packing shall be level A, or commercial or hanger pack as specified (see 6.2).

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

5.2.1 Level A. Fifteen coats of one size and length only, packaged as specified in 5.1.1, shall be packed in a fiberboard shipping container conforming to type SF, class weather resistant, grade V2s, size 3A of MIL-B-17757. The fiberboard used for fabricating the box liner shall conform to type CF, class weather resistant, variety DW, grade V15c of MIL-B-17757. Level A folded coats shall be stacked flat, collars alternated, fifteen in depth within a shipping container. Each container shall have the contents completely covered on the top and bottom with a sheet of commercial grade kraft paper. Toward the end of the contract or when there are less than the required amount per container of the same size, mixed sizes may be packed within the same shipping container.

5.2.2 Commercial. Coats preserved as specified in 5.1.2, shall be packed in accordance with ASTM D 3951.

5.2.3 Hanger pack. When specified (see 6.2), twelve coats of one size and length only, packaged as specified in 5.1.3 shall be packed in a type I container, using Style A or B hanger bar in accordance with MIL-C-44192. The loaded container shall be marked and palletized in accordance with MIL-C-44192.

5.3 Marking. In addition to any special marking required by the contract, shipping containers shall be marked in accordance with MIL-STD-129.

5.4 Palletization. When specified, (see 6.2) coats packed as specified in 5.2.1 and 5.2.2 shall be palletized on a 4-way entry pallet in accordance with load type 1A of MIL-STD-147. Pallet type shall be type I (4-way entry), type IV or type V in accordance with MIL-STD-147. Pallets shall be fabricated from wood groups I, II, III or IV of MIL-STD-731. Each prepared load shall be bonded with primary and secondary straps in accordance with bonding means C and D or film bonding means F or G. Pallet pattern shall be in accordance with the appendix of MIL-STD-147. Interlocking of loads shall be effected by reversing the pattern of each course. If the container is of a size which does not conform to any of the patterns specified in MIL-STD-147, the pallet used shall be approved by the contracting officer.

6. NOTES

(This section contains information of a general or explanatory nature that may be helpful, but is not mandatory.)

6.1 Intended use. The coats described herein are intended for wear by women personnel of the U. S. Marine Corps.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

6.2 Ordering data

6.2.1 Acquisition requirements. Acquisition documents should specify the following:

(a) Title number and date of this specification.
(b) Size required (see 1.2).
(c) Whether first article is required (see 3.2).
(d) Level of packaging and preservation and packing required (see 5.1 and 5.2).
(e) When palletization is required (see 5.4).

6.3 Samples and shade samples. For information regarding the availability of sample of the coat and of standard shades specified, address inquiry to the procuring activity issuing the Invitation for Bids.

6.4 First article. When a first article is required, it shall be inspected and approved under the appropriate provisions of FAR 52.209. The first article should be a preproduction sample. The contracting officer should specify the appropriate type of first article and the number of units to be furnished. The contracting officer should include specific instructions in all acquisition documents regarding arrangements for selection, inspection, and approval of the first article.

6.5 Figures. Figures 1 through 3 show general design of the coat and are furnished for information only. In the event of conflict between these figures and the text of this specification, the text of this specification shall govern.

6.6 Subject term (key word) listing

All-season
Female
Jacket

6.7 Changes from previous issues. Asterisks are not used in this revision to identify changes with respect to the previous issue due to extensive changes.

Custodian:


Navy - MC

Preparing activity:

DLA - CT

Project No. 8410-0848


Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

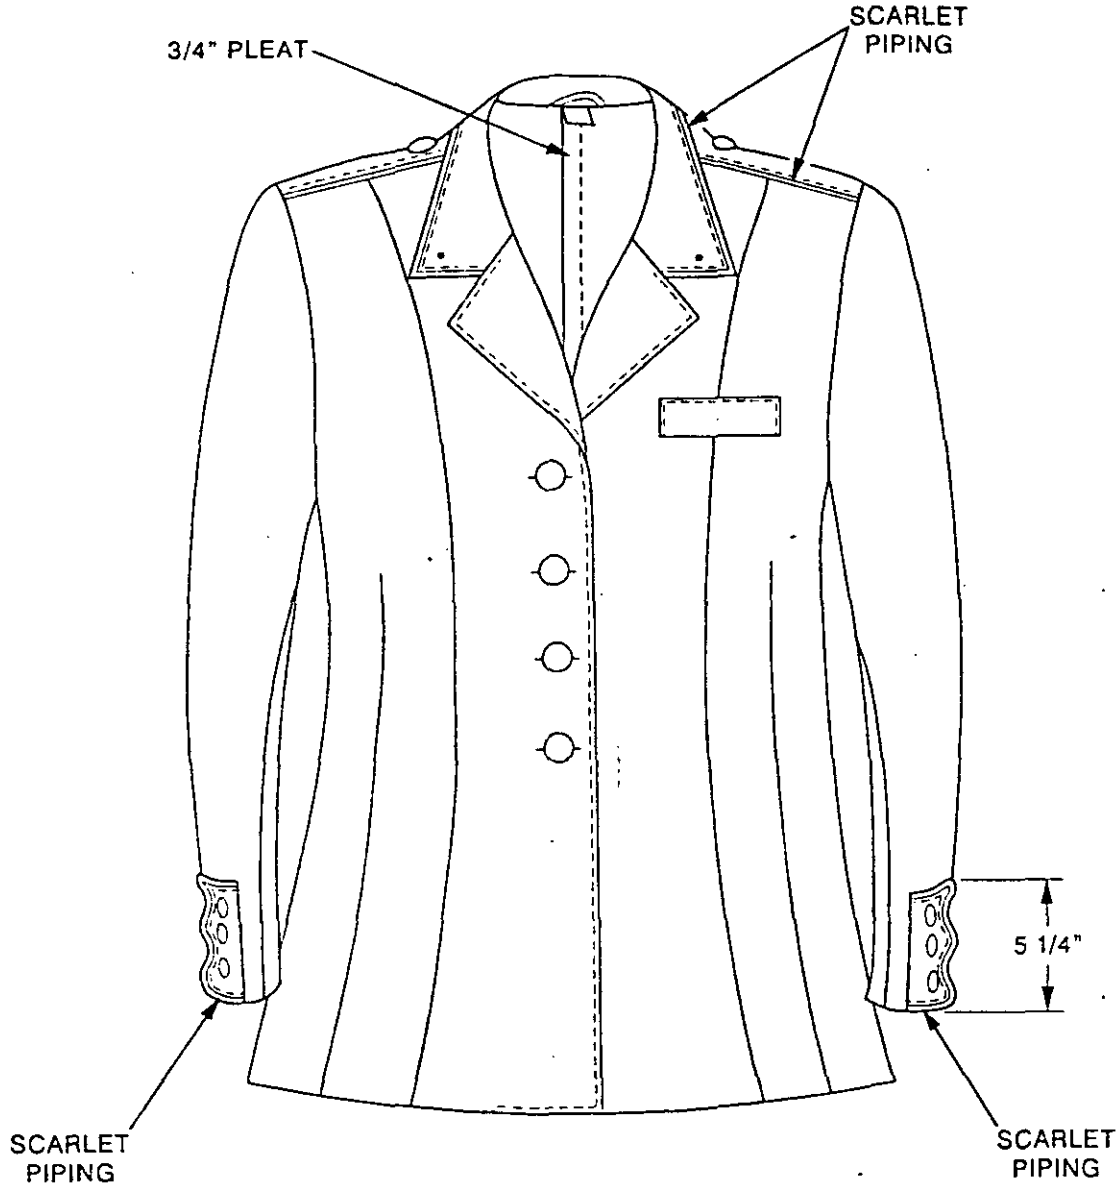

FRONT VIEW

FIGURE 1. COAT, WOMEN'S, WOOL/POLYESTER, GABARDINE, BLUE

Source: https://assist.dla.mil - Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

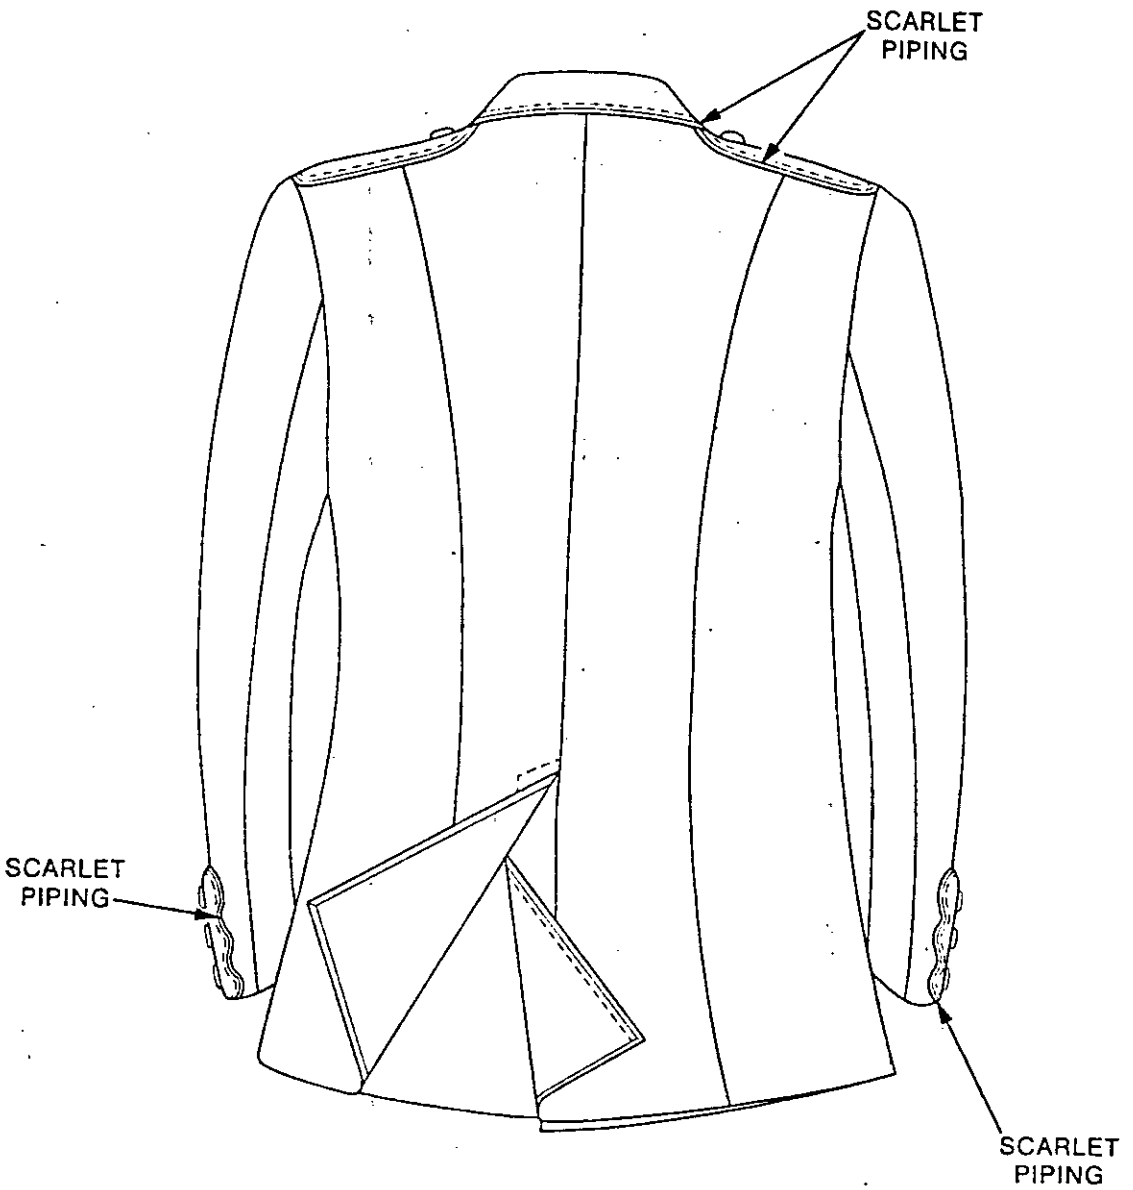

BACK VIEW

FIGURE 2. COAT, WOMEN'S, WOOL/POLYESTER, GABARDINE, BLUE

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.


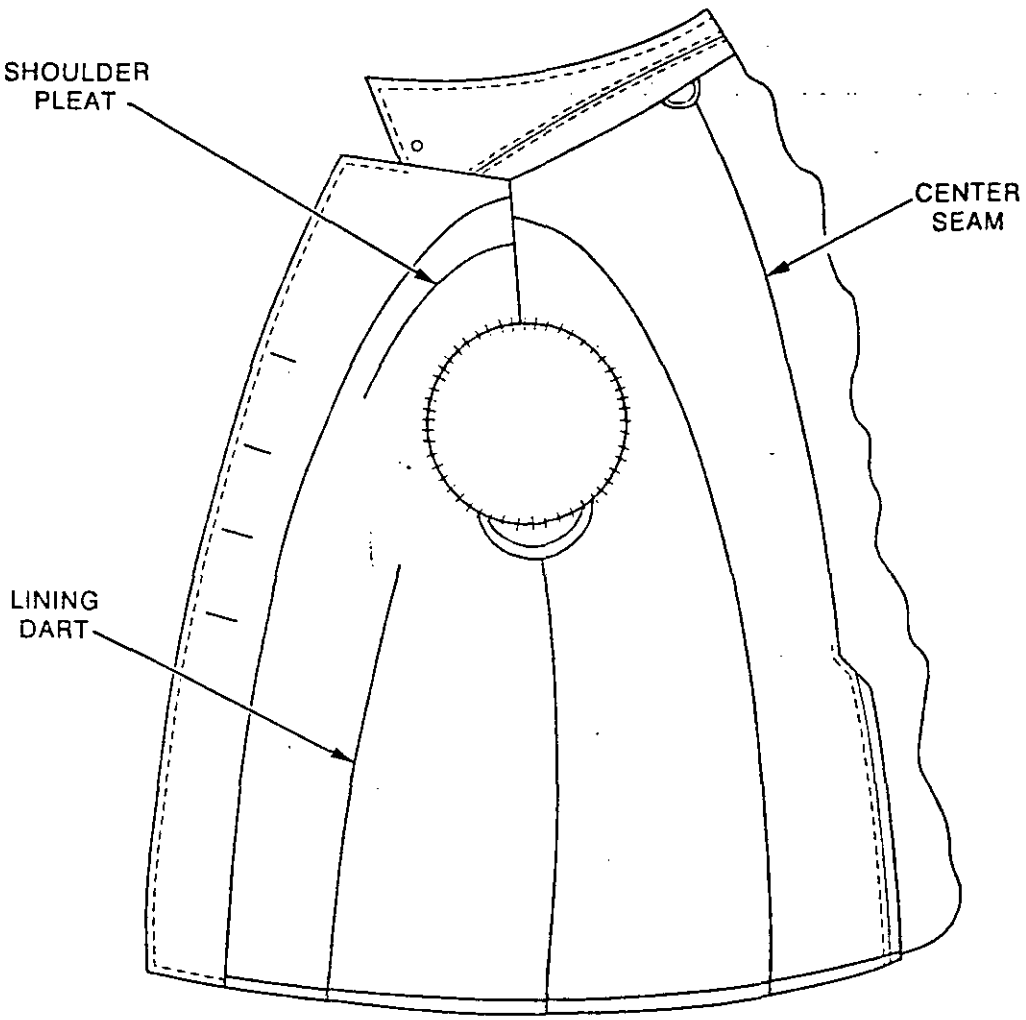


FIGURE 3. COAT, WOMEN'S, WOOL/POLYESTER, GABARDINE, BLUE

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.

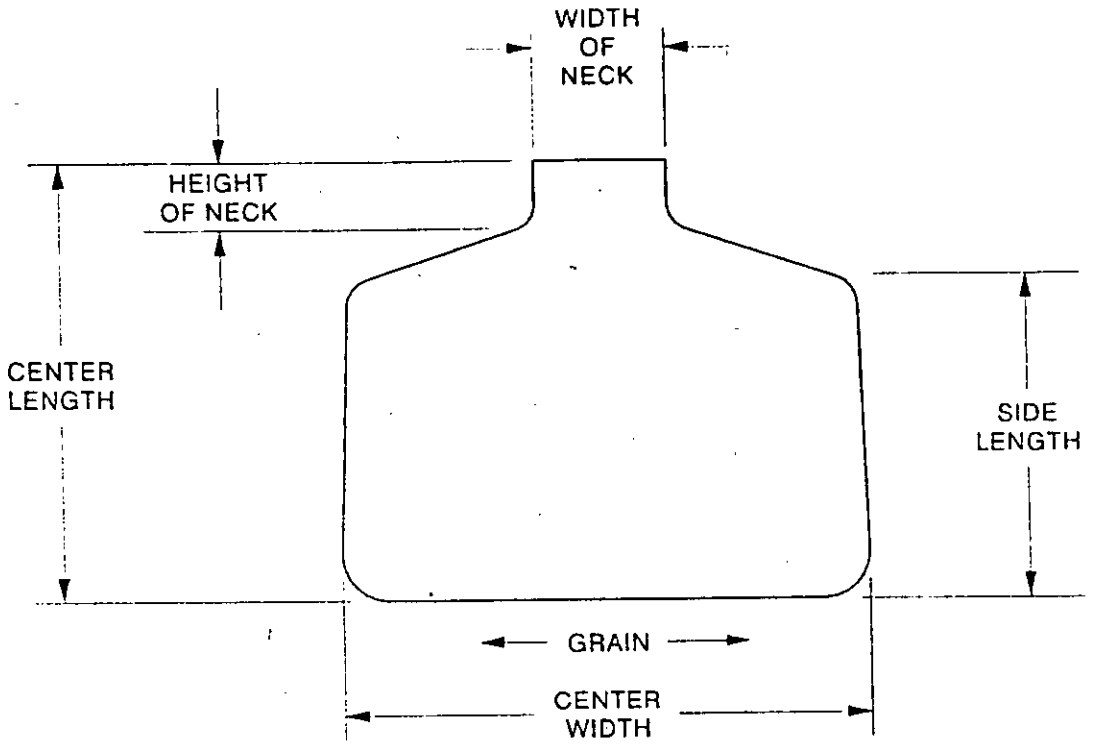

LEGEND

CENTER LENGTH	14 – 1/2 INCHES
CENTER WIDTH FOR SIZES:	
6 – 10	15 INCHES
12 – 16	18 INCHES
18 – 22	21 INCHES
SIDE LENGTH	10 – 1/2 INCHES
HEIGHT OF NECK	1 – 1/2 INCHES
WIDTH OF NECK	3 – 1/2 INCHES
PAPERBOARD	0.040 INCH THICK

NOTE: ALL MEASUREMENTS ARE APPROXIMATE

FIGURE 4. SHOULDER FORM

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T23:14Z
Check the source to verify that this is the current version before use.