MIL-L-60385B(MI)
10 March 1975
SUPERSEDING
MIL-L-60385A(MI)
22 April 1968

MILITARY SPECIFICATION

LAUNCHER FOR ROCKET, HE, 66MM, ANTITANK: M72A1 ASSEMBLY AND PACKING

This specification is approved for use by all departments and agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers special requirements not normally required by the drawings and provides the quality assurance provisions for the fabrication of parts, assembly and packing of one rocket launcher designated as Launcher, Rocket, 66MM, M72A1 for use in Rocket, HE, 66MM, Antitank: M72A1.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids form a part of this specification to the extent specified herein:

SPECIFICATIONS

Federal

PPP-B-636	Box, Shipping, Fiberboard
PPP-F-320	Fiberboard, Corrugated and Solid, Sheet Stock (Container Grade), and Cut Shapes

Military

MIL-A-2550	Ammunition and Special Weapons; General Specification for
MIL-I-45607	Inspection Equipment, Supply and Maintenance of

FSC 1340

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

STANDARDS

Military

MIL-STD-105	Sampling Procedures and Tables for Inspection by Attributes
MIL-STD-109	Quality Assurance Terms and Definitions
MIL-STD-810	Environmental Test Methods
MIL-STD-1168	Lot Numbering of Ammunition
MIL-STD-1169	Packaging, Packing, and Marking for Shipment of Inert Ammunition Components
MIL-STD-1235	Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes
* MS35190	Screw, Machine-82 Degree Flat Countersunk Head, Cross Recessed, Carbon Steel, Cadmium Plated, UNC-2

DRAWINGS

Army

* 9210200	Launcher, Rocket, 66MM, M72A1, Metal Parts Assembly

PUBLICATIONS

Army

ET-9210200	Equipment Tabulation

(Copies of specifications, standards, drawings and publications required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the contracting officer.)

3. REQUIREMENTS

3.1 Material. Materials shall be in accordance with applicable drawings and specifications.

3.1.1 Parts. All parts used in the assembly of the launcher shall meet all requirements of applicable drawings and specifications.

3.2 Launcher. The launcher shall comply with all requirements specified on the drawing (dwg.) 9210200 and with all requirements specified in applicable specifications.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

3.3 Spring embrittlement. Springs used in the launcher assembly shall be free from hydrogen embrittlement as evidenced by not breaking when extended to the point of minimum permanent distortion.

* 3.4 Operability of launcher. The complete launcher assembly shall extend fully and the detent level shall lock the assembly in the extended position when a continuous rearward force is applied to the launcher inner tube. The force required to extend the launcher from the fully closed position until the launcher is locked in the extended position shall not exceed 35 pounds maximum. With the launcher locked in the fully extended position, the firing pin shall be fully cocked and the sights shall be fully erect. When detent is depressed and closing action initiated, trigger safety must freely return from the armed to the safe position.

3.5 Trigger action.

3.5.1 "SAFE" position, non-functioning. With the launcher fully extended, the trigger mechanism in the cocked position, and the trigger safety handle in the "SAFE" position, the trigger mechanism shall not release the firing pin when a force of 30 pounds minimum is applied to the trigger.

3.5.2 "ARM" position, non-functioning. With the launcher fully extended, the trigger mechanism in the cocked position, and the trigger safety handle extended and locked in the "ARM" position, the trigger mechanism shall not release the firing pin when a force of 3 pounds minimum is applied to the trigger.

* 3.5.3 Functioning of the trigger mechanism. With the launcher fully extended, the trigger mechanism in the cocked position, and the trigger safety handle in the "ARM" position, the trigger mechanism shall release the firing pin when a force of 10 pounds maximum is applied to the trigger.

3.6 Functioning of the firing pin. The firing pin shall impact within the inscribed circuit of the test slug (see Figure I) when tested as specified herein.

3.7 First article inspection. This specification makes provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

3.8 Environmental operability. The complete launcher assembly shall comply with the requirements of paragraph 3.4, 3.5, 3.6 and dwg. 9210200 upon exposure to the following conditions:

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the currentversion before use.

a. Five-foot drop (see 4.4.10.1).

b. Transporation vibration per MIL-STD-810, Method 514, procedure X and XI, Curve AA.

* 3.9 Radiographic examination. The pawl and pawl spring shall be properly assembled as is evidenced by radiographic examination of the launcher (see dwg. 9210200 and 4.4.11).

3.10 Workmanship . All parts, subassemblies and assemblies shall be fabricated and finished in a thorough, workmanlike manner. They shall be free of burrs, chips, sharp edges, cracks, unblended radii, surface defects, dirt, grease, rust, corrosion products, and other foreign matter that may impair proper functioning of the launcher or that may cause premature functioning of the loaded rocket or deterioration of the complete round in storage. The cleaning method shall not be injurious to any of the parts, nor shall the parts be contaminated by the cleaning agent used. Painted or coated surfaces shall be restored when these surfaces have been marred or scratched. All required markings shall be neat, clean and sharply defined.

* 3.11 Inspection marking. After any inspection requiring marking, the mark indicating successful inspection must be applied prior to any additional processing of the accepted assembly or part.

* 3.12 Other tube and mechanism assembly (dwg. 9210803). After bonding and curing of the trigger housing to the outer tube assembly, the full length (except 2 inches to 3 inches from the end where the O-ring retainer is attached) of the outer tube shall be gaged with a plug 14 inches long x 2.661 - .001 inches diameter.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for inspection. Unless otherwise specified in the contract or purchase order, the supplier is responsible for the performance of all inspection requirements as specified herein. Except as otherwise specified in the contract or order, the supplier may use his own or any other facilities suitable for the performance of the inspection requirements specified herein, unless disapproved by the Government. The Government reserves the right to perform any of the inspections set forth in the specification where such inspections are deemed necessary to assure supplies and services conform to prescribed requirements. Reference shall be made to MIL-STD-109 in order to define terms used herein. The provisions of MIL-A-2550 shall apply.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:20Z
Check the source to verify that this is the currentversion before use.

4.1.1 Submission of product. At the time the completed lot of product is submitted to the Government for acceptance, the contractor shall supply the following information accompanied by a certificate which attests that the information provided is correct and applicable to the product being submitted:

a. A statement that the lot complies with all of the quality assurance provisions specified within this specification.

b. Number of units of product inspected.

c. Results obtained, by defect code, for all inspections performed.

d. Drawing, specification number and date, together with an identification and date of changes.

e. Certificates of conformance on all material purchased by the contractor when such material is controlled by Government or commercial specifications referenced in any of the contractual documents.

f. Number of items in the lot.

g. Date submitted.

The certificate shall be signed by a responsible agent of the certifying organization. The initial certificate submitted shall be substantiated by evidence of the agent's authority to bind his principal. Substantiation of the agent's authority will not be required with subsequent certificates unless, during the course of the contract, this authority is vested in another agent of the certifying organization.

4.2 First article inspection.

4.2.1 Submission. The contractor shall submit a first article sample as designated by the contracting officer for evaluation in accordance with the provisions of 4.2.2. The first article sample shall consist of 30 complete launcher assemblies and 10 complete sets of parts (i.e. 10 each of every component and every subassembly) which have been produced by the contractor or furnished by a supplier and which have been manufactured using the same production processes, procedures and equipment which will be used in fulfilling the contract. All parts and materials, including packaging and packing, shall be obtained from the same source of supply as will be used in regular production. Prior to submission, the contractor shall inspect the sample to the degree necessary to assure that it conforms to the requirements of the contract and submit a record of this inspection with the sample, including statements of findings of tests and examinations and certificates of conformance for materials, (see 4.1.1.e).

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

A sample containing known defects will not be submitted unless specifically authorized by the contracting officer. A first article sample, or portion thereof, as directed by the contracting officer, shall also be submitted whenever there is a lapse in production for a period in excess of 90 days or whenever a change occurs in manufacturing process, material used, drawing or specification such as to significantly affect product uniformity as determined by the Government.

4.2.2 Inspection to be performed. Assemblies and components will be subjected by the Government to any or all of the examinations or tests specified in 4.3.2 and 4.3.3 of this specification and any or all requirements of the applicable drawings. Destructive tests specified shall be performed only after all other inspections and tests for other characteristics have been completed.

4.2.3 Rejection. If any assembly or component fails to comply with any of the applicable requirements, the first article sample shall be rejected. The Government reserves the right to terminate its inspection upon any failure of an assembly or component to comply with any of the stated requirements.

4.3 Inspection provisions.

4.3.1 Lot formation. The term "lot" as used throughout this specification refers to an inspection lot, which is defined as an essentially homogeneous collection of units of product from which a representative sample is drawn and inspected to determine conformance of the lot with applicable requirements. The sample selected shall represent only that quantity of units from which the sample was drawn and shall not be construed to represent any prior or subsequent quantities presented for inspection. Homogeneity shall be considered to exist provided the lot has been produced by one manufacturer, in one unchanged process, in accordance with the same drawing, specification, or revision thereof. Changes to either the process, specification, or drawing not affecting safety, performance, interchangeability, or storage, as determined by the Government inspector, shall not be deemed to alter the homogeneity of the lot. Inspection lots shall comply with MIL-STD-105 and shall be numbered in accordance with MIL-STD-1168.

Unless otherwise approved by the contracting officer, the inspection lot size of major assemblies or end items deliverable under the contract shall be not less than the smallest weekly estimate of quantities contractually scheduled for production during the contract period nor more than the largest quantity contractually scheduled for delivery during any month of the contract period. Inspection lots for components or subassemblies, other than the items of delivery, shall be homogeneous and of a size convenient to the contractor.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2 Examination. Sampling plans and procedures for the following classifications of defects shall be in accordance with MIL-STD-105 except that inspection for critical defects, when listed, shall be 100 percent. Continuous sampling plans in accordance with MIL-STD-1235 may be used if approved by the procuring activity. Also, at the option of the procuring activity, AQL's and sampling plans may be applied to the individual characteristics listed using an AQL of 0.40 percent for each major defect and an AQL of 0.65 percent for each minor defect. Once agreement has been reached as to which method will be used (group or individual) that method will be used for all of the CD's listed in this specification. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.3.4.

4.3.2.1 Pin, pull (see dwg. 10048758 covering a detail of dwg. 10048757).

Categories	Defects	Method of Inspection	Code No. (see 6.2)
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Diameter of wire, minimum (min)	Gage	01001
102.	Protective finish incomplete or inadequate	Visual	01002
Minor:	AQL 1.00 Percent		
201.	Diameter of wire, maximum (max)	Gage	01003
202.	Evidence of poor workmanship (see 3.10)	Visual	01004

4.3.2.2 Cover, housing, pin, firing (see dwg. 9210222 covering a detail of dwg. 9210224).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Diameter or screw holes	Gage	02001
102.	Location of screw holes	Gage	02002
103.	Diameter of pull pin hole, max.	Gage	02003
104.	Location of pull pin hole	Gage	02004
105.	Protective finish incomplete or inadequate	Visual	02005
Minor:	AQL 1.00 percent		
201.	Diameter of pull pin hole, min.	Gage	02006
202.	Evidence of poor workmanship (see 3.10)	Visual	02007

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2.3 Cover assembly firing pin housing (see dwg. 9210224 covering a detail of 9210200).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Assembly incomplete or incorrect	Visual	03001
102.	Protective finish incomplete or inadequate	Visual	03002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	03003

4.3.2.4 Bracket, sight, rear (see dwg.9210175 covering a detail of dwg. 9210173).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Diameter of pivot holes, maximum (max.)	Gage	04001
102.	Protective finish incomplete or inadequate	Visual	04002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	04003

4.3.2.5 Housing, sight, rear (see dwg. 9210210 covering a detail of dwg. 9210205).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 percent		
101.	Diameter of pivot holes, max	Gage	05001
102.	Height to top of cavity, min	Gage	05002
103.	Entire profile of sidewalls of cavity, min	Gage	05003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	05004

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2.6 Element, bimetallic (see dwg. 9210213 covering a detail of dwg. 9210211).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Body diameter,max	Gage	06001
102.	Length of bent tab, min	Gage	06002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	06003

4.3.2.7 Slide (see dwg. 9210212 covering a detail of dwg. 9210211).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Diameter of sight hole	Gage	07001
102.	Total width, max	Gage	07002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	07003

4.3.2.8 Rear sight element assembly (see dwg. 9210211 covering a detail of dwg. 9210205).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 percent		
101.	Dimension A length	Gage	08001
102.	Assembly angularity	Gage	08002
* 104.	Eyelet not secure	Visual/Manual	08004
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	08005

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2.9 Rear sight assembly, prior to assembly of rear sight element assembly (see dwg. 9210205 covering a detail of dwg. 9210200).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.40 percent		
101.	Entire viewing portion of windows not clean	Visual	09001
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	09002

4.3.2.10 Spring, sight, rear (see dwg. 9210206 covering a detail of dwg. 9210200).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.40 percent		
101.	Torque test failure	Test	10001
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	10002

4.3.2.11 Spring, sight, front (see dwg. 9210189 covering a detail of dwg. 9210173).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.40 percent		
101.	Torque test failure	Test	11001
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	11002

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2.12 Sight, front (see dwg. 9210194 covering a detail of dwg. 9210200). (If component 9234281 is used, inspection provisions of paragraph are deleted).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Material not clear	Visual	12001
102.	Vertical distance between range graduations	Gage	12002
Minor:	AQL 0.65 percent		
201.	Location of stadia lines	Gage	12003
202.	Evidence of poor workmanship (see 3.10)	Visual	12004

4.3.2.13 Spring, trigger (see dwg. 9210179 covering a detail of dwg. 9210177).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 percent		
101.	Profile	Gage	13001
102.	Thickness, min	Gage	13002
103.	Protective finish incomplete or inadequate	Visual	13003
104.	Location of hole	Gage	13005
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	13004

4.3.2.14 Trigger assembly (see dwg. 9210177 covering a detail of dwg. 9210173)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Both rivets not rolled secure	Visual/Manual	14001

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	14002

4.3.2.15 Detent, safety (see dwg. 9210181 covering a detail of dwg. 9210180.

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Depth of slot	Gage	15001
102.	Protective finish incomplete or missing	Visual	15002
103.	Radius at bottom of slot	Gage	15004
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	15003

4.3.2.16 Pull rod safety (see dwg. 9210182 covering a detail of dwg. 9210180.

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.65 percent		
101.	Diameter at base of undercut	Gage	16001
102.	Angle at undercut	Gage	16002
103.	Width of head, min	Gage	16003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	16004

4.3.2.17 Safety assembly (see dwg. 9210180 covering a detail of dwg. 9210173)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Components not secure	Visual/Manual	17001
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	17002

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2.18 Spring, safety (see dwg. 9210183 covering a detail of dwg. 9210173)

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Load at compressed lengths	Test	18001
102.	Protective finish incomplete or inadequate	Visual	18002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	18003

4.3.2.19 Trigger housing assembly (see dwg. 9210173 covering a detail of dwg. 9210203).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Components missing, loose, damaged or improperly assembled	Visual	20001
102.	All rivets not rolled over and secure	Visual	20002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	20003

4.3.2.20 Spring, pawl (see dwg. 9210155 covering a detail of dwg. 9210159).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Entire profile	Gage	21001
102.	Thickness	Gage	21002
103.	Diameter of rivet holes, max.	Gage	21003
104.	Location of rivet holes	Gage	21004
105.	Location of cutout	Gage	21005
106.	Profile of cutout	Gage	21006
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	21008

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2.21 Stop, lever, detent (see dwg. 9210218 covering a detail of dwg. 9210220).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Distance of rivet holes from shoulder	Gage	22001
102.	Height of shoulder, min	Gage	22002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	22003

4.3.2.22 Lever, detent (see dwg. 9210164 covering a detail of dwg. 9210220).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Longitudinal distance of detent stop holes from edge, min	Gage	23001
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	23002

4.3.2.23 Pawl (see dwg. 9210163 covering a detail of dwg. 9210159).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Profile along entire bottom surface	Gage	24001
102.	Thickness	Gage	24002
103.	Diameter of hole, max	Gage	24003
104.	Total height to entire top surface	Gage	24004
105.	Component cracked	Visual	24005
106.	Protective finish incomplete or inadequate	Visual	24006
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	24007

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2.24 Extension, pin, firing (see dwg. 9210160 covering a detail of dwg. 9210171).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Overall width	Gage	25001
102.	Location of pawl cutout from longitudinal edge	Gage	25002
103.	Length of pawl cutout, min.	Gage	25003
104.	Width of pawl cutout	Gage	25004
105.	Width of firing pin staking slot, max.	Gage	25005
106.	Height of raised portion	Gage	25006
107.	Burrs	Visual	25007
108.	Protective finish incomplete or inadequate	Visual	25008
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	25009

4.3.2.25 Rod, pin, firing (see dwg. 9210161 covering a detail of dwg. 9210217).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 1.00 percent		
101.	Profile of point	Gage	26001
102.	Length from spring pin hole to firing pin point	Gage	26002
103.	Height of staking tab end	Gage	26003
104.	Thickness, firing pin end	Gage	26004
105.	Thickness, staking tab, min	Gage	26005
106.	Protective finish incomplete or inadequate	Visual	26006
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	26007

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2.26 Spring, pin, firing (see dwg. 9210166 covering a detail of dwg. 9210171).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Load at compressed lengths	Gage	27001
102.	Protective finish incomplete or inadequate	Visual	27002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	27003

4.3.2.27 Spring, rebound (see dwg. 9210168 covering a detail of dwg. 9210171).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Load at compressed lengths	Gage	28001
102.	Protective finish incomplete or inadequate	Visual	28002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	28003

4.3.2.28 Pin spring (see dwg. 9210162 covering a detail of dwg. 9210159).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Pin length, min	Gage	29001
Major:	None defined.		
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	29002

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the currentversion before use.

4.3.2.29 Channel (see dwg. 9210152 covering a detail of dwg. 9210159).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 0.65 percent		
101.	Width of channel walls	Gage	30001
102.	Outside width	Gage	30002
103.	Height of hole for spring pin securing firing pin extension	Gage	30003
104.	Diameter of pawl spring pin holes, max.	Gage	30004
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	30005

4.3.2.30 Firing pin rod assembly (see dwg. 9210217 covering a detail of dwg. 9210171).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Stake insecure	Visual/Manual	31001
Major:	AQL 0.40 percent		
101.	Lubricant not applied	Visual	31003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	31002

4.3.2.31 Housing, pin, firing (see dwg. 9210169 covering a detail of dwg. 9210171).

Categories	Defects	Method of Inspection	Code No.
Critical: None defined.			
Major:	AQL 1.00 percent		
101.	Dimensions of firing pin hole at face of igniter cavity	Gage	32001
102.	Pitch diameter of screw threads	Gage	32002

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Major:	(Continued)		
103.	Depth of threads, min	Gage	32003
104.	Diameter of igniter cavity	Gage	32004
105.	Depth of igniter cavity	Gage	32005
106.	Location of screw holes	Gage	32006
107.	Protective finish incomplete or inadequate	Visual	32007
Minor:	AQL 1.50 percent		
201.	Width of igniter tube slot, min	Gage	32008
202.	Length from igniter tube slot to igniter cavity face, max	Gage	32009
203.	Evidence of poor workmanship (see 3.10)--	Visual	32010

4.3.2.32 Mechanism subassembly (see dwg. 9210171 covering a detail of dwg. 9210199).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Pin spring for firing pin seated at proper depth	Gage	33001
102.	Distance between face of igniter cavity and drilled hole	Gage	33002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)-	Visual	33003

4.3.2.33 Mechanism assembly (see dwg. 9210199 covering a detail of dwg. 9210203).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Clips not staking pawl roll pin	Visual/Manual	34004
* 2.	Retainer clip missing, loose, or improperly assembled	Visual/Manual	34008

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Major:	AQL 0.40 percent		
101.	All rivets and spring pins secure -------	Visual	34005
102.	Components missing, loose, damaged, or improperly assembled ----------	Visual	34006
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)--	Visual	34007

4.3.2.34 Tube, outer (see dwg. 9210150 covering a detail of dwg. 9210172).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
* Major:	AQL 0.40 percent		
102.	Wall thickness ----------	Gage	35003
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10) ----------	Visual	35004

4.3.2.35 Outer tube and mechanism assembly (see dwg. 9210203 covering a detail of dwg. 9210200).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Distance from point of firing pin rod to face of igniter cavity when firing pin is pressed to rearwardmost position (see dwg. 9210199)-----	Gage	36001
Major:	AQL 0.65 percent		
101.	"O" ring missing, damaged, or improperly seated ----------	Visual	36002

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the current version before use.

	Categories	Defects	Method of Inspection	Code No.
	Major:	(continued)		
*	102.	3.60 inch distance from rear end of "O" ring retainer to rear surface of trigger housing	Gage	36003
	103.	Components missing, loose, damaged, or improperly assembled	Visual	36004
*	104.	Inside diameter (see 3.12)	Gage	36006
	Minor:	AQL 0.65 percent		
	201.	Evidence of poor workmanship (see 3.10)	Visual	36005

4.3.2.36 Tube, inner (see dwg. 9210204 covering a detail of dwg. 9210200).

	Categories	Defects	Method of Inspection	Code No.
	Critical:			
*	1.	Wall thickness, minimum (see 3.11)	Gage	37010
	Major:	AQL 0.65 percent		
	101.	Acceptance gage fails to pass through entire length of tube under the maximum specified force	Gage	37002
	102.	Location of holes on aft end	Gage	37003
	103.	Inner tube fails to enter acceptance gage up to tube shoulders under the specified maximum force	Gage	37004
	104.	Protective finish incomplete or inadequate	Visual	37005
	Minor:	AQL 1.50 percent		
	201.	Width of igniter tube slot, min	Gage	37006
	202.	Depth to end of igniter tube slot, min	Gage	37007
	203.	Evidence of poor workmanship (see 3.10)	Visual	37008

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.2.37 Spring, strap, sling (see dwg. 10048638 covering a detail of dwg. 9210201).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Load at test height	Gage	38001
102.	Protective finish incomplete or inadequate	Visual	38002
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	38003

4.3.2.38 Sling assembly (see dwg. 9210201 covering a detail of dwg. 9210200).

Categories	Defects	Method of Inspection	Code No.
Critical:	None defined.		
Major:	AQL 0.40 percent		
101.	Components missing, loose, damaged, or improperly assembled	Visual	39001
Minor:	AQL 0.65 percent		
201.	Evidence of poor workmanship (see 3.10)	Visual	39002

* 4.3.2.39 Launcher, rocket, 66MM, M72A1, metal parts assemby (see dwg. 9210200).

Categories	Defects	Method of Inspection	Code No.
Critical:			
1.	Wall thickness test marking missing	Visual	40019
2.	Pawl not protruding through channel (see 3.9)	Test	40034
3.	Roll pin not inserted through pawl and channel (see 3.9)	Test	40035
4.	Pawl spring improperly assembled (see 3.9)	Test	40036

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the current version before use.

Categories	Defects	Method of Inspection	Code No.
Critical: (Continued)			
5.	Hydrostatic test stamp on inner tube missing	Visual	37001
6.	Hydrostatic test mark on outer tube missing	Visual	35001
Major:	AQL 1.00 percent		
* 101.	Distance between trigger ears and channel with trigger subjected to the specified load	Gage	40001
102.	Connectors loose or improperly crimped on pull pin	Visual	40002
103.	Rubber boots missing or damaged	Visual	40003
104.	Components missing, loose, damaged, or improperly assembled	Visual/Manual	40004
* 106.	Rear sight & boot assembled improperly	Visual	40006
107.	Protective finish incomplete or inadequate	Visual	40007
* 108.	Excessive adhesive	Visual	40008
* Minor:	AQL 1.00 percent		
* 201.	Decals incorrect, illegible, or missing	Visual	40009
* 202.	Evidence of poor workmanship (see 3.10)	Visual	40010

4.3.3 Testing.

4.3.3.1 First article sample (see 4.2.1). The samples submitted as the first article quantity shall be tested as specified herein after being examined 100 percent for the applicable classifications of defects in paragraph 4.3.2.

4.3.3.1.1 Spring embrittlement (see 3.3 and 4.4.1) - Major Defect - Code No. 41001. A sample of 10 of each type of spring used in the assembly shall be selected for the first article sample. The sample shall be tested as specified in 4.4.1. Rejection shall be as specified in 4.2.3.

4.3.3.1.2 Visual inspection for protrusion or recession on the firing pin channel of the firing pin housing (see dwg. 9210169)- Major Defect - Code No. 32011. A sample of ten firing pin housings shall be selected for the first article sample for this examination. Each of the firing pin housings shall be sectioned longitudinally along the firing pin channel vertical centerline. Visual inspection

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the current version before use.

of each of the sections shall be performed to determine if protrusions or recessions (ledges, burrs, raises, etc.) not shown on the drawing are present in the firing pin channel of the firing pin housing. Rejection shall be as specified in 4.2.3.

4.3.3.1.3 Hydrostatic test of inner tube (see dwg. 9210204) - Critical Defect - Code No. 37009. A sample of ten inner tubes shall be selected for the first article sample, and tested as specified in 4.4.2, using test equipment specified in 4.3.4. Rejection shall be as specified in 4.2.3

4.3.3.1.4 Hydrostatic test of outer tube (see dwg 9210150) - Critical Defect - Code No. 35006. A sample of 10 outer tubes be selected for the first article sample for this test. The test shall be performed as specified in 4.4.3.2, using test equipment specified in 4.3.4. Rejection shall be as specified in 4.2.3.

4.3.3.1.5 External hydrostatic test of outer tube (see dwg. 9210150) - Major defect - Code No. 35007. A sample of 10 outer tubes shall be selected for the first article sample for this test. The test shall be performed as specified in 4.4.4, using test equipment specified in 4.3.4. Rejection shall be as specified in 4.2.3.

4.3.3.1.6 Test of the bimetallic element.

4.3.3.1.6.1 Angular rotation (see dwg. 9210213) - Major Defect-Code No. 06004. A sample of 10 bimetallic elements shall be selected for the first article sample for this test. The test shall be performed as specified in 4.4.5.1, using test equipment specified in 4.3.4. Rejection shall be as specified in 4.2.3.

4.3.3.1.6.2 Contraction cycling (see dwg. 9210213) - Major Defect - Code No. 06005. A sample of 10 bimetallic elements shall be selected for the first article sample for this test. The test shall be performed as specified in 4.4.5.2 using test equipment specified in 4.3.4. Rejection shall be as specified in 4.2.3.

4.3.3.1.7 Test of rear sight.

4.3.3.1.7.1 Seal of rear sight assembly (see dwg. 9210205) - Major Defect - Code No. 09004. A sample of 10 rear sight assemblies shall be selected for the first article sample for this test. The test shall be performed as specified in 4.4.6.1, using test euipment specified in 4.3.4. Rejection shall be as specified in 4.2.3.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:20Z
Check the source to verify that this is the currentversion before use.

4.3.3.1.7.2 Rate of contraction of bimetallic element (see dwg. 9210213) - Major Defect - Code No. 09006. A sample of 10 rear sight assemblies shall be selected for the first article samples for this test. The test shall be performed as specified in 4.4.6.3, using test equipment specified in 4.3.4. Rejection shall be as specified in 4.2.3.

4.3.3.1.8 Operability of launcher (see 3.4) - Major Defect - Code No. 40012. A sample of 30 complete launcher assemblies shall be selected for the first article sample and tested as specified in 4.4.7. Rejection shall be as specified in 4.2.3.

4.3.3.1.9 Trigger action. The 30 complete launcher assemblies as tested in 4.3.3.1.8 shall be submitted to the following tests:

4.3.3.1.9.1 "SAFE" position, non-functioning (see 3.5.1) - Critical Defect - Code No. 40013. The test shall be performed as specified in 4.4.8.1. Rejection shall be as specified in 4.2.3.

4.3.3.1.9.2 "ARM" position, non-functioning (see 3.5.2) - Critical defect - Code No. 40014. The test shall be performed as specified in 4.4.8.2. Rejection shall be as specified in 4.2.3.

4.3.3.1.9.3 Functioning of the trigger mechanism (see 3.5.3) - Major Defect - Code No. 40015. The test shall be performed as tested in 4.4.8.3. Rejection shall be as specified in 4.2.3.

4.3.3.1.10 Functioning of the firing pin (see 3.6) - Major Defect - Code No. 40016. The complete launcher assemblies as tested in 4.3.3.1.9 shall be utilized for this test. The test shall be performed as specified in 4.4.9, using test equipment specified in 4.3.4. Rejection shall be as specified in 4.2.3.

4.3.3.1.11 Sight alignment test (see dwg. 9210200) - Major Defect - Code No. 40011. The 30 complete launcher assemblies as tested in 4.3.3.1.10 shall be utilized for this test. The sight alignment shall be checked using test equipment as specified in 4.3.4. Rejection shall be as specified in 4.2.3.

4.3.3.1.12 Environmental operability (see 3.8). The 30 complete launcher assemblies as tested in 4.3.3.1.11 shall be utilized for this test. Testing and sampling shall be in accordance with Table I using test equipment specified in 4.3.4. Rejection shall be as specified in 4.2.3. Samples utilized for this test shall be considered as destructive test samples.

Source: https://assist.dla.mil -- Downloaded: 202640-26T04:20Z
Check the source to verify that this is the currentversion before use.

TABLE I

	Environmental Phase	Sample	Test Procedure	Classification	Code No.
	A. Five-Foot Drop	15	4.4.10.1		
			4.3.3.1.8 (Non-operable)	Major	40020
			4.3.3.1.9.1 (Functioning in safe position)	Critical	40021
			4.3.3.1.9.2 (Functioning below minimum load)	Special (see 6.5)	40022
			4.3.3.1.9.3 (Non-functioning of trigger mechanism)	Major	40023
			4.3.3.1.10 (Non-functioning of firing pin)	Major	40024
*			4.3.3.1.11 (Sights not aligned)	(For information only)	
	B. Transporation	15	4.4.10.2		
	Vibration		MIL-STD-810, Method 514		
			4.3.3.1.8 (Non-operable)	Major	40026
*			4.3.3.1.9.1 (Functioning in safe position)	Critical	40027
*			4.3.3.1.9.2 (Functioning below minimum load	Special (see 6.5)	40028
			4.3.3.1.9.3 (Non-Functioning of trigger mechanism)	Major	40029
			4.3.3.1.10 (Non-Functioning of firing pin)	Major	40030
			4.3.3.1.11 (sights not aligned)	Major	40031

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.3.2 Production.

4.3.3.2.1 Spring embrittlement (see 3.3 and 4.4.1) - Major Defect - Code No. 41001. A sample of 10 of each type of spring used in the assembly, except for the spring, pawl, dwg. no. 9210155, shall be selected from each heat treatment batch. A sample of 25 shall be selected from each heat treatment batch of pawl springs. The sample shall be tested as specified in 4.4.1 and the heat treatment batch shall be rejected if one or more springs are classed defective.

4.3.3.2.2 Visual inspection for protrusions or recession on the firing pin channel of the firing pin housing (see dwg. 9210169)- Major Defect - Code No. 32011. A sample of ten firing pin housings shall be selected from each lot for this examination. Each of the firing pin housing shall be sectioned longitudinally along the firing pin channel vertical centerline. Visual inspection of each of the sections shall be performed to determine if protrusions or recessions (ledges, burrs, raises, etc.) not shown on the drawing are present in the firing pin channel of the firing pin housing. If one or more protrusions are present, the lot shall be rejected.

* 4.3.3.2.3 Hydrostatic test of inner tube (see 9210204 and 3.11) - Critical Defect - Code No. 37009. This test shall be performed 100 percent. The test shall be performed as specified in 4.4.2, using test equipment specified in 4.3.4. Launcher inner tubes which are classed defective shall be removed from the lot.

4.3.3.2.4 Internal hydrostatic test of outer tube.

* 4.3.3.2.4.1 Non-destructive (see 9210150 and 3.11) - Critical Defect - Code No. 35005. This test shall be performed 100 percent. The test shall be performed as specified in 4.4.3.1 using test equipment specified in 4.3.4. Launcher outer tubes which are classed defective shall be removed from the lot.

4.3.3.2.4.2 Destructive (see dwg. 9210150) - Critical Defect - Code No. 35006. A sample of 15 outer tubes shall be selected from each lot for this test. The test shall be performed as specified in 4.4.3.2, using test equipment specified in 4.3.4. If one or more outer tubes are classed defective, the lot shall be rejected.

4.3.3.2.5 External hydrostatic test of outer tube (see dwg. 9210150) - Major Defect - Code No. 35007. A sample of 15 outer tubes shall be selected from each lot for this test. The test shall be performed as specified in 4.4.4, using test equipment specified in 4.3.4. If one or more tubes are classed defective, the lot shall be rejected.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.3.2.6 Test of the bimetallic element.

4.3.3.2.6.1 Angular rotation (see dwg. 9210213) - Major Defect - Code No. 06004. A sample of 50 bimetallic elements shall be selected from each lot for this test. The test shall be performed as specified in 4.4.5.1, using test equipment specified in 4.3.4. If one or more assemblies are classed defective, the lot shall be rejected.

4.3.3.2.6.2 Contraction cycling (see dwg. 9210213) - Major Defect - Code No. 06005. A sample of 50 bimetallic elements shall be selected from each lot for this test. The test shall be performed as specified in 4.4.5.2 using test equipment specified in 4.3.4. If one or more assemblies are classed defective, the lot shall be rejected.

4.3.3.2.7 Test of rear sight.

4.3.3.2.7.1 Seal of rear sight assembly (see dwg. 9210205) - Major Defect - Code No. 09004. This test shall be performed 100 percent. The test shall be performed as specified in 4.4.6.1, using test equipment specified in 4.3.4. Rear sight assemblies which are classed defective shall be removed from the lot.

4.3.3.2.7.2 Relative humidity of assembly atmosphere (see dwg. 9210205) - Major Defect - Code No. 09005. This test shall be performed 100 percent and as specified in 4.4.6.2 using test equipment as specified in 4.3.4. Rear sight assemblies which are classed defective shall be removed from the lot.

4.3.3.2.7.3 Rate of contraction of bimetallic element (see dwg. 9210213) - Major Defect - Code No. 09006. A sample of 50 rear sight assemblies (dwg. 9210205) shall be selected from each lot for this test. The test shall be performed as specified in 4.4.6.3, using test equipment specified in 4.3.4. If one or more assemblies are classed defective, the lot shall be rejected.

* 4.3.3.2.8 Sight alignment (see dwg. 9210200) - Major Defect Code No. 40011. This test shall be performed 100 percent per EL 9210200. Sight alignment shall be gaged using test equipment specified in 4.3.4. Launchers with sights which fail to comply with the specified requirement shall be classed defective and removed from the lot.

4.3.3.2.9 Operability of launcher (see 3.4) - Major Defect - Code No. 40012. This test shall be performed 100 percent and as specified in 4.4.7. Launcher assemblies which are classed defective shall be removed from the lot.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.3.2.10 Trigger action.

4.3.3.2.10.1 "SAFE" position, non-functioning (see 3.5.1) - Critical Defect - Code No. 40013. This test shall be performed 100 percent. The test shall be performed as specified in 4.4.8.1. Launcher assemblies which are classed defective shall be removed from the lot.

4.3.3.2.10.2 "ARM" position, non-functioning (see 3.5.2) - Critical Defect - Code No. 40014. This test shall be performed 100 percent and as specified in 4.4.8.2. Launcher assemblies which are classed defective shall be removed from the lot.

4.3.3.2.10.3 Functioning of the trigger mechanism (see 3.5.3) - Major Defect - Code No. 40015. This test shall be performed 100 percent. The test shall be performed as specified in 4.4.8.3. Launcher assemblies which are classed defective shall be removed from the lot.

4.3.3.2.11 Functioning of the firing pin (see 3.6) - Major Defect - Code No. 40016. This test shall be performed 100 percent and as specified in 4.4.9, using test equipment specified in 4.3.4. Launcher assemblies which are classed defective shall be removed from the lot.

4.3.3.2.12 Environmental operability (see 3.8). Testing and sampling shall be in accordance with Table I using test equipment specified in 4.3.4. If one or more launchers are classed defective, the lot shall be rejected. Samples utilized for this test shall be considered as destructive test samples.

4.3.4 Inspection equipment. Equipment Tabulation Number ET-9210200 identifies the inspection equipment required to perform the examinations and tests prescribed in this section. The contractor shall design inspection equipment in accordance with the instructions in paragraph 6.3.

4.3.4.1 Government rights to documentation. Inspection equipment drawings and lists provided and revised in accordance with the requirements of the ET may be used by DOD activities for design, procurement, manufacture, testing, evaluation, production and receiving inspection, overhaul, shipping, storage, identification of stock, ordering and storage of replacement parts, inspection of items at overhaul, general maintenance of equipment, construction, survey and whenever inspection equipment drawings are needed.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.3.4.2 Supply and maintenance. Supply and maintenance of the equipment listed on the ET shall be in accordance with Specification MIL-I-45607.

4.3.4.3 Government use of contractor's inspection equipment. The contractor shall make available to the Government all inspection equipment necessary for determining conformance with contract requirements. Personnel for operating the equipment and verification of its accuracy shall be supplied by the contractor for the performance of examination or test by the Government.

4.4 Test methods and procedures.

4.4.1 Spring embrittlement. The spring shall be extended in a manner representative of actual functioning (i.e., bending, twisting, tension) until the spring no longer returns to its original condition. The spring shall be classed defective if it breaks prior to this point.

4.4.2 Hydrostatic test of inner tube. The inner tube shall be placed in the specified test fixture with the tube supported at each end with the sidewalls unrestricted to allow the tube to deform. The non-destructive internal hydrostatic pressure specified on the applicable drawing shall be applied and maintained for the required period of time. Any tube which bursts, cracks, dents or deforms in excess of the drawing dimensions shall be classed defective. This test may be performed prior to or after drilling holes.

4.4.3 Internal hydrostatic test of outer tube.

4.4.3.1 Non-destructive. The outer tube shall be placed in the specified test fixture with the tube supported at each end with the sidewalls unrestricted to allow the tube to deform. The non-destructive internal hydrostatic pressure specified on the applicable drawing shall be applied and maintained for the required period of time. Any tube which bursts, cracks, separates, leaks, or deforms in excess of the drawing dimensions shall be classed defective.

4.4.3.2 Destructive. The outer tube shall be placed in the specified test fixture with the tube supported at each end with the sidewalls unrestricted to allow the tube to deform. The internal hydrostatic pressure shall be applied and gradually increased until a pressure is reached where the tube bursts or cracks. Any tube which bursts or cracks below the specified burst pressure shall be classed defective.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.4.4 External hydrostatic test of outer tube. The outer tube shall be placed in the specified test fixture with the tube supported at each end with the sidewalls unrestricted to allow the tube to deform. The external hydrostatic pressure specified on the applicable drawing shall be applied and maintained for the required period of time. Any tube which fails to comply with the applicable drawing requirements shall be classed defective.

4.4.5 Test of the bimetallic element.

4.4.5.1 Angular rotation. The bimetallic element shall be placed in the specified test fixture with the element clamped at one end. The test fixture should then be conditioned to the specified extreme cold temperature and measurement taken of the angular position of the free end. The test fixture shall then be conditioned to the specified extreme hot temperature and measurement taken of the new angular position of the free end. Any element in which the difference of the two readings does not comply with the drawing requirements , shall be classed defective. Sequence of conditioning is optional.

4.4.5.2 Contraction cycling. The bimetallic element shall be placed in the specified test fixture with the element clamped at one end. The test fixture should then be conditioned to the specified extreme hot temperature and measurement taken of the coil height. The test fixture shall then be conditioned to specified extreme temperature. Repeat the hot-cold temperature cycling until the drawing specified minimum cycling has been completed. On completion of the cycling, the test fixture should then be conditioned to the specified extreme hot temperature and measurement taken of the coil height. Any element in which the difference of the two readings does not comply with the drawing requirements shall be classed defective.

4.4.6 Test of rear sight assembly (see dwg. 9210205).

4.4.6.1 Seal of rear sight assembly. The rear sight assembly shall be placed in the specified test fixture and shall be subjected to the specified pressure differential. If any assembly causes a detectable pressure change in 10 seconds, the rear sight assembly shall be classed defective and removed from the lot.

4.4.6.2 Relative humidity of assembly atmosphere. Continuous monitoring equipment shall record the relative humidity in the rear sight assembly area. This record shall be observed at the beginning and at the end of each day's production and at four hour intervals throughout continuous production. If during any interval the relative humidity exceeds the specified level, the rear sight assemblies produced during the time interval shall be classed defective.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.4.6.3 Rate of contraction of bimetallic element. The rear sight assembly shall be placed in the specified test fixture and the rate of contraction of the bimetallic element (see dwg. 9210213) shall be measured as follows: The rear sight assembly should be conditioned to the specified extreme cold temperature and measurement taken of the coil height. The rear sight assembly shall then be conditioned to the specified extreme hot temperature and measurement taken of new coil height. Prior to reaching the specified extreme lot temperature, the rear sight assembly shall be conditioned to an intermediate temperature (record temperature and coil height) to determine linearity. Any rear sight assembly which does not comply with the drawing requirements shall be classed defective. The sequence of temperature conditioning is optional.

* 4.4.7 Operability of launcher. The complete assembly, less sling, shall be extended from the fully closed position and inspected as follows: A gradual rearward force shall be applied to the inner tube until movement of the inner tube occurs. The minimum continous force required to sustain this movement to the fully-extended locked position of the launcher shall be applied. Observation shall be made of the inspection equipment to determine the maximum force required to extend the launcher. Observation shall be made to determine if the firing pin is withdrawn to the cocked position. Observation shall be made to determine that the rear sight has assumed a fully erect position as is indicated by the rear sight resting against the stopping edge of the rear sight bracket. Observation shall be made to determine that the front sight has assumed a fully erect position as indicated by the sight bracket resting against the edge of the cutout in the trigger housing. Observation shall be made for proper operation of the detent lever which locks the launcher in the extended position and when depressed, moves out of position to permit launcher closing. In closing the launcher, the detent lever shall be depressed and the front sight and bracket should be folded into the cutout in the trigger housing and the rear sight folded into the rear sight cover. Observation shall be made to determine that the front sight fits freely into the cutout and slides under the detent lever and the rear sight fits freely into the rear sight cover. Observation shall be made that when the detent is depressed and closing action initiated the trigger safety freely returns from the armed to the safe position. The launcher shall be classed defective if it fails to comply with any of the specified requirements.

4.4.8 Trigger action (see 3.5). The launcher shall be fully extended and locked. Observation shall be made that the firing pin is withdrawn to the cocked position and the following test sequences shall be performed.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

4.4.8.1 Safe position, non-functioning. With the trigger safety handle in the "SAFE" position, the specified "SAFE" position, non-functioning, minimum load shall be applied to the forward raised portion of the trigger boot in a direction perpendicular to the top surface of the trigger housing. While the specified load remains applied, the firing pin rod shall be pressed downward, in a manner which does not restrain firing pin rearward movement, until the firing pin rod bottoms against the base of the channel. The assembly shall be classed defective if the firing pin is released.

4.4.8.2 "ARM" position, non-functioning. The trigger safety handle shall be extended until it locks in the "ARM" position. Observation shall be made that the trigger safety handle is locked in the armed position prior to performing the test. The specified "ARM" position non-functioning minimum load shall be applied to the forward raised portion of the boot in a direction perpendicular to the top surface of the trigger housing. If the firing pin is released, the assembly shall be classed defective.

4.4.8.3 Functioning of the trigger mechanism. With the trigger safety handle locked in the "ARM" position, the specified functioning maximum load shall be applied to the forward raised portion of the trigger boot, in a direction perpendicular to the top surface of the trigger housing. If the firing pin is not released, the assembly shall be classed defective.

4.4.9 Functioning of the firing pin. The launcher shall be fully extended. The test slug shall be inserted in the igniter cavity and shall be held firmly against the firing pin hole in the firing pin housing. No attempt to center the slug in the cavity shall be permitted. The trigger safety handle shall be extended until it is locked in the "ARM" position and the launcher shall be "fired". The test slug shall be examined and the launcher classed defective if the test slug shows no evidence of indentation by the firing pin or if the indentation is not within the inscribed circle.

4.4.10 Environmental operability.

4.4.10.1 Five-Foot drop test. The launchers shall be assembled with an inert simulated complete round and with a sling assembly prior to performance of the test. The systems shall be dropped on a concrete surface from the following orientations:

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the current version before use.

a. Horizontal orientation to allow impact on the trigger housing (5 samples).

b. Nose-Down orientation (5 samples).

c. Base-Down orientation (5 samples).

4.4.10.2 Transporation vibration test. The launcher shall be assembled with an inert simulated complete round and with a sling assembly prior to performance of the test. Five systems shall be packed per carton (see dwg. 9227925) and submitted to the specified vibration test. The resonance search and resonance dwell sections of the specified vibration test shall not be performed.

4.4.11 Radiographic examination. The launcher in the closed position shall be fluoroscopically examined by making one observation perpendicular to the longitudinal axis of the launcher and a second observation perpendicular to the first observation. Test equipment shall be as specified in 4.3.4. If the examination reveals the pawl, pawl spring, or roll pin are not assembled in accordance with the drawing requirements, the launcher shall be considered defective.

5. PREPARATION FOR DELIVERY

5.1 Packaging, packing and marking. The launcher components, as specified below, shall be packaged, packed and marked in accordance with MIL-STD-1169, level C, and the following details:

5.1.1 Launcher, partially assembled. The launcher shall be closed without sling assembly and cover assembly firing pin housing, and with the rear cover left loose. To protect gasket, insert 1/16 inch thick commercial chipboard approximately 3-1/4 inches square between rear cover assembly and inner tube retainer ring of each partially assembled launcher. Sixteen launchers so prepared shall be packaged in a PPP-B-636, Class Domestic, Variety DW, Grade 275, Style RSC, Fiberboard box. Full length separators consisting of half-slotted partitions shall be assembled to form 16 individual cells in a 4 by 4 arrangement. A filler pad shall be inserted in the bottom of the box and one or more filler pads shall be added on top of contents as required to provide a tight pack. The separators and filler pads shall be constructed of fiberboard conforming to PPP-F-320, Class Domestic, Variety SW, Grade 125, A or C Flute. The box size shall be approximately 19 11/16 by 15 7/8 by 25 1/4 inches deep, inside dimensions. Size of filler pads shall be approximately the inside box dimensions less 1/16 inch. The box shall be closed in accordance with the Appendix of the Fiberboard Box specification.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

5.1.2 Sling assembly (dwg. 9210201). Not more than 100 sling assemblies shall be packed per shipping container.

5.1.3 Cover assembly firing pin housing (dwg. 9210224). Not more than 500 housings shall be packed per carton and not more than 10 cartons shall be packed per shipping container.

5.1.4 Screws, MS35190-251. Not more than 1,000 screws shall be packed in a suitable bag or box. Packages shall be overpacked in accordance with MIL-STD-1169 for shipment. Alternatively packaged screws may be combined with packaged housings (see 5.1.3) for shipment.

6. NOTES

6.1 Ordering data. Procurement documents shall specify the following:

a. Title, number and date of this specification.

b. Data Cards shall be prepared for each lot in accordance with the information specified in MIL-STD-1167.

6.2 Inspection code numbers. The five digit code numbers assigned to the inspections herein are to facilitate future data collection and analysis by the Government. All submitted designs shall contain a reference to the applicable 5 digit code number contained in Section 4 of this specification and the appropriate component or assembly drawing number and revision letter to which the specific design applies.

6.3 Inspection equipment. The contractor shall design inspection equipment as required by the referenced inspection Equipment Lists (EL) in accordance with the instructions of paragraphs 6.3.1 through 6.3.5.

6.3.1 Inspection equipment lists. Inspection equipment lists indicate the availability of inspection equipment designs by showing in the "number" column of the list of inspection equipment (Form SMUPA 1010) the numbers of drawings or Federal Stock Numbers of existing equipment designs, or codes as indicated in paragraph 6.3.2. Design action required of the contractor is described in paragraphs 6.3.3 and 6.3.4. The contractor will be required to prepare detailed drawings in accordance with 6.3.4 for all the equipment coded as "Contractor Design" in the number column. These contractor designs must be approved by the Government prior to fabrication or procuring of the equipment. Designs shall be submitted for approval as specified in 6.3.5.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

6.3.2 Inspection equipment list codes. The inspection equipment as defined in 6.3.3 and 6.3.4 will be designated in the EL by the following codes:

CD - Contractor design on controlled contractor format and/or commercial equipment.

MU - Army design, mandatory for use.


6.3.3 Army designs. Army designs are reflected on detailed drawings which completely depict all the information necessary for the fabrication of the item of inspection equipment. The contractor need provide no design when an Army design is listed for an item of inspection equipment. Army designs fall into two basic classifications; mandatory (designated "MU") and non-mandatory (indicated by drawing or Federal Stock Number). When an inspection equipment list reference mandatory Army designs, the contractor shall comply with, and use these designs accordingly. The contractor may, however, in connection with non-mandatory designs, and with the approval of the Government, design alternate inspection equipment or use comparable commercial equipment to facilitate his operations. Such contractor prepared designs or commercial equipment selections must be approved by the Government prior to fabrication or procuring of the equipment. Designs shall be submitted for approval as specified in 6.3.5.

6.3.4 Contractor designs. Contractor designs are designs of inspection equipment for which the Government has assigned design responsibility to the contractor. Contractor designs shall be supported by detailed drawings which depict all information necessary to completely fabricate, calibrate and operate an item of inspection equipment. This requires that the necessary views, dimensions, materials, finish, notes, operating and calibration instructions be properly depicted in accordance with approved practices to the extent that further calculation or clarification will not be required. Unless otherwise specified, contractor designs may be developed on the format the contractor normally employs in his equipment design procedure provided such format reflects the detail and information specified above, subject to the following controls: All submitted contractor designs shall conform to MIL-D-1000, Category E, Form 2. Legibility and reproducibility shall permit conventional making of clearly understandable, high contrast reproductions. Contractors shall submit one copy of final designs as a rolled set. Designs shall be submitted for approval as specified in 6.3.5.

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the currentversion before use.

6.3.5 Submission of contractor designs. Unless otherwise specified on the EL, all designs of equipment for inspection of defects classified as critical and major shall be submitted for approval to the Commanding Officer, Picatinny Arsenal, ATTN: SARPA-QA-T-T. All other designs of inspection equipment shall be approved by the inspection element of the agency administering the contract; submission shall be as directed by the contracting officer. Partial submission of inspection equipment designs is permissible and encouraged. However, the Arsenal completion date for design review will be based on the date of the final submission of designs. Picatinny Arsenal design review will be accomplished normally within one month after receipt.

6.4 Submission of first article sample. Instructions, as to the location for the evaluation of the first article sample, shall be obtained from the contracting officer. Upon receipt of such request, the contracting officer shall advise Picatinny Arsenal and instructions will be issued accordingly. All inquiries should be forwarded to: Commanding Officer, Picatinny Arsenal, ATTN: SARPA-QA-I.

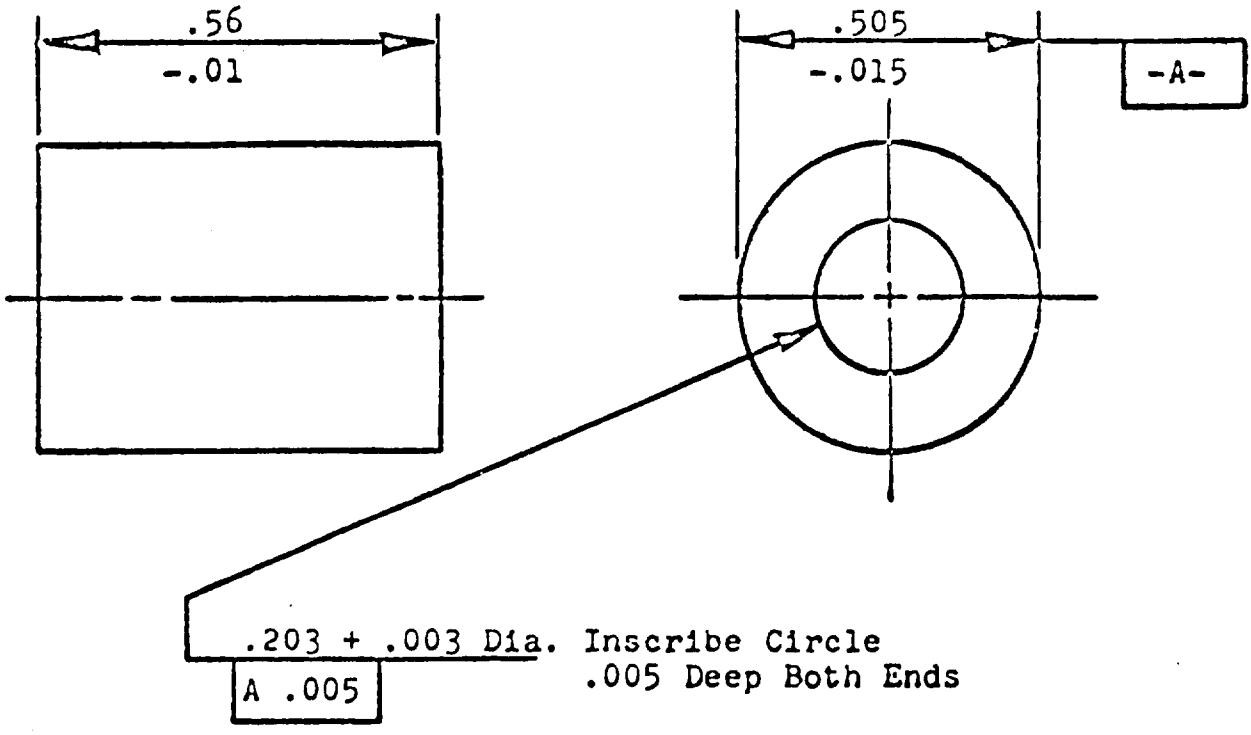

Material-Lead, Grade B, C or D
See Specification QQ-L-201.

FIGURE I

TEST SLUG

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

6.5 Special defect. A special defect is defined as a defect that judgement and experience indicate could, depending on the degree of variance from the design requirement, result in hazardous or unsafe conditions for individuals using, maintaining, or depending upon the product.

* 6.6 Changes to previous issue. The margins of this specification are marked with an asterisk to indicate where changes (additions, modification, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

Custodian:
Army - MI

Review activity:
Army - PA

Preparing Activity:
Army - MI

Project No. 1340-A450

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T04:20Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426

REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY
DOD – 314

U.S.MAIL

OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

Commander
US Army Missile Command
ATTN: AMSMI-RCS
Redstone Arsenal, AL 35809

FOLD

Source: https://assist.dla.mil -- Downloaded: 202610-26T04:20Z
Check the source to verify that this is the current version before use.