Inspection and Quality Control
HANDBOOK (Interim) **H 107**

SINGLE-LEVEL CONTINUOUS SAMPLING PROCEDURES AND TABLES FOR INSPECTION BY ATTRIBUTES



30 APRIL 1959

OFFICE OF THE ASSISTANT SECRETARY OF DEFENSE
(Supply and Logistics)
WASHINGTON 25, D.C.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

DEPARTMENT OF DEFENSE
Office of the Assistant Secretary of Defense
(Supply and Logistics)
Washington 25, D.C.

3

Single-Level Continuous Sampling Procedures and Tables for Inspection by Attributes

Inspection & Quality Control
H-107

This handbook (interim) was developed by the Ordnance Corps in the Department of the Army on behalf of the Office of the Assistant Secretary of Defense (Supply and Logistics). It provides information on the basic principles of single-level continuous sampling inspection by attributes, and includes instructions for the selection and administration of the sampling inspection procedures.

Single-level continuous sampling plans are useful in procurement, storage and maintenance inspection operations when lot accumulation is not feasible. This publication is issued to make such plans available to those in the Department of Defense and in industry who are concerned with resolving inspection and quality control problems to which such techniques might apply.

Suggestions for improvements of this handbook should be addressed to the Office of the Assistant Secretary of Defense (Supply and Logistics), Washington 25, D. C.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

FOREWARD

This handbook has been prepared to meet the growing need for a set of instructions on the inspection of product which is submitted on a continuous basis rather than in a series of groupings of product, i.e., lots. In this connection the handbook will serve as a supplement to MIL-STD-105. The handbook may be used to inspect product which is submitted by a conveyorized process or by other straight-line materials handling methods. MIL-STD-105 will continue to be used to inspect product which is submitted in definable groups or lots. It should be pointed out that the adoption of this handbook does not preclude the use of the so-called "moving lot" provisions of MIL-STD-105; it merely presents a set of plans specifically designed to inspect moving product.

The plans provided in this handbook, unlike many other sampling plans, include both a single level of sampling inspection and screening. An integral part of the operation of the plans is the alternation of sequences of screening and sampling. The screening raises the average outgoing quality to a level which meets pre-set standards.

The primary advantage of the plans in this handbook, when applicable, is that they allow acceptance of product, for the defects concerned, as the product passes the inspection station. This feature eliminates the necessity for recall, disassembly, and reinspection of rejected material. Other advantages are the reduction or elimination of storage facilities and a decrease in interference with production operations due to the required lotting on the line. The plans are suitable for single-level sampling inspection and are adaptable to inspection either by defect or by defective.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE OF CONTENTS

Paragraph	Title	Page
Foreward		ii
1.	SCOPE	
1.1	Purpose	1
1.2	Applicability	1
1.3	Supplier-Consumer Concept	1
2.	DEFINITIONS OF INSPECTION TERMS	
2.1	Inspection	1
2.2	Inspection by attributes	1
2.3	Unit of Product	1
2.4	Moving Product	1
2.5	Defect	2
2.6	Defective	2
2.7	Sampling Frequency	2
2.8	Clearance Number, i	2
3.	CLASSIFICATION OF DEFECTS	
3.1	Definition	2
3.2	Critical Defects	2
3.3	Major Defects	2
3.4	Minor Defects	2
4.	PRODUCT NONCONFORMANCE	
4.1	Defects Versus Defectives	2
4.2	Percent Defective	3
5.	ACCEPTABLE QUALITY LEVEL (AQL) AND AVERAGE OUT-GOING QUALITY LIMIT (AOQL)	
5.1	AQL	3
5.2	AOQL	3
5.3	Indexing of Sampling Plans	3
6.	SUBMITTAL OF PRODUCT	
6.1	Lot	4
7.	ACCEPTABILITY OF PRODUCT	
7.1	Determination of Acceptability	4
7.2	Acceptance	4
7.3	Inspection for Critical Defects	4

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE OF CONTENTS (Cont)

Paragraph	Title	Page
8.	DRAWING OF SAMPLES	
8.1	Sample Unit	4
8.2	Frequency of Sampling	4
8.3	Sample Selection	4
9.	OPERATION OF THE PLANS	
9.1	Types of Inspection	5
9.2	Qualification of Production for Sampling Inspection	6
9.3	Types of Plans	6
9.3.1	Administration of CSP-1 and CSP-2 Plans	7
9.3.2	CSP-A Plans	9
9.4	Order of Production	11
10.	INSPECTION STATIONS	
10.1	Within a Station	11
10.2	Multi-Station	11
11.	DISPOSITION OF REJECTED PRODUCT	11
12.	PROCESS AVERAGE	
12.1	Definition	12
12.2	Computation	12

FIGURES

Figure 1.	Procedure for CSP-1 Plans	13
Figure 2.	Procedure for CSP-2 Plans	14
Figure 3.	Procedure for CSP-A Plans	15

TABLES

Table I	AQL Values, in %	3a
Table II	Sampling Frequency Code Letters	5
Table III-A	Values of $\underline{i}$ and $\underline{a}$ for CSP-A Plans	16
Table III-1	Values of $\underline{i}$ for CSP-1 Plans	18
Table III-2	Values of $\underline{i}$ for CSP-2 Plans	19
Table IV-A	Values of L for CSP-1 Plans	20
Table IV-B	Values of L for CSP-2 Plans	21

APPENDIX

Characteristic Curves for Single-Level Continuous Sampling Plans 25

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

1. SCOPE

1.1 Purpose. This handbook establishes sampling plans and procedures for use in the determination of acceptability of products in procurement, supply and storage, and maintenance inspection operations. When applicable and desirable, this handbook shall be referenced in the specification, contract or inspection instructions and the provisions set forth herein shall govern.

1.2 Applicability. Prerequisites for the application of these sampling plans are:

(a) Moving product (see 2.4),
(b) Ample physical facilities at the site of manufacture to permit rapid 100% inspection when necessary,
(c) Relative ease of inspection, and
(d) A process which is producing or is capable of producing homogeneous material (see 9.2 (a)).

1.3 Supplier-Consumer Concept. This handbook has been written in the supplier-consumer concept to permit maximum flexibility for application in all areas of procurement, supply and storage, and maintenance inspection operations. For those procurement applications where the Government is the consumer, the Government reserves the right to specify the procedures to be followed by the supplier (contractor) and also to perform any amount of inspection deemed necessary.

2. DEFINITIONS OF INSPECTION TERMS

2.1 Inspection. Inspection means the examination of supplies, (including, when appropriate, raw materials, components and intermediate assemblies) to determine whether the supplies conform to contract requirements, which include all applicable drawings, specifications and purchase descriptions.

2.2 Inspection by Attributes. Inspection by attributes is inspection wherein certain characteristics of the sample units are inspected and classified simply as conforming, or not conforming, to specified requirements.

2.3 Unit of Product. The term "unit of product" is the entity of product inspected in order to determine its classification as defective or non-defective. The unit may be a single article, a pair, a set, a length, an area, a volume, etc., of the finished product or component thereof. The unit of product may or may not be the same as the unit of purchase, supply, production or shipment.

2.4 Moving Product. The term "moving product" refers to product which is flowing past the inspection station. In the typical case the product moves on a conveyor belt or line; however, it may be moved in tote boxes, buggies or other conveyances which are operated manually or by mobile materials-handling equipment.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

2.5 Defect. A defect is any deviation of the unit of product from requirements of the specifications, drawings, purchase descriptions and of any changes thereto in the contract or order. Defects are normally classified according to severity (see 3.). In these sampling plans, inspection may be performed by judging a class of defects or by judging an individual defect from a class independently of all other defects in that class.

2.6 Defective. A defective is a unit of product containing one or more defects.

2.7 Sampling Frequency, f. The sampling frequency, f, which is stated as a fraction of the form 1/X means that one unit shall be drawn, in a random manner, from approximately every X units. 10

2.8 Clearance Number, i. The clearance number, i, is the number of successively inspected units which must be found free of defects considered before a certain action to change the inspection procedure can be taken. (See Figures 1-3 for a description of the applicable action.)

3. CLASSIFICATION OF DEFECTS

3.1 Definition. A classification of defects is an enumeration of pertinent defects of the unit of product classified according to their importance.

3.2 Critical Defects. A critical defect is a defect that judgment and experience indicate could result in hazardous or unsafe conditions for individuals using or maintaining the product or, for major end-item units of product, such as ships, aircraft or tanks, a defect that could prevent performance of their tactical function.

3.3 Major Defects. A major defect is a defect, other than critical, that could result in failure or materially reduce the usability of the unit of product for its intended purpose.

3.4 Minor Defects. A minor defect is one that does not materially reduce the usability of the unit of product for its intended purpose, or is a departure from established standards having no significant bearing on the effective use or operation of the unit of product.

4. PRODUCT NONCONFORMANCE

4.1 Defects Versus Defectives. The sampling plans presented in this handbook may be used to make decisions on the product on the basis of either a particular defect considered individually or all defects of a given class considered collectively. When inspection is performed for an individual defect, this defect

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

shall be judged independently of all other defects. When inspection is performed for a class of defects, this class shall be judged independently of all other classes. In either case the expression of nonconformance of product shall be the percent defective.

4.2 Percent Defective. The percent defective of any given quantity of product is the number of defective units multiplied by 100 and divided by the total number of units of product inspected. Where an individual defect or a class comprising one defect is the basis for making a decision, the percent defective is merely the number of units containing the particular defect multiplied by 100 and divided by the total number of units of product inspected.

5. ACCEPTABLE QUALITY LEVEL (AQL) AND AVERAGE OUTGOING QUALITY LIMIT (AOQL)

5.1 AQL. The Acceptable Quality Level (AQL) is a nominal value expressed in terms of percent defective and serves as an index to the sampling plans to be used. Certain numerical values of AQL ranging from 0.015 to 10.0 are presented in Table I. When the AQL is specified in the form of a range, it should be treated as if it were equal to that value of AQL for which the sampling plans are furnished and which is included within the range. When the specified AQL is a particular value other than those for which sampling plans are furnished, the AQL to be used in applying the provisions of this handbook is shown in Table I.

5.2 AOQL. The Average Outgoing Quality Limit (AOQL) (stated as a percentage) is the largest fraction of defective material, which is expected on the average to pass inspection when the associated sampling plan is followed faithfully.

5.3 Indexing of Sampling Plans. The sampling plans included in this handbook are indexed by AQLs and also by approximate corresponding AOQLs.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE I - AQL VALUES, IN %

For Specified AQL Values Falling Within These Intervals	Use AQL Values Below
0.--- to 0.018	0.015
0.019 to 0.039	0.035
0.040 to 0.069	0.065
0.070 to 0.109	0.10
0.110 to 0.164	0.15
0.165 to 0.279	0.25
0.280 to 0.439	0.40
0.440 to 0.699	0.65
0.700 to 1.09	1.0
1.10 to 1.64	1.5
1.65 to 2.79	2.5
2.80 to 4.39	4.0
4.40 to 6.99	6.5
7.00 to 10.90	10.0

12

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

6. SUBMITTAL OF PRODUCT

6.1 Lot. Although lot size is not used to select a continuous sampling plan, the formation of lots may remain desirable for reasons of homogeneity, shipping convenience and facilitation of payment.

7. ACCEPTABILITY OF PRODUCT

7.1 Determination of Acceptability. The acceptability of product submitted shall be determined by use of a specified sampling plan. The characteristic curves shown in the Appendix indicate the risks, for the various sampling procedures, associated with various levels of product quality. 14

7.2 Acceptance. During 100% inspection periods, the inspection is a sorting process during which good product is allowed to pass the inspection station, while the defective units are withdrawn from the product and returned to the contractor. During periods of sampling inspection, the product is allowed to pass the inspection so long as the provisions of 9.2 and 9.3 are satisfied. Product which is allowed to pass the inspection station is considered acceptable for the defect(s) concerned, and is not subject to recall for further inspection for those defects except as noted below. Upon discovery of a critical defect during sampling inspection, the required screening will begin with the unit of product just after the last defect-free sample unit.

7.3 Inspection for Critical Defects. The consumer may specify a special procedure for the inspection for critical defects. This procedure may require 100% (every unit) inspection, or inspection at a sampling rate different from the rates contained in Table II may be required.

8. DRAWING OF SAMPLES

8.1 Sample Unit. A sample unit is a unit of product drawn from the production line as it passes a given inspection station.

8.2 Frequency of Sampling. Certain values of sampling frequency, f, ranging from 1/200 to 1/2 are provided. Unless otherwise stipulated by the consumer, Inspection Level II shall be used. The sampling frequency code letter applicable to the specified Inspection Level and for production rates of a given size shall be obtained from TableII, except that a different sampling frequency code letter than that shown in Table II may be used at the discretion of the consumer.

8.3 Sample Selection. The sample units included in f, the sampling frequency, shall be selected in such a manner as to assure an unbiased sample.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

The inspector should allow the interval between sample units to vary somewhat rather than draw sample units according to a rigid pattern.

9. OPERATION OF THE PLANS

9.1 Types of Inspection. There are three types of inspection used in the plans presented in this handbook: 100% inspection, sampling inspection, and verifying inspection.

9.1.1 The inspection of each unit of product is termed "100% inspection". When defective units are removed, as required in this handbook, 100% inspection is also known as "screening". In this handbook, 100% inspection and screening are treated as synonymous.

TABLE II - SAMPLING FREQUENCY CODE LETTERS

NUMBER OF UNITS OF PRODUCT PRODUCED IN A PRODUCTION INTERVAL*	INSPECTION INTERVALS			
	I	II		III
	CSP-1 & CSP-2	CSP-1 & CSP-2	CSP-A	CSP-1 & CSP-2
2-8	C	B	A'	A
9-25	D	C	B'	A
26-65	E	D	C'	B
66-110	F	E	D'	B
111-180	F	E	E'	C
181-300	G	E	F'	C
301-500	G	F	G'	D
501-800	G	F	H'	E
801-1300	H	F	I'	E
1301-3200	H	G	J'	F
3201-8000	I	H	K'	G
8001-22,000	J	I	L'	H
22,001-110,000	K	J	M'	I
110,001-up	K	K	N'	J

*The production interval is the period of time, usually a shift or a day, during which a number of units of product or a homogeneous batch of product is produced. The choice of the number of units of product or of the duration of the production interval must be estimated from prior information.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

9.1.2 As used in this handbook, the phrase "sampling inspection" refers to sampling performed at a stated frequency, upon product after a 100% inspection period has ended. Such product will not have been inspected previously for the defect(s) concerned.

9.1.3 Product which has been 100% inspected may be sampled at a frequency of f, or higher, in a check inspection. This type of sampling shall be termed "verifying inspection".

9.2 Qualification of Production for Sampling Inspection. The sampling provisions of these plans may be instituted when the following requirements are satisfied:

(a) All units of product are made according to the same drawings and specifications under stable conditions of production. This requirement, which is termed homogeneity, is satisfied when the production process is not altered by innovation, changes in material sources, strikes, retooling or interruptions other than those due to the end of the shift, day, or workweek.

(b) At least i successive units passing the inspection station on 100% inspection have been found free of the defect(s) under consideration.

9.3 Types of Plans. There are three different types of continuous sampling plans provided in this handbook. They have been coded for convenience of describing a particular plan type as CSP-1, CSP-2 and CSP-A. A detailed description of the operation of the different types appears in paragraphs 9.3.1 and 9.3.2. The appropriate sampling table shall be selected as follows:

CSP-1 - - - - - - - - - - Table III-1
CSP-2 - - - - - - - - - - Table III-2
CSP-A - - - - - - - - - - Table III-A

In the administration of CSP-1, CSP-2 and CSP-A plans, one of the following options will generally be exercised:

(a) All 100% inspection shall be performed by the supplier and all sampling and verifying inspection shall be performed by the consumer.

(b) All 100% inspection and sampling inspection shall be performed by the supplier and the consumer shall, if desired, utilize audit procedures by means of special sampling plans or other evaluation techniques.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

(c) Certain other options are possible and may be exercised if the situation warrants.

The specific options and procedures to be followed should be in agreement with Figures 1, 2 or 3.

9.3.1 Administration of CSP-1 and CSP-2 Plans. The three types of inspection described in 9.1 will be utilized for CSP-1 and CSP-2 plans as indicated in Figures 1 and 2 respectively. The CSP-1 and CSP-2 plans provide for alternating sequence of 100% inspection and sampling inspection with no limit on the number of such sequences provided the number of units of product inspected during a 100% inspection sequence does not exceed the appropriate L value specified in Tables IV-A or IV-B (See paragraph 9.3.1.7 below).

9.3.1.1 The following course of action applies to either option (a) or (b) described in 9.3:

At the start of production, the product shall be screened by the screening crew until the requirements of 9.2 are satisfied. Concurrently under option (a), verifying inspection will be performed by the sampling inspector. Inspection is performed for each defect assigned to the inspection station. However, judgment of the product may be either by individual defect or by class of defects (See Section 4).

9.3.1.2 The sampling inspector will tally the number of units of product containing each defect assigned to the station as well as the total number of units inspected under screening inspection and, when required, verifying inspection. When the sampling inspector finds a defect during verifying inspection, he will notify the screening crew that i successive units following the defective unit must be defect-free before screening can be terminated.

9.3.1.3 When i successive units have been found free of defect(s) by the screening crew and the sample-units drawn from these units for verifying inspection are defect-free, screening is terminated and the sampling inspector begins sampling inspection.

9.3.1.4 Whenever the sampling inspector finds that 100% inspection is necessary (See Figures 1 and 2), he proceeds as follows:

(a) The flow of product through his station is curtailed.

(b) The screening crew is notified that 100% inspection is necessary.

(c) While the screening crew is performing 100% inspection, the sampling inspector performs verifying inspection, if required.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

(d) The number of successive units of product, the number of units containing the defect(s) and the spacing of such units are noted.

(e) When i successive units of product have been found free of the defects concerned by the screening crew and the sample-units drawn from these units for verifying inspection, when required, are free of the defects concerned, the screening crew is released and the sampling inspector resumes sampling inspection.

9.3.1.5 The consumer will prescribe or approve the manner in which 100% inspection is to be performed by the screening crew and monitor such inspection. He will designate or approve the type of inspection equipment to be used and the method of inspection.

18

9.3.1.6 If an excessive number of defects (or defectives) is observed during verifying inspection, the sampling inspector will cease verifying inspection. Such inspection will not be resumed until the inspector is satisfied that:

(a) action has been taken to improve the process average, and

(b) the 100% inspection operation has been made more effective by the supplier's provision of better supervision and/or by retraining the personnel conducting the 100% inspection.

"Excessive number" is defined as one for critical defects and as two defective units separated by fifty or fewer defect-free units in the case of major and minor defects. Where excessively defective product continues to be submitted, the consumer's representative will notify the responsible agency of this condition. The agency may require a return to lot-by-lot inspection or take whatever action is necessary to assure receipt of product of acceptable quality.

9.3.1.7 Tables IV-A and IV-B have been incorporated for the purpose of signalling the need for correcting the contractor's process whenever long sequences of 100% inspection are likely to be encountered. Each table presents upper limits to the amount of 100% inspection for each CSP-1 and CSP-2 plan. At the option of the consumer, 100% inspection will be curtailed whenever the L value (L is the number of units of product inspected under 100% inspection) associated with a given plan is exceeded. The supplier will seek to identify the causes for the manufacture of defective product and correct the process prior to resuming normal production. Inspection records shall identify all stoppages of screening inspection and cite corrective action taken for each. If the consumer fails to exercise this option, the constants shown in Tables IV-A and IV-B will serve as a guide to the supplier. Whenever the L value is exceeded, the supplier should, preferably curtail 100% inspection and correct his process

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

prior to resuming normal production, but as a minimum, he should take corrective action to reduce or eliminate the incidence of defective product. Regardless of the option elected, the supplier's screening crew must clear i defect-free units prior to the resumption of sampling inspection.

9.3.1.8 Figures 1 and 2 show diagrammatic representations of the inspection procedures for the specified conditions.

19

9.3.2 CSP-A Plans. The CSP-A plans provide for alternating sequences of 100% inspection and sampling inspection with a limit on the number of such sequences. Placing a limit on the number of alternating sequences provides a procedure whereby the process is rejected when product quality is worse than the AQL. At the same time assurance is provided that product passing the acceptance requirements meets the AOQL.

9.3.2.1 At the start of production each day or of each production interval, each unit shall be inspected in the order of production by the screening crew until the requirements of 9.2 are met. Inspection is performed for each defect assigned to the inspection station. However, judgment of the product may be either by individual defect or by class of defects (see Section 4).

9.3.2.2 When i successive units have been found free of the defect(s) by the screening crew, screening is terminated and sampling at rate f is begun. If one of the defect(s) concerned is found during sampling, an immediate return to 100% inspection is required.

9.3.2.3 The inspector tallies the number of units of product containing each defect assigned to the station. A new tally is begun at the start of production for each production interval. This tally includes the results of both screening inspection and sampling inspection. If only a or fewer tallies (for the defect(s) concerned) are made during the production interval, there will be no interruption of inspection, and all product that has passed the inspector is accepted for the defect(s) concerned. Whenever a + 1 tallies (for the defect(s) concerned) are made during the production interval, the inspector stops his inspection. At this point all product which has already passed the inspector is accepted for the defect(s) concerned, except as noted in 7.2.

9.3.2.4 When the a + 1st tally has been made the inspector will inform the supplier as to which defect(s) are involved and indicate that he will no longer inspect product until the supplier locates the source of difficulty and assures him that the cause for defective product has been removed.

9.3.2.5 When the inspector is satisfied with this assurance and has verified that all units which had not reached his station at the time that inspection was

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

stopped have been removed and/or screened and are being presented as resubmitted material, he will resume inspection as in 9.3.2.1 using a sampling plan based on a new estimate of the production rate. The inspector, at his discretion, may accept screening inspection by the supplier as a basis for resuming his inspection if the problem of location and correcting the source of difficulty will result in an unreasonable delay in production. If the inspector is unable to obtain satisfactory assurance that corrective action has been taken by the supplier when required, he shall report the situation to the responsible agency. This agency may require a return to lot-by-lot inspection or take whatever action is deemed necessary to assure receipt of product of an acceptable quality.

20

9.3.2.6 Figure 3 shows a diagrammatic representation of the inspection procedure for the specified conditions.

9.3.2.7 Where the consumer wishes to increase the amount of inspection performed whenever the quality of submitted material is unsatisfactory, the following tightened inspection plan may be utilized. Upon resumption of inspection following a stoppage of inspection as described in 9.3.2.3 and 9.3.2.4, a sampling plan whose AQL and AOQL is one step tighter (i.e. smaller) than that normally specified is used until one full production interval has elapsed without the inspection being stopped. When the latter condition is satisfied, the normally prescribed AQL or AOQL is again used. For critical defects, the tightened sampling plan uses an $\underline{i}$ value twice that for the normal sampling plan.

9.3.2.8 Where the consumer wishes to reduce the amount of inspection done whenever the quality of the submitted material is very good, the following reduced sampling plan may be utilized. A sampling rate, f, one fifth of the normal rate may be used provided that:

(a) the preceding ten full production intervals have been under normal inspection and without interruptions in the inspection, and

(b) the estimated process average (see Section 12) is less than the quantity,

$$AQL - 3\sqrt{\frac{AQL(1-AQL)}{\text{number inspected}}}, \text{ where}$$

AQL is expressed as fraction defective, e.g., .01, .025, .04, etc., and

(c) production is at a steady rate.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

The normal sampling rate shall be reinstated whenever:

(a) there is an interruption of inspection and/or

(b) the estimated process average rises above the AQL and/or

(c) the consumer deems that normal inspection should be reinstated.

Reduced sampling plans shall not be used for critical defects.

9.4 Order of production. All inspection must be performed in the order in which the units of product are produced. Moreover, all units must pass each inspection station. This does not prevent process inspection by the supplier prior to submittal to the inspection station nor does it prohibit the supplier from removing or correcting units containing defects prior to submittal.

10. INSPECTION STATIONS

10.1 Within a station. Several defect classes or several defects, considered individually may be inspected at one station. In this event each defect (or defect class) is judged independently of all other defects (or defect classes) at the station. This means that screening may be in effect for certain defects (classes) while at the same time sampling may be in effect for other defects (classes) at the same station.

10.2 Multi-station. The plans in this Handbook are applicable to multi-stage inspection. Inspection may be set up so that the results are cumulative over all stations for a given defect class or so that results at each station are considered independently. It must be pointed out that the inspection results and judgments therefrom must be based on the identical list or class of defects (or individual defect) for which the AQL or AOQL was specified. If inspection is stopped where the results are cumulative over the stations, all units which have not reached the last inspection station must be removed and/or screened and presented as resubmitted material.

11. DISPOSITION OF REJECTED PRODUCT

Units containing defects, whether found by the sampling inspector or by the screening crew shall be removed from the flow of product. If found by the screening crew, such units will be turned over to the sampling inspector who will release them together with all units containing defects found in his own inspection, to the proper agent of the supplier. The supplier may correct these units,

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

in which case they shall be resubmitted to the sampling inspector separately from the normal flow of product. If the number of resubmitted units is small, the sampling inspector may inspect them himself; if the number is large, the screening crew may be required to inspect them under consumer observation and direction. In either event satisfactory units shall be released into the flow of product beyond the inspection station; units still containing defects shall be returned to the supplier for further processing or scrapping.

12. PROCESS AVERAGE

12.1 Definition. The process average is the average percent defective of product submitted by the supplier for original inspection. Original inspection is the first inspection of a particular quantity of product as distinguished from the inspection of product which has been resubmitted.

12.2 Computation. The best estimate of the process average (in %), where the number of defects (or defectives) discovered is six or more, is


$$\frac{\text{(Number of defects discovered minus one)}}{\text{(Number of units inspected minus one)}} \times 100.$$

Where five or more defects (or defectives) were discovered, compute

$$y = \frac{\text{(Number of defects discovered)}}{\text{(Number of units inspected)}} \times 100$$

and employ Figure 4 to obtain the estimate (p), the best estimate of the process average. Both methods should be applied only to results accrued up to and including the occurrence of a defect. They are not applicable to results accrued beyond the occurrence of a defect but prior to the discovery of the next.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

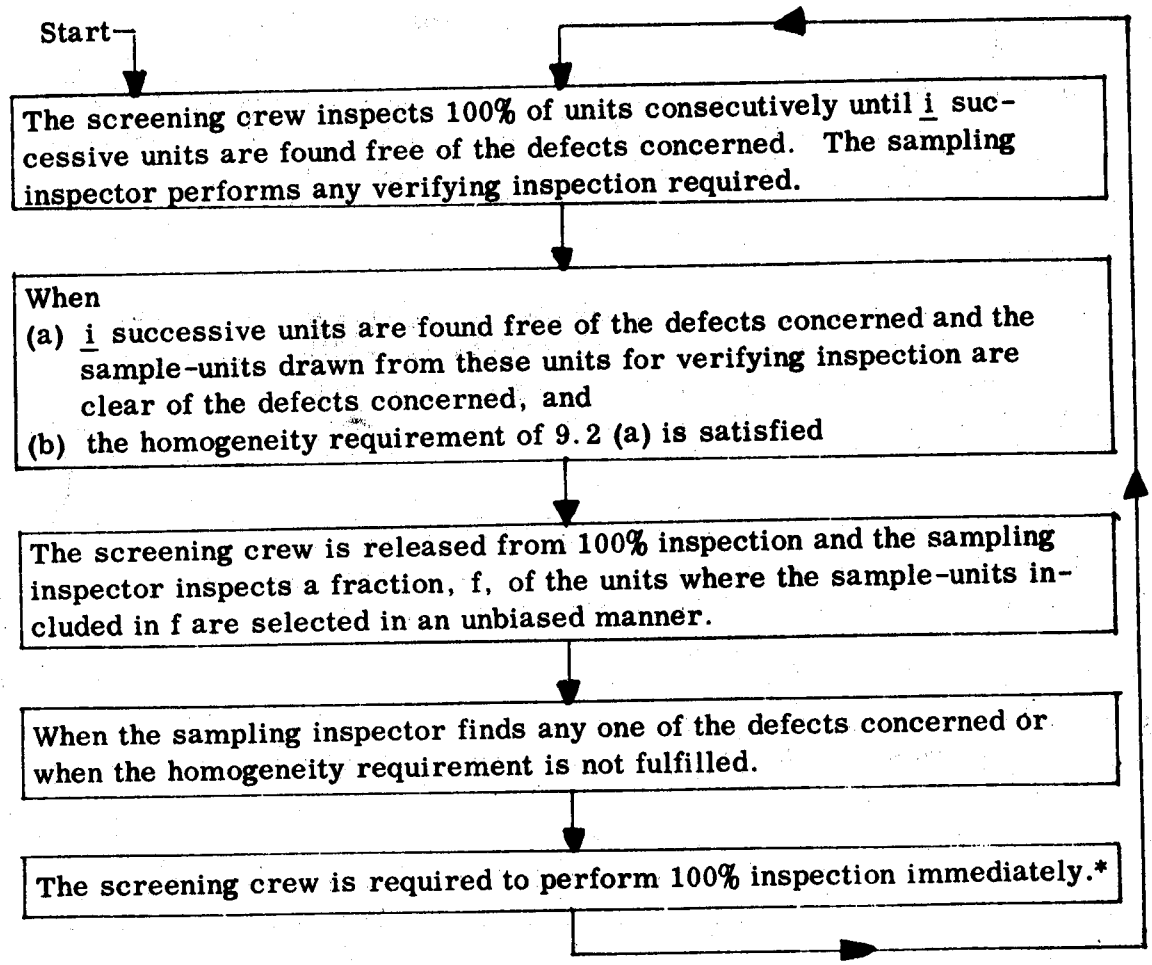

*For critical defects, screening should begin with the unit of product just after the last defect-free sample-unit.

FIGURE 1. PROCEDURE FOR CSP-1 PLANS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.


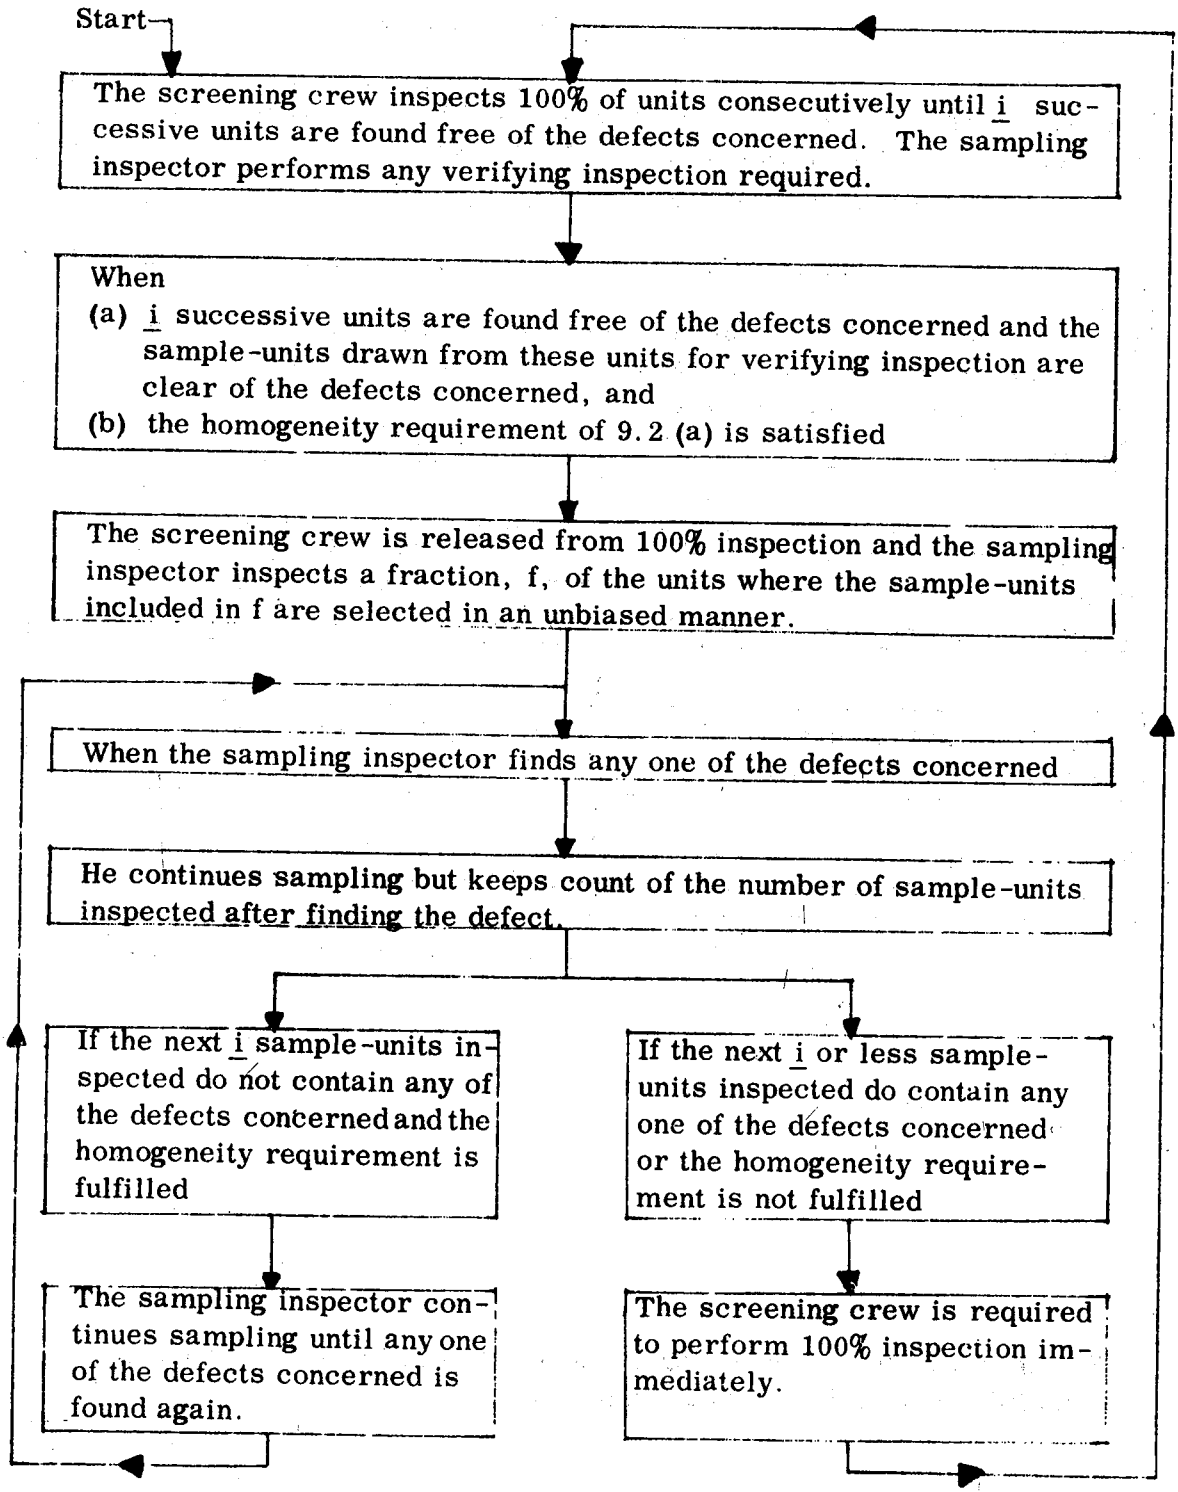


FIGURE 2 PROCEDURE FOR CSP-2 PLANS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

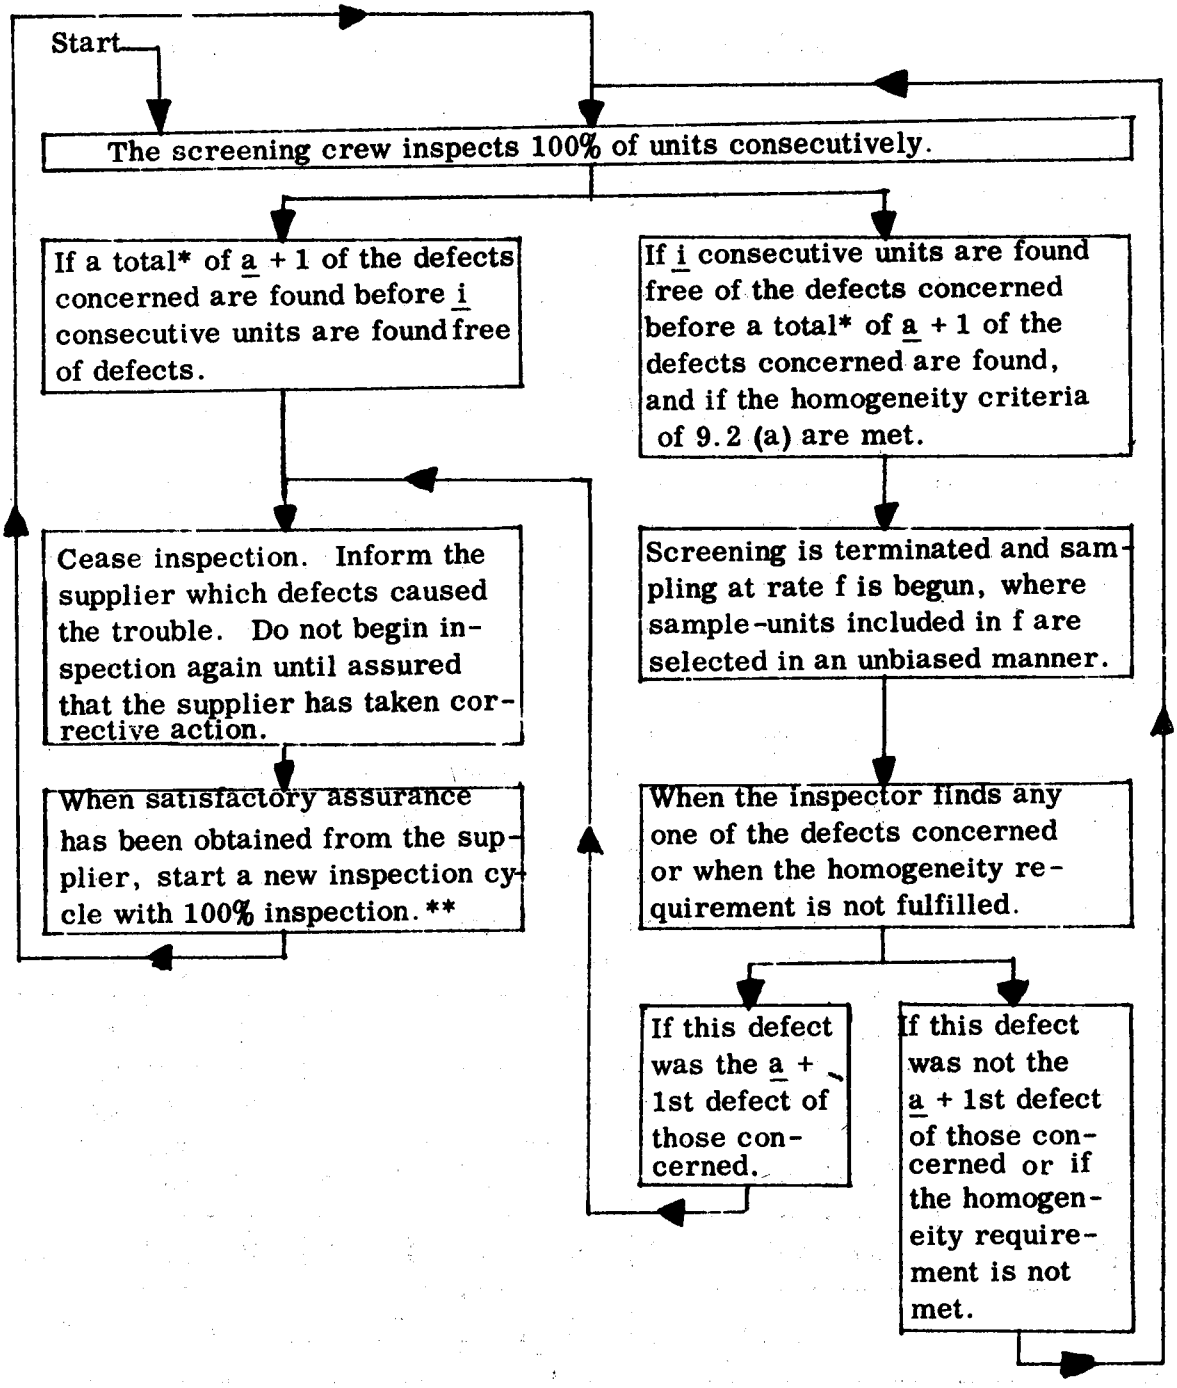

* The total of a + 1 defects includes results of all inspection for the day, both sampling and screening.

** For critical defects the screening should begin with the unit of product just after the last defect-free sample-unit.

FIGURE 3. PROCEDURE FOR CSP-A PLANS

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE III-A, Values of i and a for CSP-A Plans

Sampling Frequency Code Letter	f	AQL in %									
		.015		.10		.15		.25		.40	
		i	a	i	a	i	a	i	a	i	a
A'	1/1	100%	0	←		←		←		←	
B'	1/1	100%	0	←		←		←		←	
C'	1/5	100%	0	←		←		←		25	0
D'	1/10	100%	0	←		65	0	35	0	25	0
E'	1/10	105	0	80	0	50	0	25	0	15	0
F'	1/10	100	0	60	0	40	0	20	0	←	
G'	1/10	80	0	50	0	20	0	←		40	1
H'	1/10	80	0	30	0	←		40	1	20	1
I'	1/10	80	0	←		50	1	35	1	25	2
J'	1/15	100	0	135	1	50	1	40	2	40	3
K'	1/25	120	0	100	1	60	2	50	3	40	4
L'	1/50	160	0	80	1	90	2	80	3	50	5
M'	1/100	200	0	110	3	100	4	80	5	65	7
N'	1/200	240	0	120	6	100	8	80	11	60	15
		0.12		0.27		0.36		0.59		0.83	
		AOQL in %									

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE III-A, Values of i and a for CSP-A Plans (Cont)

Sampling Frequency Code Letter	f	AQL in %									
		.65		1.0		1.5		2.5		4.0	
		i	a	i	a	i	a	i	a	i	a
A'	1/1	100%	0	←		←		←		←	
B'	1/1	100%	0	←		←		←		100%	1
C'	1/5	25	0	←		20	1	10	1	4	1
D'	1/10	25	0	30	1	20	1	8	1	6	2
E'	1/10	15	0	20	1	10	1	8	2	6	3
F'	1/10	30	1	14	1	10	2	10	3	8	4
G'	1/10	20	1	15	2	15	3	10	4	8	6
H'	1/10	20	2	15	3	15	4	10	6	8	8
I'	1/10	25	3	20	4	15	5	10	7	8	11
J'	1/15	30	4	25	5	20	7	10	9	9	15
K'	1/25	30	5	30	8	25	11	15	17	9	24
L'	1/50	40	7	30	10	20	14	16	20	12	32
M'	1/100	50	13	35	18	25	25	20	43	12	62
N'	1/200	45	26	30	35	25	53	15	81	10	126
		1.08		1.35		2.20		3.09		4.96	
		AOQL in %									

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE III-A, Values of i and a for CSP-A Plans (Cont)

Sampling Frequency Code Letter	f	AQL in %			
		6.5		10.0	
		i	a	i	a
A'	1/1	100%	0	←	
B'	1/1	100%	2	100%	3
C'	1/5	3	2	3	3
D'	1/10	4	2	4	3
E'	1/10	4	3	4	5
F'	1/10	6	5	4	7
G'	1/10	6	8	4	11
H'	1/10	6	12	4	16
I'	1/10	6	17	4	24
J'	1/15	7	25	5	37
K'	1/25	7	34	5	53
L'	1/50	9	57	9	108
M'	1/100	15	180	12	300
N'	1/200	7	207	5	326
		7.24		10.70	
		AOQL in %			

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE III-1

Values of i for CSP-1 Plans

Sampling Frequency Code Letter	f	AQL in %													
		.015	.035	.065	.10	.15	.25	.40	.65	1.0	1.5	2.5	4.0	6.5	10.0
A	1/2	240	180	120	100	75	50	33	25	20	12	9	5	4	2
B	1/3	390	290	200	170	130	80	55	43	34	20	15	9	6	4
C	1/4	500	380	260	220	170	100	75	55	45	27	19	12	8	5
D	1/5	600	450	320	270	200	130	90	70	55	33	23	14	9	6
E	1/7	750	560	390	330	250	150	110	85	65	40	29	17	12	8
F	1/10	920	690	480	410	310	190	140	100	80	50	35	22	15	10
G	1/15	1110	840	590	500	380	230	170	130	100	65	43	27	18	12
H	1/25	1380	1040	730	620	470	290	210	160	130	75	55	34	22	15
I	1/50	1780	1340	940	800	600	370	260	200	160	100	70	42	29	19
J	1/100	2210	1660	1150	980	740	450	320	250	200	120	85	55	36	24
K	1/200	2630	1970	1370	1170	880	530	380	300	240	150	100	65	43	28
		0.12	0.16	0.23	0.27	0.36	0.59	0.83	1.08	1.35	2.20	3.09	4.96	7.24	10.70
		AOQL in %													

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE III-2

Values of i for CSP-2 Plans

Sampling Frequency Code Letter	f	AQL in %													
		.015	.035	.065	.10	.15	.25	.40	.65	1.0	1.5	2.5	4.0	6.5	10.0
A	1/2	360	270	190	160	120	75	50	39	31	19	13	8	5	3
B	1/3	590	500	310	260	200	120	90	65	50	31	22	13	9	6
C	1/4	730	550	380	320	240	150	110	80	65	39	27	17	11	7
D	1/5	850	640	440	380	280	170	120	95	75	45	32	20	13	9
E	1/7	1020	760	530	450	340	210	150	110	90	55	39	24	16	11
F	1/10	1220	920	640	540	410	250	180	140	110	70	47	29	19	13
G	1/15	1440	1090	760	650	490	300	210	170	130	80	55	35	23	16
H	1/25	1750	1320	920	780	590	360	260	200	160	95	65	42	28	19
I	1/50	2200	1650	1150	980	730	450	320	250	200	120	85	55	35	23
J	1/100	2650	2000	1380	1180	880	540	380	290	230	150	110	65	42	27
K	1/200	3200.	2400	1660	1410	1060	640	460	360	290	180	130	75	55	33
		0.12	0.16	0.23	0.27	0.36	0.59	0.83	1.08	1.35	2.20	3.09	4.96	7.24	10.70
		AOQL in %													

Note: CSP-2 Plans will not be used for inspection of critical defects.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE IV-A

Values of L for CSP-1 Plans

Sampling Frequency Code Letter	f	AQL in %													
		.015	.035	.065	.10	.15	.25	.40	.65	1.0	1.5	2.5	4.0	6.5	10.0
A	1/2	575	425	300	250	175	125	80	60	50	30	23	13	11	6
B	1/3	1075	800	550	475	375	225	150	125	95	60	45	27	19	13
C	1/4	1550	1200	800	700	525	325	250	175	150	90	60	40	27	18
D	1/5	1800	1350	1000	800	600	400	275	225	175	100	70	45	30	20
E	1/7	2350	1750	1200	1050	800	475	350	275	200	125	90	55	40	25
F	1/10	3450	2600	1800	1550	1175	725	550	400	300	200	150	90	60	40
G	1/15	5250	3950	2800	2350	1800	1100	800	625	475	325	225	125	90	60
H	1/25	6800	5100	3600	3050	2300	1425	1050	800	650	375	275	175	110	80
I	1/50	13,600	10,200	7200	6100	4600	2825	2000	1550	1225	775	550	350	250	150
J	1/100	22,200	16,700	11,500	9850	7450	4525	3225	2525	2025	1225	875	575	375	275
K	1/200	39,500	29,600	20,600	17,600	13,250	8000	5750	4525	3625	2275	1525	1000	675	450
		0.12	0.16	0.23	0.27	0.36	0.59	0.83	1.08	1.35	2.20	3.09	4.96	7.24	10.70
		AOQL in %													

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE IV-B

Values of L for CSP-2 Plans

Sampling Frequency Code Letter	f	AQL in %						
		.015	.035	.065	.10	.15	.25	.40
A	1/2	1300	975	700	600	450	275	200
B	1/3	2700	2275	1400	1175	900	550	425
C	1/4	3675	2775	1925	1625	1225	775	575
D	1/5	3400	2575	1775	1525	1125	700	500
E	1/7	5125	3825	2675	2275	1725	1075	775
F	1/10	7200	5450	3800	3200	2425	1475	1075
G	1/15	10,950	8300	5800	4950	3725	2300	1600
H	1/25	14,000	10,600	7400	6250	4725	3000	2100
I	1/50	28,600	21,450	14,950	12,750	9500	5850	4175
J	1/100	39,800	30,050	20,750	17,750	13,250	8125	5725
K	1/200	80,100	60,100	41,600	35,300	26,600	16,100	11,600
		0.12	0.16	0.23	0.27	0.36	0.59	0.83
		AOQL in %						

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

TABLE IV-B, Values of L for CSP-2 Plans (Cont)

Sampling Frequency Code Letter	f	AQL in %						
		65	1.0	1.5	2.5	4.0	6.5	10.0
A	1/2	150	125	75	50	32	21	14
B	1/3	300	250	150	105	70	44	31
C	1/4	425	350	200	150	90	60	40
D	1/5	400	325	200	150	90	55	40
E	1/7	575	475	300	200	125	85	60
F	1/10	850	650	425	300	175	125	80
G	1/15	1300	1000	625	425	275	175	125
H	1/25	1600	1300	775	525	350	225	175
I	1/50	3250	2600	1575	1125	725	475	300
J	1/100	4375	3475	2275	1675	1000	675	450
K	1/200	9050	7250	4550	3300	1925	1425	875
		1.08	1.35	2.20	3.09	4.96	7.24	10.7
		AOQL in %						


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

APPENDIX


CHARACTERISTIC CURVES FOR SINGLE-LEVEL CONTINUOUS SAMPLING PLANS

This appendix contains two distinct sets of curves. The first set is for CSP-1 and CSP-2. Since the operating characteristics of these plans are essentially equivalent, only CSP-2 curves are graphed. The vertical axis on this set is labeled the "Percent of Product Accepted on a Sampling Basis" and means that percent of the total product submitted over a long period of time which is expected to be accepted or passed by the sampling phases of the plan. The second set of graphs is for CSP-A plans. The vertical axis on this set is labeled the "Percent of Time Inspection Will Not Be Stopped". The horizontal axis on both sets of charts is labeled "Percent Defective of Submitted Material".

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

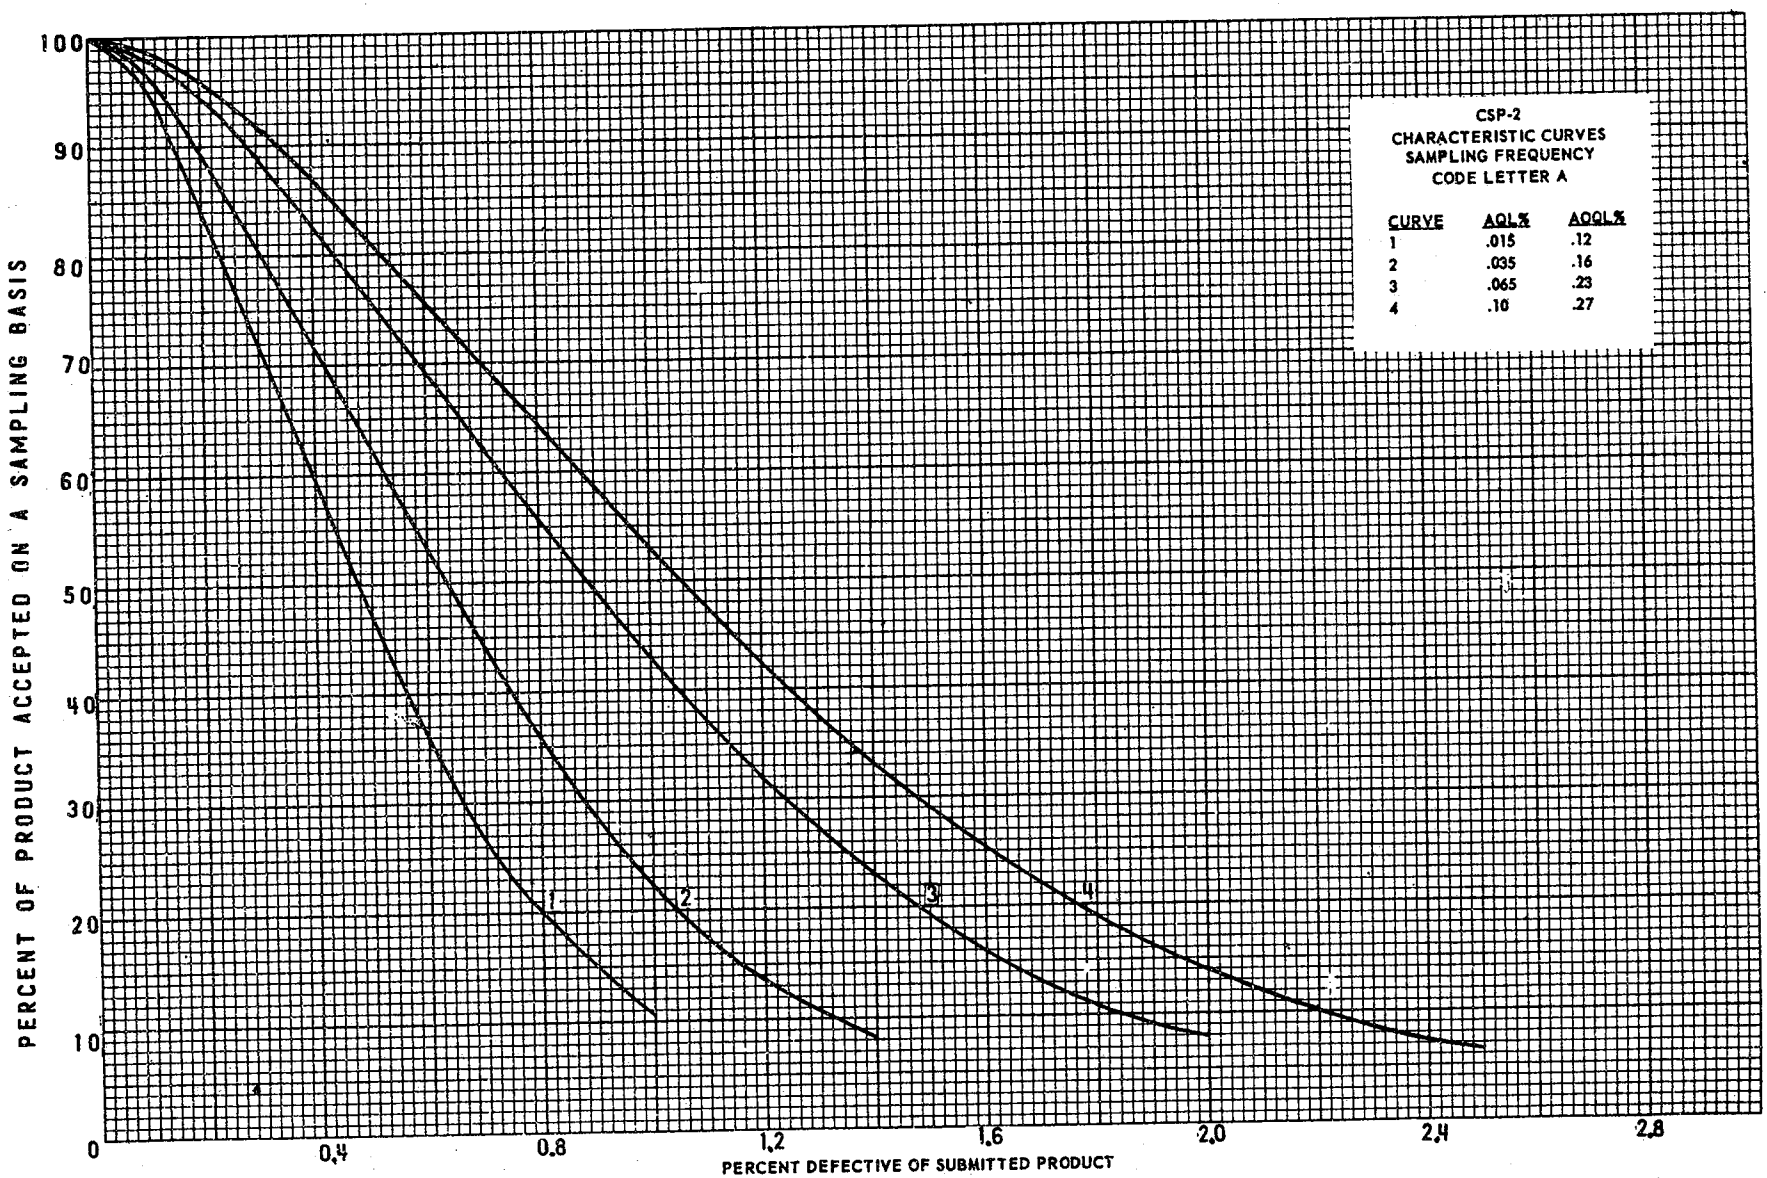


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

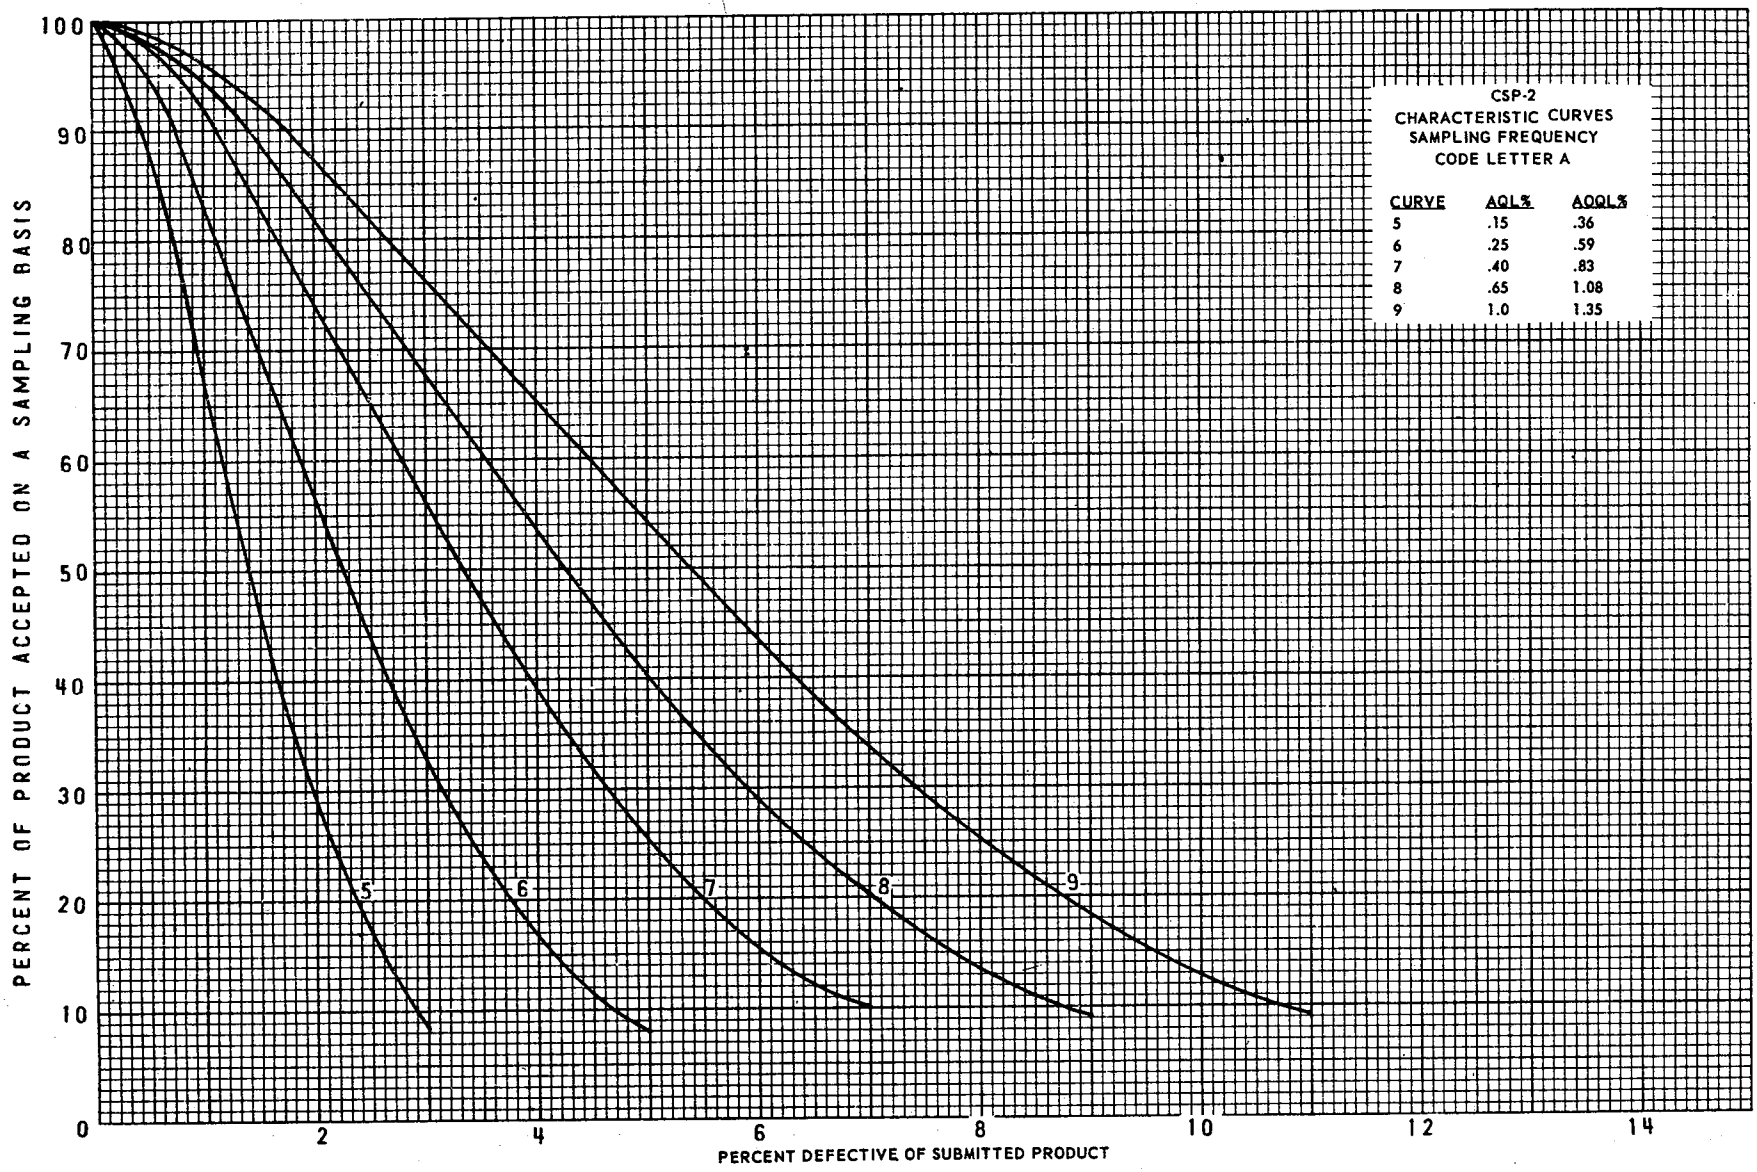


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.


37

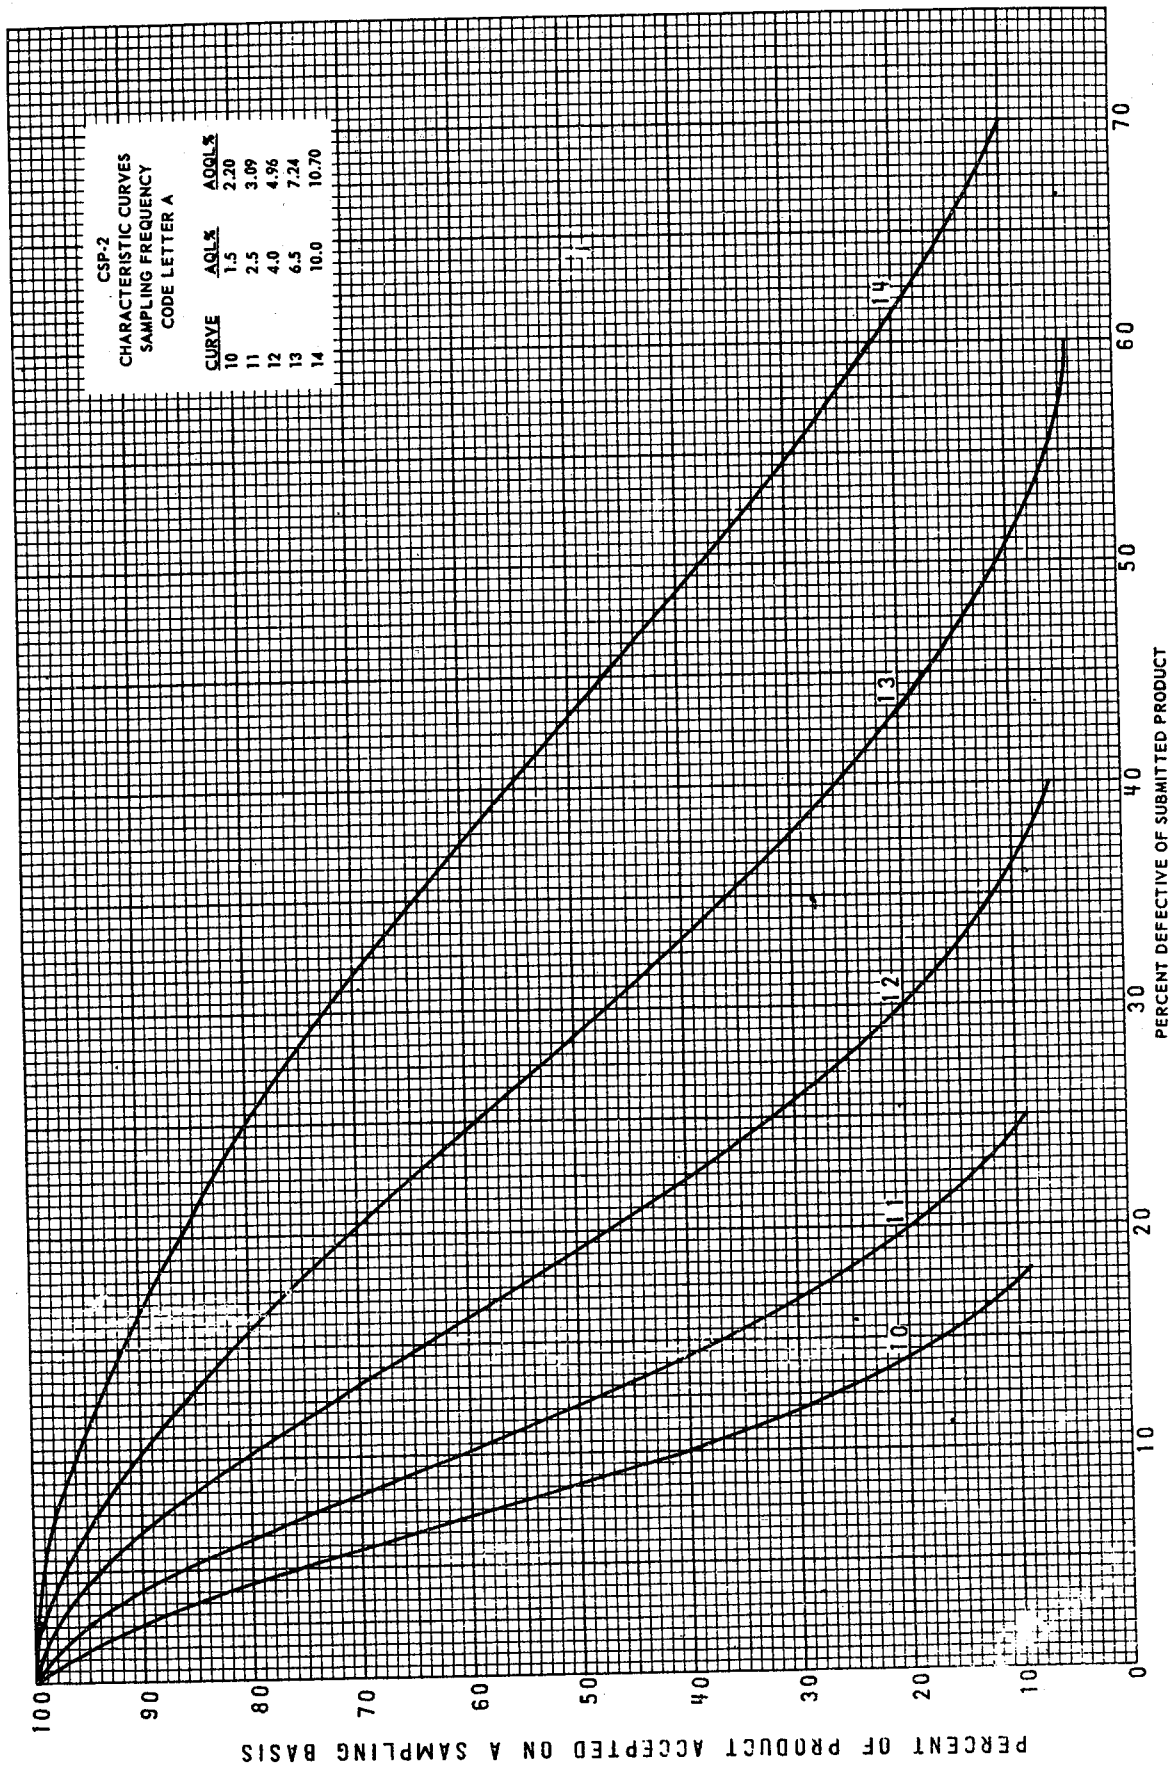


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

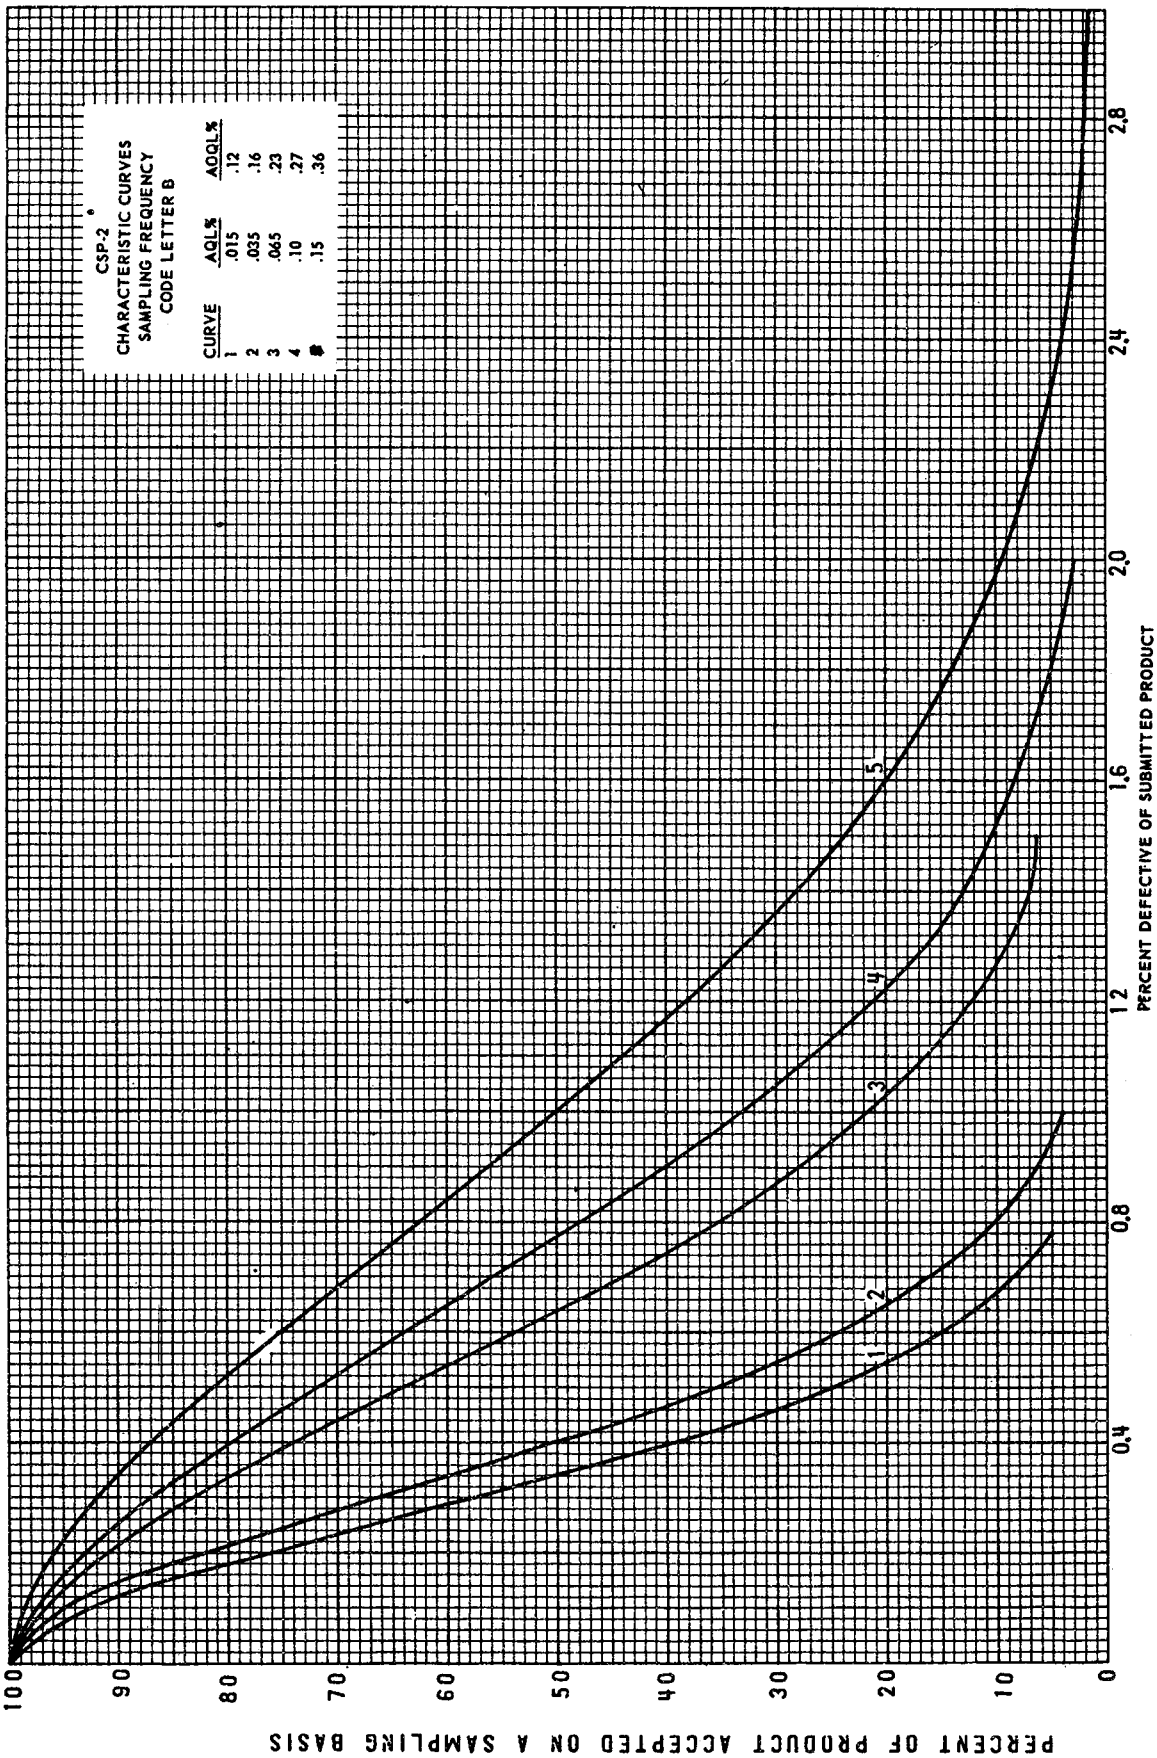


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

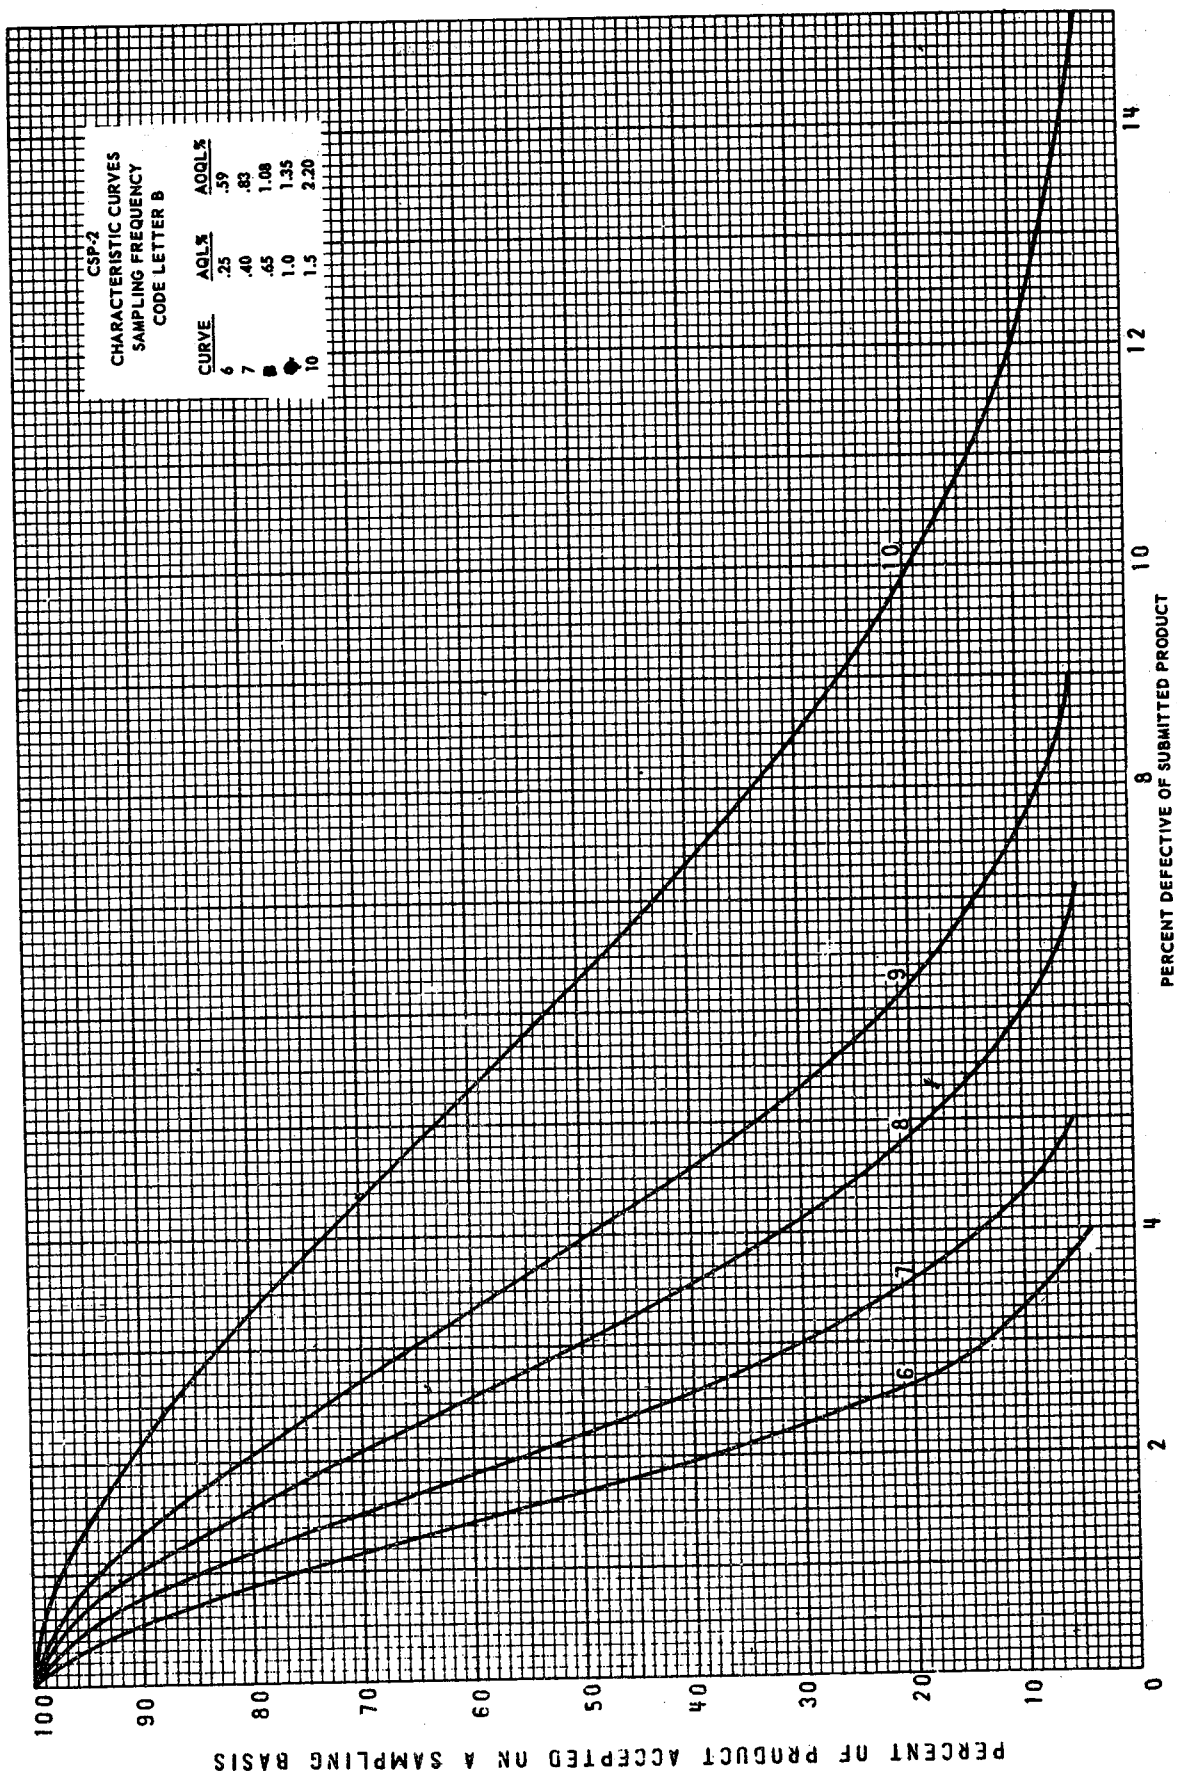


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

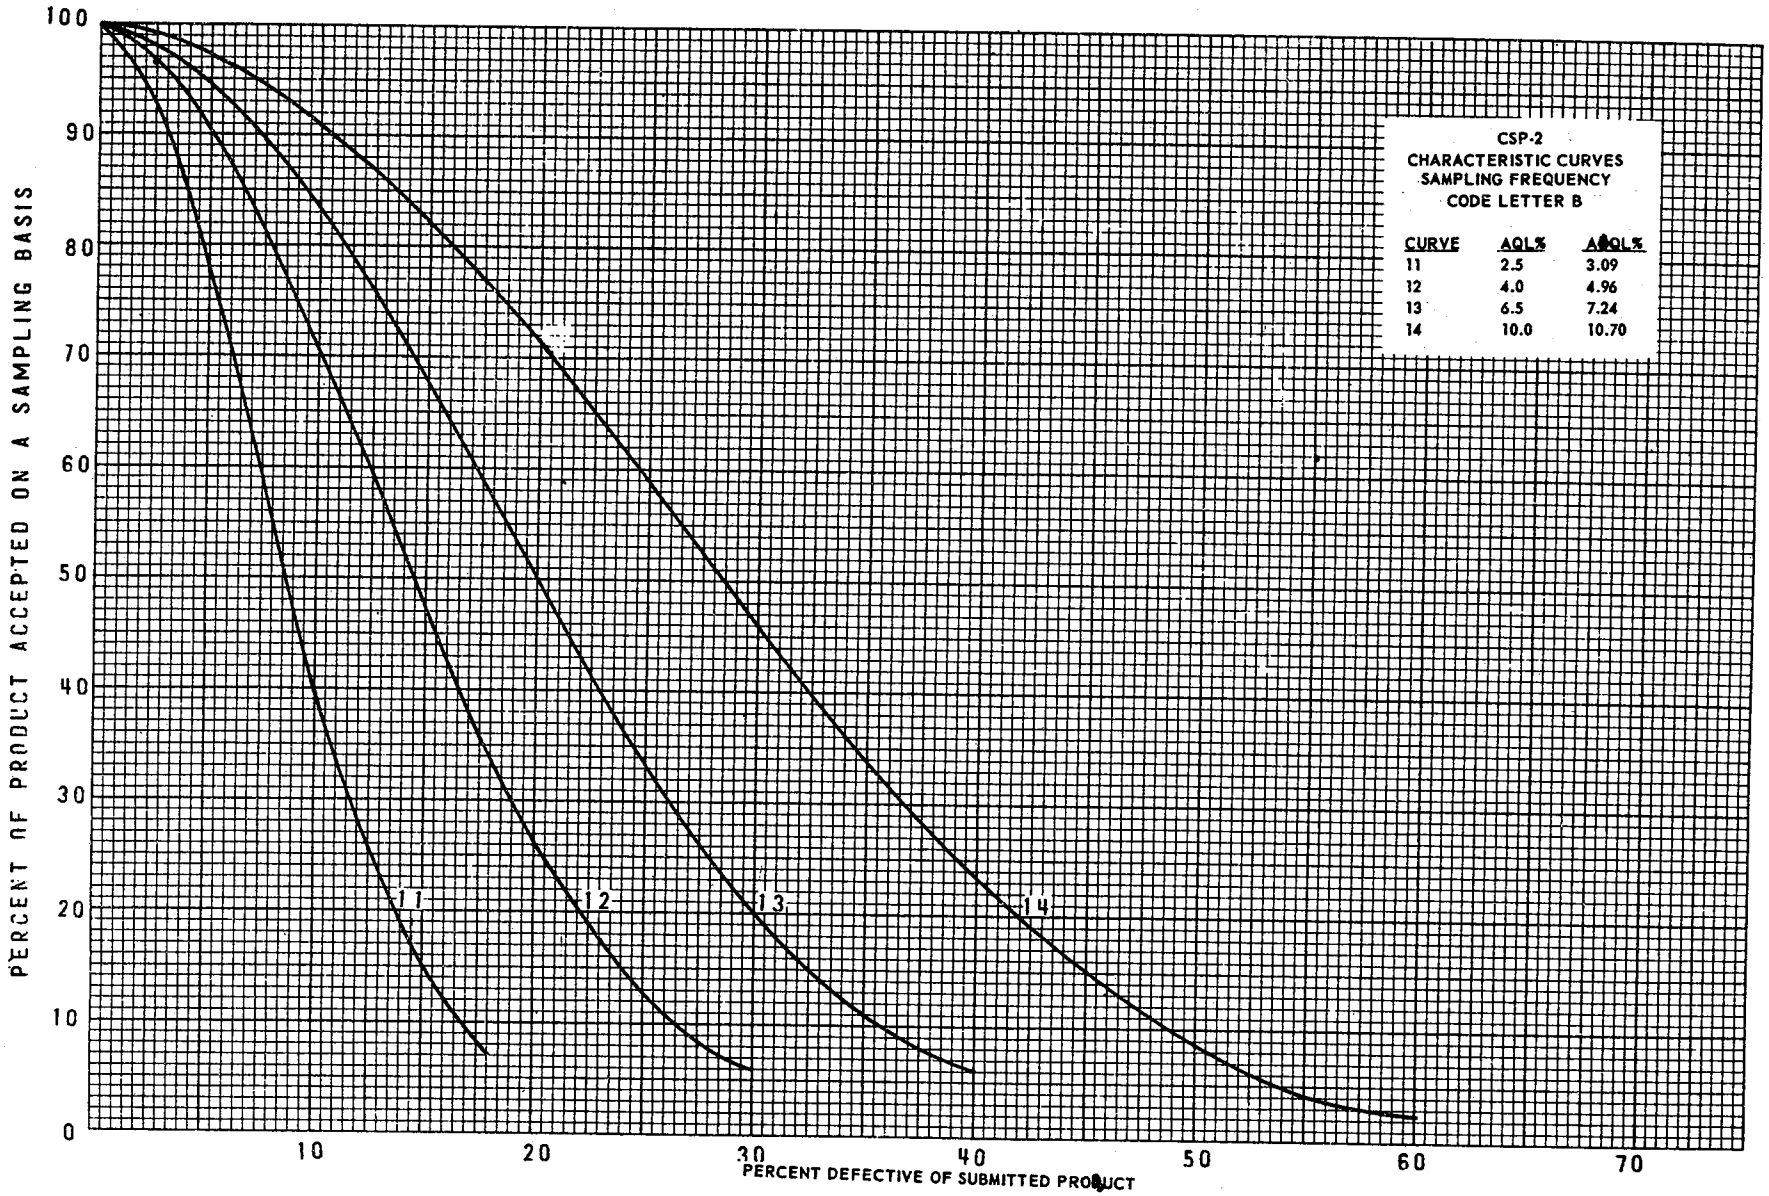


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

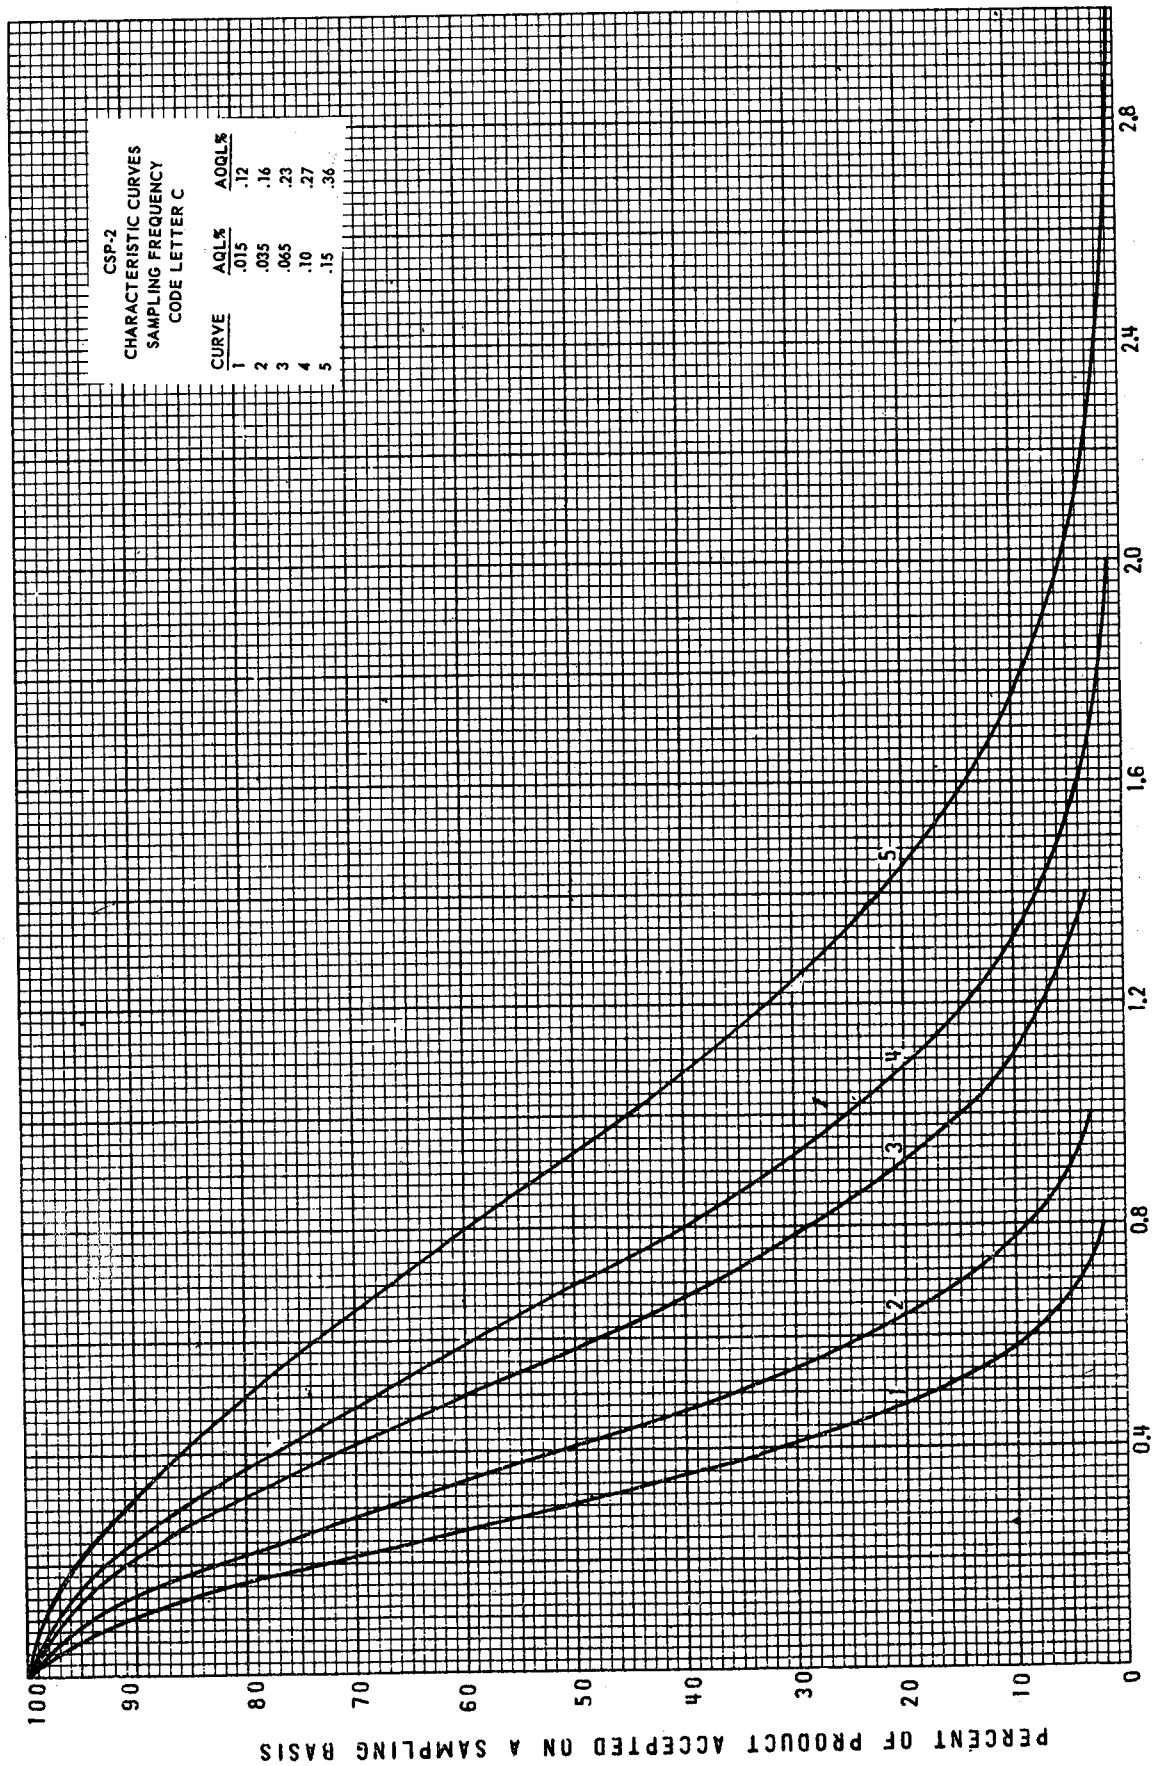


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

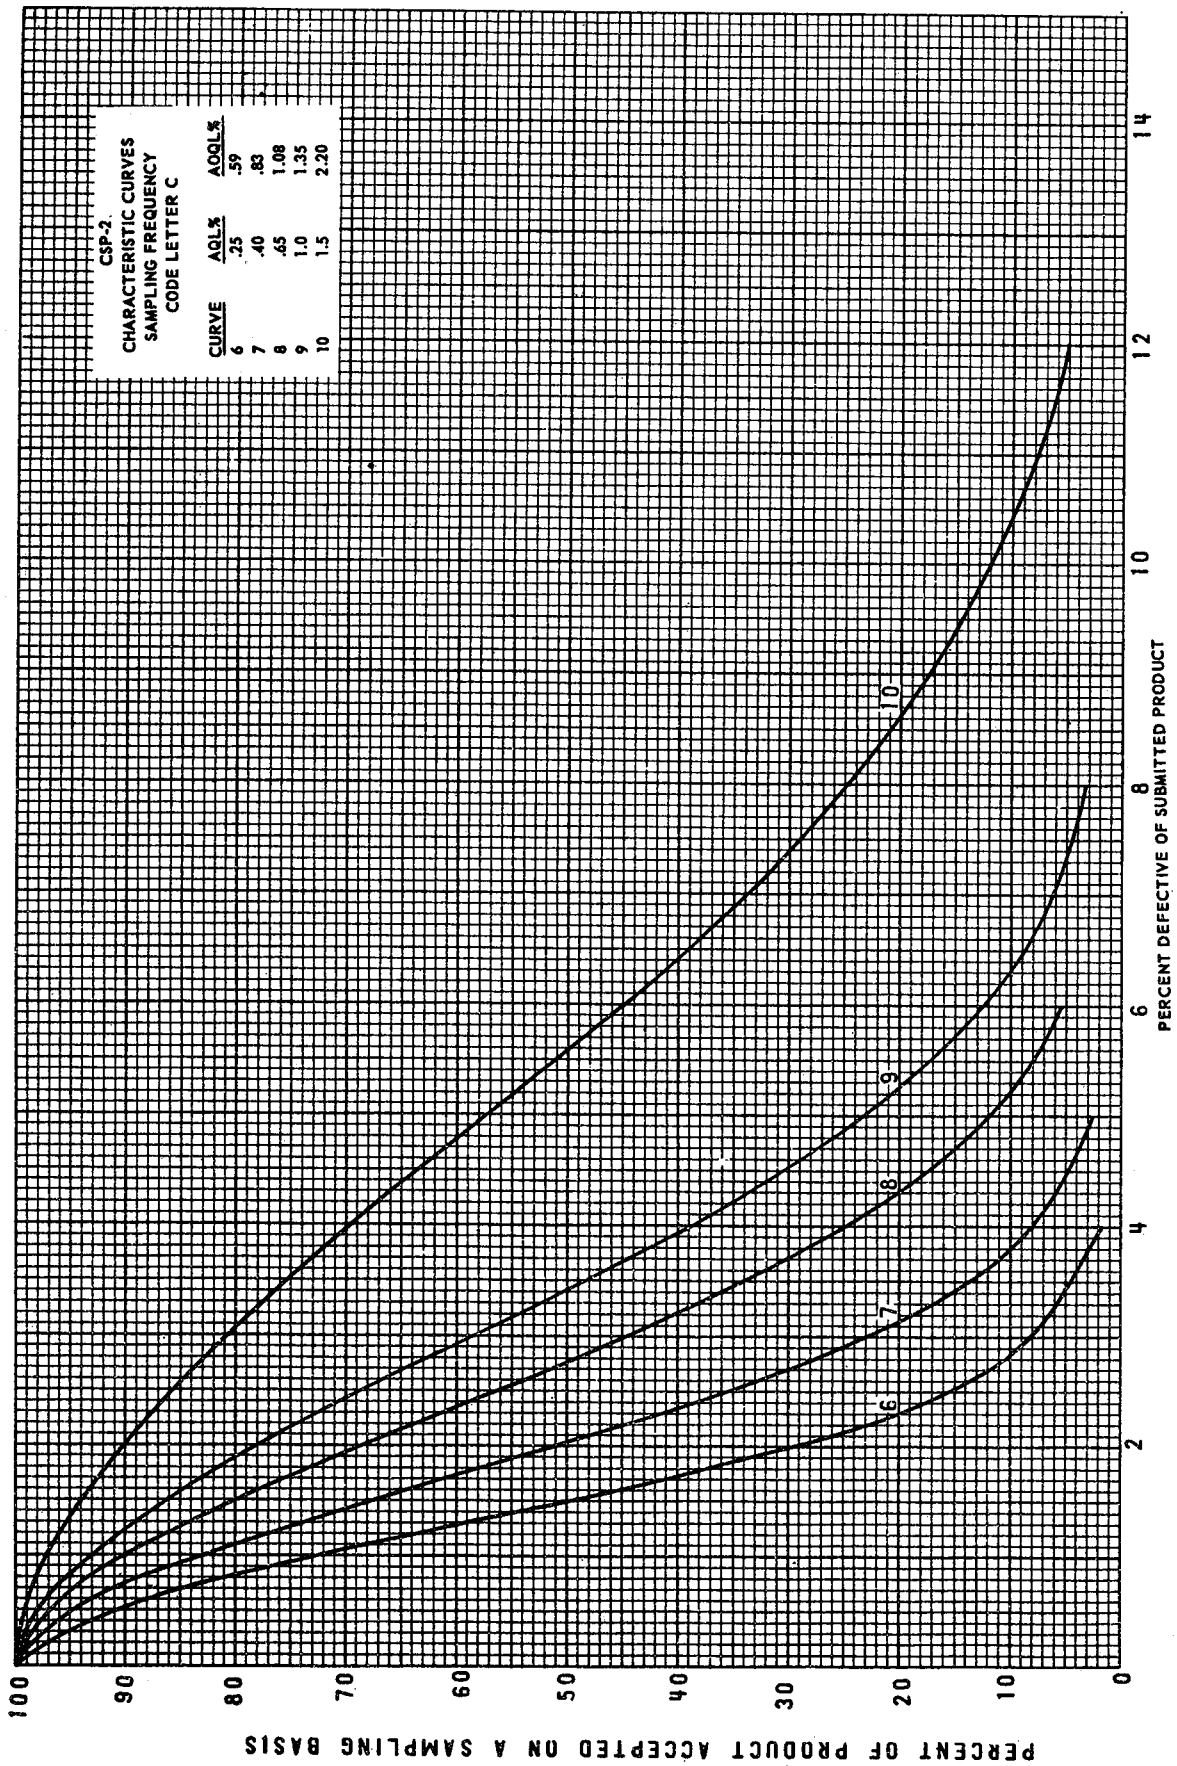


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

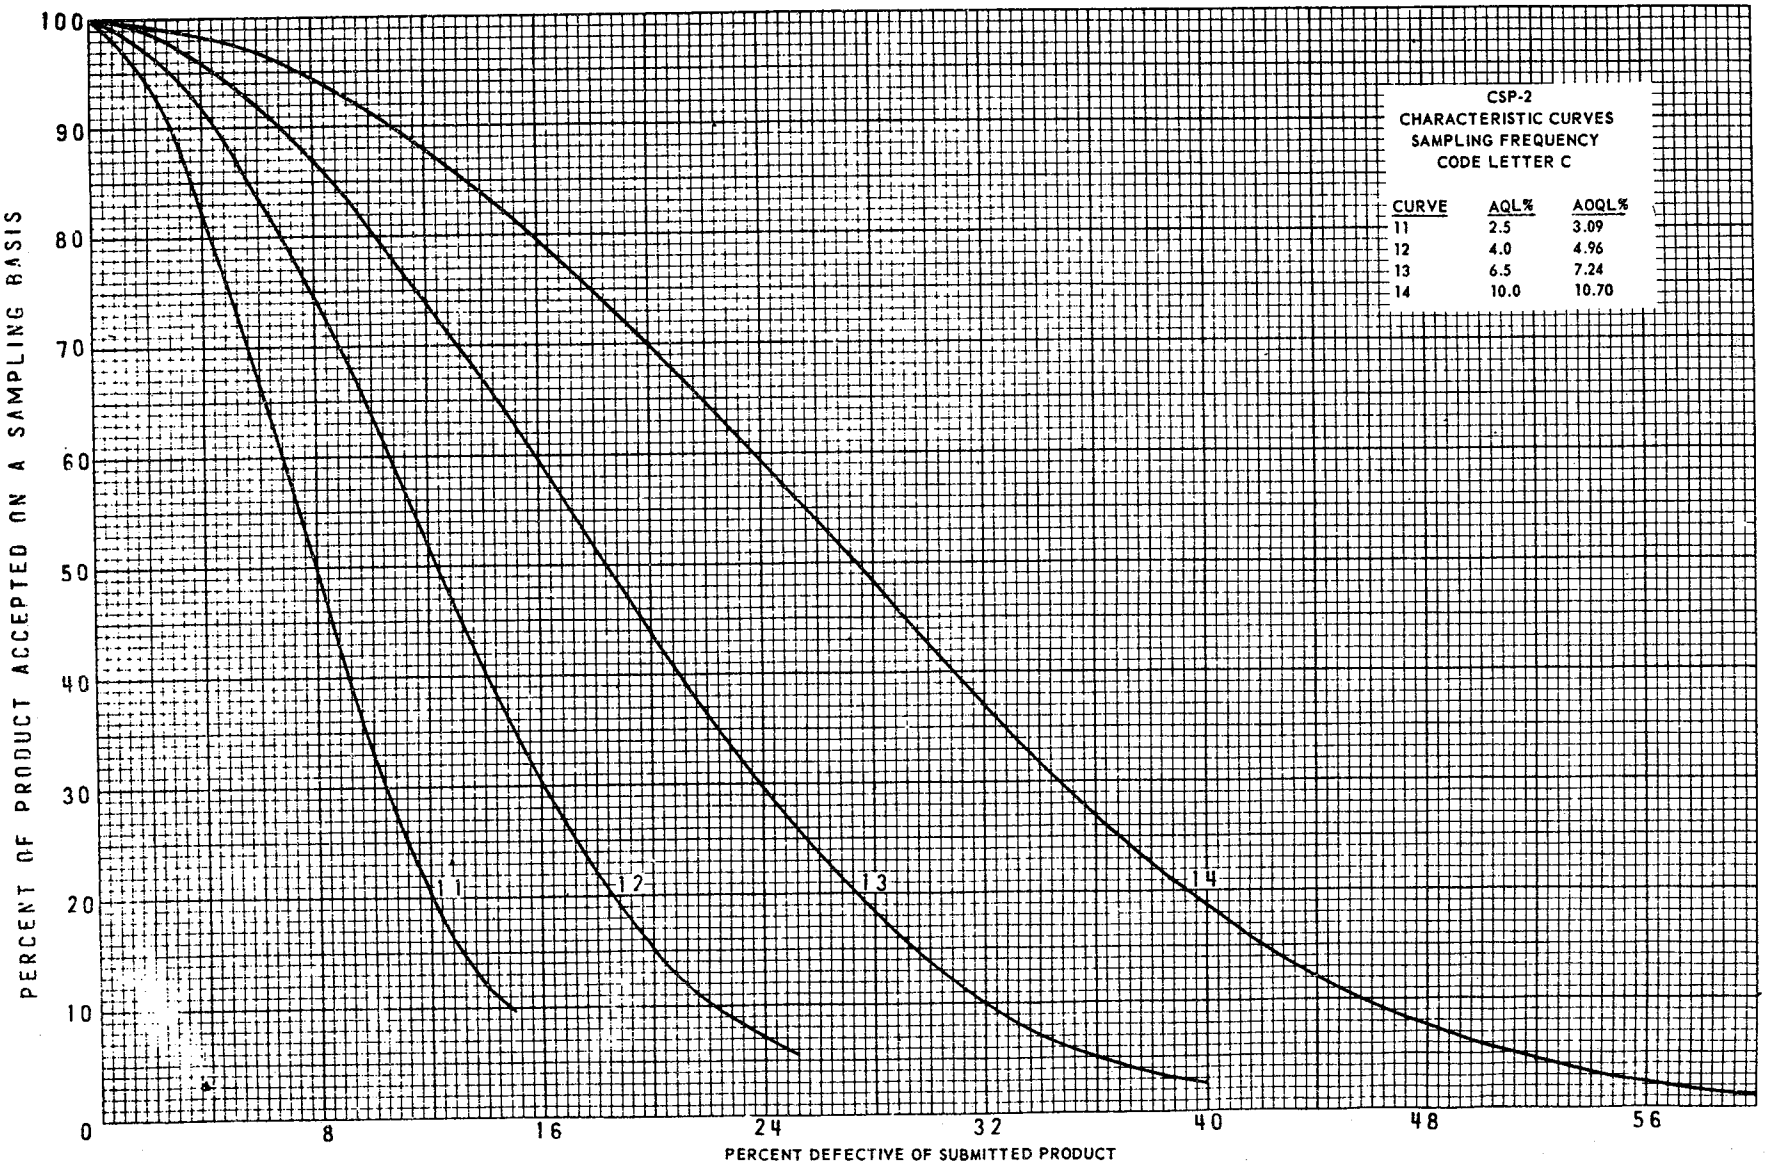


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

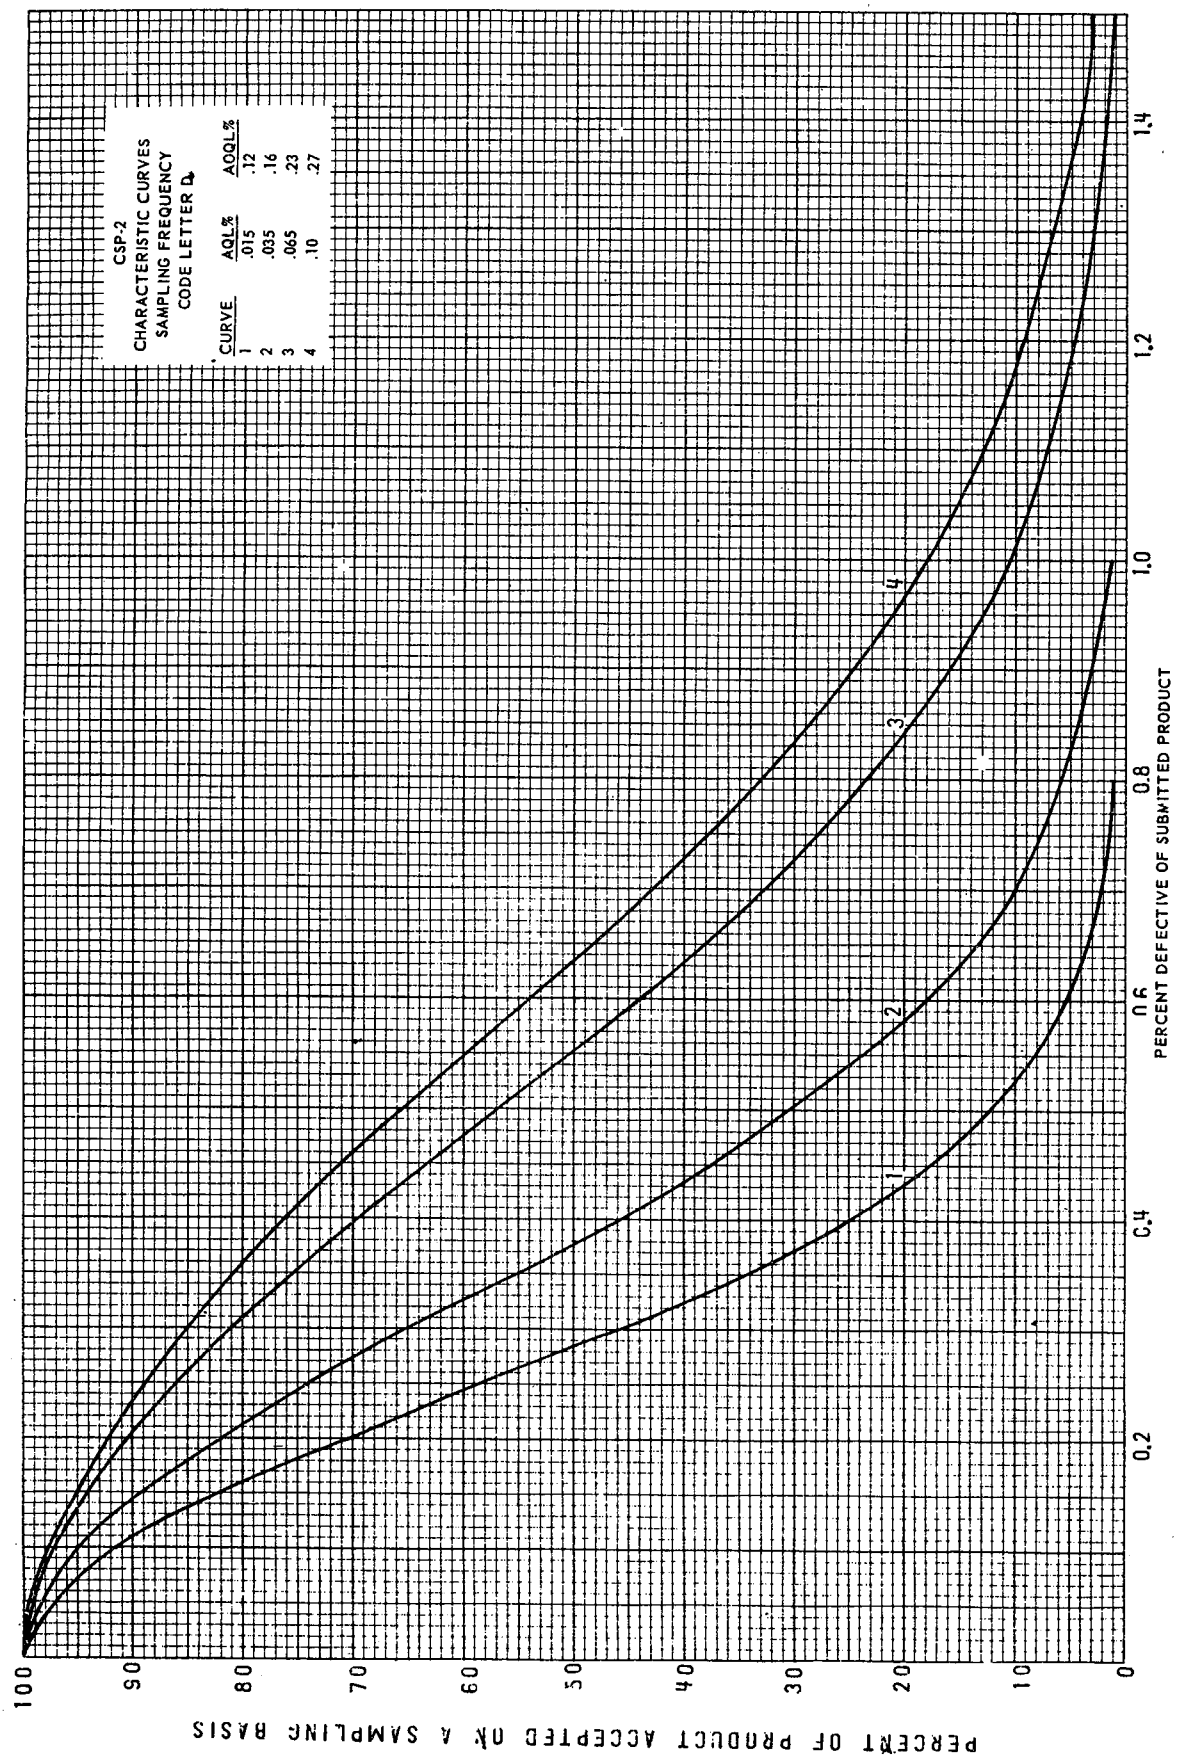

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

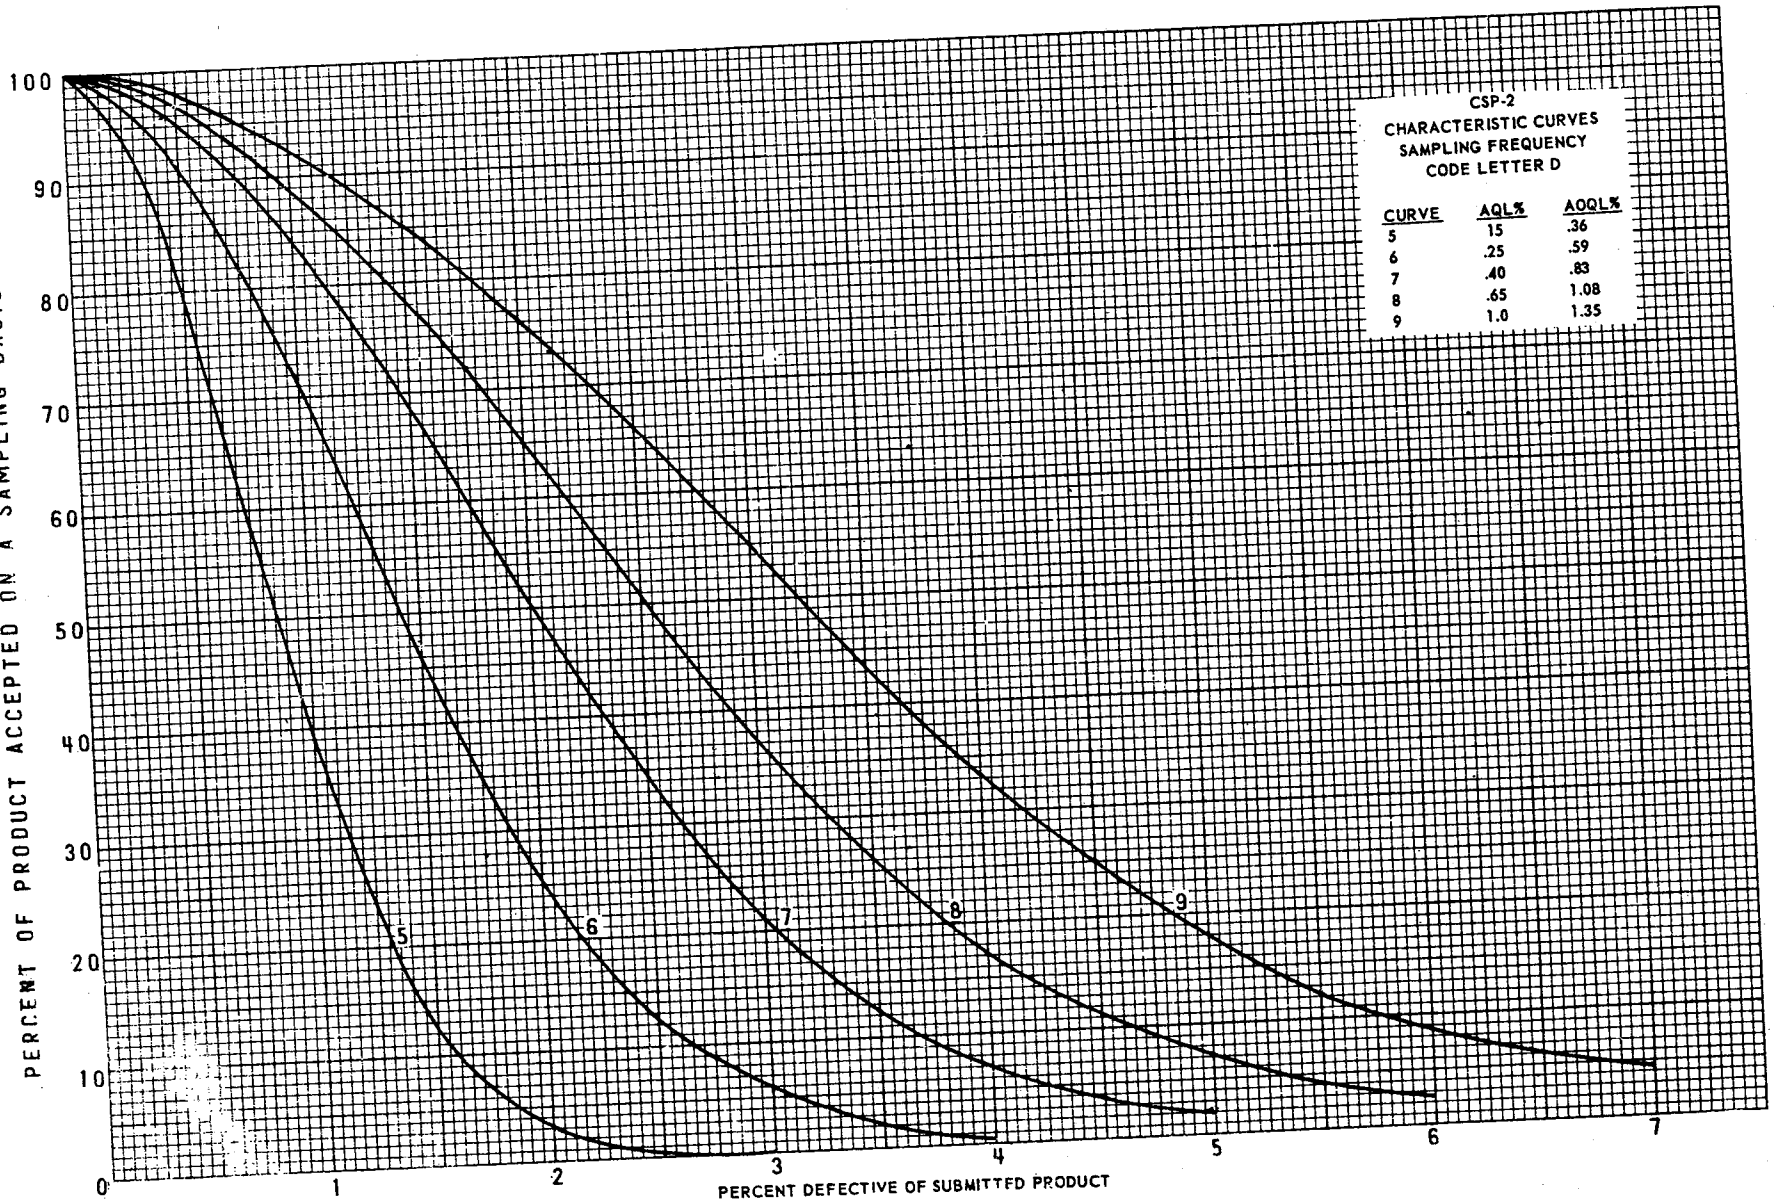


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

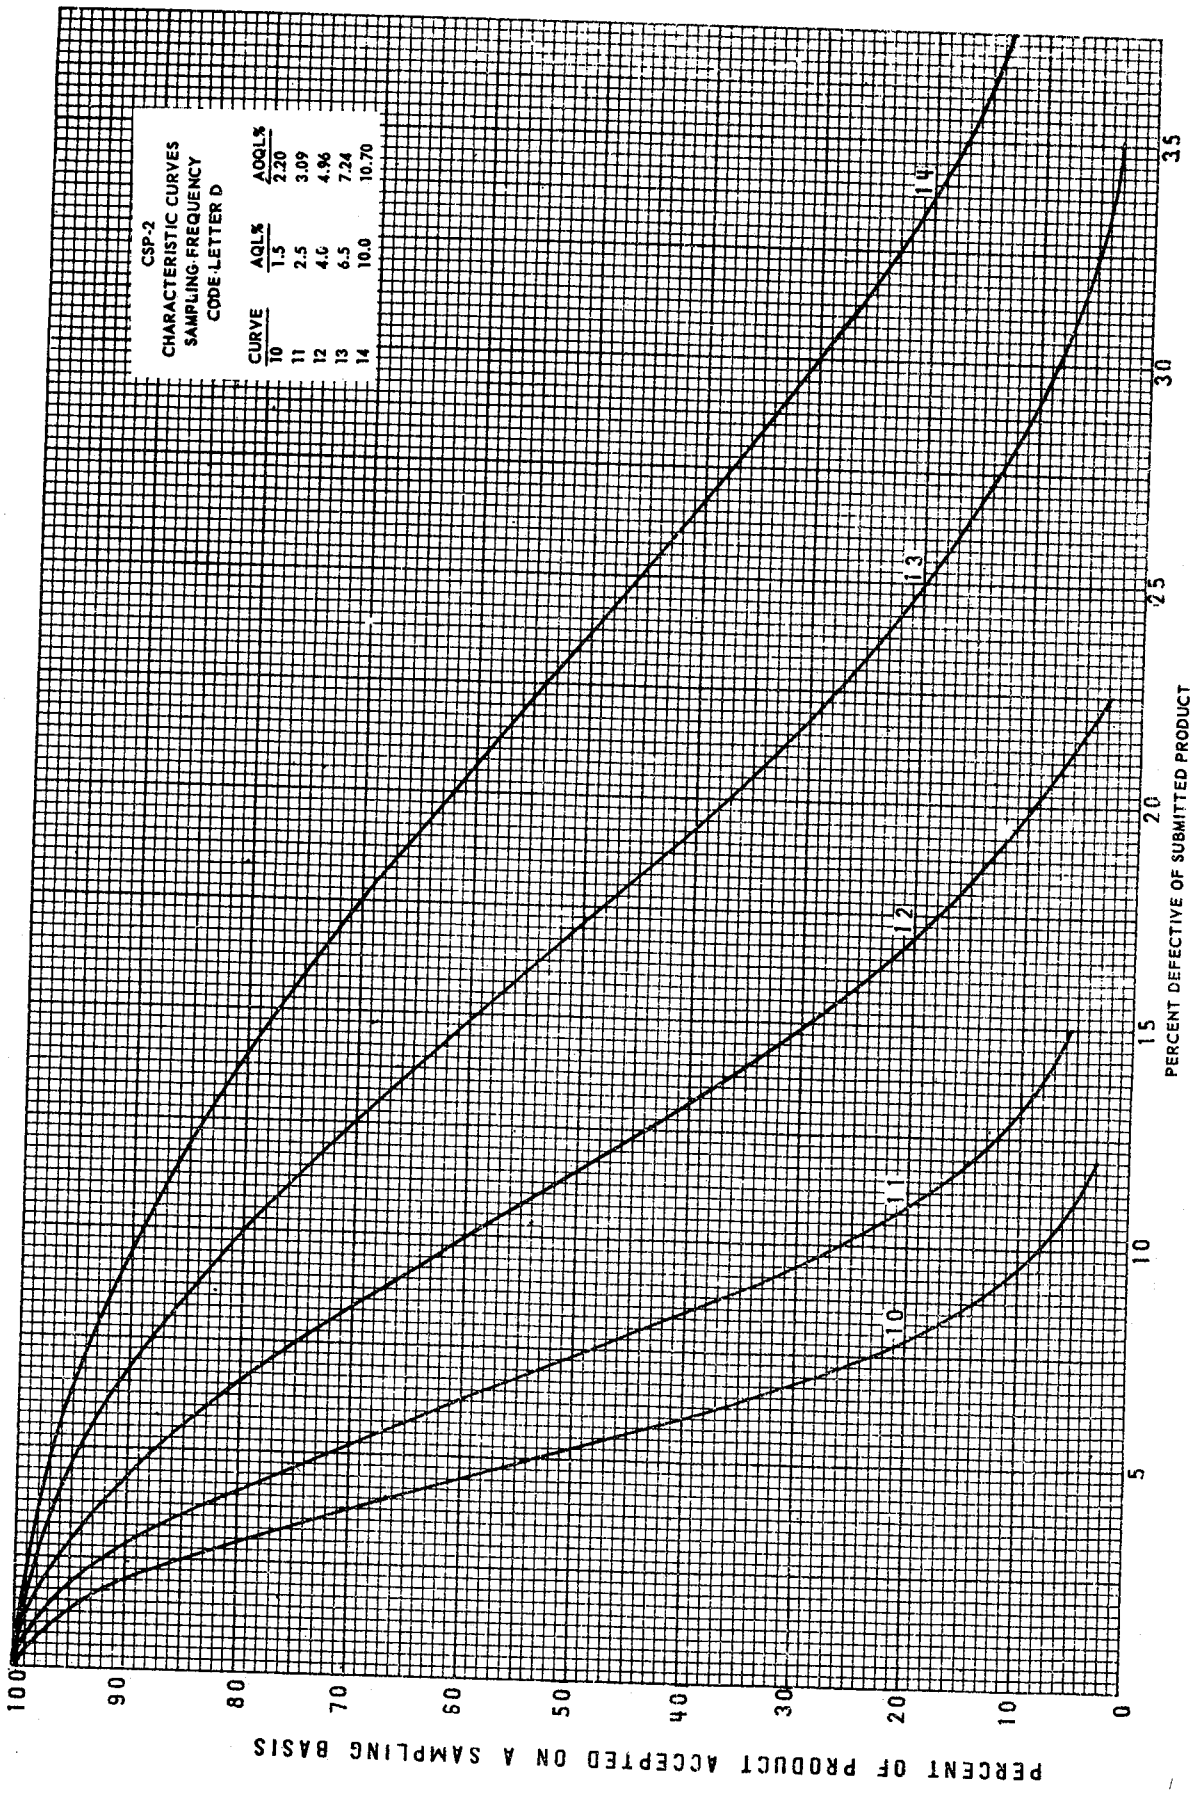


46


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

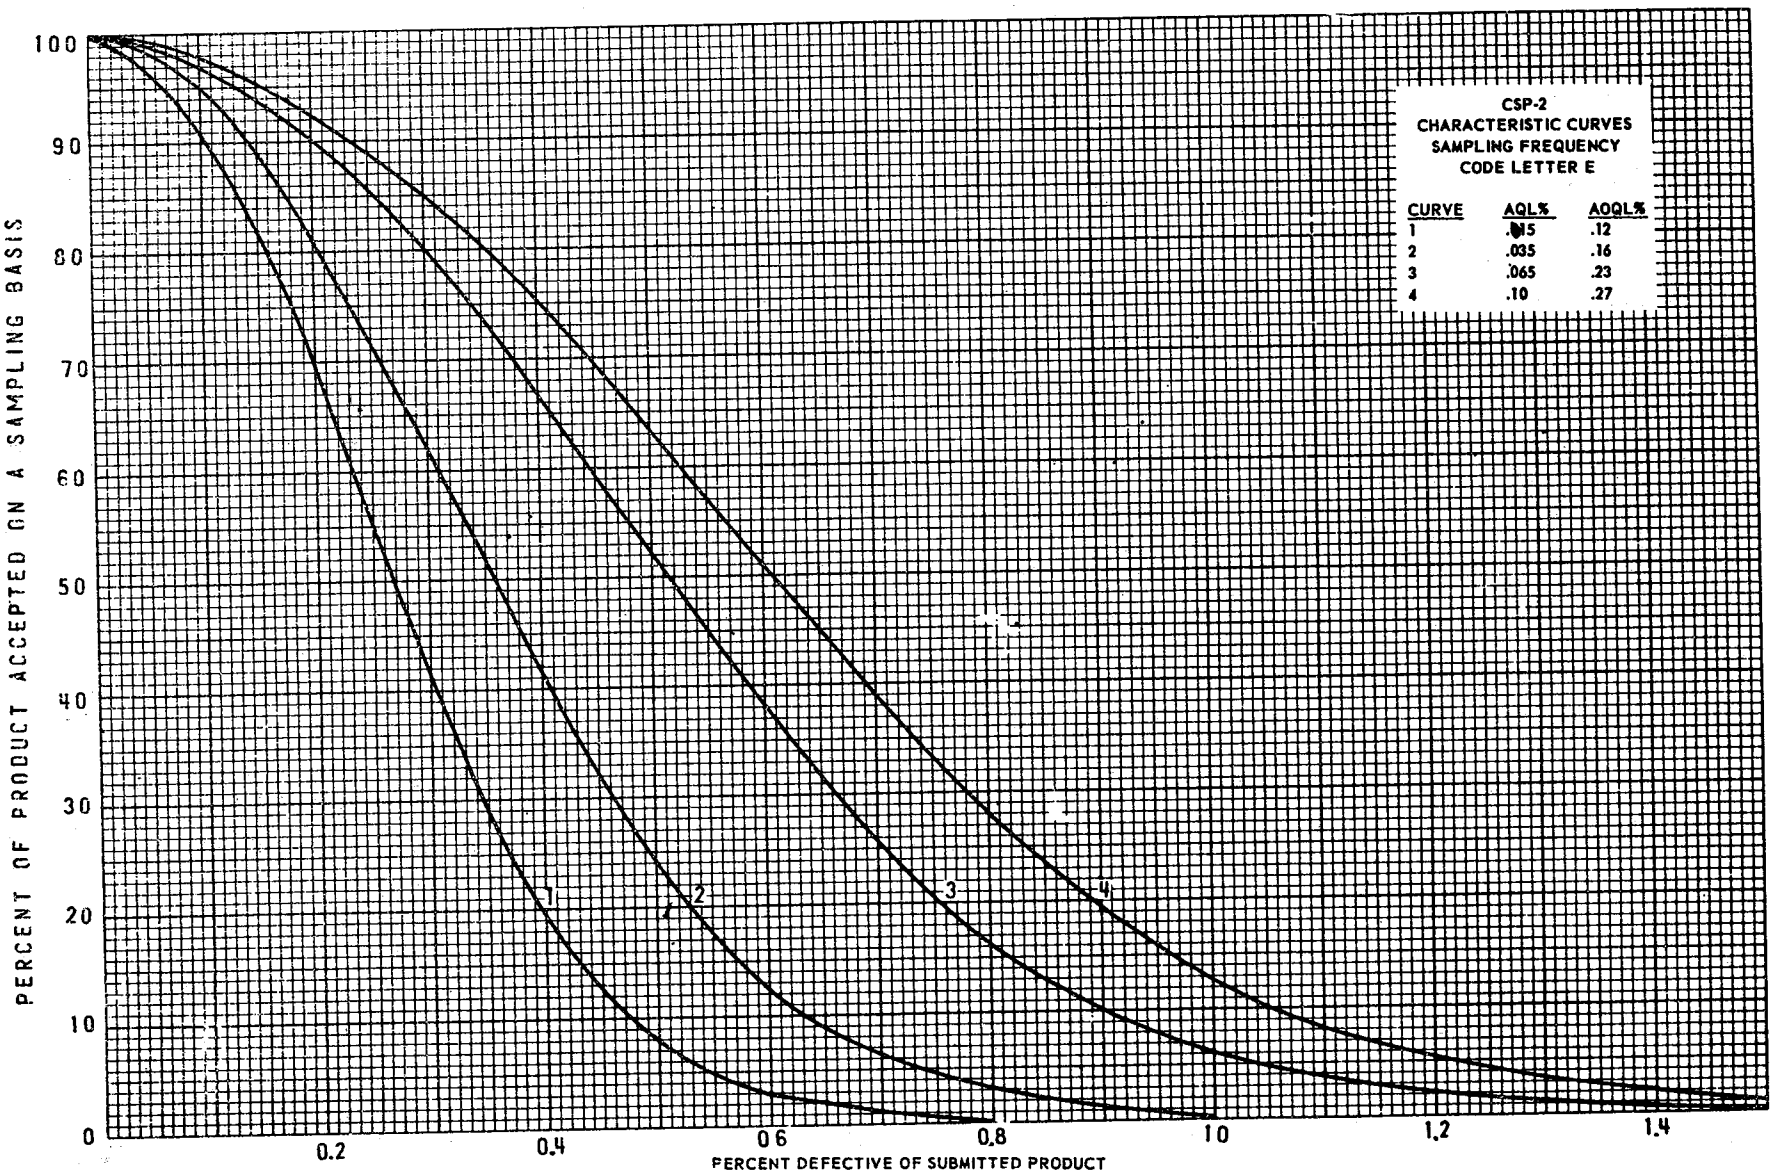


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

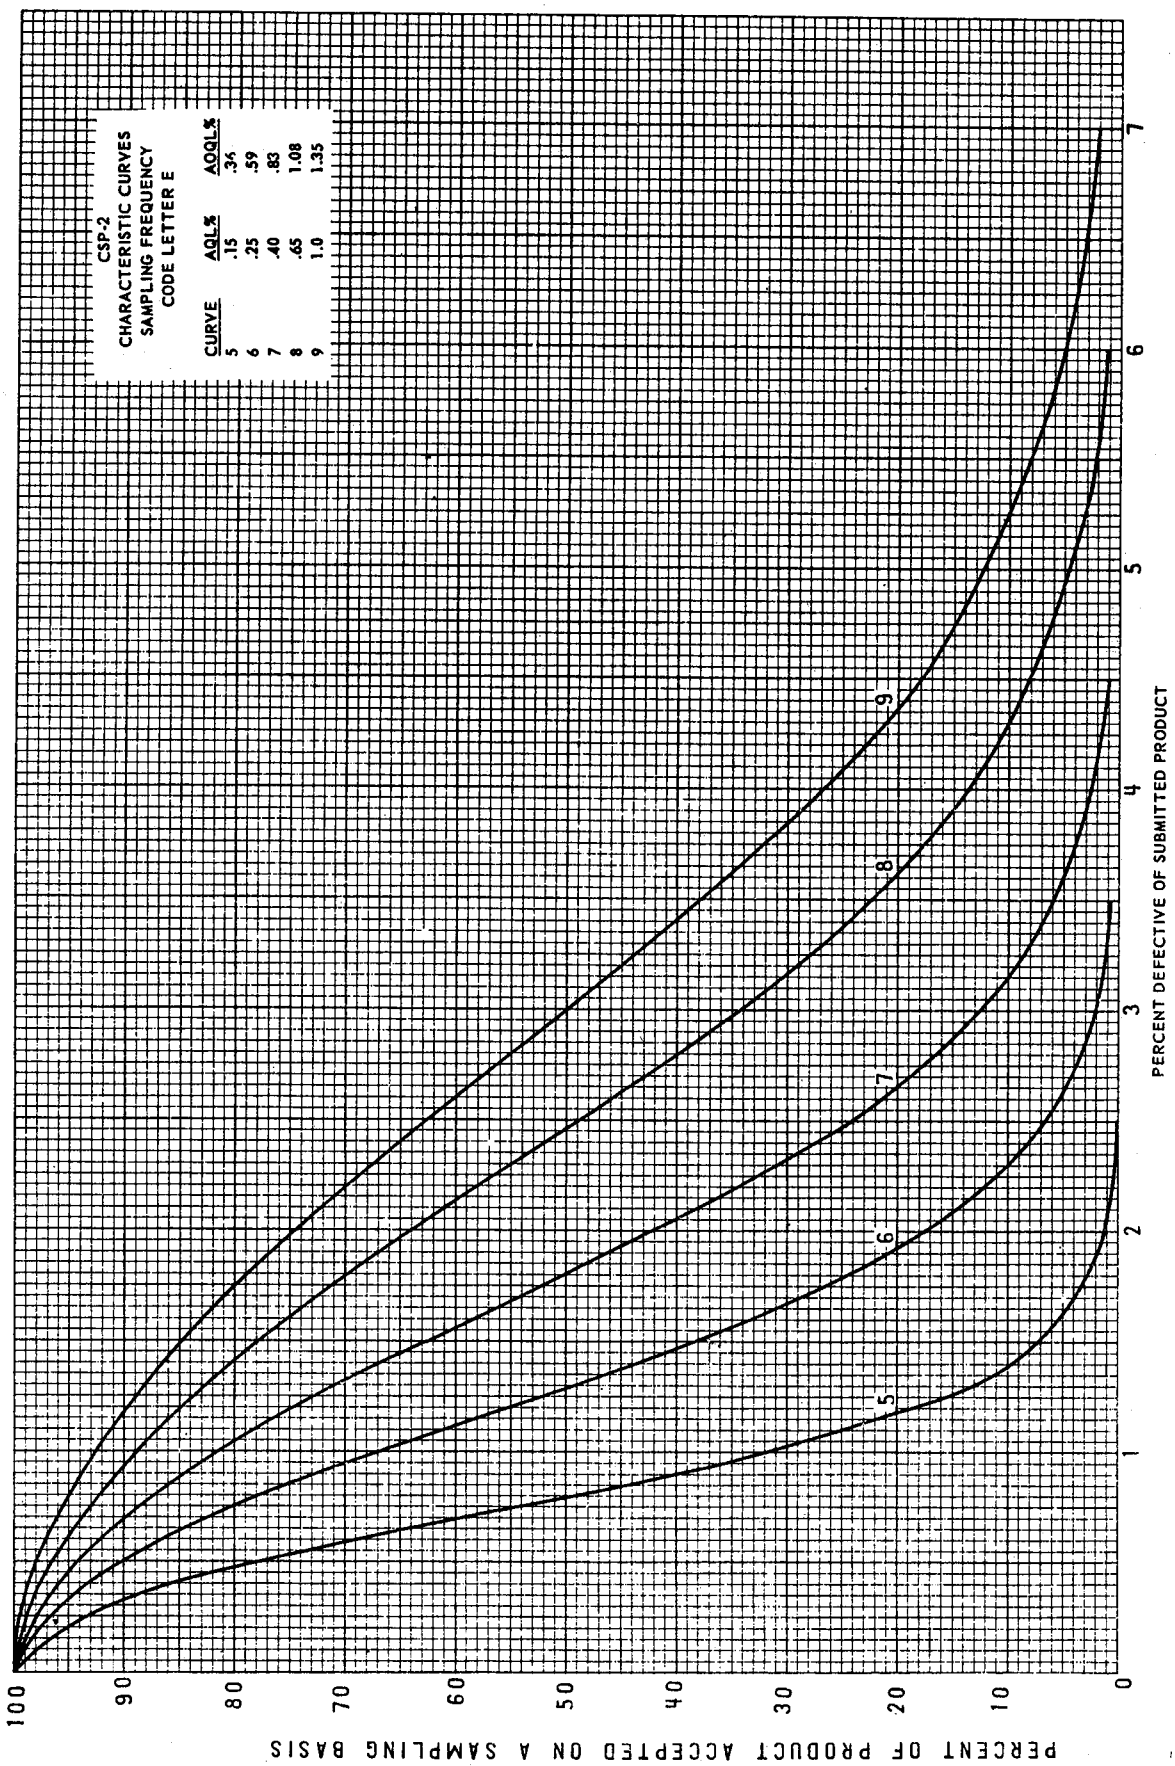


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

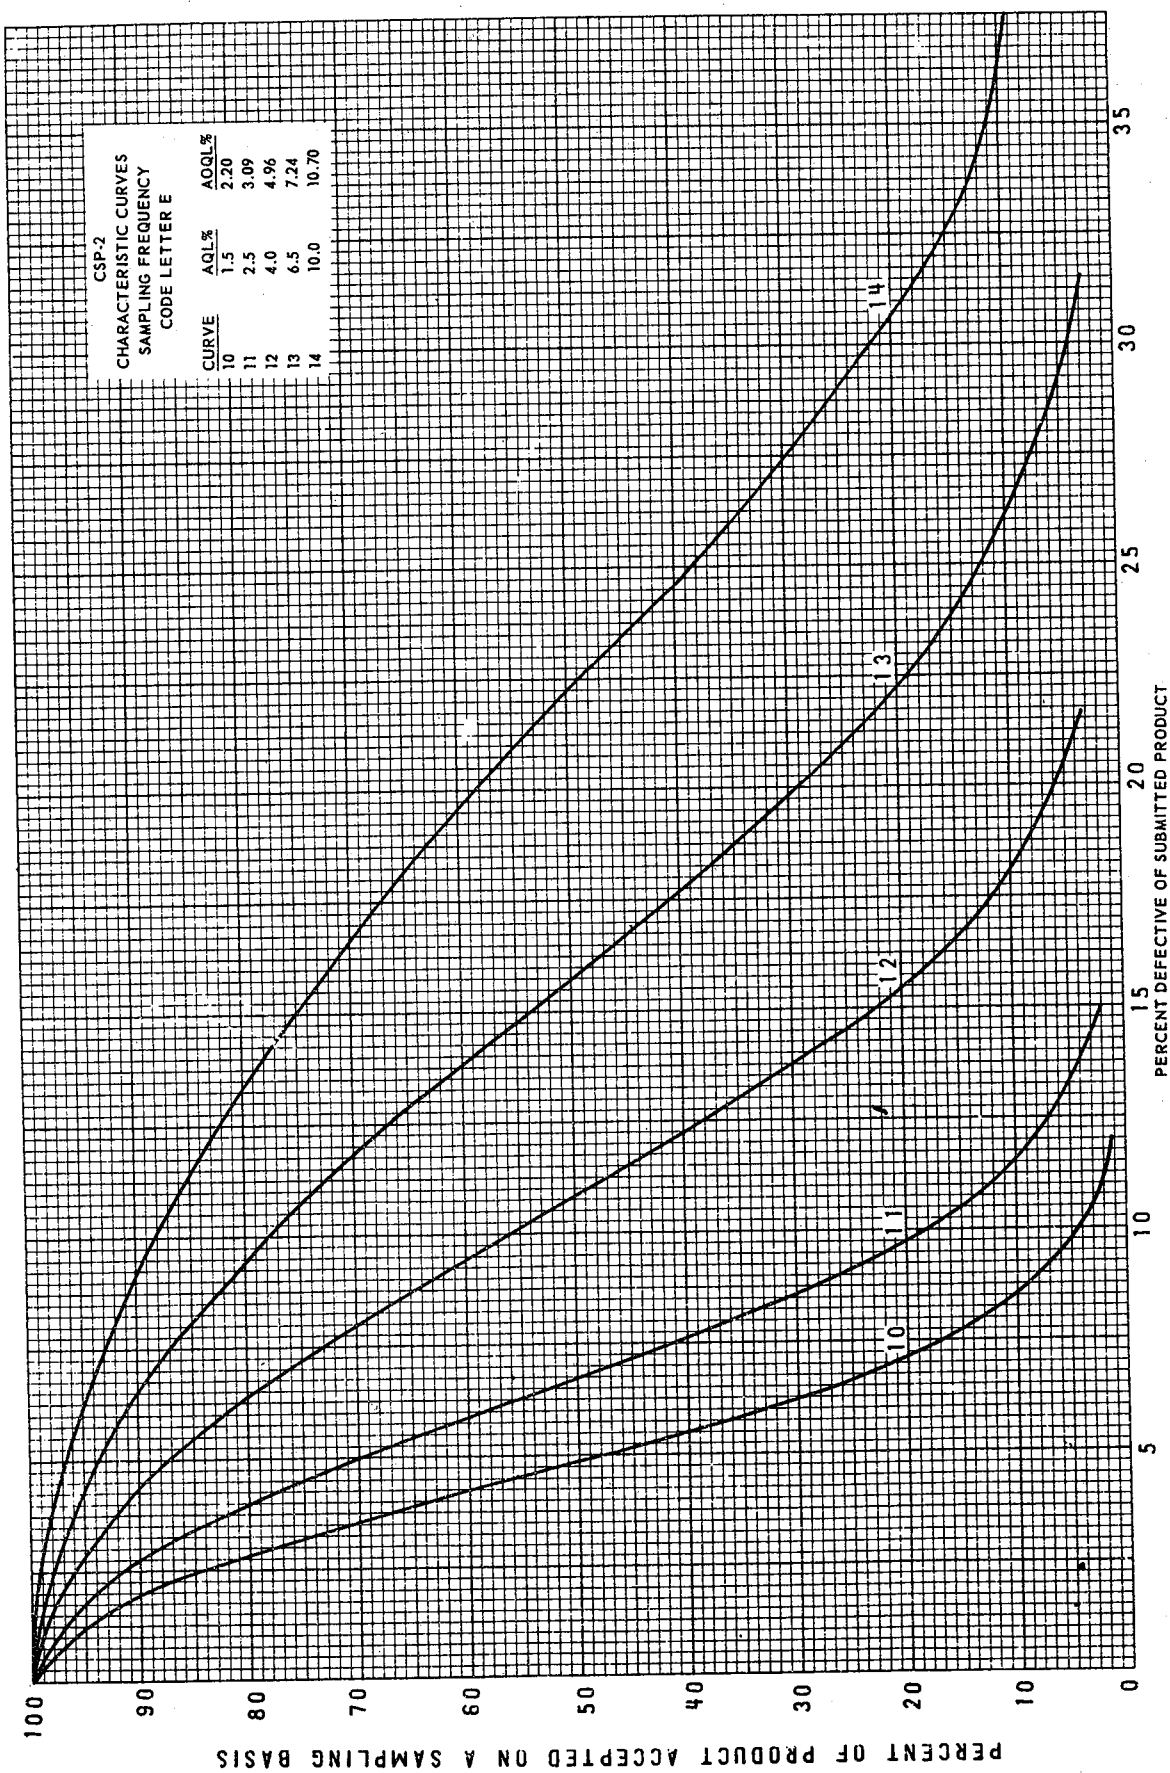


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

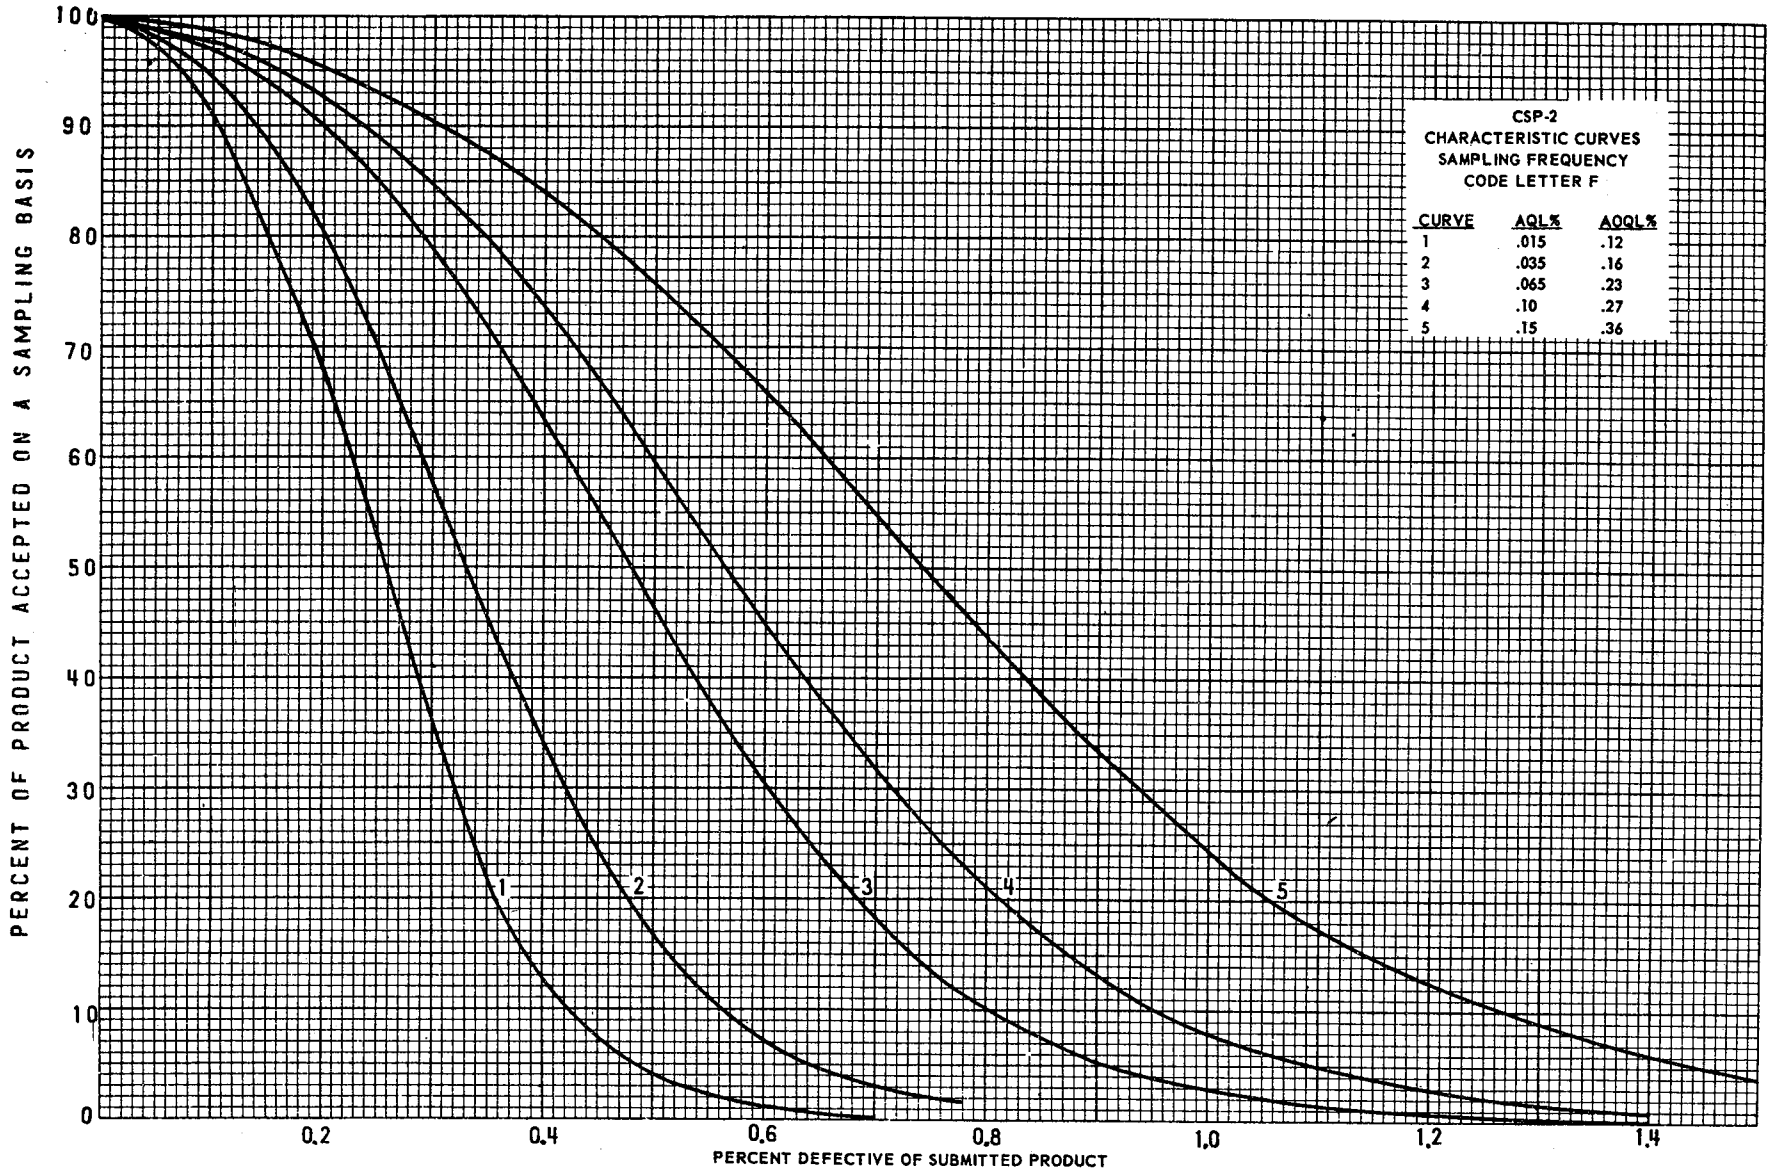


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

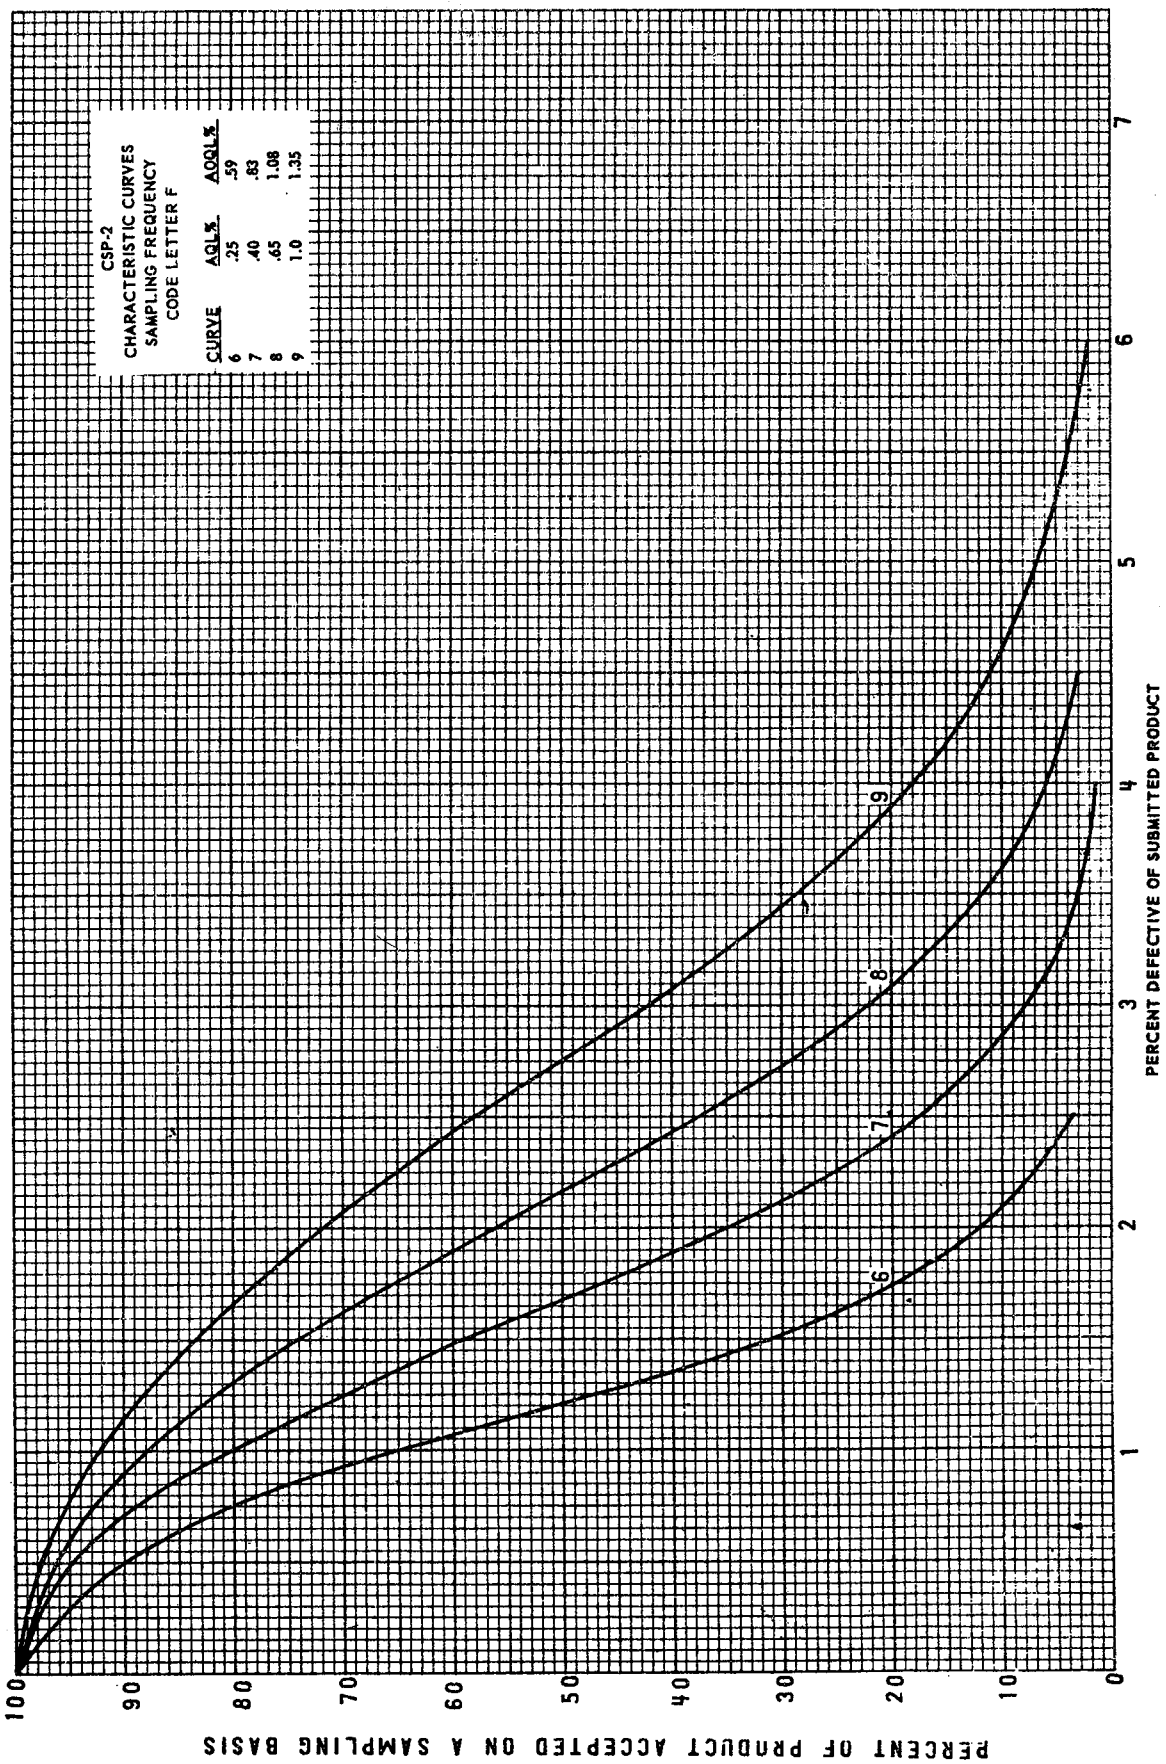


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

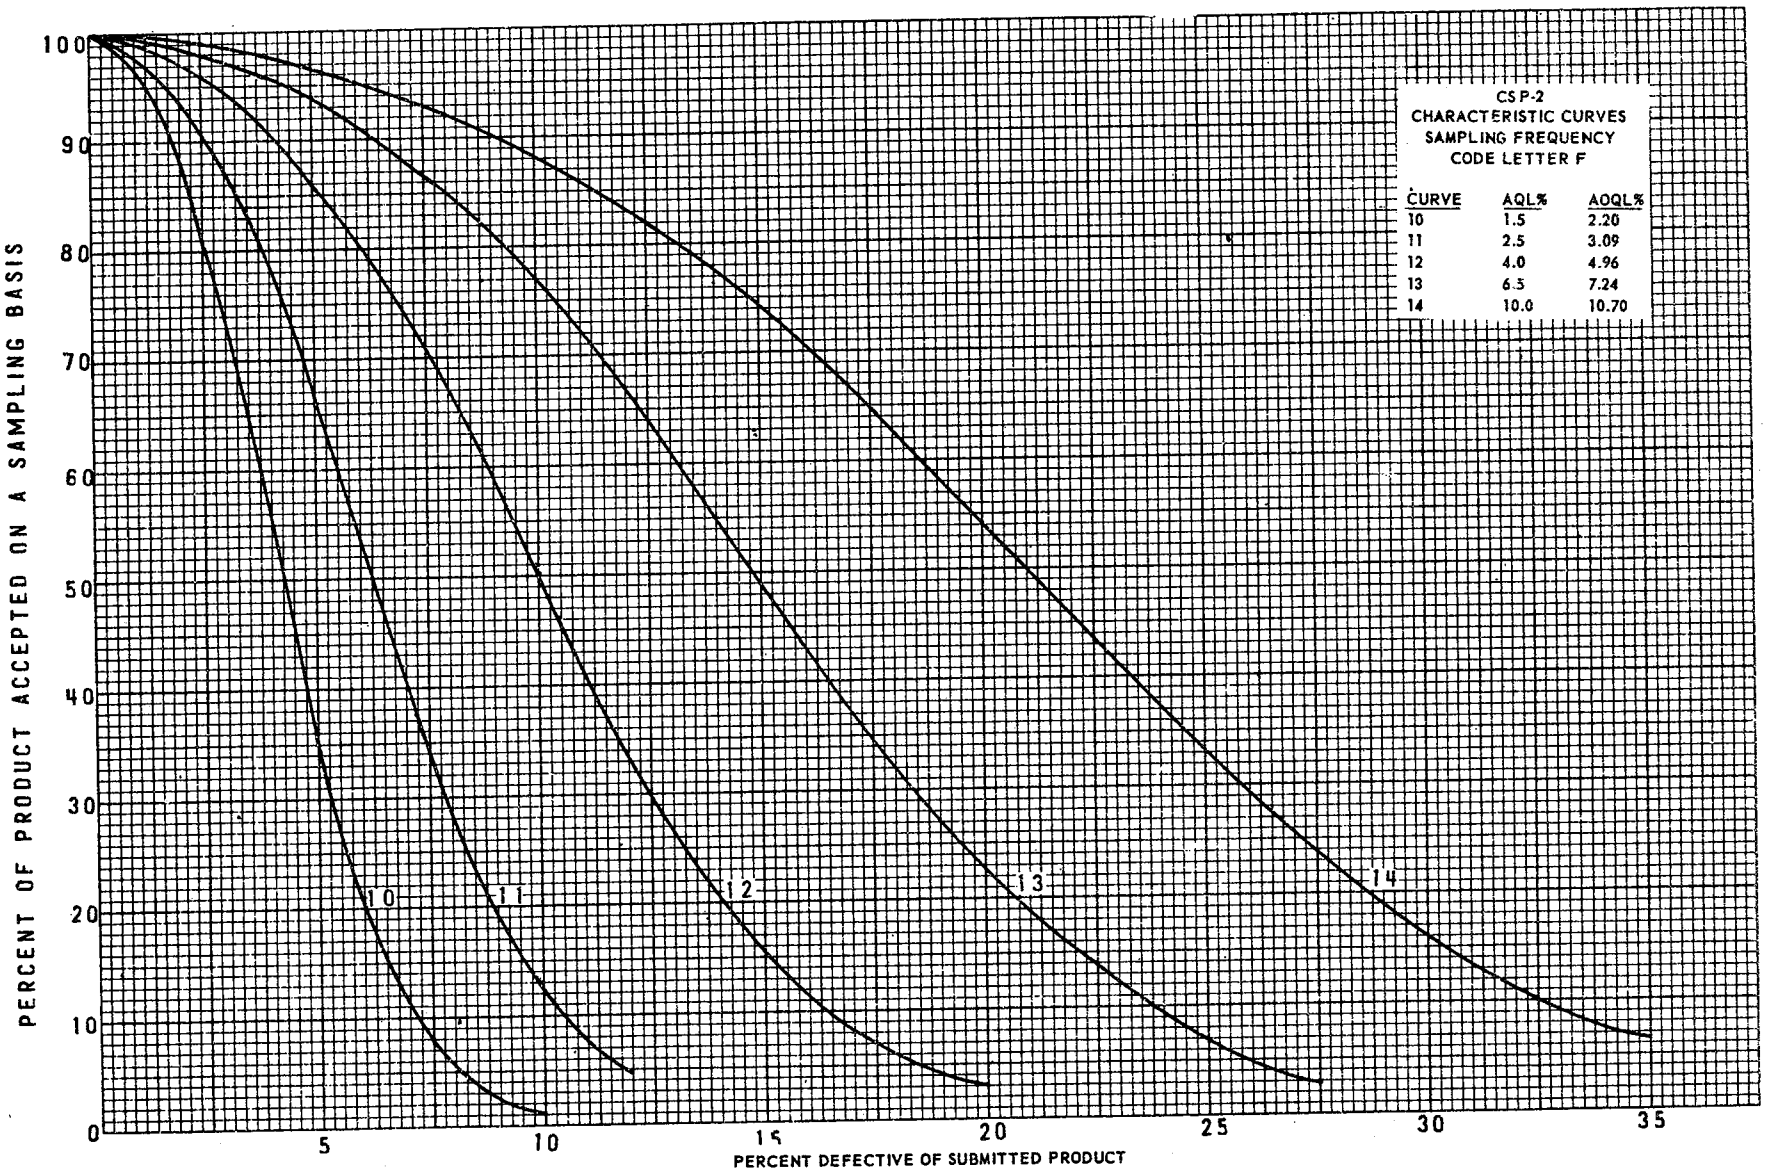


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

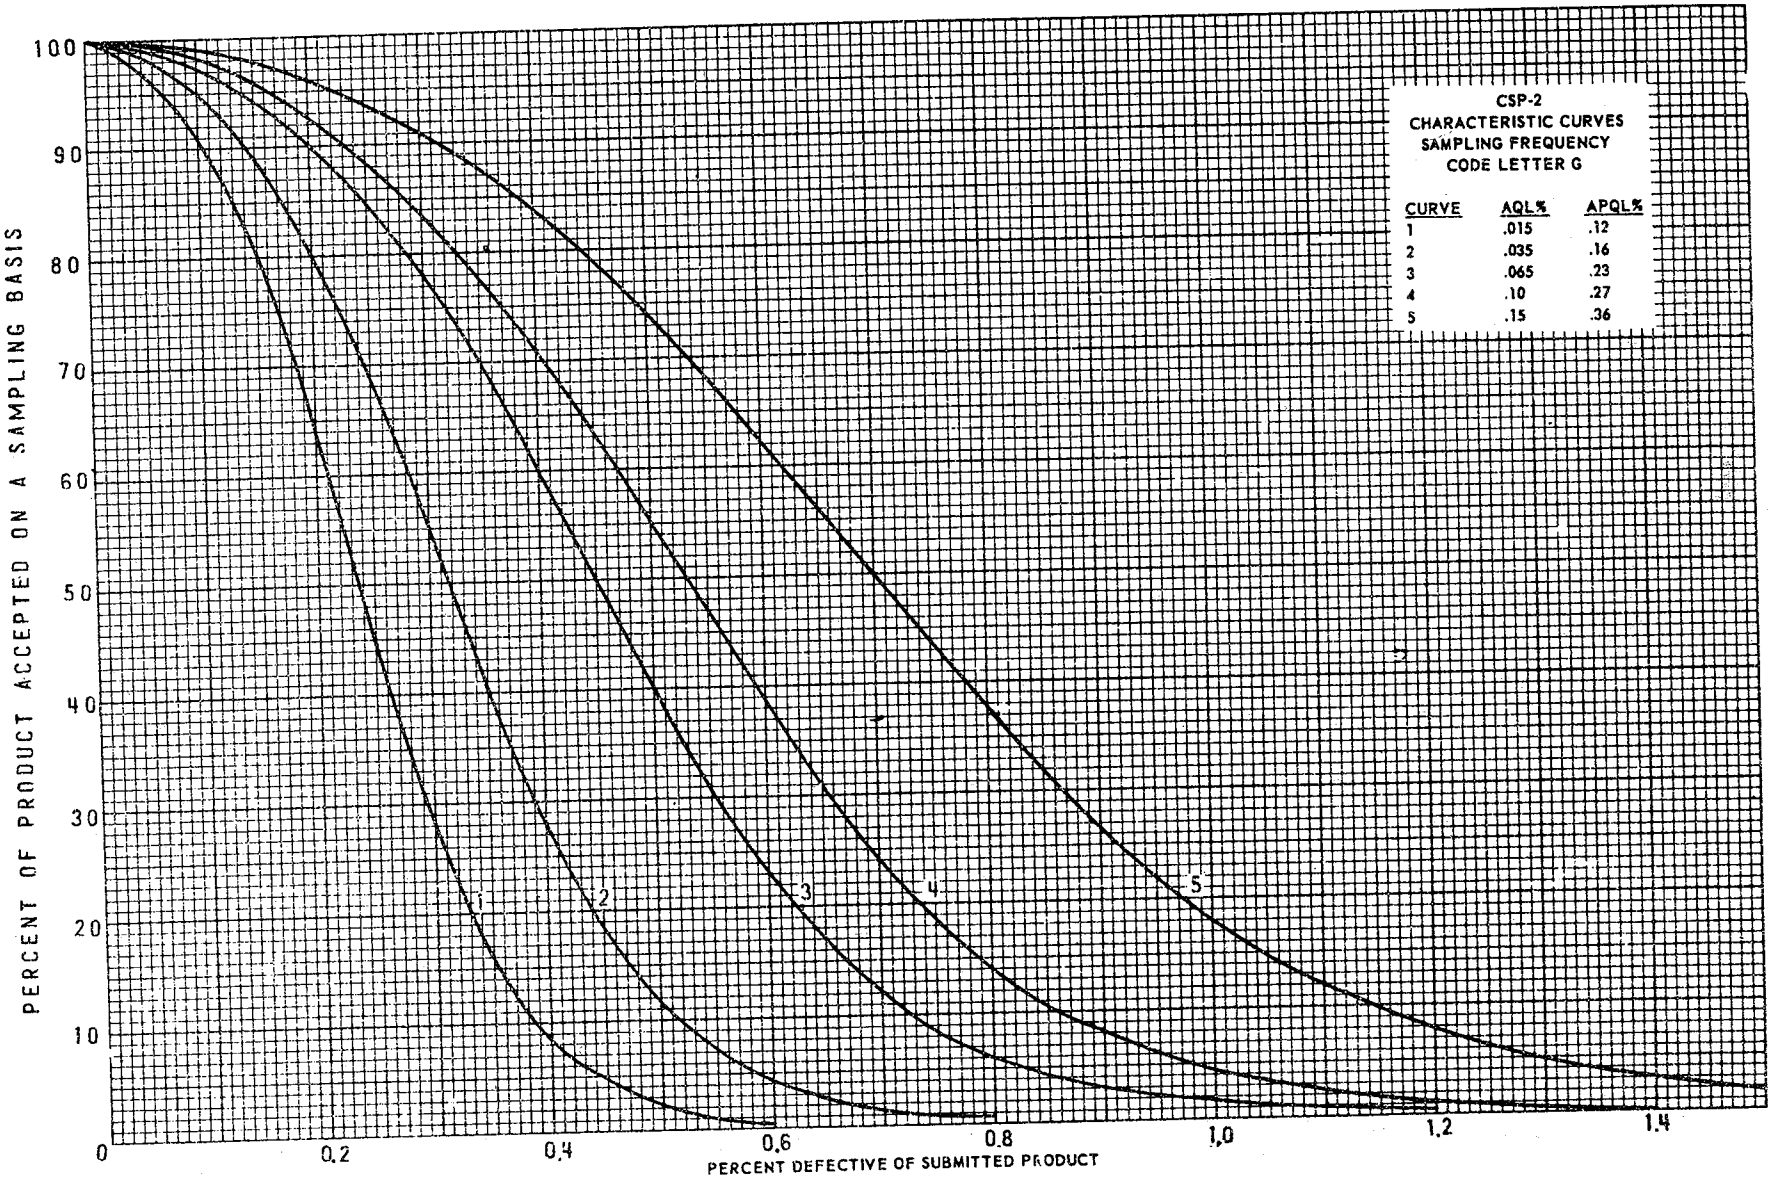


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

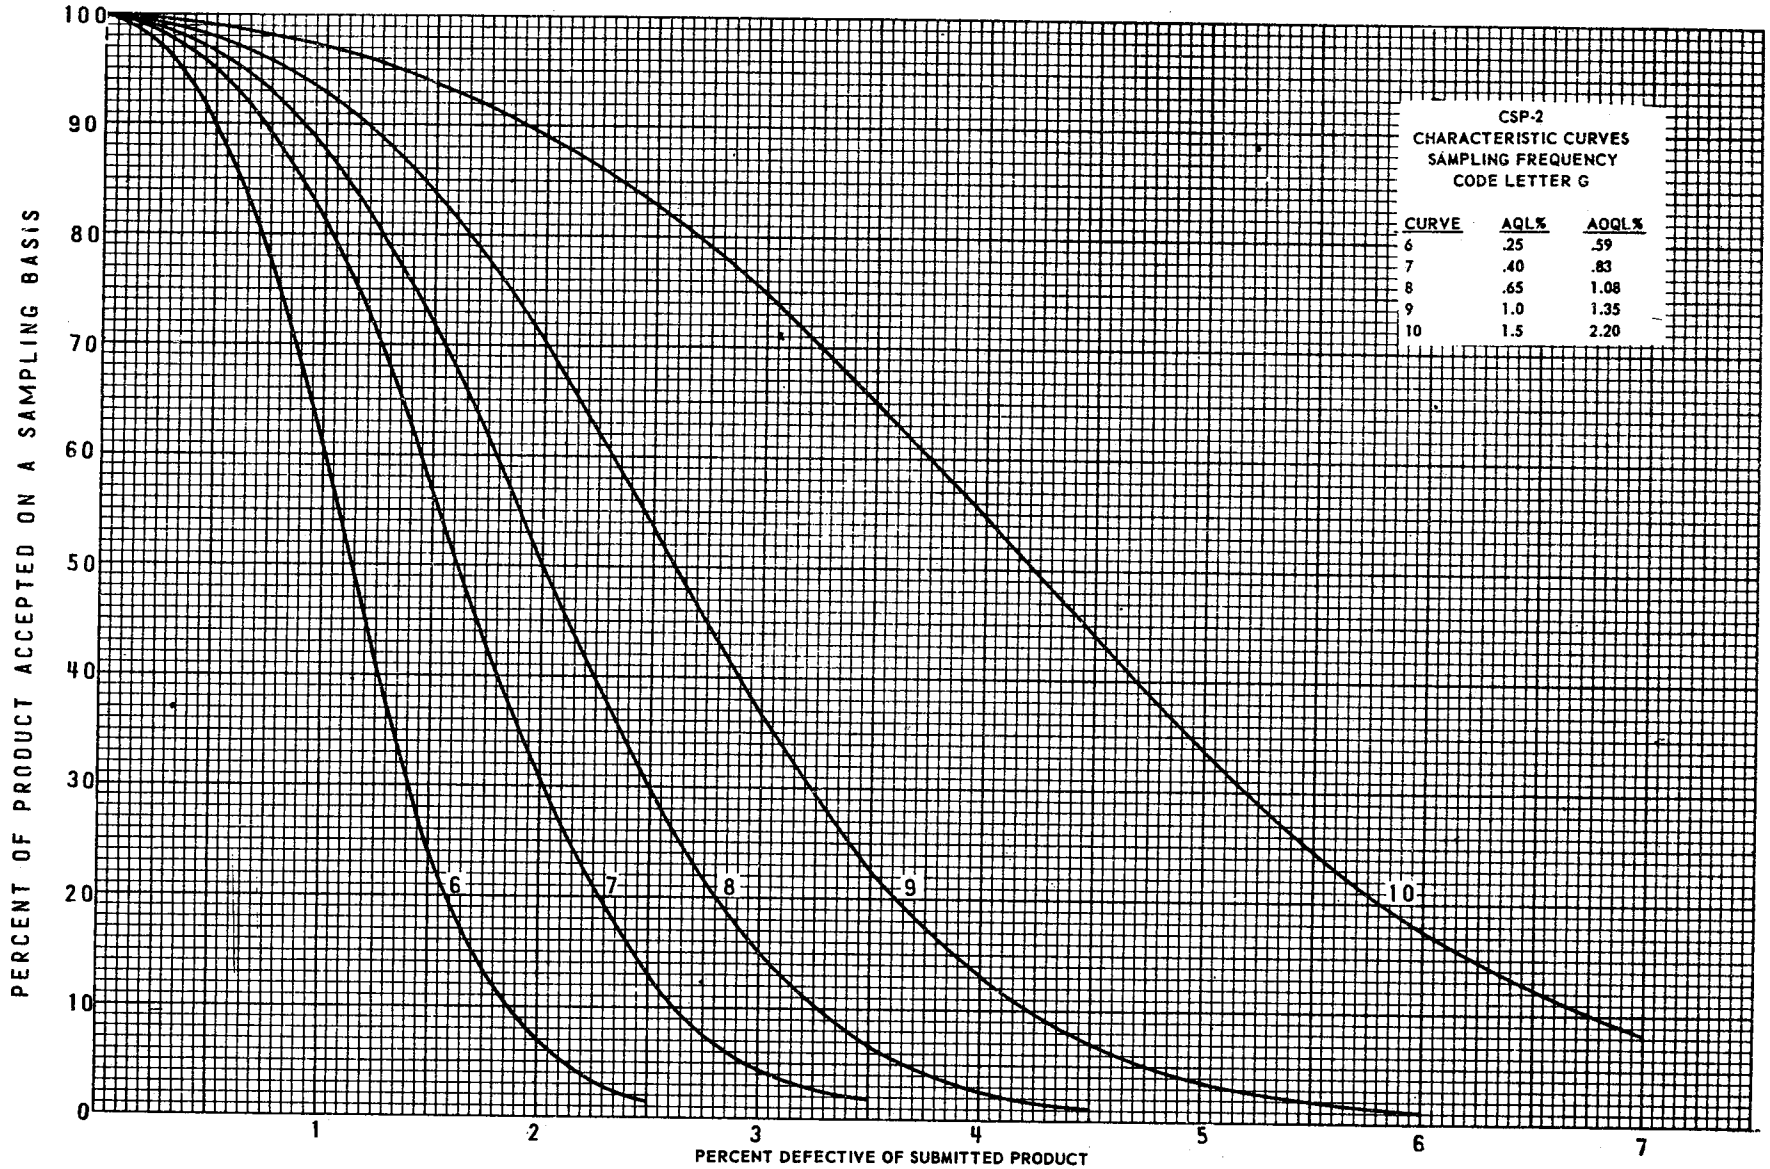


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

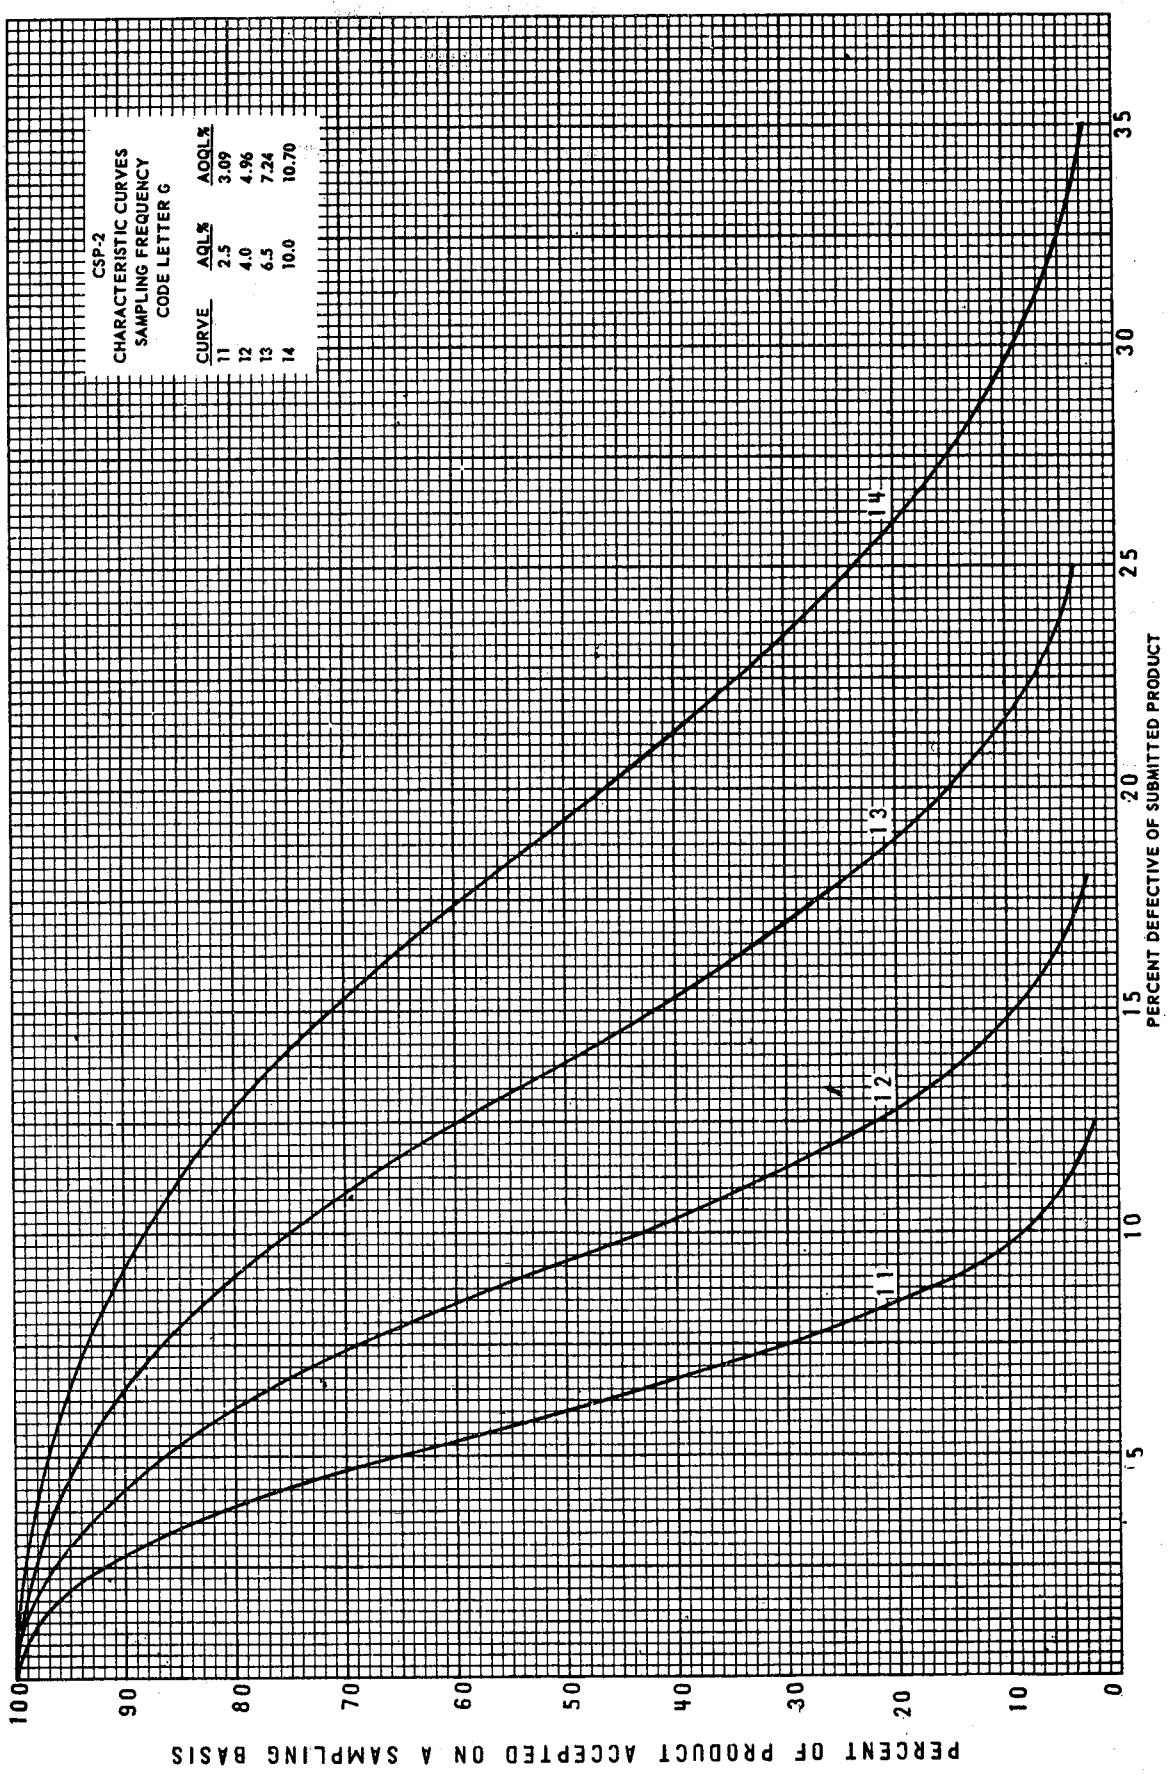


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

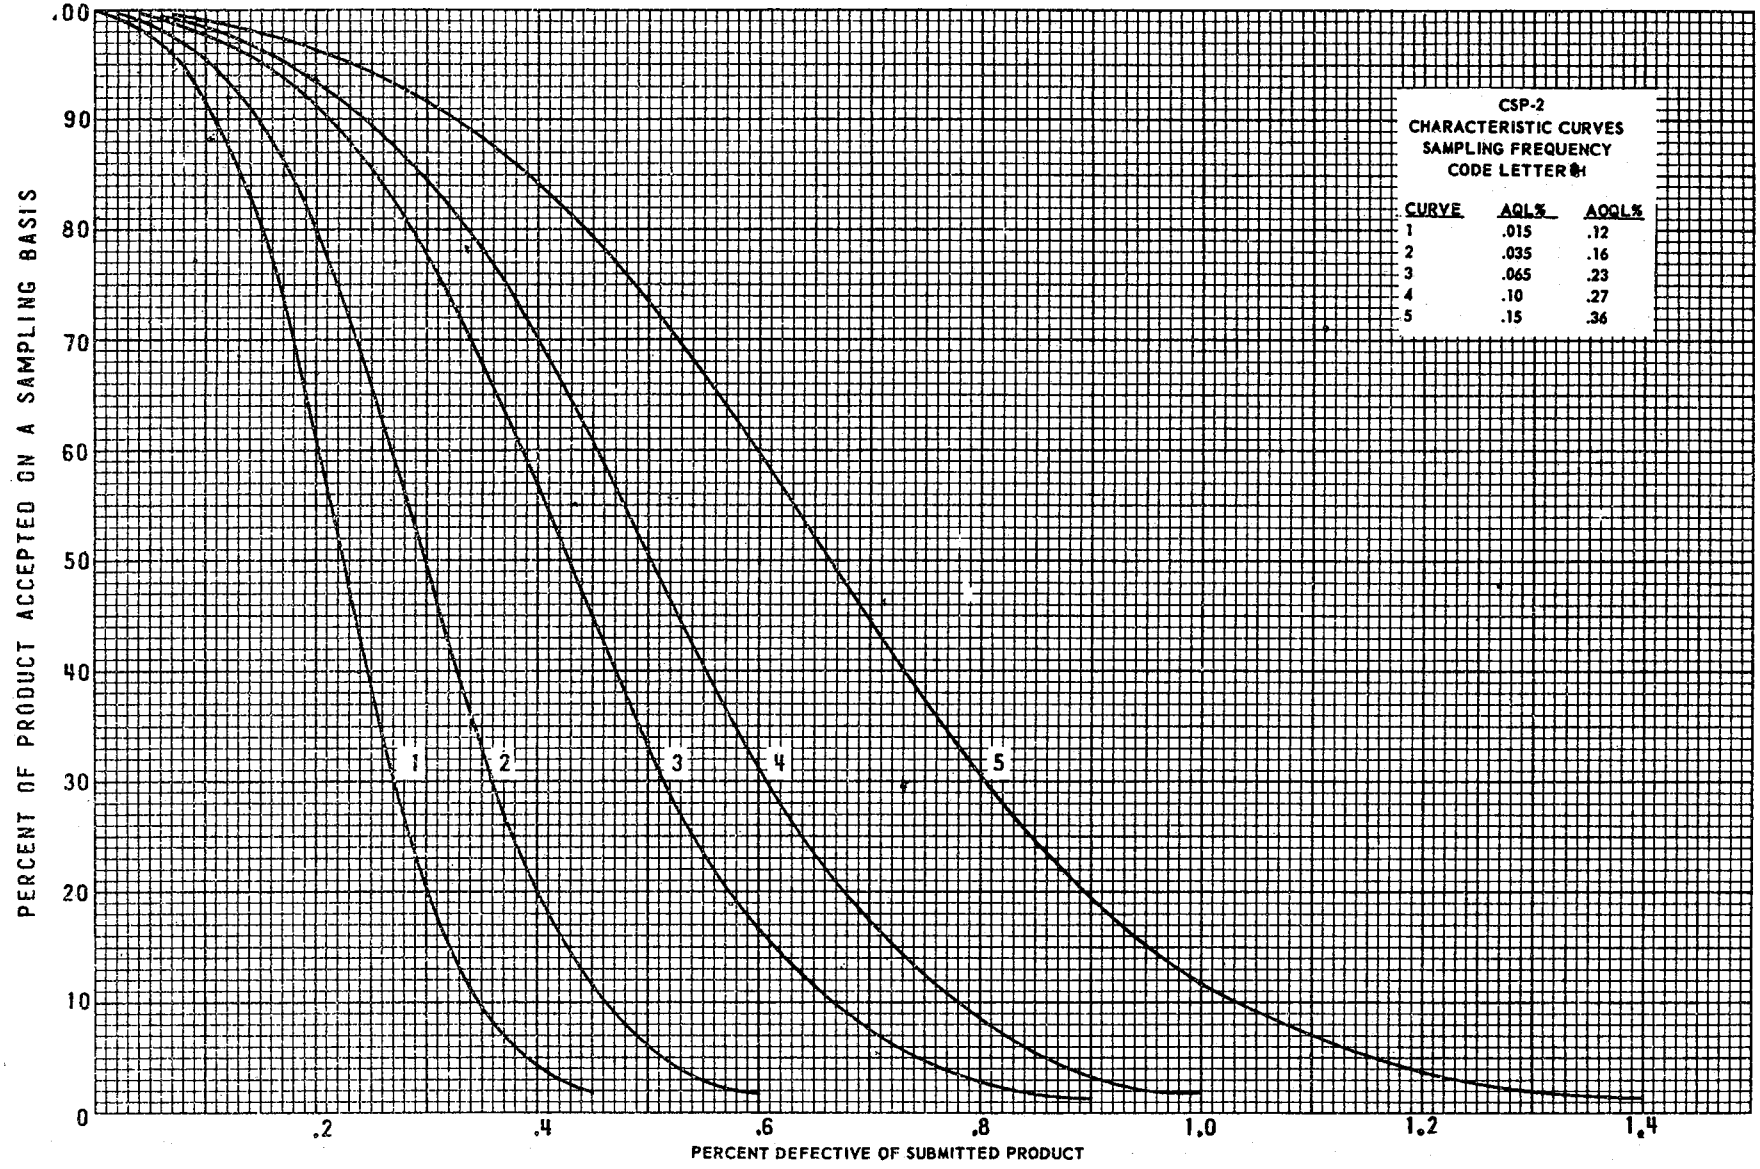


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

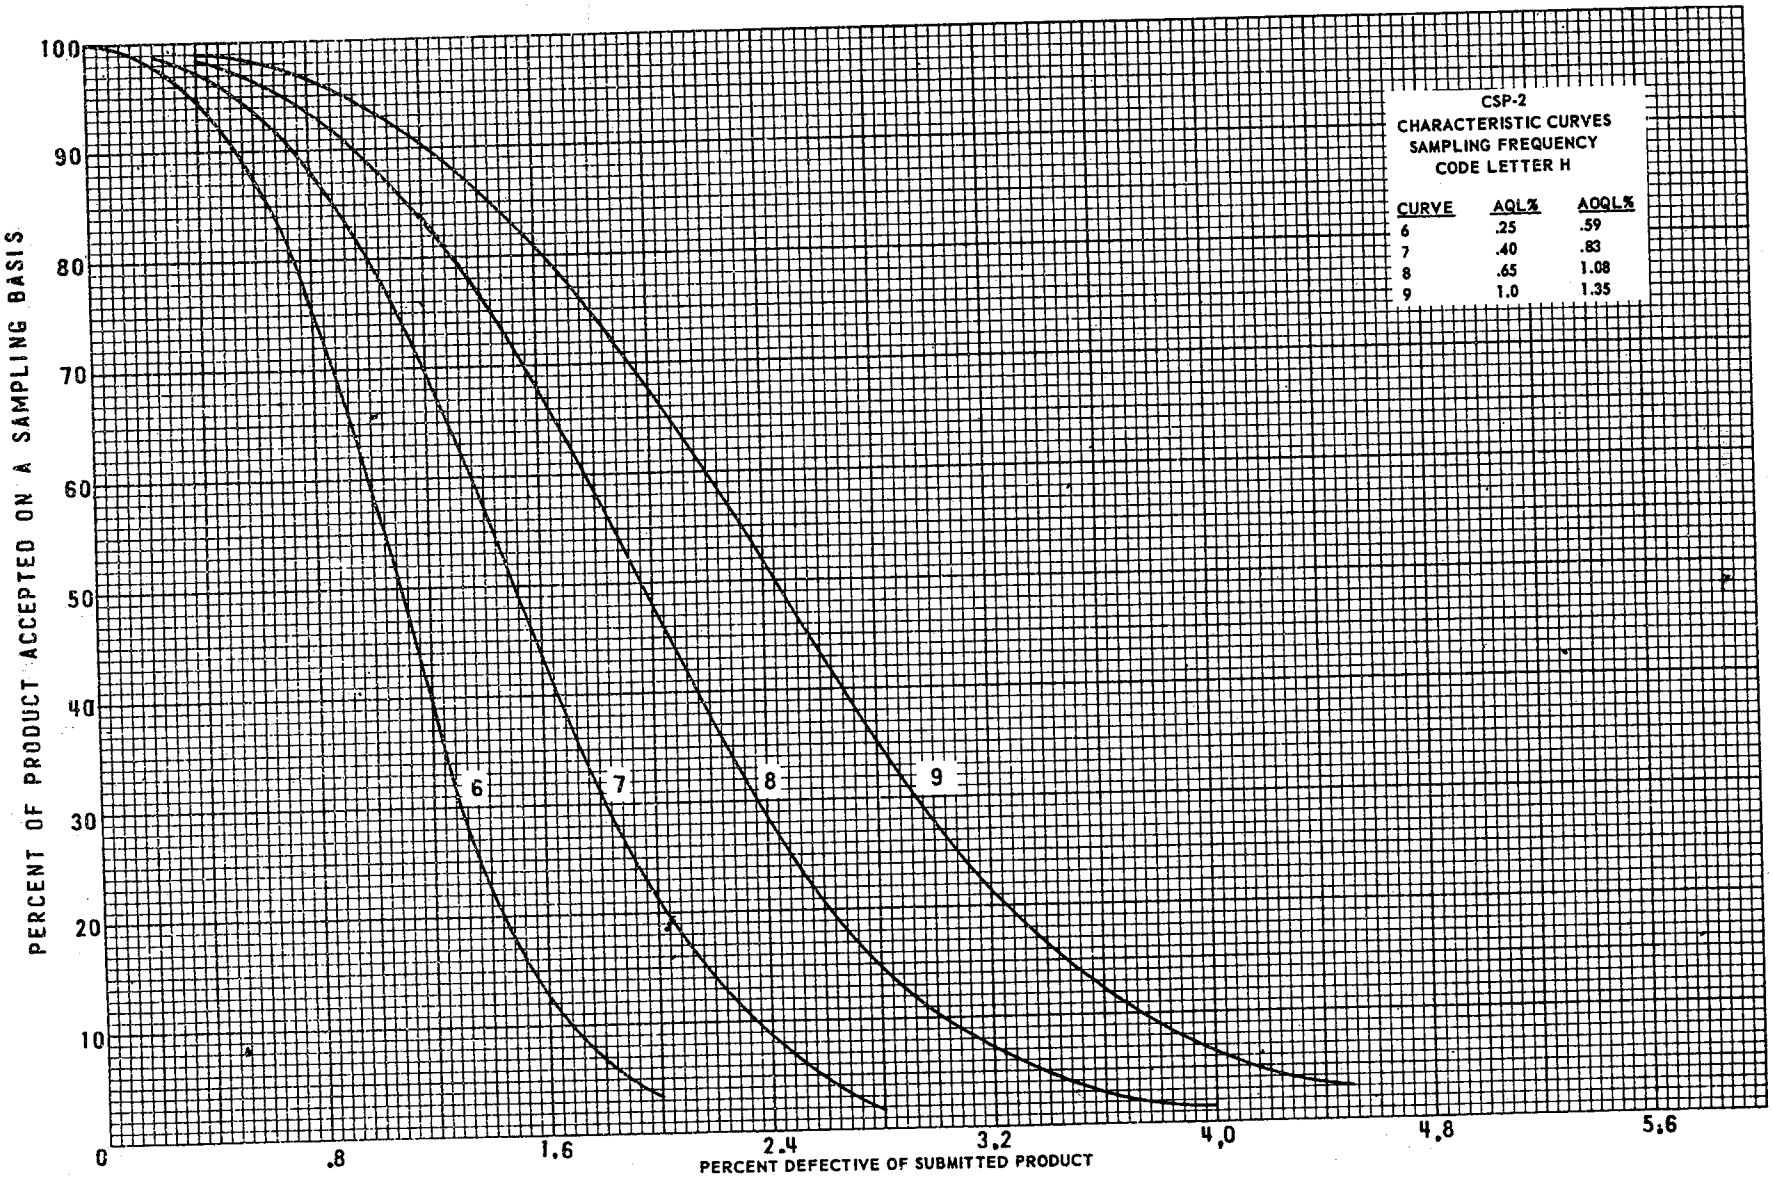


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

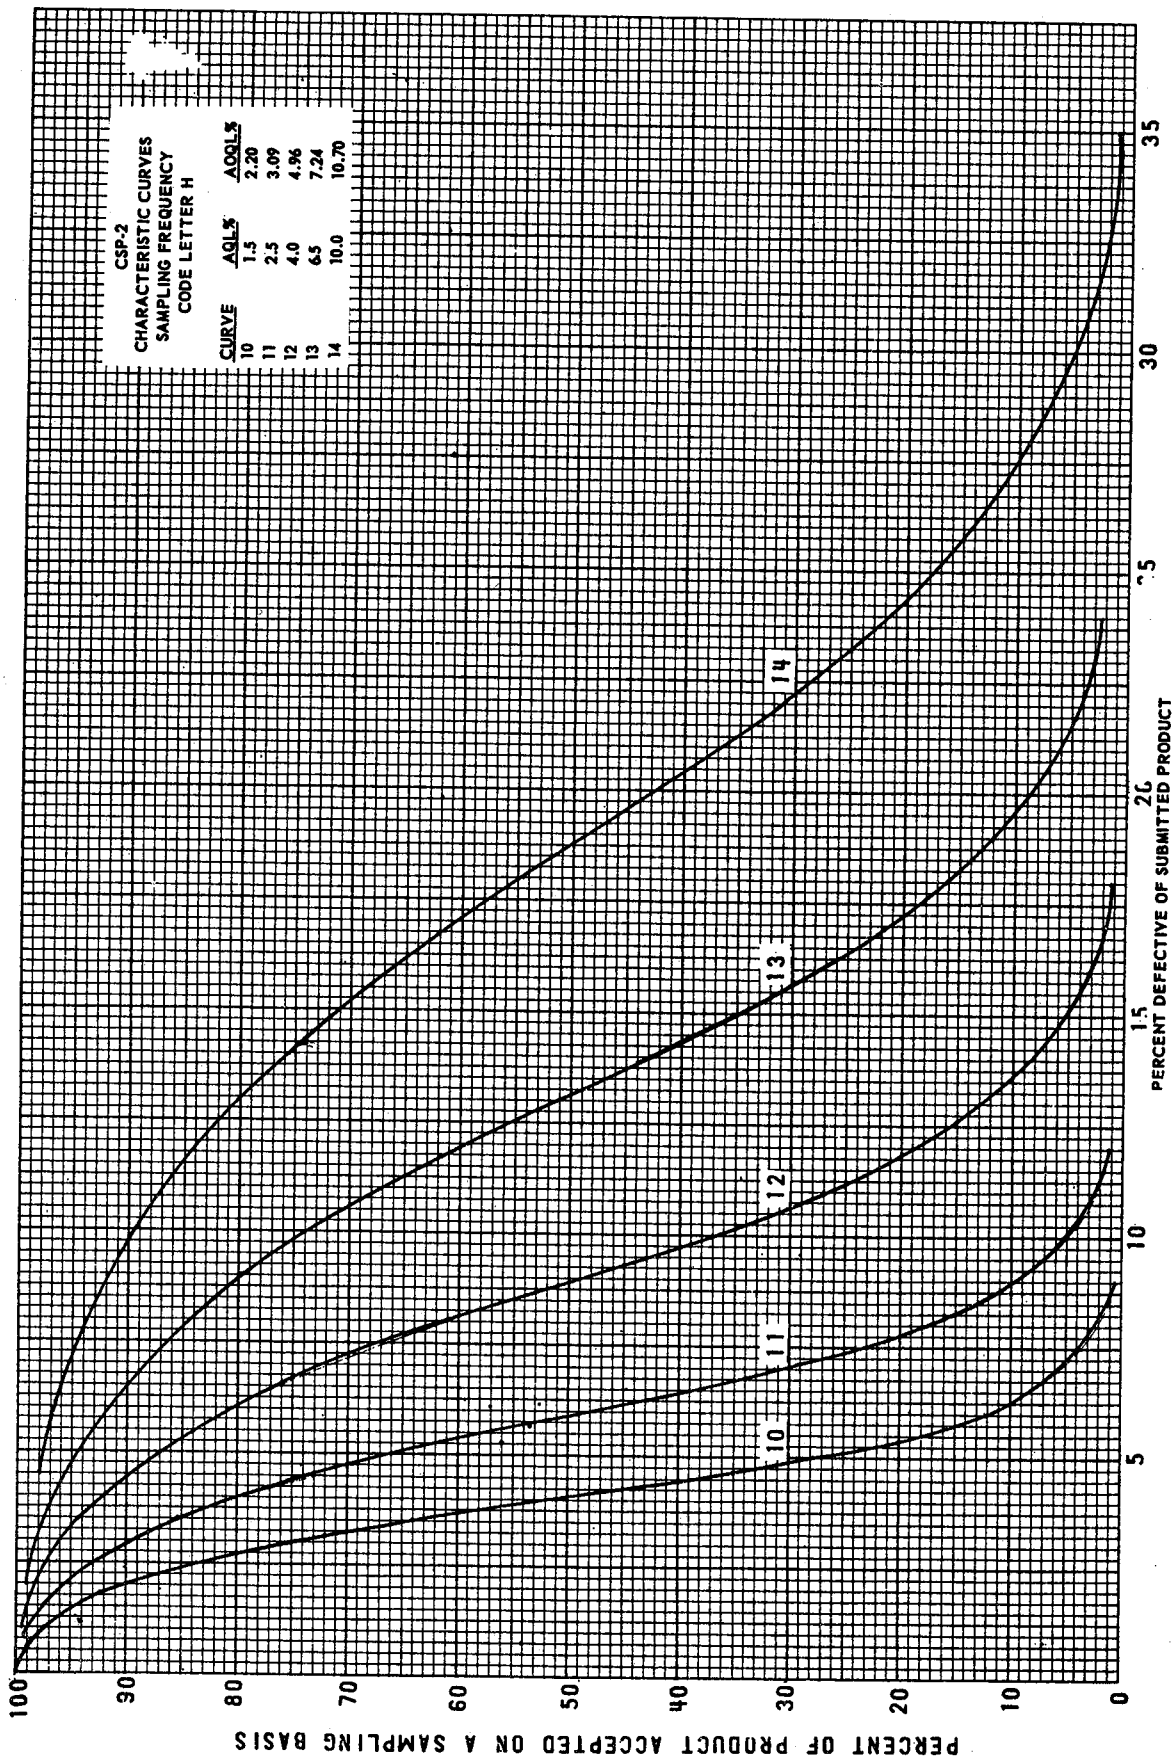

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

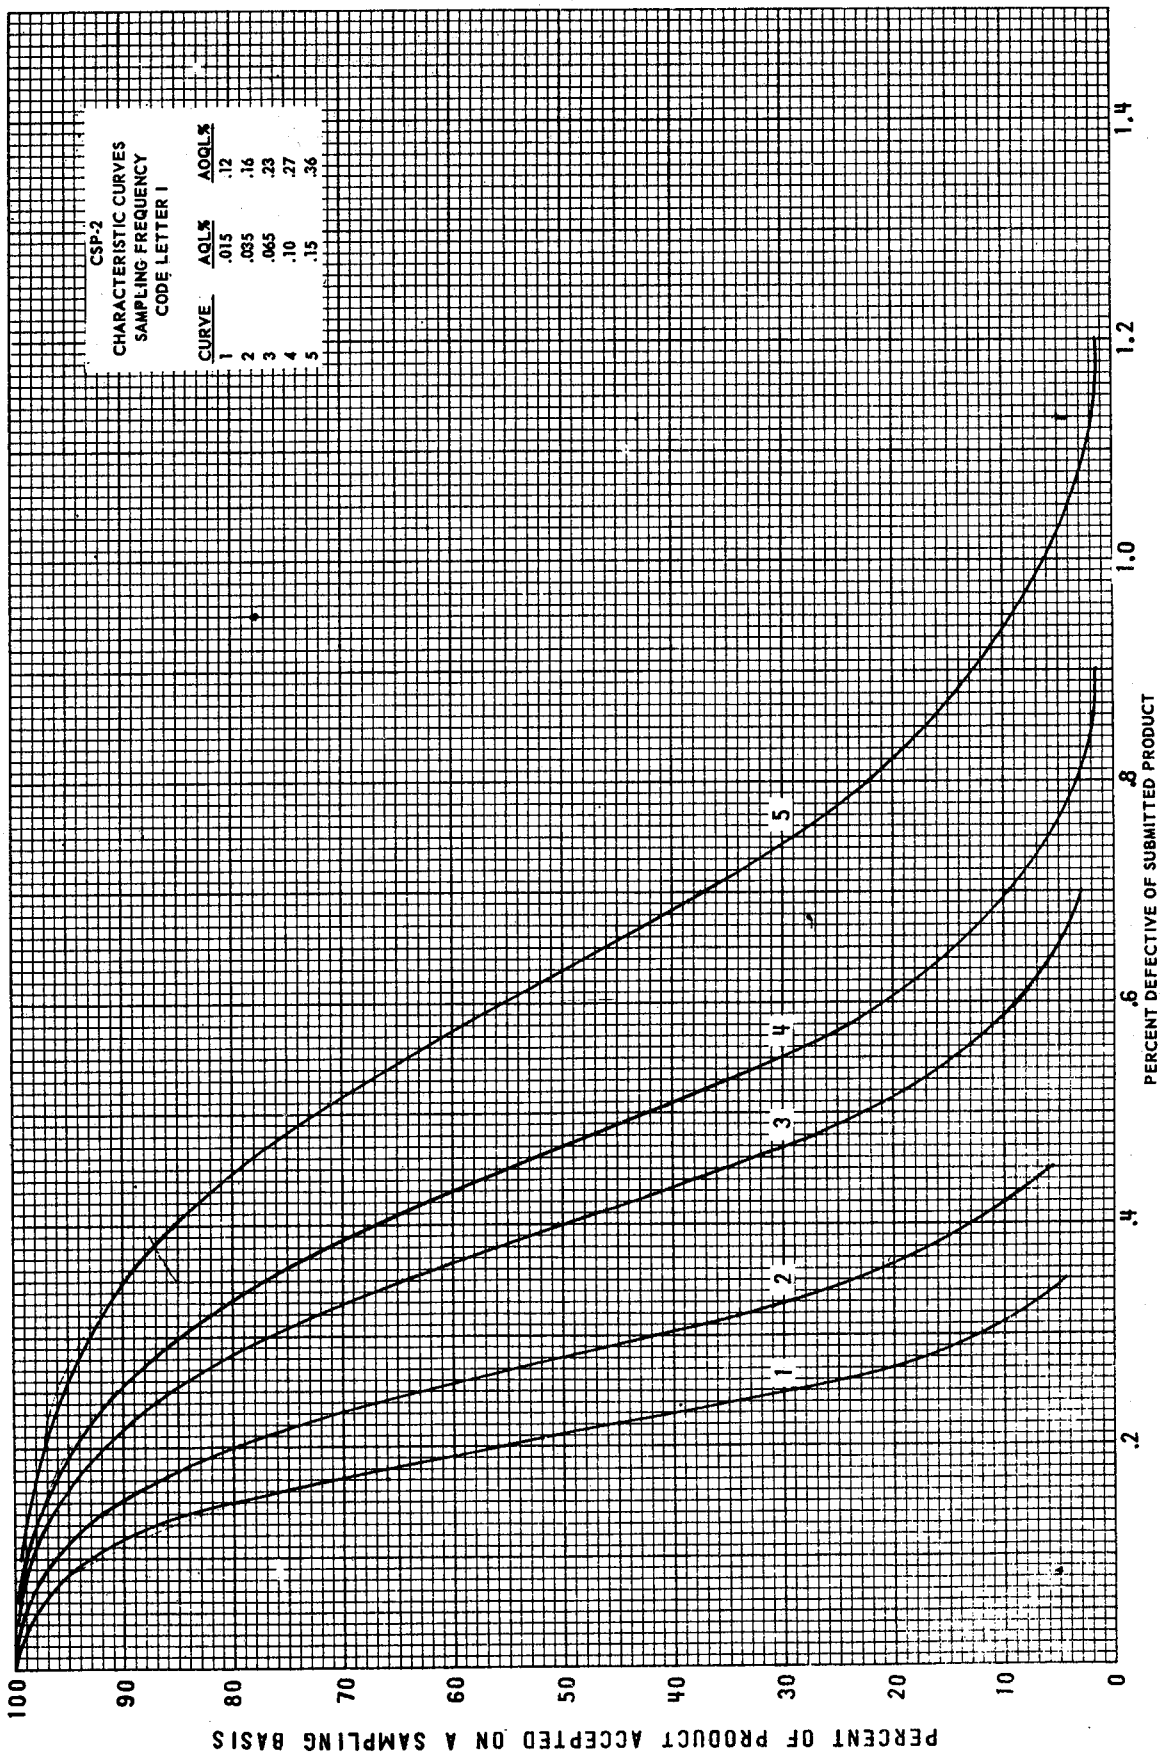


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

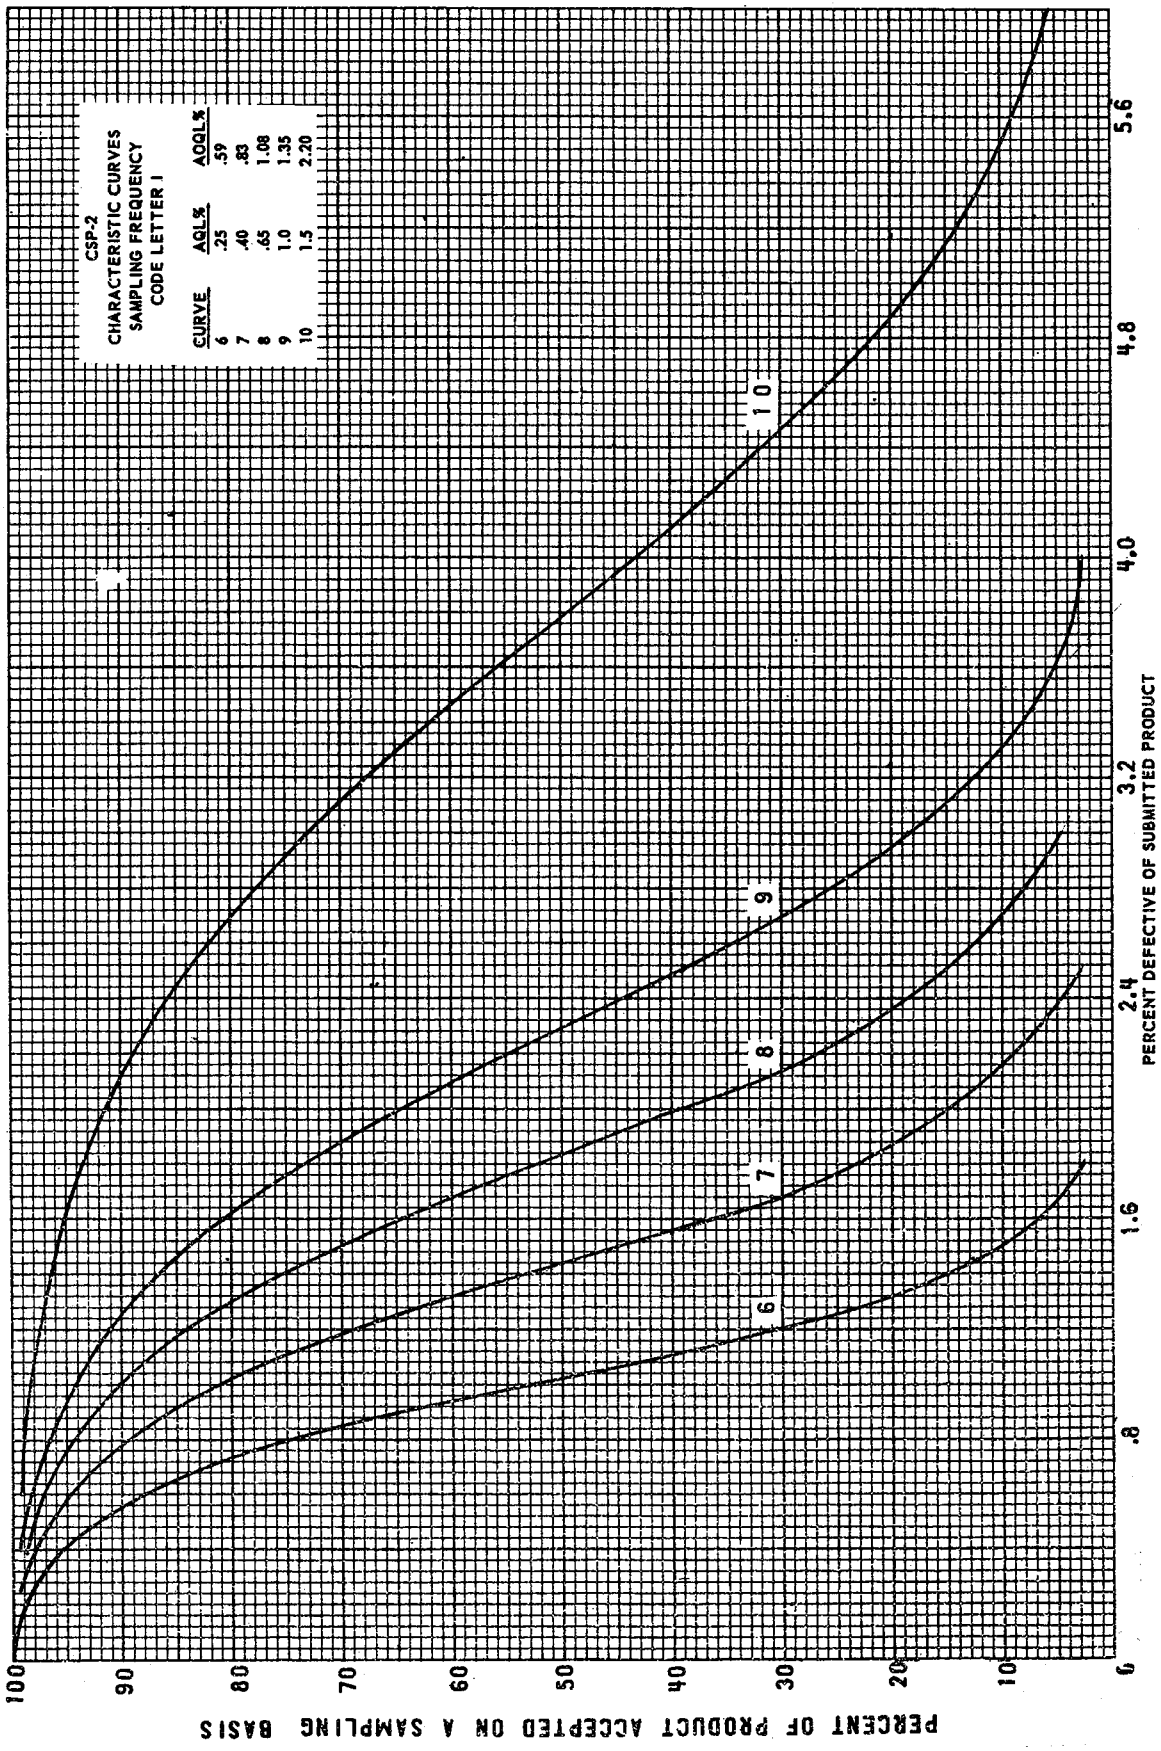


40

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

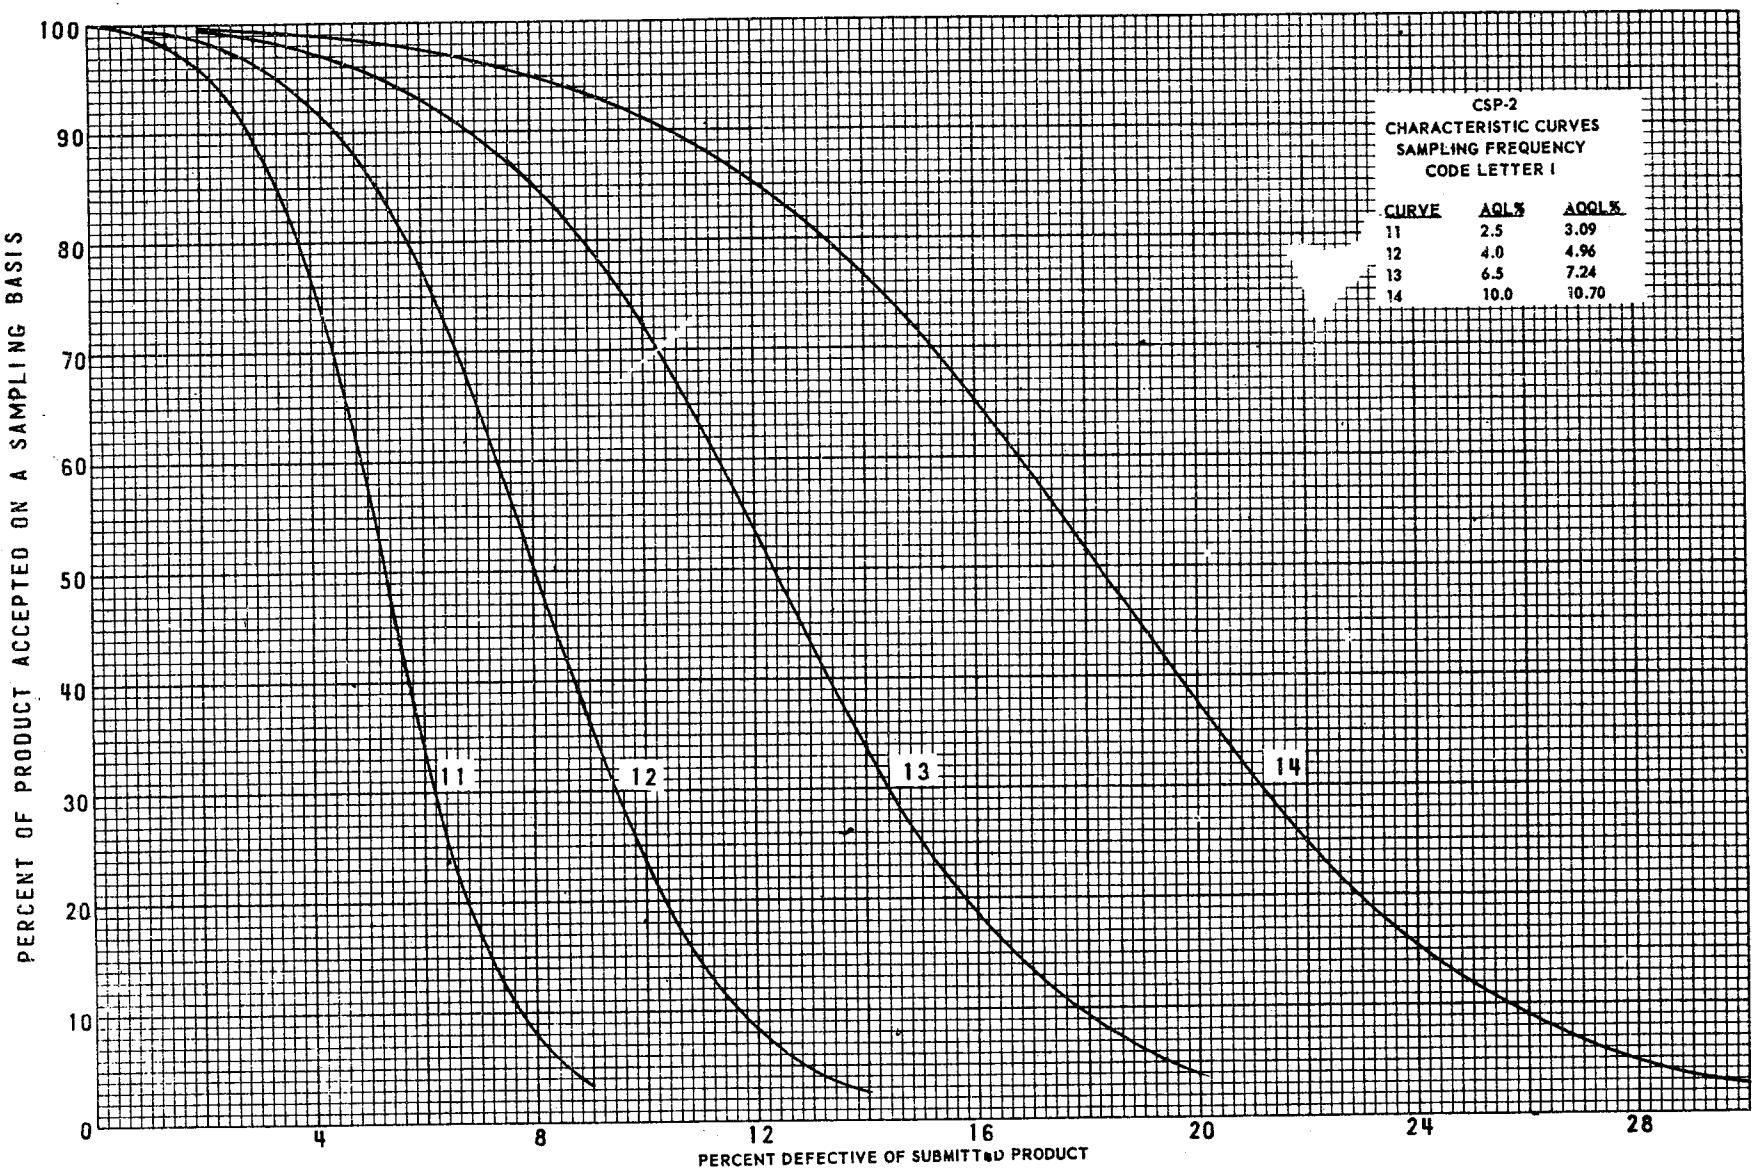


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

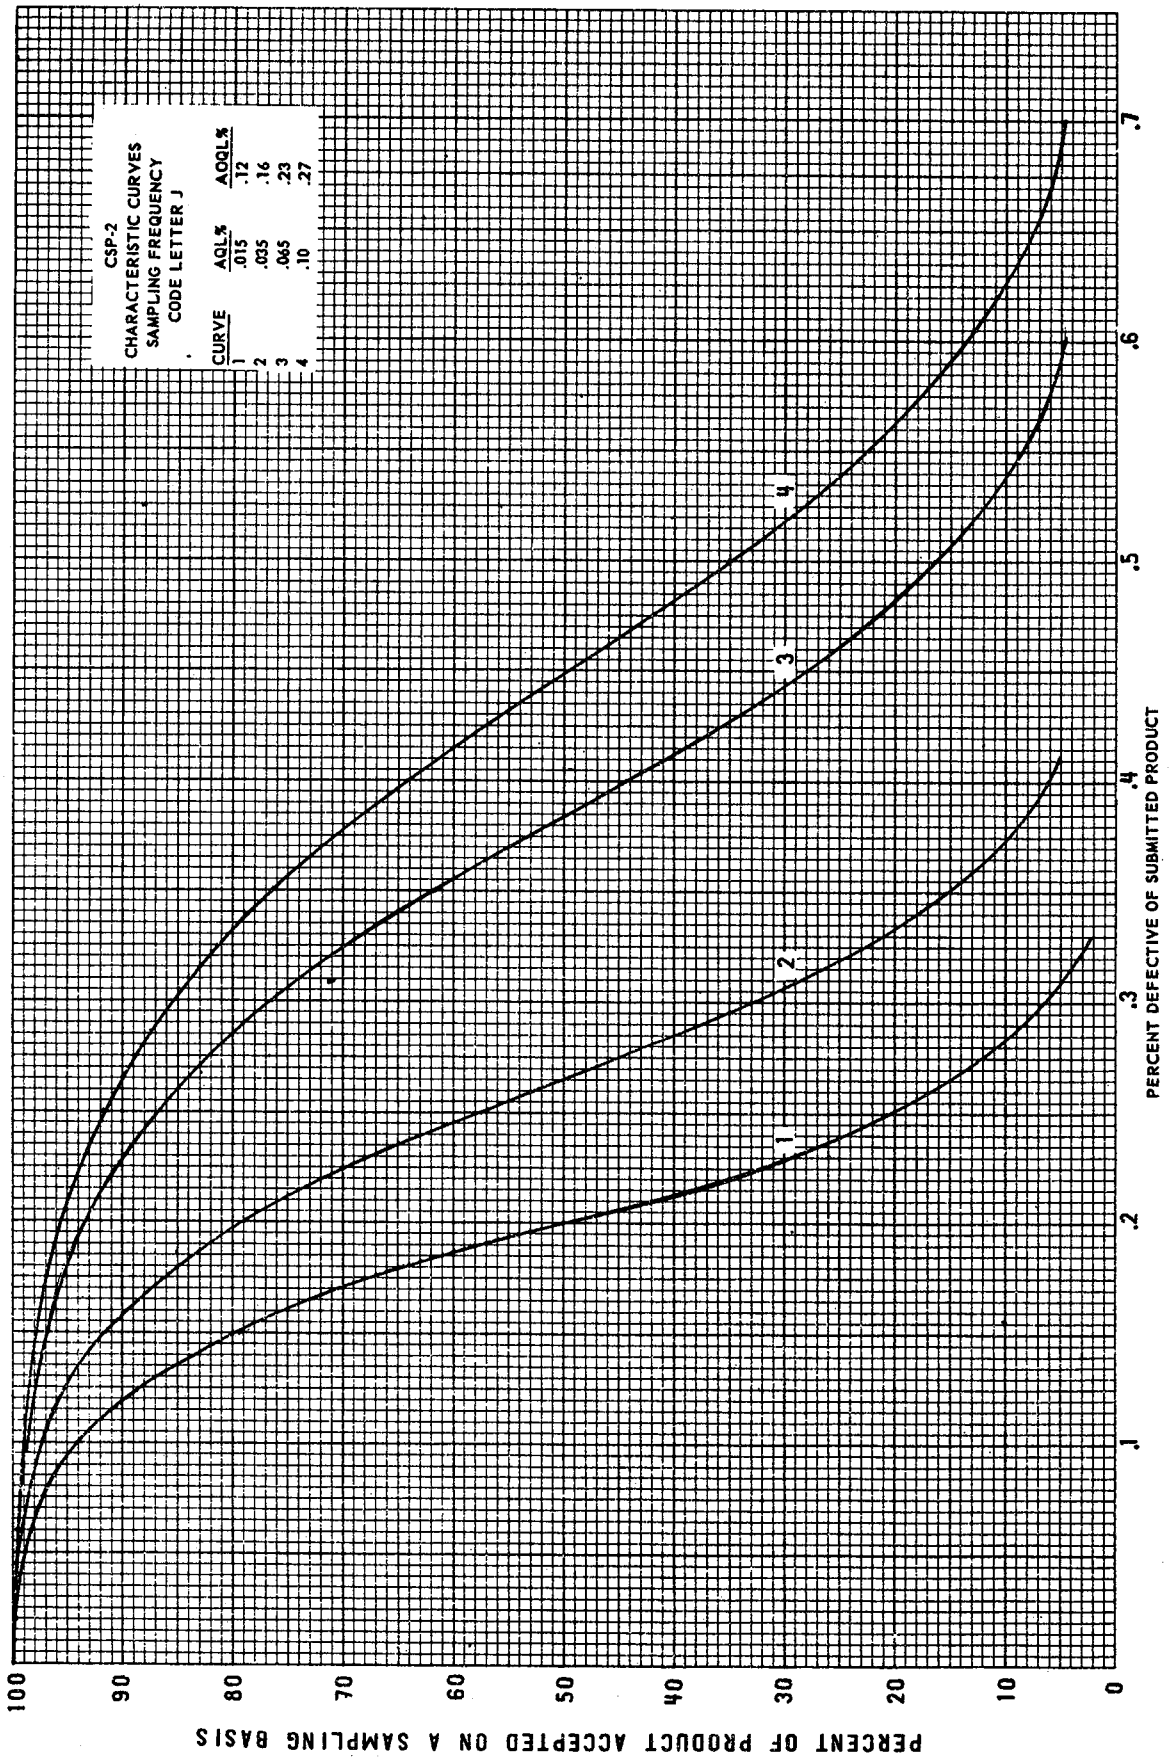


62


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

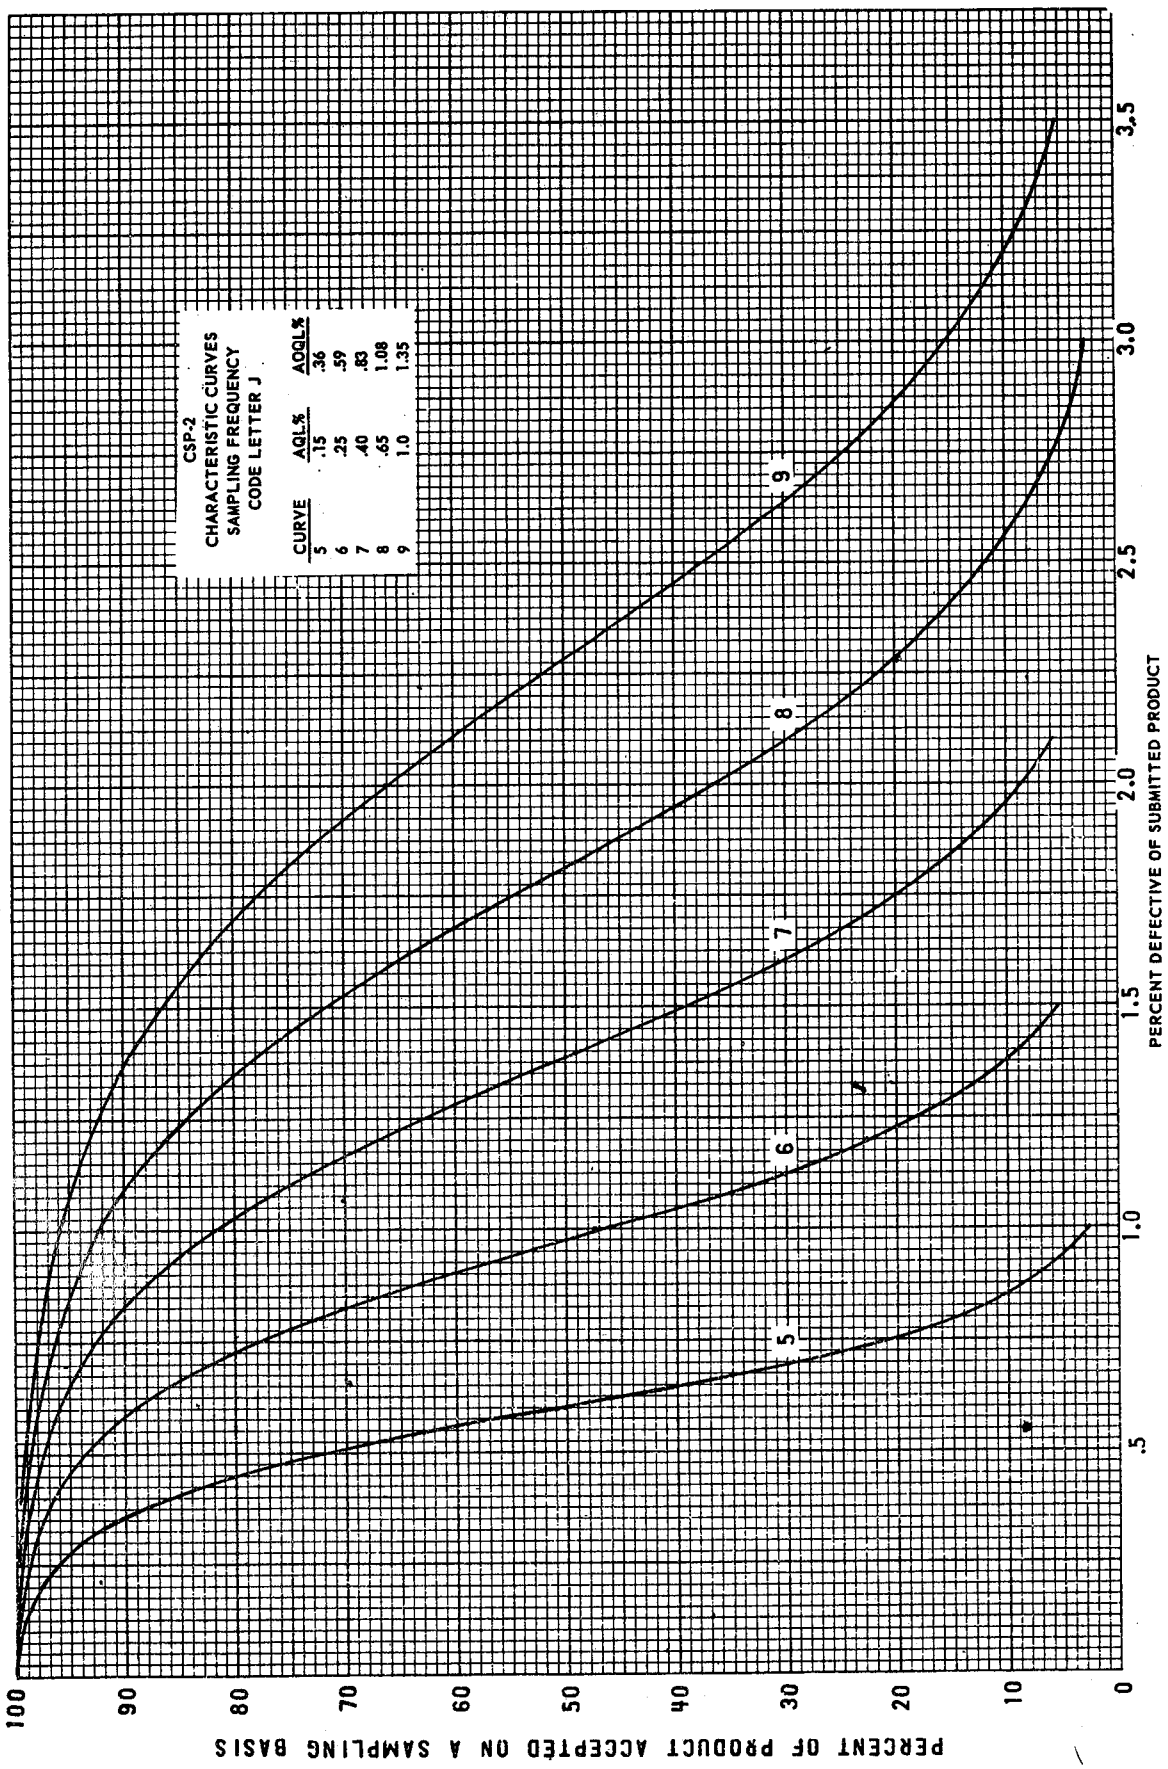


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

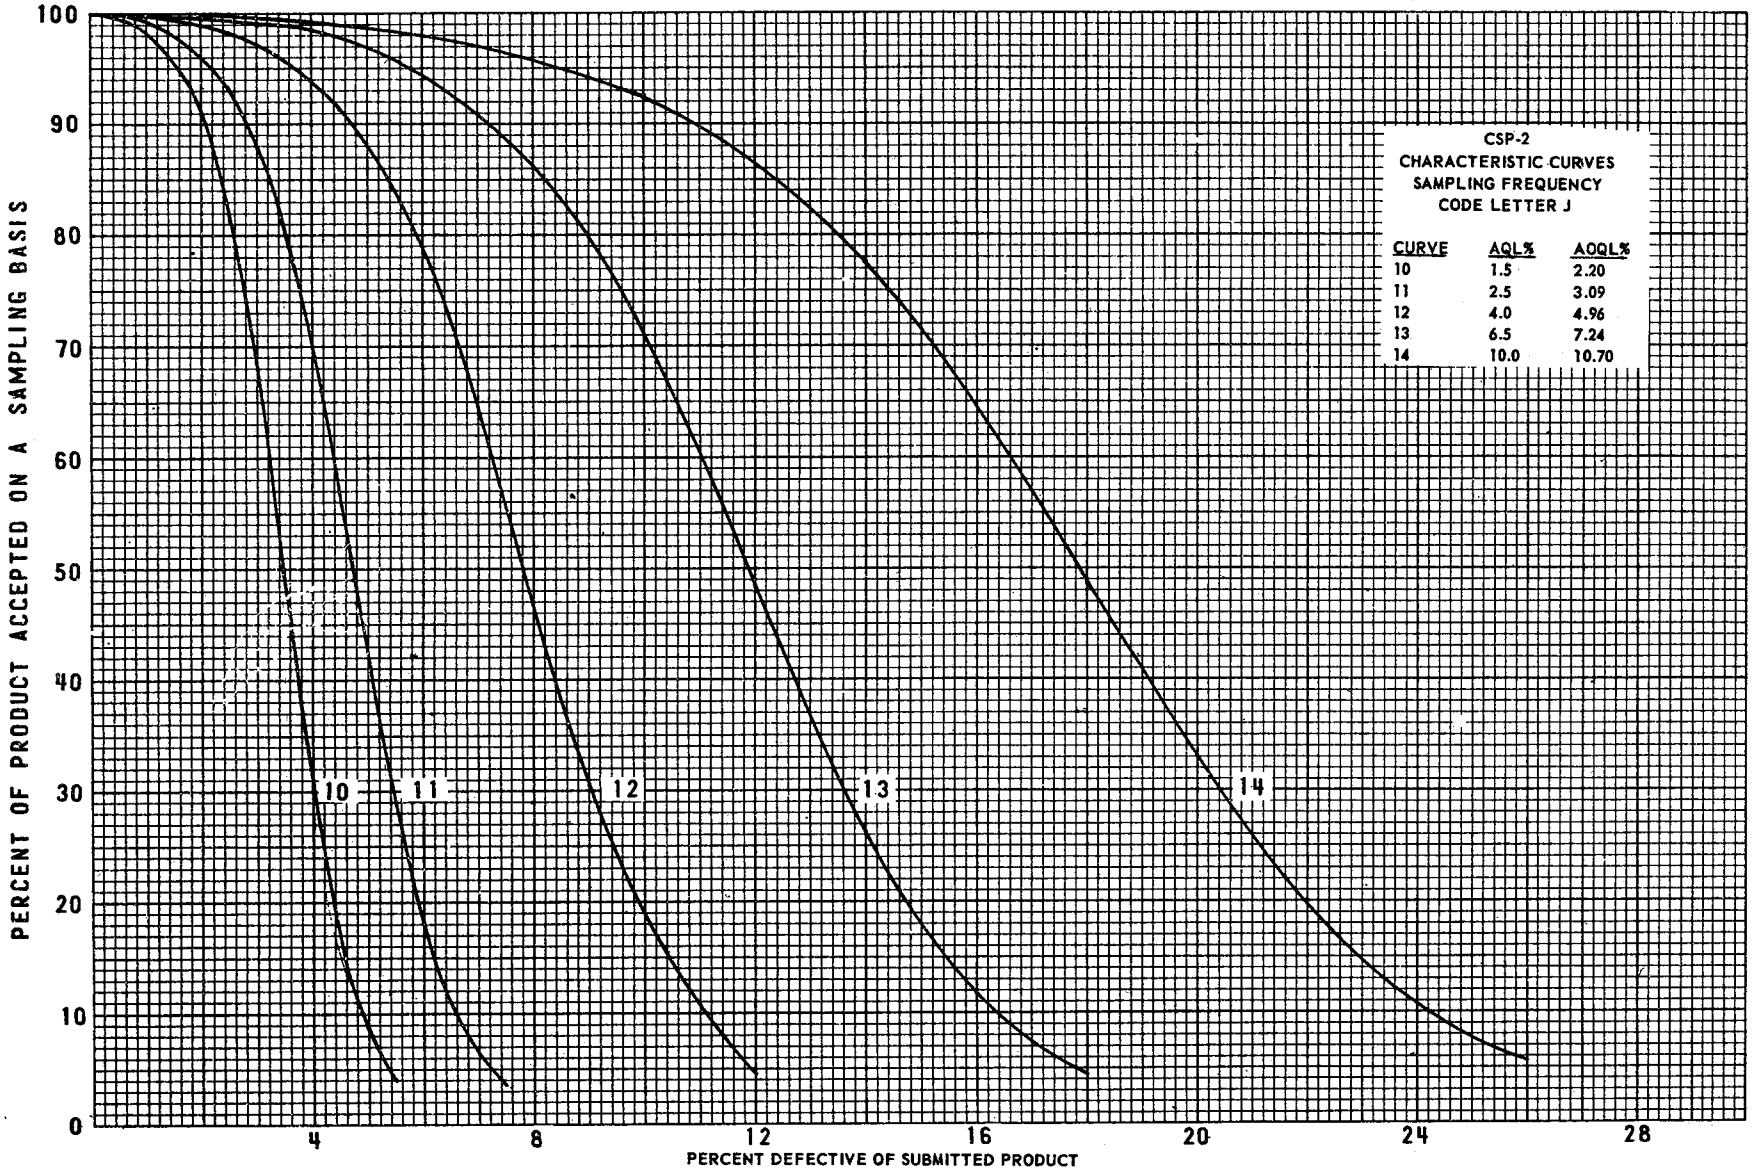


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

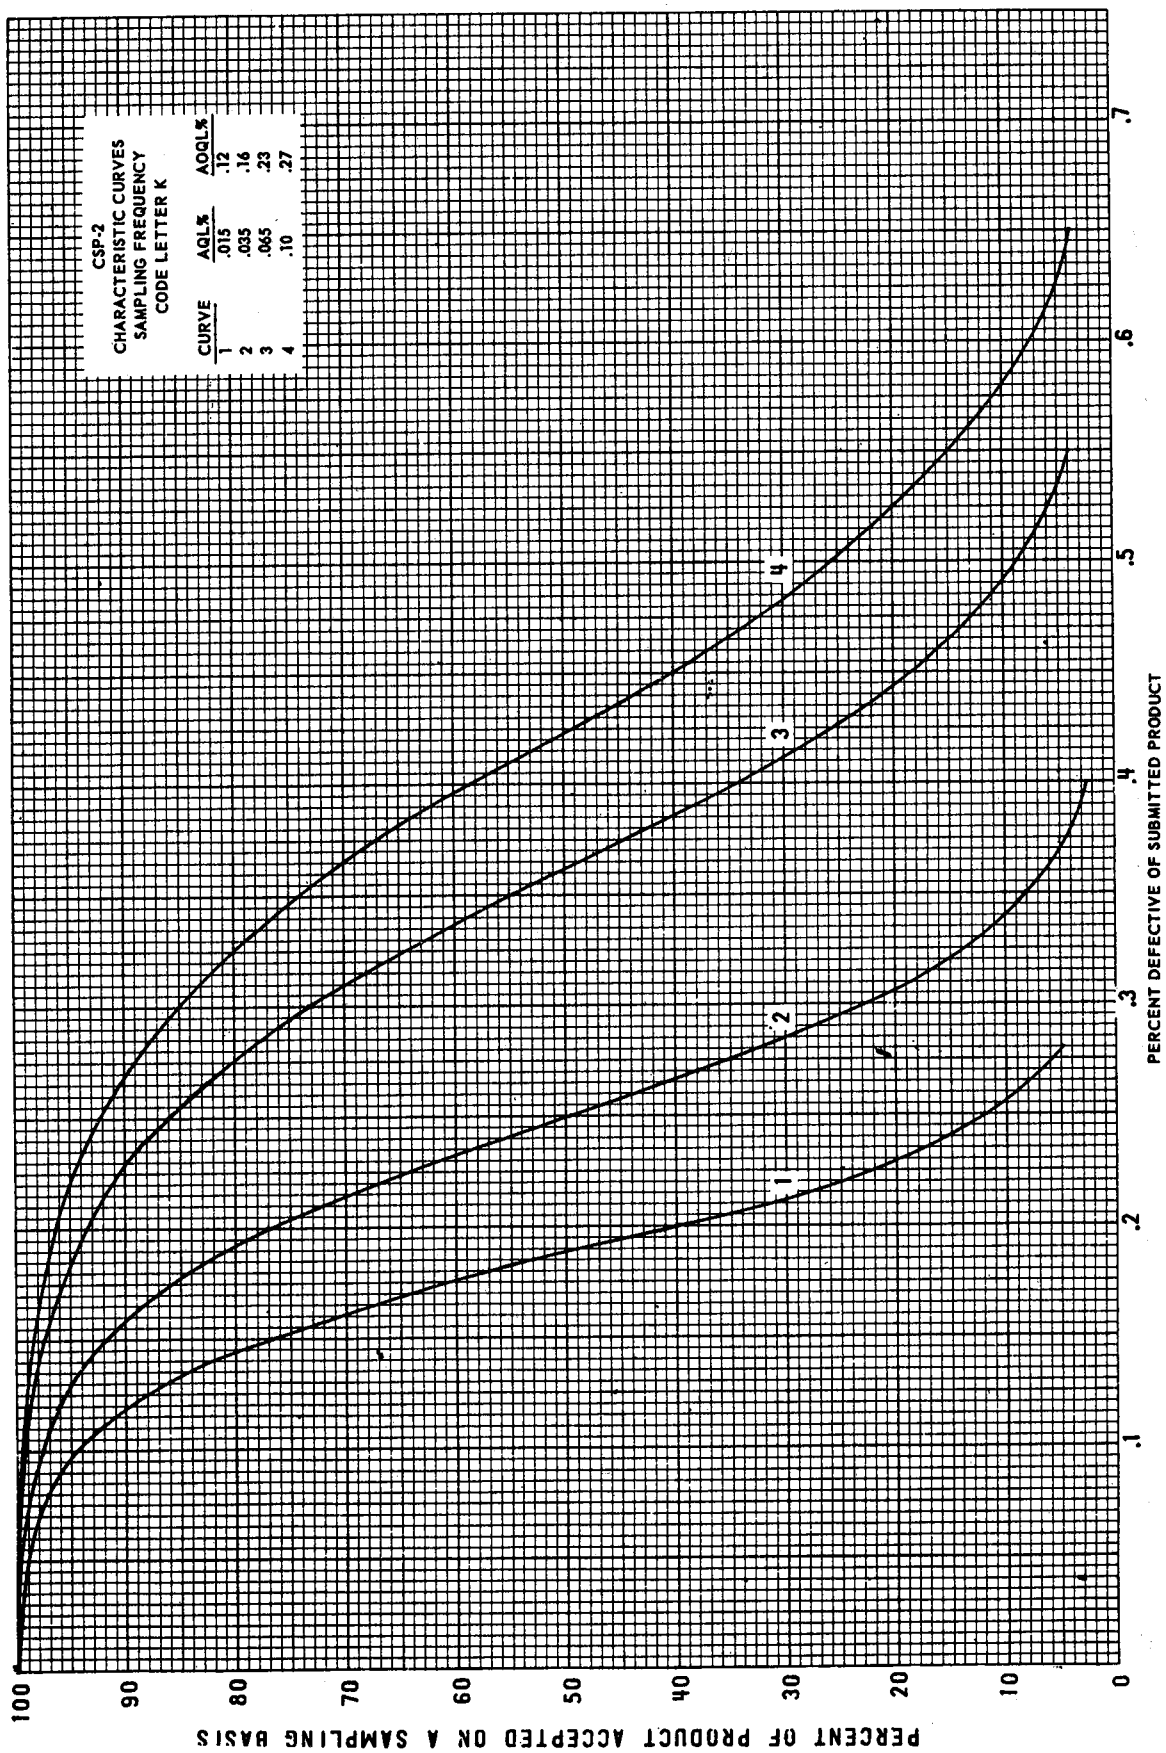


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

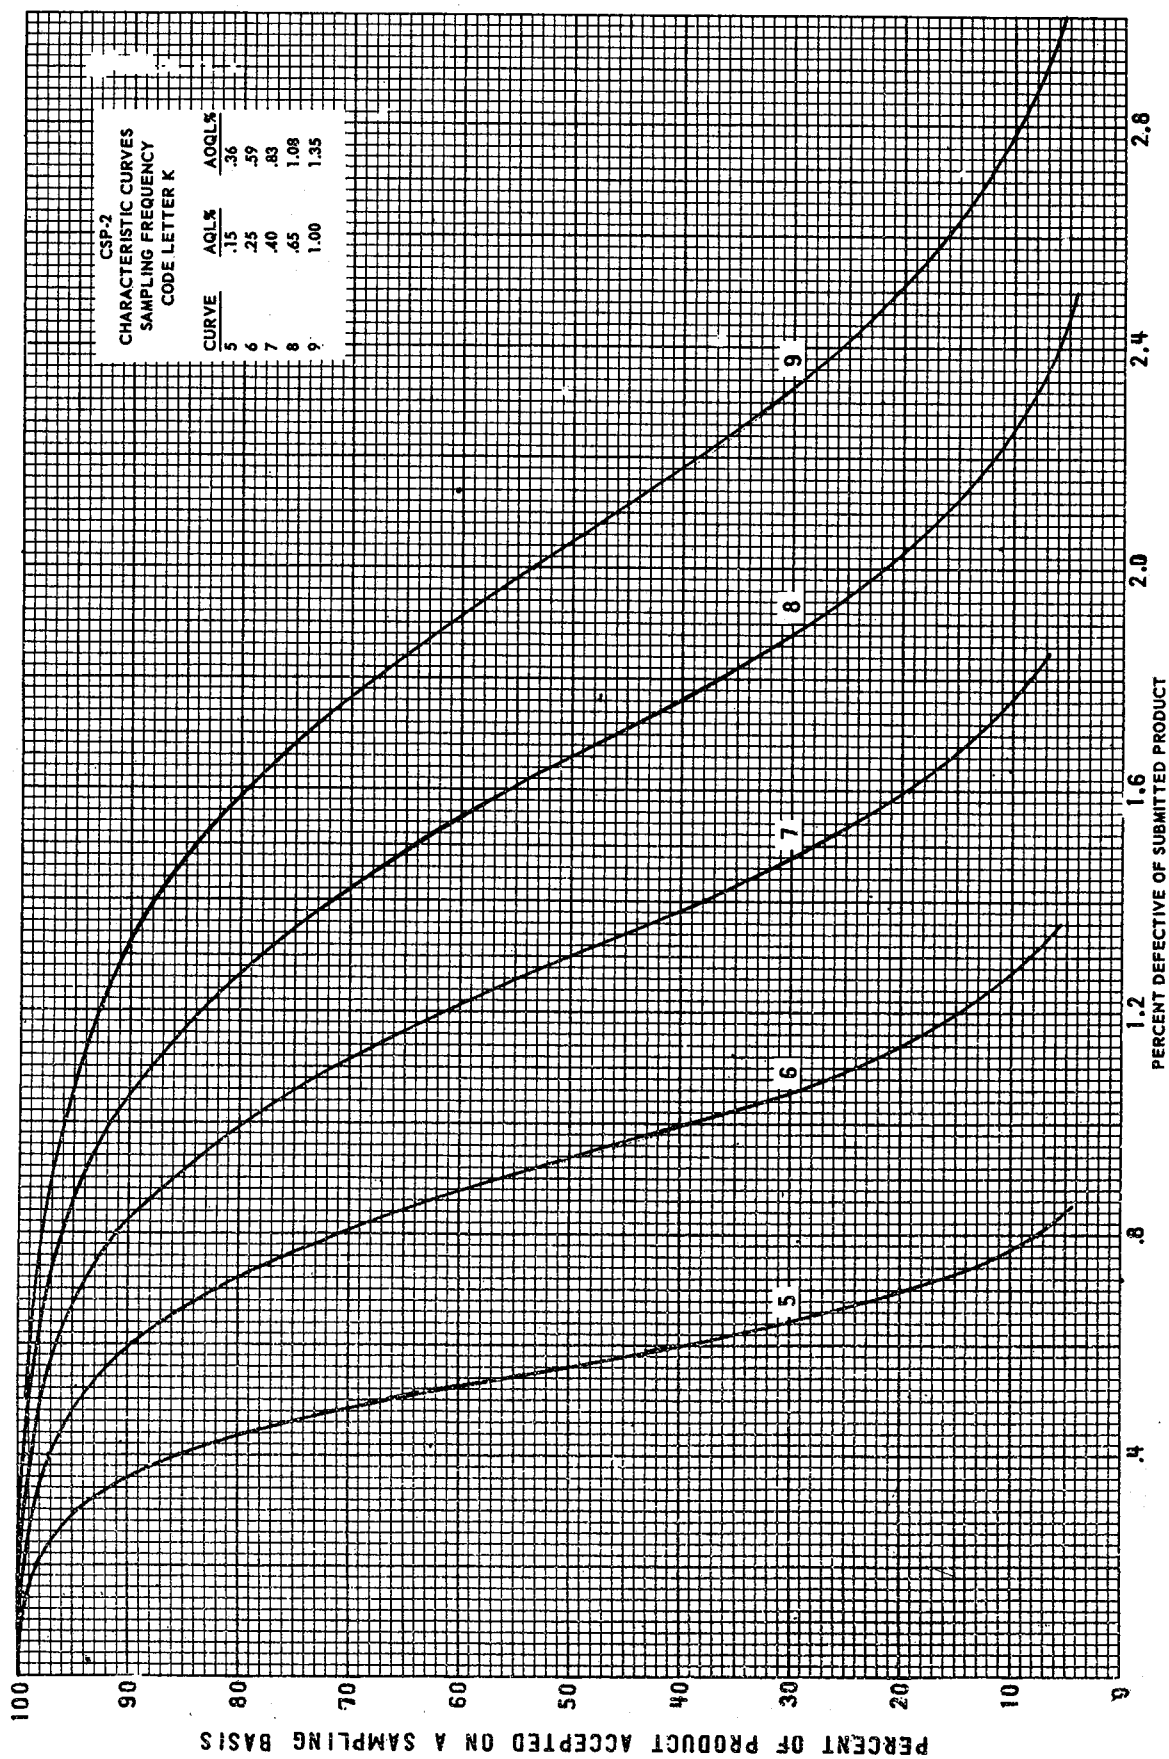


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

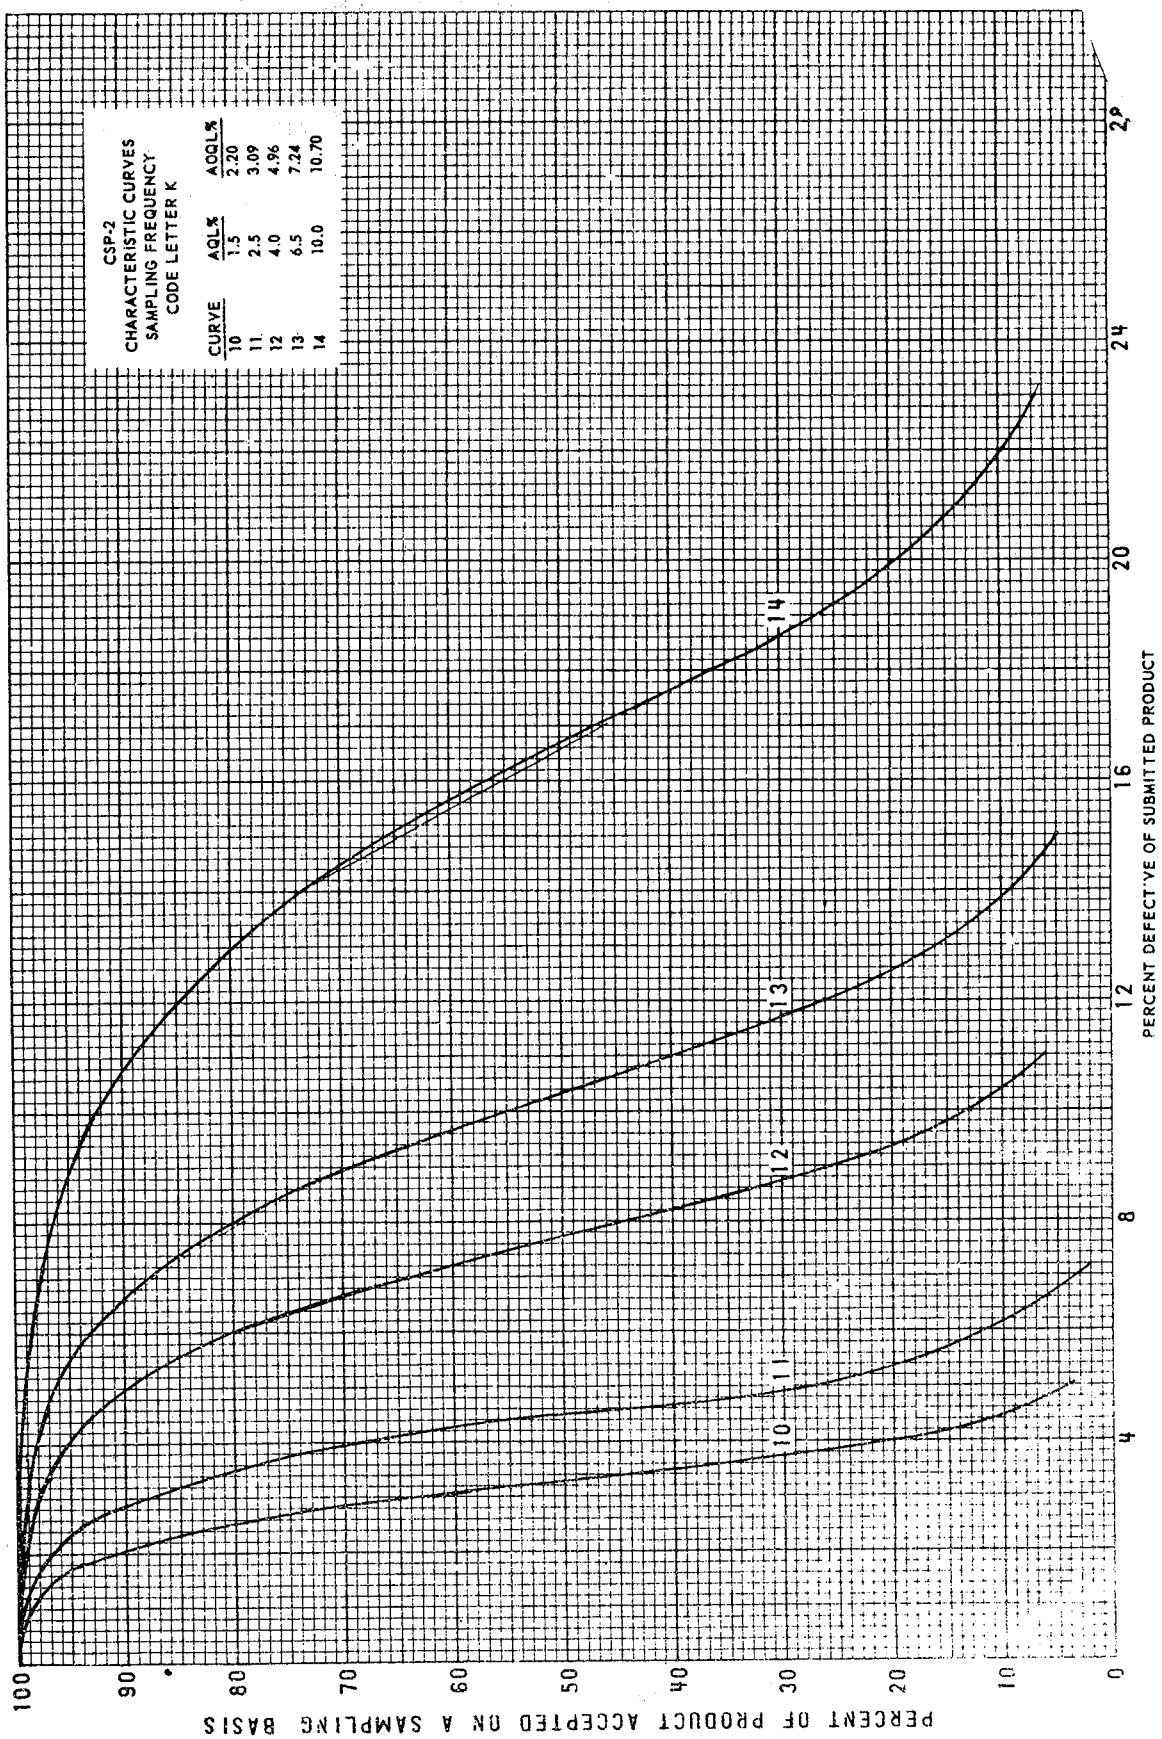


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

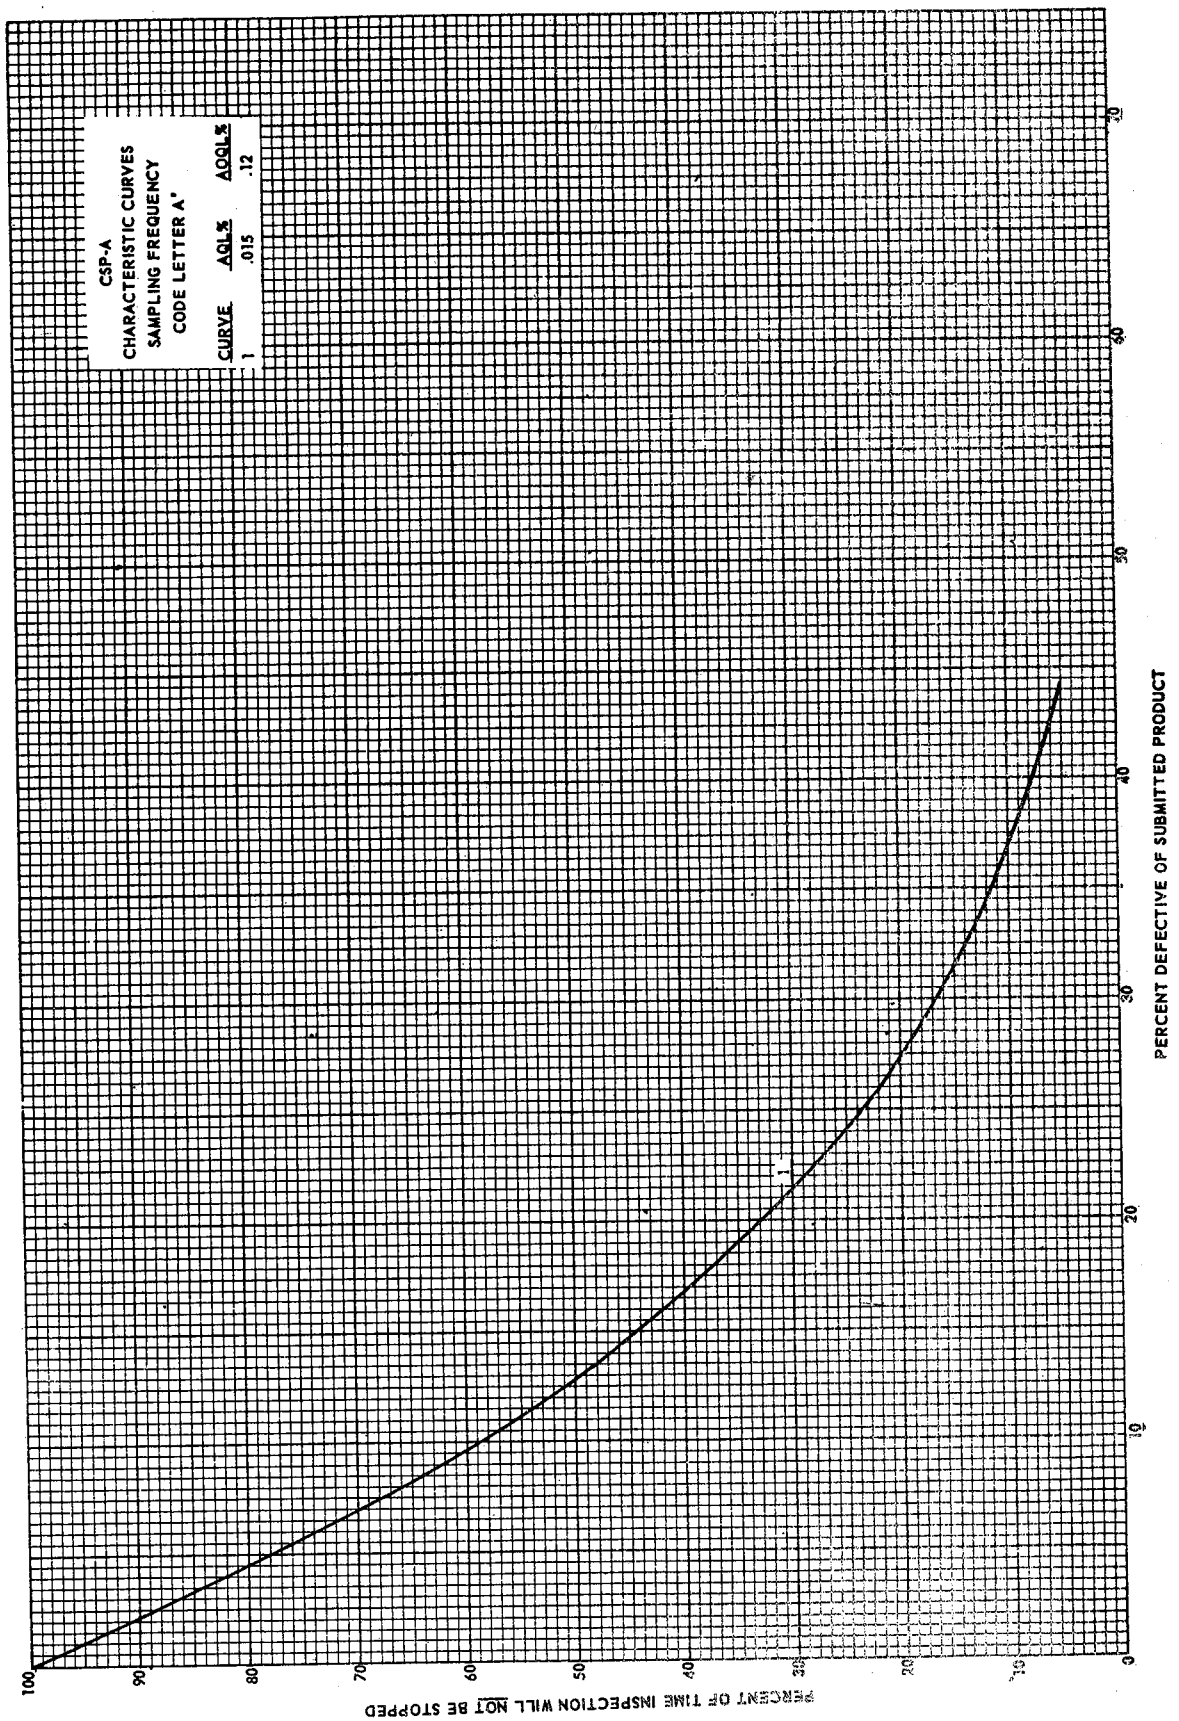

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

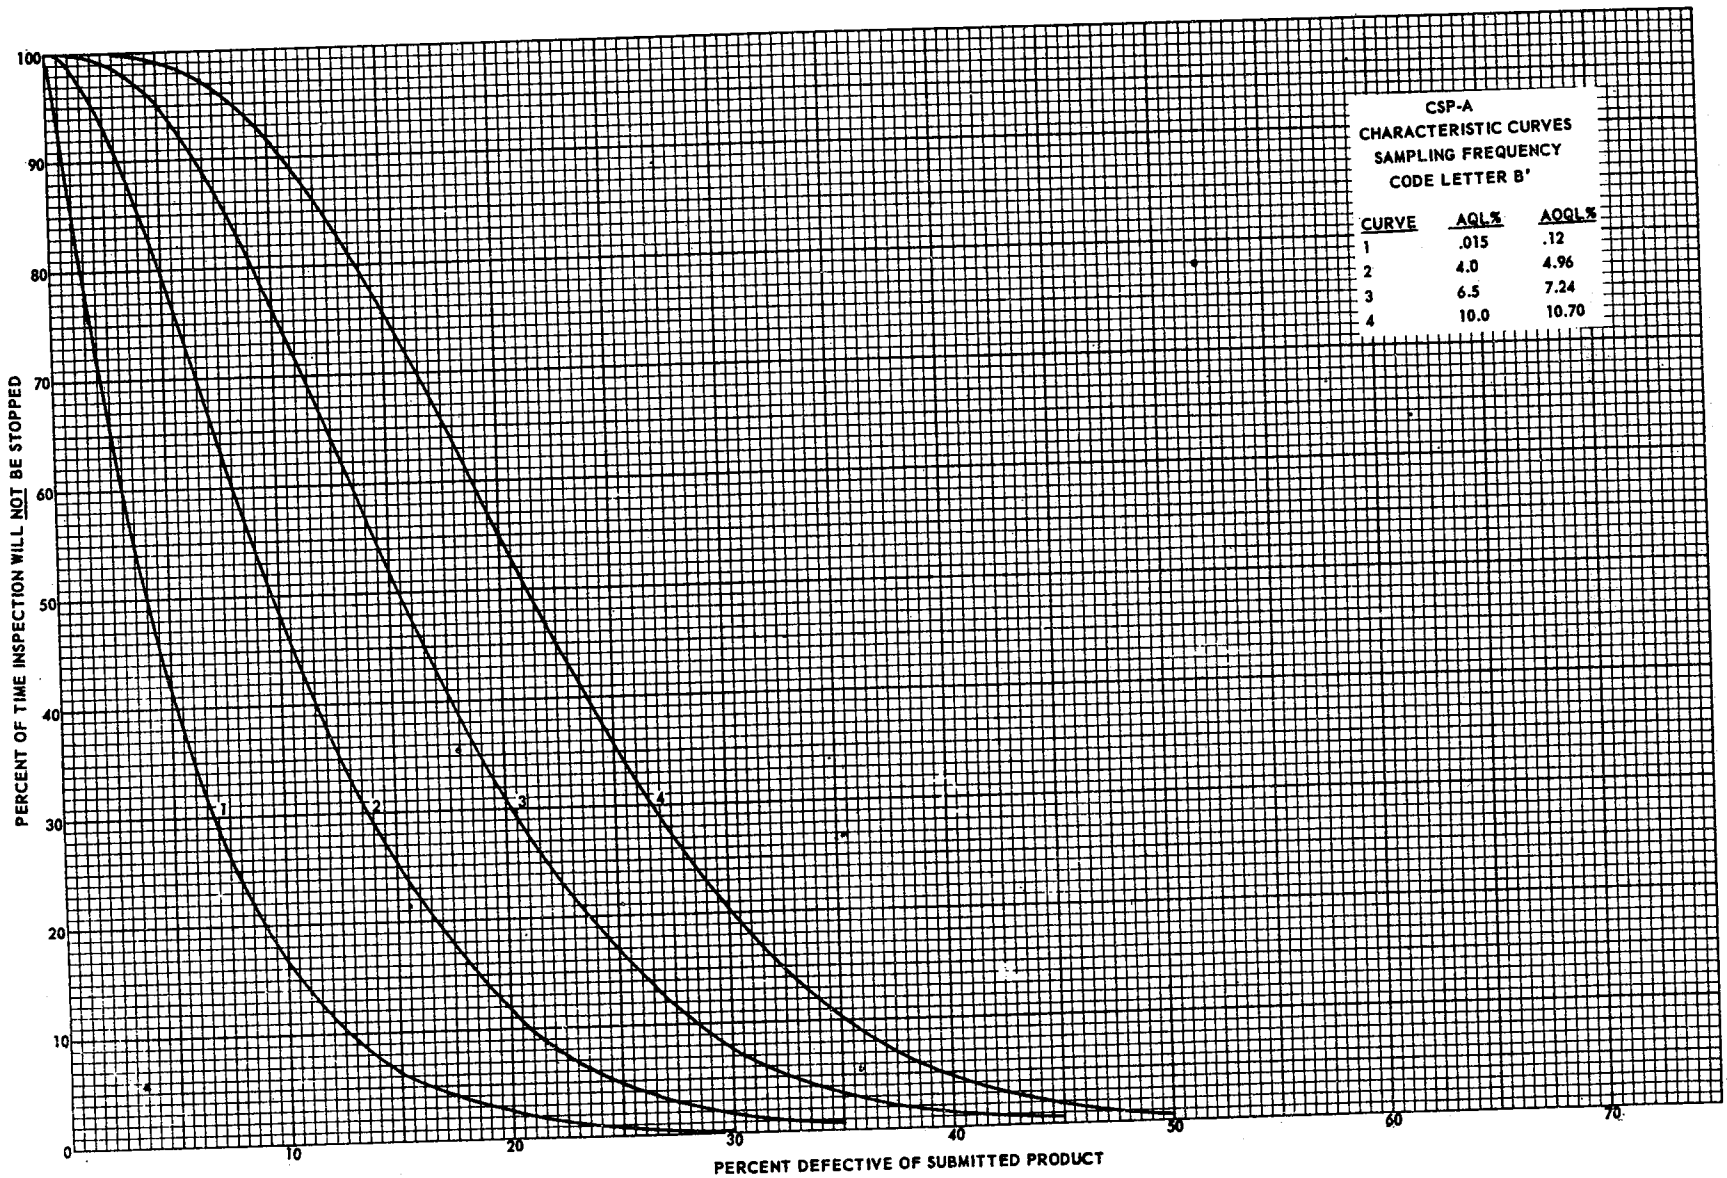


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

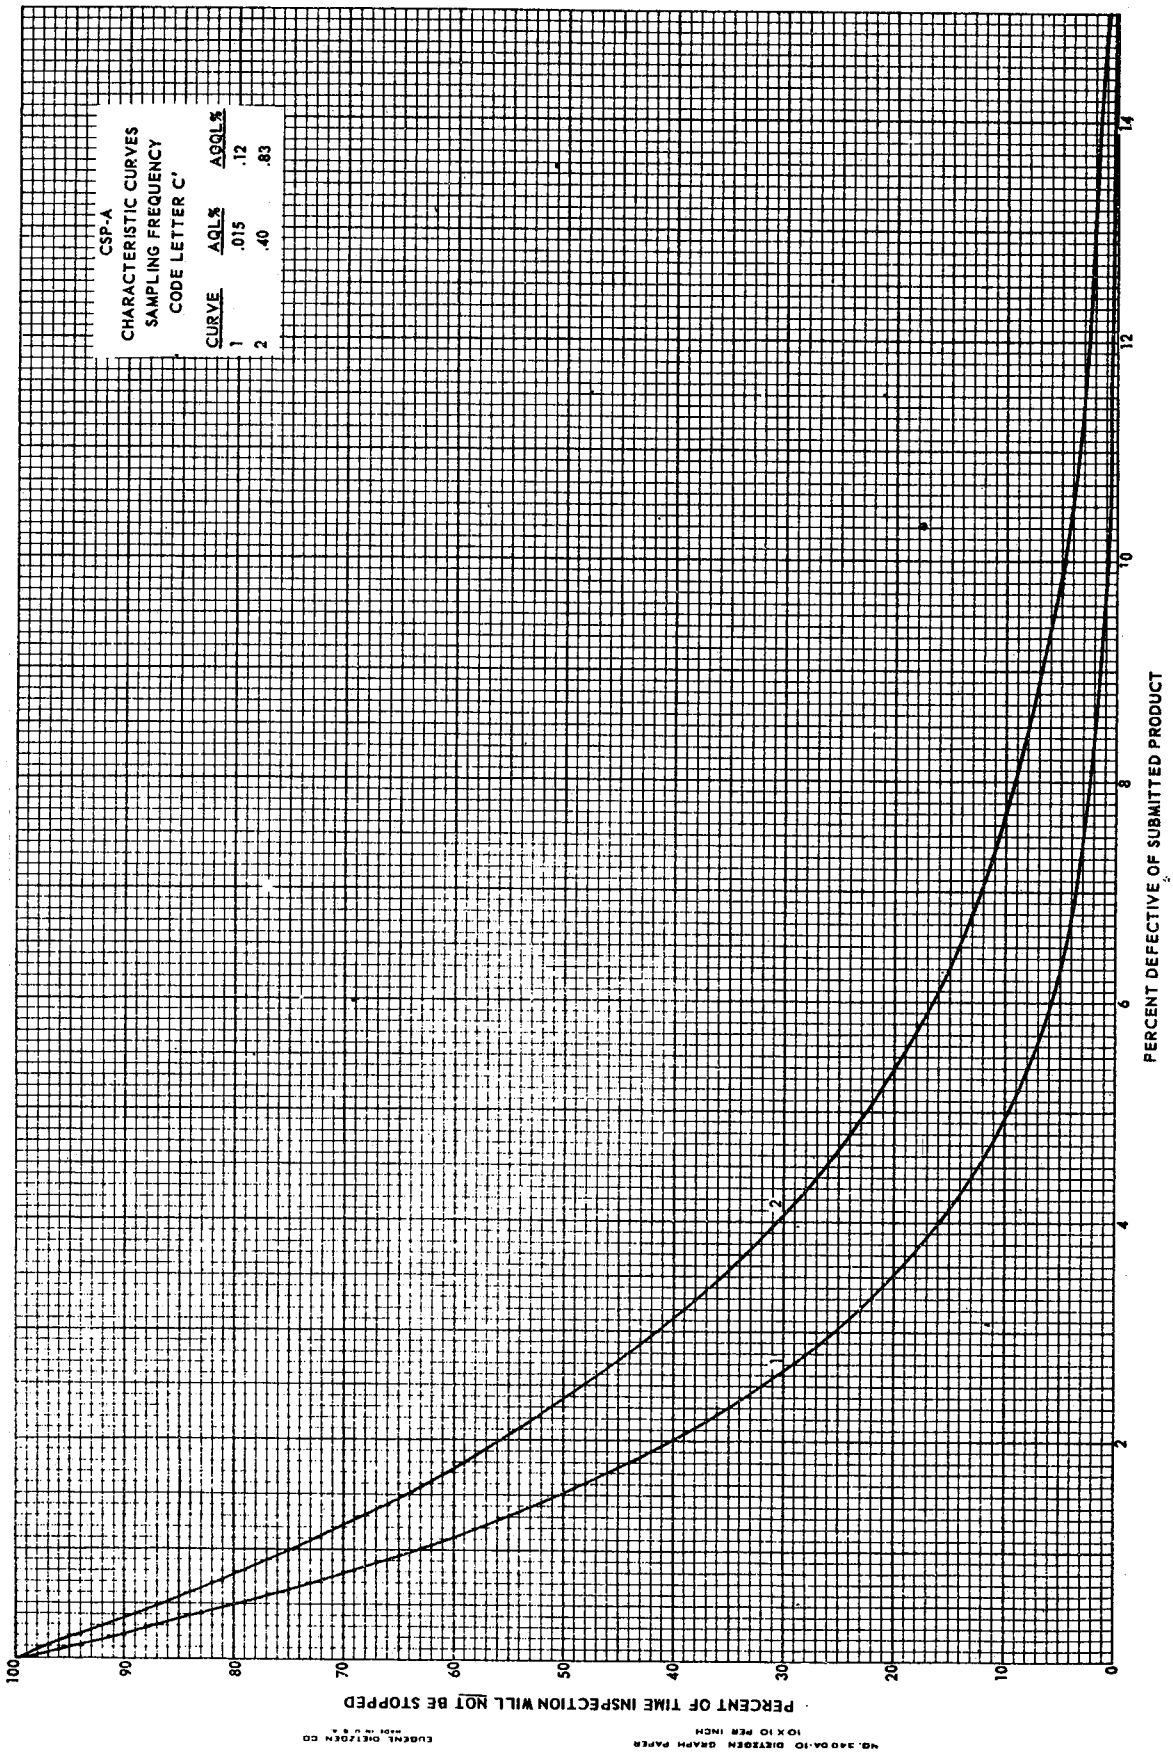


70


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

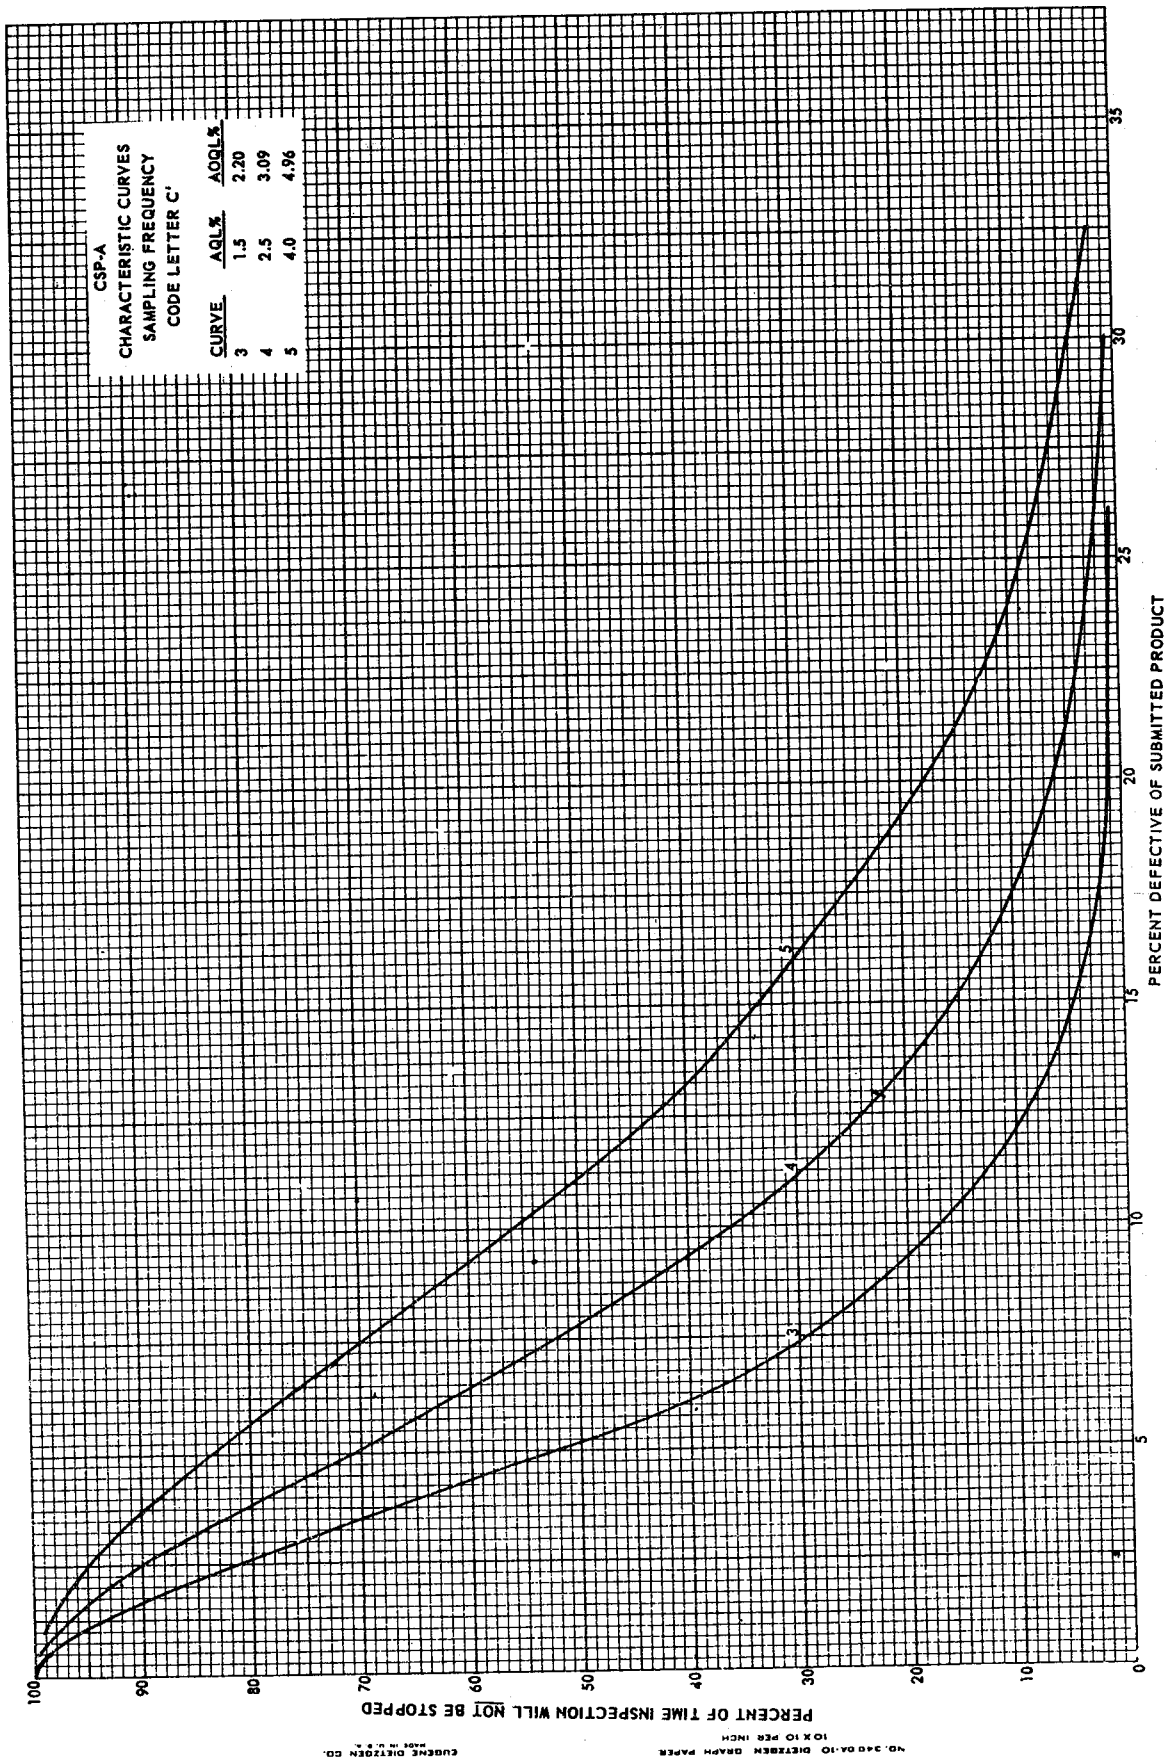


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

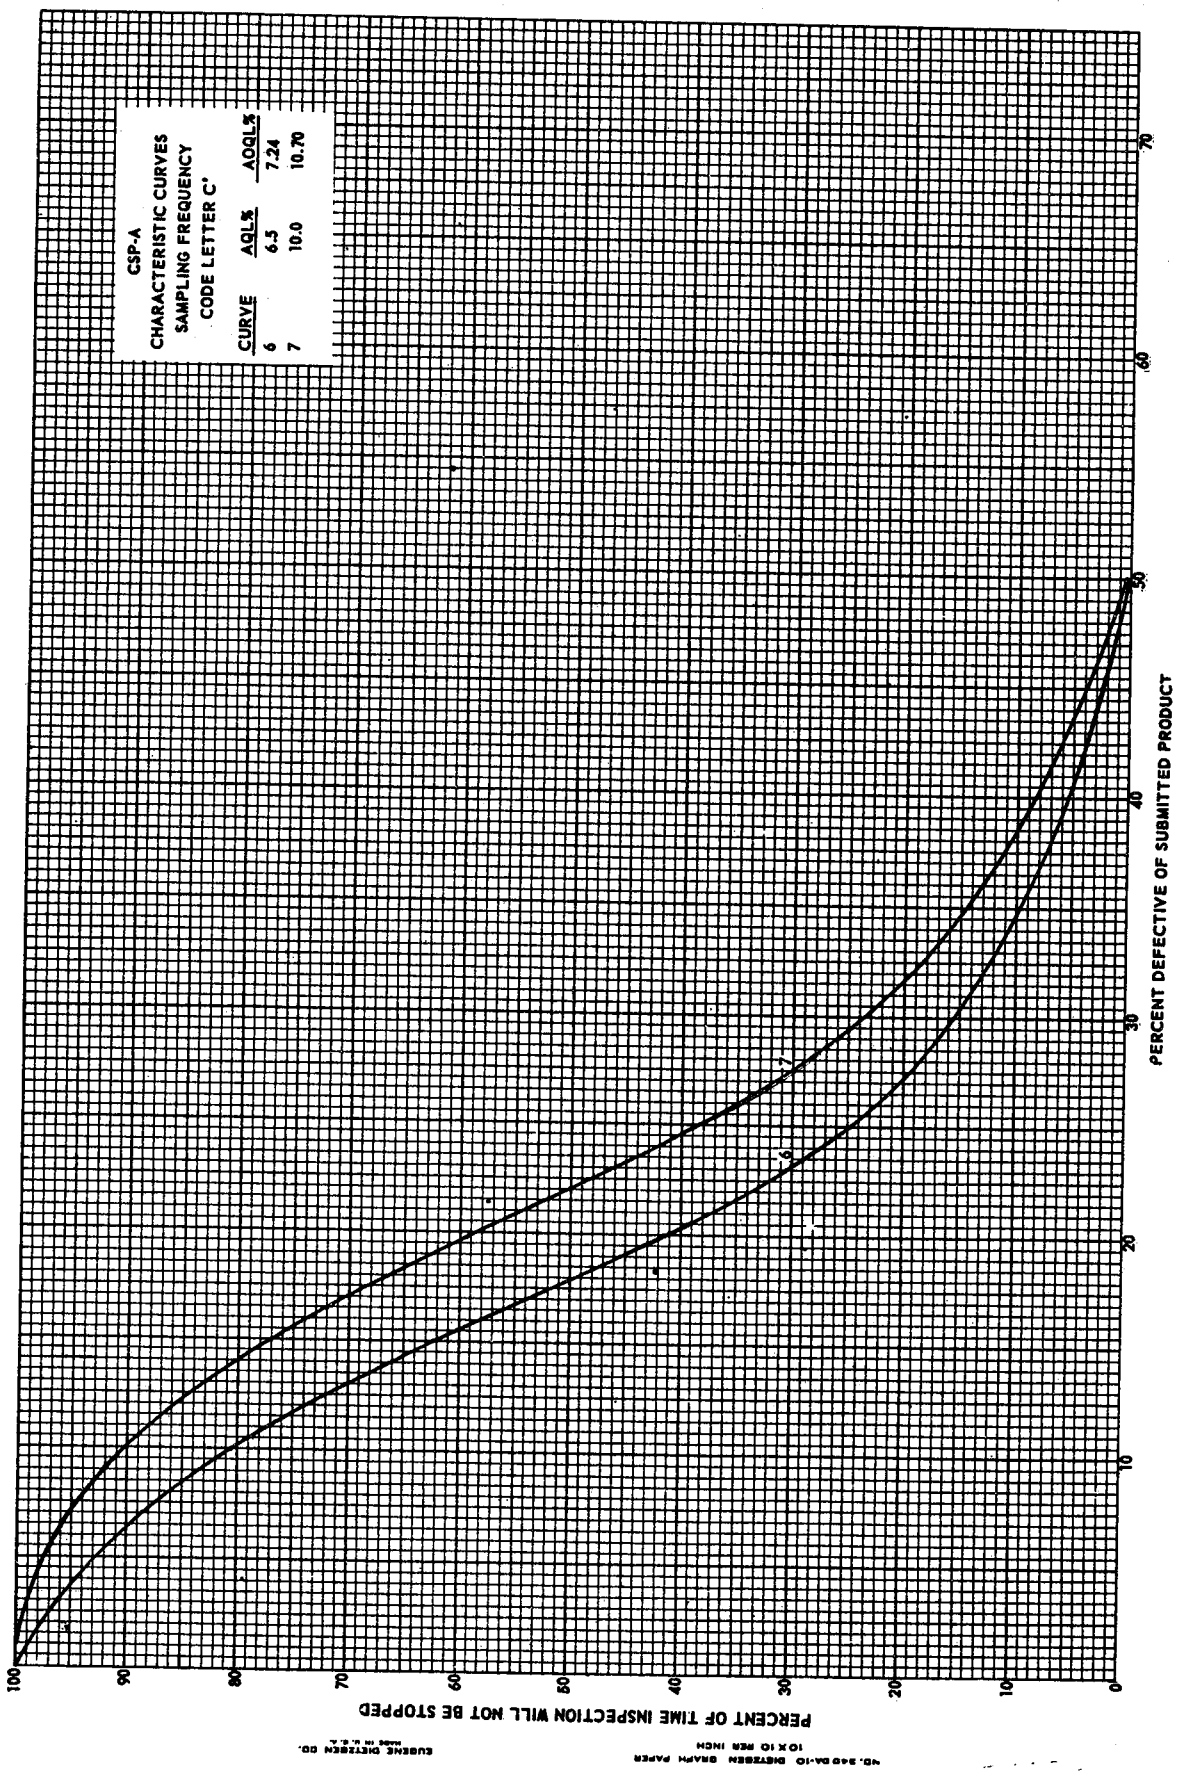

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

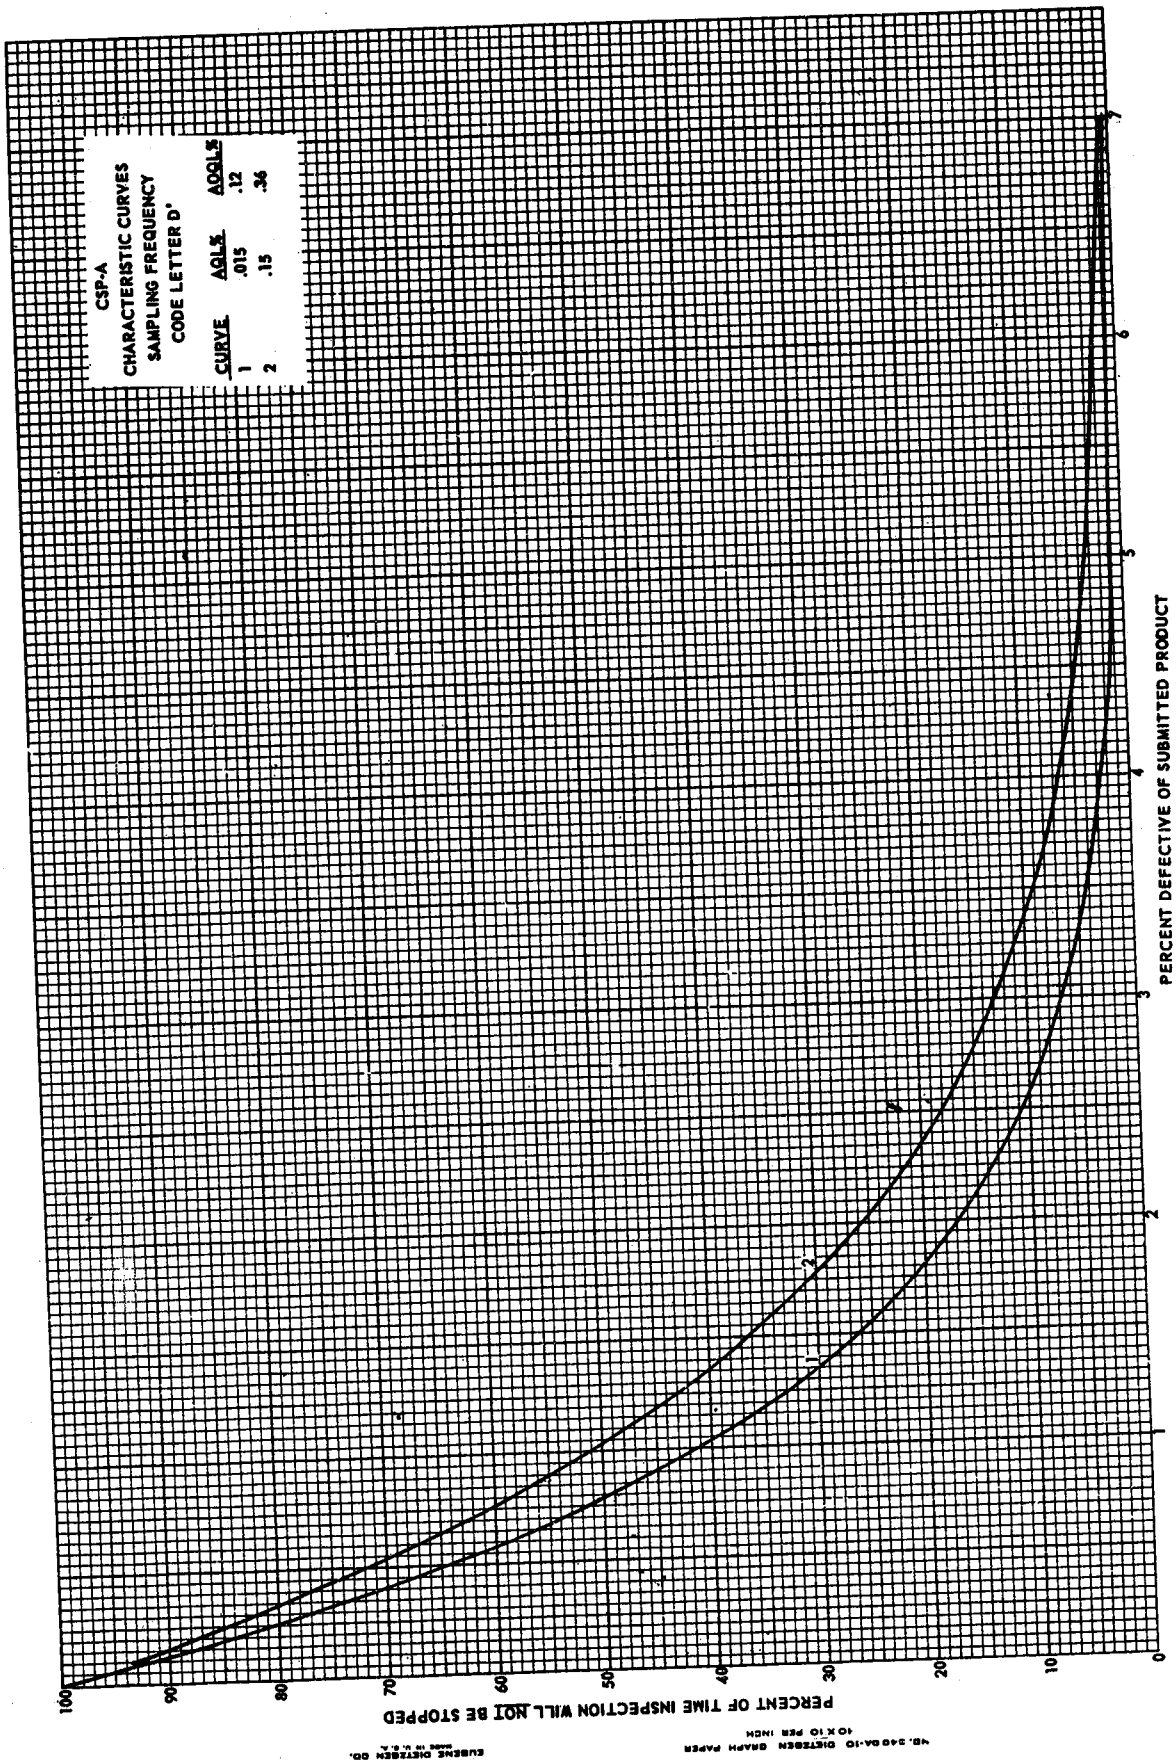


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

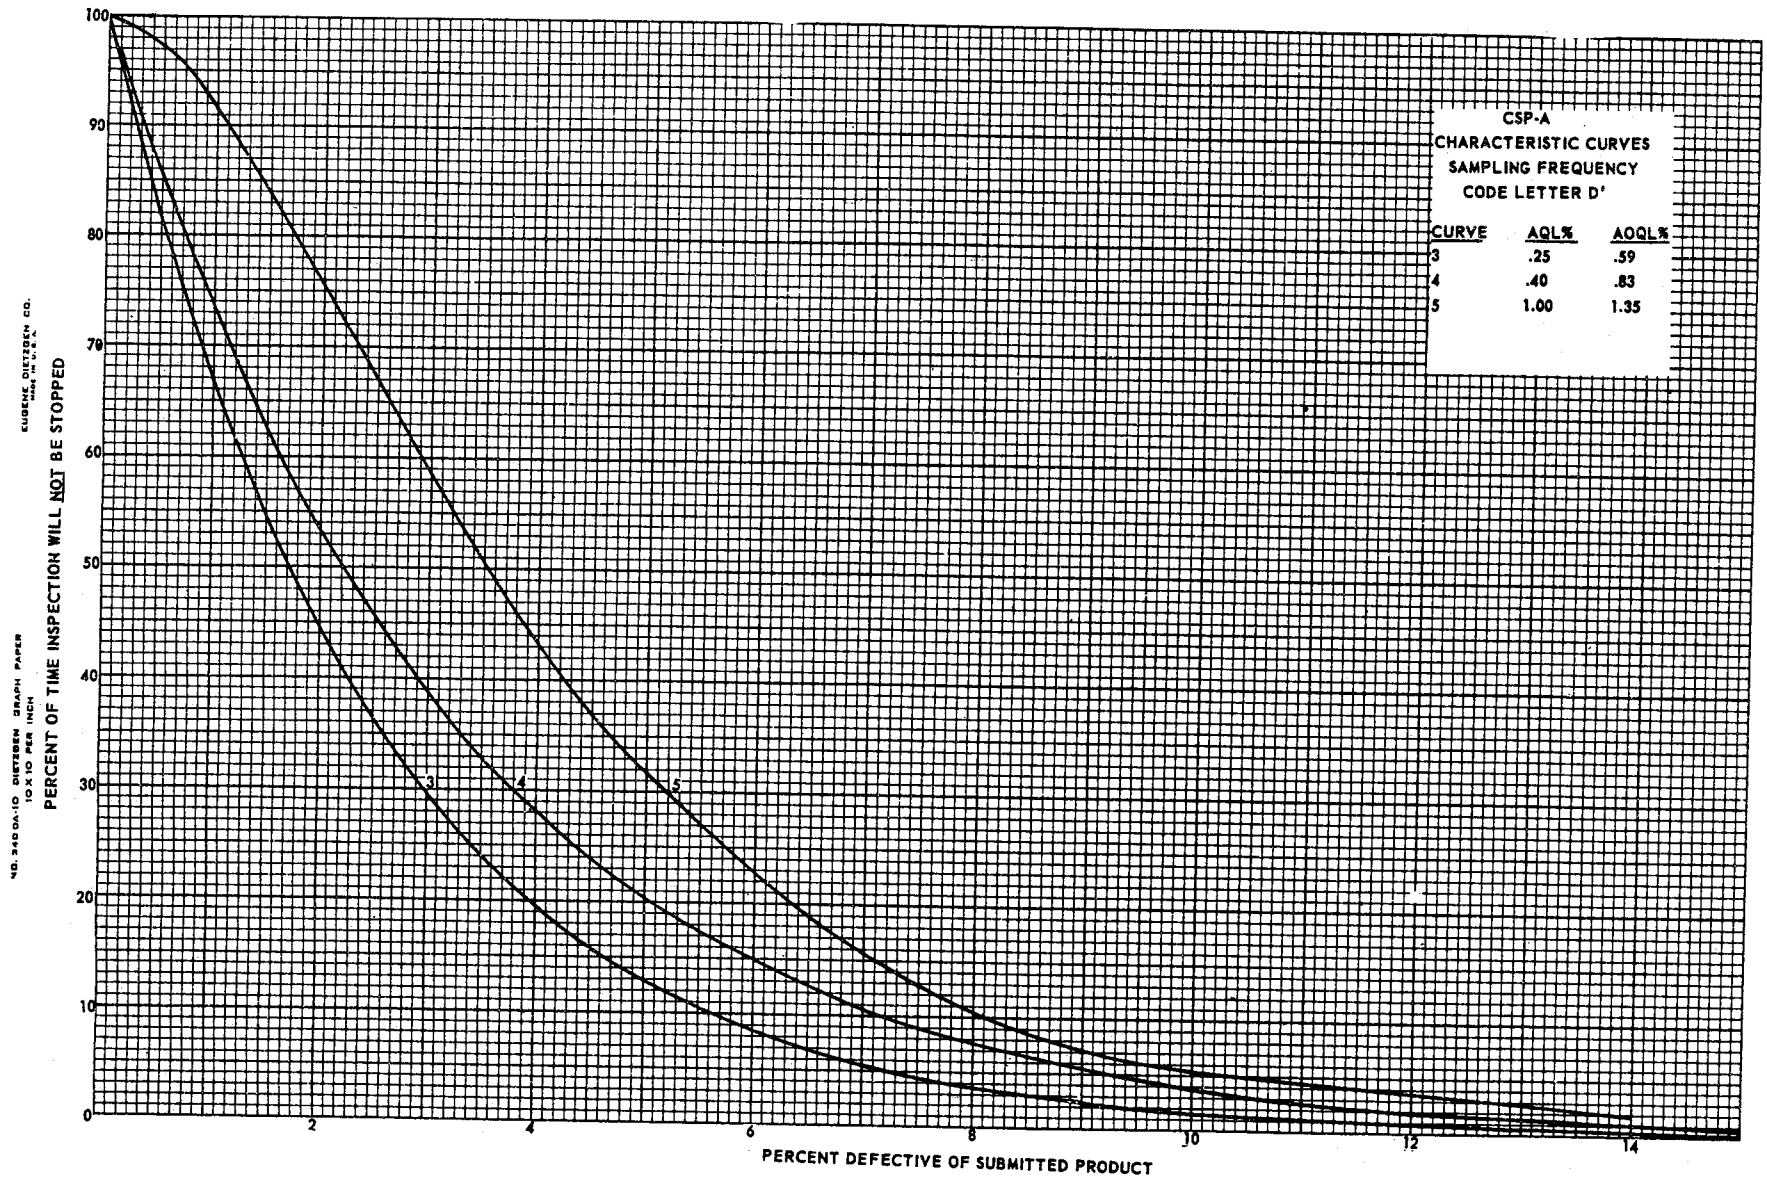


74

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

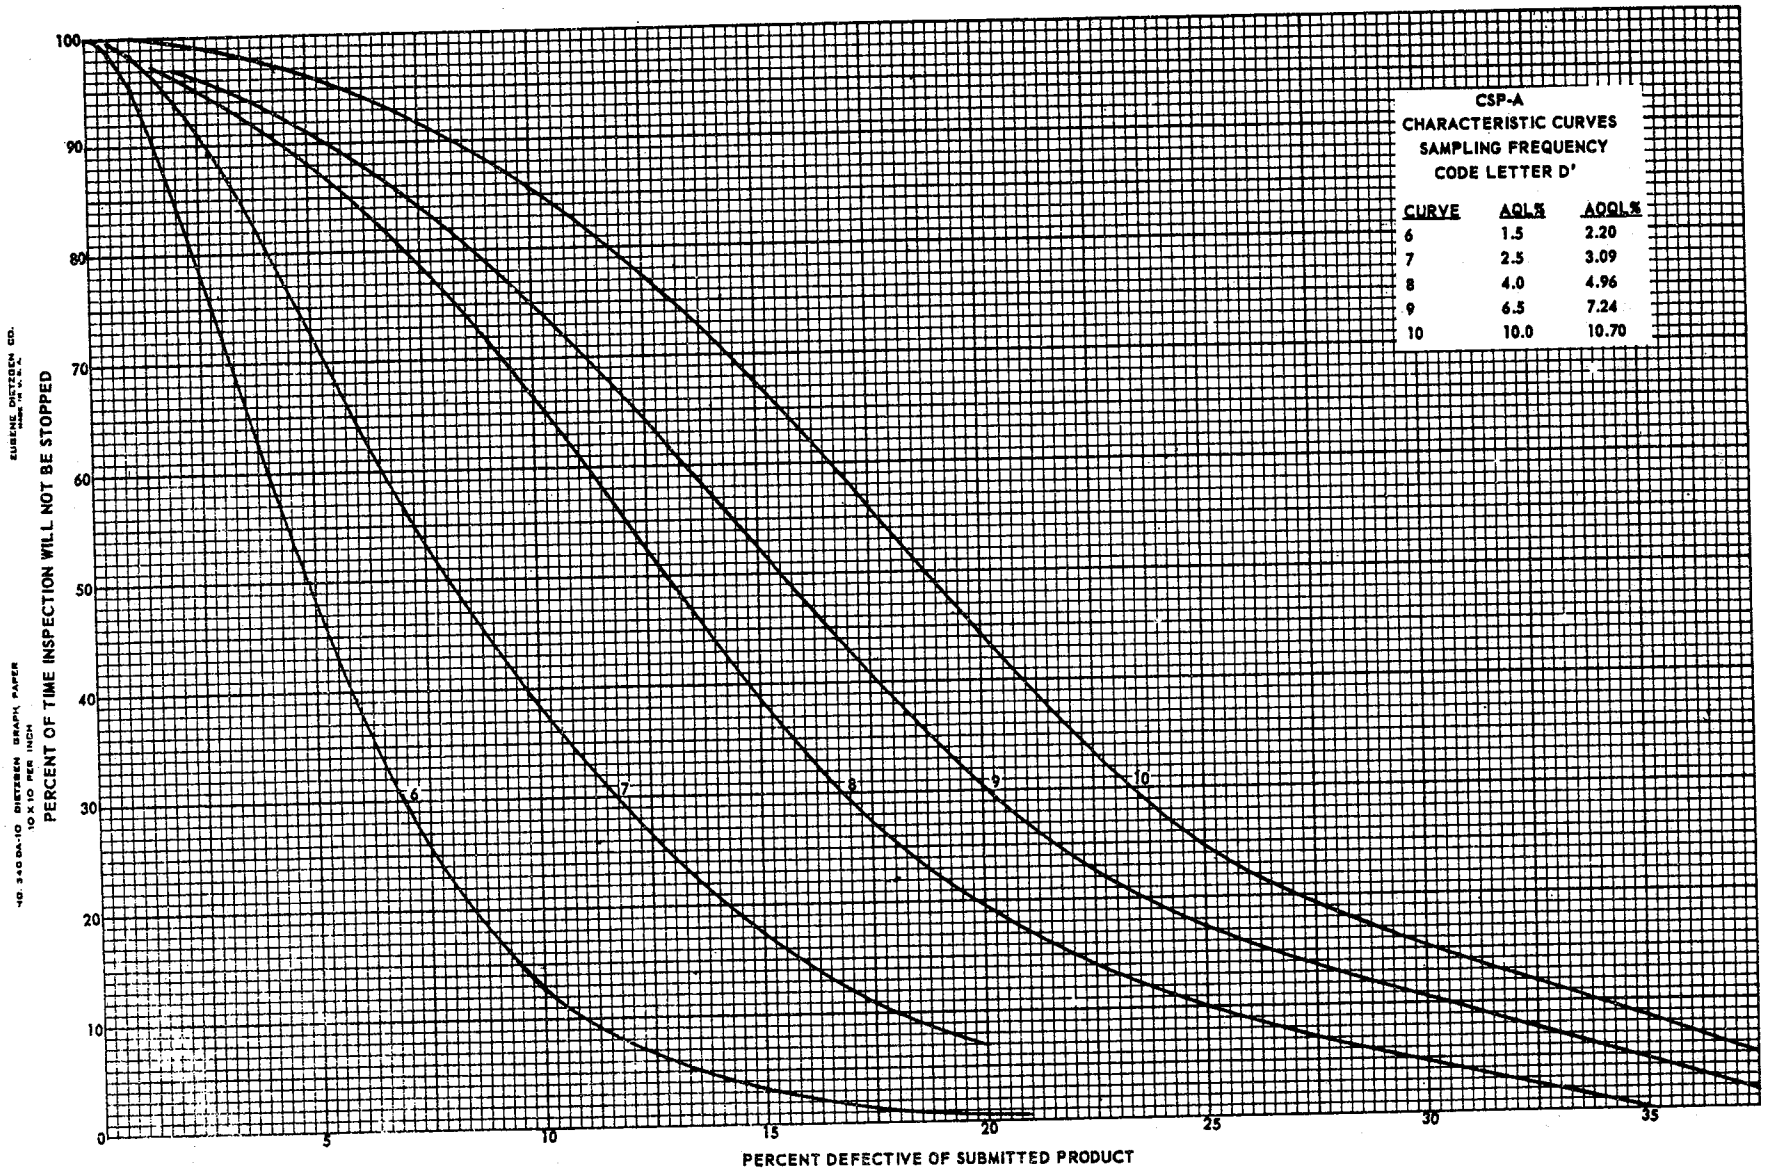

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

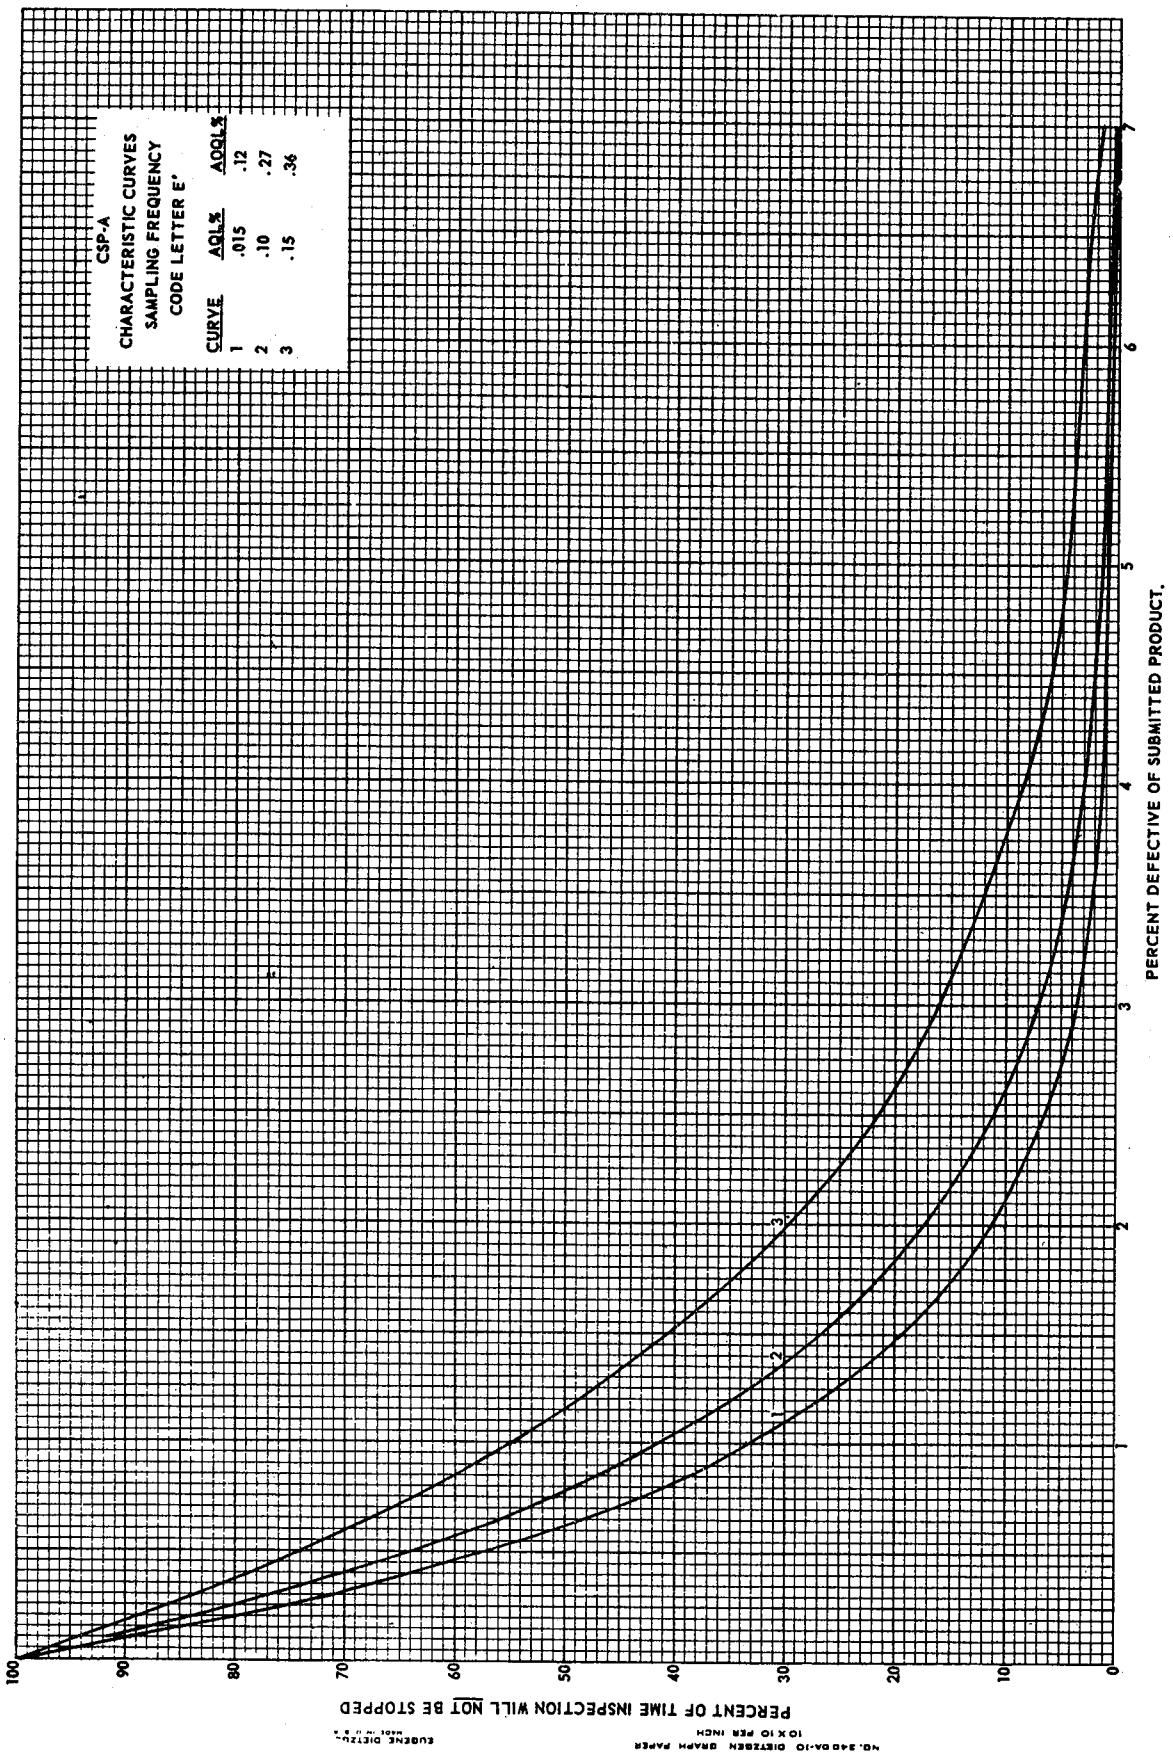

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

77

CSP-A

CHARACTERISTIC CURVES

SAMPLING FREQUENCY

CODE LETTER E

CURVE	AQL%	AQL%
4	.25	.39
5	.40	.63
6	1.05	1.35

PERCENT DEFECTIVE OF SUBMITTED PRODUCT

0 10 20 30 40 50 60 70 80 90 100


PERCENT OF TIME INSPECTION WILL NOT BE STOPPED

0 2 4 6 8 10 12 14


EUGENE DIETZGEN CO.

NO. 340 DA-10 DIETZGEN GRAPH PAPER
10 X 10 PER INCH


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

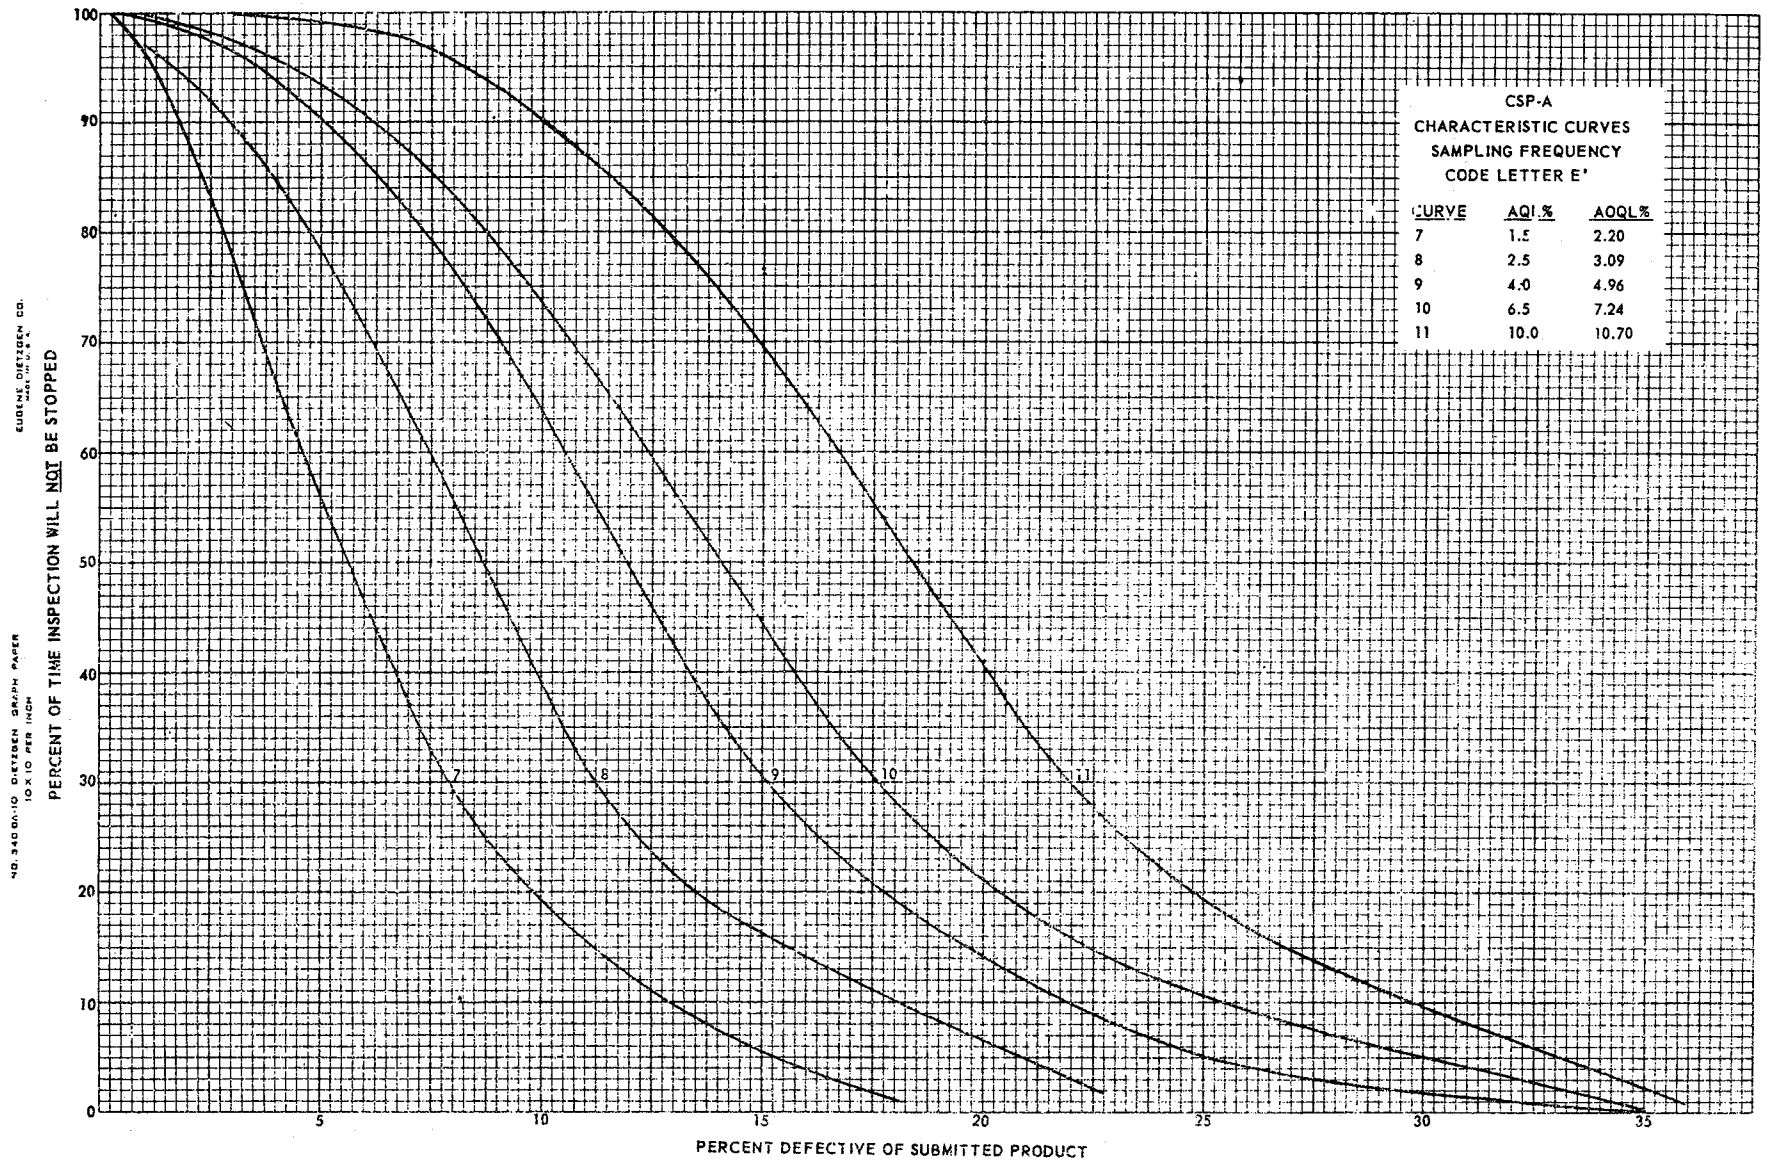


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

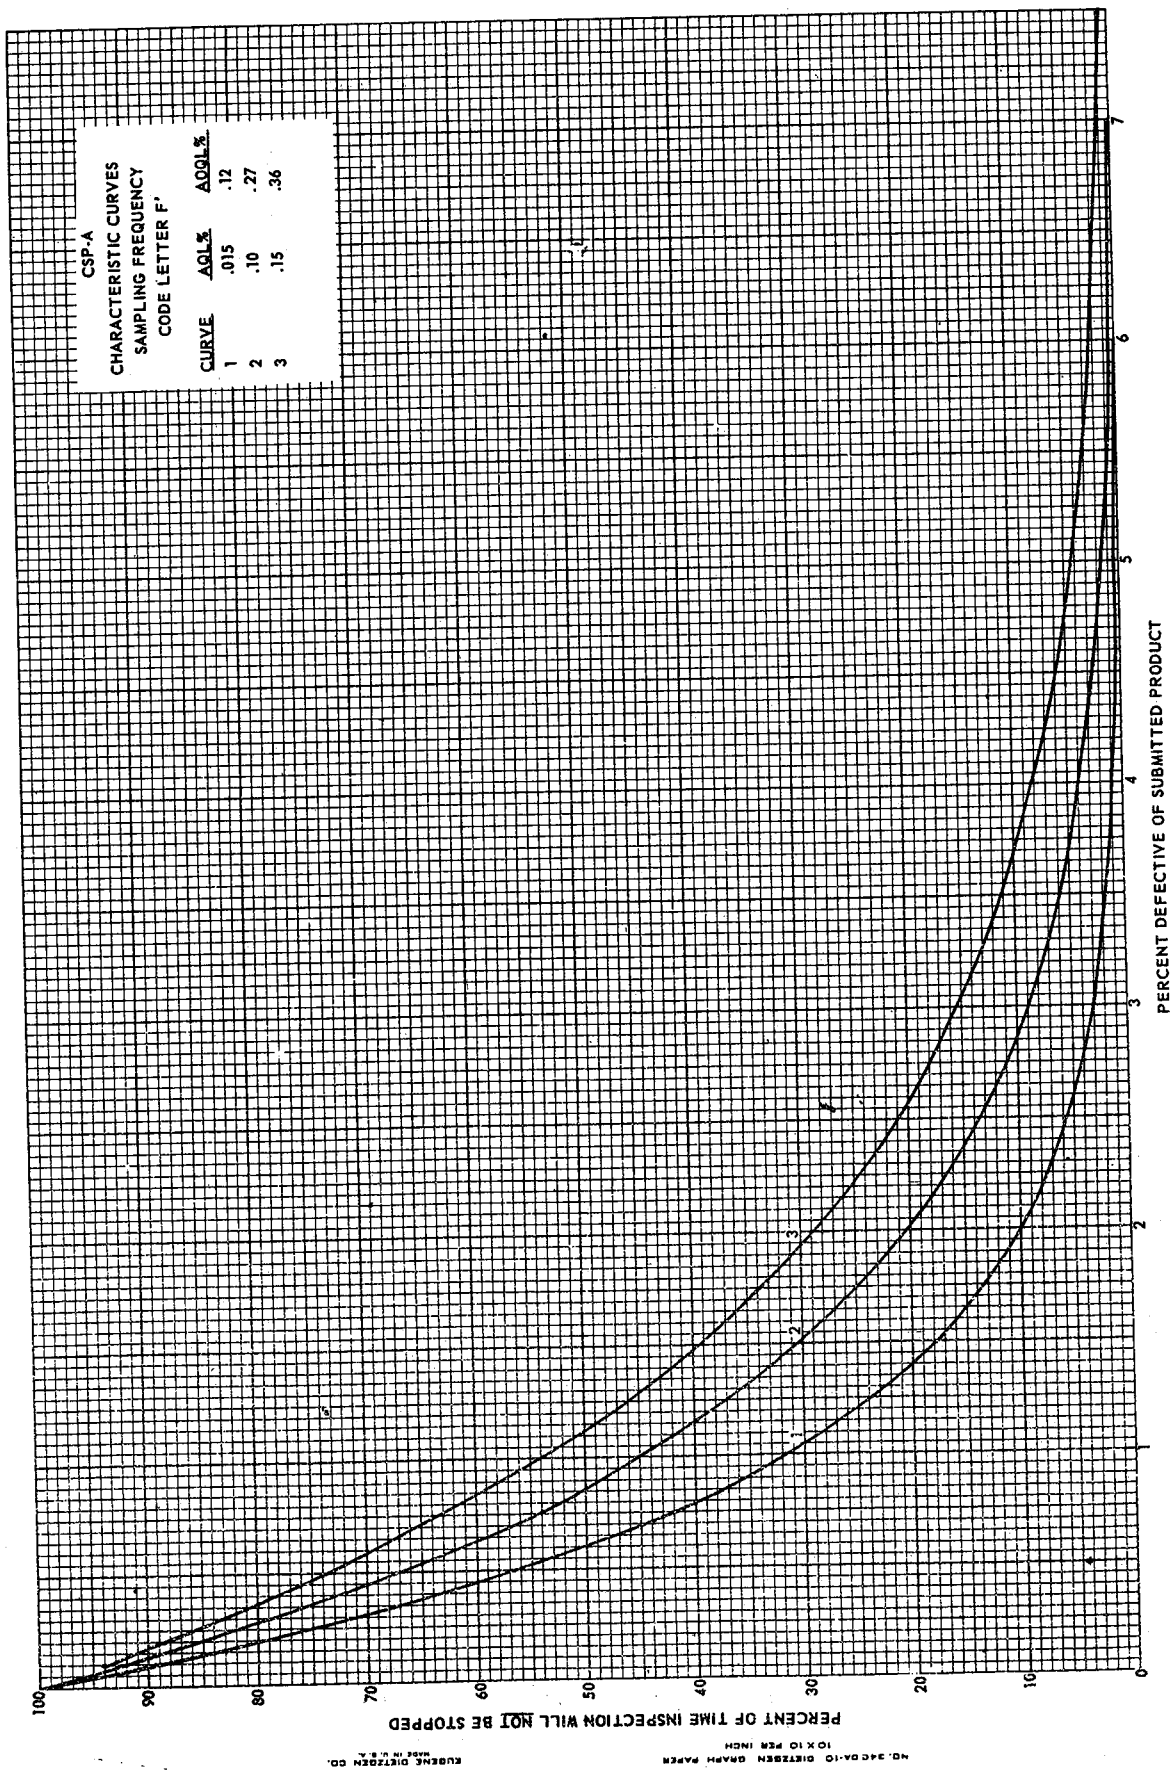

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

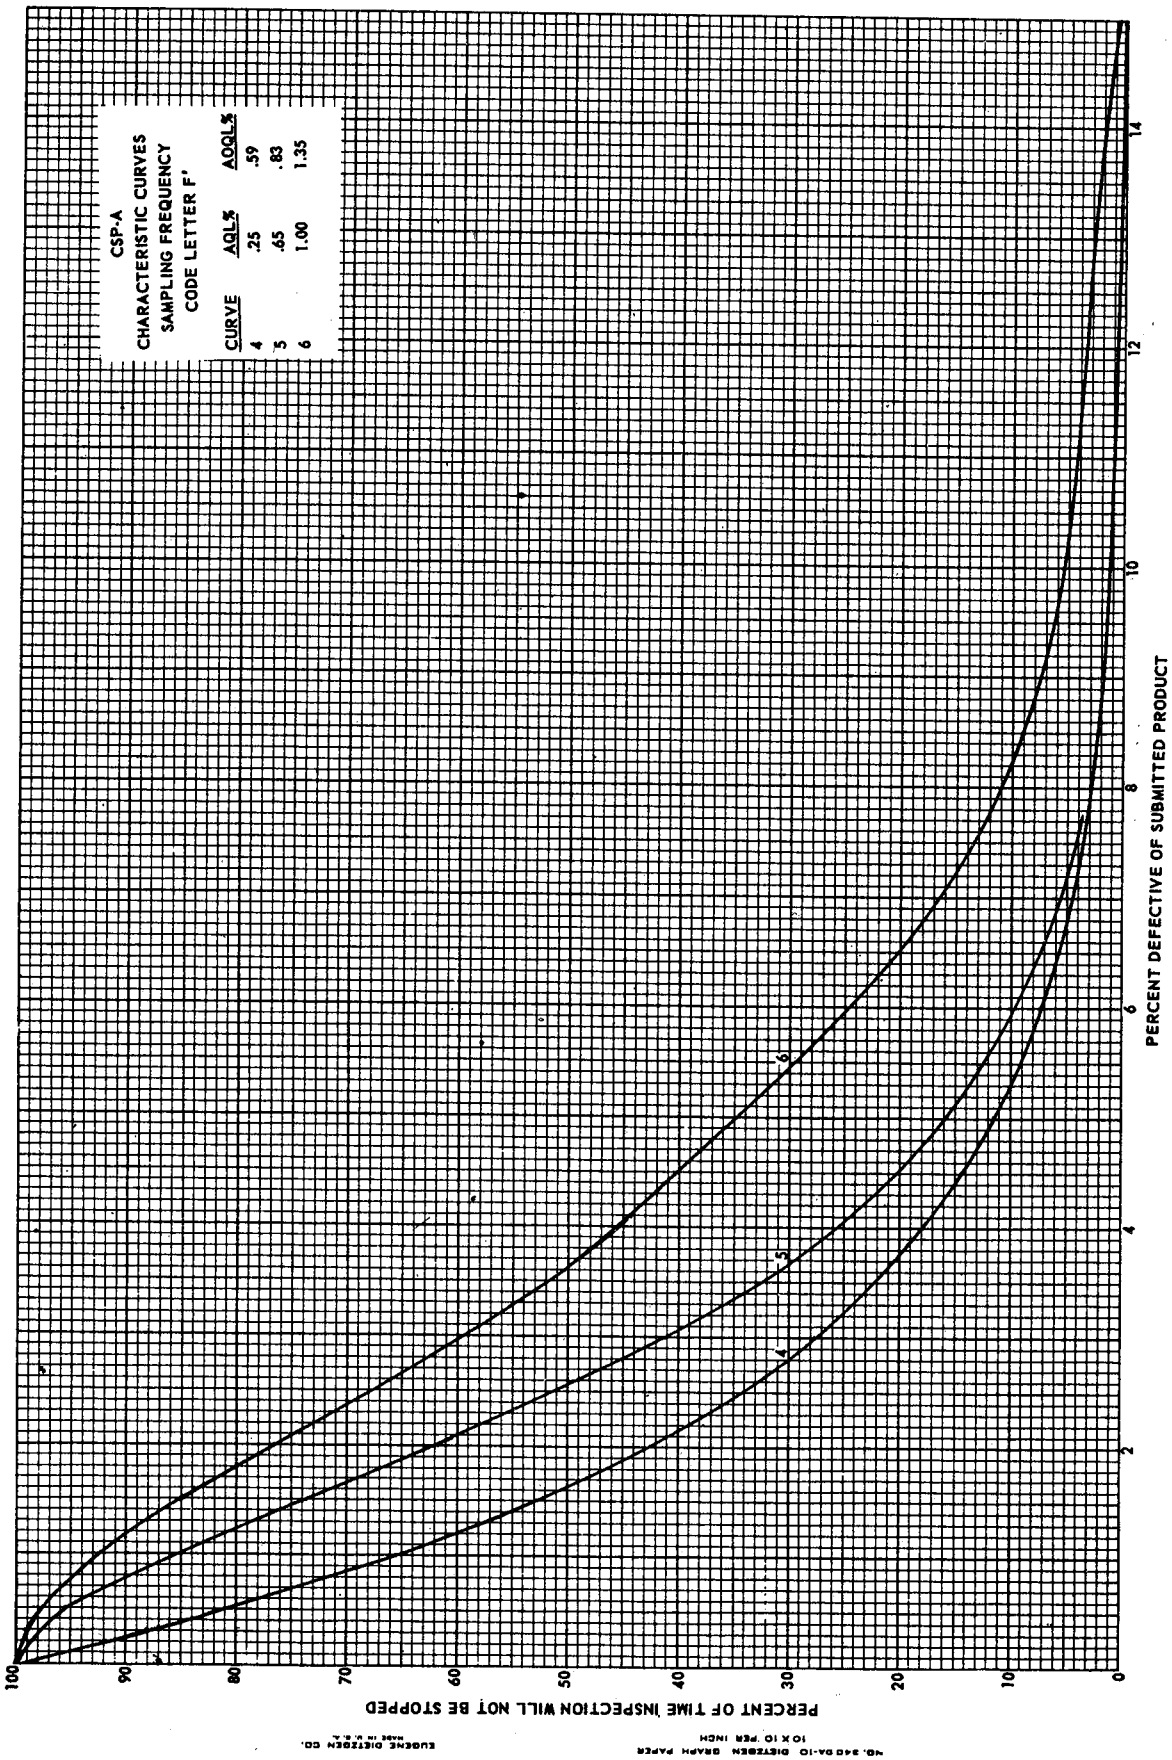


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

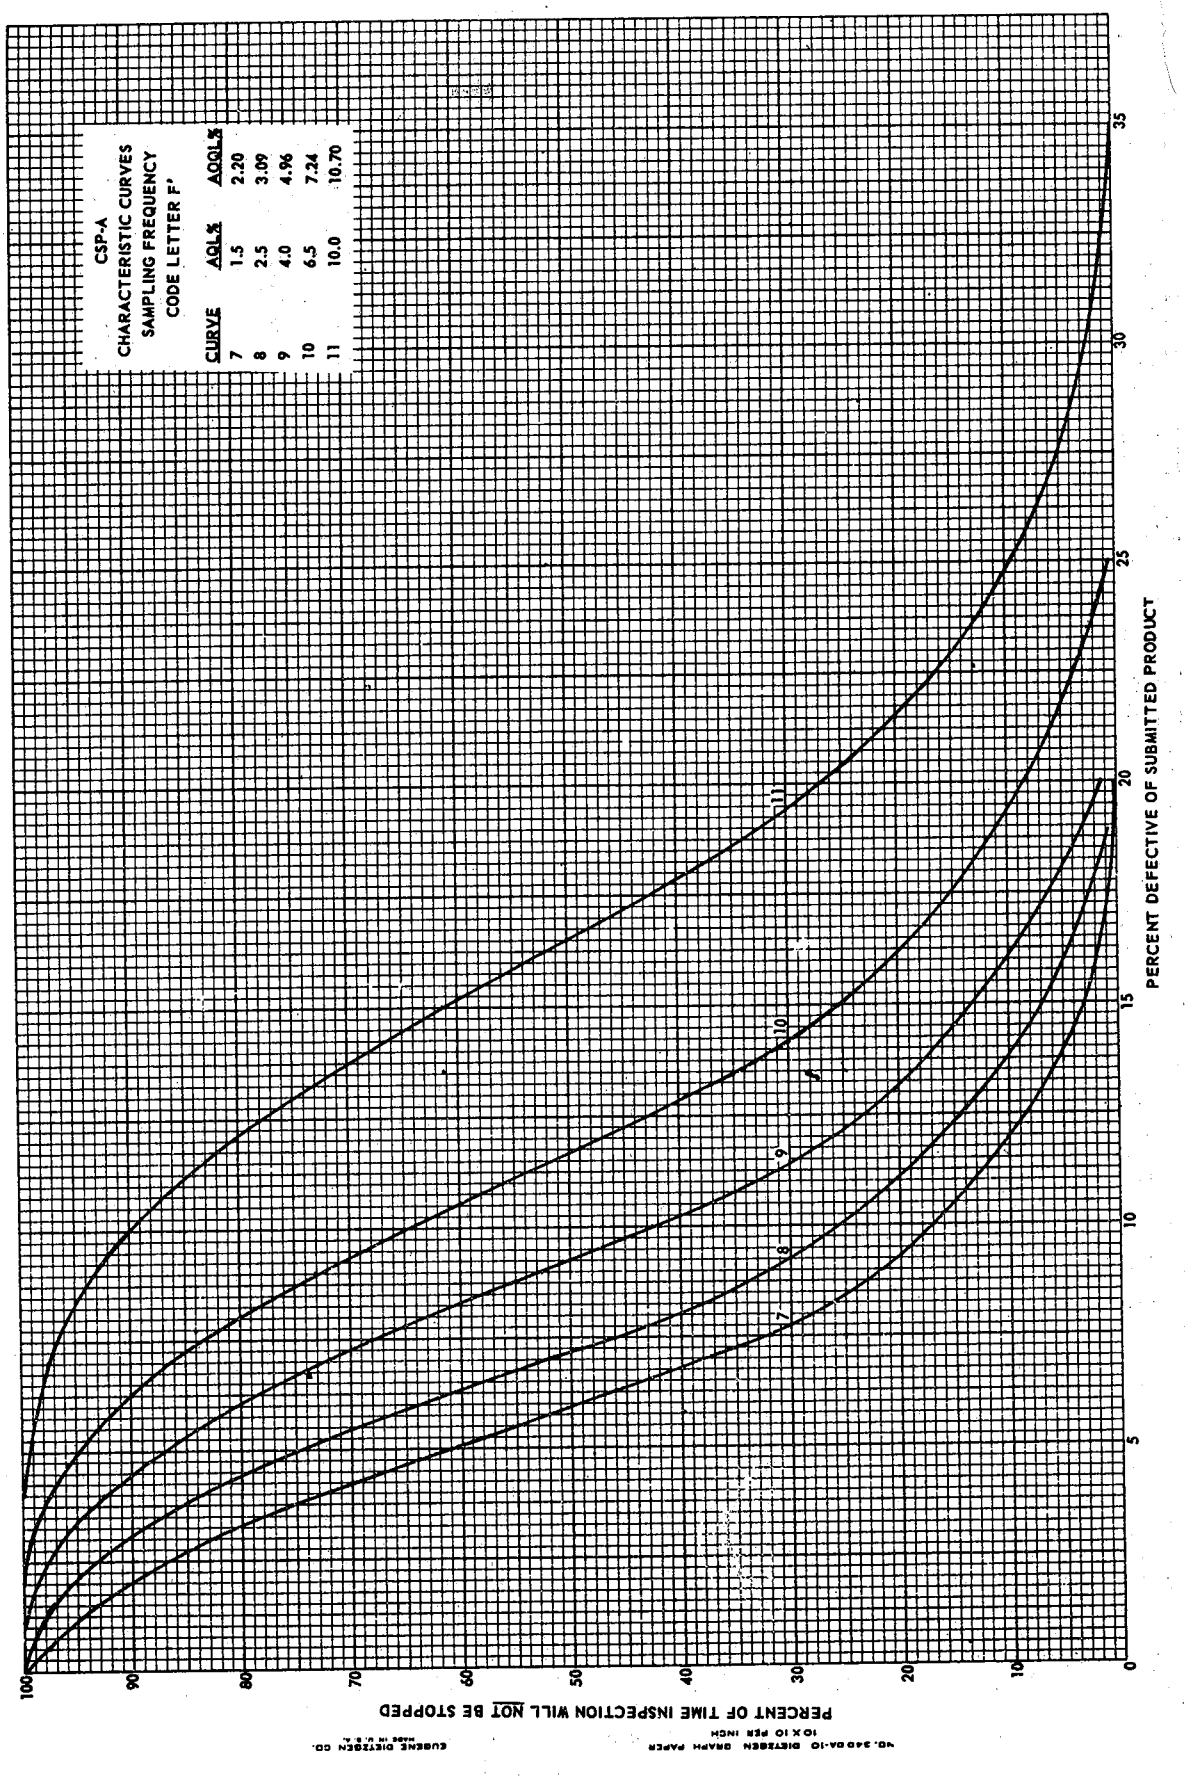


81

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

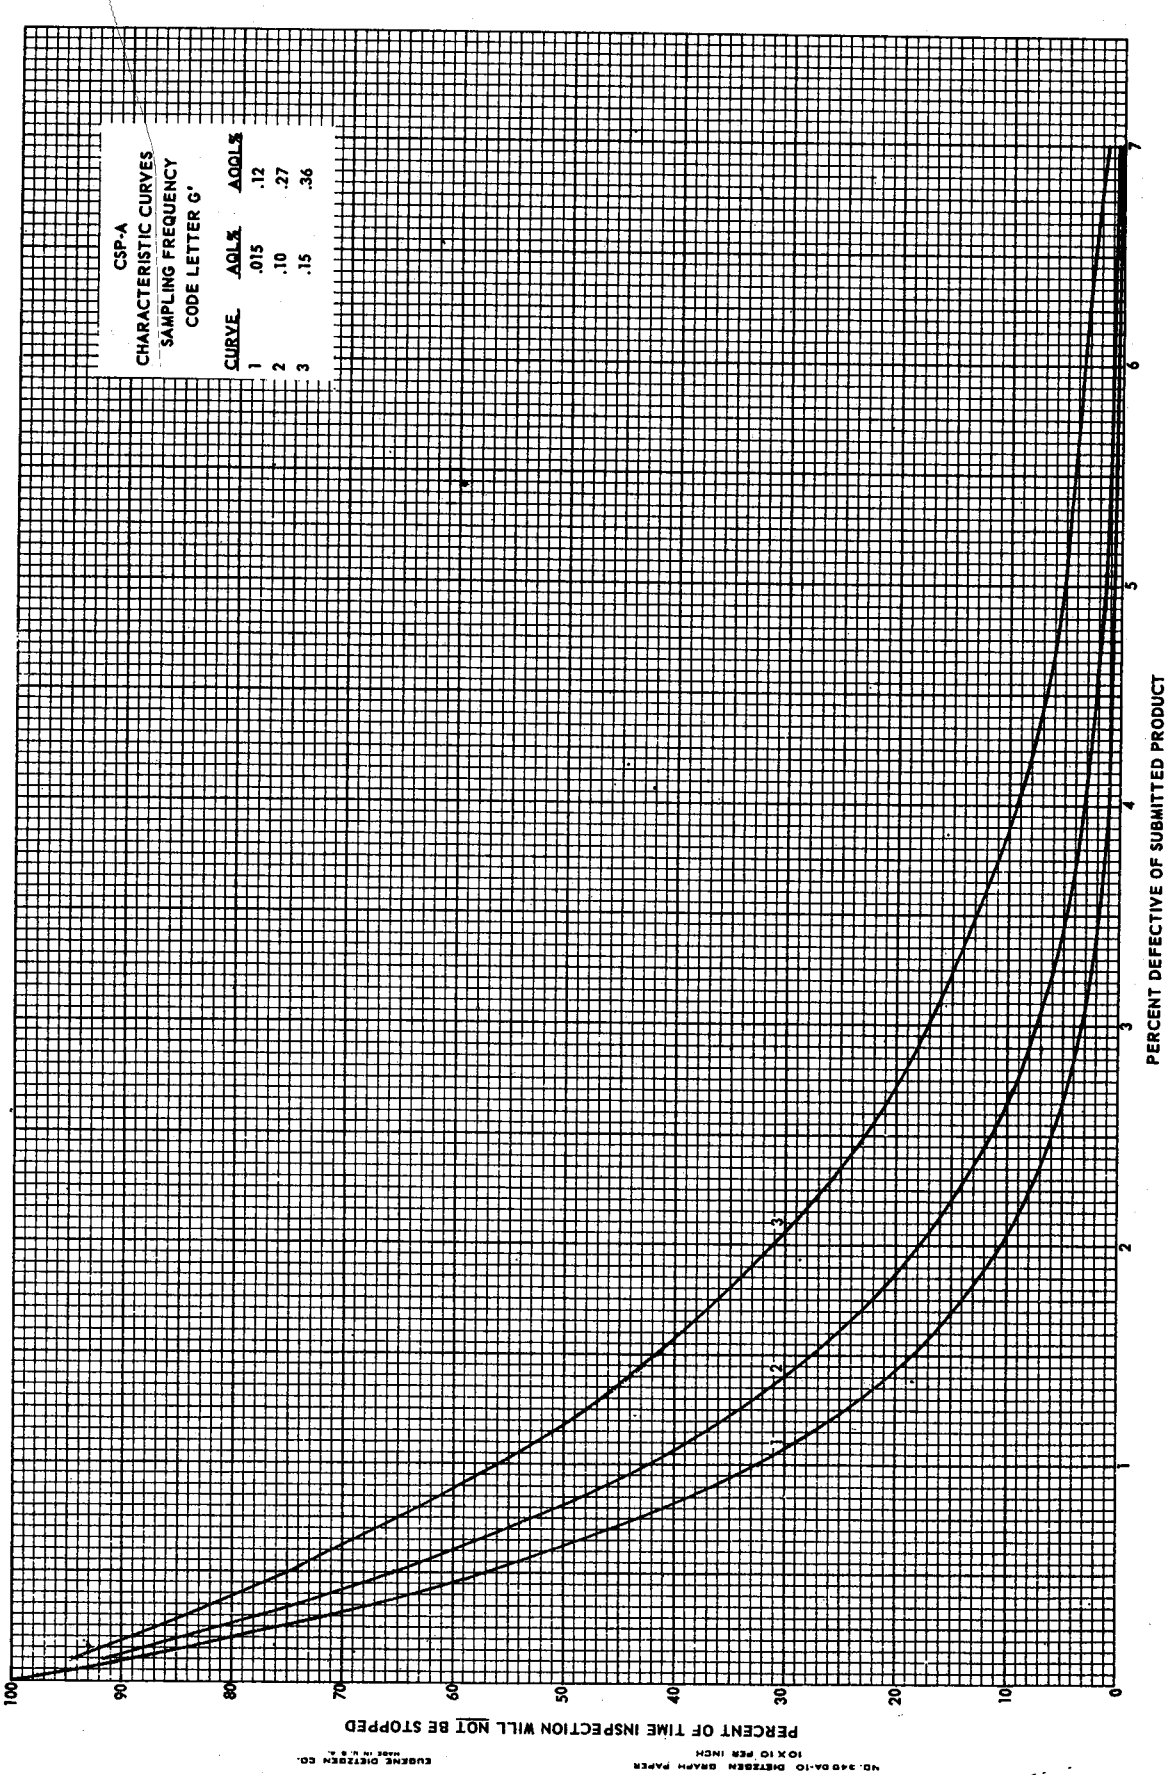


82

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

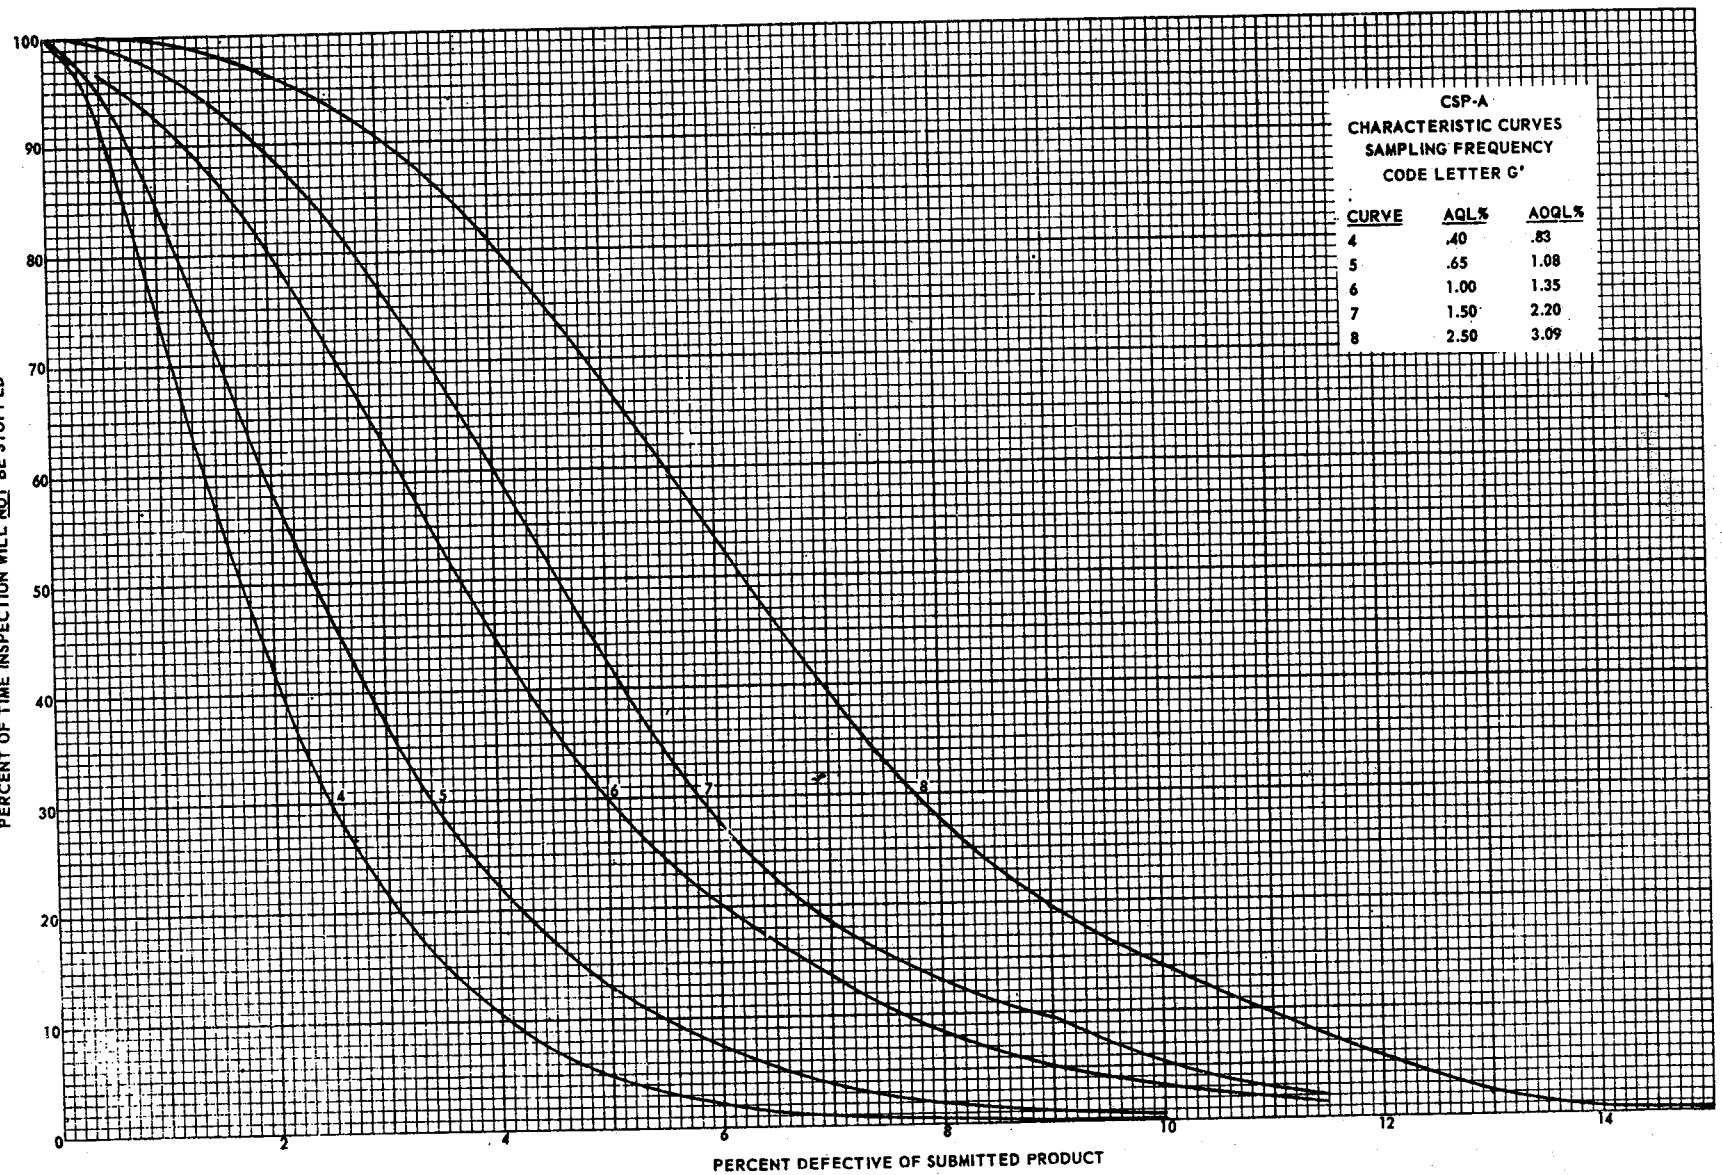

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

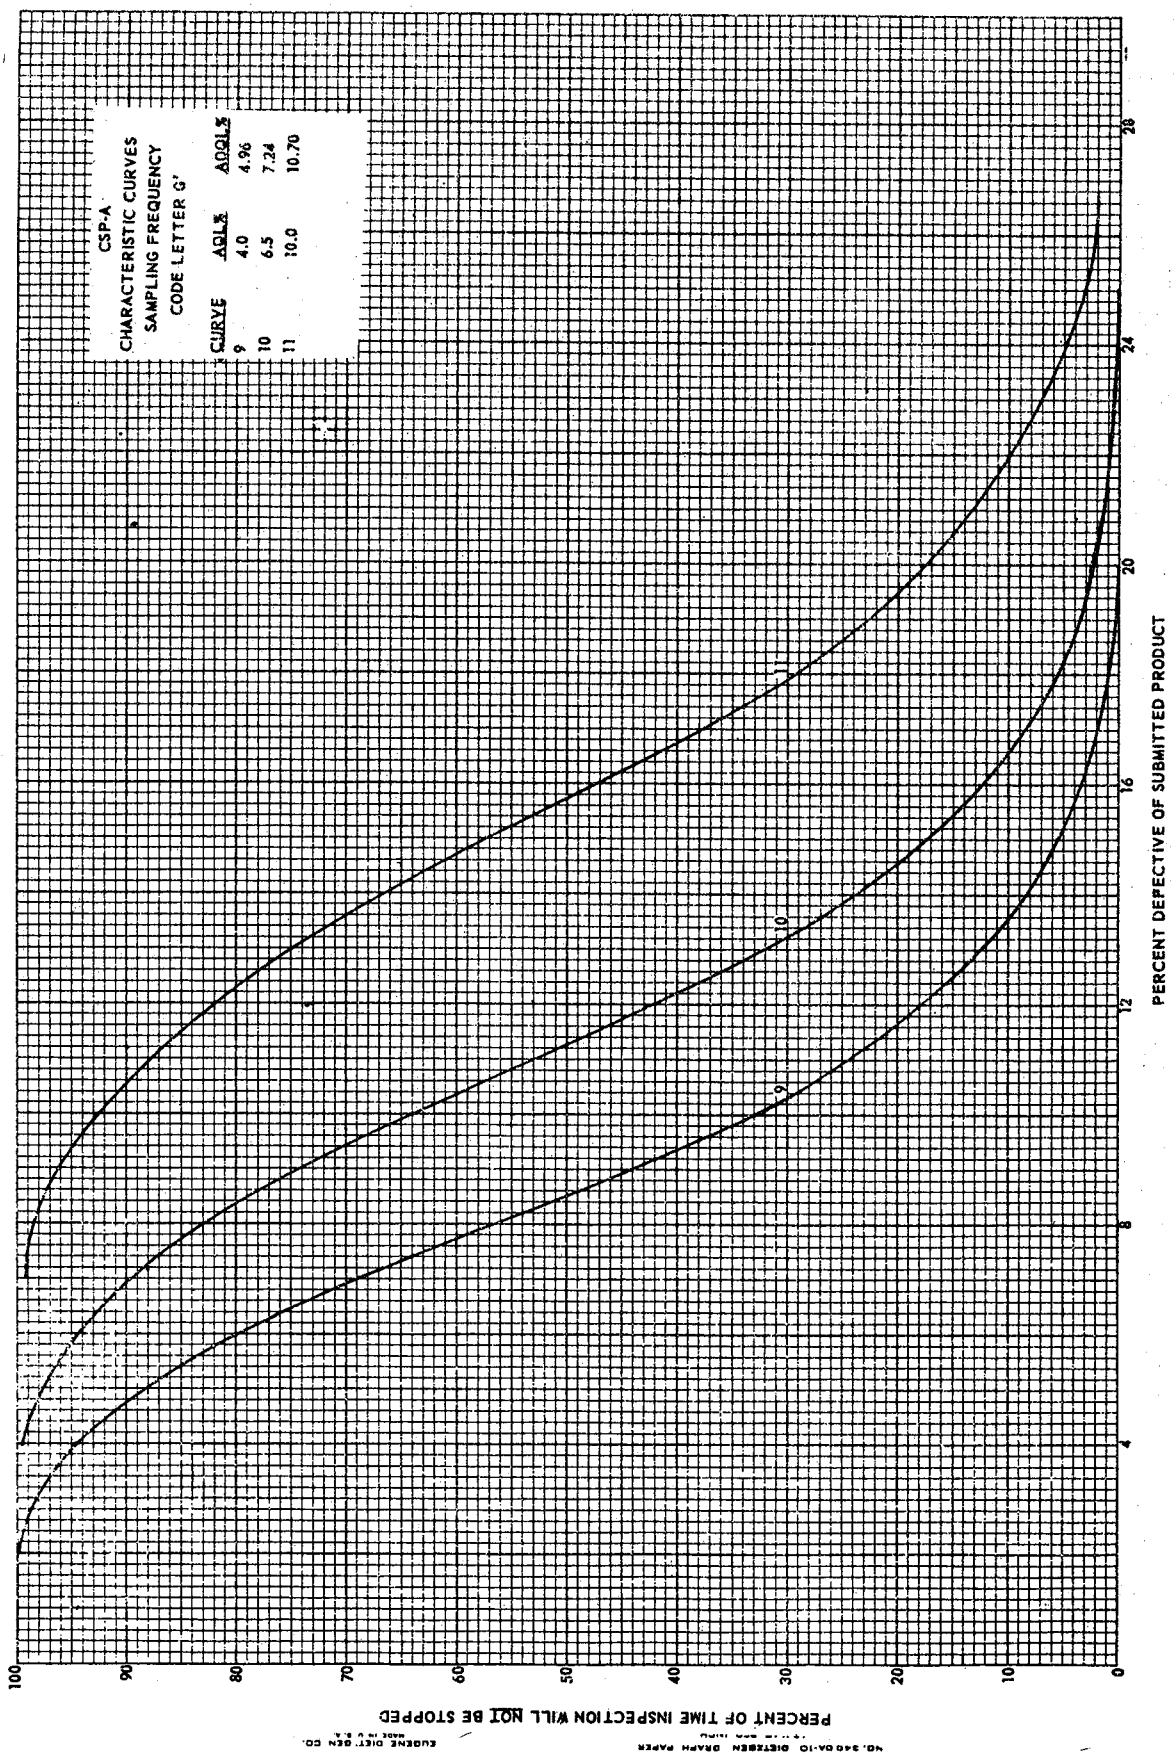


84


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

85


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

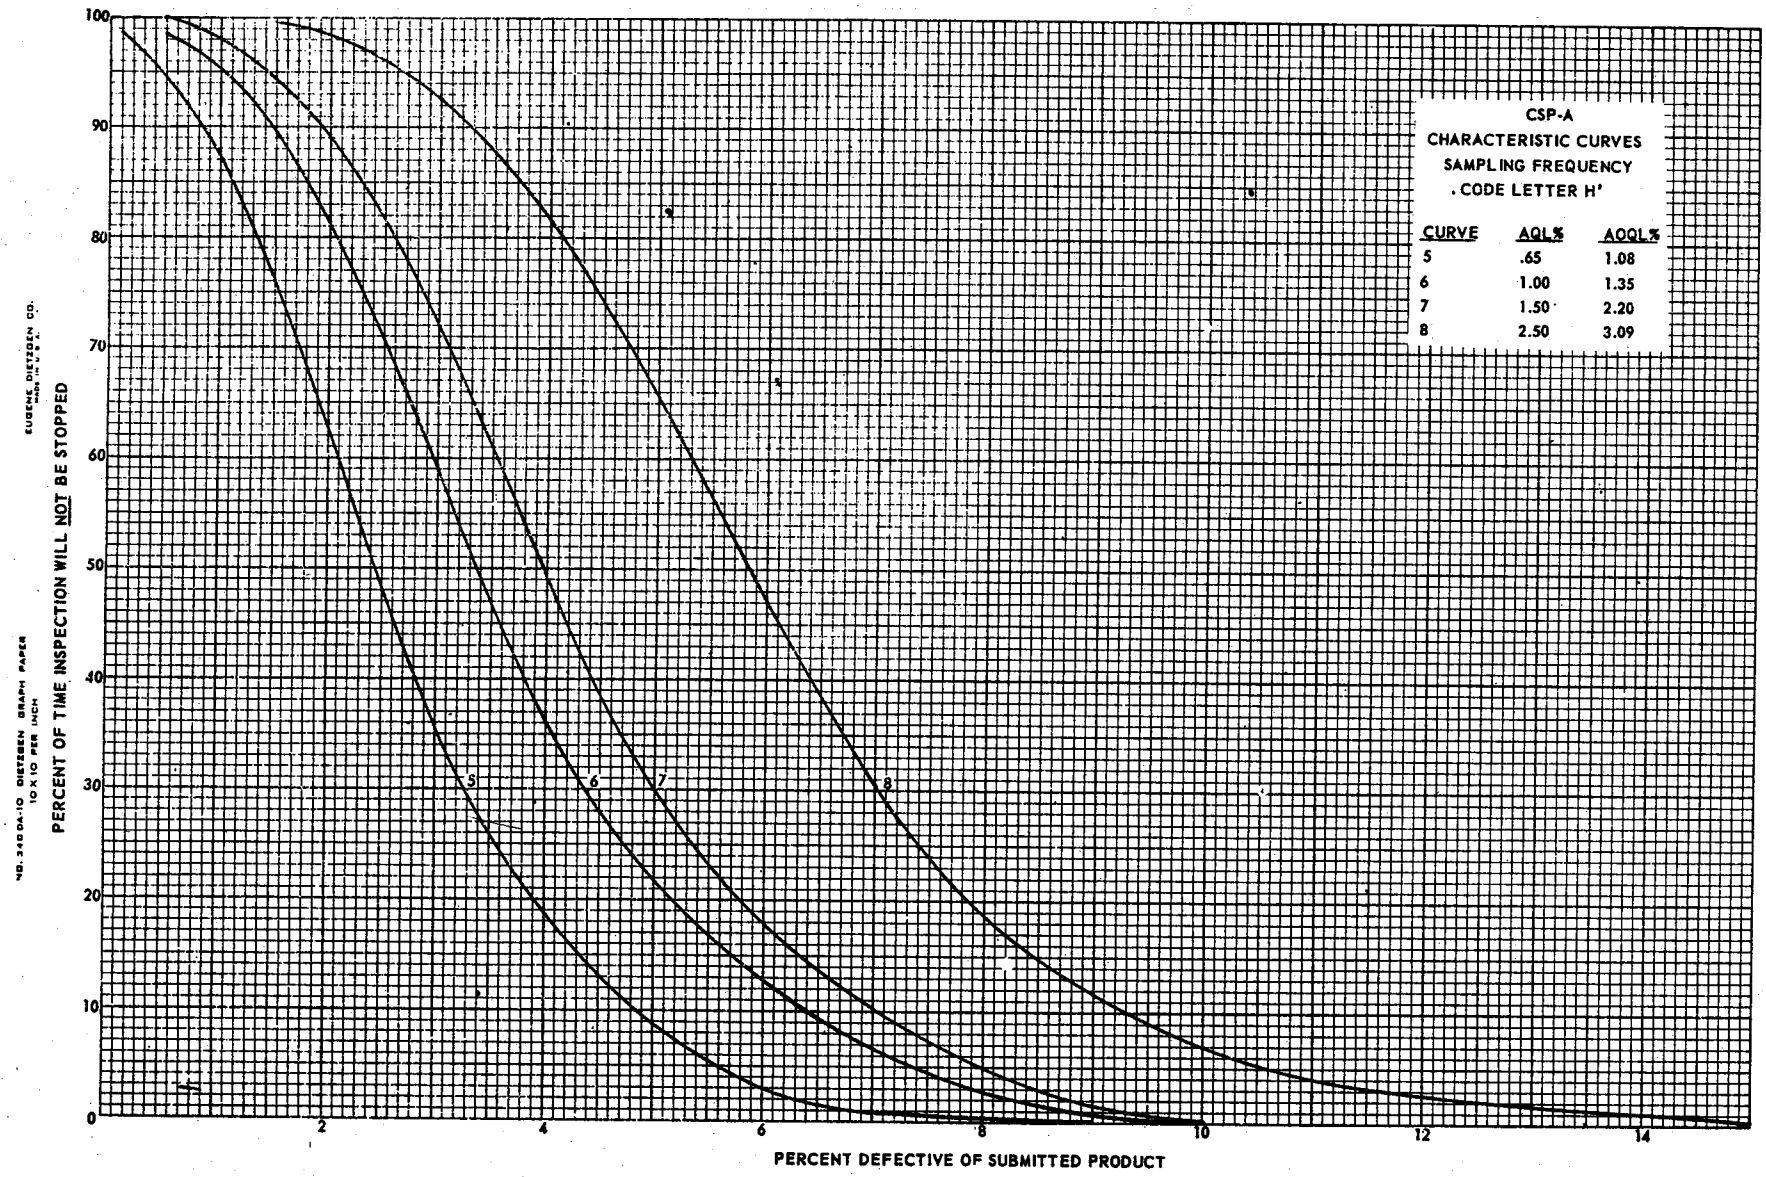

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

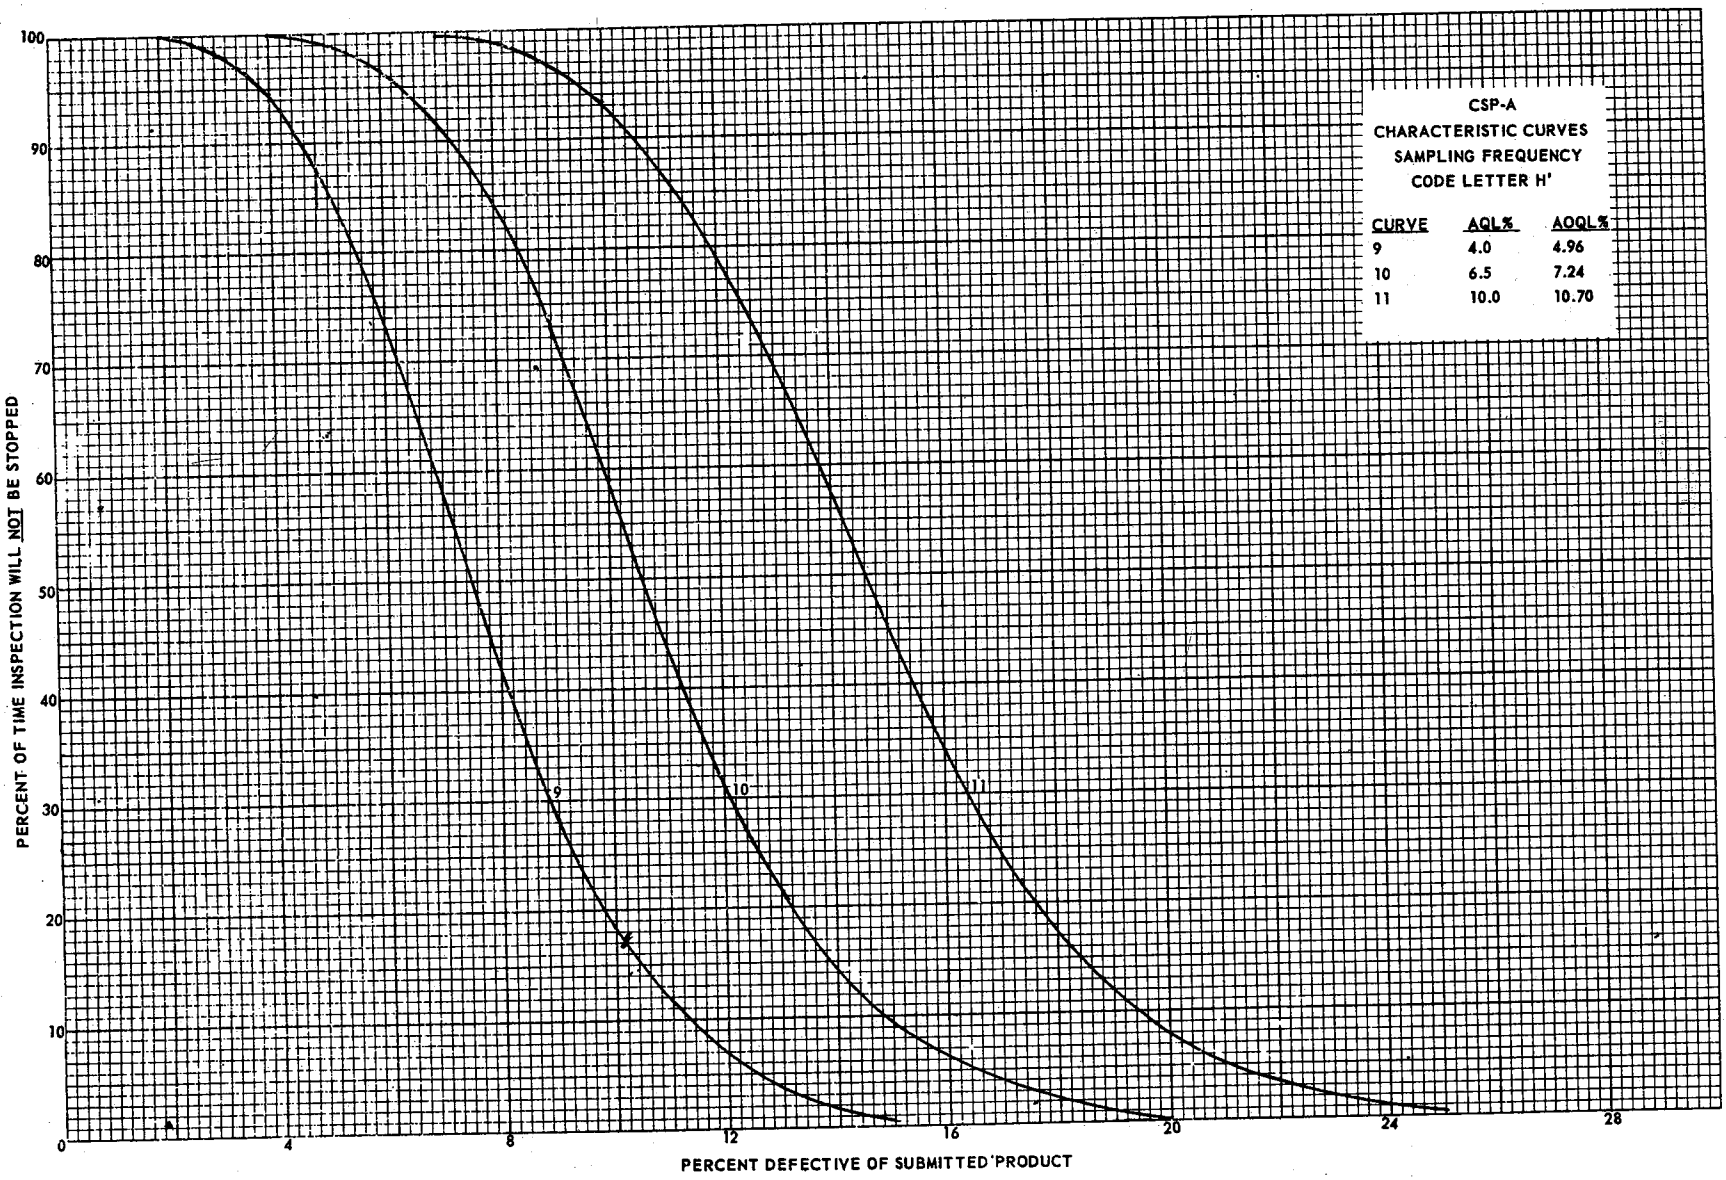


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

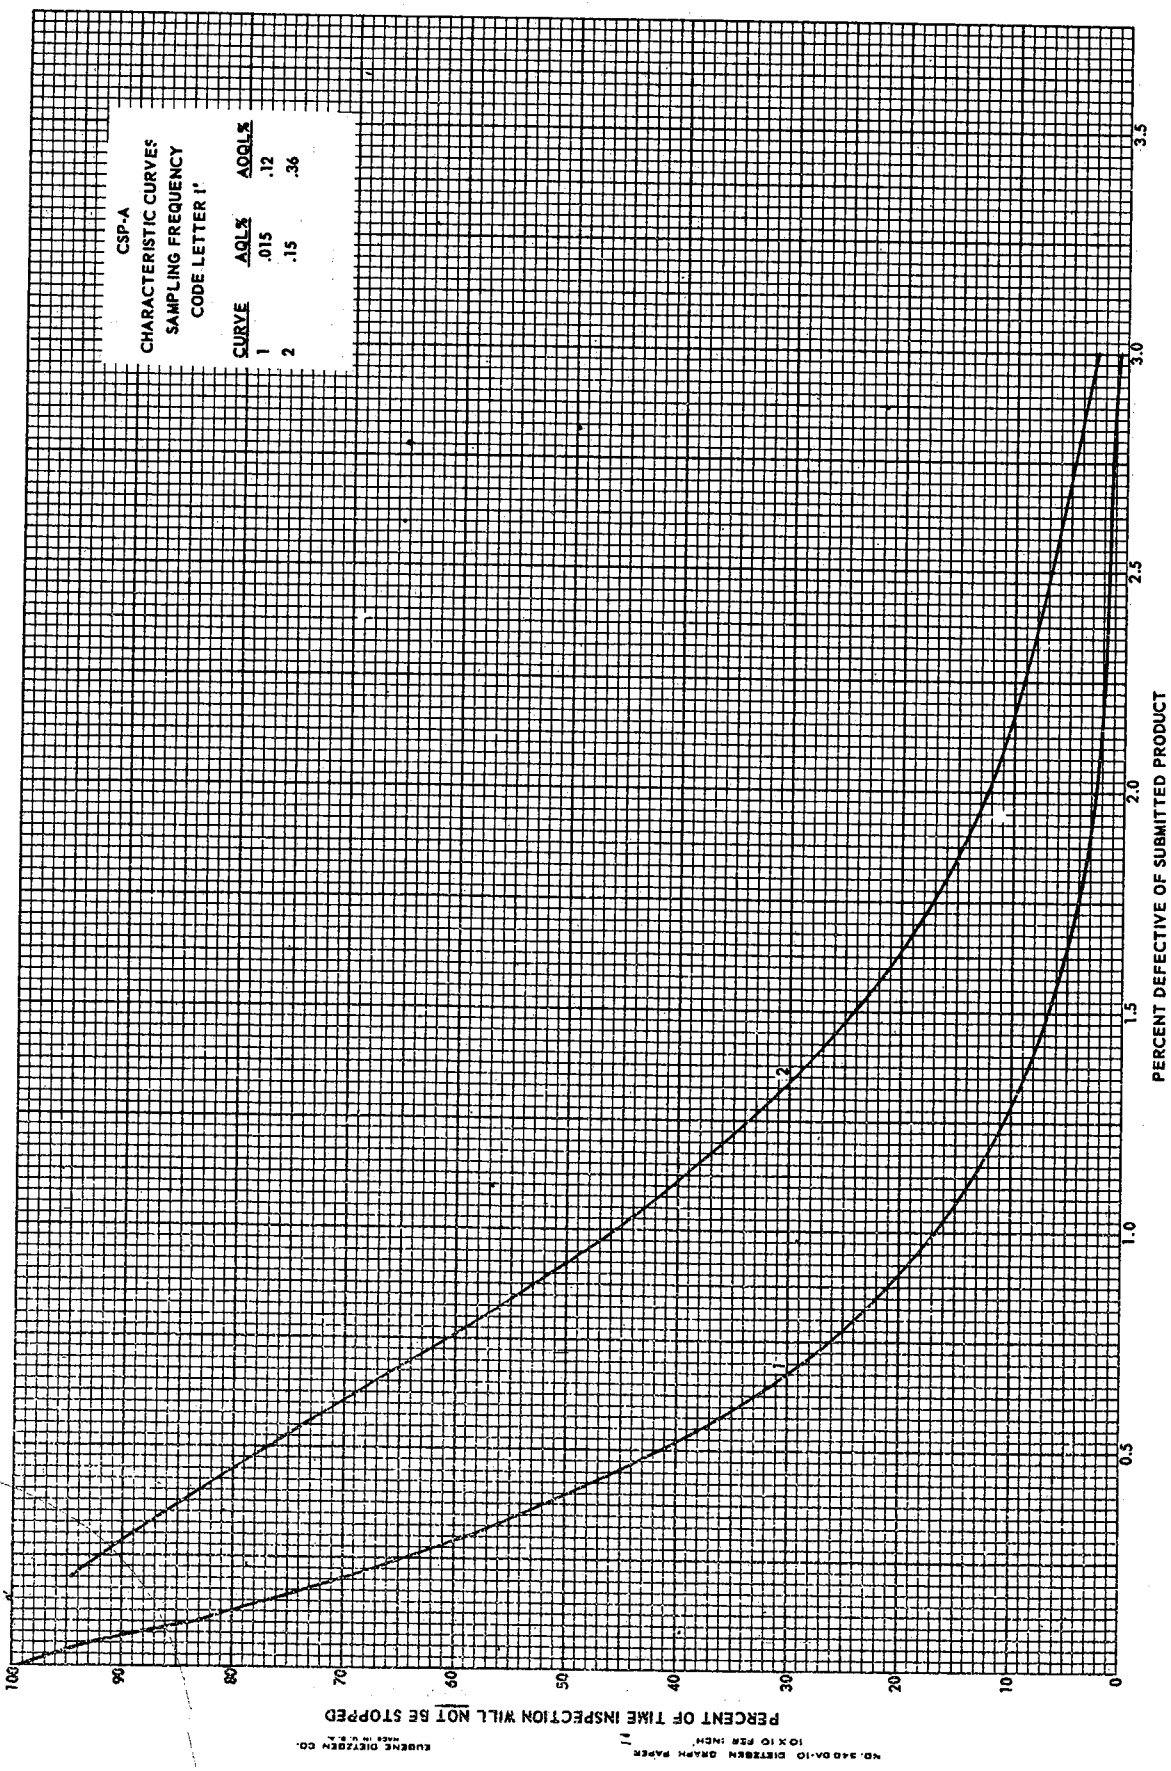


88


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

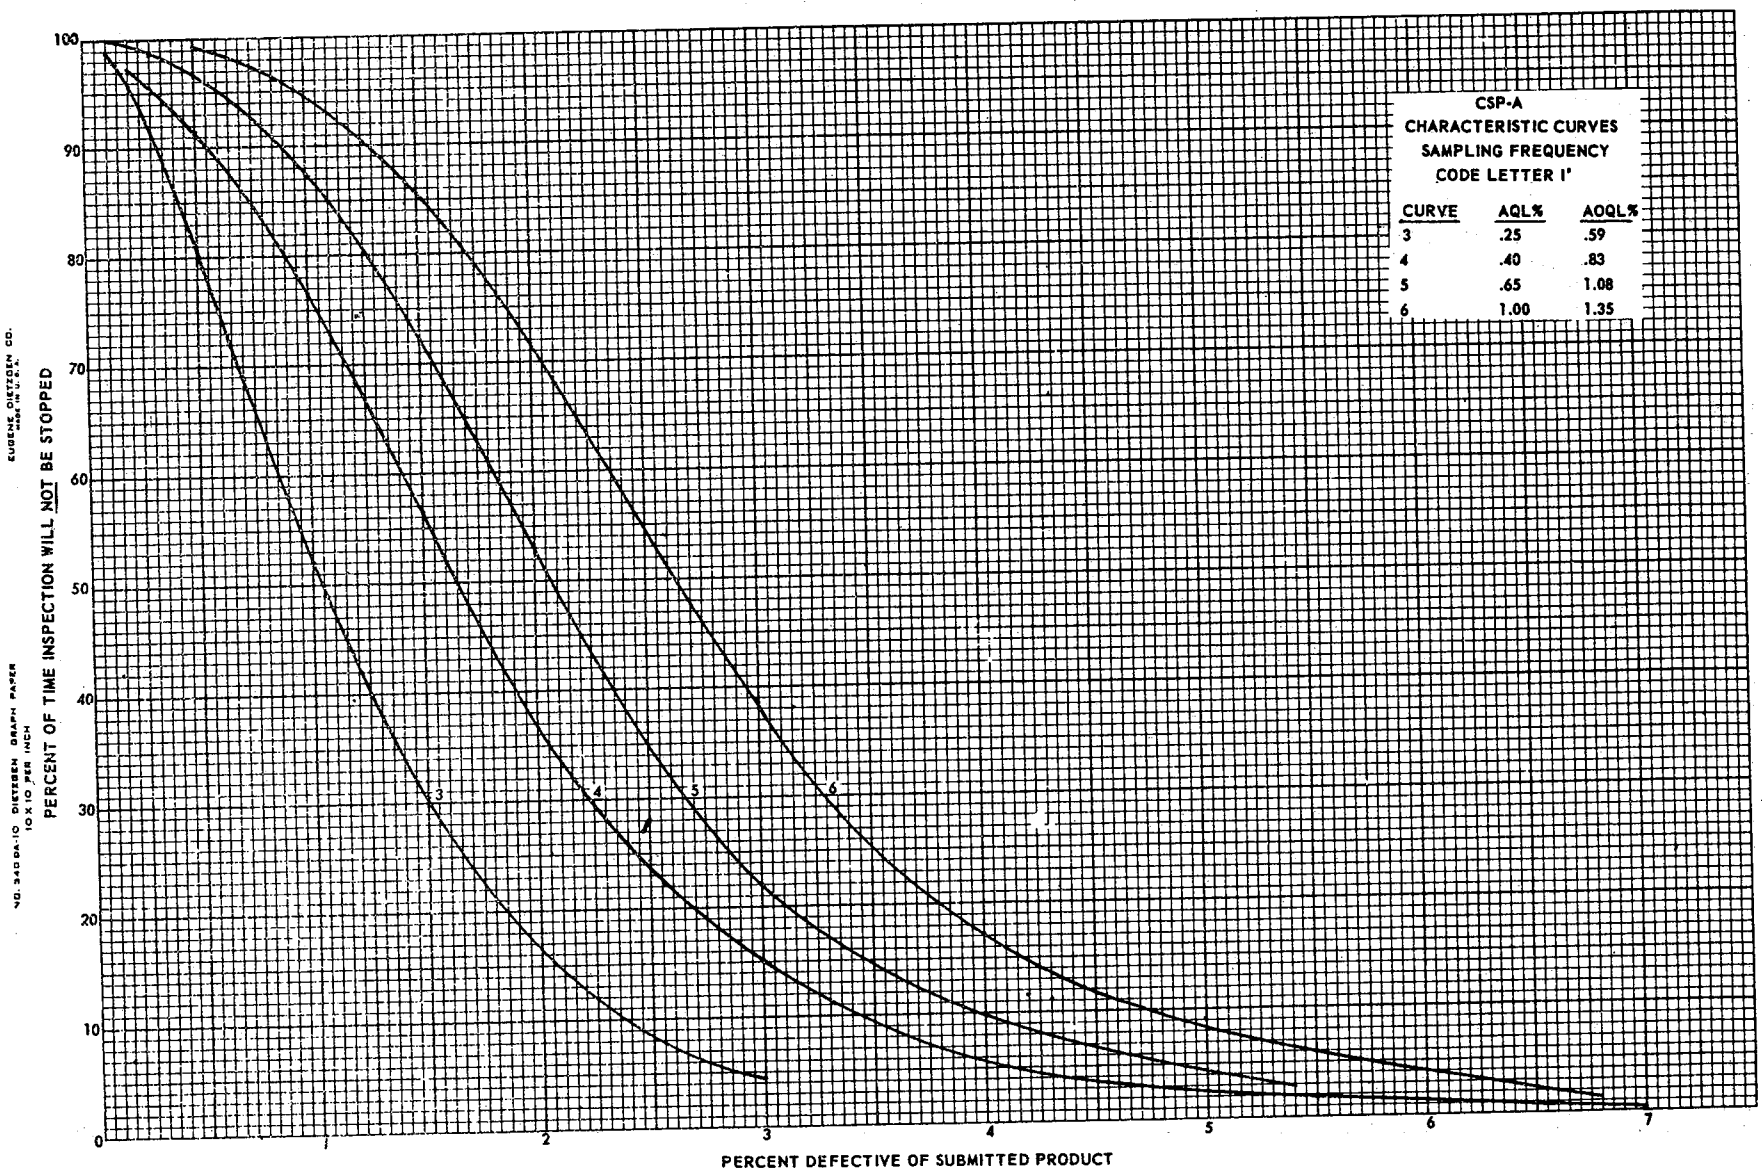


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

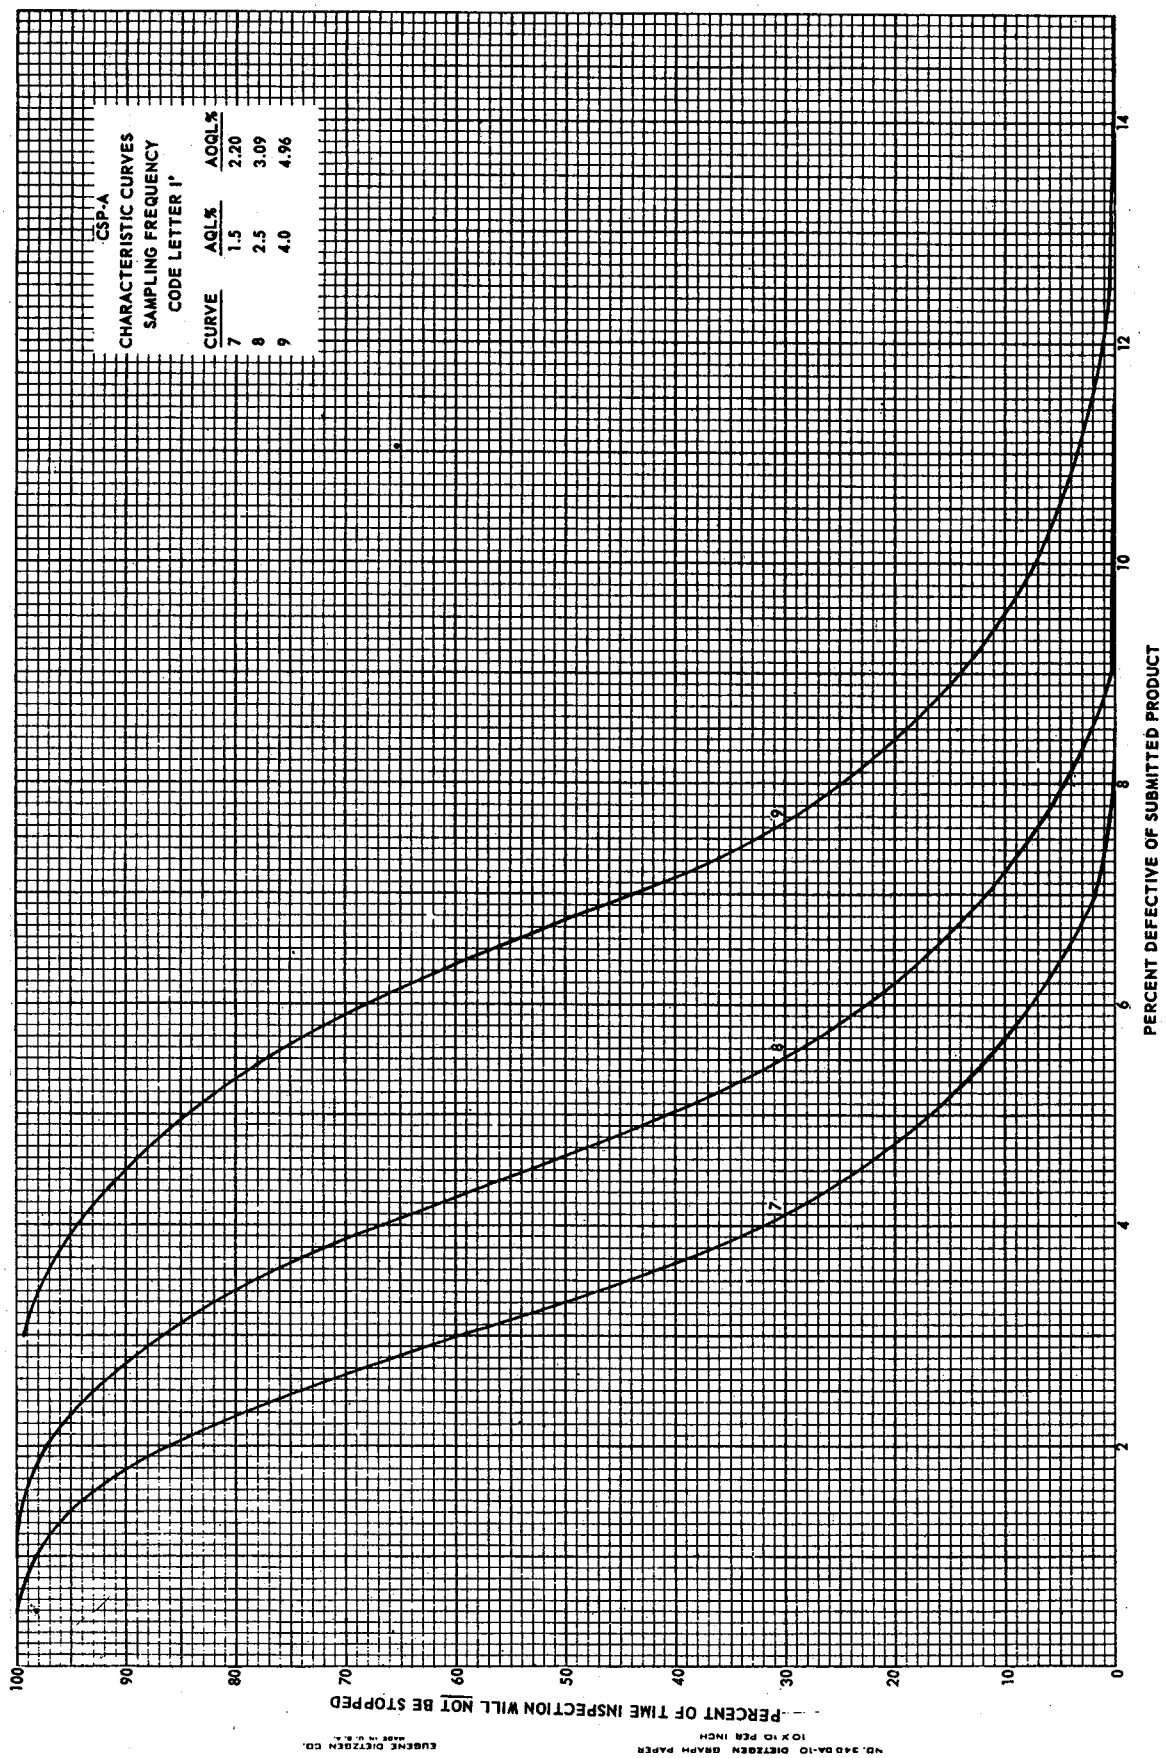

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

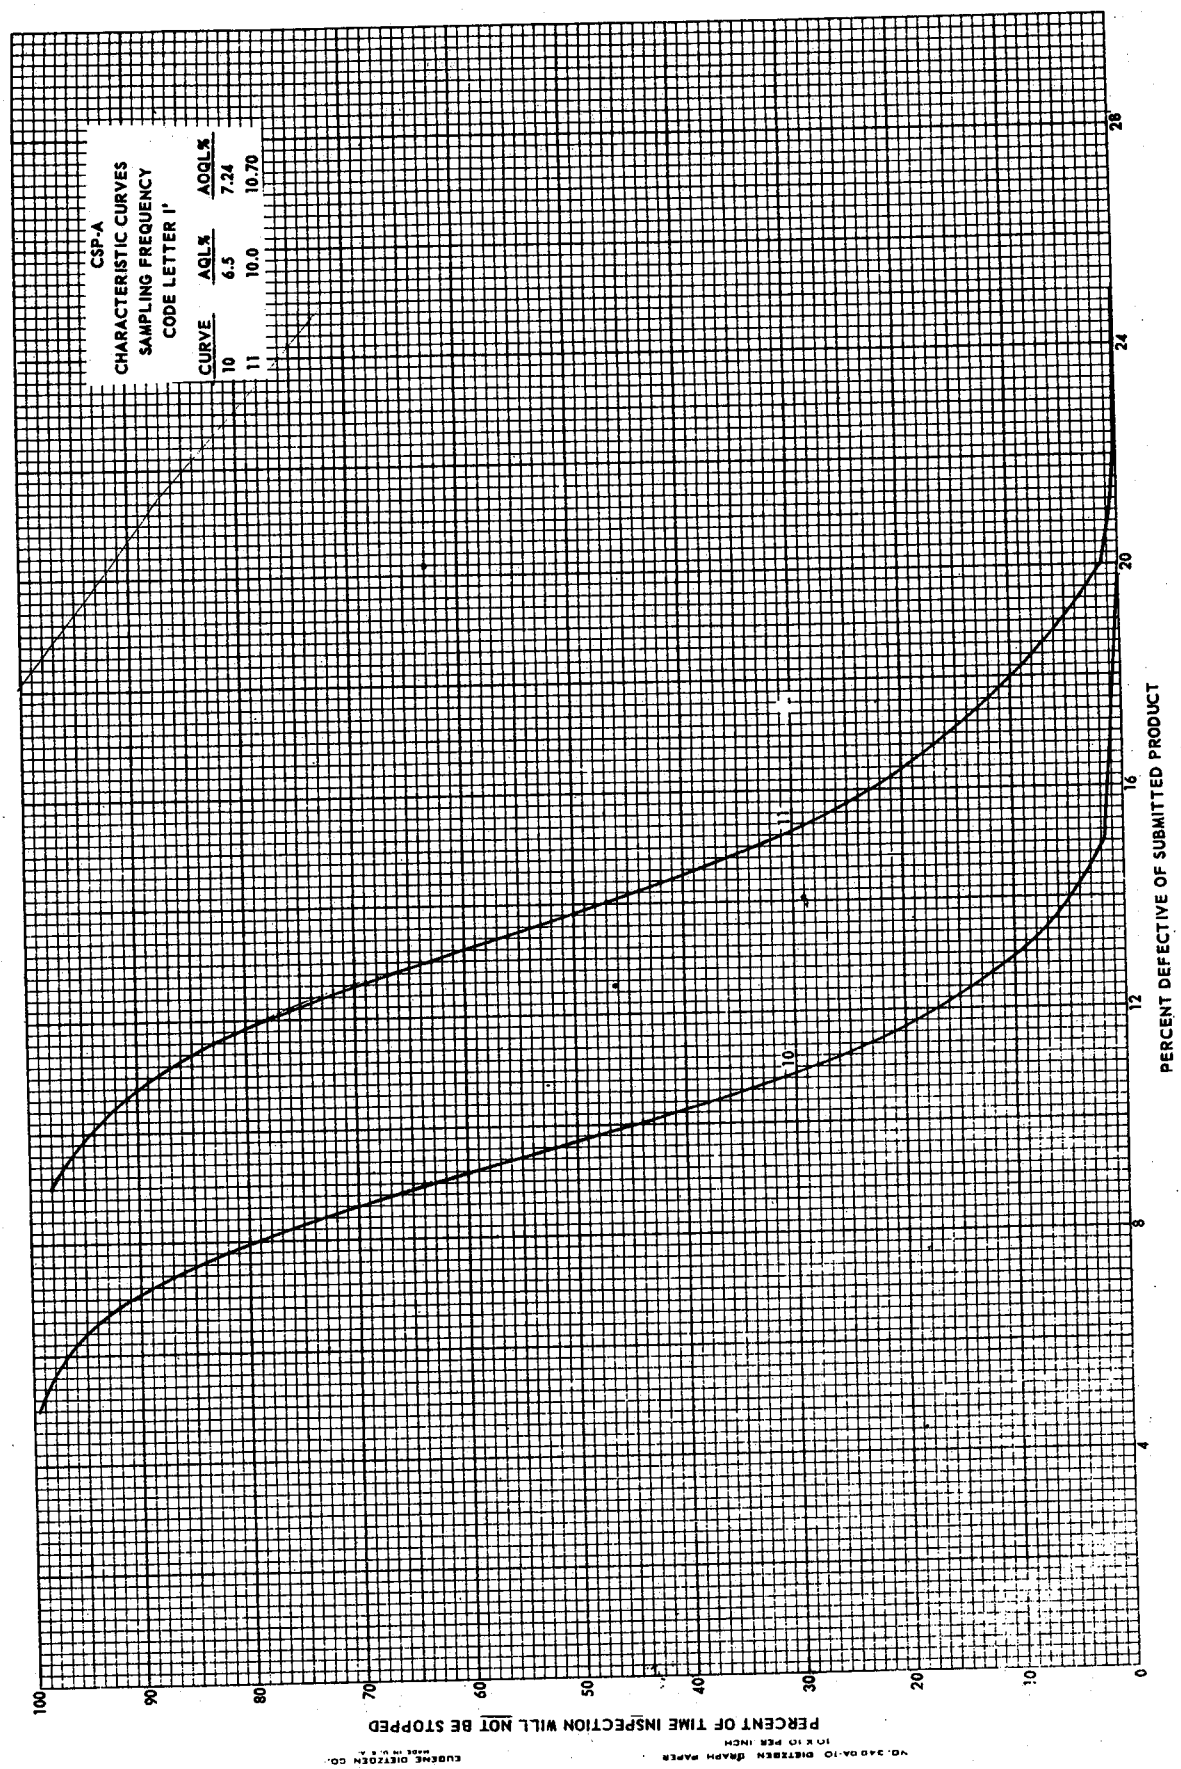


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

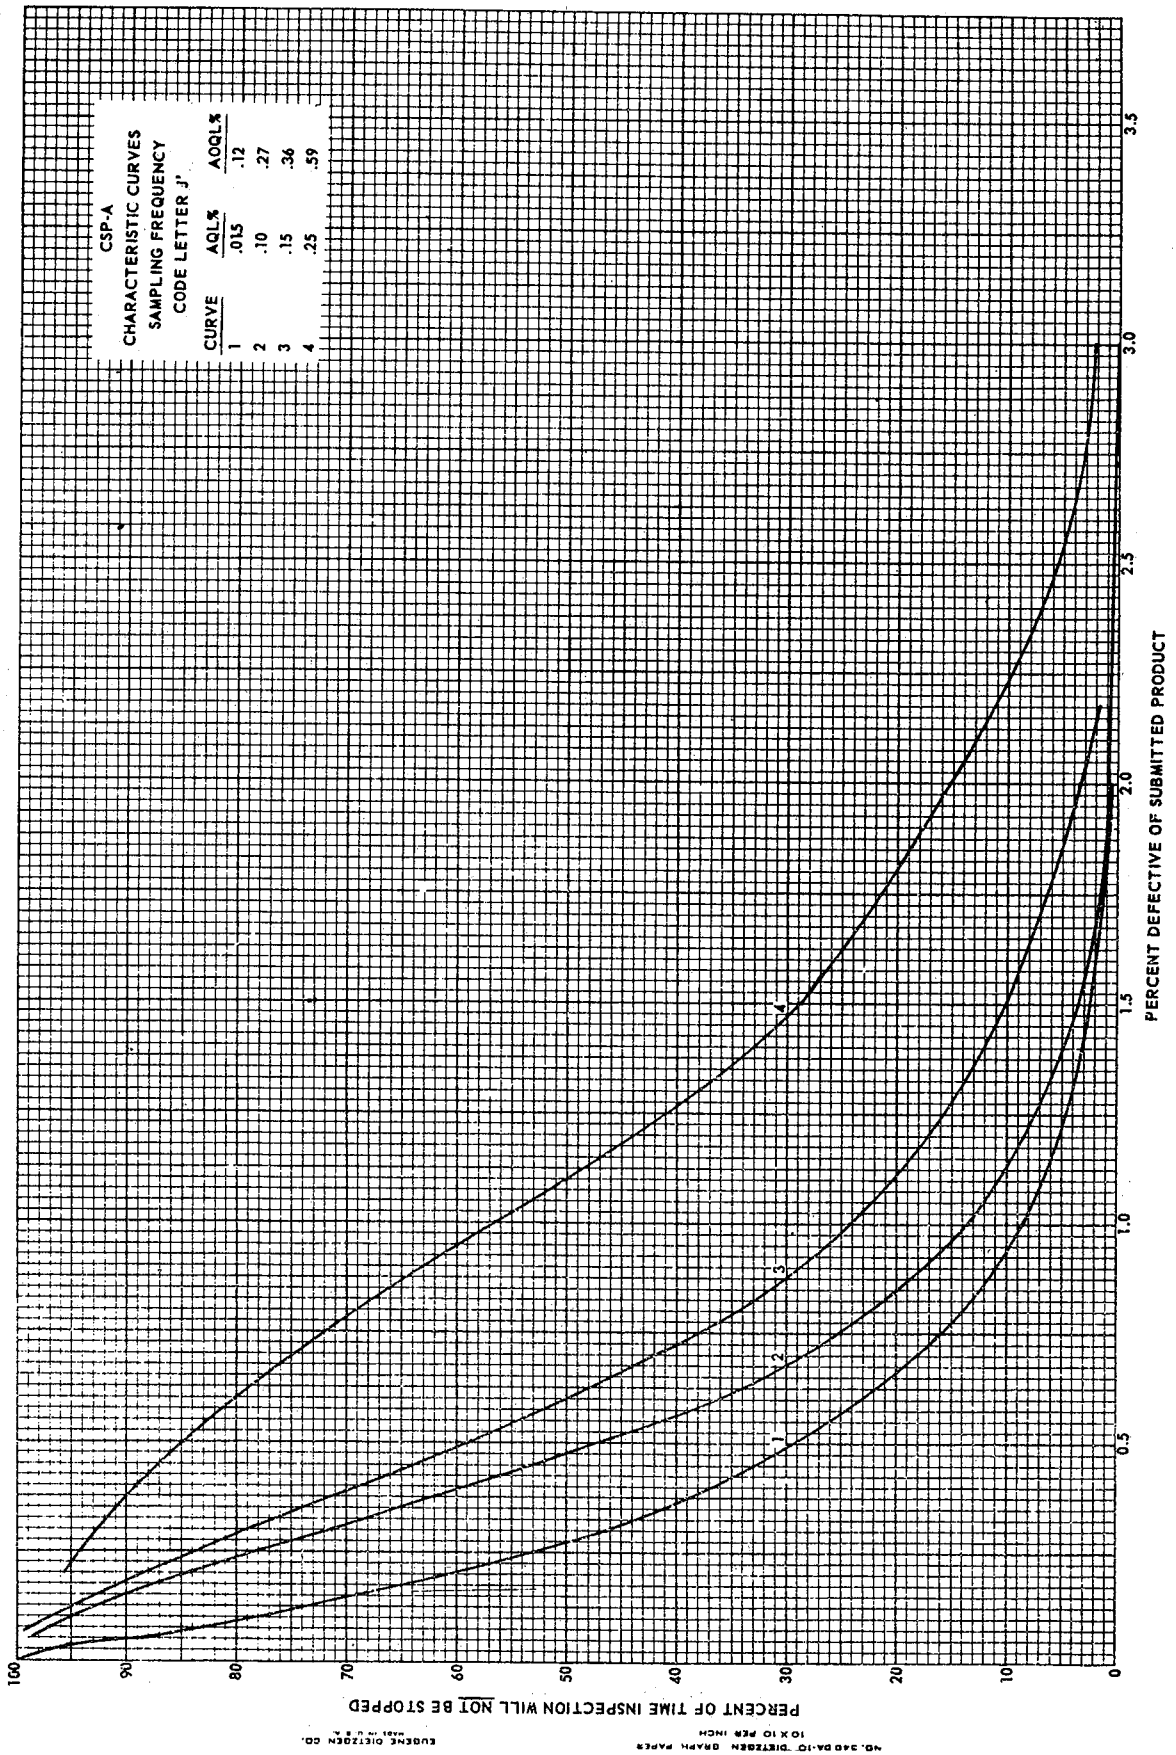


92

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

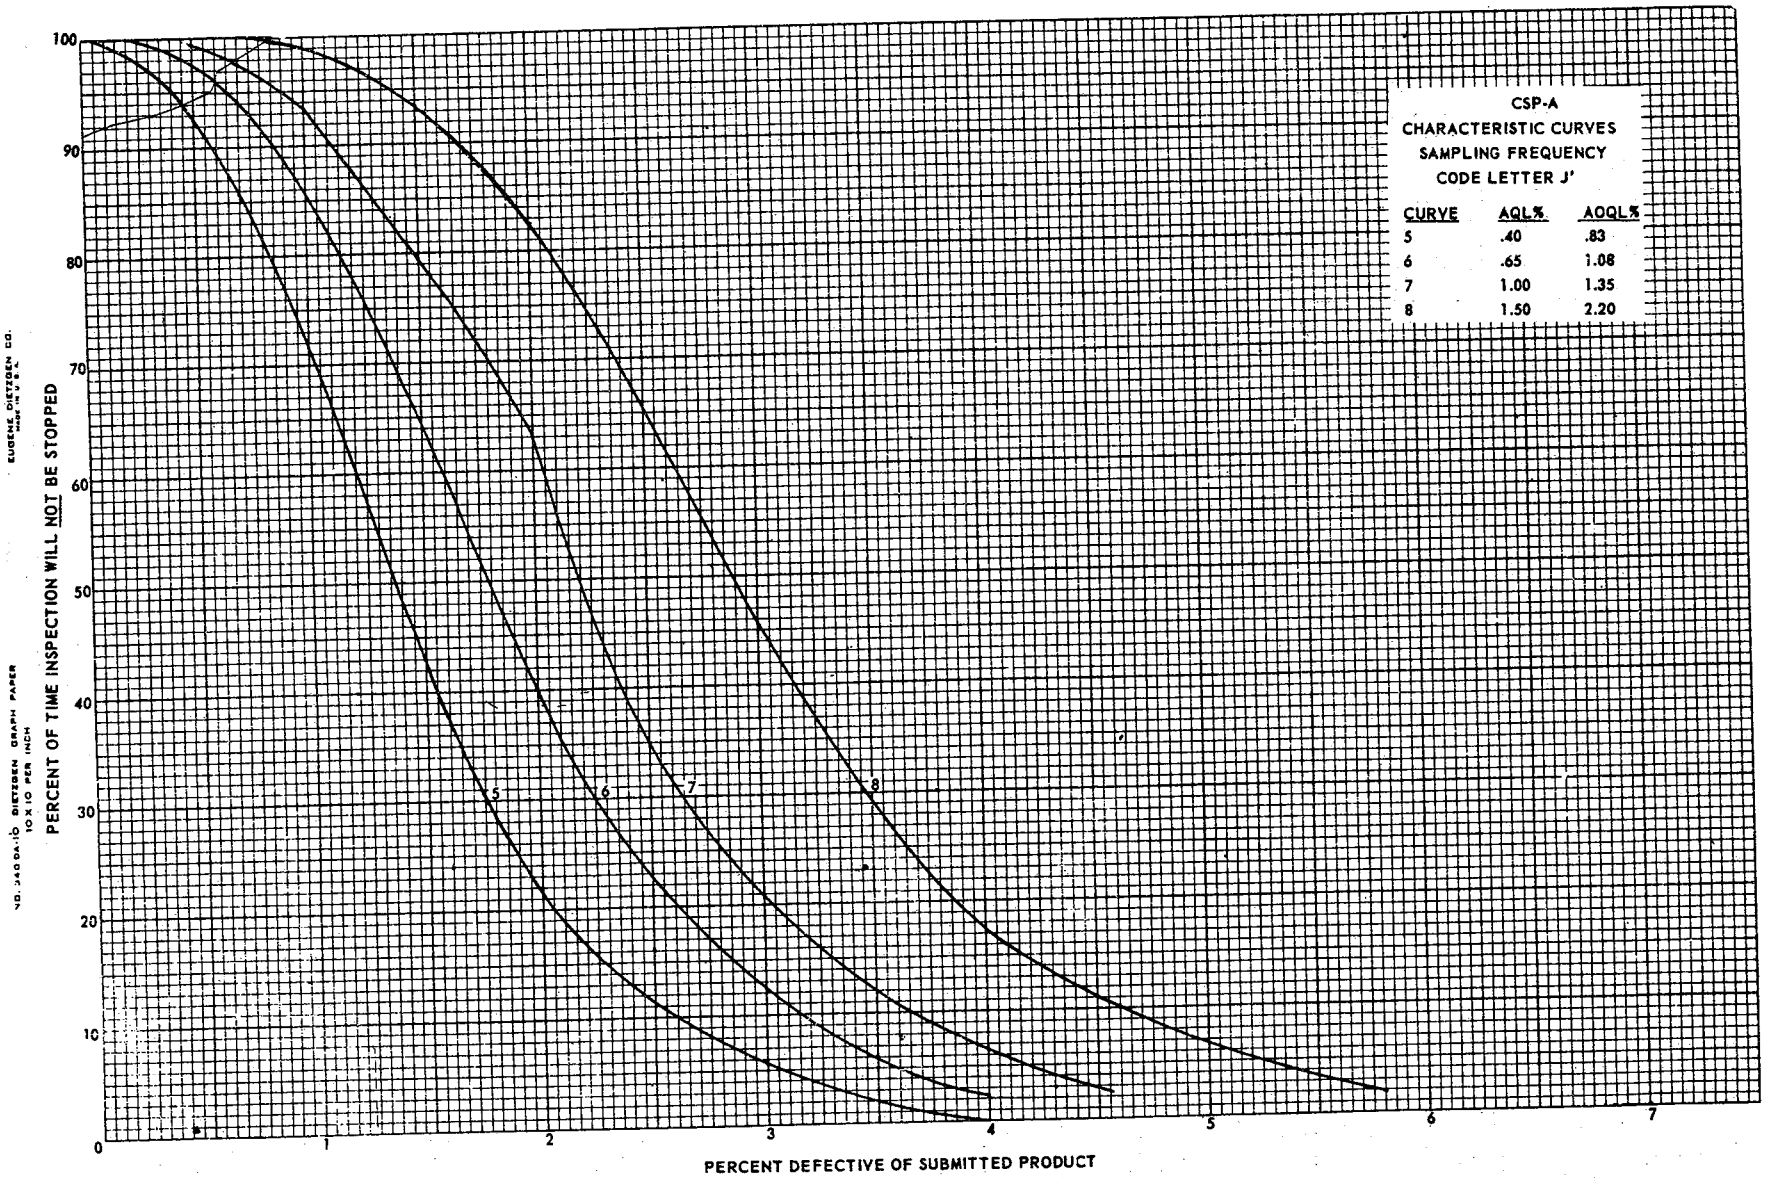


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

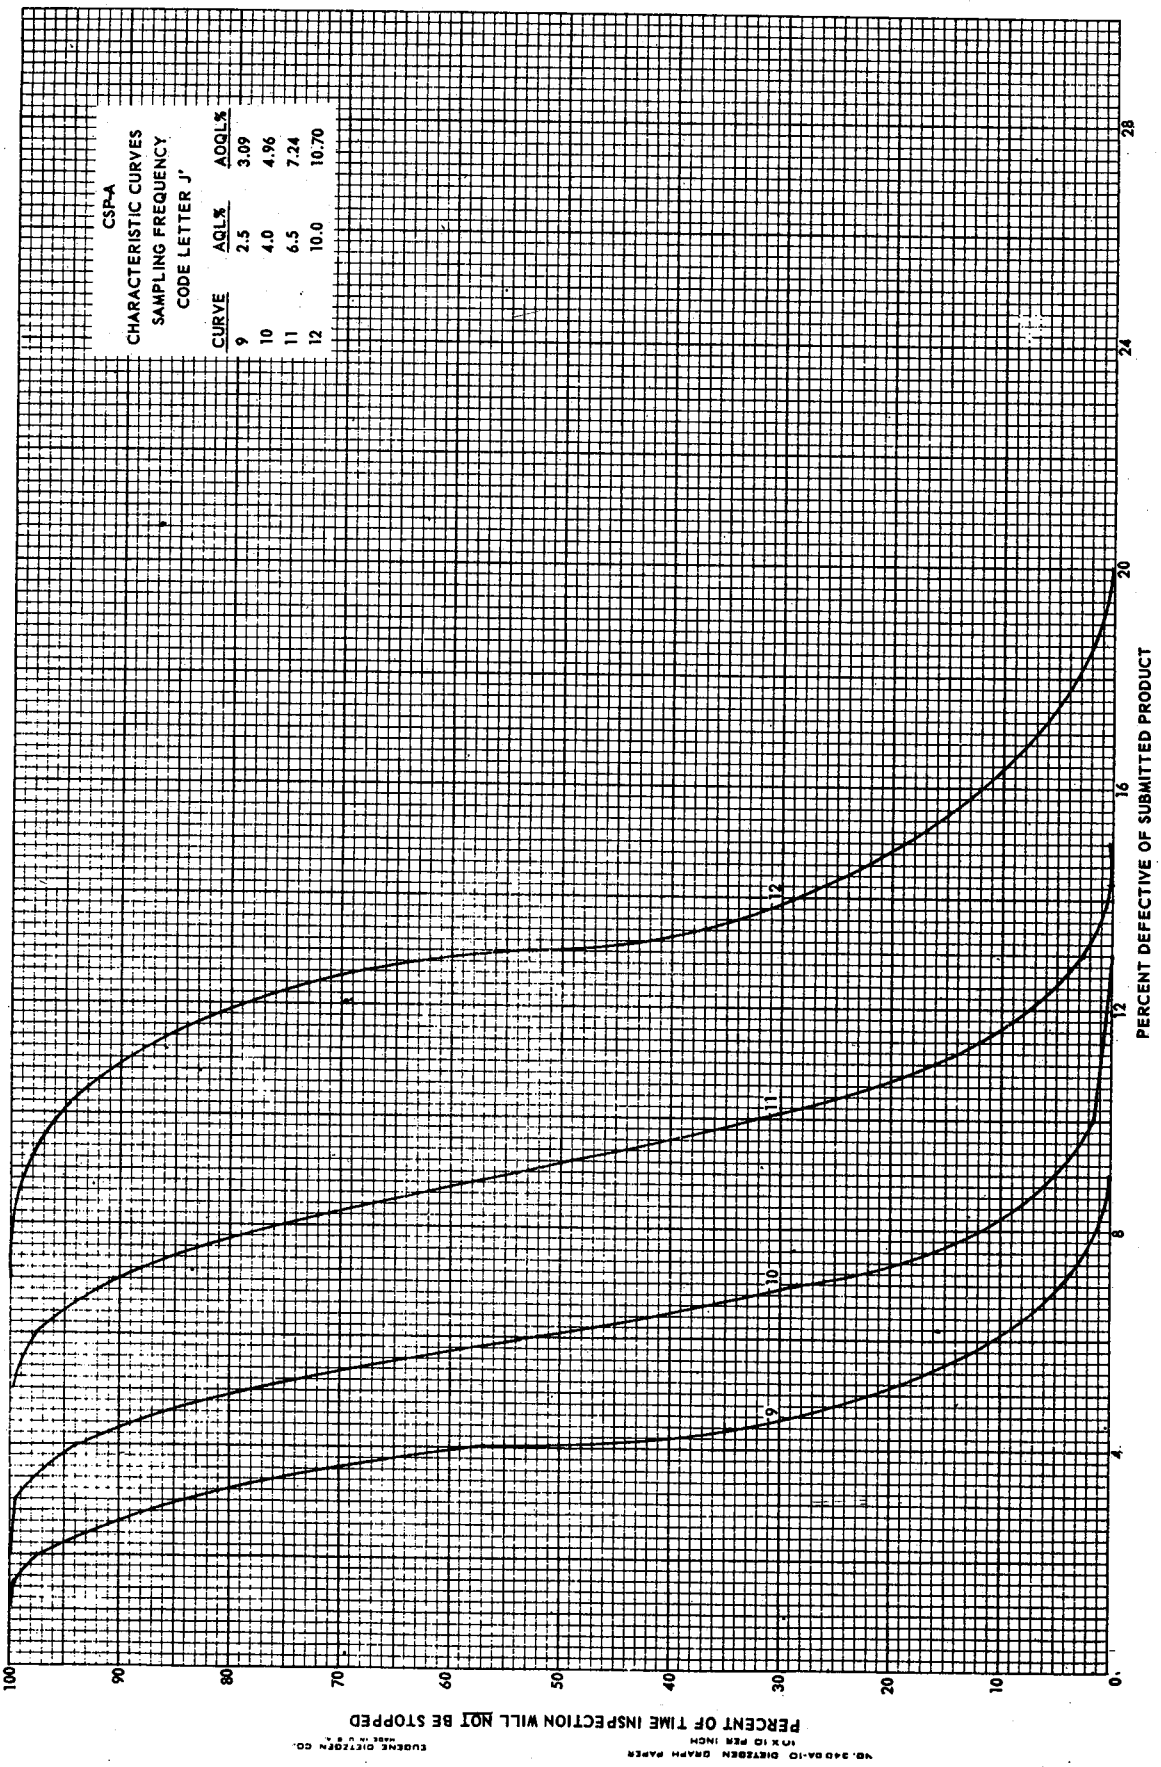


94

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

95

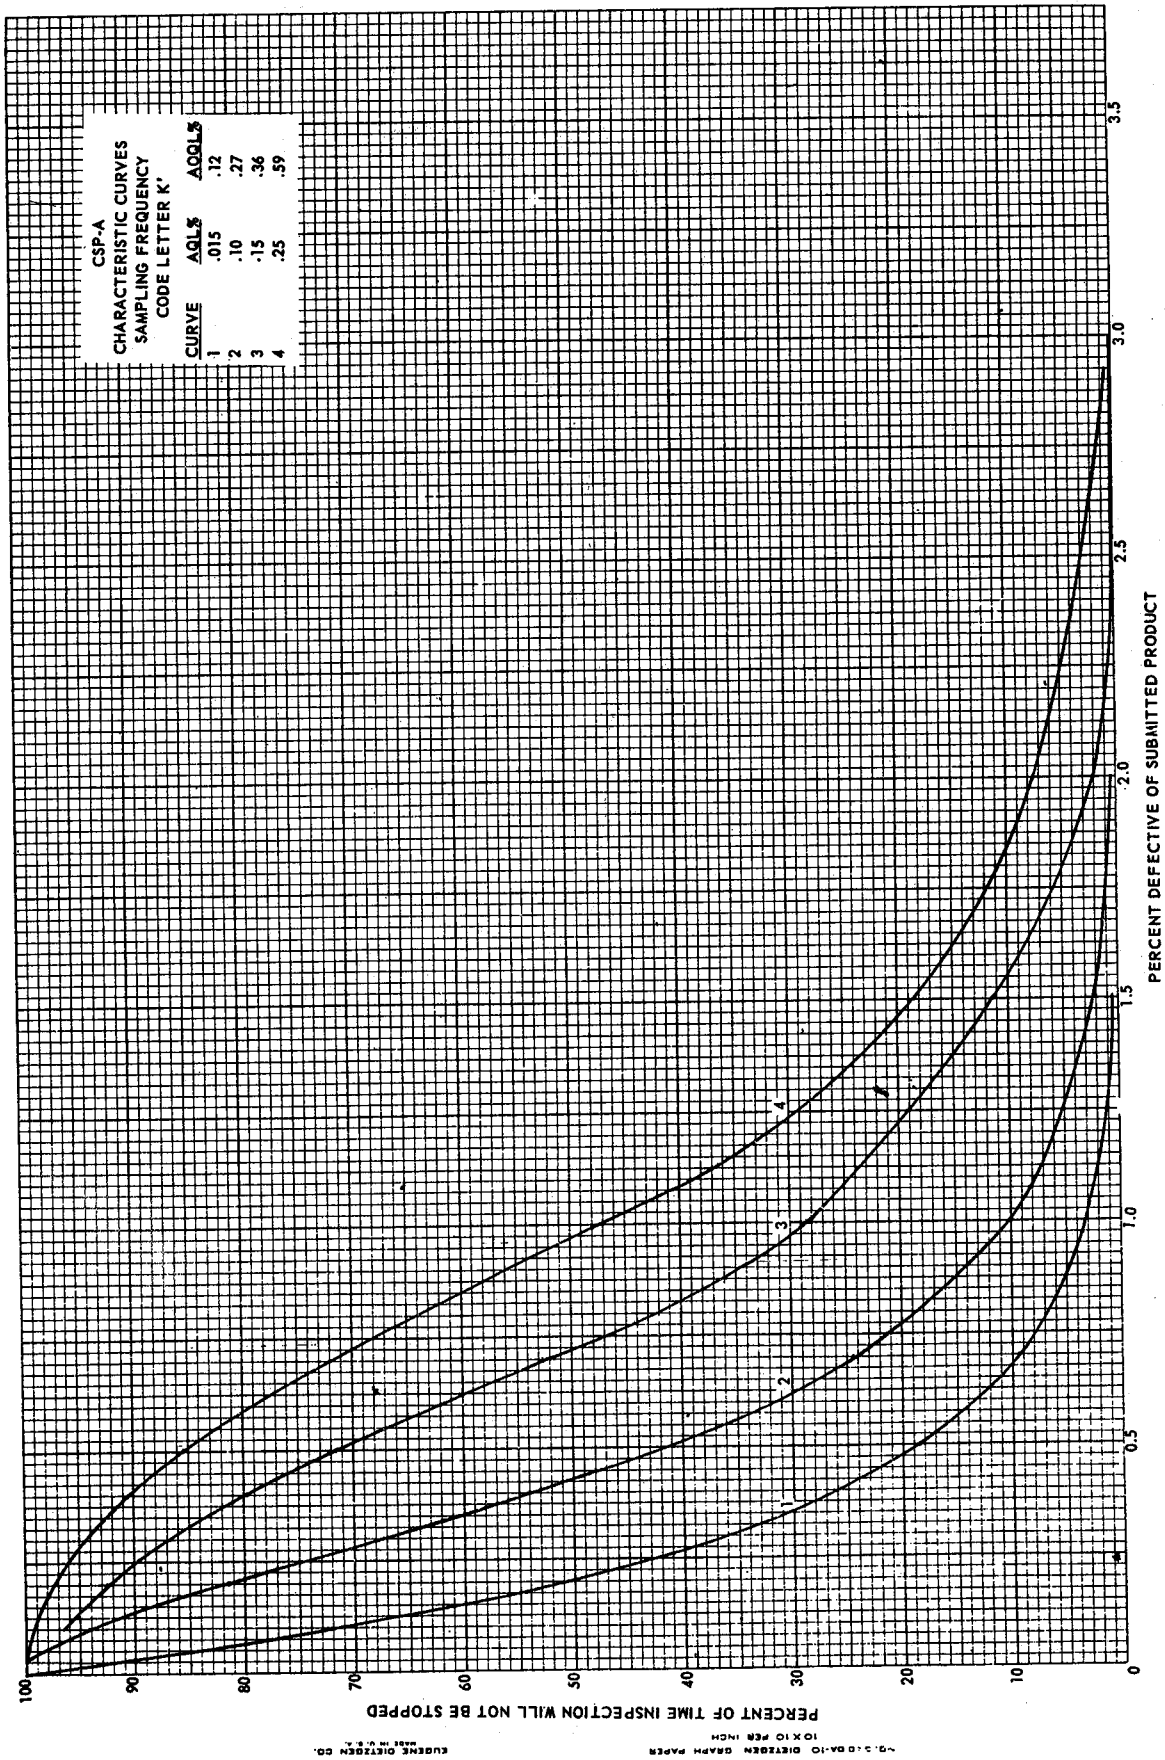


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

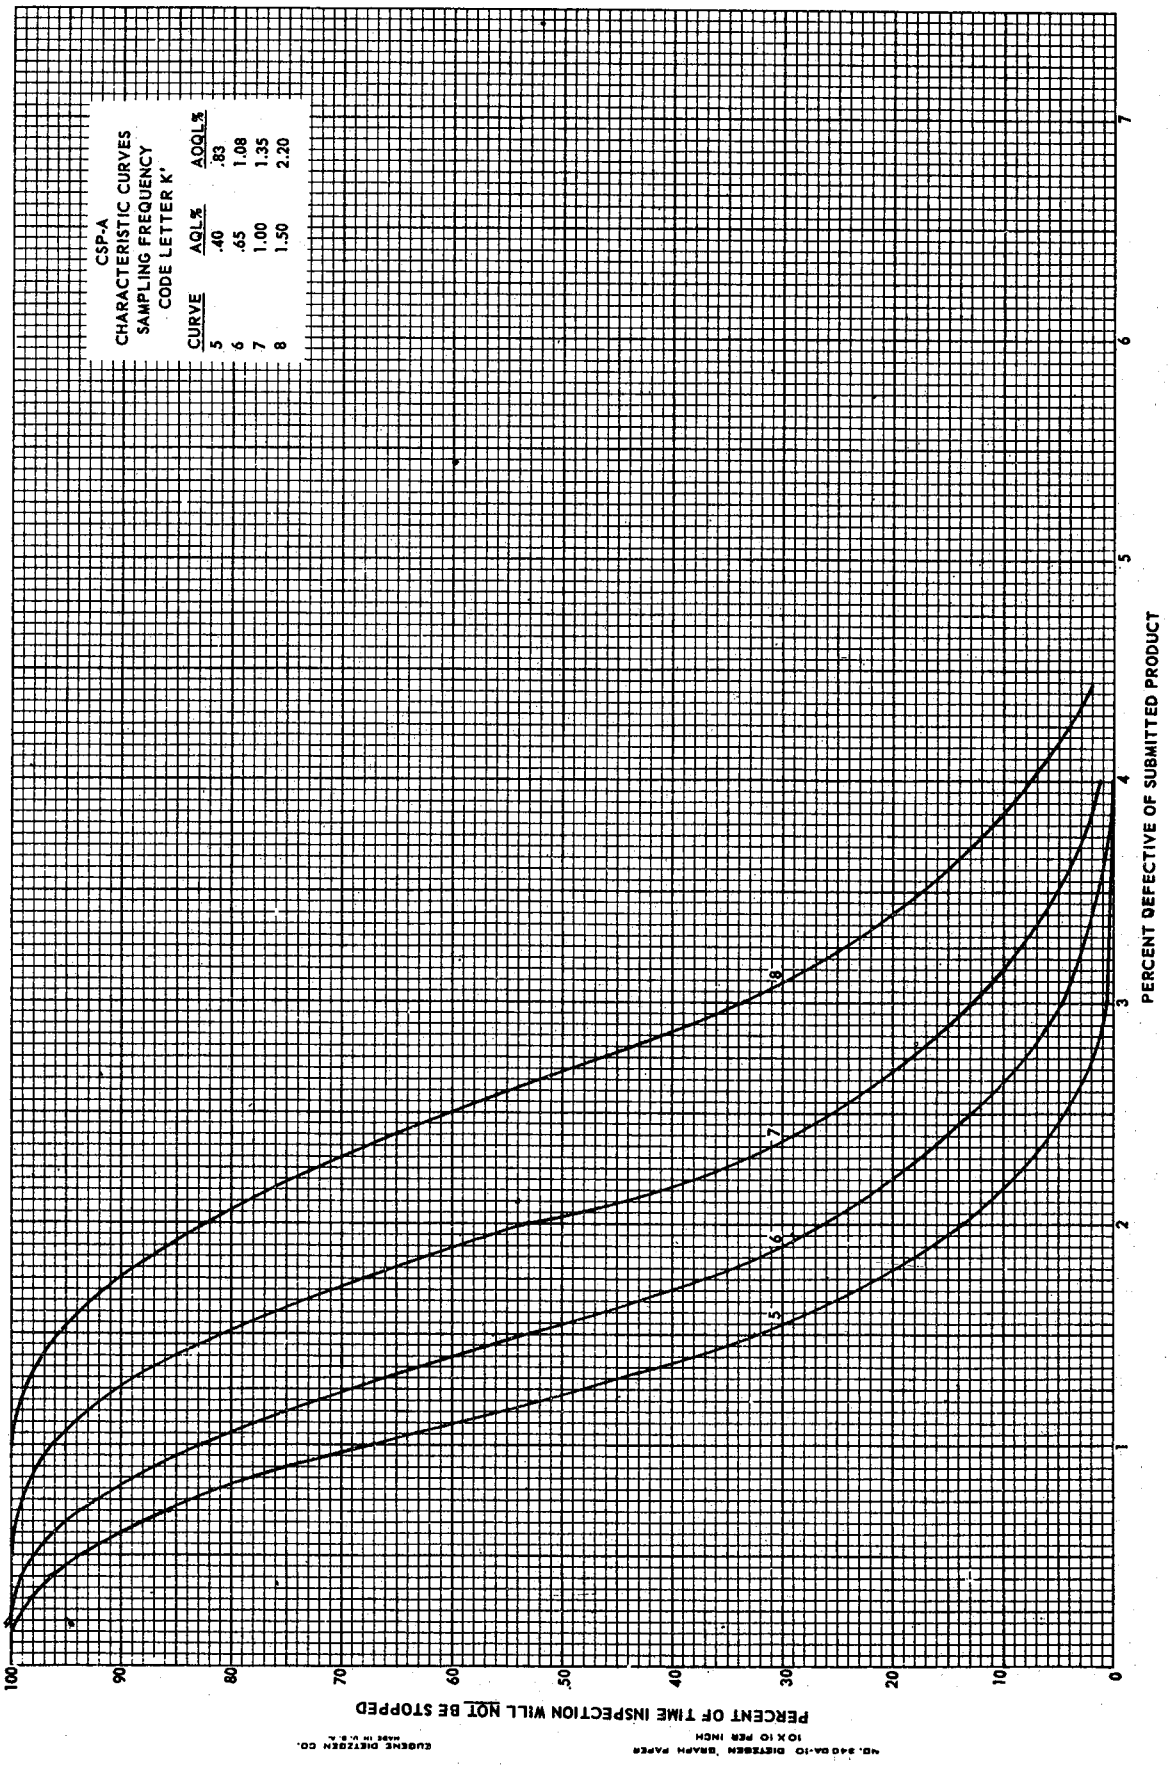


94

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

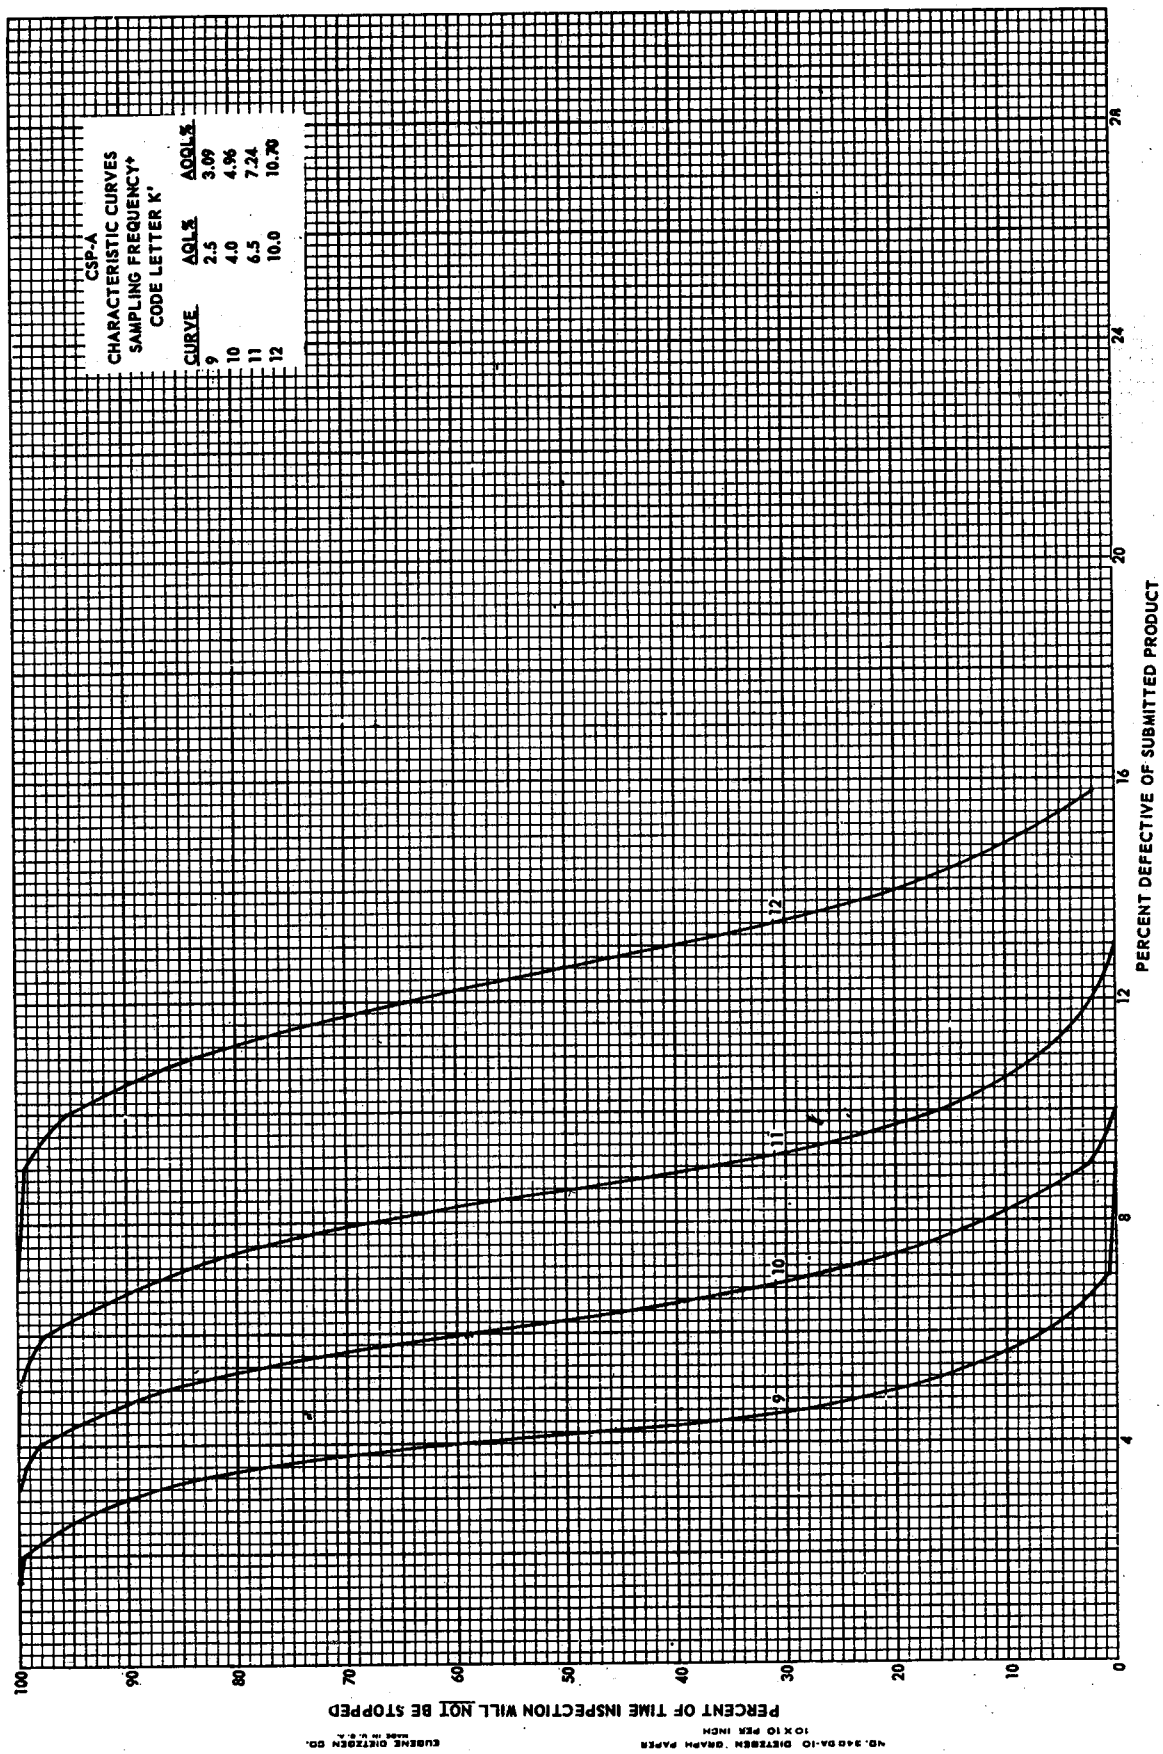


9-7


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

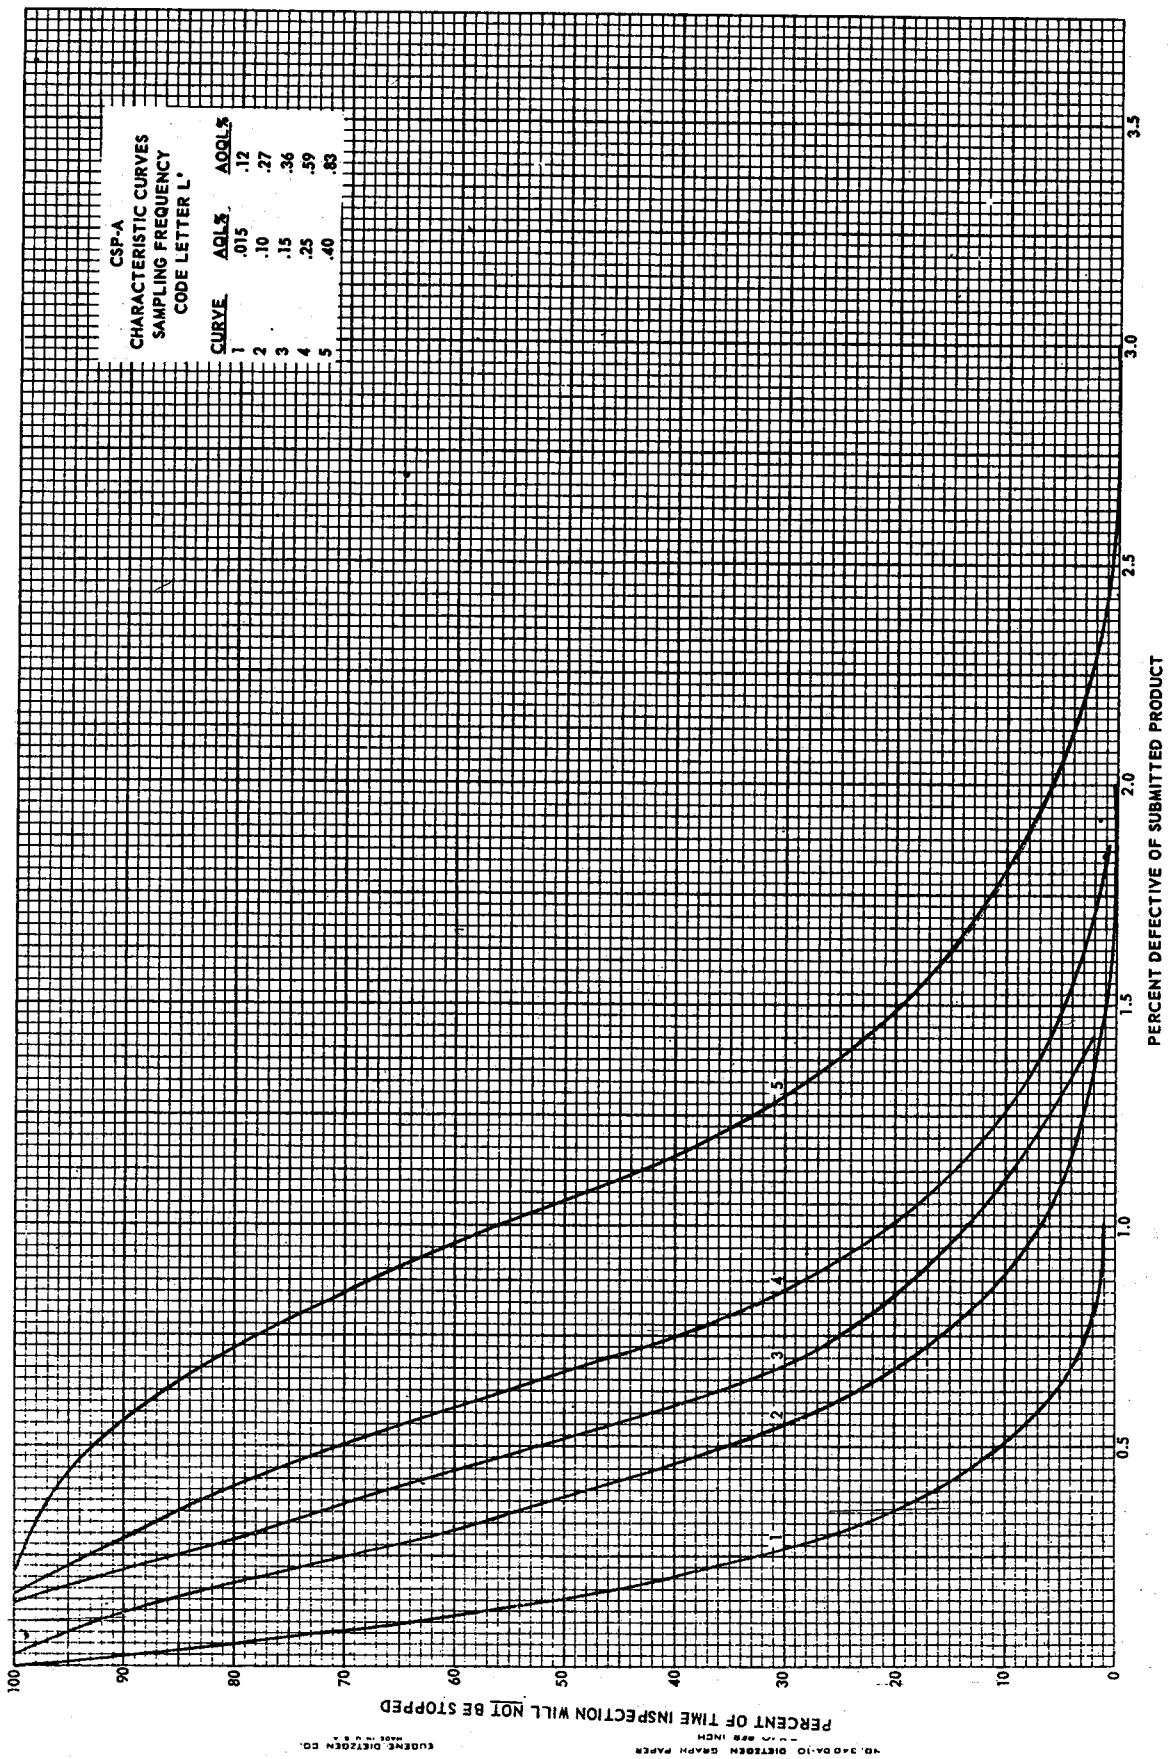


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

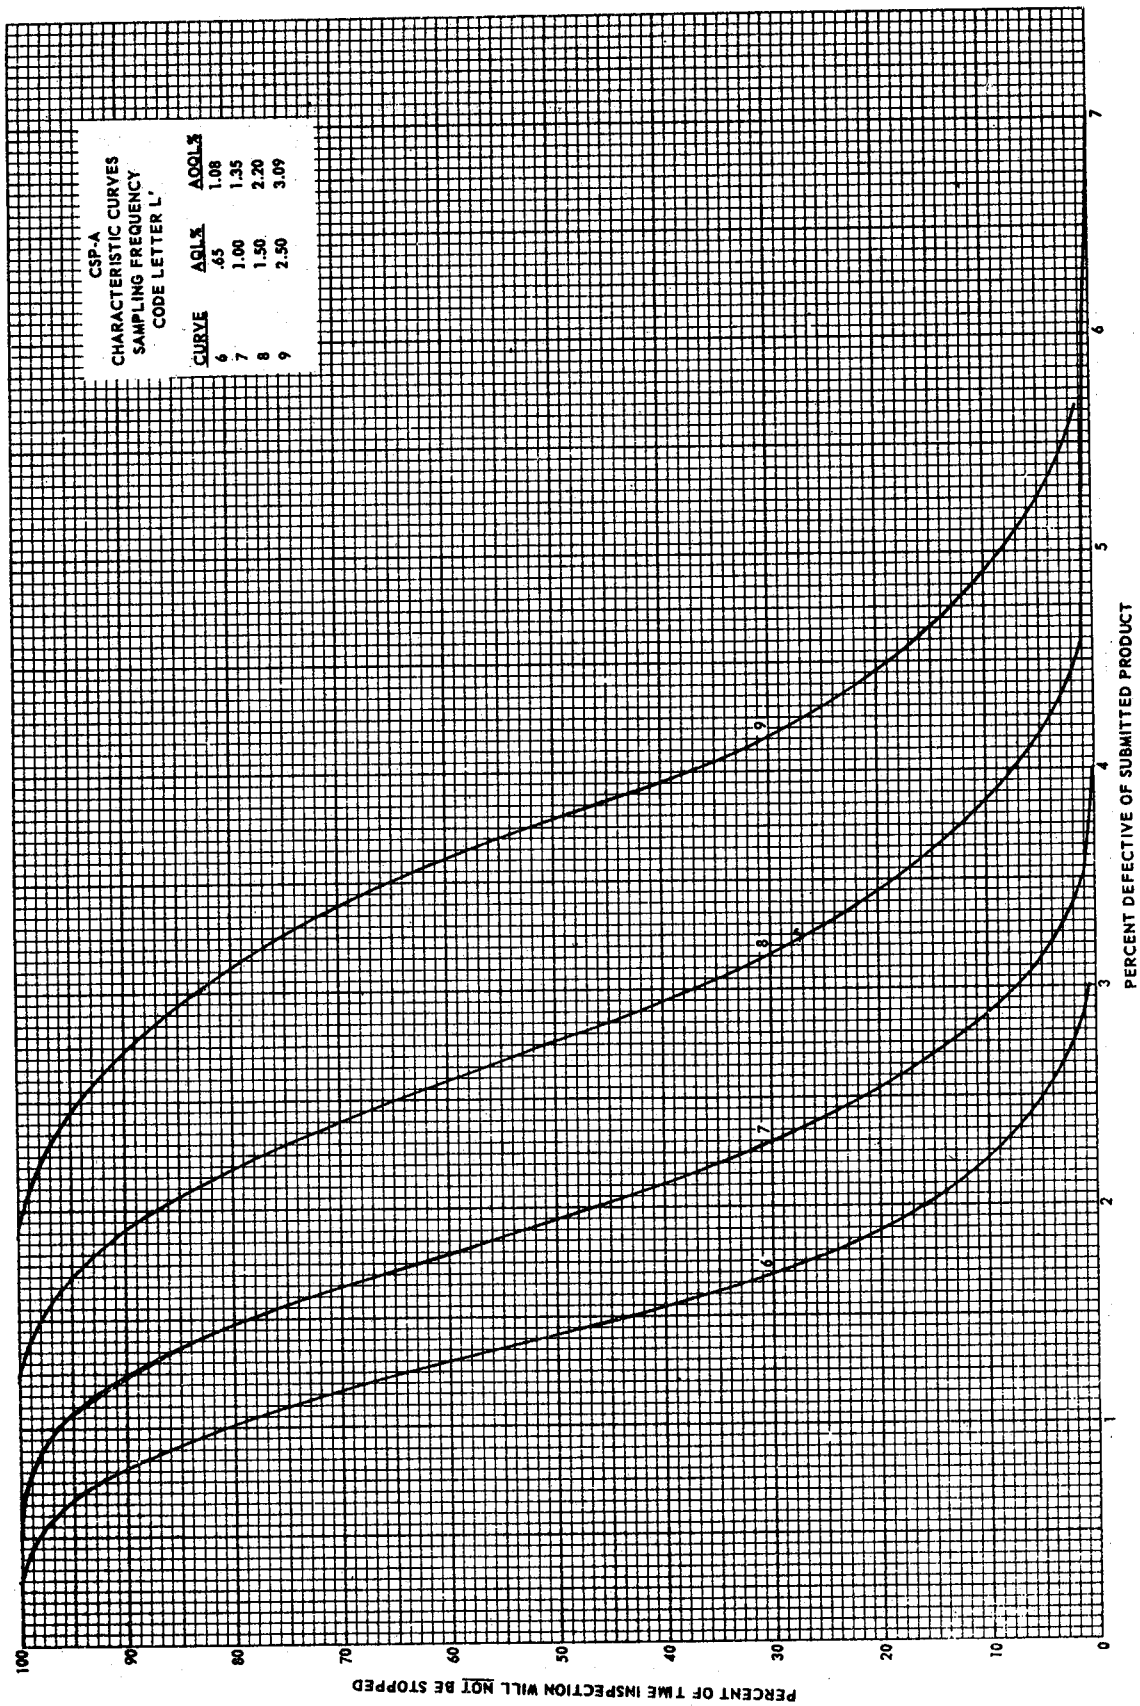


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

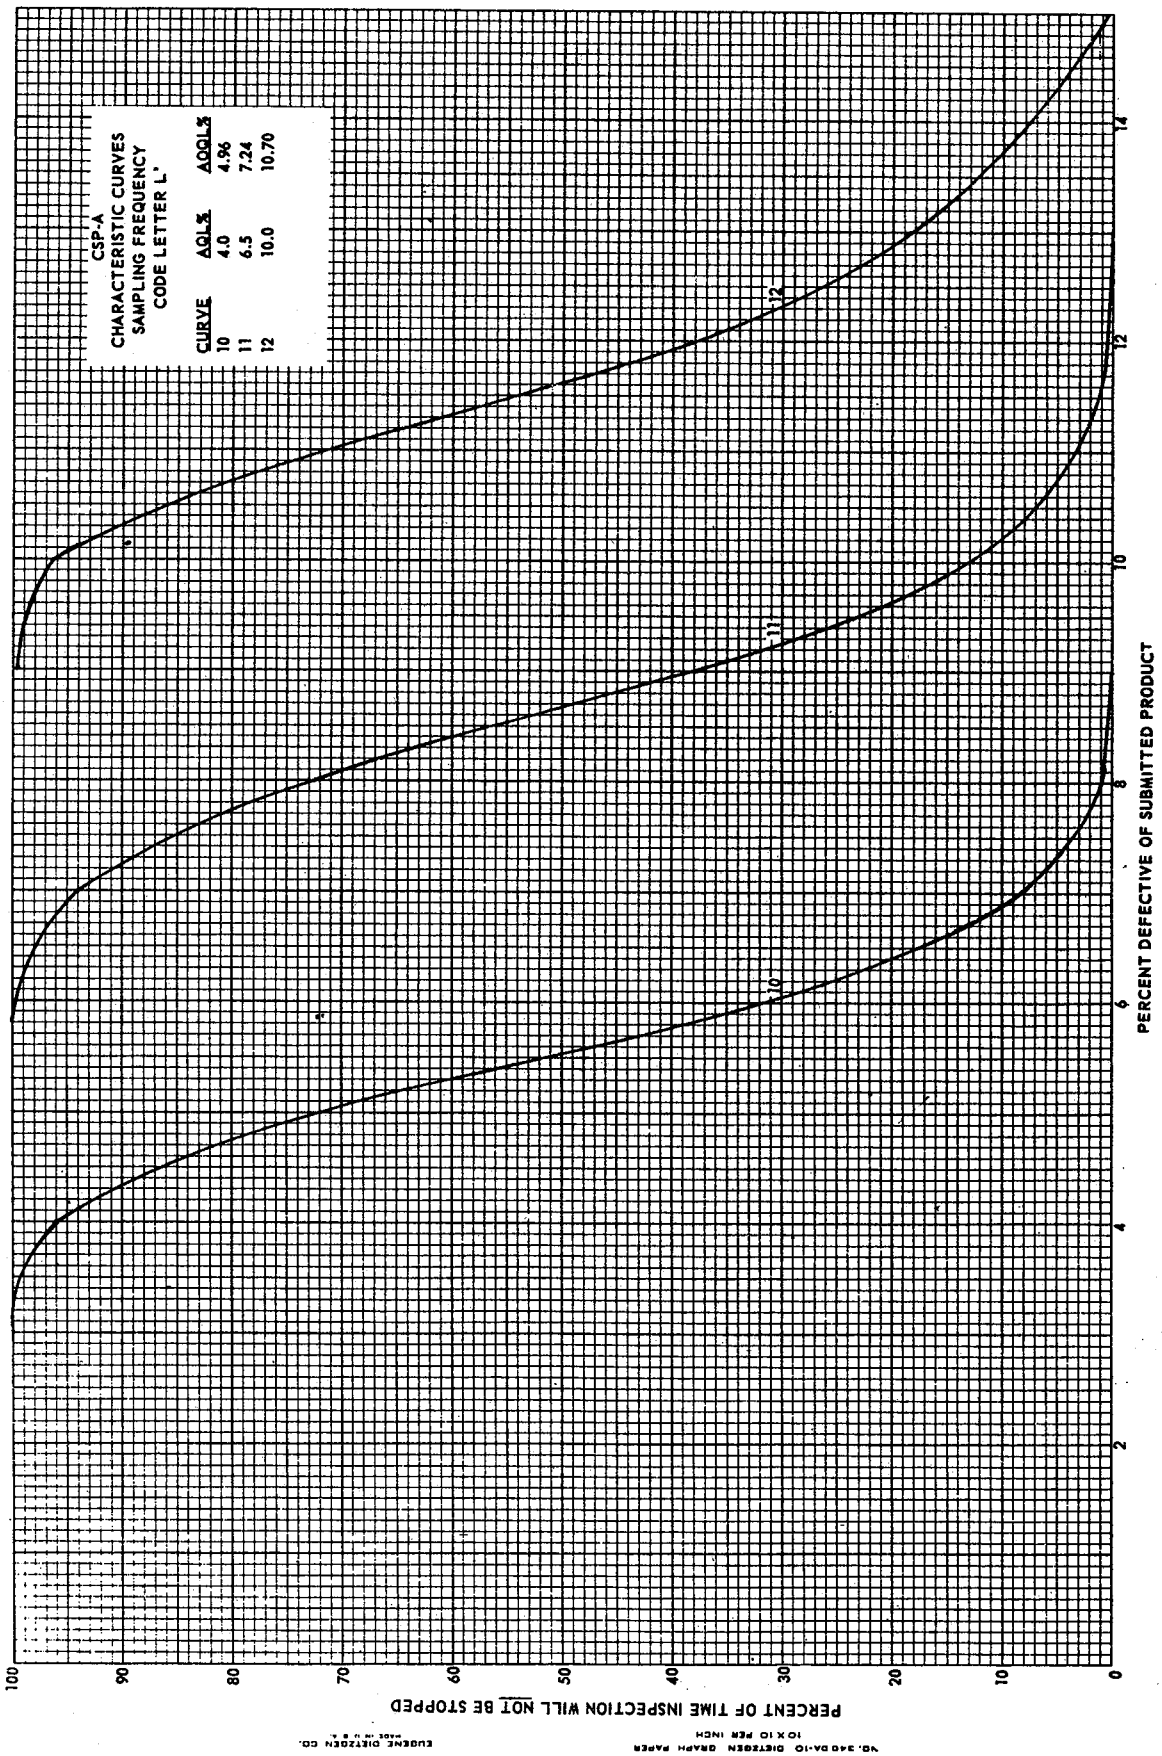

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

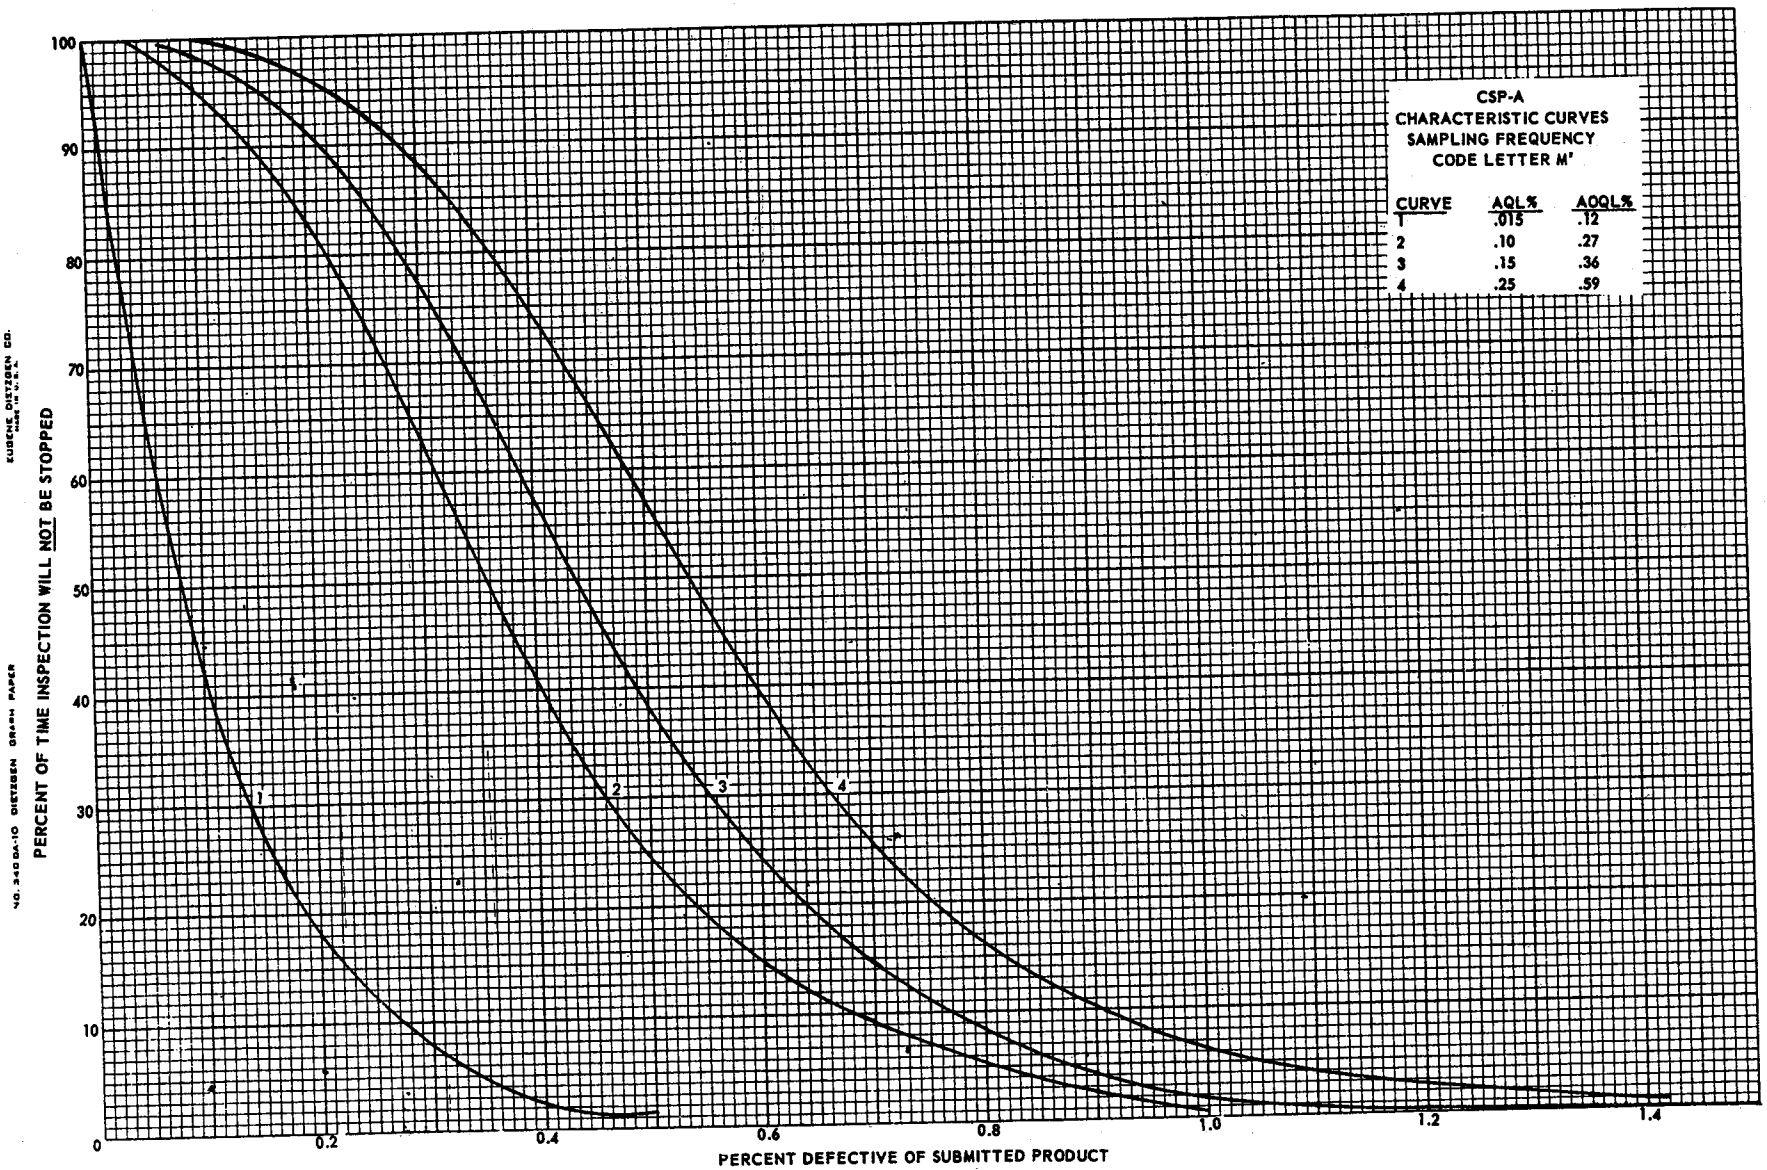


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

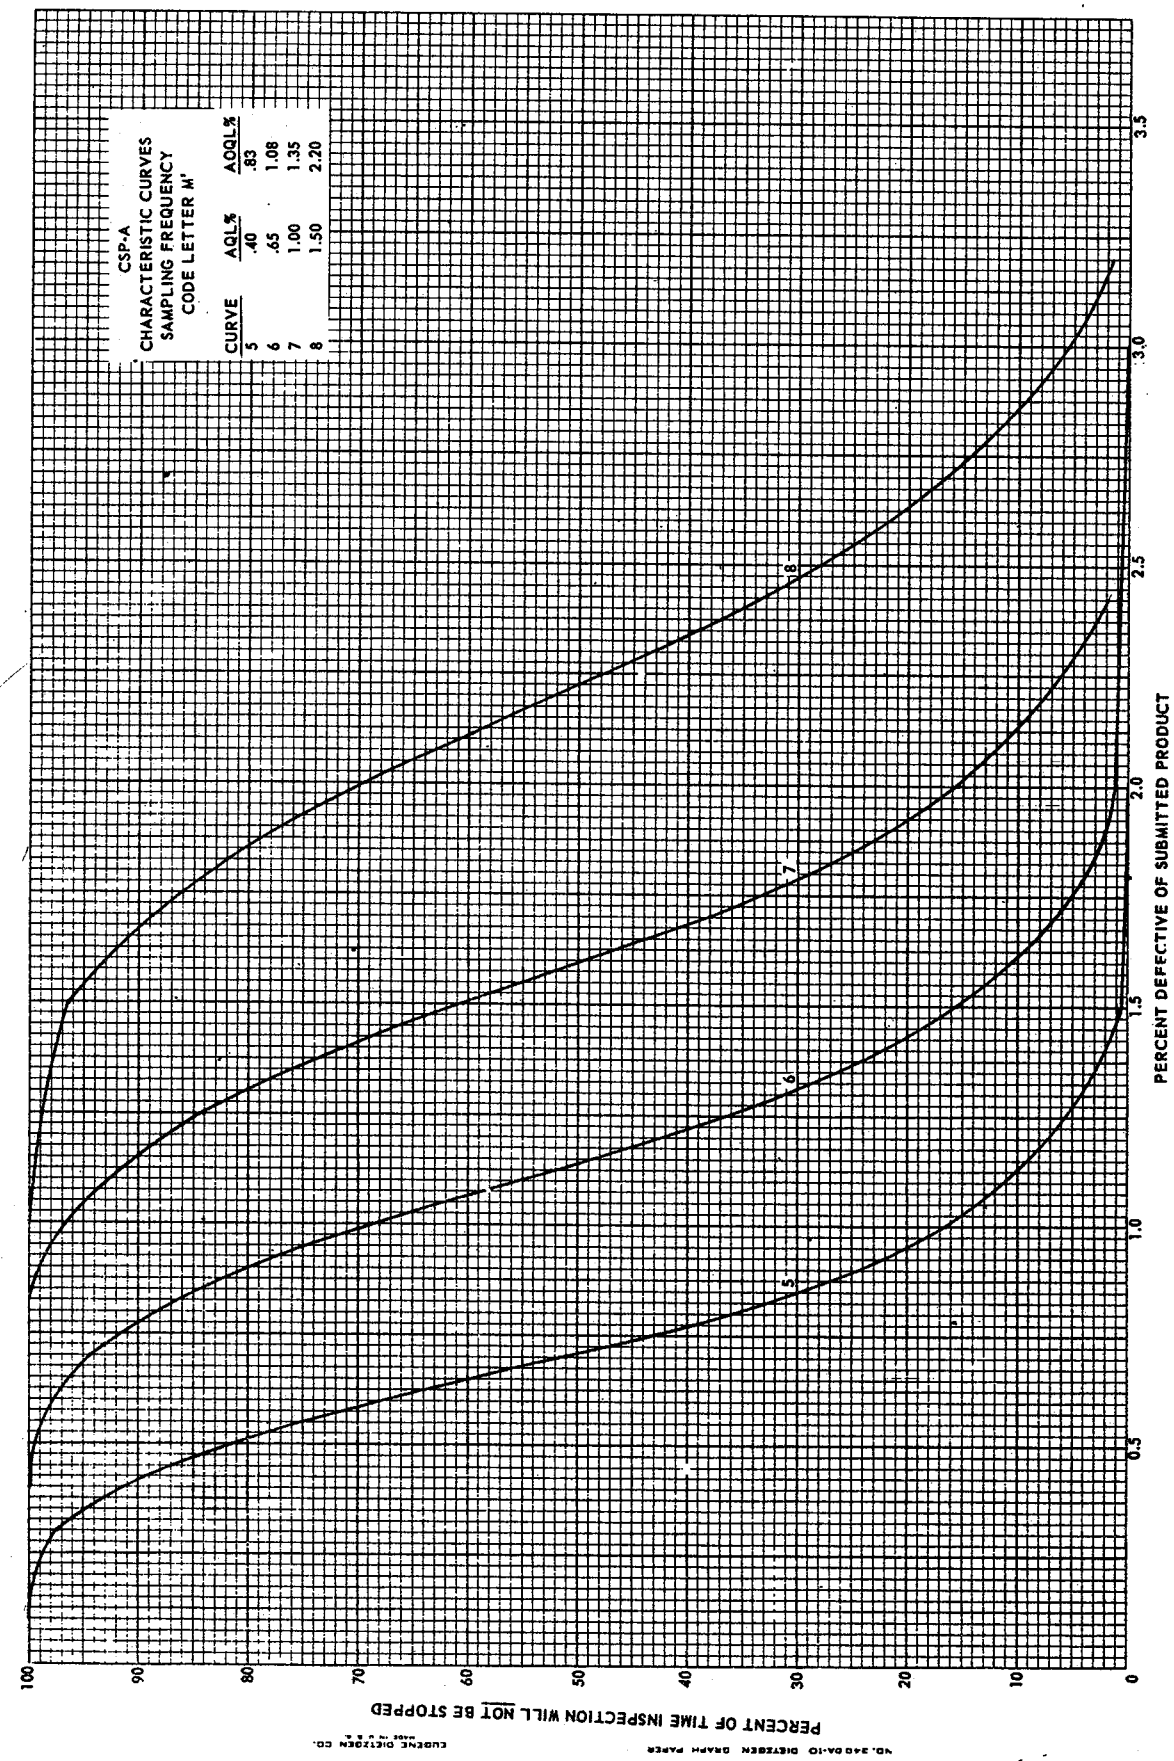


102

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

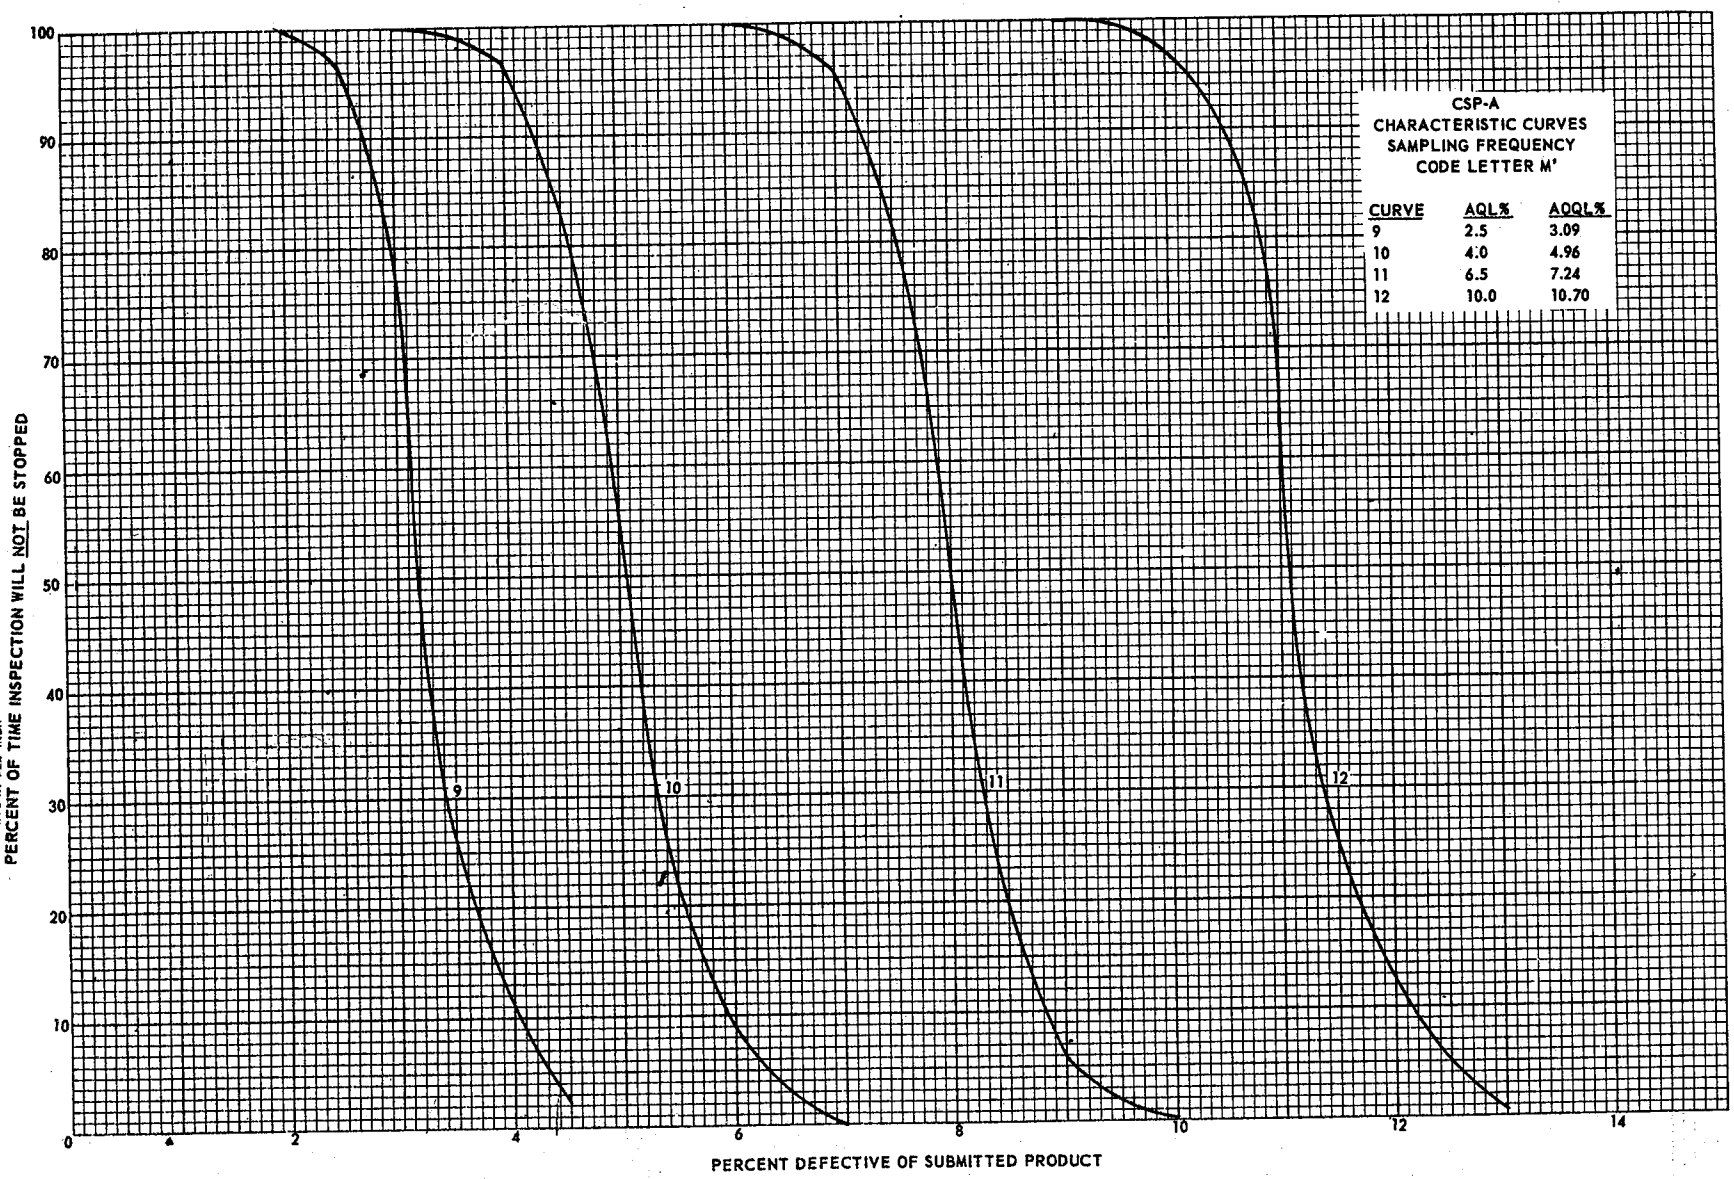


Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

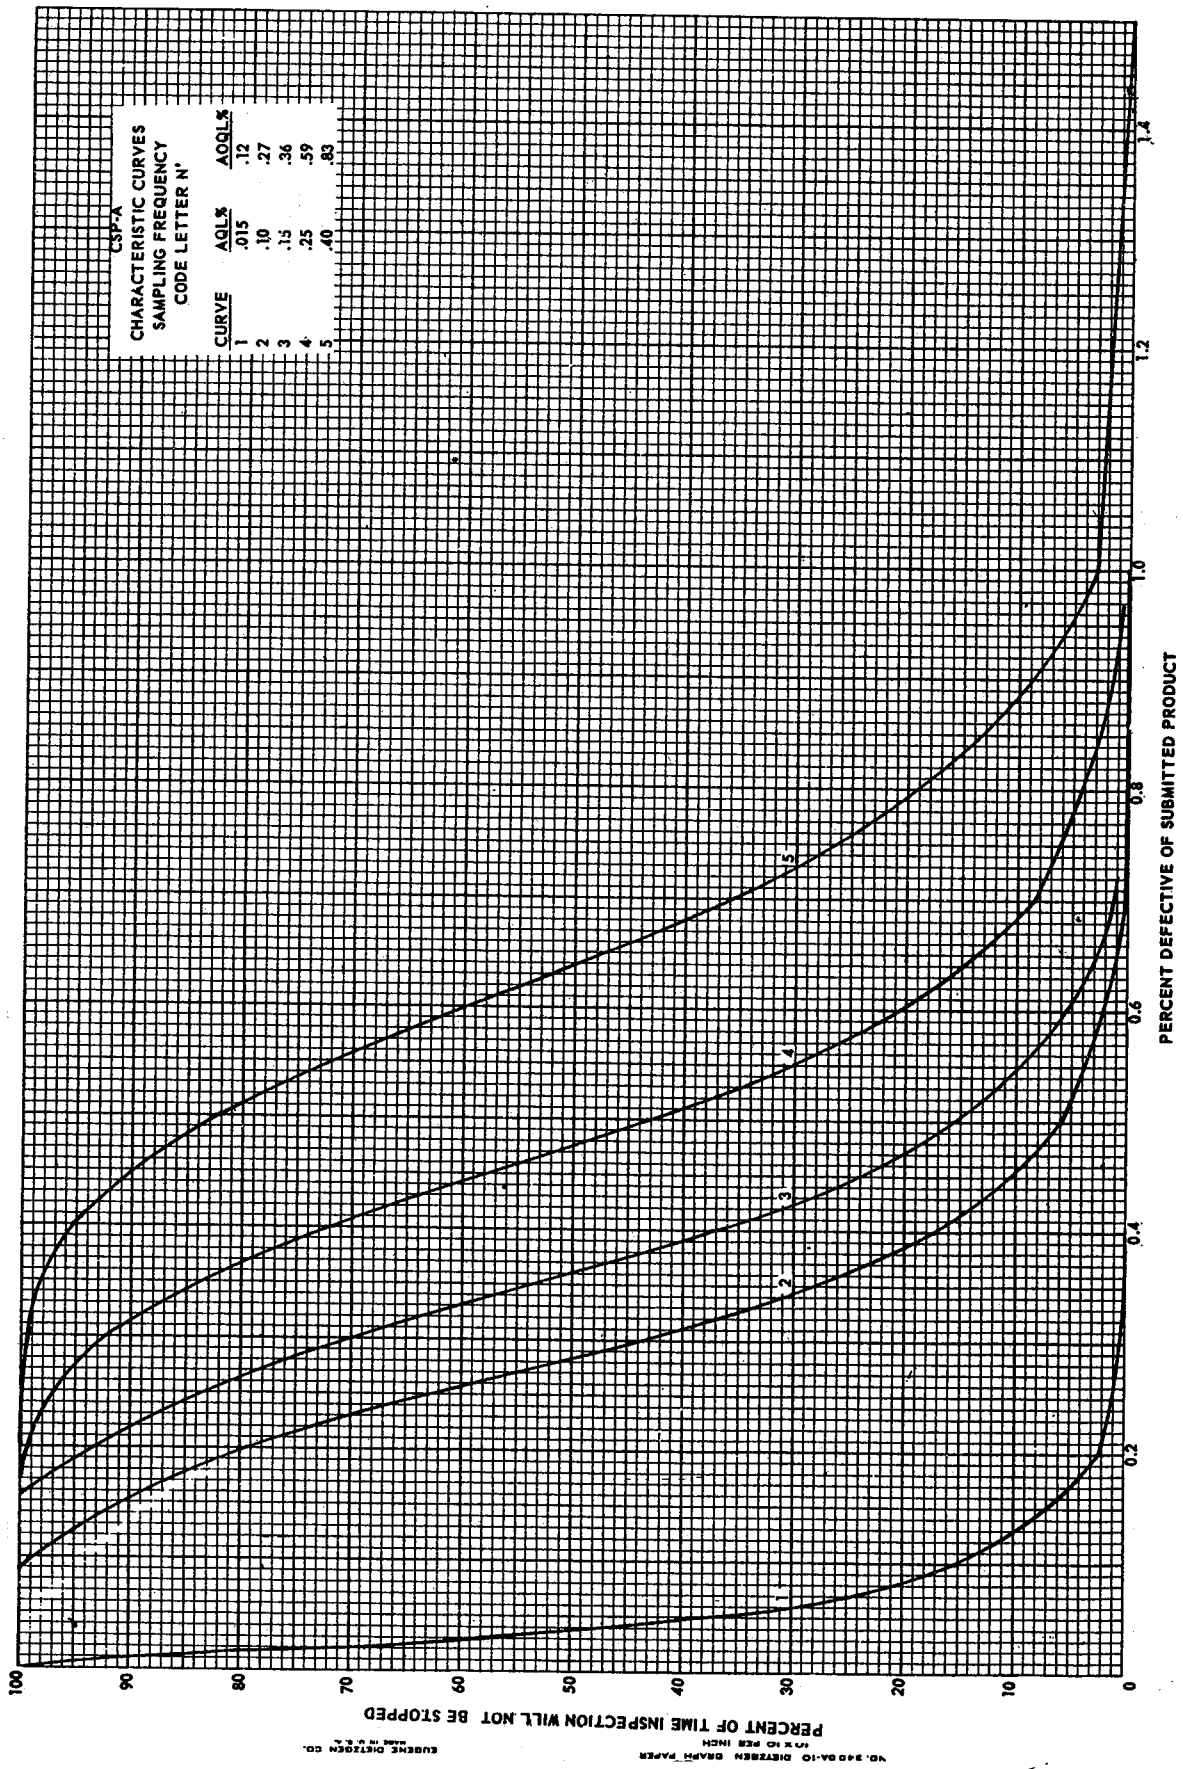


104

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

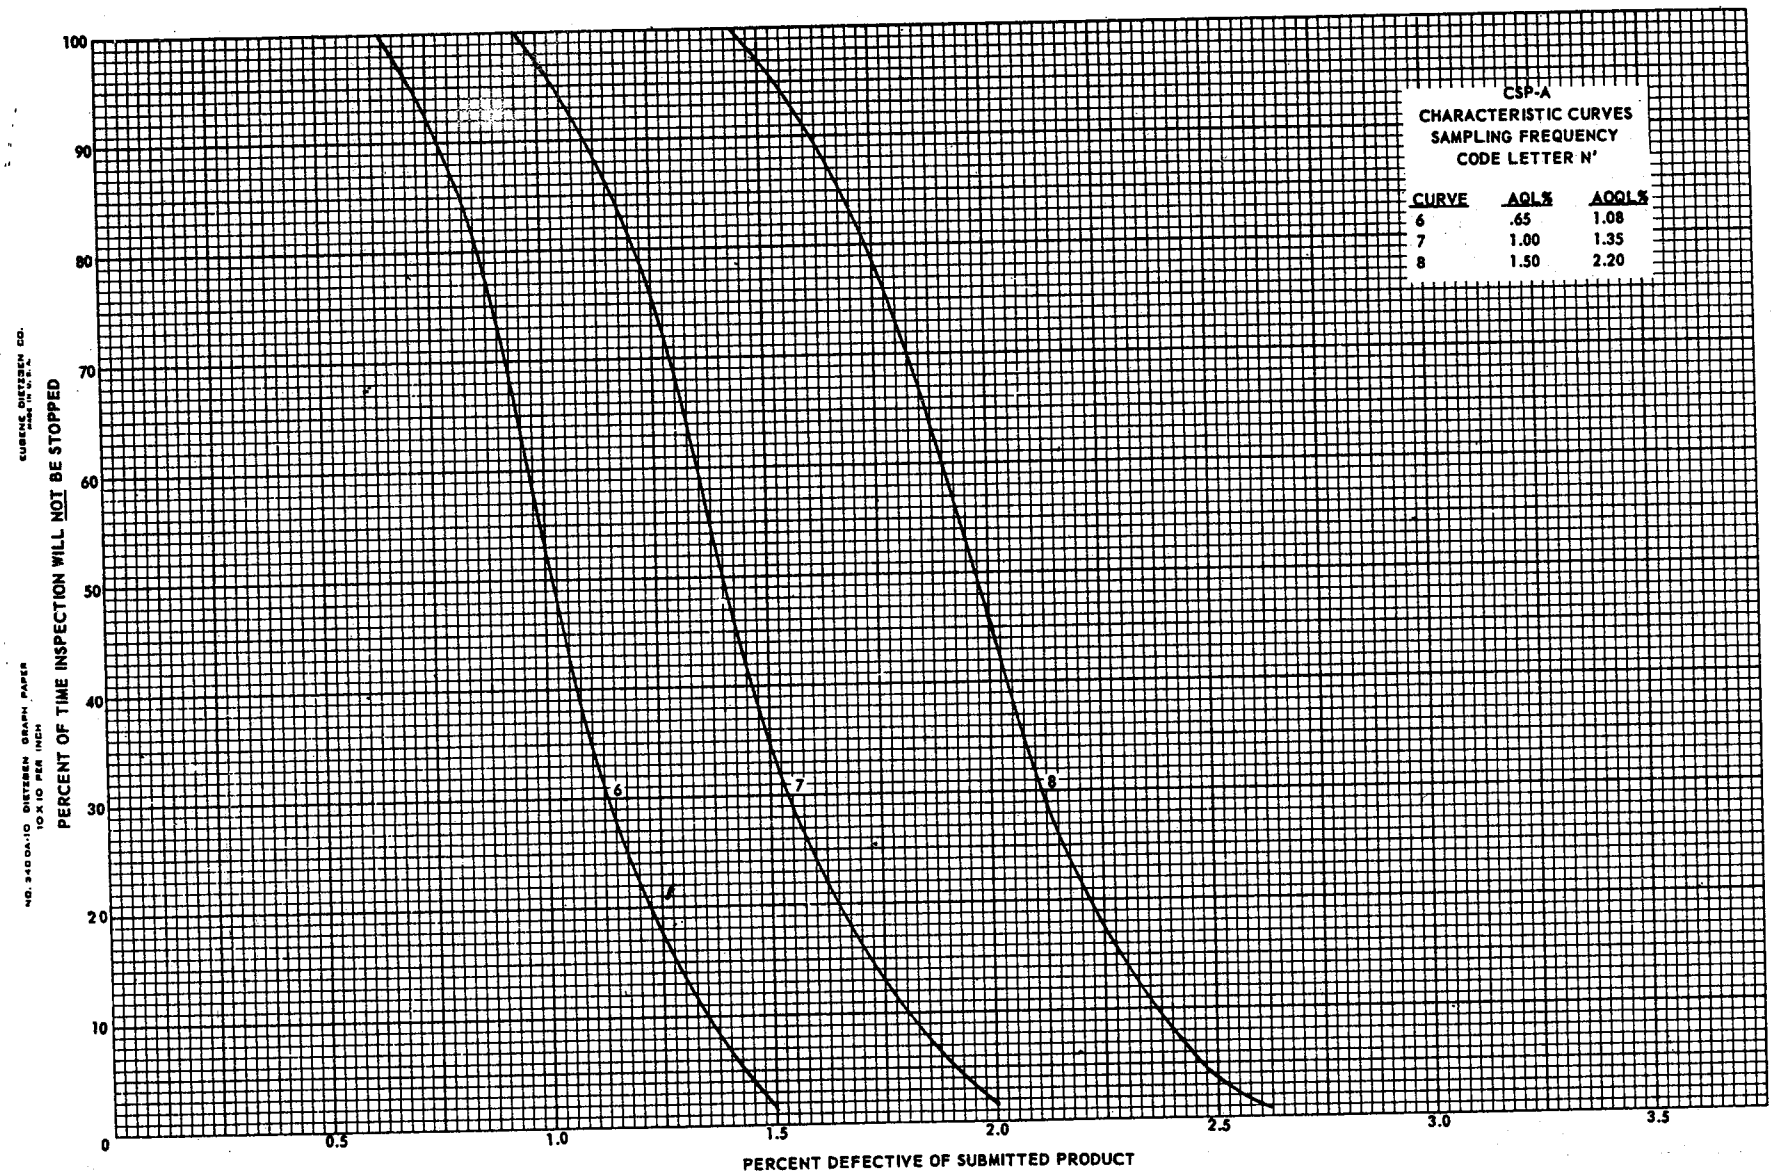

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

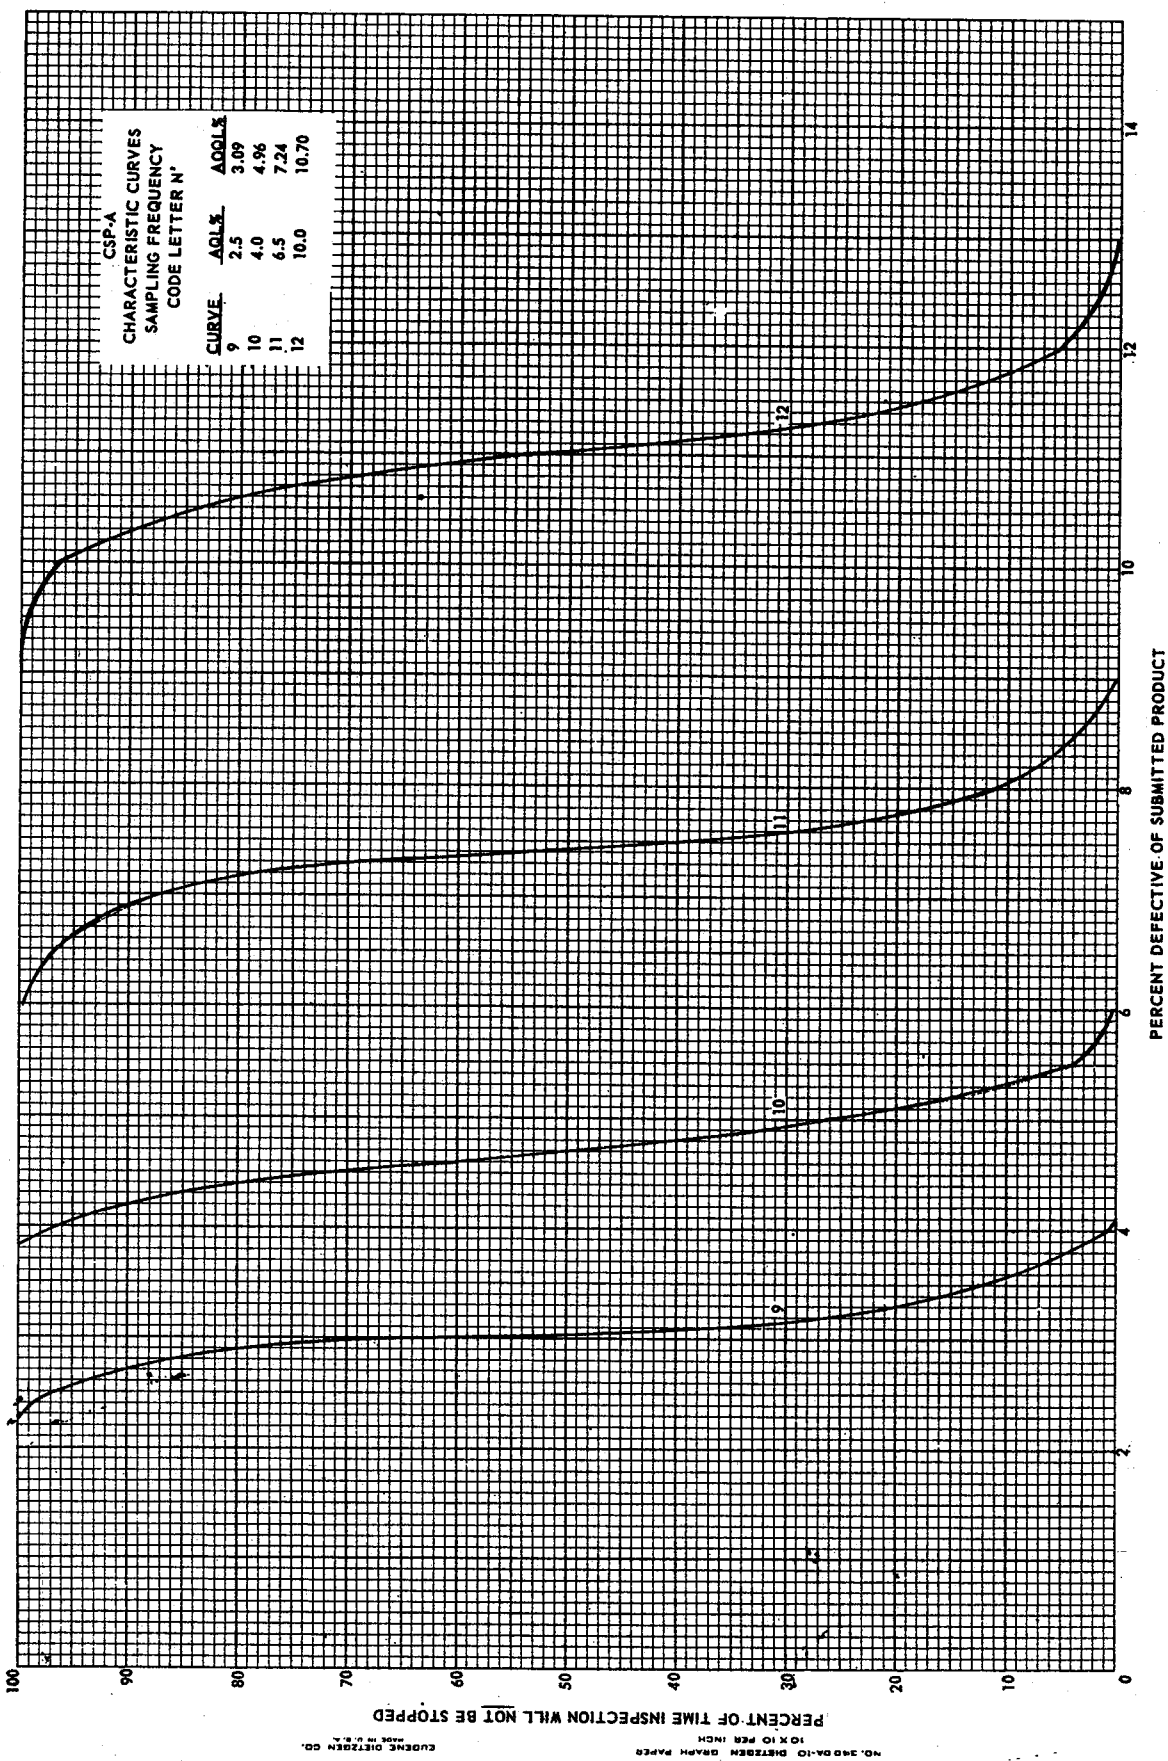

106

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.

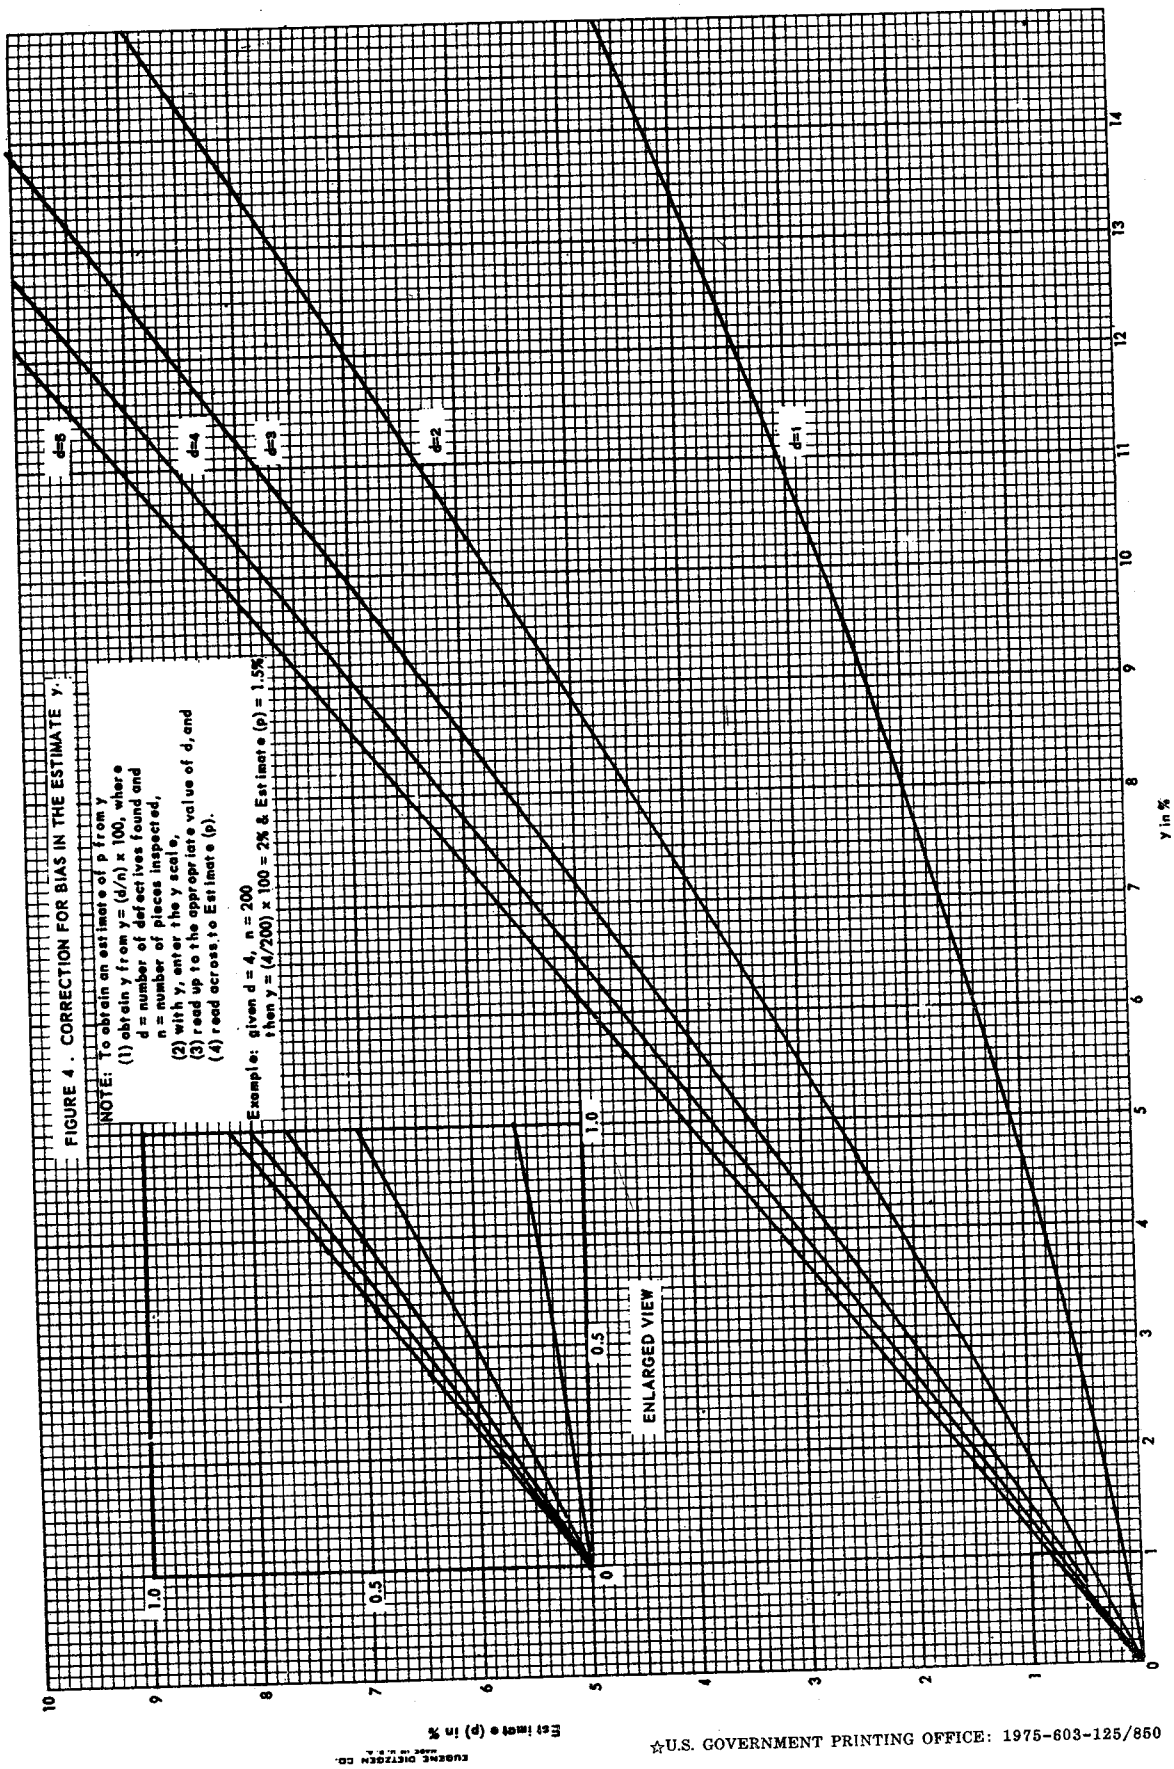


FIGURE 4 . CORRECTION FOR BIAS IN THE ESTIMATE y.

NOTE: To obtain an estimate of p from y
(1) obtain y from y = (d/n) x 100, where
d = number of defectives found and
n = number of pieces inspected,
(2) with y, enter the y scale,
(3) read up to the appropriate value of d, and
(4) read across to Estimate (p).

Example: given d = 4, n = 200
then y = (4/200) x 100 = 2% & Estimate (p) = 1.5%

☆U.S. GOVERNMENT PRINTING OFFICE: 1975-603-125/850

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T13:31Z
Check the source to verify that this is the current version before use.