REPORT DOCUMENTATION PAGE

Form Approved
OMB No. 0704-0188

The public reporting burden for this collection of information is estimated to average 1 hour per response, including the time for reviewing instructions, searching existing data sources, gathering and maintaining the data needed, and completing and reviewing the collection of information. Send comments regarding this burden estimate or any other aspect of this collection of information, including suggestions for reducing this burden, to Department of Defense, Washington Headquarters Services, Directorate for information on Operations and Reports (0704-0188), 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302. Respondents should be aware that notwithstanding any other provision of law, no person shall be subject to any penalty for failing to comply with a collection of information if it does not display a currently valid OMB control number.
PLEASE DO NOT RETURN YOUR FORM TO THE ABOVE ADDRESS.

1. REPORT DATE *(DD-MM-YYYY)*	2. REPORT TYPE	3. DATES COVERED *(From - To)*
04-01-2022	Final	

4. TITLE AND SUBTITLE
Test Operations Procedure (TOP)
02-2-812B Infrared Signature Measurements of Ground Targets

5a. CONTRACT NUMBER

5b. GRANT NUMBER

5c. PROGRAM ELEMENT NUMBER

6. AUTHORS

5d. PROJECT NUMBER

5e. TASK NUMBER

5f. WORK UNIT NUMBER

7. PERFORMING ORGANIZATION NAME(S) AND ADDRESS(ES)
Commander
U.S. Army Aberdeen Test Center
ATTN: TEAT-WFT
6943 Colleran Road, Aberdeen Proving Ground, MD 21005-5059

8. PERFORMING ORGANIZATION REPORT NUMBER
TOP 02-2-812B

9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES)
Policy and Standardization Division (CSTE-CI-P)
U.S. Army Test and Evaluation Command
6617 Aberdeen Boulevard
Aberdeen Proving Ground, MD 21005-5001

10. SPONSOR/MONITOR'S ACRONYM(S)

11. SPONSOR/MONITOR'S REPORT NUMBER(S)
Same as item 8

12. DISTRIBUTION/AVAILABILITY STATEMENT

Distribution Statement A. Approved for public release; distribution is unlimited.

13. SUPPLEMENTARY NOTES
Defense Technical Information Center (DTIC), AD No.: AD1156516

This TOP supersedes TOP 02-2-812A Infrared Measurements of Wheeled and Tracked Vehicles, dated 14 October 2011.
Marginal notations are not used in this revision to identify changes, with respect to the previous issue, due to the extent of the changes.

14. ABSTRACT
This document describes techniques and instrumentation employed to measure the midwave infrared (MWIR) and longwave infrared (LWIR) radiation, over a short distance (less than 100 meters), during development and production tests of military ground vehicles, unmanned systems, facilities, and other possible terrestrial targets that generate an infrared (IR) thermal signature and the conditions necessary to conduct these measurements.

15. SUBJECT TERMS
Midwave Infrared (MWIR); Forward Looking Infrared (FLIR); Infrared (IR); Thermal Imager; Longwave Infrared (LWIR); Spectral Radiant Intensity; Thermal Camera; Thermal Signature

16. SECURITY CLASSIFICATION OF:			17. LIMITATION OF ABSTRACT	18. NUMBER OF PAGES	19a. NAME OF RESPONSIBLE PERSON
a. REPORT	B. ABSTRACT	C. THIS PAGE			19b. TELEPHONE NUMBER *(include area code)*
Unclassified	Unclassified	Unclassified	SAR	33	

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

(This page is intentionally blank.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

U.S. ARMY TEST AND EVALUATION COMMAND
TEST OPERATIONS PROCEDURE

*Test Operations Procedure 02-2-812B
DTIC AD No. AD1156516

4 January 2022

INFRARED SIGNATURE MEASUREMENTS OF GROUND TARGET

Paragraph	1.	SCOPE	2
	2.	FACILITIES AND INSTRUMENTATION	2
	2.1	Facilities	2
	2.2	Instrumentation	5
	3.	REQUIRED TEST CONDITIONS	8
	4.	TEST PROCEDURES	9
	4.1	Test Planning	9
	4.2	Static Test Procedures	10
	4.3	Dynamic (Moving) Test Procedures	13
	4.4	Spectral Radiant Intensity Procedures	14
	5.	DATA REQUIRED	14
	5.1	Imagery Data	14
	5.2	Nonimagery Data	15
	5.3	Supporting Data	15
	5.4	Test Controls	15
	6.	PRESENTATION OF DATA	16
	6.1	Determination of Target Signatures	16
	6.2	Presentation of Signature Data	18
APPENDIX	A.	FACILITIES AND METEOROLOGICAL REQUIREMENTS	A-1
	B.	MATRIX OF TEST MEASUREMENT CONDITIONS (EXAMPLE)	B-1
	C.	DATA COLLECTION SHEETS	C-1
	D.	ABBREVIATIONS	D-1
	E.	REFERENCES	E-1
	F.	APPROVAL AUTHORITY	F-1

*This TOP supersedes TOP 02-2-812A Infrared Measurements of Wheeled and Tracked Vehicles, dated 14 October 2011.

Approved for public release; distribution unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

1. SCOPE.

a. This Test Operations Procedure (TOP) describes techniques and instrumentation employed to measure the midwave infrared (MWIR) and longwave infrared (LWIR) radiation, over a short distance (less than 100 meters (m)), during development and production tests of military ground vehicles, unmanned systems, facilities, and other possible terrestrial targets that generate an infrared (IR) thermal signature and the conditions necessary to conduct these measurements. Graphs and diagrams are presented to indicate typical measurements, but are not intended to represent any particular test results or evaluation.

b. The signature measurement test community, for the Military-related disciplines, has typically described the MWIR as nominally between 3- and 5-micrometers (µm) and the LWIR as that portion of the electromagnetic spectrum lying nominally between 8- and 12-µm. These definitions are not typical of all disciplines using this part of the electromagnetic spectrum. However, these are the definitions used in this document.

c. For IR signature data collection, a thermal characterization of a system is conducted by comparing the temperature changes under various conditions for the overall system or regions of interest. The conditions can included a fully operational system under test (SUT) (i.e., an exercised vehicle) in neutral environmental conditions as well as reference signature measurements on a cold, inactive or baseline SUT. A neutral environment is defined as the absence of adverse weather conditions such as rain, fog, snow, high winds, or dust. The environmental conditions extant during the actual testing must be fully characterized. A diurnal test should collect IR signature data on an inactive target with no internally generated heat, experiencing only the range of solar loading incurred during a characteristic 24-hour period. The measurements should include detailed IR data with sufficient supporting data to fully characterize the IR signature characteristics of the SUT in a full range of viewing aspects.

2. FACILITIES AND INSTRUMENTATION.

2.1. Facilities.

A primary requirement for the measurement facility is a location which provides for the observation of the SUT from a wide range of depression angles with the full range of target azimuth angles. A track must be provided for the testing and exercise of the SUT at representative speeds for mobile and/or vehicle targets. The facility should ideally provide sufficient, permanently installed power hookups for the extensive instrumentation required, as well as sufficient safety and security provisions for test conduct. Specific facilities are listed in Appendix A.

a. Turntable. The emplaced turntable should be set into the ground so that the rotating surface is only slightly above ground level and a vehicle can be driven directly onto the platform. An example of this type of setup is shown in Figure 1. Care must be taken to retain a natural terrain around the platform for the contrast measurements and the target-terrain interaction.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

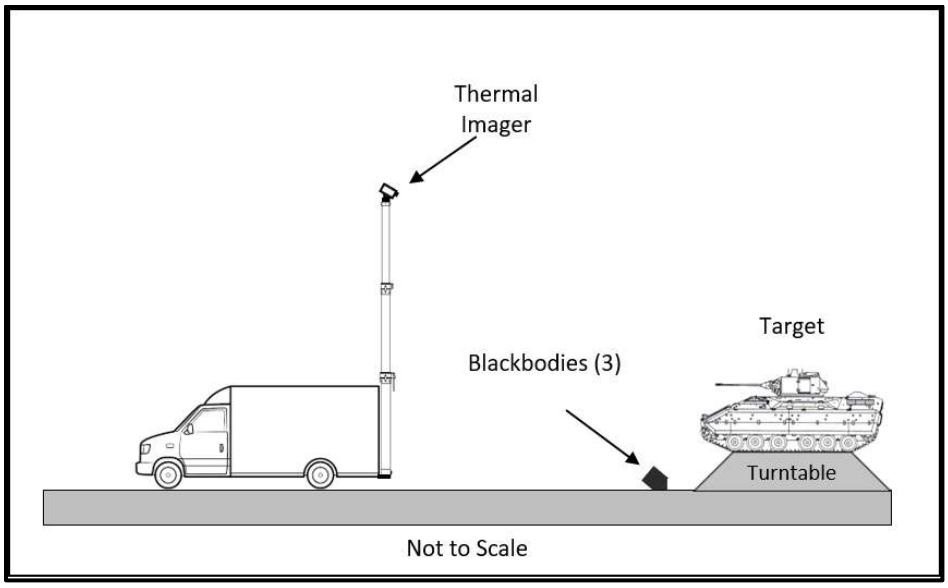


Figure 1. Example of a potential setup with turntable and elevated IR sensors.

b. Test Track. The test track should allow viewing the SUT from various angles. Figure 2 depicts an example of a test track setup. Once again, care must be taken to retain a natural terrain around the track to ensure reliable contrast measurements and the target-terrain interaction.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

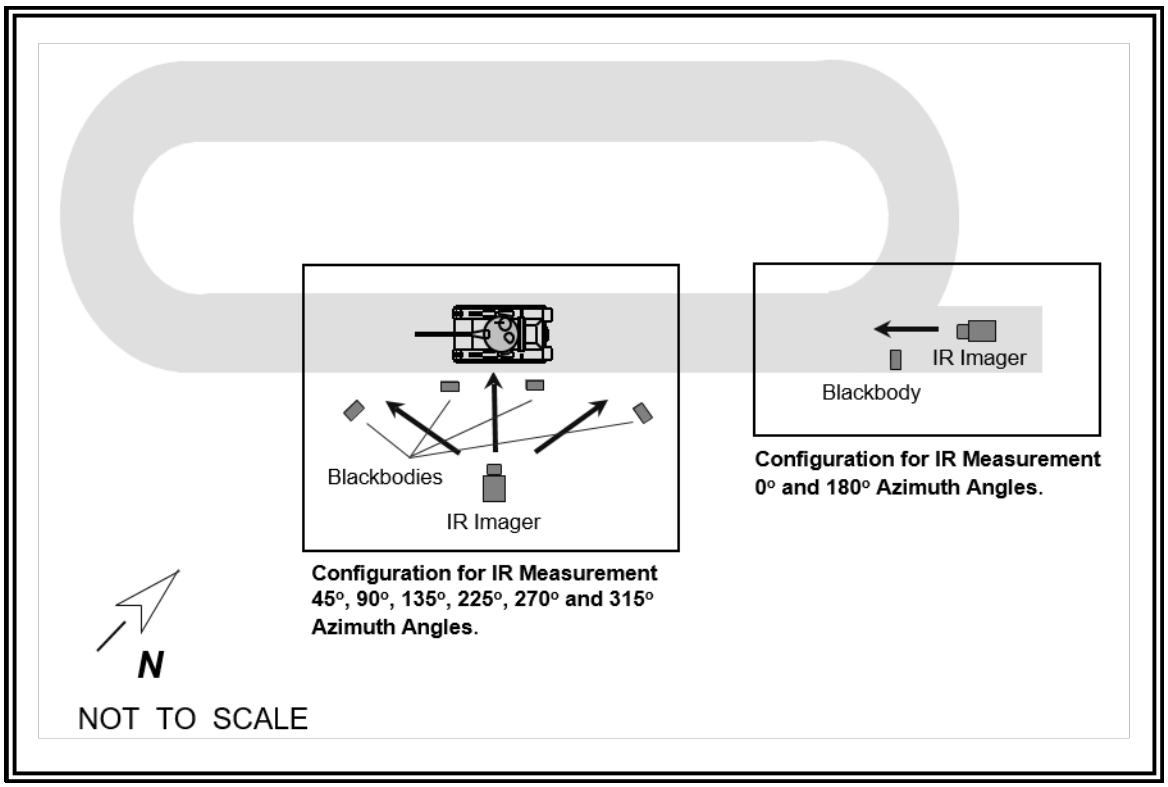


Figure 2. Example of test track with instrumentation setup for dynamic IR signatures testing.

c. Support Facilities. Ground facilities at the range location ideally include a fixed building, with visual sight onto the range, and instrumentation vans. The fixed building has a number of advantages associated with a static site including permanent facilities power hook-up, instrumentation support, security and ease of setup. Onsite instrumentation vans provide mobile shelters for a wide range of instrumentation and operators.

d. Additional equipment includes:

(1) Data recording devices.

(2) Timing insertion unit (for tagging recorded data with date, International Range Instrumentation Group (IRIG) time, and run logging data).

(3) Global Positioning System (GPS) location unit.

(4) Radio communications equipment.

e. Whatever the test facility used, target position data are an important adjunct to field testing. Target position is particularly important during moving target tests and can be provided in real time through GPS. Alternatively, a manual system based on a laser rangefinder could provide ranging data periodically.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

2.2 Instrumentation.

a. Thermal Imagery. Various thermal imagers will be used. They will differ as to exact spectral response, even if they operate nominally in the 3- to 5-µm or 8- to 12-µm band pass region. The spectral response of a detector ($R\lambda$), also termed responsivity, is used in the calibration of a thermal imager and subsequent calculations of the temperature from radiance. The detector response in the thermal imager is linear in radiometric quantity and non-linear in temperature. This non-linearity is strongly dependent upon the spectral response. Thus, R_λ is critical to determine the exact amount of radiation received from the reference sources or from the target and to convert radiometric data to temperature. Specialized imagers, such as multispectral and hyperspectral differing as to spectral resolution, may also be used. Multispectral and hyperspectral sensors collect a set of datacubes, each taken in a very narrow band pass, usually a fraction of a wavelength, over a region several wavelengths wide. Additionally, imagers may be fitted with spectral or polarizing filters.

b. Sensor System Parameters. There are two primary requirements for sensor performance. The first is the detection of scene temperature differences (temperature resolution) of at least 0.1 °Celsius (°C) for characteristic target features (spatial resolution) is of importance in the imager Field-of-View (FOV). This characteristic is reported as the Minimum Resolvable Temperature (MRT) at a target frequency in cycles/milliradian (cy/mrad). The MRT is usually presented as a curve to indicate the total system performance over a range of spatial resolutions. Additional curves could be generated for various background temperatures. The second is the minimum capability of the imager to detect any difference in the temperature from the noise. When the noise is equivalent to the smallest measurable temperature difference, the detector has reached its ability to resolve a useful thermal signal. This minimum capability of the imager is reported as the Noise Equivalent Temperature Difference (NETD) or differential temperature at a specified background temperature. There is one additional characteristic required of all imagers. This is the relative spectral response which is used in the data reduction algorithms. This characteristic is reported as a detector output versus a known input over the wavelength region of interest and is generally presented as a graph.

c. Multiple Element (Detector) Sensors. For an IR imager with multiple detector elements (e.g., focal plane array), it is important to specify the uniformity of detector response since variations in such response can affect the determination of apparent temperature in different areas of the scene.

d. Other Sensor Characteristics. Other sensor characteristics, such as FOV, Wide FOV (WFOV), Narrow FOV (NFOV), Instantaneous FOV (IFOV) and pixel resolution, do not have absolute requirements since they depend on how the system is used, the display resolution, the distance from the target, and the dimensions of the target areas to be resolved. These should be chosen appropriately for the required measurement. All of the sensor characteristics should be reported for a complete test report. Table 1 presents a list for some of the more important sensor parameters with example (not required) specifications. This list is only intended as a checklist to evaluate for a particular measurement set.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

TABLE 1. INSTRUMENTATION PARAMETERS

DEVICES FOR MEASURING	PERMISSIBLE ERROR OF MEASUREMENT
Spatially resolved apparent temperature in the 3- to 5-µm and 8- to 12-µm spectral bands	± 0.1 °C (relative) and ± 0.1 °C (absolute)
Pyranometer	± 2 percent of reading
Spectral resolution	± 0.05 µm or ± 10 wavenumber (cm^{-1})
FOV	± 0.1°
MRT	± 0.05 °C/mrad
Blackbodies	Extended area sources
NETD	± 0.1 °C at 300 Kelvin (K)
IR Radiometer	± 0.1 °C
Spectroradiometer measuring equipment	± 2 percent of reading
Meteorological Data	See Appendix A

e. Blackbody Calibration Sources. Blackbody calibration sources are intended to be placed in the target scene for recording within the collected image. Since these can be set to known temperatures they provide a means of image calibration. Typically three blackbodies are used. One is set to be slightly hotter than any object in the target scene, one colder than any such element, and a third is set to an intermediate temperature. Depending on how they are used, characteristic requirements of the sources include:

Parameter	Characteristic Values, Precision
Manufacturer	----------
Type and model	----------
Dimensions – overall:	35 by 35 centimeters (cm)
• Controlled area	30 by 30 cm
• Pattern type	Square
Temperature range of operation:	
• Low Source	Ambient to 100 °C
• High Source	60 to 600 °C
Precision of Surface Stability	0.1 °C
Calibration procedures employed	Calibration should be performed by manufacturer or National Institute of Standards and Technology certified vendor.

f. As part of the measurement process, it is necessary to be able to convert the observed image intensity values in the IR sensor into apparent temperatures as represented by the calibrated blackbody sources. With blackbodies at known temperatures bracketing the scene

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

radiance values in the image, it is possible to convert the image intensity of the target elements into apparent temperature values.

g. To this end, absolute radiance values at the measurement location should be verified using a calibrated radiometer containing spectral filters which match the spectral response of the sensor's 3- to 5-µm and 8- to 12-µm wavelength bands. Alternatively a spectroradiometer can be used to determine the radiance as a function of wavelength.

h. Spectral Measurement Instrumentation.

(1) If spectral (nonimaging) data are required, they can be acquired using a spectroradiometer or derived from the hyperspectral imaging system dataset. There are three primary requirements of radiometer performance. The first is the minimum capability of the system to detect any difference in the temperature from the noise. This characteristic is reported as the NETD at a specified background temperature.

(2) The second is the Noise Equivalent Power (NEP), a measure of a detection system's sensitivity. It is usually defined as the input power level that induces a system signal level having a signal to (system) noise ratio of one. This requires a voltage measurement of the system output as a function of (a variable) input signal.

(3) The third primary requirement is the uniformity of the response over the system's total FOV. The single element detector is not scanning the FOV but encompasses the total FOV. There are variations in the optics, and the detector itself, which will lead to a non-uniform response across the total FOV.

(4) Other radiometer characteristics, such as FOV, do not have absolute requirements since they depend on how this system is used and the distance from the target. These should be chosen appropriately for the required measurement.

(5) All of the radiometer characteristics should be reported for a complete test report. Table 2 presents a list for some of the more important parameters with example (not required) specifications. This list is only intended as a checklist to evaluate for a particular measurement set.

TABLE 2. EXAMPLE OF SPECTRORADIOMETER SPECIFICATIONS

CHARACTERISTIC	SPECIFICATION
FOV total	10 x 10°
Detector type	Indium-Antimonide
NETD	< 0.15 °C at 300 K
NEP	2.4 X 10^{-9} W/cm^2
System dynamic range	12 to 16 bits per pixel

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

i. Meteorological (MET) Instrumentation. The MET instrumentation is employed to characterize the ambient conditions. It is important to know these conditions during all tests to evaluate, as well as to estimate (or measure), the effects of the intervening atmosphere on the sensor image. The MET measurement facilities may either be provided by auxiliary technical experts (meteorologists) or dedicated (and calibrated) instrumentation employed on the range for testing. The parameters that need to be monitored are reported in Appendix A.

j. Data Processing Instrumentation. Data processing instrumentation includes image recording and processing instrumentation and computer processing hardware and software. The image processing software may take many forms and it is not appropriate to specify what particular software is required. However, important tasks that should be addressed by the software include, as a minimum, capabilities to carry out image segmentation and the assignment of temperatures to image zones based on intensity levels in the image.

3. REQUIRED TEST CONDITIONS.

a. General. For any test activity there will always be a number of actions required for the preparation of the SUT, measurement equipment, and facilities prior to test commencement. A checklist of all the required activities, tailored for the specific test, should be prepared well in advance of the activity. The tester should have a copy of the Security Classification Guide for the SUT (the total system, not a component), and be aware of the possibility of correlating signature information to system vulnerability.

b. Target Preparation. The test item must be available in the condition required for appropriate testing. This means that the SUT shall be in the configuration normally employed during field use, with all components and accessories mounted and fully operational. It must be painted and prepared as required for combat and be tested free of mud, dust, etc.

c. Range Preparation.

(1) The target configuration may be classified. All proper security precautions, including access control and target storage, should be in place well before test initiation.

(2) For testing requiring the use of tower, crane, mast, or other elevated platform for the sensor mounting and an operational turntable for target rotation, the appropriate mechanical and electrical equipment must be fully operational and configured.

d. Instrumentation Preparation. Preparation of test instrumentation primarily means ensuring that all critical pieces of equipment are properly calibrated. This includes the IR sensors, blackbody reference sources, MET sensors, and target instrumentation.

e. Test Scheduling. The test period must be scheduled in accordance with the suitable availability of all the key components. This includes:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

(1) Time to prepare all aspects of the target, range, and instrumentation.

(2) Range and facilities availability.

(3) Availability of all required test personnel.

(4) SUT availability.

(5) All required instrumentation calibrated and available.

(6) Suitable availability of resources required for data analysis and post-test processing.

4. TEST PROCEDURES.

In general, for full acquisition of SUTs MWIR and LWIR signature data, two main test types are required: static and dynamic. The static test is conducted under two kinds of conditions: with the SUT cold and idling (operational). The dynamic test is conducted with the target moving. Both static and dynamic testing are conducted under various conditions of solar loading and for various viewing aspects of the target image.

4.1 Test Planning.

Plan each SUT IR measurement project based on the following considerations:

a. Main Systems. Exhaust outlets and grilles (to include vehicle exhaust if requested); radiators; tires; suspension systems; heating systems; chemical, biological, radiological and nuclear (CBRN) systems; and exposed metal surfaces (especially where warmed by engine heat through operation or by solar heating) emit IR radiation and permit detection of the SUT by sensor directed weapons or surveillance systems. IR measurements are made of SUTs to assess their detectability and to identify temperature variations (ΔT) that could make the target vulnerable to land and airborne heat-seeking weapons. Consideration can then be given to shielding the hot spots or redesigning to suppress the IR radiation.

b. Auxiliary Systems. Personnel heaters or on-board auxiliary generators create signatures and are considered to be IR sources in addition to the basic SUT. Personnel heaters should not be used during IR signature tests, unless directed otherwise.

c. Deployment. The final deployment scenario of a SUT should be considered when conducting a test. For example, a CBRN decontamination unit would generally NOT be deployed to the front line. Thus, this item may not be required to suppress close range signature emissions.

d. Operational Scenario. The operational requirements of the SUT vehicle are required to determine the level of spatial and temperature resolution needed and the test procedures to use.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

For example, the SUT may be in defilade 20 percent of the deployment time, or the system may be in an inactive state for 30 percent of the time.

e. Orientation of Meteorological Station.

(1) Care should be taken in establishing the location and orientation of the MET station. The MET data should experience the same solar fluctuations and environmental differences as the SUT.

(2) The solar radiation sensor must be located at the test target(s) area, in the same area as the SUT to experience the same solar loading. The solar radiation sensor must give an instantaneous (defined as approximately 5- to 10-minute intervals) number of the watt per square meter per second (W/m^2s) arriving at the test target(s) for the preceding unit of time in a known spectral range.

(3) Insolation (integrated solar radiation) should be measured from two instruments parallel to the ground. One unit is to face up (Solar Irradiance) and the other is to face down (Reflected Irradiance). These data samples should be taken at 1-minute intervals during actual data collection and 15- to 30-minute intervals at all other times. These data should be collected in total W/m^2 in a known spectral range.

4.2 Static Test Procedures.

The primary purpose of a static test is to fully quantify the SUT's thermal signature from all aspects with the SUT cold and with the target idling. The cold test is essentially a test of the effect of solar loading. It must be conducted under a representative range of solar loading conditions. Since this test must necessarily be conducted over a full cycle of day and night (24 hours) it can properly be characterized as a diurnal test. Thermal imagery will be collected with a calibrated MWIR and a LWIR imager.

4.2.1 Diurnal Test Procedures.

a The SUT(s) should be positioned at the test site by the late afternoon of the day before testing is to begin (to allow a 12-hour non-operational period for the SUT to equilibrate to its environmental surroundings, i.e., static solar exposure). Three blackbody calibration sources are placed in front of the SUT in an open field so as to appear below the target in the image. The temperatures of the blackbodies should be adjusted so that the coolest and the hottest blackbody sources bracket the coolest and the hottest zones of the target. The temperature of the middle blackbody should be set approximately halfway between the other two. The IR sensors should be positioned on an elevated platform (i.e., mast or crane) and raised to the initial depression angle.

b. At selected times (usually 1-hour intervals) over a 24-hour cycle, a calibrated digital image should be taken from a MWIR and LWIR sensor and if possible 2 to 3 minutes of data should be recorded and saved as a video clip from the same imagers for each measurement. Upon completion of the diurnal test, the data should be reduced on an image processing system

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

to evaluate the radiance and apparent temperature values for each defined zone of interest on the SUT.

c. Such measurements will usually consist of a single azimuth angle at each of a number of depression angles. Immediately after each measurement series of viewing angles, the radiance of each blackbody should be measured with a calibrated radiometer and recorded.

d. The SUT data should be acquired for each depression angle. A suitable set of depression angles would include: 0, 20, 30, and 60 degrees. The first depression angle measurement should be repeated to determine if the system has undergone any changes due to environmental influences.

e. Note that if weather conditions change drastically over the diurnal cycle (heavy rain, significant change in cloud cover) it may be necessary to repeat the test on a different day.

4.2.2 Operational (Stationary) Test Procedures.

a. The operational or idle test is conducted over a full range of azimuth and depression angles. Immediately after each measurement series of viewing angles, the radiance of each blackbody should be measured with a calibrated radiometer and recorded.

b. The IR sensor should be placed on the elevating platform (i.e., a mast or crane) and raised to achieve the required depression angle. Three blackbody calibration sources must be placed in front of the turntable so as to appear below the target in the image. The temperatures of the blackbodies must be adjusted so that the coolest and the hottest sources bracket the coolest and the hottest spots in the image. The temperature of the middle blackbody should be set approximately halfway between the other two.

c. The SUT will be fully exercised, in accordance with the standard warm up stated in Table 3 for the type of operation specified in the Test Plan, and then placed (driven) onto the turntable. The SUT engine will be set to either normal idle or tactical idle, and any other auxiliary equipment turned on as specified in Test Plan. A calibrated digital image should be taken from the MWIR and LWIR imager.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

TABLE 3. STANDARD WARMUP FOR A VEHICLE

STEP	CONFIGURATION	PROCEDURE
A	Static solar exposure	Expose the SUT, not operating, to outside ambient conditions for 12 hours before test.
B	Standard slow idle	After standard warmup[a], position the vehicle or SUT at the test station to remain at applicable idle (typically 600 to 700 engine revolutions per minute (rpm) for a vehicle) for 3 minutes before data collection.
C	Standard fast idle	After standard warmup[a], position vehicle (tactical idle) or SUT at test station to remain at applicable fast idle (typically 1200 to 1500 engine rpm for a vehicle) for 3 minutes before data collection.
D	Standard slow operation	Move the SUT or vehicle steadily at 8 kilometers per hour (km/h) (5 miles per hour (mph)), may depend on minimum speed of SUT.
E	Standard moderate-speed	Move the SUT vehicle steadily at 16 km/h (10 mph), may depend on average speed of SUT.
F	Standard high-speed	Move the vehicle steadily at 32 km/h (20 mph) operation or three-quarters maximum red-line engine rpm.

[a]Standard warm-up: Operation of test vehicle 15 minutes over clockwise course and 15 minutes over counterclockwise course in high range or high gear at 16 to 32 km/h or 2000 to 2400 engine rpm. Five minutes in transit time are allowed to move vehicle from starting point to warm-up area.

d. Signature measurements should be carried out on two separate SUTs, typically a baseline SUT and an improved SUT. In order to ensure that the two SUTs are tested under the same environmental conditions, the SUTs must be tested one immediately after the other. The first SUT should be exercised and placed into position on the turntable. Once data collection is completed on the first SUT, the second exercised SUT should be placed on the turntable for data collection.

e. Target images should be acquired for each of eight azimuth angles in 45 degree increments: 0, 45, 90, 135, 180, 225, 270, and 315 degrees. The 0 degree azimuth is defined a straight-on look at the front of the SUT. The first azimuth angle measurement should be repeated to determine if the SUT has undergone any changes due to environmental influences. Each set of the azimuth angles should be acquired for various depression angles.

f. A suitable set of depression angles would include: 0, 20, 30, and 60 degrees. This full set of all viewing angles should be repeated for representative solar loading conditions. Commonly, four such daily solar conditions are considered representative. These are solar loads 0, 1, 2, and 3 defined by:

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

(1) Solar Load 0. The minimum load solar condition, occurring from 4.5 hours after sunset to 1.5 hours before sunrise.

(2) Solar Load 1. Early morning solar load, occurring from one to 2.5 hours after sunrise.

(3) Solar Load 2. The maximum solar load condition, occurring in mid-afternoon, characteristically between 1300 and 1500 hours under a clear sky.

(4) Solar Load 3. Evening solar load occurring from 1.5 hours before sunset to a one-half hour after sunset.

g. At a minimum, the minimum Solar Load 0 and maximum Solar Load 2 conditions shall be conducted. If time and conditions permit, the full complement of these four measurement conditions should be conducted for all the defined aspect angles.

h. This procedure should be repeated for all the required depression angles and solar load combinations. The data can then be reduced on an image processing system to evaluate the radiance and apparent temperature values for each defined vehicle or system zone of interest.

i. The large number of measurements required for the full matrix of viewing angles and solar load conditions will require that the testing be conducted over several days.

4.3 Dynamic (Moving) Test Procedures.

a. The dynamic test must be conducted with the SUT moving. SUT movement should be conducted on a suitable test track (Figure 2) with SUT in high gear at speeds of 10 to 20 km/h with an equal number of right and left turns made by the SUT in order to equally exercise both sides of the SUT suspension and drive train components.

b. The MWIR and LWIR sensors need to be placed in at least two different locations in order to acquire data for a full range of aspect angles. Refer to Figure 2 for an example of this configuration. The SUT should move at a constant speed in high range or high gear through the measurement zone. The measurement zone is defined as an area of approximately 20 feet over a secondary road. Figure 2 illustrates how this can be configured. Blackbody sources shall be positioned so that they are in the imager FOV at the required SUT aspect angles and allowed to come to equilibrium at their set temperatures. Six of the required aspects can be acquired from the broadside location alongside the track and the other two aspects (head-on and rear views) can be acquired looking down the length of the track.

c. It will typically be possible to acquire these views for only the zero depression angle. In some cases the compounding effects of dust on the SUT are required to be minimized. For these cases, it will be necessary for the test track to have an asphalt or concrete surface.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

4.4 Spectral Radiant Intensity Procedures.

a. The spectral radiant intensity, an additional parameter needed for the optimal measurement of IR emission from a SUT, is generally obtained using an interferometer or a spectroradiometer covering the 2- to 12-µm wavelength region.

b. General Data Collection Method. The SUT should follow the general scenario as outlined in paragraphs 4.2 and 4.3. The exceptions are that the background data must be collected as close to the SUT data collection time as feasible. Operate the SUT in accordance with conditions of Table 3. Collect spectral data of the background without the SUT. Then move the SUT into the scene and collect another set of spectral data. The SUT should be at a distance which just fills a significant portion of the FOV of the spectroradiometer being used to collect the measurements.

c. Temporal Data Collection Method. To obtain information about the temporal effects of a SUT, such as the warmup or exhaust, use the measuring instrument at a single aspect of the SUT. In this instance, the SUT is NOT warmed up in accordance with Table 3 but is warmed up while being monitored. These should begin with signatures of a cold SUT and continue at intervals of 1/2 minute, 5 minutes, 30 minutes, and 2 hours after engine starts.

5. DATA REQUIRED.

This section describes the test data to be recorded. The data collection should be adequate for correlation with test data on the same or similar items obtained at different times or locations. The data to be acquired are similar for both portions of the static test as well as the dynamic test. These data consist of calibrated IR data, temperature measurements, and information on test conditions.

5.1 Imagery Data.

a. IR signature data must be collected in both the 3- to 5-µm and 8- to 12-µm spectral regions over several SUT aspects. Each data set should be defined by the solar load, depression angle, and azimuth angle at which thermal imagery is collected. A sample for the tabular listing of all of the required conditions is found in Appendix B. The thermal data for each SUT aspect should be separated into selected zones. The SUT zones of interest are uniquely defined for each test. Both radiance (W/m^2sr) and apparent temperature (°C) must be calculated for each SUT zone, the entire SUT, and the foreground/background. Values calculated for radiance and temperature should include the mean, standard deviation, maximum, and minimum values encountered. Thermal imagery should also be collected on the background, without the SUT in the image to provide information for use in background clutter analysis.

b. Digital Imagery. Digital imagery should be collected and stored on a removable digital media such as digital video discs (DVDs) or removable drives. These media should be clearly marked with the classification, date, time and instructions, if any. Each media should be

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

uniquely identified to allow inclusion of the identification into a database for later retrieval and archiving.

5.2 Nonimagery Data.

The spectral IR signature data should be collected in the 2- to 12-µm spectral regions over several SUT aspects. Each data set should be defined by the date, time, solar load, spectral background data, depression angle, and azimuth angle at which measurement is collected. The SUT radiance (W/m^2sr) is wavelength dependent and should be calculated by subtracting the background spectral radiance from the background and SUT radiance values and reported for each SUT aspect and the background. Values calculated must include the error bars and alternate sources of error with the system and measurement conditions. Spectral data should also be reported on the background, without the SUT in the image, to provide information for use in background clutter analysis.

5.3 Supporting Data.

a. Several types of data, in addition to thermal imagery, may be collected. These include actual temperatures on the SUT exterior, meteorological data, and test documentation including imagery of the SUT and test setup.

b. An important adjunct to the imagery data is the determination of the actual temperatures on the various target zones. These may be acquired during the static testing through the use of contact sensors (thermocouples or thermistors) on the zones of interest. For such measurements, at least two sensors are to be employed for each target zone.

c. Meteorological data must be collected at 1-minute intervals during the actual data collection, and every 10 minutes during the times which data are not being collected, at the test site in accordance with the parameters listed in Appendix A, Table A-2.

d. Test documentation includes the characterization of all pertinent information on data logging forms such as those found in Appendix C. In addition, digital photography should be taken with a 35-millimeter (or equivalent) camera showing all aspects of the SUT and close-in pictures where significant detail exists. Digital photographs should also be taken of the range test setup showing the relationship of the various elements of the test, including the SUT, imager, blackbody calibration sources, and scene background and foreground.

5.4 Test Controls.

To verify the accuracy of the measurement, and to eliminate systematic errors, it is a good idea to apply contact thermocouples to the vehicle. Hand-held spot radiometers can be used as well, which measure radiant energy, like the thermal imager. Still, errors will remain, as below:

a. Uncertainty Due to the Thermal Sensor Itself and the Intervening Atmosphere. The inherent uncertainty in a modern thermal imager is usually a fraction of a degree and is insignificant compared to the sampling uncertainty, described below. The atmospheric path may

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

be important, if it is long enough, and it may both remove and add radiant energy. To compensate, blackbodies may be placed at the SUT location or at another location but at the same range as calibration sources. Blackbody temperatures should approach the coldest and the hottest extremes of the SUT and background temperatures.

b. Uncertainty Due to Sampling Error. A separate source of error is sampling error, because the combination of SUT and environment is but a single sample out of a diverse population of different SUTs in different environments, whose typical signature is the ultimate objective. For example, SUTs may differ in their paint or cleanliness, affecting their emissivity, that is, the efficiency with which they radiate energy. If a SUT has an emissivity of 85 percent, it radiates 85 percent of the energy that a perfect blackbody would at the same temperature. But it also reflects its environment, like a mirror, at a complementary 15-percent efficiency. Thus the signature of any SUT outdoors will contain an emitted component, based on its surface temperature, and a reflected component, based on its environment. The former will vary with current and recent exposure to sun, ambient air and wind, and the latter with nearby buildings or vegetation, and cloud cover, among other things. Added to this is variability in the state of its engine deck, exhaust outlet, gun tube and suspension, all of which depend on how the SUT has been recently used. Consequently any single measurement will not account for all the possible states. Even to define these SUTs and environments as narrowly as possible, and thus to minimize this error, requires instruments, such as wind meters, which themselves have inaccuracies. The more broadly these environments are defined, the greater this sampling error.

c. Uncertainty Due to Spectral Mismatch Between Imager and Tactical Sensor. If there is a spectral mismatch between the imager used to collect the signature and the tactical sensor it is intended to duplicate, the measured signature may not exactly apply. This depends on the spectral region in which the mismatch occurs, and its magnitude. Some regions, for example, are more affected by atmospheric attenuation than others, or the presence of combustion gases. Further information on spectral mismatch errors, including potential error from spectral response mismatch between laboratory and tactical sensors should be considered.

6. PRESENTATION OF DATA.

This section describes how the test data should be prepared for presentation. The primary data to be presented are the determinations of SUT signatures. The signature data can be expressed in terms of radiance from the target surface in units of watt per square meter per steradian (W/m^2sr) or as apparent temperature in units of °C.

6.1 Determination of Target Signatures.

In order to determine the radiance and apparent temperature of the defined target zones, the following measurements and processing procedures are required.

a. Pixel Intensities and Radiance. The pixel intensities in each scene are calibrated through the use of the blackbody sources in the imagery or predetermined/measured calibration files for a given thermal imaging system. The blackbody temperature is noted and the

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

appropriate isothermal zone in the image is bounded. The mean value and standard deviation of the pixels in each such zone for each blackbody in the image are then determined through a radiometric data reduction and analysis program. The mean radiance is then calculated from Planck's equation, the known emissivity of the source, and the system characteristics of the imager (viewing geometry, relative spectral transmission, sensitivity, and gain). This procedure defines a calibration curve of radiance within the imager scene as a function of observed pixel value. The radiance values then imply an apparent object temperature with an assumed unit emissivity. Given the calibration curve for each image, it is then possible to determine the radiance or apparent temperature of the SUT and the background.

b. Target Zones. The thermal image for each vehicle aspect should be separated into selected SUT zones. The SUT zones of interest are uniquely defined for each test. Each zone of interest is defined in the imagery data. The radiometric data then determines the mean and standard deviation of the pixel values for each of these defined zones. The pixel values are then directly converted to radiance or apparent temperature on the basis of the image calibration. These signature values may also be computed for the entire SUT and for any portion of the background scene.

c. Background Definition. The most important measurements of the significance of the SUT signature is obtained by comparison with the surrounding background. The background should be defined as the area immediately adjacent to the SUT containing a representative area of the foreground and background and the area of the SUT. This background must be centered on the centroid of the SUT but excluding the SUT measurements. Current philosophy dictates that if an area of widely different radiance is encountered in this background (such as the sky), then the background perimeter shall be reduced in size proportionately until this area is no longer in the background.

d. Contrast Metrics. The thermal signature values of a SUT and the background/foreground can be determined using different software packages developed for that purpose. Most thermal imagers will come with software to allow the operator to outline the SUT and then the software will automatically calculate the Area Weighted Average (AWA) Delta T contrast value between the SUT and the adjacent background/foreground, two times the area of SUT, as well as all the desired statistics about the SUT and adjacent background/foreground, pixel count, minimum and maximum temperature, standard deviation, etc. Two of the most useful metrics that are used in analysis are the AWA Delta T (ΔT_{AWA}) and root sum square (RSS) Delta T (ΔT_{rss}). The formulas and descriptions for these two metrics are shown in Equations 1 and 2, and in Table 4.

AWA Delta T (ΔT)

(Equation 1)

$$\Delta T_{AWA} = \bar{T}_{tgt} - \bar{T}_{bkg}$$

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

RSS Delta T (ΔT_{rss})

(Equation 2)

$$\Delta T_{rss} = \sqrt{(\bar{T}_{tgt} - \bar{T}_{bkg})^2 + S^2}$$

TABLE 4. INFRARED CONTRAST MEASUREMENT VARIABLES

VARIABLE	DESCRIPTION OF VARIABLE	UNIT
$\bar{T}_{tgt}$	Average Target Temperature	°C
$\bar{T}_{bkg}$	Average Background Temperature	°C
S^2	Variance of Target	Unitless

Note: Average temperatures and variance are calculated from radiance values before converting to temperature.

6.2 Presentation of Signature Data.

Calibrated thermal imagery data can be reported in different formats: digital thermal images, tabular data, and graphical plots. The form of each format is described below.

a. Imagery Data. Thermal imagery selected by the test sponsor can be copied onto DVD, secure digital (SD) card, or portable hard drive and delivered at the completion of the data acquisition. In addition, thermal imagery can be transmitted electronically through secure means. All imagery data delivered to the customer must be clearly identified as to the media from which it was extracted, to include the unique identification of the media.

b. Tabular Data. A data table should be constructed for each SUT data set and background listing radiance and apparent temperature. The table should also include the AWA Delta T (ΔT_{AWA}) and RSS Delta T (ΔT_{rss}). The target as a whole, and the background tabulated data must include the mean, standard deviation, maximum, and minimum of both radiance and temperature.

c. Graphical Data. For each solar load and depression angle in the operational test, the mean radiance and standard deviation should be graphed for each radiance zone versus azimuth angle. For the diurnal test, the mean radiance and standard deviation should be graphed for the vehicle zones versus the time of day.

d. Nonimagery Data. Plots of the spectral data should be presented showing the background information and the SUT data. Any differences from what would be expected of a normal spectral emission of the SUT must be highlighted, such as the peak emissions in the 3- to 5-µm region commonly referred to as the Red and Blue spikes.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

e. Supporting Data. In addition to the calibrated signature data, the following supporting data are required to completely define the test results. They are defined as part of the data to be presented and should be made available to the test sponsor:

(1) Meteorological ground truth data for each day of testing.

(2) Physical temperatures of the target exterior.

(3) Graphical display of solar loading versus time of day for each day of testing.

(4) A tabulation of solar angle versus time of day at the test site latitude.

(5) A brief description of the terrain surrounding the target, both foreground and background.

(6) A schematic representation of the test site to include a diagrammatic layout of all instrumentation and the SUT.

(7) A tabulation of instrumentation used to collect data with associated calibration intervals.

(8) Imagery of selected target aspects.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

(This page is intentionally blank.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

APPENDIX A. FACILITIES AND METEOROLOGICAL REQUIREMENTS.

A.1 FACILITIES.

Recommended facility parameters are shown in Table A-1.

TABLE A-1. RECOMMENDED FACILITIES

ITEM	REQUIREMENT
Elevating Platform (i.e., mast, crane, or tower)	Height requirement is instrumentation dependent: must allow the imager to accommodate entire target, blackbodies and the background within the FOV at all depression angles required.
Camera(s) Mount	Must be stable to support an elevated camera(s) and accommodate the instrumentation package size, weight and power requirements needed. Must provide imager depression angle adjustment from 0 to 90º at the target location.
Distance for Turntable	Must be sufficient to allow the entire target within the imager FOV at all depression angles noted under the elevated platform.
TURNTABLE	
Capacity	Minimum 70 tons.
Deck Size	Minimum 6.7 meters.
Turning Rate	Minimum 30º/min.
Positioning Accuracy	± 1 degree.
Loading/unloading Time	< 5 minutes.
Test Track	Minimum 300-meter straight away.
Open Area	Large enough for test vehicle to fill FOV of radiometer; background as required in test requirements.
Firing Range	As applicable to weapon under test.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

APPENDIX A. FACILITIES AND METEOROLOGICAL REQUIREMENTS.

A.2 METEOROLOGICAL DATA.

The instrumentation required for the collection of meteorological data for all portions of the tests involving thermal signature collection are listed in Table A-2.

TABLE A-2. METEOROLOGICAL INSTRUMENTATION AND PERMISSIBLE ERROR

DEVICES FOR MEASURING	PERMISSIBLE UNCERTAINTY OF MEASUREMENT
Ambient air temperature	±0.5 °C
Relative humidity	±5 percent and >30 percent at extremes
Barometric pressure	±1 millibars
Solar irradiance	±1 percent of W/m^2 value
Reflected irradiance	±1 percent of W/m^2 value
Cloud cover	±10 percent
Precipitation type	Rain, snow, etc.
Precipitation rate	±5 percent mm/hr reading
Soil moisture	Volumetric water content
Surface texture	(Description)
Ground cover	(Description)
Wind speed	±2 km/h
Wind direction	±10 degrees
Meteorological station site	±1 meter
Soil temperature	±1 °C
Sun position	(Latitude and longitude)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

APPENDIX B. MATRIX OF TEST MEASUREMENT CONDITIONS (EXAMPLE).

Solar Load	Sensor Depression Angles, degrees	Target Aspect/Azimuth Angles, degrees							
		0	45	90	135	180	235	270	315
SL0	0								
SL0	20								
SL0	30								
SL0	60								
SL1	0								
SL1	20								
SL1	30								
SL1	60								
SL2	0								
SL2	20								
SL2	30								
SL2	60								
SL3	0								
SL3	20								
SL3	30								
SL3	60								

Figure B-1. Example of measurement matrix for static target operating test

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

(This page is intentionally blank.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

APPENDIX C. DATA COLLECTION SHEETS.

The following data are to be recorded for each test.

Target Type/Identification _____
Target Serial Number _____
Engine Identification _____
Date/Location of Manufacture _____
Odometer Reading _____
Surface Condition Paint _____
Cleanliness _____
Mechanical Condition _____
Condition of Exhaust Area _____
Payload, Attachments/
Configuration _____

Checklist of Documentation
_____ Imagery Survey
_____ Diagram with dimensions of engine compartment an exhaust area
_____ Speed versus rpm table/chart

Figure C-1. SUT Identification and condition.

Date: _____ Time: _____

Imager Type: _____ Waveband: _____
Test Type: Diurnal _____ Operational _____ Dynamic _____
Solar Load Condition: _____
View Depression Angle: _____
Target Azimuth Angle: _____
Blackbody Set Temperatures: 1_____ 2_____ 3_____
Comments/Special Conditions _____

Figure C-2. Test type and conditions.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

(This page is intentionally blank.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

APPENDIX D. ABBREVIATIONS.

ATEC	U.S. Army Test and Evaluation Command
AWA	area weighted average
°C	degrees Celsius
CBRN	chemical, biological, radiological and nuclear
cm	centimeter
cy/mrad	cycles/milliradian
DCI	Directorate for Capabilities Integration
DTIC	Defense Technical Information Center
FLIR	Forward Looking Infrared
FOV	field of view
GPS	Global Positioning System
IFOV	instantaneous field of view
IR	infrared
IRIG	International Range Instrumentation Group
K	Kelvin
km/h	kilometers per hour
LWIR	longwave infrared
µm	micrometer
m	meter
MET	meteorological
mph	miles per hour
mrad	milliradian
MRT	minimum resolvable temperature
MWIR	midwave infrared
NEP	noise equivalent power
NETD	noise equivalent temperature difference
NFOV	narrow field of view
R_λ	spectral response (also termed responsivity)
rpm	revolutions per minute
RSS	root sum square
sr	steradian
SUT	system under test

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

APPENDIX D. ABBREVIATIONS.

TOP	Test Operations Procedure
W	Watt
WFOV	wide field of view

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

APPENDIX E. REFERENCES.

For information only (related publications).

a. Ballistic Research Laboratories [1977], Procedure for the Reduction of IR Scanner Data, Aberdeen Proving Ground, MD, April 1977.

b. Baumann, J.L., and M.D. Dixon [1979], Precision Stabilization Requirements for Long-Range Acquisition Systems, SPIE Vol. 187 System Aspects of Electro-Optics.

c. Hoover, C., J. Ratches, F. Shields, and K. Mayo [1982], Night Vision and Electro-Optics Laboratory (NVEOL) Performance Model and Its Uses, SPIE Vol. 327 Sensor Design Using Computer Tools.

d. Hudson, R.D., [1969], Infrared System Engineering, John Wiley & Sons, NY.

e. Jacobs, Pieter A. [1996], Thermal Infrared Characterization of Ground Targets and Backgrounds.

f. Sabol, B.M. and K.G. Hall [1989], Image Metrics Approach to Understanding Effects of Terrain and Environment on Performance of Thermal Target Acquisition Systems, U.S. Army Engineer Waterways Experiment Station, Vicksburg, MS.

g. Spiro, I.J. and M. Schlessinger [1989], Infrared Technology Fundamentals, Marcel Dekker, Inc, NY.

h. Thermal Infrared Signature Standards, Ver. 1.0, 1 Dec 2007. Published by National Signatures Program (now Signatures Support program). SIPRNET http://dt.dia.smil.mil/nsp or 1-877-238-8821.

i. Wolfe, W. L. and G.J. Zissis, eds., [1978], The Infrared Handbook Environmental Research Institute of Michigan, Office of Naval Research, Washington, DC.

j. DCS Corporation [1988], Infrared Imaging System Analysis, IRIA Series in Infrared & Electro-Optics.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

(This page is intentionally blank.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

APPENDIX F. APPROVAL AUTHORITY.

CSTE-CI 4 January 2022

MEMORANDUM FOR

Commander, U.S. Army Operational Test Command
Director, U.S. Army Evaluation Center
Commanders, ATEC Test Centers
Technical Directors, ATEC Test Centers

SUBJECT: Test Operations Procedure 02-2-812B, Infrared Signature Measurements of Ground Targets

1. Test Operations Procedure (TOP) 02-2-812B, Infrared Signature Measurements of Ground Targets, has been reviewed by the U.S. Army Test and Evaluation Command (ATEC) Test Centers, the U.S. Army Operational Test Command, and the U.S. Army Evaluation Center. All comments received during the formal coordination period have been adjudicated by the preparing agency.

2. Scope of the document. This document describes techniques and instrumentation employed to measure the midwave infrared and longwave infrared radiation, over a short distance (less than 100 meters), during development and production tests of military ground vehicles, unmanned systems, facilities, and other possible terrestrial targets that generate an infrared thermal signature, and the conditions necessary to conduct these measurements.

3. This document is approved for publication and has been posted to the Reference Library of the ATEC Vision Digital Library System (VDLS). The VDLS website can be accessed at https://vdls.atc.army.mil/.

4. Comments, suggestions, or questions on this document should be addressed to U.S. Army Test and Evaluation Command (CSTE-CI), 6617 Aberdeen Boulevard-Third Floor, Aberdeen Proving Ground, MD 21005-5001; or e-mailed to usarmy.apg.atec.mbx.atec-standards@mail.mil.

ZWIEBEL.MICHAEL.J.1229197289 Digitally signed by ZWIEBEL.MICHAEL.J.1229197289 Date: 2022.01.13 09:13:00 -05'00'

MICHAEL J. ZWIEBEL
Director, Directorate for Capabilities Integration (DCI)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

(This page is intentionally blank.)

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.

Forward comments, recommended changes, or any pertinent data which may be of use in improving this publication to the following address: Policy and Standardization Division (CSTE-CI-P), U.S. Army Test and Evaluation Command, 6617 Aberdeen Boulevard, Aberdeen Proving Ground, Maryland 21005-5001. Technical information may be obtained from the preparing activity: Commander, U.S. Army Aberdeen Test Center, ATTN: TEAT-WFT, 6943 Colleran Road, Aberdeen Proving Ground, MD 21005-5059. Additional copies can be requested through the following website: https://www.atec.army.mil/publications/documents.html, or through the Defense Technical Information Center, 8725 John J. Kingman Rd., STE 0944, Fort Belvoir, VA 22060-6218. This document is identified by the accession number (AD No.) printed on the first page.

Source: https://assist.dla.mil -- Downloaded: 2026-10-26T14:49Z
Check the source to verify that this is the current version before use.