INCH-POUND

MIL-C-28754/12F
26 JULY 1991
SUPERSEDING
MIL-C-28754/12E
13 DECEMBER 1982

MILITARY SPECIFICATION SHEET

CONNECTORS, ELECTRICAL, MODULAR, CONNECTOR ASSEMBLY, TYPE IV, SINGLE SPAN (FOR SOLID STATE OR DIP FRAME)


This specification is approved for use by all Departments and Agencies of the Department of Defense.

The requirements for acquiring the connector-frame assemblies described herein shall consist of this specification sheet and the issue of the following specification listed in that issue of the Department of Defense Index of Specifications and Standards (DODISS) specified in the solicitation: MIL-C-28754. *

AMSC N/A FSC 5935

DISTRIBUTION STATEMENT A. Approved for public release; distribution is unlimited.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.

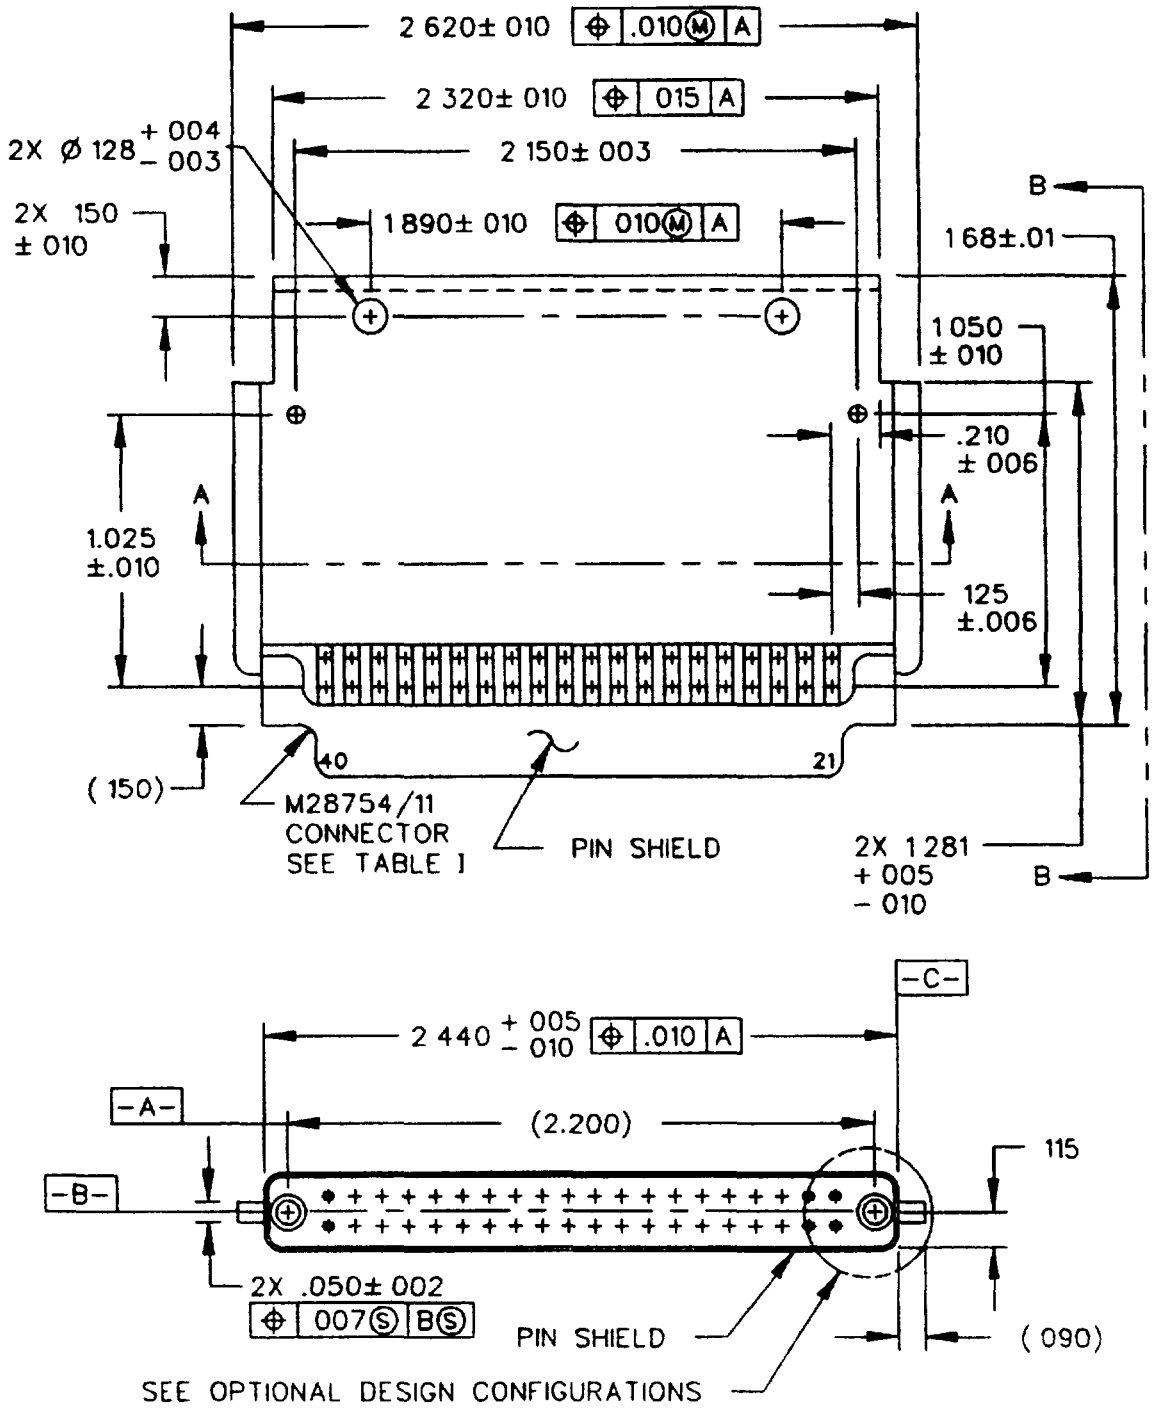

No Hole Pattern - M28754/12-05, and M28754/12-08

FIGURE 1. Connector assembly.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.


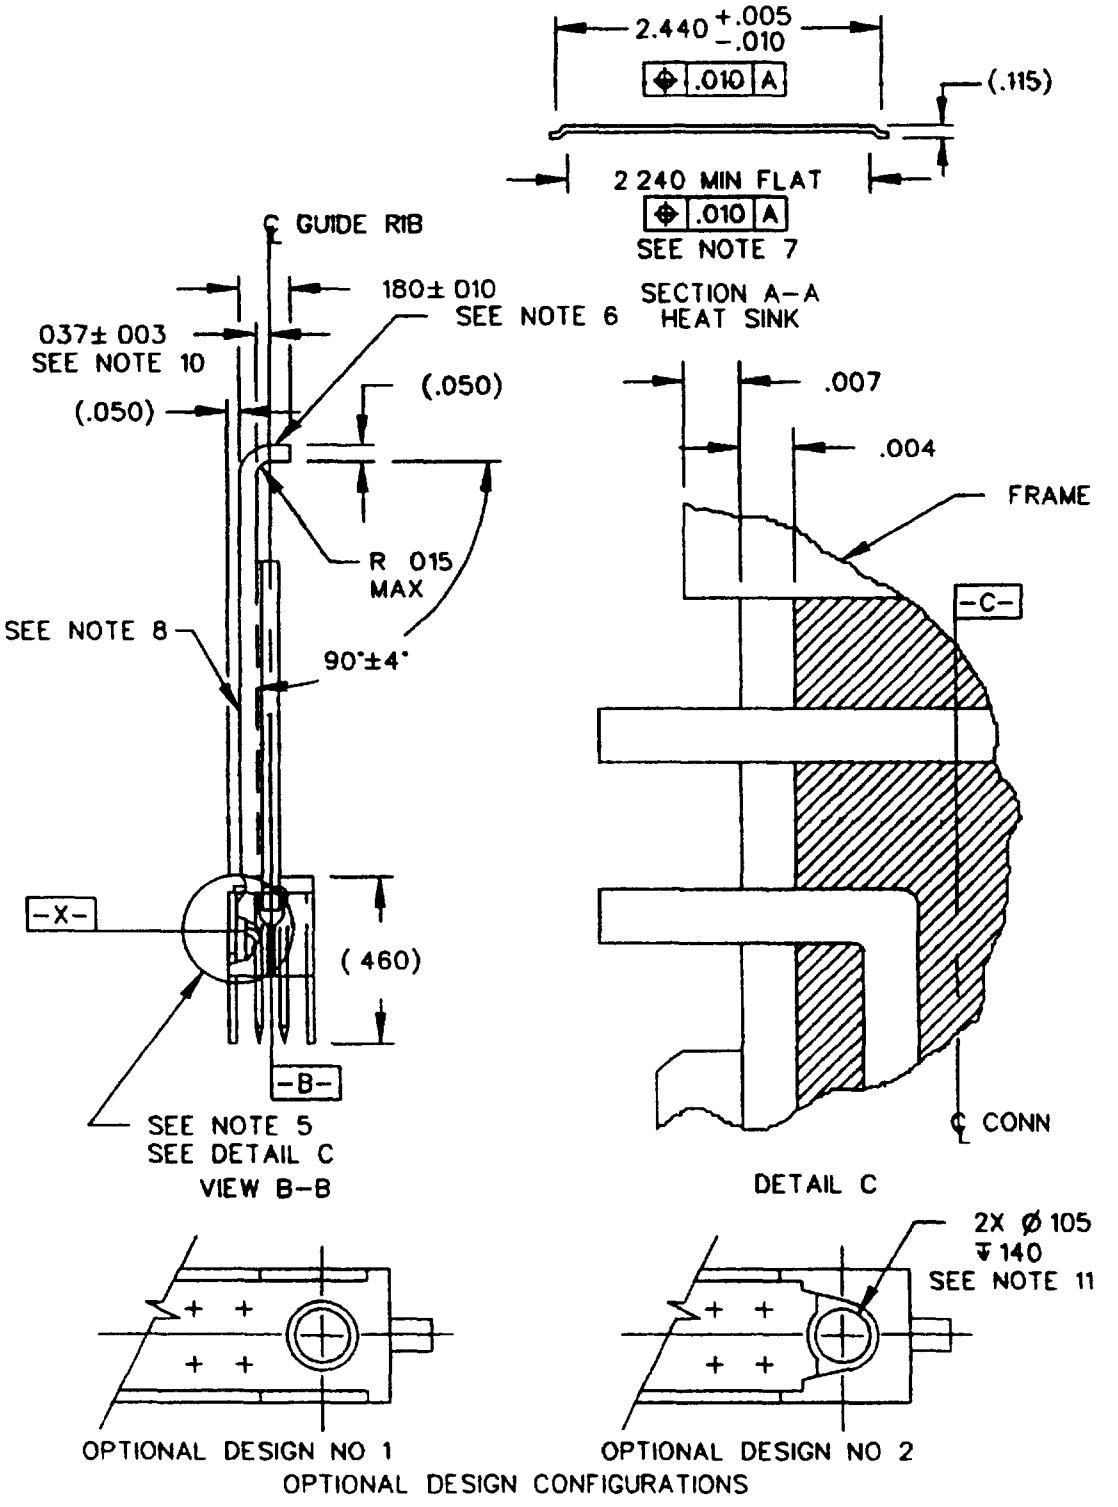


FIGURE 1. Connector assembly - Continued.


Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.

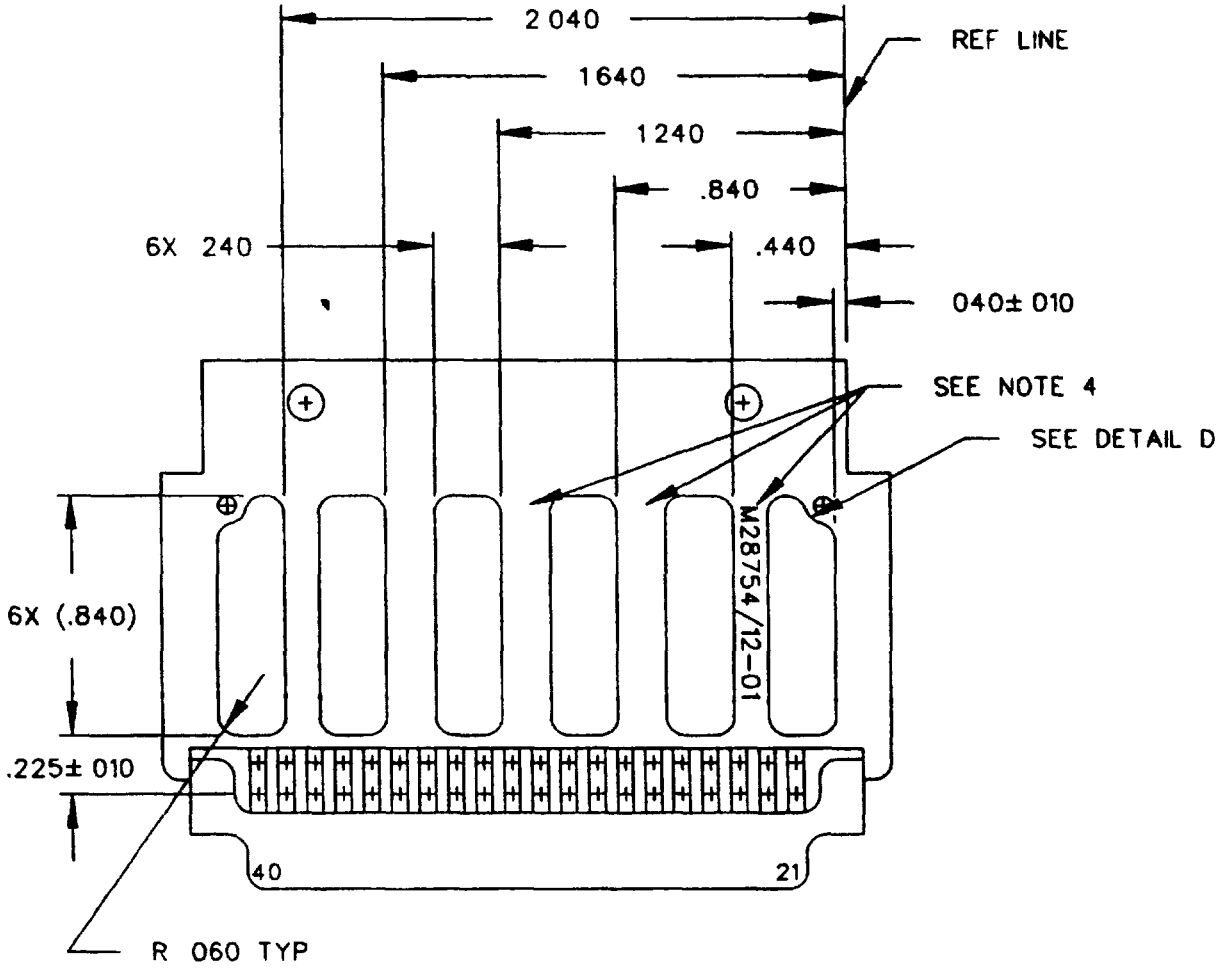

Hole patterns - M28754/12-01, M28754/12-03, and M28754/12-06 *

FIGURE 1. Connector assembly - Continued. *


Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.

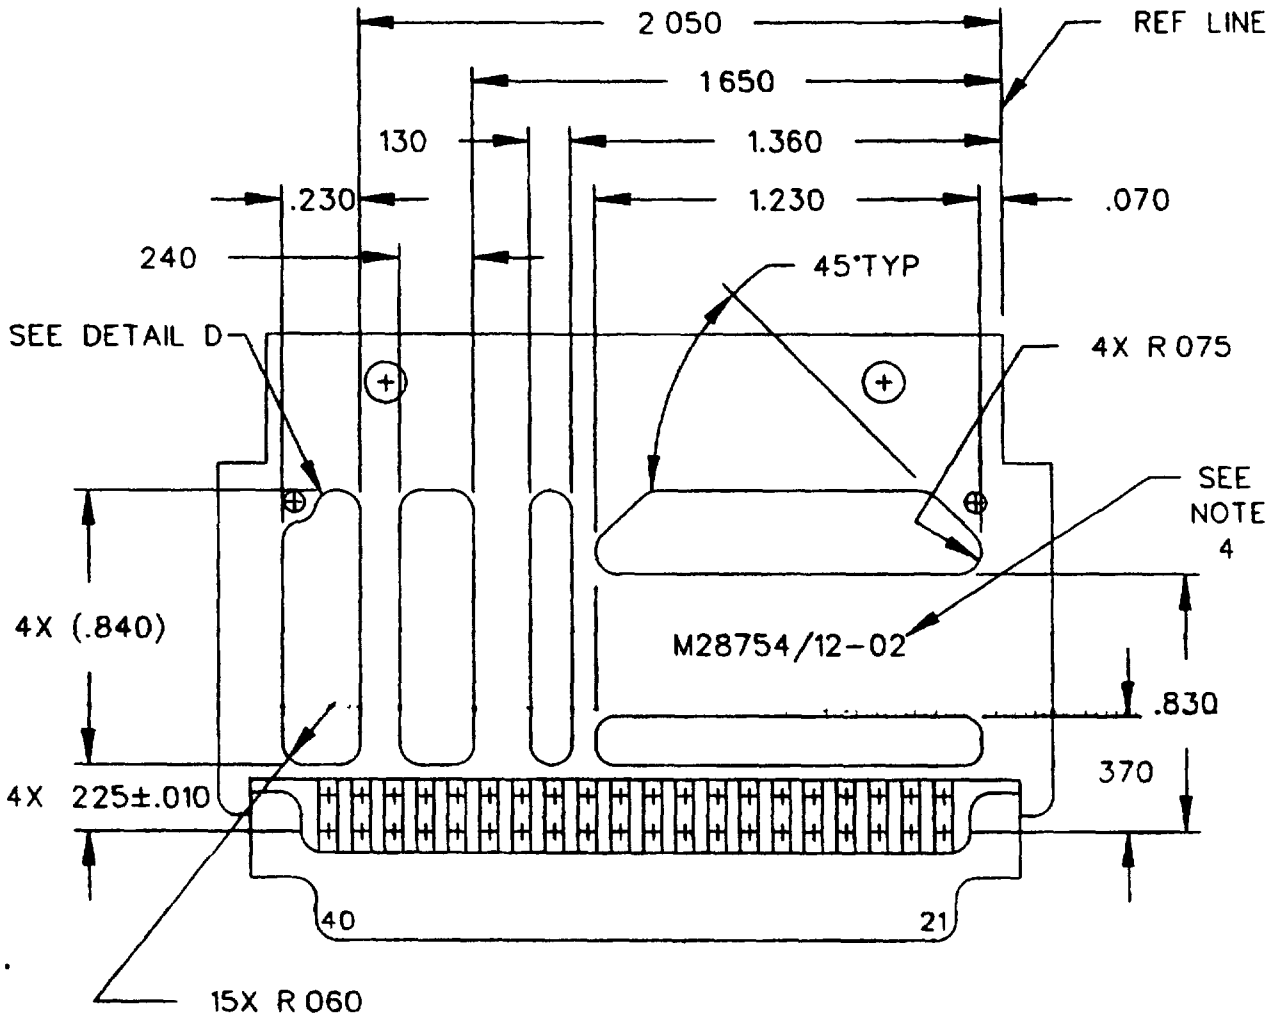

Hole Patterns - M28754/12-02, M28754/12-04, and M28754/12-07 *

FIGURE 1. Connector assembly - Continued. *

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.

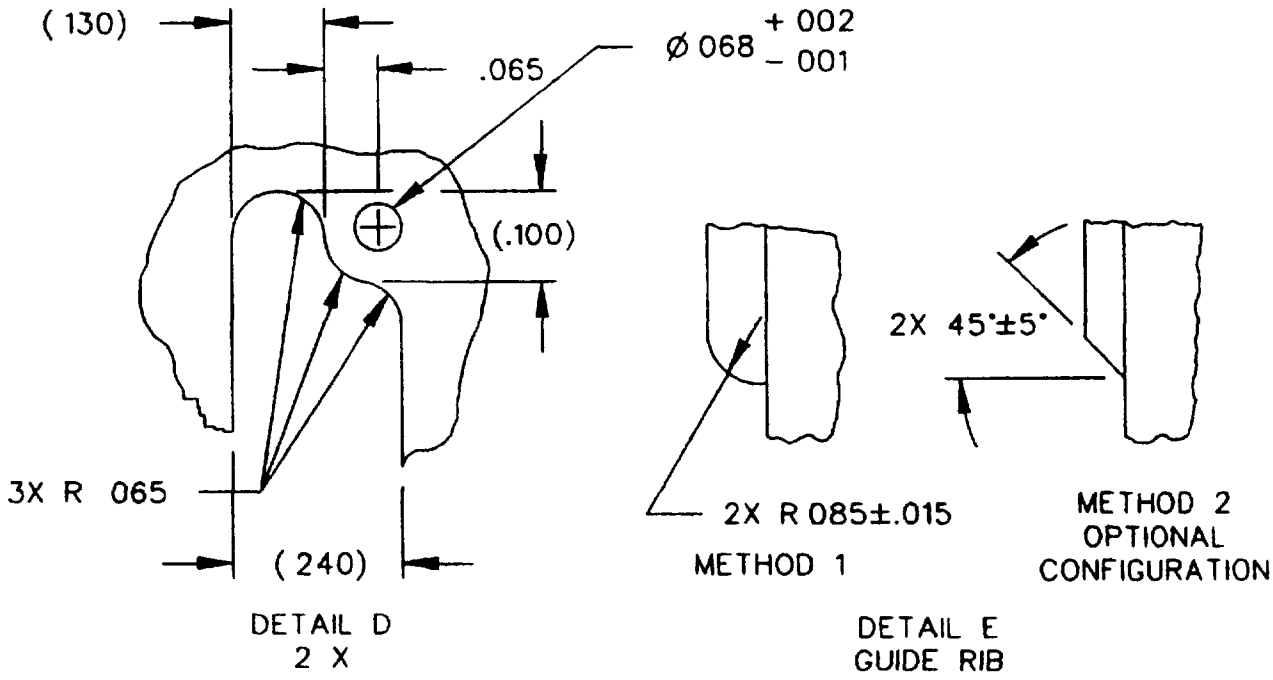

INCHES	MM	INCHES	MM	INCHES	MM	INCHES	MM
0.001	0.03	0.065	1.65	0.210	5.33	1.650	41.91
0.002	0.05	0.068	1.73	0.225	5.72	1.680	42.67
0.003	0.08	0.070	1.78	0.230	5.84	1.890	48.01
0.004	0.10	0.075	1.90	0.240	6.10	2.040	51.82
0.005	0.13	0.085	2.16	0.370	9.40	2.050	52.07
0.006	0.15	0.090	2.29	0.440	11.18	2.150	54.61
0.007	0.18	0.100	2.54	0.460	11.68	2.200	55.88
0.010	0.25	0.105	2.67	0.830	21.08	2.240	56.90
0.015	0.38	0.115	2.92	0.840	21.34	2.320	58,93
0.020	0.51	0.125	3.18	1.025	26.04	2.440	61.98
0.034	0.86	0.128	3.25	1.050	26.67	2.620	66.55
0.037	0.94	0.130	3.30	1.230	31.24		
0.040	1.02	0.140	3.56	1.240	31.50		
0.050	1.27	0.1475	3.746	1.281	32.54		
0.06	1.5	0.150	3.81	1.360	34.54		
0.060	1.52	0.180	4.57	1.640	41.66		

FIGURE 1. Connector assembly - Continued. *

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.

NOTES:

1. Dimensions are in inches.

2. Metric equivalents are given for general information only and are based upon 1.00 inch = 25.4 mm.

3. Unless otherwise specified, tolerances are plus or minus 0.005 inch (0.13 mm) on decimals and plus or minus 2° on angles.

4. Mark in this area in white or yellow characters, 0.06 inch (1.5 mm) high, either side.

5. Frame surface shall be flush with the connector within plus 0.007 inch (0.18 mm), minus 0.004 inch (0.01 mm).

6. Top surface of the fin shall be flat for a minimum 0.090 inch (2.29 mm) width along the total length.

7. Frame shall be flat within 0.006 inch (0.15 mm) T.I.R. in area described by section "A-A".

8. Frame shall be perpendicular to connector mating interface within plus 0.005 inch (0.13 mm) (solder tail side) minus 0.010 inch (0.25 mm) opposite side..

9. Datum "B" is established by a plane passing though the center of the keying pin holes located by the 2.200 inch (55.88 mm) dimension.

10. The 0.037 inch (0.94 mm) plus or minus 0.003 inch (0.08 mm) dimension is measured from the Guide Rib Centerline.

11. For -06, -07, or -08, 0.095 plus or minus 0.001 dia x 0.150 deep. *

FIGURE 1. Connector assembly - Continued.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.

REQUIREMENTS:

Dimensions and configurations: See figure 1.

Applicable connector: See table I.

Frame: Aluminum alloy 5052, H32, H34, or H38 in accordance with QQ-A-350/8. Anodized black in accordance with MIL-A-8625, type II, class 2.

Marking: In accordance with MIL-C-28754, table I and figure 1.

Military part number: M28754/12- (dash number from table I).

Qualifications testing: Perform the applicable tests as specified in MIL-C-28754 and the appendix thereto. *

Extended qualifications: Qualification of M28754/12-01, /12-02, /12-03, /12-04, or /12-05 extends qualification to other products as specified in the appendix to MIL-C-28754. Qualification of M28754/12-06, /12-07, or /12-08 extends qualification to other products as specified in the appendix to MIL-C-28754. *

Changes from previous issue: The margins of this specification sheet are marked with asterisks to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.

TABLE I. Dash number and applicable connector.

Dash no.	Applicable connector	Description	Supersedes drawing no.	
01	M28754/11-01	Uninsulated pin shield	0102-655, code 28687	
02	M28754/11-01	Uninsulated pin shield	900AS2005, code 30003	
03	M28754/11-02	Insulated pin shield		
04	M28754/11-02	Insulated pin shield		
05	M28754/11-02	Insulated pin shield		
06	M28754/11-03	Insulated pin shield		*
07	M28754/11-03	Insulated pin shield		*
08	M28754/11-03	Insulated pin shield		*

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.

Custodians:
Army - CR
Navy - SH
Air Force - 85

Review activities:
Navy - MC
Air Force - 11, 99
DLA - ES

User activities:
Army - AR, MI
Navy - AS

Agent:
NW

Preparing activity:
Navy - SH

(Project 5935-3770-04)

Source: https://assist.dla.mil -- Downloaded: 2026-10-20T14:33Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

INSTRUCTIONS

1. The preparing activity must complete blocks 1, 2, 3, and 8. In block 1, both the document number and revision letter should be given
2. The submitter of this form must complete blocks 4, 5, 6, and 7.
3. The preparing activity must provide a reply within 30 days from receipt of the form

NOTE: This form may not be used to request copies of documents, nor to request waivers, or clarification of requirements on current contracts. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements

I RECOMMEND A CHANGE:	1. DOCUMENT NUMBER MIL-C-28754/12F	2. DOCUMENT DATE (YYMMDD)

3. DOCUMENT TITLE Connectors, Electrical, Modular, Connector Assembly, Type IV, Single Span (For Solid State or Dip Frame)

4. NATURE OF CHANGE *(Identify paragraph number and include proposed rewrite, if possible Attach extra sheets as needed.)*

5. REASON FOR RECOMMENDATION

6. SUBMITTER

a. NAME (Last, First, Middle Initial)	b. ORGANIZATION	
c. ADDRESS (Include Zip Code)	d. TELEPHONE (Include Area Code) (1) Commercial (2) AUTOVON (If applicable)	7. DATE SUBMITTED (YYMMDD)

8. PREPARING ACTIVITY

a NAME Technical Point of Contact (TPOC): Mr. Robert F. Dilger (Code 602A) PLEASE ADDRESS ALL CORRESPONDENCE AS FOLLOWS:	b TELEPHONE (Include Area Code) (1) Commercial TPOC: 812-854-1528 (2) AUTOVON 88-482-1528
c ADDRESS (Include Zip Code) Commanding Officer Naval Weapons Support Center ATTN: Robert F. Dilger, Bldg. 2940W, Code 602A Crane, Indiana 47522-5060	IF YOU DO NOT RECEIVE A REPLY WITHIN 45 DAYS, CONTACT. Defense Quality and Standardization Office 5203 Leesburg Pike, Suite 1403, Falls Church, VA 22041-3466 Telephone (703) 756-2340 AUTOVON 289-2340

Source: https://assist.dla.mil -- Downloaded: 2026-10-20114:33Z
Check the source to verify that this is the current version before use.