MIL-G-13706D (PA)
17 October 1975
Superseding
MIL-G-13706C (MU)
22 January 1968

MILITARY SPECIFICATION

GRENADE, HAND, OFFENSIVE, MK3A2 WITH FUZE M206A2 LOADING, ASSEMBLING AND PACKING

*This specification is approved for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the loading, assembling and packing for one type of grenade, designated as Grenade, Hand, Offensive, MK3A2 with Fuze M206A2.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids, or request for proposals, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification For

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes (ABC-STD-105)
MIL-STD-1169 - Packaging, Packing and Marking for Shipment of Inert Ammunition Compnents

FSC: 1330

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

DRAWINGS

U.S. ARMY PICATINNY ARSENAL

9211614 - Container, Fiber, Ammunition, For Grenade, Hand, Offensive, MK2A2 w/Fuze M206A2
9211615 - Box, Packing, Ammunition, for Grenade, Hand, Offensive, MK3A2, w/Fuze M206A2
9215458 - Grenade, Hand, Offensive, MK3A2 w/Fuze M206A2

(Copies of specifications, standards and drawings required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer).

*(For meaning of asterisk see paragraph 6.7)

3. REQUIREMENTS

3.1 Material. - Materials shall be in accordance with applicable drawings and specifications.

3.2 Grenade. - The grenade shall comply with all requirements specified on Drawing (dwg.) 9215458 and with all requirements specified in applicable specifications.

3.3 Functioning. - The grenade shall detonate in not less than three (3) seconds nor more than 10 seconds without evidence of large fragments of unburned explosive.

3.4 Release resistance. - The safety clip shall not be disengaged from its assembled position over the lever by a load of less than twenty-five (25) ounces when tested (see 6.4).

3.5 X-ray examination of M206A2 Fuze, Grenade, prior to loading in the MK3A2 Hand Grenade. - Each fuze shall be x-rayed and its radiograph shall be examined before loading of the fuze in the grenade body for the following defects: delay column missing; short delay column; variation in column density; voids at bottom of delay column; anvil punch penetration at bottom of delay column; porosity in the fuze body, broken styphnate and azide in detonator cup, foreign matter in delay column. This examination shall be conducted as specified.

Source: https://assist.dla.mil -- Downloaded: 202610-18T02:10Z
Check the source to verify that this is the current version before use.

3.6 Workmanship. - All parts and assemblies shall be fabricated and loaded in a thorough workmanlike manner, and all manufacturing, processing, and assembly operations shall be correctly performed. They shall be clean and free of burrs, sharp edges, unblended radii, surface defects, chips, dirt, grease and oil (except where specifically required), corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part or assembly nor shall they be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined. Required packing shall be dry.

3.7 First Article Inspection. - This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for Inspection and Standard Quality Assurance Provisions. - Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

*4.2 Classification of inspections. - The following types of inspection shall be conducted on this item.

a. First Article Inspection

b. Quality Conformance Inspection

4.3 First Article Inspection

*4.3.1 Submission. - The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2 and 4.3.3. The first article sample shall consist of the following items in sample quantities as indicated.

*4.3.2 Inspections to be performed. - See MIL-A-48078 and paras 4.4.2.1 thru 4.4.2.7, testing per para 4.4.3, and Table I specified herein.

*4.3.3 Rejection. - (See MIL-A-48078).

Source: https://assist.dla.mil -- Downloaded: 202610-18T02:10Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-G-13706D (PA)

PARAGRAPH	TITLE Grenade, Hand, Offensive, MK3A2 with Fuze M206A2 Loading, Assembling and Packing		SHEET 1 OF 2		DRAWING NUMBER See Below NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Charge (Dwg. 9215460) Examination for Defects	15	100%	3.2	4.4.2.1
	Loading Assembly, Prior to Assembly of Cover (Dwg. 9215459) Examination for Defects	15	100%	3.2	4.4.2.2
	Loading Assembly Prior to Assembly of Fuze (Dwg. 9215459) Examination for Defects	15	100%	3.2	4.4.2.3
	Fuze Prior to Assembly in Grenade Body (Dwg. 9215458) Examination for Defects	15	100%	3.2	4.4.2.4
	Assembly (Dwg. 9215458) Examination for Defects	15	100%	3.2	4.4.2.5
	Assembly (Dwg. 9215458) Functioning	30	100%	3.3	4.5.1

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-G-13706D (PA)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
	Grenade, Hand, Offensive, MK3A2 with Fuze M206A2 Loading, Assembling and Packing				See Below
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Assembly (Dwg. 9244148) Release Resistance	30	100%	3.4	4.5.2
	Fuze Prior to Assembly in Grenade Body (Dwg. 9215458) X-Ray Examination	30	100%	3.5	4.5.3

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection

*4.4.1 Inspection lot formation. - Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In additions, inspection lots of grenades shall contain:

a. Charges from one supplier containing not more than two lots of TNT from one manufacturer.

b. Fuze well liners from one manufacturer.

c. Fuzes from not more than one serial lot of one lot interfix number from one manufacturer.

d. Parts of one lot interfix number from one manufacturer.

*4.4.2 Examination. - (See MIL-A-48078). Unless otherwise specified in the classification of defects and test tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection level II. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-G-13706D (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9215460
4.4.2.1	Charge				NEXT HIGHER ASSEMBLY 9215458
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Weight of charge		0.40%	3.2	Balance
132	Diameter of fuze well, minimum, (min.)		0.40%	3.2	Gage
133	Depth of fuze well, min.		0.40%	3.2	Gage
134	Concentricity of fuze well diameter to outside diameter		0.40%	3.2	Gage
Minor					
201	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-G-13706D (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.2	Loading Assembly, Prior to Assembly of Cover				9215459
					NEXT HIGHER ASSEMBLY 9215458
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Pad missing, improperly assembled or torn		0.40%	3.2	Visual
132	Charge cracked or broken		0.40%	3.2	Visual
133	Presence of foreign material in body, fuze well, or on charge		0.40%	3.2	Visual
134	Coating compound missing or inadequate on body tube		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-G-13706D (PA)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.3	Loading Assembly Prior to Assembly of Fuze		9215459
			NEXT HIGHER ASSEMBLY
			9215458

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Cover loose		0.40%	3.2	Manual
132	Fuze threads damaged.		0.40%	3.2	Visual
133	Explosive visible through any opening except fuze well		0.40%	3.2	Visual
Minor					
201	Length, max		0.65%	3.2	Gage
202	Loose charge		0.65%	3.2	Manual
203	Marking missing, misleading or unidentifiable		0.65%	3.2	Visual
204	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20260-18T02:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-G-13706D (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.4	Fuze Prior to Assembly in Grenade Body				9215458
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Fiber glass sleeve missing		100%	3.2	Visual
Major B					
131	Adhesive missing or inadequate on fuze thread		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-G-13706D (PA)

PARAGRAPH	TITLE		SHEET 1 OF 2		DRAWING NUMBER 9215458
4.4.2.5	Assembly				NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical					
1	Safety pin prongs incorrectly formed or cracked		100%	3.2	Visual
2	Pull ring assembly missing		100%	3.2	Visual
3	Safety clip missing or incorrectly assembled		100%	3.2	Visual
4	Either or both lever hinge ears missing		100%	3.2	Visual
5	Both lever hinge ears not bent away from the body past the vertical centerline of the body hinge bosses		100%	3.2	Visual/Figure 1B
6	Ends of both lever hinge ears not bent upwards		100%	3.2	Visual/Figure 1A
Major A					
101	Either lever hinge ear not bent away from the body past the vertical centerline of the body hinge boss		0.40%	3.2	Visual/Figure 1B
102	End of either lever hinge ear not bent upwards		0.40%	3.2	Visual/Figure 1A
Test	Release Resistance	500	(a)	3.4	4.5.2

NOTES: (a) Accept with 5 or less defects
Reject with 6 or more defects

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20260-18T02:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-G-13706D (PA)

PARAGRAPH	TITLE		SHEET 2 OF 2		DRAWING NUMBER
4.4.2.5	Assembly				9215458
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Major B					
131	Length		0.40%	3.2	Gage
132	Fuze not seated		0.40%	3.2	Visual
133	Fuze loose		0.40%	3.2	Manual
Minor					
201	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20260-18T02:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-G-13706D (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.6	Sealed Fiber Container				9211614
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Container cut or damaged through all impregnated layers		0.40%	3.2	Visual
132	Tape incomplete or badly wrinkled		0.40%	3.2	Visual
133	Metal ends loose, distorted or punctured		0.40%	3.2	Visual
134	Grenade missing		0.40%	3.2	Visual
Minor					
201	Tear tab length		0.65%	3.2	Gage
202	Contents loose		0.65%	3.2	Manual
203	Excessive gap between cover and body		0.65%	3.2	Visual
204	Marking incorrect, incomplete or illegible		0.65%	3.2	Visual
205	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 20260-18T02:10Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-G-13706D (PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.7	Sealed Packing Box	1 OF 1	9211615
			NEXT HIGHER ASSEMBLY

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Hardware missing, broken or loose		0.40%	3.2	Visual
132	Strapping missing, broken or loose		0.40%	3.2	Visual
133	Contents loose		0.40%	3.2	Manual
134	Box damaged		0.40%	3.2	Visual
135	DOD symbol misleading or unidentifiable		0.40%	3.2	Visual
136	Number of containers incorrect		0.40%	3.2	Visual
Minor					
201	Strapping improperly assembled		0.65%	3.2	Visual
202	Metallic seal unsealed or improperly positioned		0.65%	3.2	Visual
203	Handle insecure		0.65%	3.2	Manual
204	Marking incorrect, incomplete or illegible		0.65%	3.2	Visual
205	Evidence of poor workmanship		1.00%	3.6	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74

Source: https://assist.dla.mil -- Downloaded: 2026-04-18T02:10Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Functioning. - The grenade assemblies shall be observed for any failure to comply with the requirements as classified in Table II.

TABLE II

Functioning time less than min or greater than max (see 3.3)	Critical
Failure to function (see 3.3)	Major A
Evidence of large fragments of unburned explosive (see 3.3)	Major A

4.4.3.1.1 Beginning with the first lot produced and continuing until three (3) consecutive lots have complied with the acceptance criteria specified, eighty (80) grenade assemblies shall be selected for test. The lot shall be rejected if during the test a critical defect occurs, or if three (3) or more assemblies exhibit any of the major defects listed in Table II.

4.4.3.1.2 After three (3) consecutive accepted lots have complied with the criteria of 4.4.3.1.1, thirty (30) grenade assemblies shall be selected for test. The lot shall be accepted on zero failures and shall be rejected if a critical defect occurs or if two or more assemblies exhibit any of the major defects listed in Table II. The lot shall undergo a retest of thirty (30) samples if one major defect (see Table II) occurs in the initial sample group. Upon retesting the lot shall be rejected if a critical defect occurs or if two or more assemblies exhibit any of the major defects tested in Table II.

4.4.3.2 X-ray examination of Fuze Assembly prior to loading in MK3A2 Hand Grenade (see para. 3.5). - Each fuze assembly, prior to loading into the MK3A2 Grenade shall be subject to the examination for the following:

a. Missing delay column (Critical defect)
b. Short delay column (Critical defect)

Source: https://assist.dla.mil -- Downloaded: 202610-18T02:10Z
Check the source to verify that this is the current version before use.

c. Variation in column density (Major A defect)
d. Voids at bottom of delay column (Major A defect)
e. Anvil punch penetration at bottom of delay column (Major A defect)
f. Porosity in the fuze body (Major A defect)
g. Broken styphnate and azide in detonator cup (Major A defect)
h. Foreign matter in delay column (Major A defect)

If any fuze shows evidence of any of the defects listed above, it shall be classed as defective and removed from the lot. The method of fuze examination will be in accordance with para. 4.5.3. Definitions of defective fuzes are defined in para. 6.5.

4.4.4 Inspection Equipment. - The inspection equipment required to perform the inspections and tests prescribed in this specification is identified in the 'Paragraph Reference/ Inspection Method' column in the tables starting with paragraph 4.4.2.1, and the test method paragraphs (see 4.5). The contractor shall submit for approval, inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and section 6.2 herein.

4.5 Test methods and procedures.

4.5.1 Functioning. - The grenade assembly shall be immersed in water maintained at seventy (70) plus or minus five (5) degrees Fahrenheit (F.) for one hour at a depth of not less than two inches. The assembly shall be removed from the water and within one hour shall be mounted in the functioning test fixture specified in 4.4.4 and detonated by remotely removing the safety pin. The fixture and grenade shall be centered in a barricaded arena capable of withstanding the effects of detonation. The grenade assembly shall be observed for compliance with the requirements.

4.5.2 Release resistance. - The load shall be applied slowly and steadily parallel with the safety pin in the clip releasing direction until the total load is supported by the clip. The clip shall be observed for compliance with the requirements.

4.5.3 X-ray examination of M206A2 Fuze Assembly. - Inspection equipment and the image quality of the radiographs

Source: https://assist.dla.mil -- Downloaded: 202610-18T02:10Z
Check the source to verify that this is the current version before use.

for this examination shall be satisfactory to the Procurement Contracting Officer. The direction of the x-ray beam employed in this inspection shall be perpendicular to the axis of the delay tube.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging.

5.1.1 Level A. - Grenades shall be packaged in accordance with dwg. 9211614.

5.2 Packing.

5.2.1 Level A. - The unit packaged grenades shall be packed in accordance with dwg. 9211615.

5.3 Marking. - Marking shall be in accordance with dwgs. 9211614 and 9211615.

6. NOTES

6.1 Ordering Data. - Procurement documents shall specify the following:

a. Title, number and data of this specification.

b. Provisions for submission of first article samples.

c. Provisions of MIL-A-48078.

6.2 Submission of Inspection Equipment Designs for Approval. - (See MIL-A-48078). Submit equipment designs as required, to Commander: Picatinny Arsenal, ATTN: SARPA-QA-T-T, Dover, New Jersey 07801.

6.3 Distribution of ammunition data cards. - Distribution of data cards shall include the following: Commander: Picatinny Arsenal, ATTN: SARPA-QA-A-M and SARPA-AD-E-C2, Dover, New Jersey 07801. Data cards for all lots of grenades and fuzes submitted to 100% x-ray screening should be annotated to reflect performance of this inspection.

6.4 The safety clip shall also be considered disengaged from its assembled position over the lever when the square end

Source: https://assist.dla.mil -- Downloaded: 202610-18T02:10Z
Check the source to verify that this is the current version before use.

of the safety clip moves upon the flat surface of the lever to the extent that the clip does not return to its original assembled position when the load is removed.

6.5 Definitions of Critical and Major defects for use in X-ray examination of fuze assembly.

6.5.1 Missing or short delay column (Critical defect). - This defect is defined as critical when there is no column or when the delay column does not reach the base of the threaded portion of the fuze body.

6.5.2 Variation in column density (Major defect). - This defect is defined as a major defect when there is significant variation within a given delay column of the apparent column density as viewed on the radiograph.

6.5.3 Voids at the bottom of delay column (Major defect). - This defect is classed as a major defect when the void at the bottom of the delay column (detonator end) extends across the entire diameter of the fuze body delay cavity.

6.5.4 Anvil punch penetration at bottom of the delay column (Major defect). - This defect is classed as a major defect when the anvil punch penetration at the bottom of the delay column, including any breakout, extends more than 0.100 inch up into the column. (Note: Fuzes without any other defects which have anvil punch penetration, including breakout, which does not extend more than 0.100 inch up into the column are acceptable providing the height of the delay column is at least 0.700 inch when measured from the top of the anvil punch mark or breakout. Measurement is not made from the base of the delay column).

6.5.5 Porosity in the fuze body (Major defect). - This defect is defined as a major defect when the fuze body, at the intersection of the threaded portion and the delay column, is found to be porous.

6.5.6 Broken styphnate and azide in detonator cup (Major defect). - This defect is defined as a major defect when any broken, crumbled, or loose styphnate and azide is detected in the detonator tube.

6.5.7 Foreign matter in the delay column (Major defect). - The defect is defined as a major defect when any foreign matter

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

is detected in the delay column which could preclude the proper initiation and propagation of the delay element.

6.6 Disposition of defective fuze assemblies.

6.6.1 Critically defective fuze assemblies. - When a critically defective fuze is found, this Arsenal (SARPA-QA-A-M) shall be immediately notified and the fuze held pending disposition and in no instance will the fuze be destroyed without permission of the Procurement Officer.

6.6.2 All defective fuze culled from each lot should be re-x-rayed to confirm their identity, and the effectiveness of the screening process, in addition this Arsenal will be notified on a continuing basis of the quantities and specified types of defects found per lot, so that remedial action may be taken at the fuze contractor's plan.

Asterisks


6.7 The margins of this specification are marked with an asterisk to indicate where changes (additions, modifications, corrections, deletions) from the previous issue were made. This was done as a convenience only and the Government assumes no liability whatsoever for any inaccuracies in these notations. Bidders and contractors are cautioned to evaluate the requirements of this document based on the entire content irrespective of the marginal notations and relationship to the last previous issue.

Custodian:
Army-PA


Preparing Activity:
Army-PA

Project Number: 1330-A-055

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

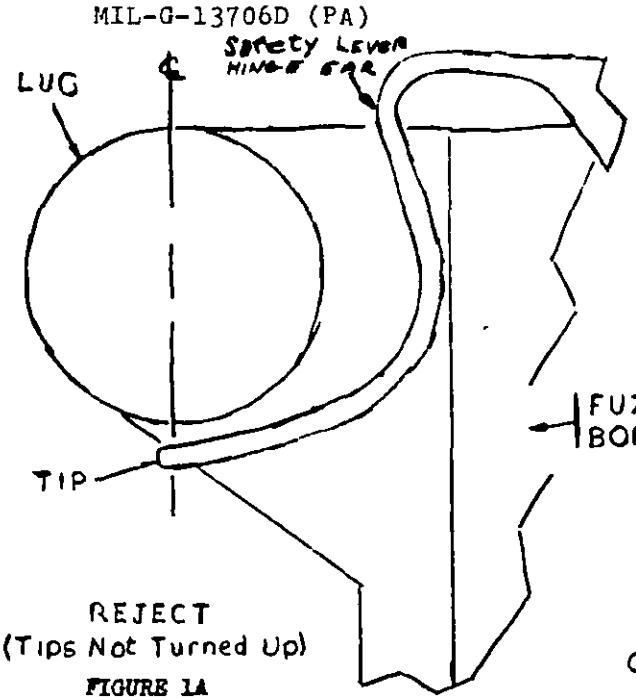

REJECT
(Tips Not Turned Up)
FIGURE 1A

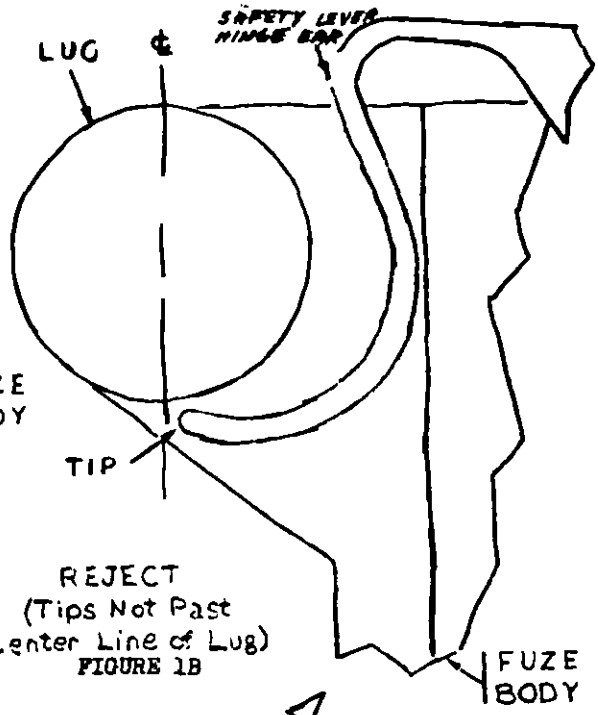

REJECT
(Tips Not Past
Center Line of Lug)
FIGURE 1B

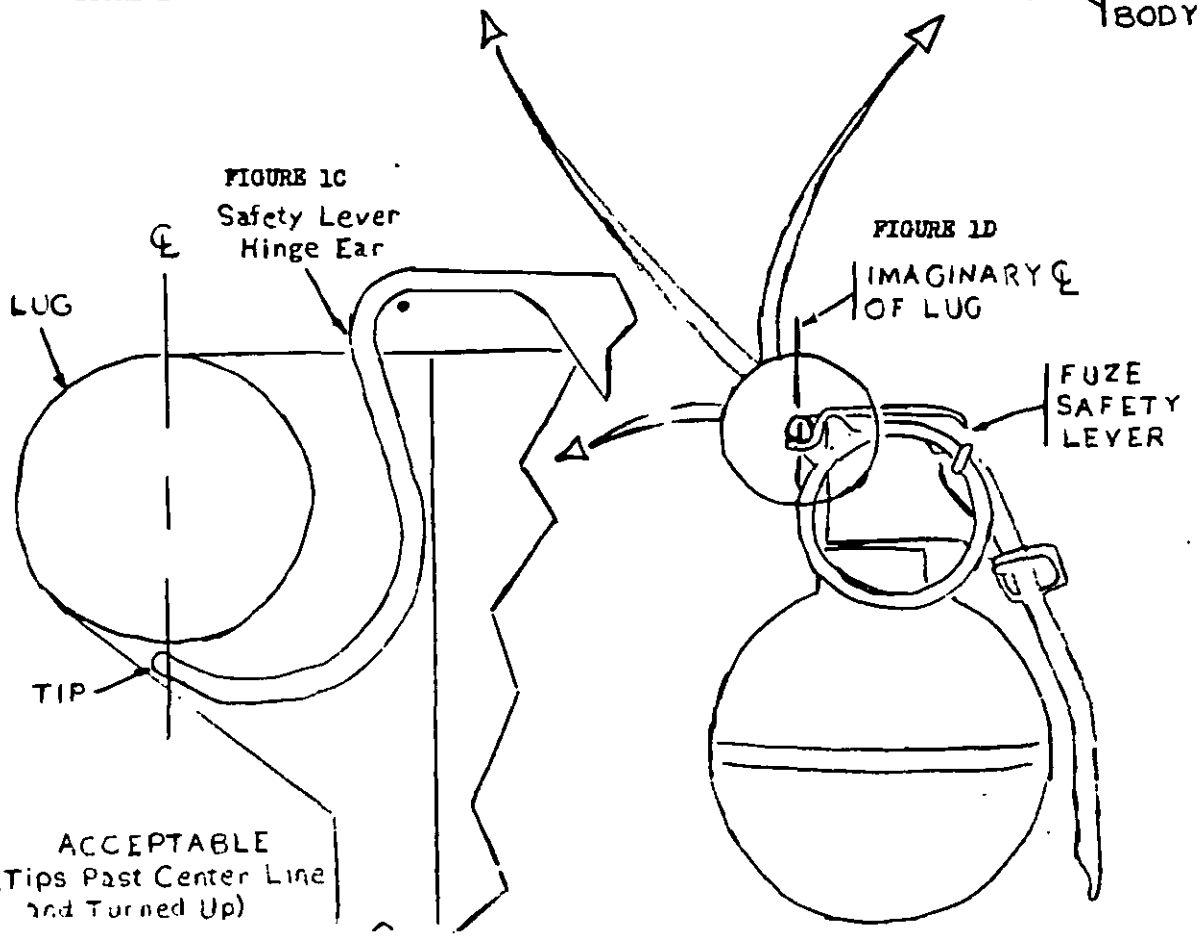


FIGURE 1

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

FOLD

POSTAGE AND FEES PAID
DEPARTMENT OF THE ARMY
DOD – 314



OFFICIAL BUSINESS
PENALTY FOR PRIVATE USE $300

COMMANDER
Picatinny Arsenal
ATTN: SARPA-QA-N-Q
Dover, New Jersey 07801

FOLD

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

DD FORM 1 JAN 72 1426 REPLACES EDITION OF 1 JAN 66 WHICH MAY BE USED

Source: https://assist.dla.mil -- Downloaded: 2026-10-18T02:10Z
Check the source to verify that this is the current version before use.