MILITARY SPECIFICATION

# FUZE, GRENADE: HAND, PRACTICE, M228 PARTS FOR, AND LOADING, ASSEMBLING AND PACKING (RENOVATED)

This specification is approved for use by Picatinny Arsenal, Department of the Army and is available for use by all Departments and Agencies of the Department of Defense.

## 1. SCOPE

1.1 This specification covers the renovation of the Fuze, Hand Grenade, M213 to Fuze, Grenade: Hand, Practice, M228.

## 2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein:

SPECIFICATIONS

MILITARY

MIL-P-116 - Preservation, Method of
MIL-P-223 - Powder, Black
MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification For
MIL-F-14943 - Fuze, Grenade: Hand, Practice, M228 Parts For, and Loading, Assembling and Packing

STANDARDS

MILITARY

MIL-STD-105 - Sampling Procedures and Tables for Inspection by Attributes (ABC-STD-105)
MIL-STD-414 - Sampling Procedures and Tables for Inspection by Variables for Percent Defective

FSC: 1330

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

MIL-STD-1235 - Single and Multilevel Continuous Sampling Procedures and Tables for Inspection by Attributes

DRAWINGS

U.S. ARMY PICATINNY ARSENAL

PRODUCT AND PACKAGING DRAWINGS

9235210 - Fuze, Grenade: Hand, Practice, M228
9251665 - Box, Wirebound, Packing, Ammunition, for Fuze, Hand Grenade, M213, M215 or Practice, Delay, M228
9251666 - Carton, Packing, Ammunition, for Fuze, Hand Grenade, M213, M215 or Practice, Delay, M228

INSPECTION EQUIPMENT DRAWINGS

8816636 - Adapter Drop Test
9278658 - Training Manual For Radioisotopic Automatic Hand Grenade Fuze Checker

(Copies of specifications, standards and drawings required by suppliers in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer.)

## 3. REQUIREMENTS

3.1 Material. - Materials shall be in accordance with the applicable drawings and specifications.

3.2 Fuze. - The fuze shall comply with all requirements specified on Drawing (dwg.) 9235210, all associated drawings, and with all requirements specified in applicable specifications.

3.3 Fuze Body. - There shall be no evidence of cuts in fuze body after removal of the detonator assembly nor evidence of explosive on fuze body or in flash hole.

3.4 Functioning. - The fuze shall not dud (see 6.5) nor fail to function because of a "hung" striker (see 6.6). It shall function high order (see 6.7), and shall comply with the following delay time requirements:



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

3.4.1 Premature. - The fuze shall not function in less than three (3) seconds.

3.4.2 Normal Delay. - The fuze shall function in not less than four (4) nor more than five (5) seconds.

3.4.3 Excessive Delay. - No fuze shall have a functioning delay time greater than ten (10) seconds.

3.5 Workmanship. - All parts and assemblies shall be fabricated and loaded in a thorough workmanlike manner, and all manufacturing, processing, and assembly operations shall be correctly performed. They shall be clean and free of burrs, sharp edges, unblended radii, surface defects, chips, dirt, grease and oil (except where specifically required), corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part or assembly nor shall they be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined. Required packing shall be dry.

3.6 First Article Inspection. - This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

## 4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for Inspection and Standard Quality Assurance Provisions. - Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspections. - The following types of inspection shall be conducted on this item.

a. First Article Inspection
b. Quality Conformance Inspection

4.3.1 Submission. - The contractor shall submit a first article sample as designated by the Contracting Officer for evaluation in accordance with provisions of 4.3.2 and 4.3.3. The first article sample shall consist of: sets of parts,



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

every subassembly and completely loaded fuze assemblies as specified in Table 1.

4.3.2 Inspections to be performed. - See MIL-A-48078 and paras 4.4.2.1 thru 4.4.2.6 testing per para. 4.4.3, and Table I specified herein.

4.3.3 Rejection. - See MIL-A-48078



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

TABLE 1 - FIRST ARTICLE INSPECTION

**CLASSIFICATION OF DEFECTS & TESTS**

| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| | Fuze, Grenade; Hand Practice, M228 (Renovated) | | | | See Below |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| | Igniter Case Assembly, (Dwg. 9235948) | | | | |
| | Examination for Defects | 25 | 100% | 3.2 | 4.4.2.1 |
| | Fuze Assembly (Dwg. 9235210) | | | | |
| | Examination for Defects | 25 | 100% | 3.2 | 4.4.2.10 |
| | Automatic Inspection of Delay Column (a) | 500 | 100% | 3.2 | 4.4.3.5 |
| | And Igniter Case Assembly | | | | |
| | Safety Pin Withdrawal (Lower Limit) (b) | 500 | 100% | 3.2 | 4.4.3.6.2 |
| | (Upper Limit) | 500 | 100% | 3.2 | 4.4.3.6.1 |
| | Functioning | 500 | 100% | 3.2 | 4.4.3.2 |

(a) Prior to performing the functioning test, the five-hundred samples shall be subjected to the testing prescribed in 4.4.3.5, 4.4.3.6.1 and 4.4.3.6.2.

NOTES:

(b) Upper limit to be performed in conjunction with the functioning test specified in 4.4.3.2.2.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection.

4.4.1 Inspection lot formation. - Inspection lots shall comply with the lot formation provisions of MIL-A-48078. In addition, inspection lots of fuzes shall contain:

a. Metal parts or metal parts assemblies of one lot interfix number from one manufacturer.
b. Black powder of one lot number from one manufacturer.
c. Previously assembled M213 fuzes from not more than one lot from one manufacturer, except that lots from one manufacturer consisting of less than 1000 fuzes may be combined into hybrid lots of not more than 10,000 fuzes.

4.4.2 Examination. - (See MIL-A-48078). Unless otherwise specified in the classification of defects and test tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.4.4.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

# CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63056(PA)

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.1 | Igniter Case Assembly | 1 | 1 | 9235948 |
| | | | | NEXT HIGHER ASSEMBLY 9235210 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major B 131 | Weight of black powder | | 0.40% | 3.2 | Balance |
| Minor 201 | Evidence of poor workmanship | | 1.00% | 3.5 | Visual |

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

# CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63056(PA)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.2 | Lever | 1 OF 1 | 8822378 |
| | | | NEXT HIGHER ASSEMBLY: 9235210 |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major | None defined | | | | |
| Minor | | | | | |
| 201 | Protective coating missing or base metal exposed | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.00% | 3.5 | Visual |

NOTES:

SARPA-QA FORM 2567 FEB 74 4810



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9235210 |
|---|---|---|---|---|---|
| 4.4.2.3 | Fuze Assembly, Prior to Assembly of Igniter Case Assembly | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Presence of Explosive | | 100% | 3.3 | Visual |
| Major | None defined | | | | |
| Minor | None defined | | | | |

NOTES:

SARPA-QA FORM 2567 FEB 74 4B10



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

**CLASSIFICATION OF DEFECTS & TESTS** MIL-F-63056 (PA)

| PARAGRAPH | TITLE | | SHEET 1 OF 2 | | DRAWING NUMBER |
|---|---|---|---|---|---|
| 4.4.2.4 | Fuze Assembly | | | | 9235210 |
| | | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | | | | | |
| 1 | Crack in igniter case assembly | | 100% | 3.2 | Visual |
| 2 | Safety pin ends incorrectly formed or cracked | | 100% | 3.2 | Visual |
| 3 | Automatic inspection marks (two) missing | | 100% | 3.2 | Visual |
| 4 | Igniter crimp incomplete, nonuniform or contains cusps | | 100% | 3.2 | Visual |
| 5 | Safety clip missing or incorrectly assembled | | 100% | 3.2 | Visual |
| 6 | Either or both lever hinge ears missing | | 100% | 3.2 | Visual |
| 7 | Both lever hinge ears not bent away from the body past the vertical centerline of the body hinge bosses | | 100% | 3.2 | Visual/Figure 1B |
| 8 | Ends of both lever hinge ears not bent upwards | | 100% | 3.2 | Visual/Figure 1A |
| 9 | Igniter case assembly color incorrect | | 100% | 3.2 | Visual |
| Major A | | | | | |
| 101 | Either lever hinge ear not bent away from the body past the vertical centerline of the body hinge bosses | | 0.40% | 3.2 | Visual/Figure 1B |
| 102 | End of either lever hinge ear not bent upwards | | 0.40% | 3.2 | Visual/Figure 1A |

NOTES:

SARPA-QA FORM 2567 FEB 74 4810



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63056(PA)

| PARAGRAPH | TITLE | SHEET | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.4 | Fuze Assembly | 2 OF 2 | 9235210 |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Major B | | | | | |
| 131 | Functional concentricity of igniter case assembly with thread | | 0.40% | 3.2 | Gage |
| 132 | Distance from flat on body to bottom of igniter case assembly | | 0.40% | 3.2 | Gage |
| 133 | Diameter of igniter case assemlby crimps | | 0.40% | 3.2 | Gage |
| 134 | Sealing compound missing or incomplete | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Protective coating damaged to extent that base metal is exposed | | 0.65% | 3.2 | Visual |
| 202 | Marking missing, incorrect or illegible | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.00% | 3.5 | Visual |

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

11

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS



| PARAGRAPH | TITLE | | SHEET 1 OF 1 | | DRAWING NUMBER 9251666 |
|---|---|---|---|---|---|
| 4.4.2.5 | Sealed Carton | | | | NEXT HIGHER ASSEMBLY |
| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
| Critical | None defined | | | | |
| Major B | | | | | |
| 131 | Carton punctured, cut or torn | | 0.40% | 3.2 | Visual |
| 132 | Sealing strip incomplete or badly wrinkled | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Contents move when shaken | | 0.65% | 3.2 | Manual |
| 202 | Marking missing, misleading or unidentifiable | | 0.65% | 3.2 | Visual |
| 203 | Evidence of poor workmanship | | 1.00% | 3.5 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

## CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63056(PA)

| PARAGRAPH | TITLE | SHEET 1 OF 1 | DRAWING NUMBER |
|---|---|---|---|
| 4.4.2.6 | Sealed Barrier Bag | | 9251666 |
| | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None defined | | | | |
| Major B | | | | | |
| 131 | Seal improper or incomplete | | 0.40% | 3.2 | Visual |
| 132 | Bag punctured, torn or cut | | 0.40% | 3.2 | Visual |
| Minor | | | | | |
| 201 | Marking missing, misleading or unidentifiable | | 0.65% | 3.2 | Visual |
| 202 | Evidence of poor workmanship | | 1.00% | 3.5 | Visual |

NOTES:

SARPA-QA FORM 2567 FEB 74 4810



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

## CLASSIFICATION OF DEFECTS & TESTS

MIL-F-63056(PA)

| PARAGRAPH | TITLE | SHEET | OF | DRAWING NUMBER |
|---|---|---|---|---|
| 4.4.2.7 | Sealed Wooden Packing Box | 1 | 1 | 9251666 |
| | | | | NEXT HIGHER ASSEMBLY |

| CATEGORY | EXAMINATION OR TEST | NO. OF SAMPLE UNITS | AQL OR 100% | REQUIREMENT PARAGRAPH | PARAGRAPH REFERENCE /INSPECTION METHOD |
|---|---|---|---|---|---|
| Critical | None Defined | | | | |
| Major B | | | | | |
| 131 | Box damaged exposing contents | | 0.40% | 3.2 | Visual |
| 132 | DOD symbol misleading or unidentifiable | | 0.40% | 3.2 | Visual |
| 133 | Wire missing, broken or loose | | 0.40% | 3.2 | Visual/Manual |
| Minor | | | | | |
| 201 | Metallic seal missing, unsealed or improperly positioned (Level A shipments only) | | 0.65% | 3.2 | Visual |
| 202 | Marking misleading or unidentifiable | | 0.65% | 3.2 | Visual |
| 203 | Wire loops improperly engaged | | 0.65% | 3.2 | Visual |
| 204 | Evidence of poor workmanship | | 1.00% | 3.5 | Visual |

NOTES:





Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Fuze Body (see 3.3). - Major A Defect - 100% Inspection - Each fuze body after removal of the detonator assembly and prior to assembly of the igniter case assembly shall be examined as specified in 4.5.1 for evidence of cuts. Any fuze body that fails to comply with the requirement shall be classed defective and removed from the lot.

4.4.3.2 Functioning (see 3.4). - The fuzes shall be observed for any failure to comply with the requirements as classified in Table II when tested as specified in 4.5.2, using equipment in accordance with 4.4.4.

TABLE II

| Defect | | Classification |
|---|---|---|
| Premature delay failure | (see 3.4.1) | Critical |
| Excessive delay failure | (see 3.4.3) | Critical |
| "Hung" striker failure | (see 3.4) | Critical |
| Normal delay failure | (see 3.4.2) | Major A |
| Dud | (see 3.4) | Major A |

Five hundred (500) assemblies shall be selected from each lot for static and dynamic tests using two hundred fifty (250) assemblies for each test phase. The lot shall be rejected if any of the following test results occur.

a. A critical defective is found (see Table II).
b. Four (4) or more fuzes dud or function low order.
c. Five (5) or more normal delay failures occur in either group or the combined number of normal delay failures in both groups equals or exceeds eight (8).

4.4.3.3 Automatic Inspection of Delay Column and Igniter Case Assembly. - (see dwg. 9235210 and 9278658).

TABLE III

| Characteristics | Classification |
|---|---|
| Delay column missing, less than 0.7 inch in height, or inadequately consolidated | Critical |



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

Detonator Assembly present Critical

This inspection shall be conducted 100 percent using the specified automatic radioisotopic inspection equipment as per dwg. 9278658 to assure that the fuze assembly does not contain the defects listed in Table III. The inspection shall be performed in accordance with the procedures specified in 4.5.3 (see 6.8). Fuzes rejected by the equipment may be re-inspected one time. Fuzes which are not accepted by the equipment on re-inspection shall be classed defective and removed from the lot.

4.4.3.3.1 Verification Inspection of Delay Column and Igniter Case Assembly (see dwg. 9235210). - A sample of three-hundred (300) fuze assemblies shall be selected from each four hours of production and subjected to reinspection with the automatic radioisotopic inspection equipment for the defect listed in 4.4.3.3, Table III. The sample fuzes shall be selected from production just prior to insertion into the packing container. If any fuzes are found to be defective, all production represented by the sample shall be rejected.

4.4.3.4 Safety Pin Withdrawal (see dwg. 9235210). - Major A defects.

4.4.3.4.1 Lower Limit. - The sampling plan for this test shall be in accordance with MIL-STD-1235, CSP-1 and AQL of 0.40 percent, wherein i = 500 F = 1/100. Any fuzes assembly with a safety pin that fails to comply with the requirements shall be classed defective and removed from the lot. The test procedures and equipment shall be as specified in 4.5.4.

4.4.3.4.2 Upper Limit. - (Pins subjected to this test shall not be returned to the lot). The sampling plan for this test shall be in accordance with MIL-STD-105 using Code Letter K and an AQL of 2.50 percent. Any fuze assembly with a safety pin that fails to comply with the requirement shall be classed defective and removed from the lot. The test procedure and equipment shall be as specified in 4.5.4.

4.4.3.5 Moisture Content of Black Powder (see dwg. 9235948) Major A Defect. - The contractor shall provide adequate controls to assure compliance with the requirements and shall test for verification a minimum of one sample of black powder selected at the loading station at the time of loading from each eight hours production of igniter case assemblies. A composite sample shall not be used. Failure of



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

the sample to comply with the requirement shall cause the black powder represented by the sample, including any igniter case assemblies loaded with the non-conforming powder to be rejected. The contractor shall maintain adequate records to provide identification of the powder used in the loaded igniter case assemblies. Test shall be performed as specified in 4.5.5 using equipment in accordance with 4.4.4.

4.4.4 Inspection Equipment. - The inspection equipment required to perform the inspections and tests prescribed in this specification is identified in the 'Paragraph Reference/ Inspection Method' column in the tables starting with paragraph 4.4.2.1, and the test method paragraphs (see 4.5). The contractor shall submit for approval, inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and section 6.3 herein.

4.5 Test Methods and Procedure. -

4.5.1 Fuze Body. - The fuze body after removal of the detonator assembly and prior to assembly of the igniter case assembly shall be visually examined to determine compliance with the requirement.

4.5.2 Functioning and Delay Time. - The fuzes shall be immersed in water maintained at a temperature of seventy (70) degrees Fahrenheit (F.) plus or minus ten (10) degrees Fahrenheit (F.) for a period of twenty-five (25) plus or minus five (5) minutes. The water shall contain a wetting agent. The fuzes shall be positioned vertically with the top of the fuze approximately six (6) inches below the surface of the water. After removal from the water, the fuzes shall be maintained at a temperature of seventy (70) degrees F. plus or minus ten (10) degrees F. and tested within fifteen (15) minutes by each of the following methods:

4.5.2.1 Static. - The fuze assembly shall be assembled in a fixture. The safety pin shall be pulled and the fuze allowed to function. The functioning order and the recorded delay time shall be observed to determine compliance with the requirements.

4.5.2.2 Dynamic. - The fuze assembly shall be assembled in a fixture as required per dwg. 8816636. The safety pin shall be pulled out and the fuze released to fall four (4) feet to impact on a two (2) inch min. thick steel plate placed with the impact



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

surface perpendicular to the drop axis. The functioning order and delay time shall be observed to determine compliance with the requirements.

4.5.3 Automatic Inspection of Delay Column and Igniter Case Assembly. - The automatic radioisotopic inspection equipment, its operation, calibration, and maintenance shall be in accordance with dwg. 9278658. As a minimum, the inspection equipment shall be checked at each inspection station with the specially designated accept-reject standards, for each hour of production, immediately after each down period, and prior to starting daily production. In addition, whenever a power failure occurs the criteria for calibrating and stabilizing the inspection equipment shall be in accordance with dwg. 9278658. If, at any time the testing operation is found to be improper, the testing device shall be declared inoperative until repaired and all assemblies tested since the last satisfactory check shall be rejected subject to retest. Whenever a defective assembly is found, positive action shall be taken to determine the specific cause of the defect and corrective measures instituted to prevent recurrence. The action taken shall be stated on the Critical Defect Report. The Government representative will examine the testing device, test method, records of inspection and handling, and identification of material undergoing test at regular but unscheduled intervals to determine that the test is being carried out in accordance with these provisions.

4.5.4 Safety pin withdrawal (upper and lower limits). - The fuze assembly shall be assembled in a fixture, and the required withdrawal force applied to the safety pin.

4.5.5 Moisture content of black powder. - The moisture content of the black powder shall be determined in accordance with the procedure specified in MIL-P-223.

4.5.6 Heat seal test of sealed bag. - This test shall be performed as specified in MIL-P-116.

## 5. PREPARATION FOR DELIVERY

### 5.1 Preservation and packaging

5.1.1 Level A. - The fuzes shall be preserved and packaged in accordance with dwg. 9251666.



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

5.2 Packing

5.2.1 Level A. - The cartons shall be packed in accordance with dwg. 9251665.

5.3 Marking. - Marking shall be in accordance with dwg. 9251665 and 9251666.

6. NOTES

6.1 Intended Use. - This fuze is intended to be used with the M69, practice hand grenade.

6.2 Ordering Data. - Procurement documents shall specify the following:

a. Title, number and date of this specification.
b. Provisions for submission of first article samples.
c. Provisions of MIL-A-48078.

6.3 Submission of Inspection Equipment Designs for Approval (See MIL-A-48078). - Submit equipment designs as required, to Commander: Picatinny Arsenal, ATTN: SARPA-QA-T-T, Dover, New Jersey 07801.

6.4 Distribution of ammunition data cards. - Distribution of data cards shall include the following: Commander, Picatinny Arsenal, ATTN: SARPA-QA-A-M, Dover, New Jersey 07801.

6.5 Dud. - A dud is defined as a fuze failure caused by non-initiation of the primer assembly when impacted by the striker assembly on the first attempt.

6.6 "Hung" striker. - A hung striker is defined as a striker assembly that fails to rotate and impact the primer assembly due to a burr (including flash) or other cause which results in sufficient restraint to prevent rotation of the striker assembly upon release of the lever.

6.7 High and Low order Functioning. - High order functions are characterized by a complete and instantaneous explosion accompanied by a loud sharp report. Low order functions are characterized by an abnormally low level of explosive sound.

6.8 The automatic equipment designated for the delay column inspection is specifically designed to positively screen out



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

fuzes with delay columns less than 0.7 inch in height or delay columns which have not been consolidated at the required minimum pressure. Fuzes with properly consolidated delay columns having the required height of 0.8 inch, minimum, will be accepted. The equipment may occasionally accept fuzes with delay columns between 0.7 inch and 0.8 inch depending on the specific combination of column length and column density contained in a particular fuze. It will also be reconfigured to screen out detonator assemblies when used for this renovation.

6.9 Renovation. - Renovation of ammunition items includes the disassembling, repairing, replacing, cleaning and reassembling of components of an end item. Therefore, the requirements and inspections listed in this specification apply only to components that have been renovated to the extent that the inspections herein are applicable and may be performed.


Custodian:
Army-PA

Preparing Activity:
Army-PA


Project Number: 1330-A-084



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

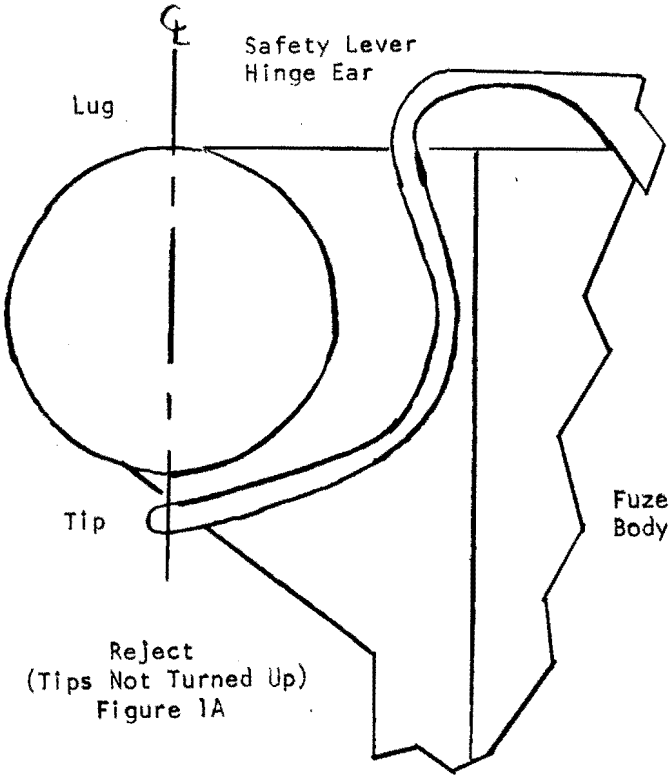



Reject
(Tips Not Turned Up)
Figure 1A

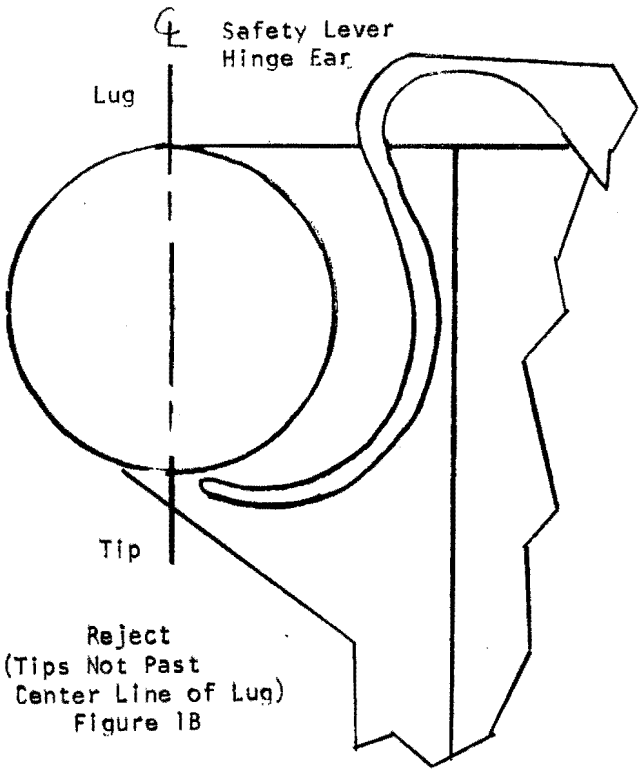


Reject
(Tips Not Past
Center Line of Lug)
Figure 1B

Fuze
Body

Figure 1C
Safety Lever
Hinge Ear

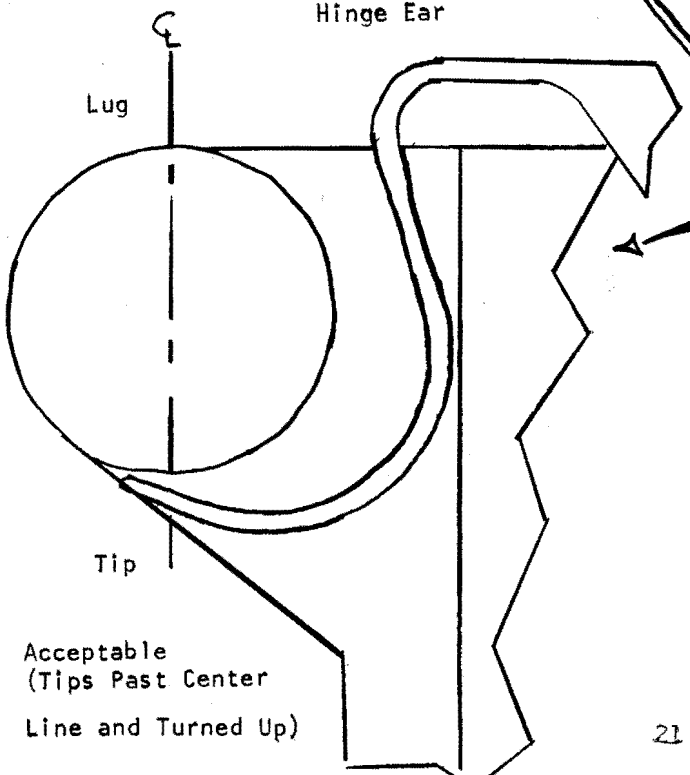


Acceptable
(Tips Past Center
Line and Turned Up)

Figure 1D

Imaginary
of Lug

Fuze
Safety
Lever



Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.