MILITARY SPECIFICATION

PANEL, FIRING FAE CBU-55 UH-1
ASSEMBLING AND PACKING

This specification is approved for use by Picatinny Arsenal, Department of the Army, and is available for use by all Departments and Agencies of the Department of Defense.

1. SCOPE

1.1 This specification covers the fabrication, assembling and packing for one type of Firing Panel designated as Panel, Firing FAE CBU-55 UH-1.

2. APPLICABLE DOCUMENTS

2.1 The following documents of the issue in effect on date of invitation for bids or request for proposal, form a part of this specification to the extent specified herein.

SPECIFICATIONS

MILITARY

MIL-P-116 - Preservation, Methods of
MIL-A-48078 - Ammunition, Standard Quality Assurance Provisions, General Specification For

STANDARDS

FEDERAL

FED-STD-151 - Metals; Test Methods

MILITARY

MIL-STD-105D - Sampling Procedures and Tables for Inspection by Attributes (ABC-STD-105)

FSC: 1345

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

MIL-STD-171 - Finishing of Metals and Wood Surfaces

DRAWINGS

U.S. ARMY PICATINNY ARSENAL

8880602 - Marking and Sealing for Unit Packages
9233628 - Box, Packing, for Panel, Firing, Mine Dispenser (UH-1B Automated) or Panel, Firing FAE CBU-55 UH-1
9275308 - Cable Assembly Power Electrical UH-1
9275309 - Cable Assembly Special Purpose Electrical UH-1
9275320 - Panel, Firing FAE CBU-55 UH-1
9277243 - Packing and Marking for Box, Fiberboard for, Cable Assembly Power
9277244 - Box, Fiberboard, Packing for, Cable Assembly
9277245 - Packing and Marking, for Box, Fiberboard, for, Cable Assembly Special Purpose
9277246 - Box, Fiberboard, Packing for, Cable Assembly Special Purpose

(Copies of specifications, standards and drawings required by contractors in connection with specific procurement functions should be obtained from the procuring activity or as directed by the Contracting Officer).

3. REQUIREMENTS

3.1 Material. - Materials shall be in accordance with applicable drawings and specifications.

3.2 Assembly. - The assembly shall comply with all requirements specified on Drawing (dwg.) 9275320 and with all requirements specified in applicable specifications.

3.3 Functioning (see 4.5.1)

3.3.1 POWER and ARM switches in the safe positions. - With the POWER and ARM switches in the safe position, and the selector switch in the BOTH position, the LEFT and RIGHT indicator lamps shall not fail to light, and shall remain lit after depressing the FIRE button (see 4.5.1.1).

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

3.3.2 POWER and ARM switches in the on positions, and selector switch in the BOTH position. - With the POWER and ARM switches in the on positions, and the selector switch in the BOTH position, the LEFT and RIGHT indicator lamps shall not remain lit after depressing the FIRE button (see 4.5.1.2).

3.3.3 Selector switch on LEFT position. - With the selector switch on LEFT position, the LEFT indicator lamp shall not remain lit and the RIGHT indicator lamp shall remain lit after depressing the FIRE button (see 4.5.1.3).

3.3.4 Selector switch on RIGHT position. - With the selector switch on RIGHT position, the RIGHT indicator lamp shall not remain lit and the LEFT indicator lamp shall remain lit after depressing the FIRE button (see 4.5.1.4).

3.3.5 POWER switch in the on position, ARM switch in safe position, and selector switch in the BOTH position. - With the POWER switch in the on position, the ARM switch in the safe position, and the selector switch in the BOTH position, the LEFT and RIGHT indicator lamps shall not fail to go out after depressing the FIRE button (see 4.5.1.5).

3.3.6 Indicator lamp function test. - The indicator lights, when depressed, shall not fail to light (see 4.5.1.6).

3.4 Cable assembly

3.4.1 Continuity.- The cable shall have a maximum resistance of four hundred (400) milliohms between all connected pins on the cable (See 4.5.2).

3.4.2 Insulation Resistance.-The insulation resistance of all pins on each plug or connector relative to the remaining pins on that plug or connector shall be such that the leakage current is no greater than two (2) microamperes when a thousand, plus or minus fifty (1000 ± 50), volts alternating current is applied for a minimum time period of ten (10) seconds. (See 4.5.2)

3.5 Workmanship. - All parts and assemblies shall be fabricated and finished in a thorough workmanlike manner, and all manufacturing, processing, and assembly operations shall be correctly performed. They shall be clean and free of burrs, sharp edges, unblended radii, surface defects, chips, dirt,

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

grease and oil (except where specifically required), corrosion products and other foreign matter. The cleaning method used shall not be injurious to any part or assembly nor shall they be contaminated by the cleaning agent. Exterior surface coatings shall be continuous except for a few light scratches not exposing base material. All required markings shall be neat and sharply defined. Required packing shall be dry.

3.6 First Article Inspection. - This specification contains technical provisions for first article inspection. Requirements for the submission of first article samples by the contractor shall be as specified in the contract.

4. QUALITY ASSURANCE PROVISIONS

4.1 Responsibility for Inspection and Standard Quality Assurance Provisions. - Unless otherwise specified herein or in the contract, the provisions of MIL-A-48078 shall apply and are hereby made a part of this detail specification.

4.2 Classification of inspections. - The following types of inspection shall be conducted on this item.

a. First Article Inspection

b. Quality Conformance Inspection

4.3 First Article Inspection

4.3.1 Submission. - The contractor shall submit a first article sample (see 6.1b) as designated by the Contracting Officer. The first article sample shall consist of five (5) complete sets of parts and 5 assemblies (i.e. 5 each of every component and assembly). The first article shall be evaluated in accordance with the provisions of 4.3.2 and 4.3.3.

4.3.2 Inspections to be performed. - See MIL-A-48078, paragraph 4.4.2 and Table I specified herein.

4.3.3 Rejection. - See MIL-A-48078.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

TABLE I - FIRST ARTICLE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
	Panel, Firing F.A.E. CBU-55 UH-1				9275320
					NEXT HIGHER ASSEMBLY
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
	Metal Parts Examination for Defects	5		3.2	4.4.2.1 thru 4.4.2.18
	Assemblies Dwg. 9275320, 9275308, 9275309 Examination for Defects	5		3.2	4.4.2.12, 4.4.2.14, 4.4.2.15
	Testing Functioning	5		3.3	4.4.3.1
	Cable Assembly	5		3.4	4.4.3.2

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

4.4 Quality conformance inspection

4.4.1 Inspection lot formation. - Inspection lots shall comply with the lot formation provisions of MIL-A-48078.

4.4.2 Examination. - (See MIL-A-48078). Unless otherwise specified in the classification of defects and test tables, sampling plans for major and minor defects shall be in accordance with MIL-STD-105, Inspection Level II. Equipment necessary for the performance of the inspections listed shall be in accordance with 4.4.4.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9275318
4.4.2.1	Panel, Front				NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Total length		0.40%	3.2	Gage
132	Total width		0.40%	3.2	Gage
133	Location of control panel fastener holes		0.40%	3.2	Gage
134	Any hole missing		0.40%	3.2	Visual
Minor					
201	Protective finish missing or incomplete		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.2	Panel				9275319
					NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Any hole missing		0.40%	3.2	Visual
Minor					
201	Protective finish missing or incomplete		0.65%	3.2	Visual
202	Marking misleading or unidentifiable		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

8

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9275313
4.4.2.3	Panel, Rear				NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Total length		0.40%	3.2	Gage
132	Total width		0.40%	3.2	Gage
133	Any hole missing		0.40%	3.2	Visual
Minor					
201	Protective finish missing or incomplete		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.4	Post, Mounting				9275302
					NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Total length		0.40%	3.2	Gage
132	Minor diameter of thread (max)		0.40%	3.2	Gage
133	Pitch diameter of thread (max)		0.40%	3.2	Gage
Minor					
201	Protective finish missing or incomplete		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.5	Cover		9275315
			NEXT HIGHER ASSEMBLY 9275320

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Length to far end of panel		0.40%	3.2	Gage
132	Length to near end of panel		0.40%	3.2	Gage
133	Width of panel cutout		0.40%	3.2	Gage
134	Depth		0.40%	3.2	Gage
135	Any hole missing		0.40%	3.2	Visual
Minor					
201	Protective finish missing or incomplete		0.65%	3.2	Visual
202	Any radius missing		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9275312
4.4.2.6	Plate, Identification				NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major	None defined				
Minor					
201	Marking misleading or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.7	Switch, Rotary		9275311
			NEXT HIGHER ASSEMBLY 9275320

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Length of shaft (min)		0.40%	3.2	Gage
102	Incorrect number of positions on switch		0.40%	3.2	Visual/Manual
Major B					
131	Any component missing or damaged		0.40%	3.2	Visual
132	Flat missing or incorrectly located		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9275316
4.4.2.8	Cover Assembly				NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Any component missing or damaged		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.9	Rear Panel Assembly				9275314
					NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Any component missing or damaged		0.40%	3.2	Visual
132	Any receptacle improperly assembled		0.40%	3.2	Visual
133	Rivets above flush		0.40%	3.2	Visual
Minor					
201	Marking misleading or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.10	Front Panel Assembly				9275317
					NEXT HIGHER ASSEMBLY
					9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Any component missing, improperly assembled or damaged		0.40%	3.2	Visual
Minor					
201	Marking misleading or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9275308
4.4.2.11	Cable Assembly Power Electrical: UH-1 Prior to Potting				NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Improper color coding of wires between connector and power plug		0.40%	3.2	Visual
Major B					
131	Soldering improper		0.40%	3.2	Visual
132	Marking misleading or unidentifiable		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.12	Cable Assembly Power Electrical: UH-1				9275308
					NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Any component missing or damaged		0.40%	3.2	Visual
Major B					
131	Potting missing or improperly applied		0.40%	3.2	Visual
132	Potting compound on surface of connector		0.40%	3.2	Visual
Minor					
201	Total length		0.65%	3.2	Scale
202	Marking misleading or unidentifiable		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

CLASSIFICATION OF DEFECTS & TESTS

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.13	Cable Assembly Special Purpose Electrical UH-1, prior to Potting	1 OF 1	9275309
			NEXT HIGHER ASSEMBLY 9275320

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Improper color coding of wires between connectors		0.40%	3.2	Visual
Major B					
131	Soldering improper		0.40%	3.2	Visual
Minor					
201	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE	SHEET 1 OF 1	DRAWING NUMBER
4.4.2.14	Cable Assembly Special Purpose Electrical UH-1		9275309
			NEXT HIGHER ASSEMBLY 9275320

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Any component missing or damaged		0.40%	3.2	Visual
Major B					
131	Potting missing or improperly applied		0.40%	3.2	Visual
132	Potting compound or surface of connector		0.40%	3.2	Visual
Minor					
201	Total length		0.65%	3.2	Scale
202	Sleeving improperly applied		0.65%	3.2	Visual
203	Marking misleading or unidentifiable		0.65%	3.2	Visual
204	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE	SHEET	DRAWING NUMBER
4.4.2.15	Panel, Firing F.A.E. CBU-55 UH-1	1 OF 1	9275320
			NEXT HIGHER ASSEMBLY 9275320

CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major A					
101	Any component missing, improperly assembled or damaged		0.40%	3.2	Visual
102	Improper wiring and color coding of wires		0.40%	3.2	Visual
103	Diode reversed		0.40%	3.2	Visual
Major B					
131	Soldering improper		0.40%	3.2	Visual
132	Insulation missing		0.40%	3.2	Visual
Minor					
201	Sleeving missing		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER 9233628
4.4.2.16	Carton, Inner, prior to sealing				NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Carton cut, punctured or torn		0.40%	3.2	Visual
Minor					
201	Any packing material missing		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.17	Carton, Inner, Sealed				9233628
					NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Bag punctured, torn or seal incomplete		0.40%	3.2	Visual
Minor					
201	Contents loose		0.65%	3.2	Visual
202	Marking misleading or unidentifiable		0.65%	3.2	Visual
203	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

QUALITY CONFORMANCE INSPECTION

CLASSIFICATION OF DEFECTS & TESTS

MIL-P-63052 (PA)

PARAGRAPH	TITLE		SHEET 1 OF 1		DRAWING NUMBER
4.4.2.18	Carton, Outer, Sealed				8880602
					NEXT HIGHER ASSEMBLY 9275320
CATEGORY	EXAMINATION OR TEST	NO. OF SAMPLE UNITS	AQL OR 100%	REQUIREMENT PARAGRAPH	PARAGRAPH REFERENCE /INSPECTION METHOD
Critical	None defined				
Major B					
131	Tape missing or improperly applied		0.40%	3.2	Visual
Minor					
201	Marking misleading or unidentifiable		0.65%	3.2	Visual
202	Evidence of poor workmanship		1.00%	3.5	Visual

NOTES:

SARPA-QA FORM 2567 FEB 74 4810

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

4.4.3 Testing

4.4.3.1 Functioning. - This test shall be performed 100 percent on all firing panels. Any panel which fails to meet the requirements shall be removed from the lot. Any failure due to a defective bomb rack shall not be cause for rejection of the firing panel.

4.4.3.2 Cable Assembly.-

4.4.3.2.1 Continuity Test.- This test shall be performed 100 percent in accordance with the procedure specified in 4.5.2. All assemblies that fail to comply with the requirement shall be classed defective and removed from the lot (Non-Destructive Test).

4.4.3.2.2 Insulation Resistance Test.- This test shall be performed 100 percent in accordance with the procedure specified in 4.5.2. All assemblies that fail to comply with the requirement shall be classed defective and removed from the lot (Non-Destructive Test).

4.4.4 Inspection Equipment. - The inspection equipment required to perform the inspections and tests prescribed in this specification is identified in the 'Paragraph Reference/ Inspection Method' column in the tables starting with paragraph 4.4.2.1, and the test method paragraphs (see 4.5). The contractor shall submit for approval, inspection equipment designs in accordance with the terms of the contract. See Section 6 of MIL-A-48078, and 6.2 herein.

4.5 Test Methods and Procedures

4.5.1 Functioning. - The firing panels shall be electrically connected to a left and right bomb rack (see Fig. I) for the performance of the following tests. An 18 volt plus 2 volt (DC) 15 ampere power supply will be required.

4.5.1.1 POWER and ARM switches in safe position. - Place the POWER and ARM switches in the safe positions and the selector switch in the BOTH position with the LEFT and RIGHT rack suspension hooks closed. Observe for compliance with the applicable requirements prior to and after depressing the FIRE button.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

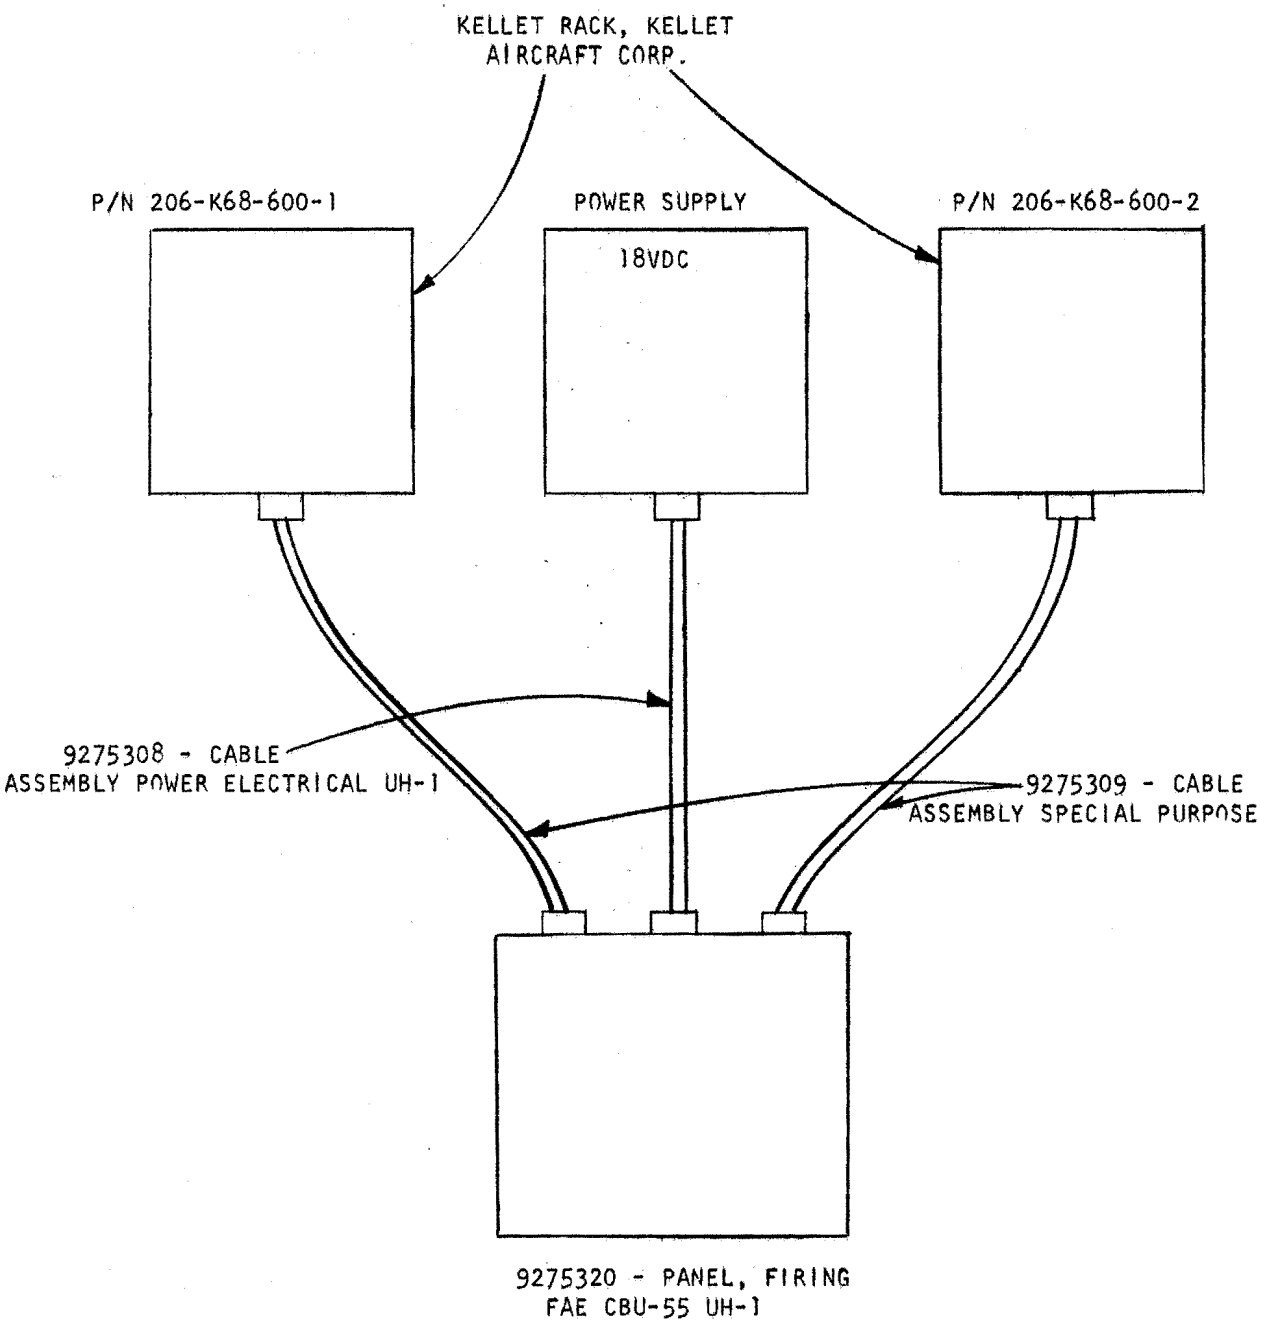


FIGURE 1

FIRE CONTROL PANEL FUNCTIONAL TEST SETUP
SCHEMATIC

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

4.5.1.2 POWER and ARM switches in the on positions and selector switch in the BOTH position. - Place the power and arm switches in the on positions and selector switch in the BOTH position. Observe that the arming solenoids on the bomb rack are in the extended positions, and the rack suspension hooks are closed. Depress the FIRE bottom and observe for compliance with the applicable requirements.

4.5.1.3 Selector switch on LEFT position. - Place the selector switch in LEFT position and close the left and right rack suspension hooks. Depress the FIRE button and observe for compliance with the applicable requirements.

4.5.1.4 Selector switch in RIGHT position. - Place the selector switch in the RIGHT position and close the left and right rack suspension hooks. Depress the FIRE button and observe for compliance with the applicable requirements.

4.5.1.5 POWER switch in the on position, ARM switch in the safe position and selector switch in the BOTH position. Place the POWER switch in the on position, ARM switch in the safe position and selector switch in the BOTH position. Observe that the rack suspension hooks are closed. Depress the FIRE button and observe for compliance with the applicable requirements. NOTE: Observe also that the solenoid pins have remained retracted.

4.5.1.6 Indicating lamp function test. - Place the POWER and ARM switches in the safe positions, and the rack suspension hooks in the open positions. Depress all indicator lamps consecutively and observe for compliance with the applicable requirements.

4.5.2 Cable assembly.

4.5.2.1 Continuity Test.- The cable shall be tested for the required resistance using a Government approved fixture and digital ohmmeter. Any cable failing to comply with all of the specified requirements of 3.4 shall be classed defective.

4.5.2.2 Insulation Resistance Test.- The cable shall be tested for the required insulation resistance using a Government approved test fixture and megohmmeter. Any cable failing to comply with all of the specified requirements of 3.4 shall be classed defective.

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

5. PREPARATION FOR DELIVERY

5.1 Preservation and packaging

5.1.1 Level A. - The firing panels and cables shall be preserved and packaged in accordance with Drawings 9233628, 9277243, 9277244, 9277245, and 9277246.

5.2 Packing

5.2.1 Level A. - The carton shall be packed as specified on Drawing 8880602.

5.3 Marking. - The markings shall be in accordance with Drawings 8880602, 9233628, 9277243, 9277244, and 9277245.

6. NOTES

6.1 Ordering Data. - Procurement documents shall specify the following:

a. Title, number and date of this specification.

b. Provisions for submission of first article samples.

c. Provisions of MIL-A-48078.

6.2 Submission of Inspection Equipment Designs for Approval. (See MIL-A-48078). Submit equipment designs as required, to Commander: Picatinny Arsenal, ATTN: SARPA-QA-T-T, Dover, New Jersey 07801.

6.3 Distribution of ammunition data cards. - Distribution of data cards shall include the following: Commander, Picatinny Arsenal, ATTN: SARPA-QA-A-M, Dover, New Jersey 07801.

Custodian:
Army-PA

Preparing Activity:
Army-PA

Project Number: 1345-A-163

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.

STANDARDIZATION DOCUMENT IMPROVEMENT PROPOSAL

OMB Approval
No. 22-R255

INSTRUCTIONS: The purpose of this form is to solicit beneficial comments which will help achieve procurement of suitable products at reasonable cost and minimum delay, or will otherwise enhance use of the document. DoD contractors, government activities, or manufacturers/ vendors who are prospective suppliers of the product are invited to submit comments to the government. Fold on lines on reverse side, staple in corner, and send to preparing activity. Comments submitted on this form do not constitute or imply authorization to waive any portion of the referenced document(s) or to amend contractual requirements. Attach any pertinent data which may be of use in improving this document. If there are additional papers, attach to form and place both in an envelope addressed to preparing activity.

DOCUMENT IDENTIFIER AND TITLE

NAME OF ORGANIZATION AND ADDRESS

CONTRACT NUMBER

MATERIAL PROCURED UNDER A

☐ DIRECT GOVERNMENT CONTRACT ☐ SUBCONTRACT

1. HAS ANY PART OF THE DOCUMENT CREATED PROBLEMS OR REQUIRED INTERPRETATION IN PROCUREMENT USE?

A. GIVE PARAGRAPH NUMBER AND WORDING.

B. RECOMMENDATIONS FOR CORRECTING THE DEFICIENCIES

2. COMMENTS ON ANY DOCUMENT REQUIREMENT CONSIDERED TOO RIGID

3. IS THE DOCUMENT RESTRICTIVE?

☐ YES ☐ NO *(If "Yes", in what way?)*

4. REMARKS

SUBMITTED BY *(Printed or typed name and address - Optional)*

TELEPHONE NO.

DATE

Source: https://assist.dla.mil -- Downloaded: 2026-10-23T02:07Z
Check the source to verify that this is the current version before use.