MIL-STD-1373
NOTICE 1
3 November 1971

MILITARY STANDARD

SCREW-THREAD, MODIFIED, 60°, STUB, DOUBLE

To all holders of MIL-STD-1373.

1. The following page(s) of MIL-STD-1373 have been revised and supersedes the page(s) listed:

New Page	Date	Superseded Page	Date
11	3 November 1971	11	8 April 1971
12	8 April 1971	(Reprinted without change)	

2. Retain this Notice and insert before the table of contents.

3. Holders of MIL-STD-1373 will verify that page change(s) and addition(s) indicated above have been entered. The Notice page will be retained as a check sheet. This issuance, together with appended page(s), is a separate publication. Each Notice is to be retained by stocking points until the Military Standard is completely revised or cancelled.

Custodians:
Army - EL
Navy - EC

Review activities:
Army - SC

User activities:
Navy - YD, SH, AS

Preparing activity:
Navy - EC
(Project MISC-0793)

Source: https://assist.dla.mil -- Downloaded: 2026-10-24T00:10Z
Check the source to verify that this is the current version before use.

TABLE X.
Double 60° Stub Modified Thread Form Basic Dimensions, .1428 Pitch
(See figure 1)

Thread Size	Depth of Thread (Basic) h	Total Depth of Thread	Width of Flats							
			External Thread (Screw)				Internal Thread (Nut)			
			F_C (Major D.)		F_R (Minor D.)		F_C (Minor D.)		F_R (Major D.)	
			Basic	Max / Min	Basic	Max / Min	Basic	Max / Min	Basic	Max / Min
2.0000 2.2500 2.7500 3.0000 3.2500	.0619	.0647	.0357	.0425 / .0298	.0324	.0382 / .0220	.0443	.0512 / .0373	.0324	.0394 / .0209

Note: Formulas for these values are given in table XI.

TABLE XI.
FORMULAS FOR CALCULATING WIDTH OF FLATS

External Thread (screw)

F_C (Major Dia)
BASIC = P/2 - [(Max Major D. Screw) - Max P. D. screw)] tan 30°
MAX = P/2 - [(Min Major D. Screw) - (Max P. D. screw)] tan 30°
MIN = P/2 - [(Max Major D. screw) - (Min P. D. screw)] tan 30°

F_R (Minor Dia)
BASIC = P/2 - [(Max P. D. screw) - (Max Minor D. screw)] tan 30°
MAX = P/2 - [(Min P. D. screw) - (Max Minor D. screw)] tan 30°
MIN = P/2 - [(Max P. D. screw) - (Min Minor D. screw)] tan 30°

Internal Thread (nut)

F_C (Minor Dia)
BASIC = P/2 - [(Min P. D. nut) - (Min Minor D. nut)] tan 30°
MAX = P/2 - [(Min P. D. nut) - (Max Minor D. nut)] tan 30°
MIN = P/2 - [(Max P. D. nut) - (Min Minor D. nut)] tan 30°

F_R (Minor Dia)
BASIC = P/2 - [(Min Major D. nut) - (Min P. D. nut)] tan 30°
MAX = P/2 - [(Min Major D. nut) - (Max P. D. nut)] tan 30°
MIN = P/2 - [(Max Major D. nut) - (Min P. D. nut)] tan 30°

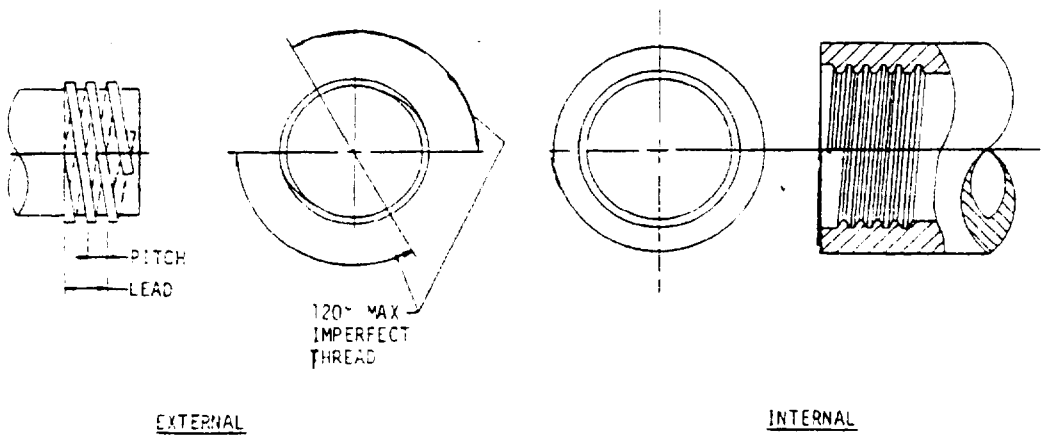


FIGURE 3. Thread start.

Source: https://assist.dla.mil -- Downloaded: 2026-10-24T00:10Z
Check the source to verify that this is the current version before use.

TABLE XII.

Gage Measurements .05 Pitch

Size	Basic Helix Angle	Setting Plug (External Thread)								Plug Gage (Internal Thread)			
		Unplated				After Plating							
		Pitch Diameter		Measurement Over (3) Wires .02887 Diameter		Pitch Diameter		Measurement Over (3) Wires .02887 Diameter		Pitch Diameter		Measurement Over (3) Wires .02887 Diameter	
		Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max
.2500	7°52'	.2245	.2305	.26826	.27422	.2245	.2320	.26826	.27572	.2320	.2400	.27572	.28369
.3750	5°07'	.3495	.3555	.39299	.39898	.3495	.3570	.39299	.40048	.3570	.3650	.40048	.40847
.5000	3°48'	.4745	.4805	.51791	.52391	.4745	.4820	.51791	.52540	.4820	.4900	.52540	.53340
.5625	3°21'	.5370	.5430	.58038	.58638	.5370	.5445	.58038	.58788	.5445	.5525	.58788	.59588
.6250	3°01'	.5995	.6055	.64287	.64887	.5995	.6070	.64287	.65037	.6070	.6150	.65037	.65837

Note: A helix angle correction has been added.

TABLE XIII.

Gage Measurements 0.1 Pitch

Size	Basic Helix Angle	Setting Plug (External Thread)								Plug Gage (Internal Thread)			
		Unplated				After Plating							
		Pitch Diameter		Measurement Over (3) Wires .05774 Diameter		Pitch Diameter		Measurement Over (3) Wires .05774 Diameter		Pitch Diameter		Measurement Over (3) Wires .05774 Diameter	
		Min	Max	Min	Max	Min	Max	Min	Max	Min	Max	Min	Max
.6875	5°30'	.6520	.6600	.73903	.74702	.6520	.6615	.73903	.74852	.6615	.6715	.74852	.75851
.7500	5°02'	.7145	.7225	.80146	.80945	.7145	.7240	.80146	.81095	.7240	.7340	.81095	.82094
.8750	4°17'	.8395	.8475	.92637	.93436	.8395	.8490	.92637	.93586	.8490	.8590	.93586	.94586
1.0000	3°46'	.9645	.9725	1.05131	1.05931	.9645	.9740	1.05131	1.06080	.9740	.9840	1.06080	1.07080
1.1250	3°20'	1.0790	1.0890	1.16577	1.17573	1.0790	1.1030	1.16577	1.17776	1.0910	1.1030	1.17776	1.18976
1.2500	3°00'	1.2040	1.2140	1.29064	1.30074	1.2040	1.2160	1.29064	1.30274	1.2160	1.2280	1.30274	1.31477
1.3750	2°43'	1.3290	1.3390	1.41562	1.42562	1.3290	1.3410	1.41562	1.42762	1.3410	1.3530	1.42762	1.43962
1.5000	2°29'	1.4540	1.4640	1.54062	1.55062	1.4540	1.4660	1.54062	1.55262	1.4660	1.4780	1.55262	1.56462
1.7500	2°07'	1.7040	1.7140	1.79062	1.80062	1.7040	1.7160	1.79062	1.80262	1.7160	1.7280	1.80262	1.81462
2.0000	1°51'	1.9540	1.9640	2.04062	2.05062	1.9540	1.9660	2.04062	2.05262	1.9660	1.9780	2.05262	2.06462
2.2500	1°39'	2.2040	2.2140	2.29062	2.30062	2.2040	2.2160	2.29062	2.30262	2.2160	2.2280	2.30262	2.31462
2.5000	1°29'	2.4540	2.4640	2.54062	2.55062	2.4540	2.4660	2.54062	2.55262	2.4660	2.4780	2.55262	2.56462

Note: A helix angle correction has been added for wire dimensions above the dashed line.

Source: https://assist.dla.mil -- Downloaded: 2026-10-24T00:10Z
Check the source to verify that this is the current version before use.